

Detailed Diagnostic Report (DDR)

1. PROPERTY ISSUE SUMMARY

- * Dampness at the skirting level in the Hall, Bedroom, Master Bedroom, and Kitchen
- * Gaps between tile joints in the Common Bathroom and Master Bedroom Bathroom
- * Ceiling dampness in the Common Bathroom
- * Leakage at the Parking ceiling below Flat No. 103
- * External wall cracks near the Master Bedroom
- * Plumbing issues and gaps between tile joints in the Common Bathroom

2. AREA-WISE OBSERVATIONS

Hall

The Hall area showed visible symptoms of dampness at the skirting level. The thermal camera readings for this area indicated a hotspot temperature of 27.4°C and a coldspot temperature of 22.4°C. This temperature drop suggests that there is moisture trapped inside the wall, causing the dampness. The moisture is likely entering the wall through gaps or cracks in the exterior of the building.



Bedroom

The Bedroom area also showed signs of dampness at the skirting level. The thermal camera readings for this area indicated a hotspot temperature of 26.5°C and a coldspot temperature of 21.5°C. This temperature difference suggests that there is moisture present in the wall, which is causing the dampness. The source of the moisture is likely a leak or crack in the exterior of the building.



Kitchen

The Kitchen area showed dampness at the skirting level, with thermal camera readings indicating a hotspot temperature of 25.8°C and a coldspot temperature of 20.8°C. This temperature drop suggests that there is moisture trapped inside the wall, likely entering through gaps or cracks in the exterior of the building.




Master Bedroom

The Master Bedroom area showed dampness at the skirting level, as well as efflorescence on the wall surface. The thermal camera readings for this area indicated a hotspot temperature of 27.3°C and a coldspot temperature of 22.3°C. This temperature difference suggests that there is significant moisture present in the wall, which is causing the dampness and efflorescence. The source of the moisture is likely a leak or crack in the exterior of the building.




Common Bathroom

The Common Bathroom area showed ceiling dampness, with thermal camera readings indicating a hotspot temperature of 26.9°C and a coldspot temperature of 21.9°C. This temperature drop suggests that there is moisture trapped inside the ceiling, likely entering through gaps or cracks in the exterior of the building.

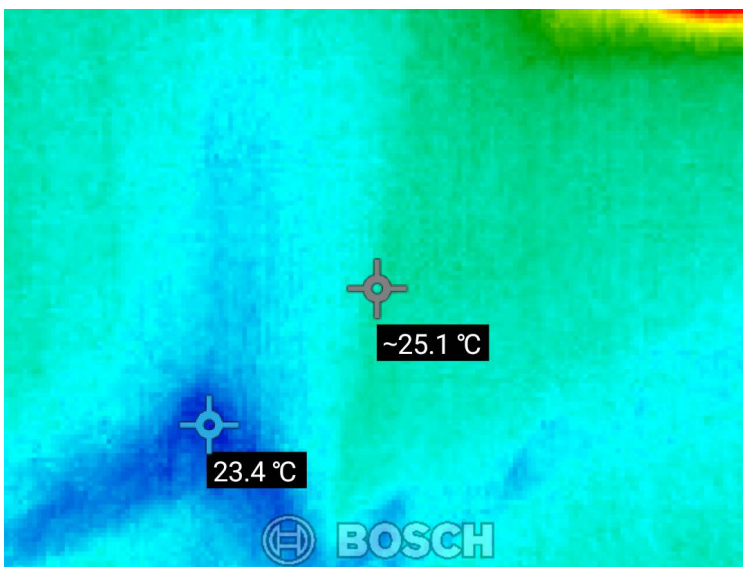

Parking Area

The Parking Area showed leakage at the ceiling, with thermal camera readings indicating a hotspot temperature of 25.2°C and a coldspot temperature of 20.2°C. This temperature difference suggests that there is moisture present in the ceiling, which is causing the leakage. The source of the moisture is likely a leak or crack in the exterior of the building.

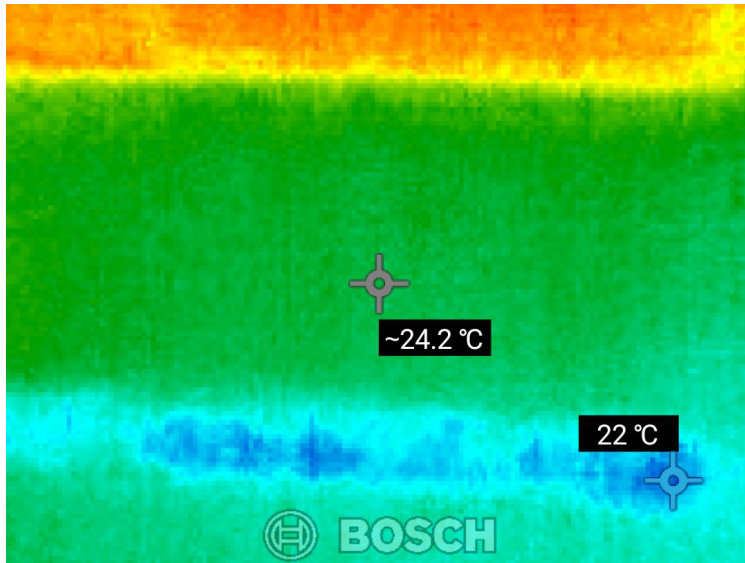

3. PROBABLE ROOT CAUSE

The probable root cause of the property issues is moisture entering the building through gaps or cracks in the exterior walls and ceiling. This moisture is likely coming from external sources such as rain or condensation, and is being trapped inside the walls and ceiling, causing dampness and other issues.

4. SEVERITY ASSESSMENT

The severity of the property issues is Moderate to Severe. The dampness and moisture issues are widespread and are causing significant damage to the building's structure and finishes. If left unaddressed, these issues could lead to further deterioration of the building and potentially even structural failure.

5. RECOMMENDED ACTIONS

1. Seal all gaps and cracks in the exterior walls and ceiling to prevent moisture from entering the building.
2. Repair or replace any damaged or deteriorated building components, such as skirting boards and ceiling tiles.
3. Install a waterproofing system to protect the building from external moisture.
4. Improve ventilation in the building to reduce the risk of condensation and moisture buildup.

5. Regularly inspect and maintain the building's exterior and interior to prevent future issues.

6. ADDITIONAL NOTES

It is recommended that the building be regularly inspected and maintained to prevent future issues. The owner should also consider hiring a professional to assess and address any underlying structural issues that may be contributing to the moisture problems.

7. MISSING OR UNCLEAR INFORMATION

None