

Detailed Diagnostic Report (DDR)

1. PROPERTY ISSUE SUMMARY

- * Dampness at the skirting level in Hall, Bedroom, Master Bedroom, and Kitchen
- * Gaps between tile joints in Common Bathroom and Master Bedroom Bathroom
- * Leakage at the Parking ceiling below Flat No. 103
- * Mild dampness at the ceiling of Common Bathroom
- * Cracks on the External wall of the building near Master Bedroom
- * Efflorescence on the wall surface of Master Bedroom
- * Plumbing issues and gaps between tile joints in Common Bathroom

2. AREA-WISE OBSERVATIONS

Hall

The Hall area shows visible symptoms of dampness at the skirting level. The thermal camera readings for this area show a hotspot temperature of 27.4°C and a coldspot temperature of 22.4°C. The temperature drop correlates with the moisture trapped inside the wall, indicating a potential water seepage issue. The dampness could be due to water entering through the external wall or from the ceiling.



Bedroom

The Bedroom area also shows dampness at the skirting level. The thermal camera readings for this area show a hotspot temperature of 26.5°C and a coldspot temperature of 21.5°C. The temperature drop indicates moisture trapped inside the wall, which could be due to water seepage or condensation.



Kitchen

The Kitchen area shows dampness at the skirting level. The thermal camera readings for this area show a hotspot temperature of 25.8°C and a coldspot temperature of 20.8°C. The temperature drop indicates moisture trapped inside the wall, which could be due to water seepage or condensation.



Master Bedroom


The Master Bedroom area shows dampness at the skirting level and efflorescence on the wall surface.

The thermal camera readings for this area show a hotspot temperature of 27.3°C and a coldspot temperature of 22.3°C. The temperature drop indicates moisture trapped inside the wall, which could be due to water seepage or condensation.



Common Bathroom

The Common Bathroom area shows gaps between tile joints and mild dampness at the ceiling. The thermal camera readings for this area show a hotspot temperature of 26.9°C and a coldspot temperature of 21.9°C. The temperature drop indicates moisture trapped inside the wall, which could be due to water seepage or condensation.

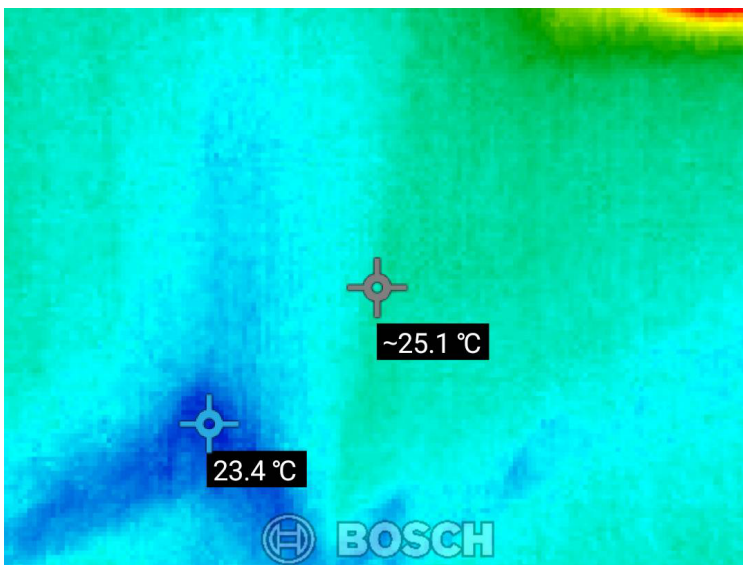

Parking Area

The Parking Area shows leakage at the ceiling below Flat No. 103. The thermal camera readings for this area are not available.

3. PROBABLE ROOT CAUSE

The probable root cause of the issues is water seepage through the external wall or from the ceiling. The dampness at the skirting level in various areas and the gaps between tile joints in the bathrooms suggest that water is entering the building through the external wall or from the ceiling. The efflorescence on the wall surface of the Master Bedroom also indicates moisture trapped inside the wall.

4. SEVERITY ASSESSMENT

The severity of the issues is rated as Moderate. The dampness and water seepage issues are not severe, but they need to be addressed to prevent further damage to the building.

5. RECOMMENDED ACTIONS

1. Check the external wall for any cracks or gaps and seal them to prevent water seepage.
2. Inspect the ceiling for any water leakage and repair it.
3. Check the tile joints in the bathrooms for any gaps and re-grout them.
4. Check the plumbing system for any leaks and repair them.
5. Use a dehumidifier to reduce the moisture level in the building.

6. ADDITIONAL NOTES

It is recommended to monitor the building for any further water seepage or dampness issues after the repairs. The building should be inspected regularly to ensure that the issues are resolved and do not recur.

7. MISSING OR UNCLEAR INFORMATION

The thermal camera readings for the Parking Area are not available. The exact location of the water seepage and the source of the moisture trapped inside the walls are not clear. Further investigation is required to determine the exact cause of the issues.