

# Pavement Inspection

Automated Pavement Inspection Report

Inspector: Not specified | Date: September 03, 2026 at 08:50 PM | Images Analyzed: 693

## ■ IMMEDIATE ACTION REQUIRED

**1 critical defect(s)** detected that pose direct danger to road users. Inspect and, if confirmed, repair or barricade first. The legislated deadline depends on the defect type and the highway's class — see the repair-timeline table below.  
**Systemic pavement failure detected.** High defect density indicates structural degradation across this section. Recommend full section assessment and possible rehabilitation rather than spot repairs.

*Severities are AI suggestions — no inspector review applied.*

## Pavement Condition Index (PCI)

85

Good

Network PCI — length-weighted average of 38 road segments, each scored from distress density over a fixed sample-unit grid (D6433-informed, not a certified survey)

Good (85-100)

Satisfactory (70-84)

Fair (55-69)

Poor (40-54)

Very Poor (25-39)

Serious (10-24)

Failed (0-9)

## Segment PCI

| #  | Chainage    | PCI | Rating       | Defects |
|----|-------------|-----|--------------|---------|
| 1  | 0–100 m     | 92  | Good         | 1       |
| 2  | 100–200 m   | 77  | Satisfactory | 4       |
| 3  | 200–300 m   | 88  | Good         | 2       |
| 4  | 300–400 m   | 96  | Good         | 1       |
| 5  | 400–500 m   | 83  | Satisfactory | 3       |
| 6  | 500–600 m   | 99  | Good         | 1       |
| 7  | 600–700 m   | 99  | Good         | 1       |
| 8  | 700–800 m   | 99  | Good         | 0       |
| 9  | 800–900 m   | 88  | Good         | 10      |
| 10 | 900–1000 m  | 89  | Good         | 8       |
| 11 | 1000–1100 m | 88  | Good         | 13      |
| 12 | 1100–1200 m | 93  | Good         | 7       |
| 13 | 1200–1300 m | 92  | Good         | 7       |
| 14 | 1300–1400 m | 92  | Good         | 9       |
| 15 | 1400–1440 m | 95  | Good         | 2       |
| 16 | 1440–1540 m | 99  | Good         | 1       |
| 17 | 1540–1640 m | 100 | Good         | 0       |
| 18 | 1640–1740 m | 78  | Satisfactory | 6       |
| 19 | 1740–1840 m | 81  | Satisfactory | 18      |
| 20 | 1840–1909 m | 82  | Satisfactory | 9       |
| 21 | 1909–2009 m | 65  | Fair         | 25      |
| 22 | 2009–2109 m | 65  | Fair         | 27      |
| 23 | 2109–2194 m | 66  | Fair         | 21      |
| 24 | 2194–2294 m | 87  | Good         | 12      |
| 25 | 2294–2394 m | 82  | Satisfactory | 8       |
| 26 | 2394–2494 m | 80  | Satisfactory | 11      |
| 27 | 2494–2594 m | 84  | Satisfactory | 6       |
| 28 | 2594–2694 m | 86  | Good         | 6       |

|    |             |    |              |    |
|----|-------------|----|--------------|----|
| 29 | 2694–2794 m | 90 | Good         | 6  |
| 30 | 2794–2838 m | 73 | Satisfactory | 6  |
| 31 | 2838–2938 m | 76 | Satisfactory | 18 |
| 32 | 2938–3038 m | 77 | Satisfactory | 18 |
| 33 | 3038–3138 m | 81 | Satisfactory | 18 |
| 34 | 3138–3238 m | 81 | Satisfactory | 19 |
| 35 | 3238–3338 m | 76 | Satisfactory | 27 |
| 36 | 3338–3438 m | 81 | Satisfactory | 24 |
| 37 | 3438–3538 m | 84 | Satisfactory | 15 |
| 38 | 3538–3571 m | 69 | Fair         | 7  |

Street PCI

| Street               | Chainage    | Length | PCI | Rating       | Defects |
|----------------------|-------------|--------|-----|--------------|---------|
| Leslie Street        | 1909–2194 m | 286 m  | 65  | Fair         | 73      |
| Ellesmere Road       | 2838–3571 m | 733 m  | 79  | Satisfactory | 146     |
| Lawrence Avenue East | 2288–2838 m | 550 m  | 84  | Satisfactory | 43      |
| Pharmacy Avenue      | 2194–2288 m | 94 m   | 87  | Good         | 12      |
| Sheppard Avenue East | 1440–1909 m | 468 m  | 88  | Good         | 34      |
| Neilson Road         | 0–883 m     | 883 m  | 91  | Good         | 19      |
| Sheppard Avenue East | 883–1440 m  | 558 m  | 91  | Good         | 50      |

Rows are cut where the driven route changes street, and again at every recording break, so a row is one street in one place; a street driven in two clips gets one row per clip, each labelled with its own chainage. A stretch that matched no street is carried by the row next to it: the row before, or the row after where the stretch opens a clip. Rows therefore cover each clip a street was matched in, end to end. A clip where nothing matched contributes no row, so the row lengths need not sum to the whole driven route.

Asset Management Summary

|             |           |               |                 |
|-------------|-----------|---------------|-----------------|
| 85          | Good      | 3,571 m       | 38              |
| Network PCI | Condition | Scored length | Segments scored |

Condition profile


| Condition    | Length  | Share of scored length |
|--------------|---------|------------------------|
| Fair         | 319 m   | 8.9%                   |
| Satisfactory | 1,512 m | 42.3%                  |
| Good         | 1,740 m | 48.7%                  |


### Worst streets

| Street               | Chainage      | Length | PCI | Rating       | Defects |
|----------------------|---------------|--------|-----|--------------|---------|
| Leslie Street        | 1,909–2,194 m | 286 m  | 65  | Fair         | 73      |
| Ellesmere Road       | 2,838–3,571 m | 733 m  | 79  | Satisfactory | 146     |
| Lawrence Avenue East | 2,288–2,838 m | 550 m  | 84  | Satisfactory | 43      |
| Pharmacy Avenue      | 2,194–2,288 m | 94 m   | 87  | Good         | 12      |
| Sheppard Avenue East | 1,440–1,909 m | 468 m  | 88  | Good         | 34      |
| Neilson Road         | 0–883 m       | 883 m  | 91  | Good         | 19      |
| Sheppard Avenue East | 883–1,440 m   | 558 m  | 91  | Good         | 50      |

Ontario Regulation 588/17 requires municipalities to publish a current level of service for their road assets, including surface condition. The network PCI above is that kind of measure, produced by a D6433-informed automated screen of dashcam imagery. It is not a certified condition survey and does not by itself discharge any reporting obligation; treat it as a screening layer that tells a qualified inspector where to look first.

## Evidence — the 10 highest-priority findings

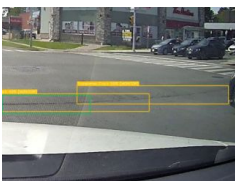
| # | What the model saw                                                                  | Defect                                          | Where                                                       | Action                                                                                                                                                                                     |
|---|-------------------------------------------------------------------------------------|-------------------------------------------------|-------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 1 |  | <b>Transverse_Crack</b><br><b>CRITICAL</b> HIGH | Pharmacy Avenue<br>43.743400, -79.304719<br>f00447.jpg      | Emergency repair or<br>barricade required                                                                                                                                                  |
| 2 |  | <b>Pothole</b><br><b>URGENT</b> MEDIUM          | Sheppard Avenue East<br>43.793674, -79.240023<br>f00357.jpg | Suspected pothole —<br>field-verify before<br>scheduling; detector<br>confidence is low for this<br>class, and the O. Reg.<br>239/02 clock needs a<br>measurement this scan<br>cannot make |
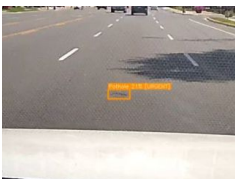
|   |                                                                                     |                                        |                                                             |                                                                                                                                                                       |
|---|-------------------------------------------------------------------------------------|----------------------------------------|-------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 3 |    | <b>Pothole</b><br><b>URGENT</b> MEDIUM | Lawrence Avenue East<br>43.743721, -79.302509<br>f00479.jpg | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 4 |    | <b>Pothole</b><br><b>URGENT</b> MEDIUM | Lawrence Avenue East<br>43.743486, -79.303630<br>f00462.jpg | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 5 |    | <b>Pothole</b><br><b>URGENT</b> MEDIUM | Leslie Street<br>43.791313, -79.368363<br>f00401.jpg        | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 6 |   | <b>Pothole</b><br><b>URGENT</b> MEDIUM | Lawrence Avenue East<br>43.743862, -79.302005<br>f00490.jpg | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 7 |  | <b>Pothole</b><br><b>URGENT</b> MEDIUM | Lawrence Avenue East<br>43.744539, -79.298546<br>f00544.jpg | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 8 |  | <b>Pothole</b><br><b>URGENT</b> MEDIUM | Lawrence Avenue East<br>43.744039, -79.300970<br>f00506.jpg | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |


|    |                                                                                   |                                        |                                                             |                                                                                                                                                                       |
|----|-----------------------------------------------------------------------------------|----------------------------------------|-------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 9  |  | <b>Pothole</b><br><b>URGENT</b> MEDIUM | Ellesmere Road<br>43.765894, -79.280983<br>f00555.jpg       | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 10 |  | <b>Pothole</b><br><b>URGENT</b> LOW    | Lawrence Avenue East<br>43.743848, -79.302071<br>f00489.jpg | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |

Each crop is cut from the annotated frame this defect was photographed on, around the box the detector drew, and is only ever shrunk — never enlarged. Ordering is safety priority, then suspected potholes, then severity, then confidence, which is the same order the defect inventory uses, so the two cannot disagree about which finding is worst. A crop is evidence of what the model flagged, not confirmation that the flag is right; that is what the field visit in the Action column is for.

### Safety Priority Summary

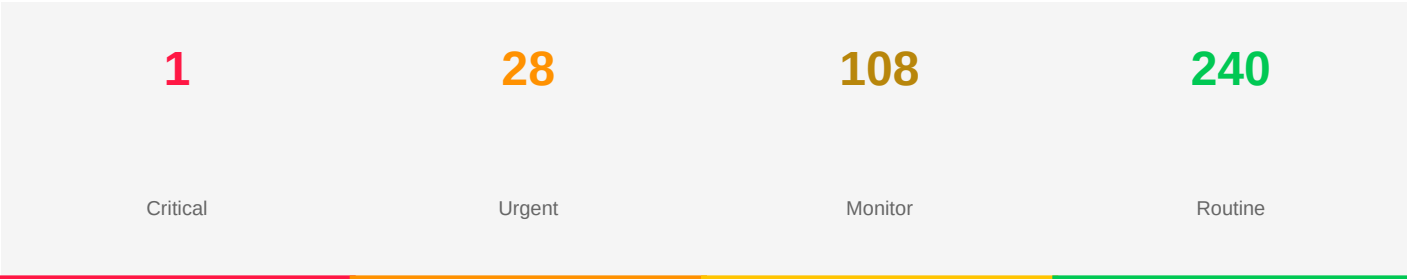

### Executive Summary

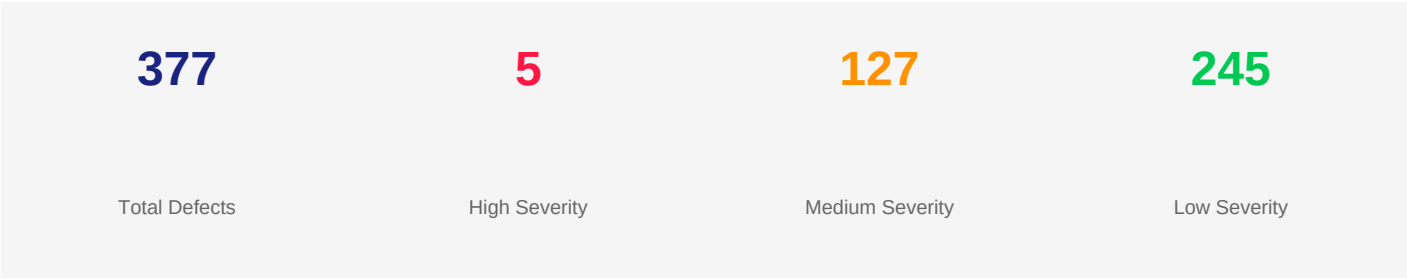


Average Confidence: 21.8%


Images Analyzed: 693

### Distribution Analysis

Severity Distribution

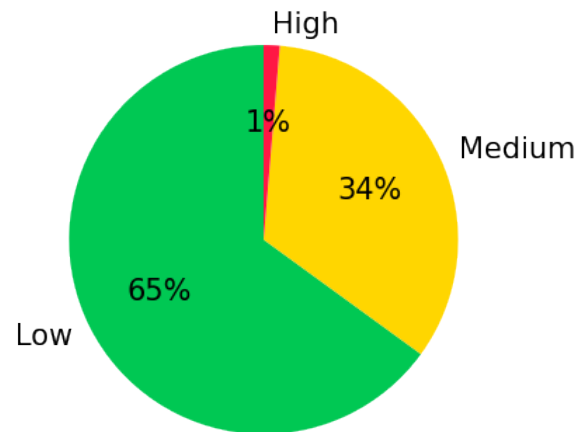

Safety Priority Distribution

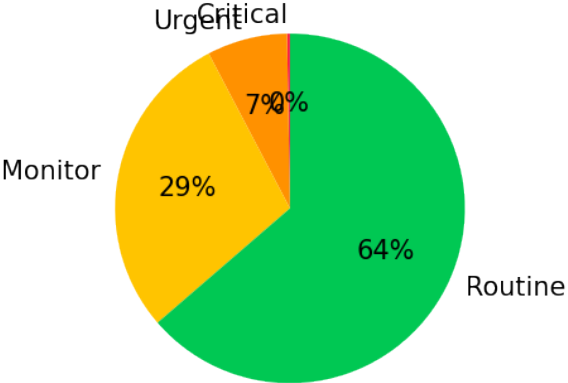

Recommended Maintenance Plan

|                |                                                                              |
|----------------|------------------------------------------------------------------------------|
| CRITICAL       |                                                                              |
| Action:        | Emergency repair or barricade required                                       |
| Defects (1):   | 1x Transverse_Crack                                                          |
| URGENT         |                                                                              |
| Action:        | Schedule priority maintenance                                                |
| Defects (28):  | 13x Pothole, 11x Alligator_Crack, 4x Longitudinal_Crack                      |
| MONITOR        |                                                                              |
| Action:        | Include in next maintenance cycle                                            |
| Defects (108): | 82x Longitudinal_Crack, 25x Transverse_Crack, 1x crack                       |
| ROUTINE        |                                                                              |
| Action:        | Log and monitor at next inspection                                           |
| Defects (240): | 149x Longitudinal_Crack, 50x Transverse_Crack, 35x crack, 6x Alligator_Crack |

Repair timelines under O. Reg. 239/02 (Minimum Maintenance Standards for Municipal Highways)

| Defect type     | Provision                                                                   | Applies once a field measurement confirms | Repair within, after becoming aware |
|-----------------|-----------------------------------------------------------------------------|-------------------------------------------|-------------------------------------|
| Alligator_Crack | No standard — the regulation sets no repair timeline for this defect class. |                                           |                                     |

|                    |                          |                                                                                                                                                     |                                                                                                |
|--------------------|--------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------|
| Longitudinal_Crack | s. 8, Table (Cracks)     | greater than 5 cm wide and 5 cm deep for a continuous distance of three metres or more                                                              | Class 1: 30 days · Class 2: 30 days · Class 3: 60 days · Class 4: 180 days · Class 5: 180 days |
| Pothole            | s. 6, Table 1 (Potholes) | surface area and depth both exceed the Table 1 values for the class (600 cm² Class 1, 800 cm² Class 2, 1,000 cm² Classes 3-5; 8 cm deep throughout) | Class 1: 4 days · Class 2: 4 days · Class 3: 7 days · Class 4: 14 days · Class 5: 30 days      |
| Transverse_Crack   | s. 8, Table (Cracks)     | greater than 5 cm wide and 5 cm deep for a continuous distance of three metres or more                                                              | Class 1: 30 days · Class 2: 30 days · Class 3: 60 days · Class 4: 180 days · Class 5: 180 days |
| crack              | s. 8, Table (Cracks)     | greater than 5 cm wide and 5 cm deep for a continuous distance of three metres or more                                                              | Class 1: 30 days · Class 2: 30 days · Class 3: 60 days · Class 4: 180 days · Class 5: 180 days |

No repair timeline: O. Reg. 239/02 (Minimum Maintenance Standards for Municipal Highways) sets a standard for potholes (s. 6), cracks over 5 cm wide and deep (s. 8), surface discontinuities (s. 16) and shoulder drop-offs (s. 7). Fatigue (alligator) cracking is not among them, and neither is any crack under the s. 8 dimensions.

**Standards this scan cannot check:** Roadway surface discontinuities (s. 16, Table): vertical step formation at a joint or crack exceeding 5 cm. Shoulder drop-offs (s. 7, Table): shoulder more than 8 cm below the paved roadway for a continuous distance of 20 metres or more. Neither is detected by dashcam imagery, so their absence from this report is a limit of the survey, not a finding.

Repair timelines are quoted from O. Reg. 239/02 (Minimum Maintenance Standards for Municipal Highways), <https://www.ontario.ca/laws/regulation/020239> (consolidation period beginning May 3, 2018; last amendment O. Reg. 366/18). Highway class is assigned by O. Reg. 239/02 (Minimum Maintenance Standards for Municipal Highways), s. 1 (2) and its Table, from the posted speed limit and the average daily traffic. A dashcam scan measures neither, so this report prints every class rather than assuming one. Class 6 highways are outside the regulation (s. 2 (3)). PaveScan measures pixels, not centimetres, so it cannot establish that any defect exceeds an MMS threshold; the timelines above are the ones that apply once a field measurement does.

## Defect Inventory

| # | File       | Defect Type   | Priority | Confidence | Severity       | Width (px) | Area (px) | Latitude  | Longitude  | Action                                                           |
|---|------------|---------------|----------|------------|----------------|------------|-----------|-----------|------------|------------------------------------------------------------------|
| 1 | f00447.jpg | Transverse_C  | CRITICAL | 58.6%      | HIGH<br>(0.49) | -          | 51,854    | 43.743400 | -79.304719 | Emergency repair or barricade required                           |
| 2 | f00393.jpg | Longitudinal_ | URGENT   | 45.2%      | HIGH<br>(0.77) | -          | 166,248   | 43.791684 | -79.368452 | Priority repair: significant defect requiring prompt maintenance |
| 3 | f00572.jpg | Longitudinal_ | URGENT   | 21.2%      | HIGH<br>(0.56) | -          | 154,041   | 43.766095 | -79.279806 | Schedule priority maintenance                                    |



|    |            |                |        |       |                  |   |         |           |            |                                                                           |
|----|------------|----------------|--------|-------|------------------|---|---------|-----------|------------|---------------------------------------------------------------------------|
| 4  | f00404.jpg | Alligator_Crac | URGENT | 27.3% | MEDIUM<br>(0.41) | - | 45,511  | 43.791172 | -79.368336 | Schedule repair: the pavement structure is affected, not just the surface |
| 5  | f00406.jpg | Alligator_Crac | URGENT | 8.4%  | MEDIUM<br>(0.40) | - | 107,659 | 43.791079 | -79.368313 | Schedule repair: the pavement structure is affected, not just the surface |
| 6  | f00689.jpg | Alligator_Crac | URGENT | 11.7% | MEDIUM<br>(0.38) | - | 144,604 | 43.767554 | -79.272618 | Schedule repair: the pavement structure is affected, not just the surface |
| 7  | f00026.jpg | Alligator_Crac | URGENT | 11.6% | MEDIUM<br>(0.33) | - | 86,734  | 43.804669 | -79.217436 | Schedule repair: the pavement structure is affected, not just the surface |
| 8  | f00034.jpg | Alligator_Crac | URGENT | 24.7% | MEDIUM<br>(0.33) | - | 24,746  | 43.804291 | -79.217329 | Schedule repair: the pavement structure is affected, not just the surface |
| 9  | f00032.jpg | Alligator_Crac | URGENT | 9.8%  | MEDIUM<br>(0.32) | - | 72,598  | 43.804396 | -79.217349 | Schedule repair: the pavement structure is affected, not just the surface |
| 10 | f00084.jpg | Alligator_Crac | URGENT | 11.7% | MEDIUM<br>(0.32) | - | 77,840  | 43.802049 | -79.217906 | Schedule repair: the pavement structure is affected, not just the surface |
| 11 | f00382.jpg | Alligator_Crac | URGENT | 11.4% | MEDIUM<br>(0.32) | - | 76,488  | 43.792189 | -79.368567 | Schedule repair: the pavement structure is affected, not just the surface |

|    |            |                |        |       |                  |   |        |           |            |                                                                                                                                                                       |
|----|------------|----------------|--------|-------|------------------|---|--------|-----------|------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 12 | f00054.jpg | Alligator_Crac | URGENT | 7.6%  | MEDIUM<br>(0.31) | - | 67,208 | 43.803372 | -79.217328 | Schedule repair: the pavement structure is affected, not just the surface                                                                                             |
| 13 | f00328.jpg | Alligator_Crac | URGENT | 17.7% | MEDIUM<br>(0.31) | - | 67,562 | 43.794099 | -79.238096 | Schedule repair: the pavement structure is affected, not just the surface                                                                                             |
| 14 | f00357.jpg | Pothole        | URGENT | 29.5% | MEDIUM<br>(0.30) | - | 6,216  | 43.793674 | -79.240023 | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 15 | f00401.jpg | Pothole        | URGENT | 23.5% | MEDIUM<br>(0.30) | - | 2,970  | 43.791313 | -79.368363 | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 16 | f00462.jpg | Pothole        | URGENT | 24.7% | MEDIUM<br>(0.30) | - | 10,153 | 43.743486 | -79.303630 | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |

|    |            |         |        |       |                  |   |       |           |            |                                                                                                                                                                                                                          |
|----|------------|---------|--------|-------|------------------|---|-------|-----------|------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 17 | f00479.jpg | Pothole | URGENT | 26.2% | MEDIUM<br>(0.30) | - | 3,442 | 43.743721 | -79.302509 | Suspected<br>pothole —<br>field-verify<br>before<br>scheduling;<br>detector<br>confidence<br>is low for<br>this class,<br>and the O.<br>Reg.<br>239/02<br>clock<br>needs a<br>measurement<br>this scan<br>cannot<br>make |
| 18 | f00490.jpg | Pothole | URGENT | 23.4% | MEDIUM<br>(0.30) | - | 6,688 | 43.743862 | -79.302005 | Suspected<br>pothole —<br>field-verify<br>before<br>scheduling;<br>detector<br>confidence<br>is low for<br>this class,<br>and the O.<br>Reg.<br>239/02<br>clock<br>needs a<br>measurement<br>this scan<br>cannot<br>make |
| 19 | f00506.jpg | Pothole | URGENT | 20.3% | MEDIUM<br>(0.30) | - | 6,694 | 43.744039 | -79.300970 | Suspected<br>pothole —<br>field-verify<br>before<br>scheduling;<br>detector<br>confidence<br>is low for<br>this class,<br>and the O.<br>Reg.<br>239/02<br>clock<br>needs a<br>measurement<br>this scan<br>cannot<br>make |

|    |            |                     |        |       |                  |    |        |           |            |                                                                                                                                                                                                                          |
|----|------------|---------------------|--------|-------|------------------|----|--------|-----------|------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 20 | f00544.jpg | Pothole             | URGENT | 20.9% | MEDIUM<br>(0.30) | -  | 1,807  | 43.744539 | -79.298546 | Suspected<br>pothole —<br>field-verify<br>before<br>scheduling;<br>detector<br>confidence<br>is low for<br>this class,<br>and the O.<br>Reg.<br>239/02<br>clock<br>needs a<br>measurement<br>this scan<br>cannot<br>make |
| 21 | f00555.jpg | Pothole             | URGENT | 20.1% | MEDIUM<br>(0.30) | -  | 3,066  | 43.765894 | -79.280983 | Suspected<br>pothole —<br>field-verify<br>before<br>scheduling;<br>detector<br>confidence<br>is low for<br>this class,<br>and the O.<br>Reg.<br>239/02<br>clock<br>needs a<br>measurement<br>this scan<br>cannot<br>make |
| 22 | f00419.jpg | Alligator_Cracks    | URGENT | 16.4% | MEDIUM<br>(0.28) | -  | 37,788 | 43.790517 | -79.368176 | Schedule<br>priority<br>maintenance                                                                                                                                                                                      |
| 23 | f00352.jpg | Pothole             | URGENT | 17.7% | LOW<br>(0.26)    | -  | 24,059 | 43.793743 | -79.239708 | Suspected<br>pothole —<br>field-verify<br>before<br>scheduling;<br>detector<br>confidence<br>is low for<br>this class,<br>and the O.<br>Reg.<br>239/02<br>clock<br>needs a<br>measurement<br>this scan<br>cannot<br>make |
| 24 | f00571.jpg | Longitudinal_Cracks | URGENT | 22.4% | HIGH<br>(0.21)   | 26 | 4,919  | 43.766081 | -79.279869 | Schedule<br>priority<br>maintenance                                                                                                                                                                                      |

|    |            |         |        |       |               |   |       |           |            |                                                                                                                                                                       |
|----|------------|---------|--------|-------|---------------|---|-------|-----------|------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 25 | f00461.jpg | Pothole | URGENT | 15.2% | LOW<br>(0.19) | - | 4,652 | 43.743472 | -79.303764 | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 26 | f00426.jpg | Pothole | URGENT | 13.1% | LOW<br>(0.18) | - | 2,408 | 43.790273 | -79.368100 | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 27 | f00489.jpg | Pothole | URGENT | 19.6% | LOW<br>(0.18) | - | 2,949 | 43.743848 | -79.302071 | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |

|    |            |                |         |       |                  |   |         |           |            |                                                                                                                                                                       |
|----|------------|----------------|---------|-------|------------------|---|---------|-----------|------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 28 | f00541.jpg | Pothole        | URGENT  | 18.6% | LOW<br>(0.18)    | - | 1,763   | 43.744499 | -79.298752 | Suspected pothole — field-verify before scheduling; detector confidence is low for this class, and the O. Reg. 239/02 clock needs a measurement this scan cannot make |
| 29 | f00577.jpg | Longitudinal_C | URGENT  | 19.8% | HIGH<br>(0.15)   | - | 10,796  | 43.766165 | -79.279502 | Schedule priority maintenance                                                                                                                                         |
| 30 | f00575.jpg | Longitudinal_C | MONITOR | 36.8% | MEDIUM<br>(0.58) | - | 90,741  | 43.766138 | -79.279624 | Include in next maintenance cycle; monitor for progression                                                                                                            |
| 31 | f00374.jpg | Longitudinal_C | MONITOR | 23.9% | MEDIUM<br>(0.56) | - | 151,119 | 43.792549 | -79.368650 | Include in next maintenance cycle; monitor for progression                                                                                                            |
| 32 | f00525.jpg | Transverse_C   | MONITOR | 50.0% | MEDIUM<br>(0.56) | - | 82,675  | 43.744294 | -79.299636 | Include in next maintenance cycle; monitor for progression                                                                                                            |
| 33 | f00570.jpg | Longitudinal_C | MONITOR | 28.5% | MEDIUM<br>(0.56) | - | 183,138 | 43.766068 | -79.279984 | Include in next maintenance cycle; monitor for progression                                                                                                            |
| 34 | f00580.jpg | Longitudinal_C | MONITOR | 26.3% | MEDIUM<br>(0.56) | - | 185,825 | 43.766206 | -79.279304 | Include in next maintenance cycle; monitor for progression                                                                                                            |
| 35 | f00415.jpg | Transverse_C   | MONITOR | 81.2% | MEDIUM<br>(0.55) | - | 76,802  | 43.790679 | -79.368218 | Include in next maintenance cycle; monitor for progression                                                                                                            |

|    |            |                |         |       |                  |   |         |           |            |                                                            |
|----|------------|----------------|---------|-------|------------------|---|---------|-----------|------------|------------------------------------------------------------|
| 36 | f00682.jpg | Longitudinal_C | MONITOR | 34.3% | MEDIUM<br>(0.55) | - | 147,838 | 43.767472 | -79.273024 | Include in next maintenance cycle; monitor for progression |
| 37 | f00686.jpg | Longitudinal_C | MONITOR | 20.5% | MEDIUM<br>(0.53) | - | 158,225 | 43.767518 | -79.272788 | Include in next maintenance cycle; monitor for progression |
| 38 | f00432.jpg | Transverse_C   | MONITOR | 76.6% | MEDIUM<br>(0.50) | - | 54,108  | 43.743977 | -79.304756 | Include in next maintenance cycle; monitor for progression |
| 39 | f00549.jpg | Longitudinal_C | MONITOR | 35.0% | MEDIUM<br>(0.50) | - | 57,656  | 43.744604 | -79.298342 | Include in next maintenance cycle; monitor for progression |
| 40 | f00590.jpg | Longitudinal_C | MONITOR | 38.7% | MEDIUM<br>(0.50) | - | 60,004  | 43.766331 | -79.278686 | Include in next maintenance cycle; monitor for progression |
| 41 | f00378.jpg | Transverse_C   | MONITOR | 30.6% | MEDIUM<br>(0.49) | - | 115,480 | 43.792371 | -79.368585 | Include in next maintenance cycle; monitor for progression |
| 42 | f00380.jpg | Longitudinal_C | MONITOR | 24.2% | MEDIUM<br>(0.48) | - | 124,117 | 43.792280 | -79.368576 | Include in next maintenance cycle; monitor for progression |
| 43 | f00346.jpg | Longitudinal_C | MONITOR | 29.6% | MEDIUM<br>(0.47) | - | 113,090 | 43.793827 | -79.239333 | Include in next maintenance cycle; monitor for progression |
| 44 | f00440.jpg | Transverse_C   | MONITOR | 36.1% | MEDIUM<br>(0.47) | - | 55,351  | 43.743661 | -79.304756 | Include in next maintenance cycle; monitor for progression |

|    |            |                |         |       |                  |   |         |           |            |                                                            |
|----|------------|----------------|---------|-------|------------------|---|---------|-----------|------------|------------------------------------------------------------|
| 45 | f00482.jpg | Transverse_C   | MONITOR | 30.3% | MEDIUM<br>(0.47) | - | 144,682 | 43.743761 | -79.302406 | Include in next maintenance cycle; monitor for progression |
| 46 | f00556.jpg | Longitudinal_C | MONITOR | 35.8% | MEDIUM<br>(0.47) | - | 40,814  | 43.765879 | -79.280983 | Include in next maintenance cycle; monitor for progression |
| 47 | f00597.jpg | Longitudinal_C | MONITOR | 42.1% | MEDIUM<br>(0.46) | - | 48,211  | 43.766411 | -79.278397 | Include in next maintenance cycle; monitor for progression |
| 48 | f00343.jpg | Longitudinal_C | MONITOR | 20.1% | MEDIUM<br>(0.44) | - | 90,831  | 43.793873 | -79.239138 | Include in next maintenance cycle; monitor for progression |
| 49 | f00523.jpg | Transverse_C   | MONITOR | 58.8% | MEDIUM<br>(0.44) | - | 57,117  | 43.744264 | -79.299763 | Include in next maintenance cycle; monitor for progression |
| 50 | f00538.jpg | Transverse_C   | MONITOR | 24.5% | MEDIUM<br>(0.44) | - | 99,716  | 43.744461 | -79.298839 | Include in next maintenance cycle; monitor for progression |
| 51 | f00614.jpg | Longitudinal_C | MONITOR | 36.3% | MEDIUM<br>(0.44) | - | 33,721  | 43.766613 | -79.277336 | Include in next maintenance cycle; monitor for progression |
| 52 | f00628.jpg | Longitudinal_C | MONITOR | 35.1% | MEDIUM<br>(0.44) | - | 41,824  | 43.766800 | -79.276313 | Include in next maintenance cycle; monitor for progression |
| 53 | f00342.jpg | Longitudinal_C | MONITOR | 25.7% | MEDIUM<br>(0.43) | - | 68,296  | 43.793881 | -79.239075 | Include in next maintenance cycle; monitor for progression |



|    |            |                |         |       |                  |   |        |           |            |                                                            |
|----|------------|----------------|---------|-------|------------------|---|--------|-----------|------------|------------------------------------------------------------|
| 54 | f00371.jpg | Longitudinal_C | MONITOR | 23.4% | MEDIUM<br>(0.43) | - | 81,880 | 43.792687 | -79.368661 | Include in next maintenance cycle; monitor for progression |
| 55 | f00587.jpg | Longitudinal_C | MONITOR | 27.5% | MEDIUM<br>(0.43) | - | 81,986 | 43.766294 | -79.278874 | Include in next maintenance cycle; monitor for progression |
| 56 | f00589.jpg | Longitudinal_C | MONITOR | 35.3% | MEDIUM<br>(0.43) | - | 32,736 | 43.766320 | -79.278742 | Include in next maintenance cycle; monitor for progression |
| 57 | f00363.jpg | Longitudinal_C | MONITOR | 21.1% | MEDIUM<br>(0.42) | - | 78,129 | 43.793587 | -79.240395 | Include in next maintenance cycle; monitor for progression |
| 58 | f00406.jpg | Longitudinal_C | MONITOR | 23.5% | MEDIUM<br>(0.42) | - | 56,801 | 43.791079 | -79.368313 | Include in next maintenance cycle; monitor for progression |
| 59 | f00687.jpg | Longitudinal_C | MONITOR | 29.4% | MEDIUM<br>(0.41) | - | 71,113 | 43.767529 | -79.272728 | Include in next maintenance cycle; monitor for progression |
| 60 | f00335.jpg | Longitudinal_C | MONITOR | 33.6% | MEDIUM<br>(0.40) | - | 68,746 | 43.793975 | -79.238586 | Include in next maintenance cycle; monitor for progression |
| 61 | f00350.jpg | Longitudinal_C | MONITOR | 23.4% | MEDIUM<br>(0.40) | - | 68,139 | 43.793772 | -79.239582 | Include in next maintenance cycle; monitor for progression |
| 62 | f00394.jpg | Longitudinal_C | MONITOR | 38.5% | MEDIUM<br>(0.40) | - | 26,371 | 43.791640 | -79.368442 | Include in next maintenance cycle; monitor for progression |

|    |            |                |         |       |                  |   |        |           |            |                                                            |
|----|------------|----------------|---------|-------|------------------|---|--------|-----------|------------|------------------------------------------------------------|
| 63 | f00401.jpg | Longitudinal_C | MONITOR | 24.9% | MEDIUM<br>(0.40) | - | 58,404 | 43.791313 | -79.368363 | Include in next maintenance cycle; monitor for progression |
| 64 | f00452.jpg | Longitudinal_C | MONITOR | 25.7% | MEDIUM<br>(0.40) | - | 66,491 | 43.743349 | -79.304359 | Include in next maintenance cycle; monitor for progression |
| 65 | f00498.jpg | Longitudinal_C | MONITOR | 21.4% | MEDIUM<br>(0.40) | - | 57,904 | 43.743951 | -79.301460 | Include in next maintenance cycle; monitor for progression |
| 66 | f00513.jpg | Transverse_C   | MONITOR | 23.0% | MEDIUM<br>(0.40) | - | 89,990 | 43.744126 | -79.300391 | Include in next maintenance cycle; monitor for progression |
| 67 | f00539.jpg | Transverse_C   | MONITOR | 32.0% | MEDIUM<br>(0.40) | - | 71,475 | 43.744474 | -79.298786 | Include in next maintenance cycle; monitor for progression |
| 68 | f00373.jpg | Longitudinal_C | MONITOR | 38.5% | MEDIUM<br>(0.39) | - | 25,438 | 43.792595 | -79.368652 | Include in next maintenance cycle; monitor for progression |
| 69 | f00381.jpg | Longitudinal_C | MONITOR | 32.6% | MEDIUM<br>(0.39) | - | 64,095 | 43.792235 | -79.368576 | Include in next maintenance cycle; monitor for progression |
| 70 | f00421.jpg | Longitudinal_C | MONITOR | 24.8% | MEDIUM<br>(0.39) | - | 65,231 | 43.790441 | -79.368160 | Include in next maintenance cycle; monitor for progression |
| 71 | f00616.jpg | Longitudinal_C | MONITOR | 37.3% | MEDIUM<br>(0.39) | - | 29,919 | 43.766639 | -79.277212 | Include in next maintenance cycle; monitor for progression |

|    |            |                       |       |                  |   |         |           |            |                                                            |
|----|------------|-----------------------|-------|------------------|---|---------|-----------|------------|------------------------------------------------------------|
| 72 | f00649.jpg | Longitudinal_CMONITOR | 38.1% | MEDIUM<br>(0.39) | - | 29,807  | 43.767065 | -79.275032 | Include in next maintenance cycle; monitor for progression |
| 73 | f00375.jpg | Longitudinal_CMONITOR | 16.0% | MEDIUM<br>(0.38) | - | 139,190 | 43.792508 | -79.368631 | Include in next maintenance cycle; monitor for progression |
| 74 | f00648.jpg | Longitudinal_CMONITOR | 41.7% | MEDIUM<br>(0.38) | - | 28,538  | 43.767052 | -79.275093 | Include in next maintenance cycle; monitor for progression |
| 75 | f00345.jpg | Longitudinal_CMONITOR | 28.4% | MEDIUM<br>(0.37) | - | 55,312  | 43.793840 | -79.239265 | Include in next maintenance cycle; monitor for progression |
| 76 | f00548.jpg | Longitudinal_CMONITOR | 29.2% | MEDIUM<br>(0.37) | - | 56,345  | 43.744590 | -79.298402 | Include in next maintenance cycle; monitor for progression |
| 77 | f00601.jpg | Longitudinal_CMONITOR | 22.3% | MEDIUM<br>(0.37) | - | 47,735  | 43.766462 | -79.278011 | Include in next maintenance cycle; monitor for progression |
| 78 | f00400.jpg | Longitudinal_CMONITOR | 24.4% | MEDIUM<br>(0.36) | - | 42,169  | 43.791359 | -79.368376 | Include in next maintenance cycle; monitor for progression |
| 79 | f00446.jpg | Transverse_CMONITOR   | 34.0% | MEDIUM<br>(0.36) | - | 57,858  | 43.743441 | -79.304738 | Include in next maintenance cycle; monitor for progression |
| 80 | f00467.jpg | Transverse_CMONITOR   | 23.9% | MEDIUM<br>(0.36) | - | 67,927  | 43.743551 | -79.303368 | Include in next maintenance cycle; monitor for progression |

|    |            |                |         |       |                  |   |         |           |            |                                                            |
|----|------------|----------------|---------|-------|------------------|---|---------|-----------|------------|------------------------------------------------------------|
| 81 | f00547.jpg | Transverse_C   | MONITOR | 22.1% | MEDIUM<br>(0.36) | - | 56,484  | 43.744578 | -79.298409 | Include in next maintenance cycle; monitor for progression |
| 82 | f00621.jpg | Longitudinal_C | MONITOR | 28.8% | MEDIUM<br>(0.36) | - | 54,012  | 43.766704 | -79.276765 | Include in next maintenance cycle; monitor for progression |
| 83 | f00646.jpg | Longitudinal_C | MONITOR | 25.2% | MEDIUM<br>(0.36) | - | 42,874  | 43.767025 | -79.275222 | Include in next maintenance cycle; monitor for progression |
| 84 | f00689.jpg | Longitudinal_C | MONITOR | 46.0% | MEDIUM<br>(0.36) | - | 24,832  | 43.767554 | -79.272618 | Include in next maintenance cycle; monitor for progression |
| 85 | f00392.jpg | Transverse_C   | MONITOR | 17.3% | MEDIUM<br>(0.35) | - | 157,682 | 43.791730 | -79.368462 | Include in next maintenance cycle; monitor for progression |
| 86 | f00395.jpg | Longitudinal_C | MONITOR | 14.3% | MEDIUM<br>(0.35) | - | 129,920 | 43.791590 | -79.368432 | Include in next maintenance cycle; monitor for progression |
| 87 | f00424.jpg | Longitudinal_C | MONITOR | 15.6% | MEDIUM<br>(0.35) | - | 160,718 | 43.790337 | -79.368134 | Include in next maintenance cycle; monitor for progression |
| 88 | f00647.jpg | Longitudinal_C | MONITOR | 28.1% | MEDIUM<br>(0.35) | - | 48,819  | 43.767039 | -79.275154 | Include in next maintenance cycle; monitor for progression |
| 89 | f00185.jpg | Longitudinal_C | MONITOR | 20.4% | MEDIUM<br>(0.34) | - | 46,979  | 43.797911 | -79.218737 | Include in next maintenance cycle; monitor for progression |

|    |            |                |         |       |                  |   |         |           |            |                                                            |
|----|------------|----------------|---------|-------|------------------|---|---------|-----------|------------|------------------------------------------------------------|
| 90 | f00379.jpg | Longitudinal_C | MONITOR | 25.0% | MEDIUM<br>(0.34) | - | 30,955  | 43.792326 | -79.368576 | Include in next maintenance cycle; monitor for progression |
| 91 | f00565.jpg | Longitudinal_C | MONITOR | 34.7% | MEDIUM<br>(0.34) | - | 44,296  | 43.765992 | -79.280264 | Include in next maintenance cycle; monitor for progression |
| 92 | f00617.jpg | Longitudinal_C | MONITOR | 31.6% | MEDIUM<br>(0.34) | - | 45,595  | 43.766652 | -79.277087 | Include in next maintenance cycle; monitor for progression |
| 93 | f00641.jpg | Longitudinal_C | MONITOR | 20.2% | MEDIUM<br>(0.34) | - | 44,223  | 43.766961 | -79.275520 | Include in next maintenance cycle; monitor for progression |
| 94 | f00394.jpg | Transverse_C   | MONITOR | 10.2% | MEDIUM<br>(0.33) | - | 132,001 | 43.791640 | -79.368442 | Include in next maintenance cycle; monitor for progression |
| 95 | f00526.jpg | Transverse_C   | MONITOR | 20.6% | MEDIUM<br>(0.33) | - | 58,381  | 43.744304 | -79.299578 | Include in next maintenance cycle; monitor for progression |
| 96 | f00596.jpg | Longitudinal_C | MONITOR | 37.4% | MEDIUM<br>(0.33) | - | 14,121  | 43.766398 | -79.278526 | Include in next maintenance cycle; monitor for progression |
| 97 | f00199.jpg | Longitudinal_C | MONITOR | 20.0% | MEDIUM<br>(0.32) | - | 38,229  | 43.797734 | -79.219500 | Include in next maintenance cycle; monitor for progression |
| 98 | f00375.jpg | Transverse_C   | MONITOR | 20.9% | MEDIUM<br>(0.32) | - | 38,610  | 43.792508 | -79.368631 | Include in next maintenance cycle; monitor for progression |

|     |            |                |         |       |                  |   |        |           |            |                                                            |
|-----|------------|----------------|---------|-------|------------------|---|--------|-----------|------------|------------------------------------------------------------|
| 99  | f00378.jpg | Longitudinal_C | MONITOR | 19.5% | MEDIUM<br>(0.32) | - | 74,019 | 43.792371 | -79.368585 | Include in next maintenance cycle; monitor for progression |
| 100 | f00407.jpg | Longitudinal_C | MONITOR | 25.4% | MEDIUM<br>(0.32) | - | 32,046 | 43.791030 | -79.368303 | Include in next maintenance cycle; monitor for progression |

Showing the 100 highest-priority of 377 defects; 277 lower-priority rows omitted. Ordered by safety priority, then severity.

## Excluded from scoring

8 detection(s) were judged to be manhole or utility covers. Covers are infrastructure, not pavement damage, so they are excluded from the PCI and from the defect inventory below. They remain visible for review on the Detection page.

## Methodology

This report was generated using PaveScan AI, an automated pavement inspection system that combines deep learning-based defect detection with engineering assessment standards.

**Detection:** YOLO-based object detection and instance segmentation models trained on pavement distress imagery. Ensemble inference with IoU-based deduplication is used for improved coverage. Optional SAHI tiled inference detects small defects in high-resolution photos.

**Severity Assessment:** Multi-factor scoring informed by ASTM D6433 Standard Practice for Roads and Parking Lots Pavement Condition Index Surveys. Factors include defect area ratio, estimated crack width (from segmentation masks), defect type risk weight, detection confidence, and defect density. Structural failure types (potholes, alligator cracking) receive a minimum severity floor regardless of size.

**Safety Priority:** Four-tier classification (Critical, Urgent, Monitor, Routine) based on defect type, severity score, and systemic failure indicators. Prioritization follows a safety-first approach: potholes lead the ladder because of their direct hazard to road users. A pothole confirmed by a trained pothole classifier is Critical. An unconfirmed one is reported as a suspected pothole at Urgent, for field verification within 48 hours, because detector confidence for this class is low and a transverse crack or a sealed seam can be mistaken for one. No pothole classifier is installed in this build, so in practice every pothole is reported as suspected. Detections the cover classifier flags as manhole or utility covers are graded on severity like any other defect and are excluded from scoring entirely.

**PCI Scoring:** Distress density per sample unit, converted to deduct values and a Corrected Deduct Value using curves digitised from the ASTM D6433 / TM 5-623 chain. The route is tiled into fixed sample units of about 224 m², so the score does not change with the reporting segment length. Distress extent is estimated from detection geometry rather than measured on the ground, which is the main assumption in this number.

*Note: This automated assessment supplements but does not replace professional engineering judgment. Critical findings should be verified by a qualified pavement engineer before major repair decisions.*