Soldering the IN-16 sockets

I don't want to give advice to anyone about soldering nixie tubes, in this document I just show how it works for me.

Assuming all 14 nixies are more or less the same height (except for the length of the exhaust tip) and have the same internal construction, the result should be a well-aligned display board.

1. 3D print the IN-16 soldering helper tool

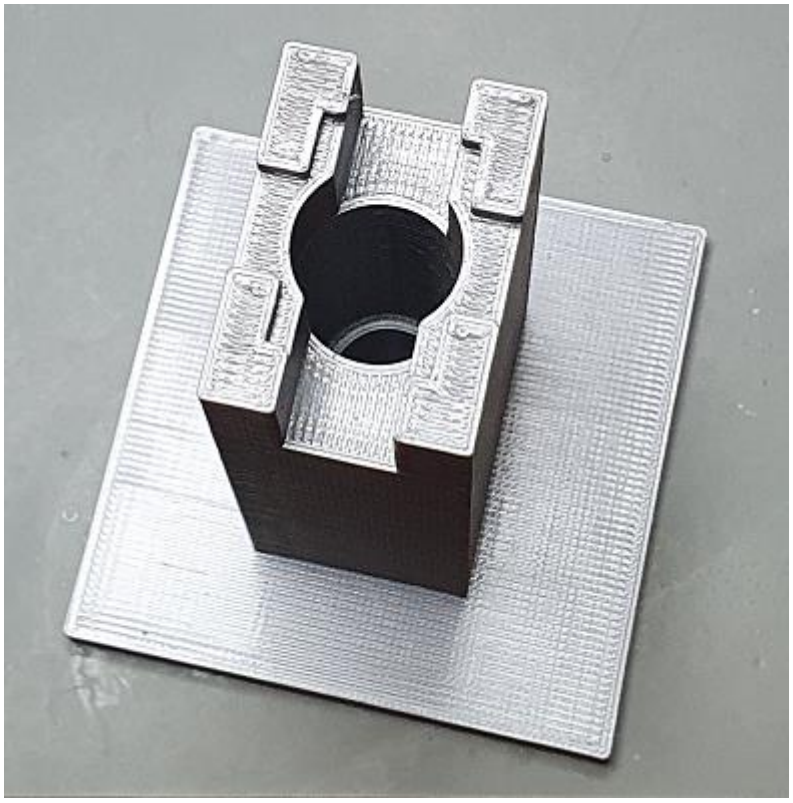

2. Solder R1, R2, H1_1 and H1_2 to the display board

3. Carefully remove the plastic spacer and find the anode lead. Leave the anode lead as it is, take the next (adjacent) lead and cut about 1mm from the free end of the lead. Then take the next lead and cut 2mm and so on…

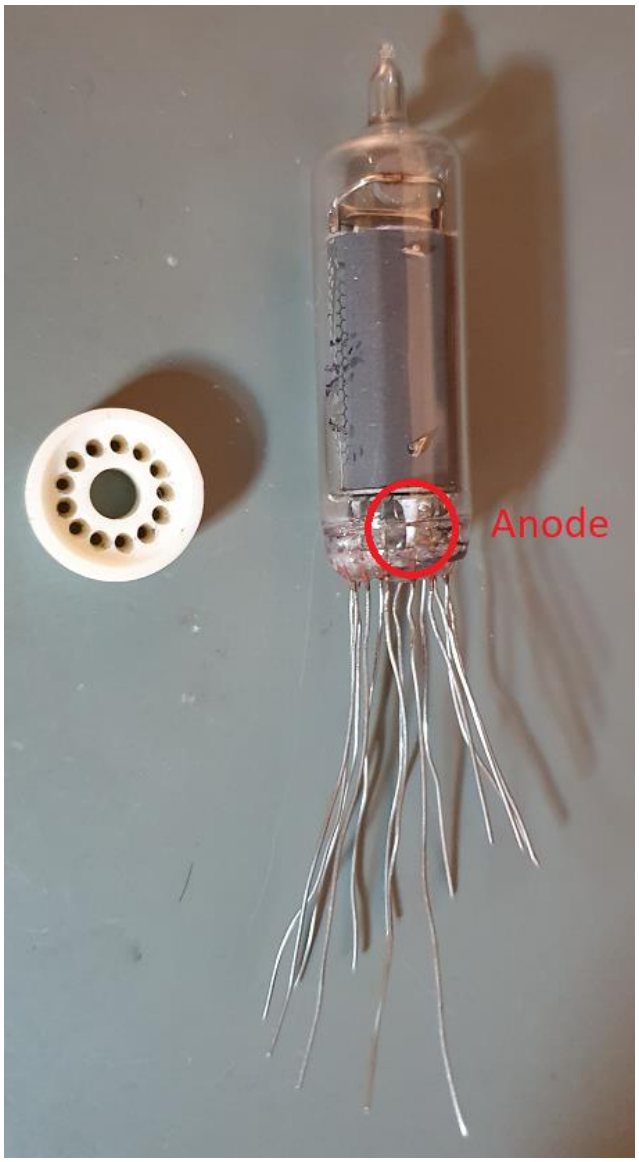

4. Introduce the leads in a socket board starting with the anode lead. On the board the anode pad is marked with an A

5. Bring the board into position, then **push the tube all the way down**. Make sure everything is correct, then solder the nixie and finally cut the leads.

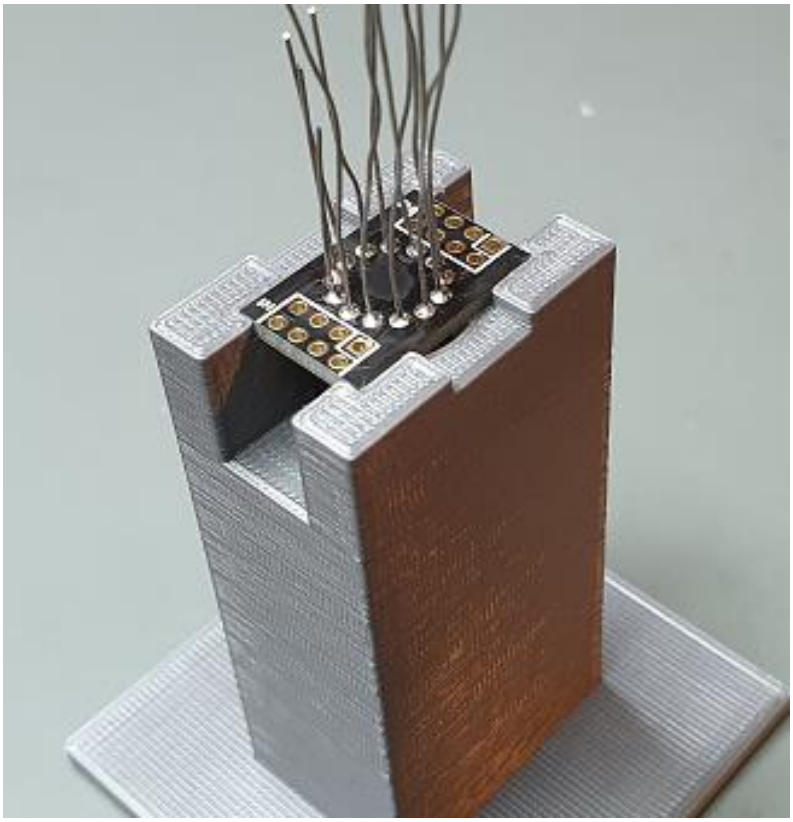

6. Put headers (longer pins facing down) into the sockets on the display board

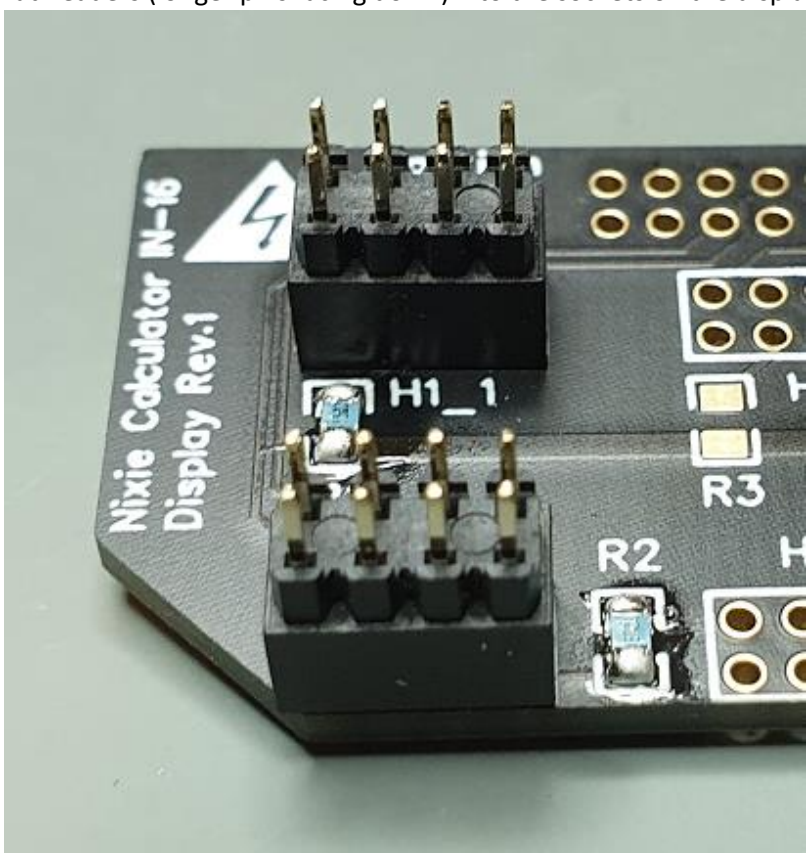

7. Place the nixie socket on the headers and solder the pins

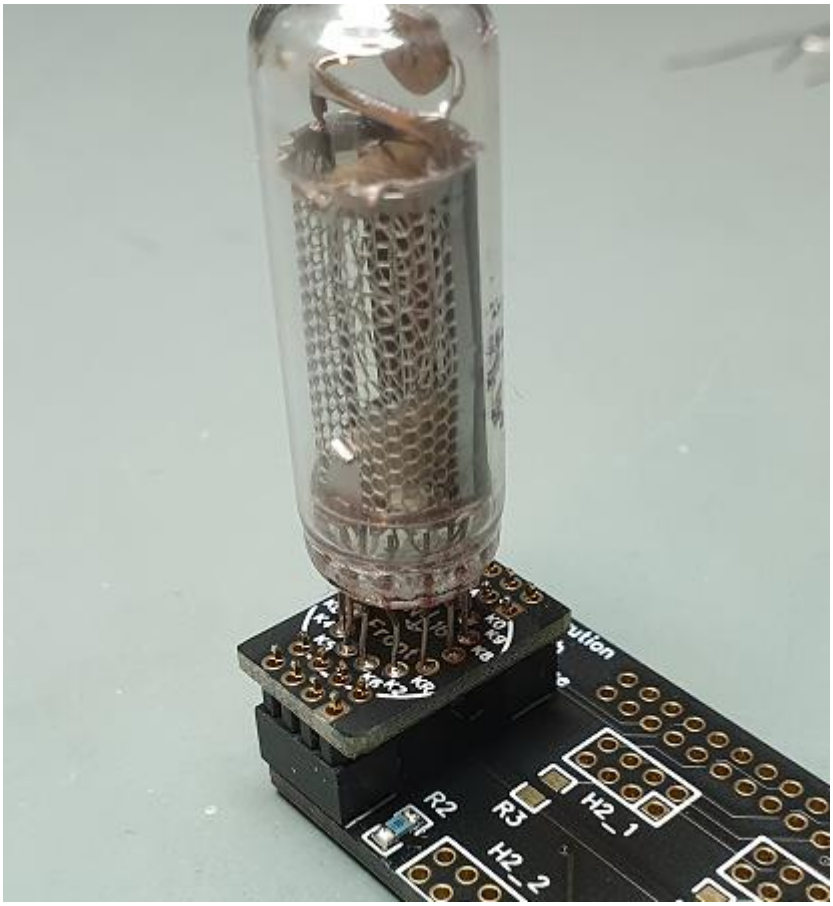
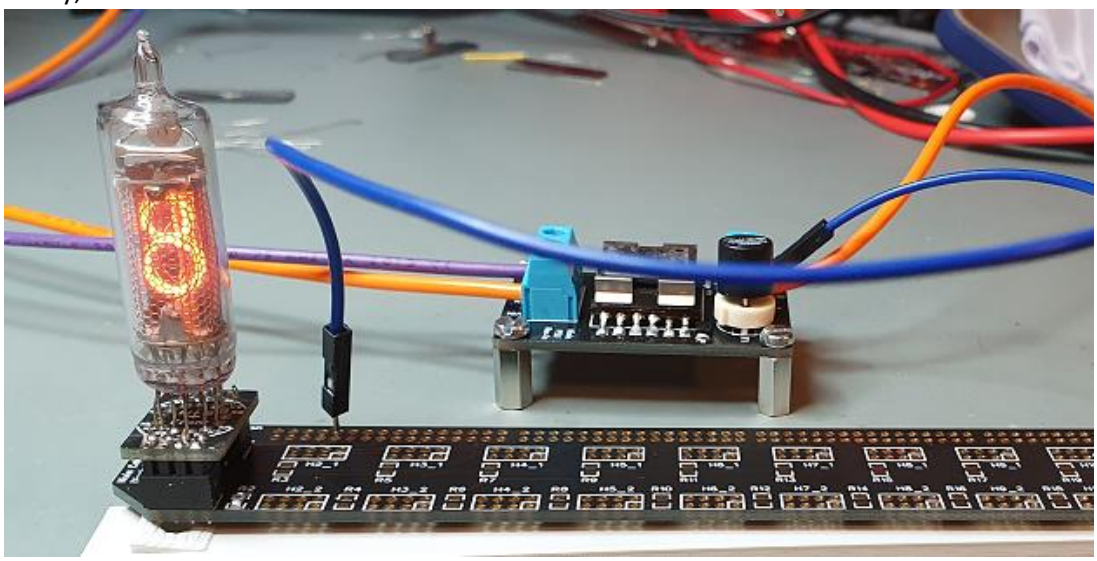
8. Finally, we can test the nixie