INTRALOX

Site walk notes — Example Foods - Smithfield

Infeed to packing · Site walk · 29 October 2026

CALL DETAILS

Date	29 October 2026
Call type	Site walk
Account manager	Alex Example
Customer	Example Foods - Smithfield
Site or area	Infeed to packing

CONTACTS

NAME	ROLE	EMAIL	MOBILE	CRM
Jo Bloggs	Maintenance	jo.bloggs@example.com	0400 000 001	On file
Pat Example	Engineering Manager	—	—	**Needs adding to Dynamics**

NOTES

- Walked three conveyors with Jo Bloggs, from the infeed (CV-100) to packing (CV-300).
- CV-100 infeed: carryway wear strips worn at the transfer end, about half their height left. Example Foods maintenance will replace them at the next shutdown. Belt, tracking, sprockets, shafts and return way are fine.
- CV-200 spiral exit: rods walking out on the left side about every third row, with worn hinges, since the wash-down change about six weeks ago. Drive sprocket teeth are hooked. A new belt and sprockets are recommended (Belts to quote, below).
- CV-300 packing: belt tracking to the right and rubbing the side frame near the outfeed. Not urgent; check the take-up adjustment at the next service. Hygiene is good.
- Second packing line: Pat Example is planning a second packing line next year, about 30 m of conveyor. Design starts in March, installation over the Christmas shutdown. Intralox to help with the layout.
- Follow-ups: quote the CV-200 belt and sprockets by Friday 30 October (Alex Example). Send the spiral and transfer case studies to Pat Example next week (Alex Example).


INTERNAL NOTES

- Second packing line: budget about $400k. They are also talking to another supplier.


- Pat Example is not in the CRM yet.

Not in the customer copy.

PHOTOS

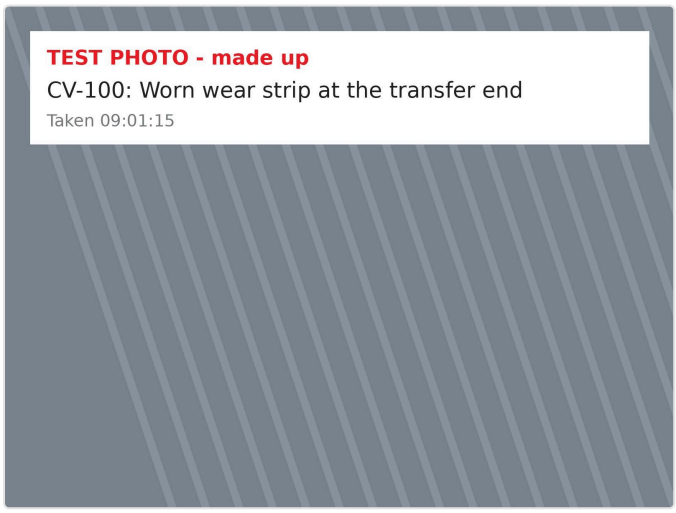

09:01 CV-100: carryway wear strips worn down at the transfer end.

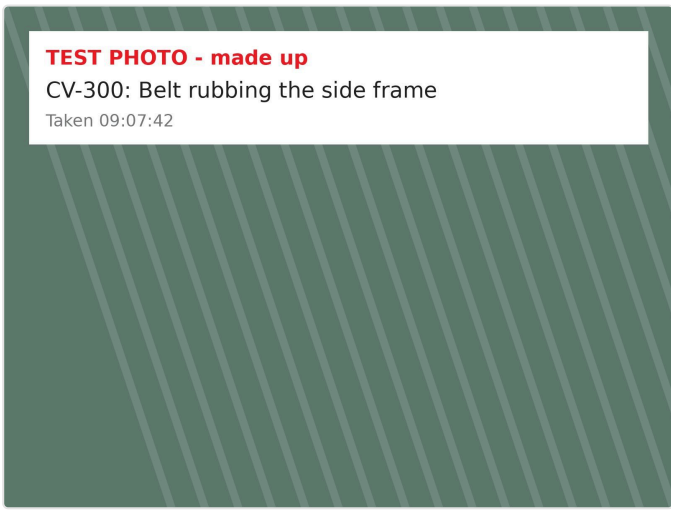

09:07 CV-300: belt rubbing the side frame near the outfeed.

BELTS TO QUOTE


Belt 1 — CV-200

BELT	
Quantity	—
Line / description	Spiral exit
Series	S800
Style / surface	Flat Top
Belt material	Acetal
Colour	White
Rod material	—
Belt width (mm)	457
Belt length (m)	24 (about)
SPROCKETS	
Description	11 tooth
Bore	40 mm square


GENERAL COMMENTS

Replacing a belt with rods walking out and worn hinges; the drive sprockets are hooked and are replaced with it. Quote requested by Friday 30 October.

Belt ID not yet confirmed with TSG.

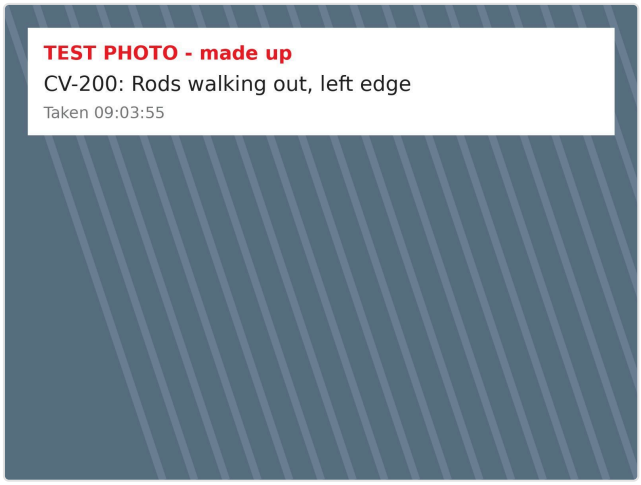

09:03 CV-200: rods walking out on the left edge.

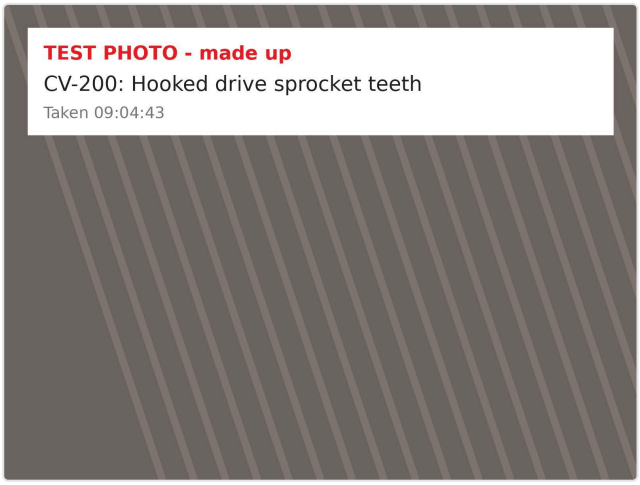

09:04 CV-200: drive sprocket teeth hooked.