

EXTRACTION LAB · BIOMASS FLOW

Charge Through THCA / HTE Pour · 34-Step Operational Process · 3 Decision Branches

App Checkpoint

Critical Control

Manual / Inferred

Branch / Decision

Handoff

Roles:

EXT

SUP


DOWN

MAINT

PHASE 1

CHARGE, REACTOR PREP & PRIMARY EXTRACTION


Biomass lot enters extraction and primary solvent contact is completed

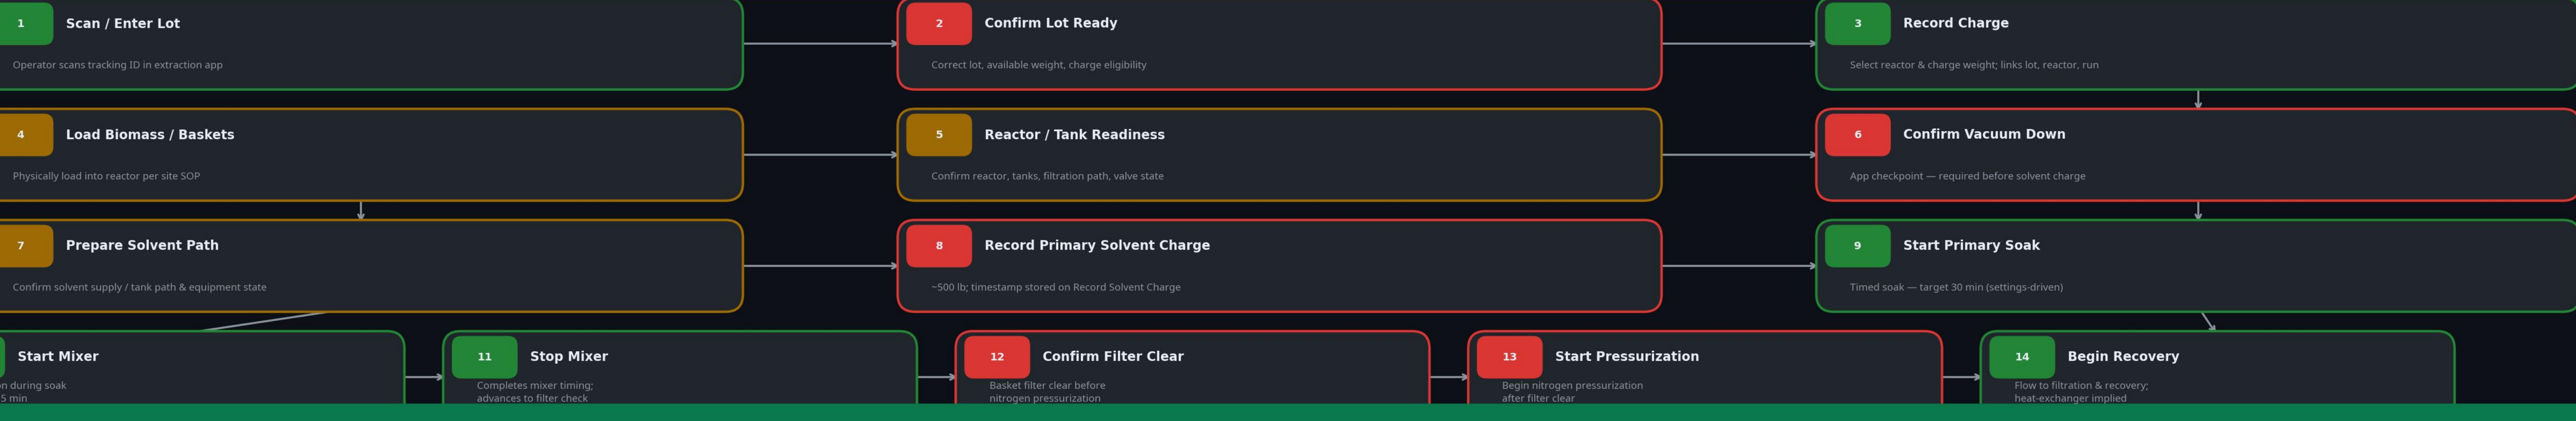

PHASE 2

FLUSH CYCLE, RECOVERY & FINAL PURGE

Critical temperature, solvent, flow, clarity, and shutdown controls

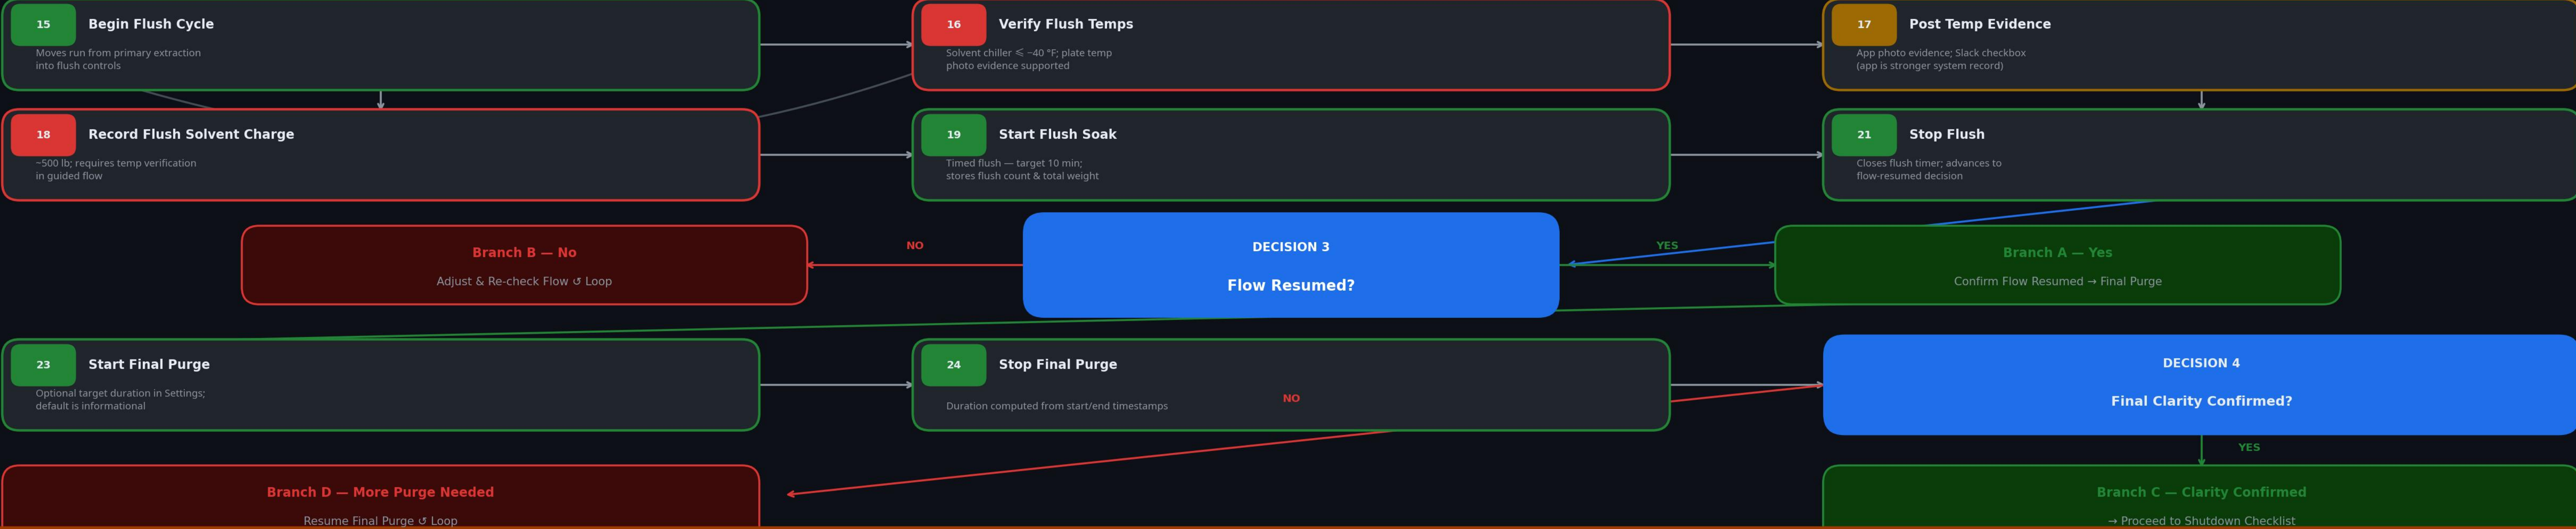

PHASE 3

BOOTH SHUTDOWN & RUN COMPLETION


Shutdown checklist and run close-out after clarity is confirmed



PHASE 4

WET THCA / HTE POUR & HANDOFF

Initial output capture and immediate downstream handoff

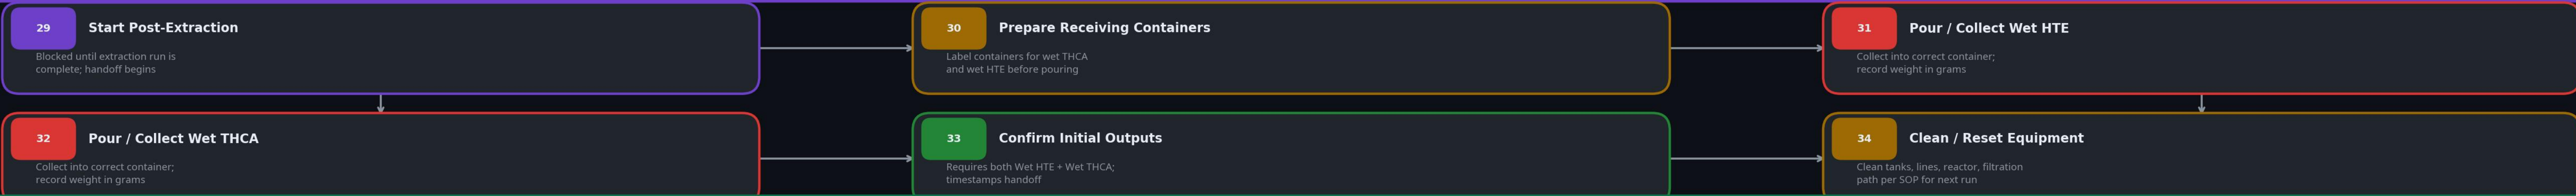

PHASE 5

DECISION TREE OVERVIEW

Three critical decision gates and their resolution paths

DECISION 1 — Lot Ready To Charge?

YES → Record charge, load reactor, confirm vacuum down
NO → Resolve readiness issue (hold lot, correct source/weight, supervisor review) → Return to Decision 1

Roles: Extractor / Supervisor

DECISION 2 — Flush Temps Acceptable?

PASS → Charge flush solvent → Start flush soak
FAIL → Correct temp / capture evidence → Re-check
Solvent chiller ≤ -40 °F threshold

Roles: Extractor / Supervisor if out of range

DECISIONS 3 & 4 — Flow / Clarity

D3 YES → Flow resumed → Final purge
D3 NO → Adjust flow → Re-check &
D4 YES → Shutdown checklist
D4 NO → Resume final purge &

PHASE 6

ROLES, TIMING & KEY CONTROLS REFERENCE

Quick-reference table for operators, supervisors, and downstream teams

Phase	Key Steps	Primary Role	Timing Target	Critical Control
1 — Charge & Primary	Steps 1–14	Extractor (EXT) Supervisor if exception	Soak: 30 min Mixer: 5 min	Vacuum down before solvent charge
2 — Flush & Purge	Steps 15–25	Extractor (EXT) Supervisor if out of range	Flush soak: 10 min Purge: settings-driven	Solvent chiller ≤ -40 °F before flush solvent
3 — Shutdown	Steps 26–28	Extractor (EXT)	After clarity confirmed	All 4 checklist items before run complete
4 — Pour & Handoff	Steps 29–34	Extractor + Downstream Operator (DOWN)	Immediately after run complete	Both wet weights entered before output confirm

PHASE 7

PROCESS GAPS & SUGGESTED IMPROVEMENTS

Identified gaps and recommended additions from the SOP alignment review

- Suggested Additions**
- Add one-page laminated "Run Card" matching app step numbers
 - Group tablet workflow into 4 big phases: Charge, Primary, Flush/Purge, Pour
 - Visual progress rail showing Branch A/B and C/D loops on screen
 - Make prep & cleaning visible: reactor ready, solvent tank ready, containers labeled, post-run clean/reset
 - Use role initials on each step: EXT, SUP, DOWN, MAINT

Process Gaps to Confirm With Team

- Exact owner & timing for tank cleaning, solvent loading, reactor readiness
- Whether -40 °F is a hard stop or supervisor-overrideable warning
- Whether Slack evidence remains required or app photo replaces it
- Whether wet HTE/THCA require container labels, tare weights, photos, or supervisor sign-off
- Whether "run complete" = booth shutdown complete or output pour complete

END-TO-END PROCESS SUMMARY · 34 Steps · 3 Decision Gates · 4 Operational Phases

BIOMASS LOT IN

CHARGE & SETUP

PRIMARY EXTRACTION

FLUSH CYCLE

FLOW DECISION

FINAL PURGE

CLARITY DECISION

SHUTDOWN CHECKLIST

WET OUTPUT POUR

CONFIRM OUTPUTS

CLEAN & RESET

APP CHECKPOINT BUTTONS · Key Operator Actions Captured in the Extraction App

Confirm Vacuum Down	Record Solvent Charge	Start Primary Soak	Start / Stop Mixer	Confirm Filter Clear	Start Pressurization
Begin Recovery	Begin Flush Cycle	Record Flush Solvent	Start / Stop Flush	Confirm Flow Resumed	Start Final Purge
Stop Final Purge	Confirm Final Clarity	Mark Run Complete	Start Post-Extraction	Confirm Initial Outputs	

CRITICAL CONTROLS — Prerequisites, Measurements & Safety-Sensitive Decisions

Lot Readiness Check

Correct lot, available weight, charge eligibility confirmed before proceeding

Vacuum Down

Must be confirmed before any solvent charge — no exceptions

Solvent Chiller Temp

Must be at or below -40 °F before flush solvent charge

Basket Filter Clear

Must be confirmed before nitrogen pressurization begins

Shutdown Checklist

All 4 items (recovery inlets, pump-down, nitrogen, dewax) before run complete

Dual Wet Weights

Both Wet HTE and Wet THCA grams required before output confirmation

Operational training map inferred from extraction app workflow, run progression state machine, and SOP alignment notes.

This infographic is NOT a replacement for the approved safety SOP, equipment manuals, or state compliance requirements.