



Introduction to Repair Tools



维修工具介绍



Tool	Quantity
T6 Torx Screwdriver	1
Hexagonal Socket Screwdriver 1.5	1
Hexagonal Socket Screwdriver 2.0	1
Hexagonal Socket Screwdriver 2.5	1
Hexagonal Socket Screwdriver 3.0	1
Tweezers	1
Hexagonal Socket Wrench 7.0	1
Wire Cutters	1
Needle-nose Pliers	1
Tin Soldering 1.0 mm	1

Note:

- 1.The screws at diagonal position need to be secured first.
- 2.When securing the screw, keep the screwdriver in a vertical position.



Hexagonal Socket Screwdriver



Tin Soldering 1.0 mm



Tweezers



Wire Cutters



Hexagonal Socket Wrench



Torx Screwdriver

Soldering Iron Maintenance:

1. Before use: Set the electronic soldering iron's temperature to a suitable value for soldering.
2. When in use: First clean the soldering surface and cover the soldering tin. If the soldering surface is soldered with too much tin, do not directly knock off the solder or knock on the edge of the dross box to make the excess tin fall off. The former is a risk to personal safety while the latter can cause equipment damage.
3. After use: Clean the soldering surface, cover the soldering tin and turn off the power.
4. Equipment finishing: Clean the soldering station and put the soldering iron back in place.

Note: Wear a mask during the soldering process


Soldering Method and Notices

1. Use a wet sponge to clean the soldering iron's soldering surface, and add soldering tin to the surface to prevent it from being oxidized due to high temperature.
2. Desolder the soldering spot and remove the cable after the soldering spot is melted; the operation time should be no more than 3 seconds.



Soldering Method and Notices


3. Use a wet sponge to clean the tip and gently scrape off the tin on the soldering spot.
4. Repeat step 3 several times. When the tin on the soldering iron is cleaned up, clean the soldering spot with the cleaner.

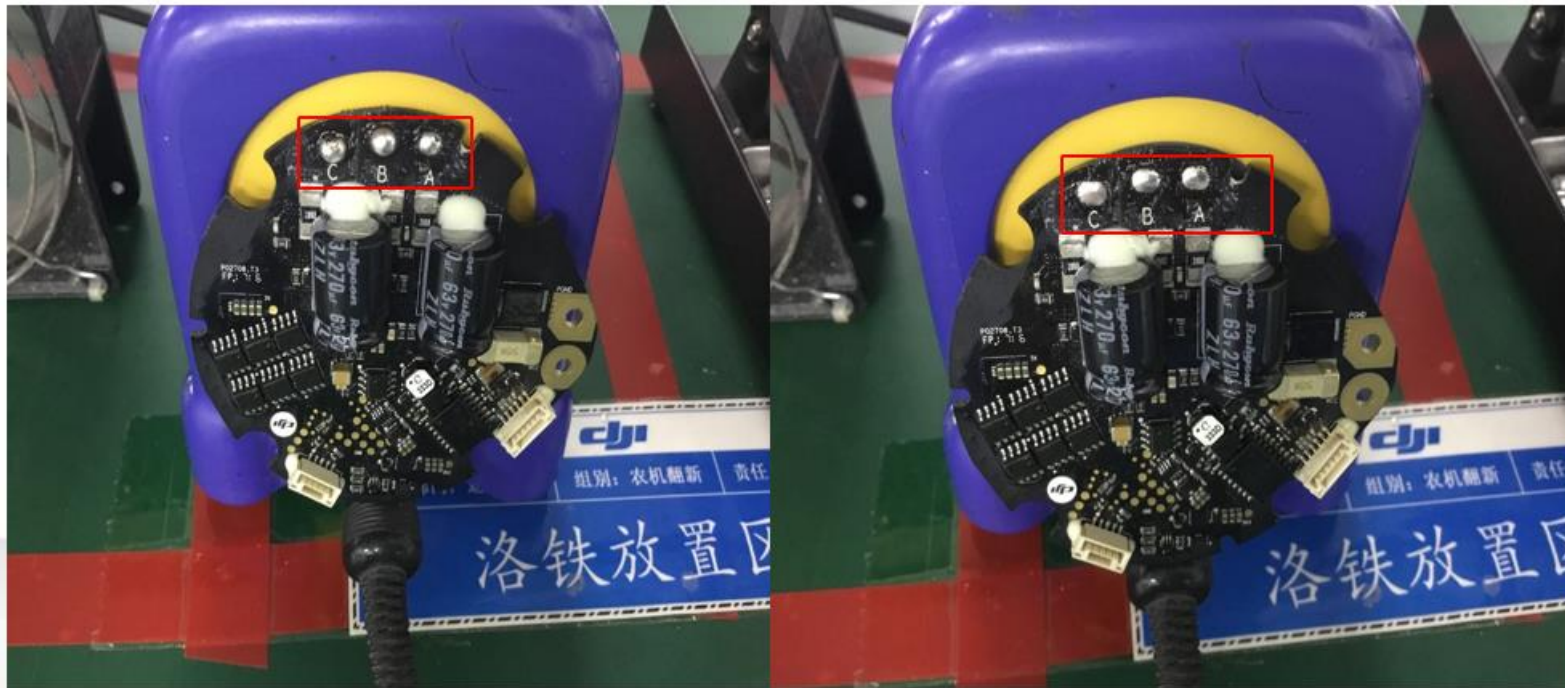

Note: The tin on the soldering joints were not cleaned as shown in figure 1, while in figure 2 the tin was cleaned.


Soldering Method and Notices

5. Place the tin wire on the soldering spot using your left hand, hold the soldering iron with your right hand and melt the tin wire on the solder joint, and fill the tin wire on the pad. The whole process cannot exceed 3 seconds, and make sure that the soldering joints on the pad is smooth and complete.

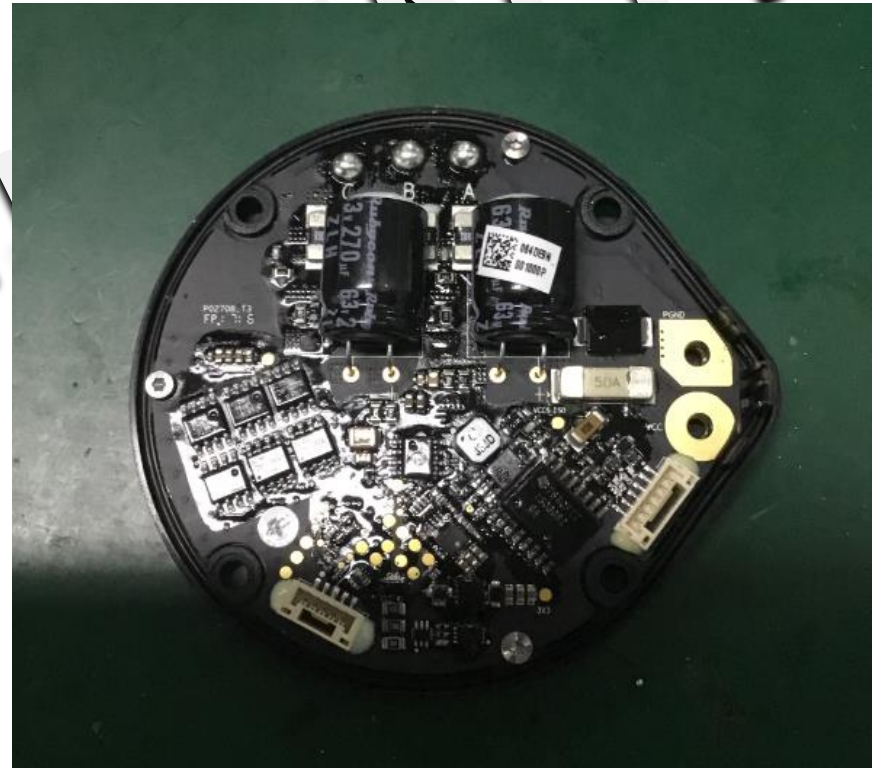



Soldering Method and Notices

6. Arrange the cables with your left hand and place it on the solder spot at an angle of about 45 degrees to the circuit board. Hold the soldering iron with your right hand and melt the soldering spot. When the soldering spot becomes liquid, directly insert the cables into the soldering spot and keep the soldering iron far away from the soldering spot. The whole process should not exceed 5 seconds. After the soldering spot is solidified, the soldering is completed. Check whether the soldering spot is smooth and complete. Pay attention to the motor cables sequence during the soldering: CCW (A-red, B-black, C-blue), CW (A-Red, B-Blue, C-Black).

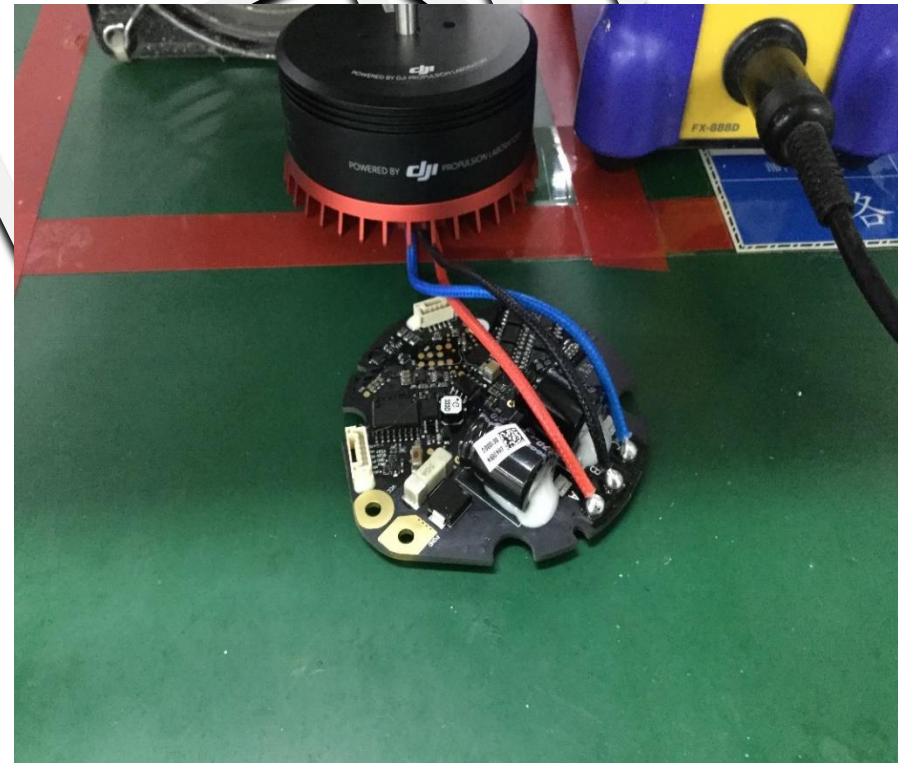

Soldering Method and Notices

7. After soldering, the solder joints should be cleaned with the cleanser. The motor cables and LED cables need to be fixed with white glue.
8. Clean the soldering surface, cover the tin and turn off the power.

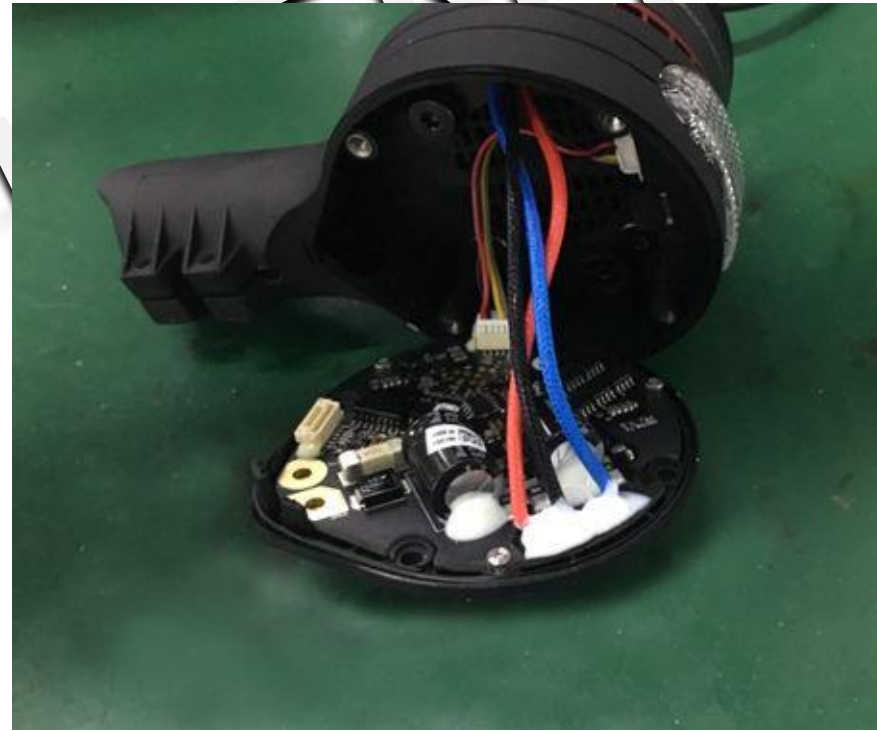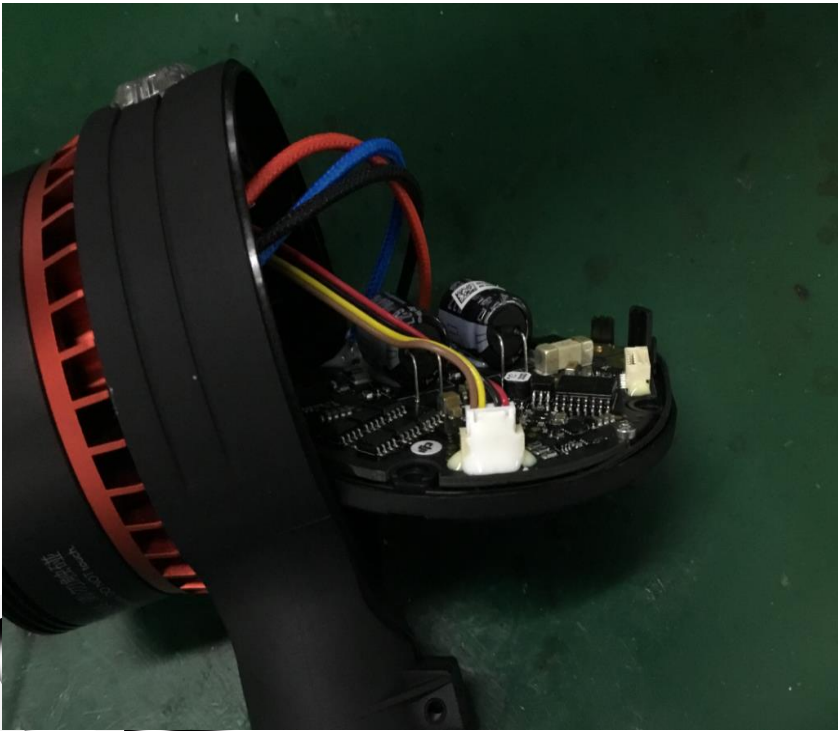



INITIAL

**THANK
YOU**

DJI