
DJI Agras --- Product Issue Troubleshooting

1.	Reattaching the dustproof ring to the control stick on the remote controller	1
2.	The DJI MG2 app prompts a “Pump Flow Calculation Error” warning, or the T20 cannot spray after taking off even though it is normal when on the ground.....	4
3.	The right dial on the T20 remote controller cannot be calibrated.....	6
4.	How to check whether the battery or aircraft is short-circuited on the T16 and T20	7
5.	The T20 remote controller cannot be powered on.....	9
6.	The T20 remote controller has cracks.....	10
7.	The screw on the supporting rod of the T20 aircraft landing gear is loose or falls off.....	11
8.	Error codes occur on the DJI Agras remote controller.	12
9.	The app prompts a “Compass disconnected” warning.....	18
10.	A “RTK board disconnected” warning is shown in the app for the T16/T20.....	19
11.	Mounting the external battery to the T20 remote controller.....	20
12.	T20 Intelligent Battery Usage Notices	21
13.	T16/T20 Intelligent Battery LED Warning Description	21
14.	Spreading System Usage Notice.....	23
15.	DJI Agras Drone Firmware Update	23
16.	Notices for Mounting T20 Aerial-Electronics System to T16.....	25
17.	Updating the T16 spray tank one-way valve to a T20 spray tank one-way valve.....	26
18.	How to identify the No.1 to No.4 electromagnetic relief valves.....	27
19.	Power Distribution Board and Battery Port Clean Notices.....	28
20.	The app prompts a warning stating that the firmware version does not match or that the firmware update failed.....	29
21.	Solution to ESC throttle cable issue	32
22.	Solution to RTK issue.....	33
23.	Solution to maximum motor speed reached issue	34
24.	Solution to the issue where there is air in the T20 aircraft pipeline, there is a large deviation with the delivery pump flow, or air cannot be discharged	35
25.	Aerial-Electronics System Module Repair Notices	38
26.	4-Channel Intelligent Battery Charger Usage and Maintenance Requirements	39
27.	DJI Agras Battery Maintenance and Storage Requirements.....	41

1. Reattaching the dustproof ring to the control stick on the remote controller

- Issue description:

As shown in the figure below, the dealer needs to attach the dustproof ring again if it is found that the dustproof ring falls off or needs to be replaced.



(a) Partially falling off


(b) Totally falling off

- Operation:

1. Remove the dustproof ring and use a dust-free cloth dipped in alcohol to clean the bonded surface of the dustproof ring, removing any residual glue, dust, or grease stains. If a new dustproof ring needs to be used, cleaning the surface where it will be attached is required.
2. Use a utility knife to clean the residual glue off from the remote controller upper cover, and then use the dust-free cloth dipped in alcohol to clean the surface where it will be attached as shown below.



3. Pull out the dustproof ring, pass it through the control stick, and attach it to the upper cover. Ensure that the dustproof ring is firmly attached to the upper cover, as shown below.

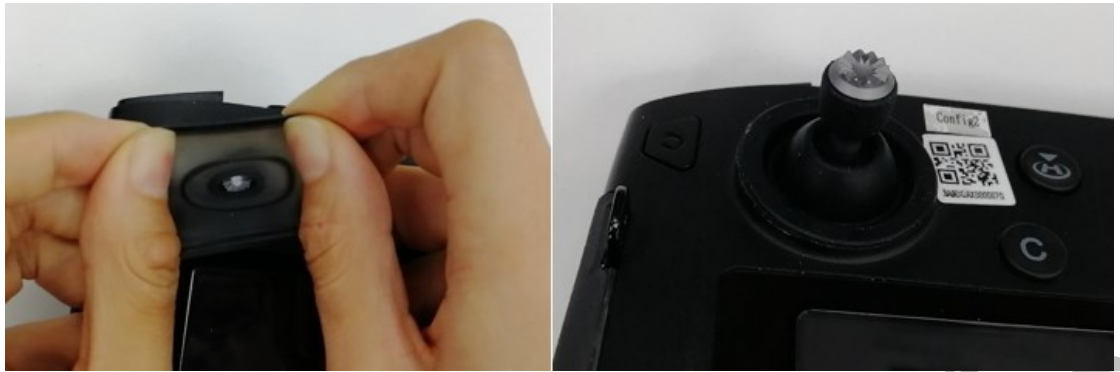

4. Apply a circle of 502 glue to the bonded position on the upper cover.



5. Use your fingers to press around the dustproof ring, and keep it pressed for 1 minute to ensure proper adhesion between the dustproof ring and the remote controller. After the pressure is maintained, let it stand for 1 hour. The appropriate pressing action is shown in the figure below.



● Notice


1. When cleaning the bonded surface of the dustproof ring and the upper cover of the remote controller, ensure that there is no debris and that the surface is level.
2. Apply the proper amount of 502 glue to the upper cover of the remote controller.
3. After the dustproof ring is attached, you need to press down on the bonded surface evenly for maintenance, or use a cylinder of the same size to press down in order to ensure that the 502 glue is properly applied. The bonding effect of the glue will be more

effective if it is left standing for 1 hour.


大疆文档 请勿外传

2. The DJI MG2 app prompts a “Pump Flow Calculation Error” warning, or the T20 cannot spray after taking off even though it is normal when on the ground.

- App warnings:

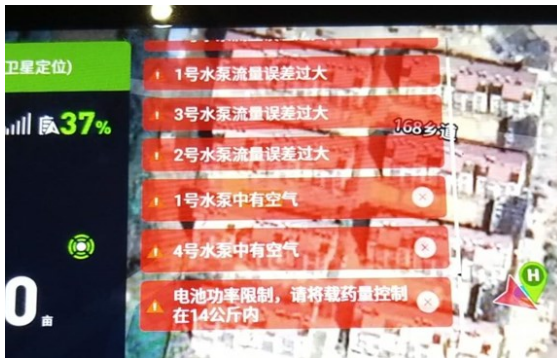

- Related product: T20
- Reason for this issue: There is air between the spray tank outlet and the nozzle
- Solution
 1. Calibrate the delivery pump and 4-channel flow meter.
 2. Check whether the hose's connector is broken.
 3. Press down firmly on the spray tank near the aircraft nose to confirm that the one-way valve is in full contact with the filter.
 4. Attach a foam piece on the spray tank near the battery to see if the situation is improved, and confirm whether the one-way valve of the spray tank is too loosely in contact with the filter due to excessive vibration in flight, which would cause air to enter the hose, as shown in the figure below. If the situation improves, promptly replace the filter.

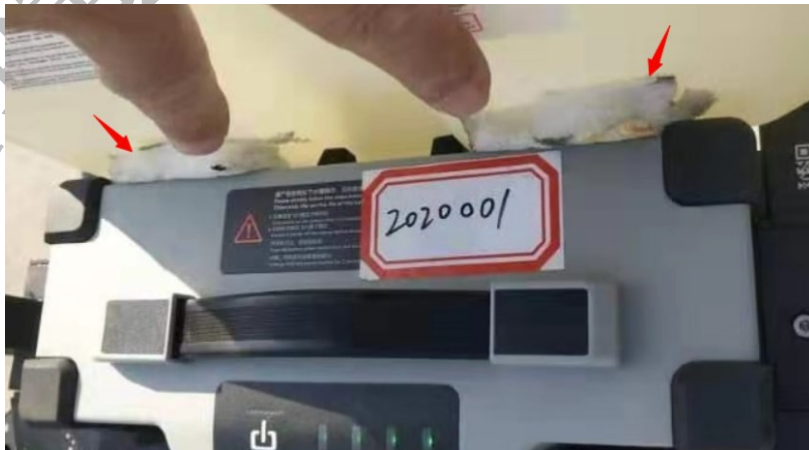

5. If the issue persists, link the remote controller with the aircraft and export the QR code of the corresponding issue, and then send it to the DJI after-sales department for further

analysis.


大疆文档 请勿外传

3. The right dial on the T20 remote controller cannot be calibrated.


- Related module: T20 remote controller
- Solution:
 - 1) Check whether the rotation of the right dial on the T20 remote controller is stuck. If so, replace the right dial module.
 - 2) Update the remote controller firmware to the latest version and recalibrate it.
 - 3) Confirm whether the remote controller has been repaired in the near future. If so, remove and insert the internal right dial cable.
 - 4) If the issue persists, contact the DJI after-sales department or send the product back for repair.

4. How to check whether the battery or aircraft is short-circuited on the T16 and T20


- Related tool: Multimeter

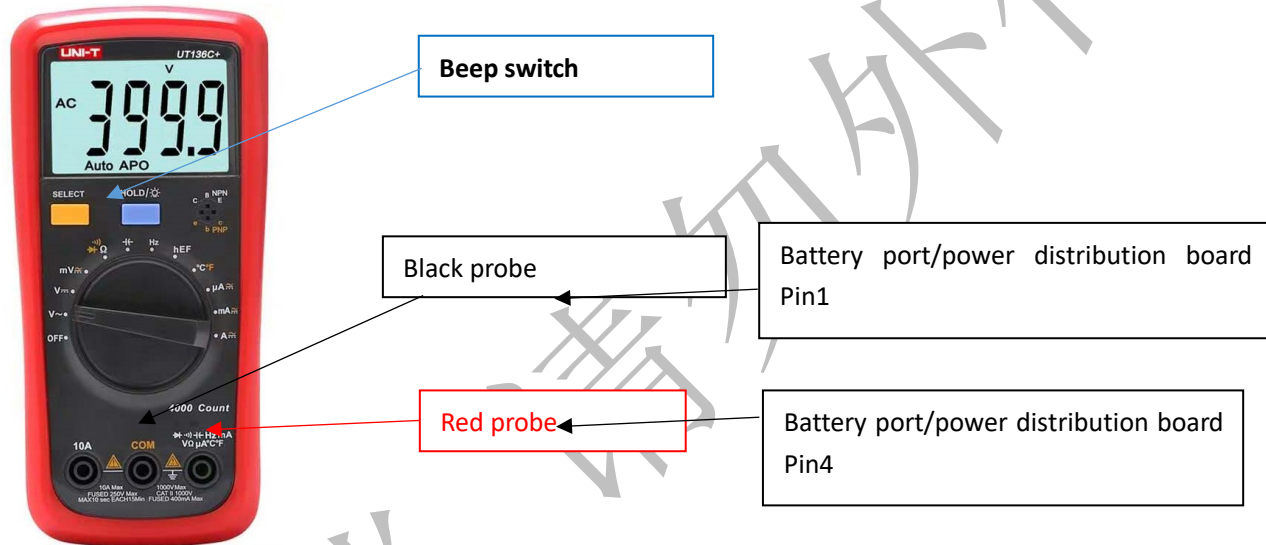

- Scenario: Powering on for the first time after aircraft crash or aircraft repair
- Test module: T16, T20, T16 battery, T20 battery
- Operation:
 1. Toggle the switch to the beep switch.
 2. Plug the black probe into COM and the red probe into VΩ, and connect the two probes to the two terminals (battery port/power distribution board Pin1 and Pin4) as shown above (Pin1 can also be measured by the red probe, and Pin4 can be measured by the black probe).
 3. We recommend measuring the terminals three times. If the multimeter beeps during one of the measurements, the aircraft or battery internal power supply system is short-circuited. In this case, the powering on test is not allowed.
 4. If the aircraft internal power supply system is short-circuited, check whether the propulsion cable is short-circuited. Check if the aircraft is water damaged, if a short circuit occurred due to hitting a high-voltage line, or if the ESC power cable is broken.
 5. If the battery internal power supply system is short-circuited, stop using it and contact the DJI after-sales department.
 6. The aircraft power distribution board and ports Pin1 and Pin4 are shown below:

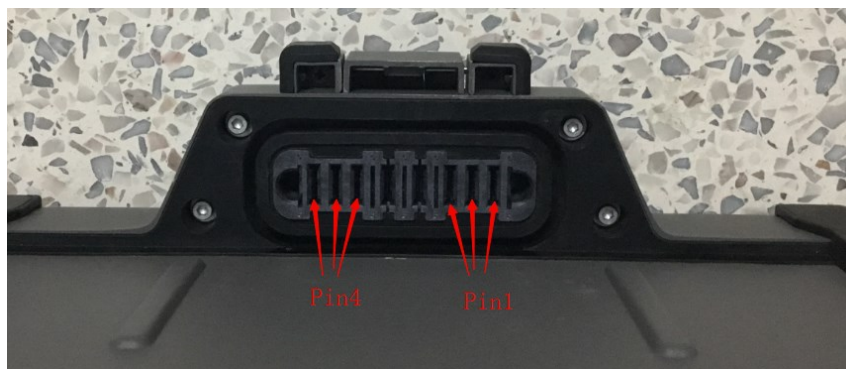

Pin1: 14S- Pin4: 14S+

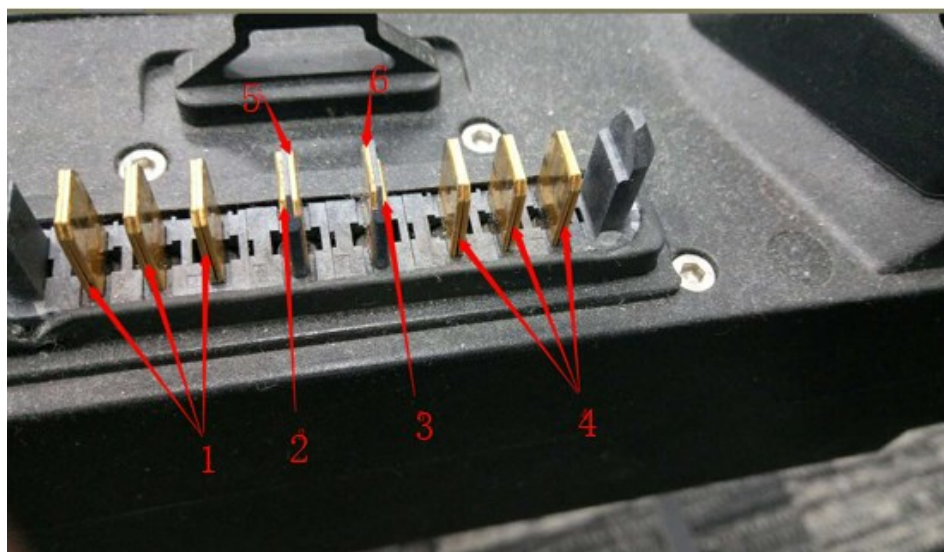

Pin1:14S- Pin2: VCC5V Pin3:VCC5V_GND Pin4:14S+ Pin5: 485A Pin6:485B

5. The T20 remote controller cannot be powered on.

- Issue: The T20 remote controller cannot be powered on when the external battery is fully charged.
- Related product: T20 remote controller
- Solution:
 1. This issue occurs because the built-in battery has run out of power. Ensure that the external battery is fully charged and mounted normally, charge the remote controller for 10 minutes, and then the issue will be fixed. After powering on and activating the device, update the remote controller firmware to the latest version.

6. The T20 remote controller has cracks.

- Picture of the issue:



- Related product: T20 remote controller
- Reason for the issue: Currently, grease is used for the edge remover when attaching the film, but the PC material of the T20 remote controller shell has poor tolerance to organic solutions, resulting in cracking of the upper shell.
- Solution: The tempered film is already attached to the current remote controller when shipped out from the factory, and no additional film is required. If a film needs to be attached again, please do not use edge remover.

7. The screw on the supporting rod of the T20 aircraft landing gear is loose or falls off.

- Related product: T20 aircraft
- Position of the screw:



- Solutions:
 1. Apply the 243 blue screw glue to the screw, and then mount and tighten the screw again.
 2. Replace it with a new screw (YC.WJ.LL000232.02), which can be purchased either through the dealer system or through contacting the regional manager. The 243 blue screw glue is required when mounting the screw.

8. Error codes occur on the DJI Agras remote controller.

- Issue: When the remote controller activation, login, or update fails, the error code shown below may occur:



- Related product: Agras remote controller
- Solution:

Error Code	Cause	Solution
101	Port signature error	Try to restart the remote controller and connect a network.
103	Data error	Try to restart the remote controller and connect a network.
104	Server connection error	Try to restart the remote controller and connect a network.
105	This service is for Agras drone owners only.	Confirm whether the account is the drone's owner, and log in to the DJI Agriculture Management Platform to check if the drone is under the account/whether the account has joined the owner's team.
401	No permission	Confirm whether the account is the drone's owner, and log in to the DJI Agriculture Management Platform to check if the drone is under the account/whether the account has joined the owner's team.
403	Operational demand rejected	Try to restart the remote controller and connect a network.

404	Unable to find the corresponding data.	Try to restart the remote controller and connect a network.
503	Third-party server error	Try to restart the remote controller and connect a network.
101003	Login status invalid	Try to connect a network and log in again.
102003	Old Agras drone does not exist	Check whether this product is shown on the DJI Agriculture Management Platform.
102004	Account doesn't match	Check whether the account input is correct.
103001	There is no Agras drone under this account.	Check whether this product is shown on the DJI Agriculture Management Platform.
104001	Unable to find the device	Try to restart the remote controller and connect a network.
104002	Not activated	Try to restart the remote controller and connect a network.
104003	Device not bounded	Try to restart the remote controller and connect a network.
104412	Save failure	Connect to the network again.
105001	Specify the type of insurance insured	Try to restart the remote controller and connect a network.
105401	The phone number is not verified. Please first complete the phone number verification.	Enter the mobile phone number again and finish the verification.
105412	The Agras drone has been activated and cannot be activated again.	Try to restart the remote controller and connect a network.
105420	dji_service error	Try to restart the remote controller and connect a network.
105421	The remote controller version does not match with the firmware version. Please update the remote controller.	Check whether the app version matches with the aircraft firmware version. Update the aircraft firmware and app version to the latest versions.
105422	Failure to obtain the aircraft model.	Restart the remote controller and activate again.
105423	The aircraft model does not match.	Restart the remote controller and activate again.
105424	The flight controller serial number does not match.	Restart the remote controller and activate again.
106001	The user is not a pilot.	Check whether the login account is correct.
106002	The user is not a team member.	Check whether the user is in the team on the DJI Agriculture Management Platform.
107002	The user is already in the team.	Check whether the user is in the team on the DJI Agriculture Management Platform. Individual members cannot be added more than once.
107003	The user does not have permission to operate.	Try to restart the remote controller and connect a network.
107004	The team does not exist.	Check whether there is a team on the DJI Agriculture Management Platform.

107005	Invitation expired	Check whether the invitation expired on the DJI Agriculture Management Platform.
107006	Invitation invalid	Check whether the invitation link is invalid on the DJI Agriculture Management Platform.
107007	The invitation does not exist.	Try to restart the remote controller and connect a network.
107008	That team name is already in use.	Check whether the name is already in use on the DJI Agriculture Management Platform.
107009	Invite other members to join the team	Log in to the DJI Agriculture Management Platform and check the "Notification" icon.
107010	The length cannot exceed 20 characters.	The length cannot exceed 20 characters.
107011	The name can only be Chinese, English, and numbers.	The name can only be Chinese, English, and numbers.
107012	The task is not complete.	The task is not complete.
108001	It is not your Agras drone.	Confirm whether the account is the drone's owner, and log in to the DJI Agriculture Management Platform to check if the drone is under the account/whether the account has joined the owner's team.
108002	The account is not a DJI account.	Check whether the account input is correct.
108004	Error	Try to restart the remote controller and connect a network.
109001	The team does not exist.	Check whether that team exists on the DJI Agriculture Management Platform.
109002	The pilot does not exist.	Check whether the pilot is in the team on the DJI Agriculture Management Platform.
109003	The user does not have permission.	Confirm whether the account is the drone's owner, and log in to the DJI Agriculture Management Platform to check if the drone is under the account/whether the account has joined the owner's team.
110001	That operation does not exist.	Try to restart the remote controller and connect a network.
110002	The operation progress is later than the data shown on the server.	Try to restart the remote controller and connect a network.
110003	The task has been completed.	Log in to the DJI Agriculture Management Platform and check the corresponding pilot list to check whether the task is complete.
111002	There is a task already in progress.	Try to restart the remote controller and connect a network.
111003	The task is not associated with the task.	Log in to the DJI Agriculture Management Platform and check the corresponding task list to add the field for operation.
111004	The team has already been disbanded.	Log in to the DJI Agriculture Management Platform and check whether that team has been disbanded.


112001	The Device UUID (Universally Unique Identifier) already exists.	Try to restart the remote controller and connect a network.
112002	The field does not exist.	Try to restart the remote controller and connect a network.
112003	Unable to operate.	Try to restart the remote controller and connect a network.
113001	Map server error	Try to restart the remote controller and connect a network.
201500	Upload failure	Confirm whether the network is normal and whether the browser is normal.
202001	The phone number format is incorrect	Enter the phone number again.
202002	The verification code is incorrect. Please try again.	Enter the phone number again and obtain the verification code.
202003	Phone number is already registered	Use another phone number to register again.
202004	The verification code is not generated or has expired. Please try to resend.	Enter the phone number again and obtain the verification code.
202404	Please enter the phone number.	Enter the phone number again.
202500	Failed to send verification code.	Try to restart the remote controller and connect a network.
203001	Code invalid	Try to restart the remote controller and connect a network.
204101	The account already exists.	Use another account to register again.
204102	The verification code is incorrect. Please try again.	Enter the phone number again and obtain the verification code.
204103	8 to 20 characters containing letters and numbers are required for the password.	Re-enter the password, making sure that the password has 8 to 20 characters.
204105	Password reset failure	Try to restart the remote controller to connect to the Internet, and confirm whether it is an email or a phone number that was used for registration.
204106	Password change failure	Try to restart the remote controller and connect a network.
204107	Wrong password, please input again.	Enter the correct password.
204108	The account is not registered or has been frozen.	Wait 30 minutes.
204109	Login fails too frequently, please try again in 5 minutes	Wait 5 minutes.
204110	Password verification failed too frequently, please try again in 5 minutes	Wait 5 minutes.
204403	Wrong user name or password	Check whether the account matches the password.
206002		The order is not accepted.

	Your order request has not been accepted and you cannot start the order	
206007	Under the current order status, the system cannot complete your operation. Please retry to load to view the latest data.	Try to restart the remote controller and connect a network.
206008	No team, unable to start taking orders	Create a team on the DJI Agriculture Management Platform.
206203	Please first complete the authentication.	Complete the authentication again on the DJI Agriculture Management Platform.
207001	The operation order cannot be cancelled.	The operation order cannot be cancelled.
207002	The order has been cancelled or is in the cancellation request stage.	The order has been cancelled or is in the cancellation request stage.
208001	Unable to update the order status.	Try to restart the remote controller and connect a network.
208002	The task is not complete.	The task is not complete.
208003	The payment amount has been set.	The payment amount has been set.
209001	Since you are not the confirmed Agras team for this order or the order has not been applied to be canceled, you have no right to agree to this cancellation request.	Since you are not the confirmed Agras team for this order or the order has not been applied to be canceled, you have no right to agree to this cancellation request.
210001	Your Agras team has already evaluated this order. It cannot be evaluated again.	Your Agras team has already evaluated this order. It cannot be evaluated again.
210002	This evaluation has already been submitted, and repeating submissions for evaluation is not allowed.	This evaluation has already been submitted, and repeating submissions for evaluation is not allowed.
211412	Unable to save the user information of the Agras team.	Try to restart the remote controller and connect a network.
212412	Unable to save the Agras drone information.	Try to restart the remote controller and connect a network.
214404	Unable to analyze the current geographic information.	Restart the remote controller and connect to the internet again.
214503	The geographic information analysis service is unavailable	Try to restart the remote controller and connect a network.
216001	The company name cannot be changed.	The company name cannot be changed.
216002	The company information change failed.	Try to restart the remote controller and connect a network.
216003	It is not allowed for the company name to contain special characters.	It is not allowed for the company name to contain special characters.

216004	The length of the company name cannot exceed 20 characters.	The length of the company name cannot exceed 20 characters.
900001	Internet connection failure	Confirm whether the network is in good condition and whether you can access the internet by opening the browser/restarting the device and reconnecting to the internet.
900002	Server error	Try to restart the remote controller and connect a network.

9. The app prompts a “Compass disconnected” warning.

- Issue Phenomenon: Warnings “Compass disconnected”, “Navigation system (IMU) error. Attitude quaternion error”, and “Navigation system (IMU) error. Filter not converged” are shown in the app.

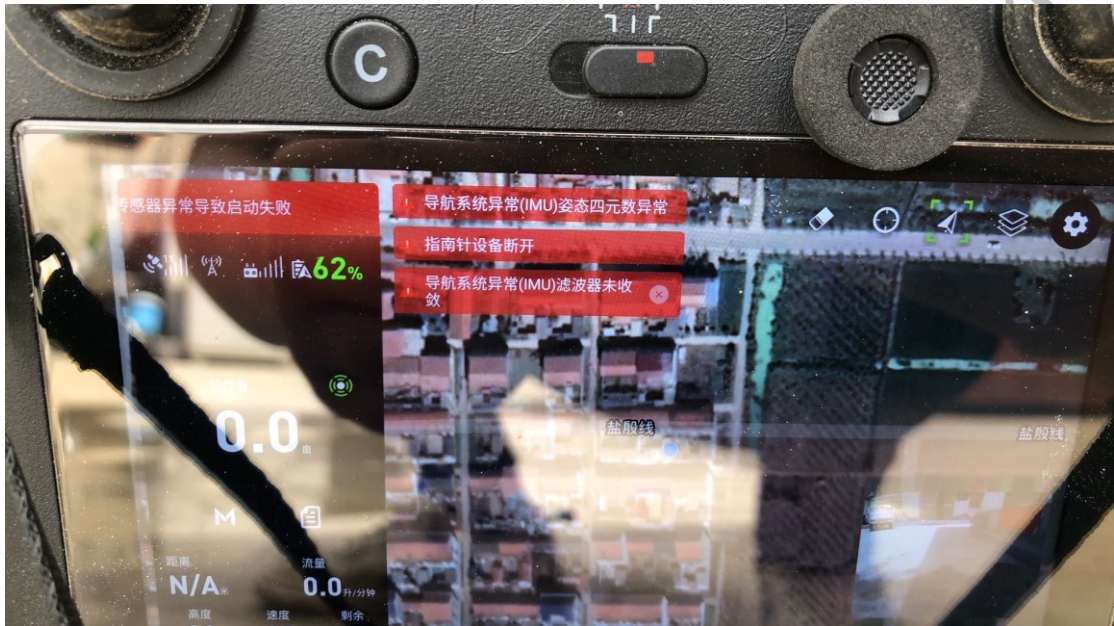

- Related product: T20
- Troubleshooting steps:
 1. If the spreading system is mounted to the aircraft, check whether the spreading system has been modified or overloaded. If yes, guide the user to use the spreading system as required under the Specifications. Note that the aircraft may crash due to unauthorized modification, which affects the product warranty service.
 2. If the spraying system is mounted to the aircraft, check that the nozzle type set in the app is the same as the nozzle which is actually used. If not, adjust the nozzle type in the app.
 3. Replace the spraying system module and update the firmware to v2.3.0223 or later.
 4. If the issue persists even after the spraying system module is replaced, link the remote controller with the aircraft and export the corresponding QR code to the DJI after-sales department.

10. A “RTK board disconnected” warning is shown in the app for the T16/T20.


- Issue phenomenon: A “RTK board disconnected” warning is shown in the app for the T16/T20.



- Related product: T16/T20
- Troubleshooting steps:
 1. The issue occurs when there is an error with the link of the RTK board inside the aerial-electronics system. In this case, replace the aerial-electronics system module and replace the serial number in the dealer system.
 2. If the issue persists even after the aerial-electronics system module is replaced, link the remote controller with the aircraft and export the corresponding QR code to the DJI after-sales department.

11. Mounting the external battery to the T20 remote controller

1. Press and hold the battery release button.
2. Insert the Intelligent Battery into the battery compartment. Ensure that the bottom of the battery is aligned with the marking line in the compartment. Otherwise, the pins on the battery port and remote controller port may become misshapen, or a short circuit may occur which could cause spontaneous combustion.
3. Push the battery to the bottom to ensure that the battery is mounted in place.
4. To remove the Intelligent Battery, press and hold the battery release button, then push the battery upward.

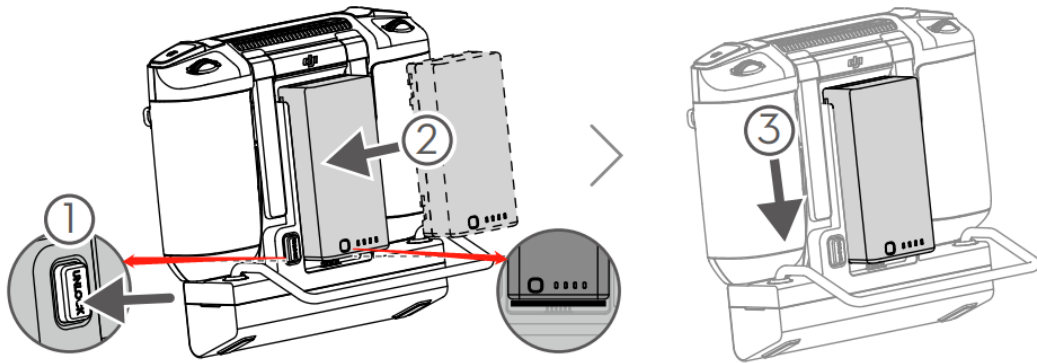

12. T20 Intelligent Battery Usage Notices

1. Check whether there is any cosmetic damage on the battery. If the battery outer shell is broken, misshapen, or has leakage, contact the DJI after-sales department. Immediately stop using the battery.
2. Check the metal contact pins between the battery and the power distribution board on the aircraft. If there is a little blackening, promptly wipe it clean with alcohol. If the blackened area is large, promptly replace the battery. The battery is not waterproof, so do not rinse it directly or soak it in water.
3. If the battery falls into water while inside an aircraft during flight, take it out immediately, and put it in a safe and open area. Keep away from the battery until the battery is completely dry. Do not use the battery again.
4. Put out any battery fire using recommended fire extinguishing equipment in the following order: water, sand, a fire blanket, dry powder, or a carbon dioxide fire extinguisher.

13. T16/T20 Intelligent Battery LED Warning Description

Battery Error LED Patterns (The LEDs near the battery power button from near to far are: LED 4, LED 3, LED 2, LED 1)	
LED 2 blinks twice per second	Overcurrent detected
LED 3 blinks twice per second	Overcharging detected
LED 3 blinks three times per second	Battery charger over-voltage
LED 4 blinks twice per second	Charging temperature is too low
LED 4 blinks three times per second	Charging temperature is too high
LED 1 and LED 4 blink	Difference between cell voltages is too large
LED 2 and LED 3 blink	Battery firmware update failure

Notices:

1. If any of the above issues occur, contact the DJI after-sales department.
2. Entering transportation mode on the battery: Press and hold the battery power button for 30 seconds to enter it into transportation mode. Short press and then press and hold again to exit the transportation mode. If the battery cannot be shut down and the LEDs are in blinking in sequence, you can also press and hold the battery power button for 30 seconds to power off the battery.

大疆文档 请勿外传

14. Spreading System Usage Notice

1. Add the spread tank load based on the actual load required under the Specifications. We do not recommend modifying the spread tank. Otherwise, an overload may cause flight accidents. If damage to a spreading system which has been modified without authorization is caused by a reliability and compatibility issue (and is not a product issue), the product warranty service will not be provided.
2. According to the length of the flight route, the principle of nearby feeding is adopted to ensure that there is liquid remaining in the spread tank when approaching the endurance point, so as to reduce the flying distance of the endurance point when the tank is empty, improving the overall operation efficiency.
3. If soaked seeds are used when planting, dry them to ensure that there is no adhesion between the seeds.
4. When fertilizing, clean out the remaining fertilizer and any dust as soon as the operation is complete in order to avoid moisture absorption, which may damage the spreading system.

15. DJI Agras Drone Firmware Update

	T20	T16	MG-1P (RTK)	MG-1S Advanced	MG-1S (RTK)	MG-1
Aircraft	Unable to update the firmware via DJI Assistant 2 for MG	Update the firmware via DJI Assistant 2 for MG		Update the firmware via DJI Assistant 2 for MG	Update the firmware via DJI Assistant 2 for MG	DJI Assistant 2 for MG v1.8 used for updating the main controller and battery; DJI Assistant 2 used for air system update.
	Unable to update the firmware with the remote controller via Wi-Fi	Update the firmware via the remote controller with a cable connection				
	Update the firmware via the remote controller via Wi-Fi					
Remote Controller	Update the firmware via DJI Assistant 2 for MG			Update the firmware	Update the	

	Update the firmware via SD card	via DJI Assistant 2 for MG	firmware via SD card	Using DJI GO for firmware updates
	Update the firmware via the app	Update the firmware via SD card		
App version update	Connect the remote controller to the internet.			The app is not required.
Note: - For v02.01.0012 or later, the T16 remote controller firmware cannot be updated via DJI Assistant 2. (Avoid the issue where the customer may update the firmware to a wrong aircraft model). For v02.01.0012 or earlier, DJI Assistant 2 can be used. - For v02.01.0012 or later, T16 and MG-1P aircraft firmware cannot be updated via DJI Assistant 2. For v02.01.0012 or earlier, DJI Assistant 2 can be used. - For some MG-1S Advanced remote controllers, the firmware list cannot be shown in DJI Assistant 2 v2.0.16 or later. The firmware package v02.01.0000 for SD cards has been released on DJI's website.				

16. Notices for Mounting T20 Aerial-Electronics System to T16

- After mounting the T20 Aerial-Electronics System to a T16 aircraft and updating the firmware to the latest version, if the T16 aircraft firmware is v02.01.0312 or lower, the app interface of the T16 remote controller will show the new app interface. But there are differences between the new app interface and the old one. Inform the customer of this information before mounting a T20 aerial-electronics system to a T16 aircraft.
- Old T16 app interface: The parameters settings are shown at the top of the screen (v02.01.0312 or lower).



- New 16 app interface: The parameters settings are shown at the left of the screen (v02.03.xxx).




17. Updating the T16 spray tank one-way valve to a T20 spray tank one-way valve

- Issue: The new T16 spray tank uses a T20 spray tank one-way valve. To use the spray tank on a T16 aircraft, the spray tank nozzle bracket and one-way valve frame base on the T16 need to be replaced with the spray tank base plug port (round ridged base) and the bottom base of the plug port.

T16		T20	
Material Number	Material Name	Material Number	Material Name
BC.AG.SS000149.01	T16 Spray Tank One-way Valve	BC.AG.SS000306.01	T20 spray tank one-way valve
YC.SJ.WS002441.03	Spray Tank One-way Valve Mounting Base	YC.SJ.WS002441.05	Spray Tank One-way Valve Mounting Base
YC.SJ.WS002438.04	Spray Tank_One-way Valve Frame Base	YC.JG.ZS000027.03	T20 Spray Tank Base Plug Port (Round Ridged Base)
YC.SJ.WS002494.02	Aircraft_Spray Tank Nozzle Bracket	YC.JG.ZS000028.02	T20 Spray Tank Base Plug Port Bottom Base
		YC.JG.MY000011.01	Spray Tank Base Filter Sealing Ring

18. How to identify the No.1 to No.4 electromagnetic relief valves

1. The No.1 electromagnetic relief valve connects to the No.1 delivery pump, which is under the No.2 aircraft arm.
2. The No.2 electromagnetic relief valve connects to the No.2 delivery pump, which is under the No.3 aircraft arm.
3. The No.3 electromagnetic relief valve connects to the No.3 delivery pump, which is under the No.5 aircraft arm.
4. The No.4 electromagnetic relief valve connects to the No.4 delivery pump, which is under the No.6 aircraft arm.

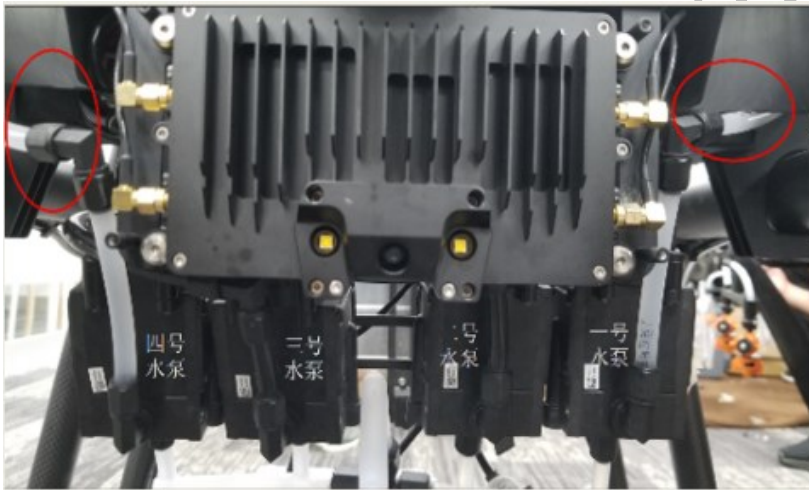

No.1 delivery pump: White hose and No.2 aircraft arm

No.2 delivery pump: Black hose and No.3 aircraft arm

No.3 delivery pump: Black hose and No.5 aircraft arm

No.4 delivery pump: White hose and No.6 aircraft arm

19. Power Distribution Board and Battery

Port Clean Notices



- **Requirements**

After operations each day, we recommend using alcohol and a dust-free cloth to clean the metal pins on the power distribution board and the battery port. Pay attention to clean off the pesticide liquid, dust, or impurities at the port. If the pins on the power distribution board are misshapen or seriously worn, replace the power distribution board as soon as possible.

- **Reason for cleaning**

Remaining pesticide liquid or dust on the power distribution board will increase the contact resistance of the battery port or damage the functionality of the power distribution board, which will cause the power distribution board or the battery port to heat up, which may then cause an aircraft malfunction or crash.

- **Photo of the issue:**

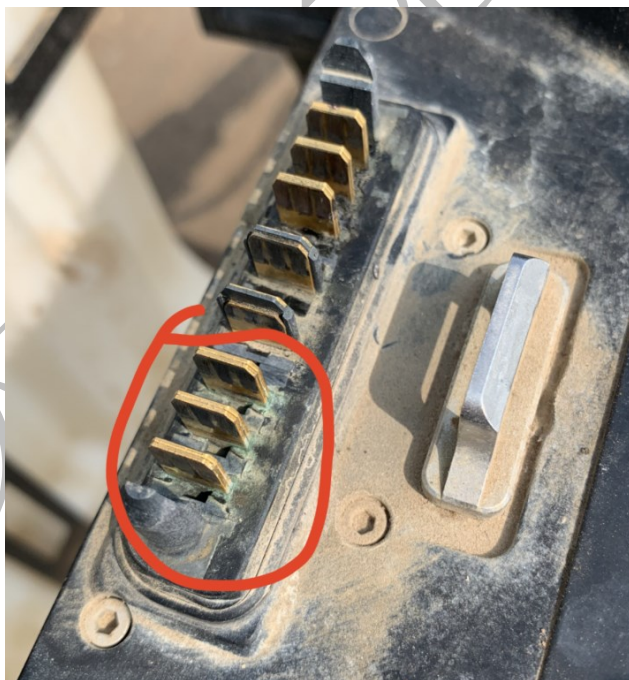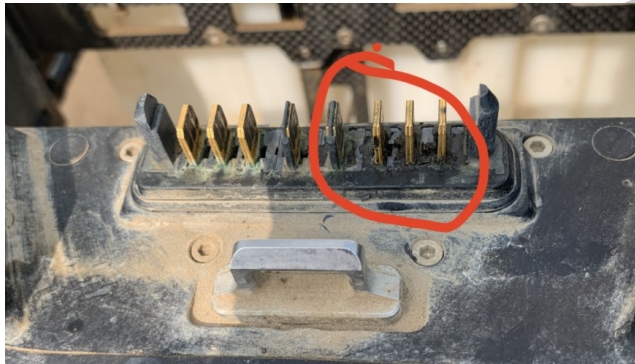

20. The app prompts a warning stating that the firmware version does not match or that the firmware update failed.

If the app prompts a warning stating that the firmware version does not match, update the firmware again following the on-screen instructions.

This issue is mostly caused by a battery firmware mismatch. An aircraft has multiple batteries. After the aircraft firmware is updated, some of the batteries have not yet been updated, resulting in a version mismatch.

If the issue persists after trying to update several times, perform the following:

1. Tap the drone icon at the top of the screen.



2. Tap the aircraft version or remote controller version 10 times continuously. (It depends on which firmware version is inconsistent.)



- The firmware version of each module will be shown, and then compare the two firmware versions.



4.

- 1) If the version of the configuration file is the same as the real version, there is no actual error, and the warning is wrongly reported.
- 2) If the version of the configuration file is lower than the real version, the remote controller did not obtain the latest version on the server in time, but it can be used normally. Repeatedly power on and off the remote controller and connect to the network again (about 3~5 times), and the remote controller will automatically obtain the correct version of the server for firmware matching, and the issue will then be fixed.
- 3) If the versions are different and the issue cannot be fixed after updating the firmware several times, check whether the corresponding hardware of the firmware version is abnormal.
- 4) If the real version is empty or shown as "NULL", there is an error with the hardware. Check the picture below to locate the issue, and then replace the corresponding module and try updating again.

英文	对应模块	小包显示的APP英文	备注
FC APP	飞控	FC_xxxx	
Radar	雷达数字板	RADAR_RC3_xxxx	
Radar WL Gnd	雷达TX板	RADAR_RC1_xxxx	
Radar Esc	雷达电调	RADAR_RC0_xxxx	
RTK Mobile	RTK模块	D_RTK7	
ESC 0、1、2、3、4、5	动力电调	ESCx_xxxx	
Center Board	中心板	RTK_CB_xxxx	T系列为喷洒板
Water Manometer	流量计	Spreader_CON_xxxx	
Sower	播撒机主板	Spreader_xxxx	没有安装播撒机时，此模块显示为 null
Sower Esc	播撒机电调	PUMP_ESC7	没有安装播撒机时，此模块显示为 null
Pump Esc0、1、2、3	水泵电调	PUMP_ESC0、1、2、3或者300x	安装播撒机时，此模块显示为 null
Battery	主电池	BAT_xxxx	
Bak Battery 601	备用电池 扩展模块	507	日本版T系列飞机才有

- 5) If the configuration file version is empty or shown as "NULL", the remote controller is not connected to the server. Connect the remote controller to the network and power it on and off several times to obtain the correct version. The warnings on the app can be ignored.
- 6) If the issue persists, link the remote controller with the aircraft and export the QR code of the corresponding issue, and then send it to the DJI after-sales department.

21. Solution to ESC throttle cable issue

- Related product: T16, T20
- Cause: The motor backup throttle warning shown in the app is caused by an error with the throttle information transmission. The link of the throttle information transmission is as shown below: Motor - ESC (powered by the distribution board) - ESC cable - spraying board - cable - aerial-electronics board
- Troubleshooting steps:
 1. Check whether the aircraft arm and ESC cable are broken, whether the motor cannot rotate smoothly, and whether the ESC is water damaged. Then replace the corresponding damaged module.
 2. After replacement, check the location of the ESC based on the app warnings.
 3. If there is only one ESC error, check the link as follows: motor - ESC - ESC cable - spraying board to see if the connection is poor or the module is moldy. Then replace the motor-ESC-ESC cable one by one for testing.
 4. If the issue persists, check the link as follows: spraying board – cable - aerial-electronics system board - power distribution board - ESC, and replace any corresponding damaged modules.
 5. If there is an error with multiple ESCs, check whether the ESC composite cable is used for T16 M126 ESCs and M345 ESCs together, or whether the ESC composite cable is used for T20 M123 ESCs and M346 ESCs together.
 6. If yes (for example, if there is an error with the T20 M123 ESCs), check the link first: M123 ESC cable - spraying board – cable - aerial-electronics system board, and replace any corresponding damaged modules.
 7. If the issue persists, check the link as follows: power distribution board - ESC and motor - ESC, and replace any corresponding damaged modules.
 8. If not, troubleshoot following step 3 and step 4.
 9. If the issue persists, link the remote controller with the aircraft and export the QR code of the corresponding issue, and then send it to the DJI after-sales department.

22. Solution to RTK issue

- Troubleshooting steps:

1. Make sure that there are no obstacles such as trees or tall buildings around the aircraft.
2. Check whether the RTK antenna port on the aerial-electronics system module has poor contact or corrosion. If so, replace the corresponding module.
3. Check the link between the RTK module, RTK feeder, and aerial-electronics system module, and replace the corresponding damaged module.
4. If the issue persists, link the remote controller with the aircraft and export the QR code of the corresponding issue, and then send it to the DJI after-sales department.


23. Solution to maximum motor speed reached issue

- Issue: The app prompts a “max motor speed reached” warning.
- Troubleshooting steps:
 1. Check whether the aircraft is flying in high-altitude areas. If the control stick is pushed too forcefully, the issue may occur. Gently push the control sticks and note that the maximum takeoff altitude is 2000 meters.
 2. Check whether the aircraft payload is overweight.
 3. Check whether the aircraft arm sleeve and spray tank are mounted firmly. If not, the issue may occur when the aircraft vibrates greatly.
 4. Check whether the limit part of the motor fixing base has been flattened. If yes, replace the motor fixing base.
 5. Check whether the propellers are broken or misshapen and whether there is any residual liquid on the propellers.
 6. If the inspection result is normal, replace all propellers and test again.
 7. If the issue persists, link the remote controller with the aircraft and export the QR code of the corresponding issue, and then send it to the DJI after-sales department.

24. Solution to the issue where there is air in the T20 aircraft pipeline, there is a large deviation with the delivery pump flow, or air cannot be discharged

Troubleshooting steps:


- 1 Calibrate the delivery pump and flow meter. If the calibration fails, replace the corresponding damaged module.
- 2 Check whether the nut on the nozzle is loose. If yes, try to reverse the sealing pad inside and install or replace it with a new one.

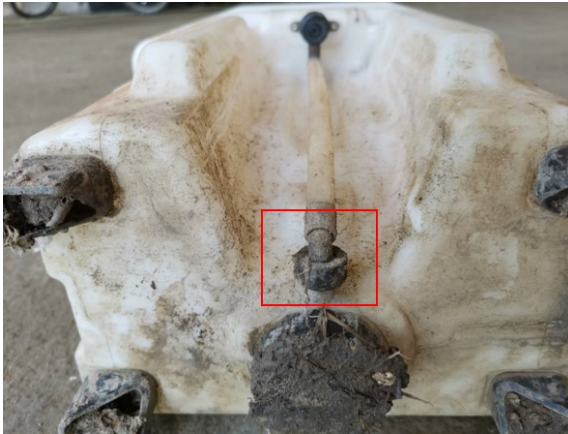

- 3 Check whether the rubber of the one-way valve is loose and whether it is connected firmly with the spray tank base plug port. If the rubber is loose, remove the sealing ring from the one-way valve cover, wrap the one-way valve cover with adhesive tape or thread seal tape, or replace the one-way valve module with a new one.



- 4 Check whether the U-type hoses are broken. If yes, replace the corresponding damaged hose.

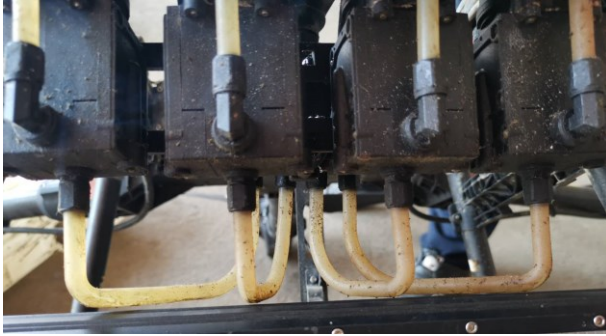

- 5 Check whether the nut between the 4-channel flow meter and spray tank base plug port is loose. If yes, replace the bottom base of the spray tank base plug port and 4-channel flow meter



- 6 Use a multimeter and toggle to ohm switch to check whether there is a short circuit in the motor shell. If the value shows OL, the motor is normal. (This indicates infinite resistance, which means that the winding and the base are open. It is normal for the winding and the base to be open.) If the value does not display OL, it means there is a short circuit inside the motor, and the corresponding motor needs to be replaced.

Normal motor



Defective motor



8. If the issue persists, link the remote controller with the aircraft and export the QR code of the corresponding issue and a screenshot of each warning, and then send them to the DJI after-


sales department.

大疆文档 请勿外传

25. Aerial-Electronics System Module Repair

Notices


1. After repair, arrange all the cables. Otherwise, the cables (especially the SDR cable) may interfere with the structure of the drone, causing damage.

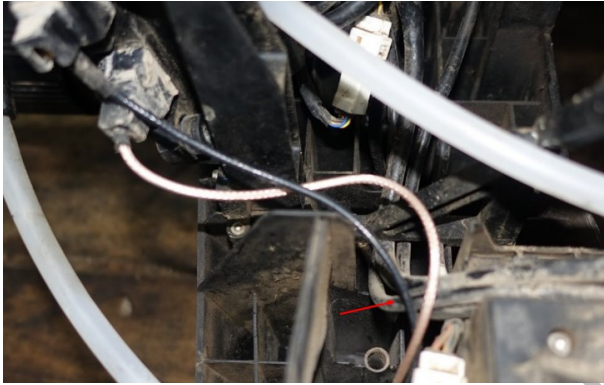

2. Irregular installation torque of the SR port between the aerial-electronics system module and the spraying module causes the sealing ring to be exposed, which affects the air tightness.

Recommended screw torque:

- a. Torque for screws securing the aerial-electronics system module cable: $2.5 \pm 0.2 \text{ kgf} \cdot \text{cm}$
- b. Torque for screws securing the spraying system module cable: $1.4 \pm 0.1 \text{ kgf} \cdot \text{cm}$

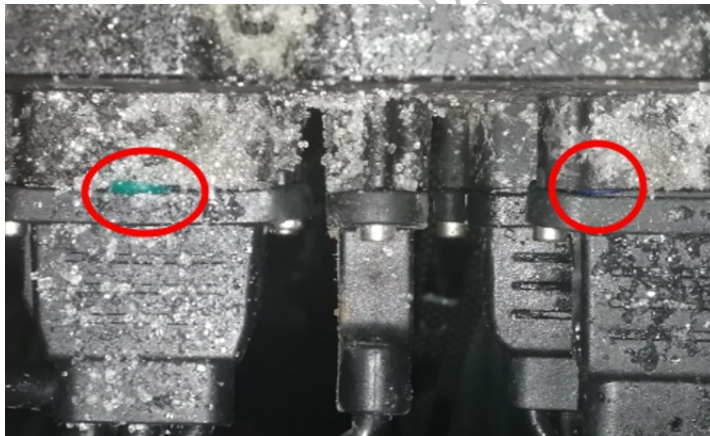

26. 4-Channel Intelligent Battery Charger

Usage and Maintenance Requirements

- **Using a generator for charging:**

1. The charger needs to be powered on after the generator is turned on to avoid large voltage fluctuations, otherwise the internal electronic parts of the charger may be damaged.
2. If you need to switch the mode button after the generator is turned on, switch the button first before connecting the charger, in order to avoid damage to the internal electronics of the charger due to large voltage incurred when switching.
3. After charging is completed, turn off the charger first, and then turn off the generator to avoid unstable voltage when the generator is powered off, otherwise the internal electronic parts of the charger may be damaged.
4. Most generators use three-phase electric power. Pay attention to the three-phase electric power cable connection.

- **Charging Notices**

1. Do not charge the charger under direct sunlight, in rain, or in a damp environment. Keep the charger away from heat, high voltage line, water, flammable gases, and corrosives.
2. When the battery charger is connected to a power outlet, the GND cable must be connected to the GND port on the battery charger. Make sure that the other end of the GND cable is on the ground.
3. In case of fire, be sure to use a dry powder fire extinguisher or sand. A liquid fire extinguisher may lead to an electrical hazard.

- **Maintenance and Storage:**

1. When the battery charger is not in use or after charging, disconnect the batteries from the battery charger and the battery charger from the power outlet, and then disconnect the AC power cable.
2. Check whether the contact pins on the battery charging cable port and adapter are have oxidation or blackening. If so, use a cotton swab and alcohol to clean the metal pins. If there is obvious signs of corrosion or deformation of the pins, replace the corresponding charging cable or adapter.
3. Check whether the charger's charging cable is broken. If yes, replace it.
4. Check whether all the buttons on the charger are functioning. If yes, or if a button is damaged, replace the corresponding button.
5. Use a clean dry towel to wipe and clean the charger cover, especially the fan metal cover behind the charger. If there is any dust, we recommend removing the fan metal cover or the charger cover and wiping it clean. If the fan blades have dust, use a soft brush to clean it.



6. When storing the charger, it is only necessary to secure the charging cable end to the clamp on the side of the battery charger.
7. The battery charger should be kept in a dry environment with a temperature range of 0°C ~45°C, and it cannot be stored under direct sunlight.

27. DJI Agras Battery Maintenance and Storage Requirements

● Storage

1. The battery storage place should be built with solid walls, Class B fire doors, explosion-proof electric appliances (if any), fire extinguishers, smoke/temperature sensors, fire-fighting sand, asbestos blankets, asbestos gloves, crucible tongs, masks, and fans. The battery can also be placed in an explosion-proof cabinet or box. Pay attention to keep the battery stored in a dry, clean, and tidy place.
2. Based on actual use patterns, a battery charging explosion-proof cabinet or battery storage explosion-proof cabinet can be used. The cabinet is divided into multiple explosion-proof boxes with customized fire panels to store the batteries separately to prevent chain explosions.
3. The batteries are not allowed to be stacked when charging. We recommend putting them in an explosion-proof box when charging. Do not squeeze a battery and power cable when the battery is placed in the explosion-proof box or explosion-proof cabinet door.
4. When placing the battery down in a location, do not put it on or let it touch metal or conductive objects, in order to prevent short circuits.
5. Do not put scrapped batteries and normal batteries in the same area.
6. Smoking and all fireworks are strictly prohibited around batteries.

● Maintenance and Storage

1. Use a clean towel to wipe the battery clean, and use a cotton swab with alcohol to clean the battery port. If the battery port is blackened out or corrosive, do not use the battery again.
2. If the battery needs be stored for a long period (more than 3 months), the battery must be placed in an environment with a temperature of $26\pm5^{\circ}\text{C}$ and a humidity of $65\pm10\%\text{RH}$, and charging is required at least once every 3 months.
3. The battery must be charged to 40%-60% during storage. At this time, the battery LED blinks as follows: LED1 and LED2 are always on (battery power: 38%~49%) or LED1 and LED2 are always on, and LED3 blinks (battery power: 50%~62%). If the battery is stored with low or high battery level, the battery may be swollen or the battery cell may become damaged.
4. We recommend using the following table for inspection every two weeks. If the battery LED does not meet the following two conditions during the inspection, the battery needs to be charged.

Battery's Serial Number		Times Charged	
Inspection Time	Battery LEDs Blinking Status (it is normal to meet one of the following)		Is charging required?
July 1 st	LED1/2 light up; LED3 blinks	LED1/2 light up	
July 15 th	LED1/2 light up; LED3 blinks	LED1/2 light up	

August 1 st	LED1/2 light up; LED3 blinks	LED1/2 light up	
August 15 th	LED1/2 light up; LED3 blinks	LED1/2 light up	

5. When removing the battery, keep your fingers clean and dry to avoid sweat and wet water from entering the battery.

- **Emergency management requirements**

1. If the electrolyte of the battery leaks or comes into contact with skin, eyes, or other parts of the body, immediately wash with clean water and go to the hospital immediately.
2. If the battery is suddenly swollen, spontaneously combusts, or explodes, first turn off the charger, stand in the safe area at the end of the battery, quickly take asbestos gloves or crucible tongs to remove the burning battery, place it on the ground, and cover it with an asbestos blanket. Then, place the fire-fighting sand over the asbestos blanket to isolate the air and suffocate it, or throw it directly into the salt water bucket. When the fire is large, it can be directly extinguished with fresh water.

Note: For T20 and T16 batteries that have been updated, press and hold the power button for 30 seconds to enter transportation mode (the battery will be shut down). Press the button once and then press and hold the button again to exit transportation mode.