



# **DJI Agras – Troubleshooting Agras Drones, Edition #4 (2021)**

|                                                                                                                                                                            |   |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---|
| 1. What should I do if the HMS prompts a warning stating that the input voltage of the management board is too low when DJI Agras generator/battery station is used? ..... | 1 |
| 2. The Agras app prompts a “Battery Module Not Recognized” warning when using T30 battery station. ....                                                                    | 2 |
| 3. Slow charging issue of the generator when used in a high altitude area.....                                                                                             | 3 |
| 4. D9000i generator charging slowly or charging failure.....                                                                                                               | 4 |
| 5. Must-Check Items of D9000i Generator for Dealers during Repair.....                                                                                                     | 6 |
| 6. How to apply glue to the cable terminal of the inverter and power module?.....                                                                                          | 8 |

# 1. What should I do if the HMS prompts a warning stating that the input voltage of the management board is too low when DJI Agras generator/battery station is used?

- Issue Description: The app prompts a warning stating that the input voltage of the management board is too low.
- Reason: The maximum battery voltage is higher than 4.35V for more than 6s. When the maximum voltage is lower than 4.15V, the prompt does not appear.


- Troubleshooting Steps:

Make sure that the generator is powered on, and then connect the T30 remote controller with the Type-C cable. If the HMS prompts the warning again, perform the following:

1. Use the multimeter to measure the output voltage of the power module. It is normal that the voltage ranges between 50V and 60V. If the voltage is lower than 50V, the power module is malfunctioning. In this case, replace the power module.
2. Use the multimeter to measure the output voltage of the power module and input voltage of the management board. Then compare with the two voltage values. If the difference is more than 30V, the cable connecting the management board and power module is malfunctioning. In this case, attach the cable again or replace the cable.
3. If the difference is less than 30V, and the output voltage of the power module ranges between 50V and 60V, it can be determined that there is an error with the input voltage of the management board. In this case, replace the management board.

## 2. The Agras app prompts a “Battery Module Not Recognized” warning when using T30 battery station.

- Issue Description: The T30 battery station is charging slowly, and the Agras app prompts a “Battery Module Not Recognized” warning.

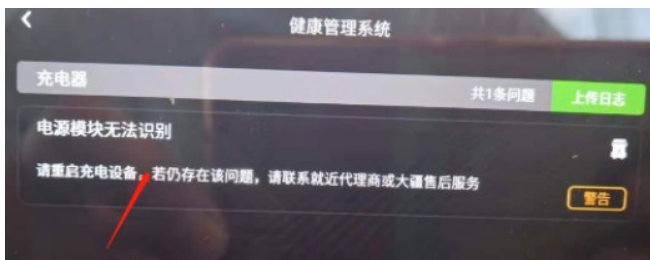


- Reason: The AC cable is attached and removed when the battery station is powered on, which may cause an app bug.
- Troubleshooting Steps:
  1. When the battery station is powered off, remove the AC cable, and wait about 5 minutes. Then attach the AC cable again and power on the battery station.
  2. If the issue persists, export the battery station log and contact DJI after-sales for analysis.

### **3. Slow charging issue of the generator when used in a high altitude area**


- Issue Description: The charging speed of the generator is slow and "gasp" sounds can be heard.
- Reason: In a high altitude area where the air is thin and the oxygen content is low, the combustion of the generator is incomplete, and the output power is unstable, causing a slow charging issue.  
  
Please note that it is a natural phenomenon and there is no error with the generator.
- Solution:
  1. Use a High Altitude Carburetor Kit to alleviate such problems.
  2. Update the generator firmware to v05.02.0334, which will lower part of the power and improve charging stability. (Charging may be 5 to 10 minutes lower than before)

## 4. D9000i generator charging slowly or charging failure

- Issue Description: The charging speed of the generator is slow or the generator cannot be used to charge.
- Reason: The cable of the inverter may be loose, there is no output from the power module, the carburetor is stuck, or the valve module is damaged.
- Troubleshooting Steps:
  1. Check whether the cable of the inverter is loose. If yes, apply the glue.

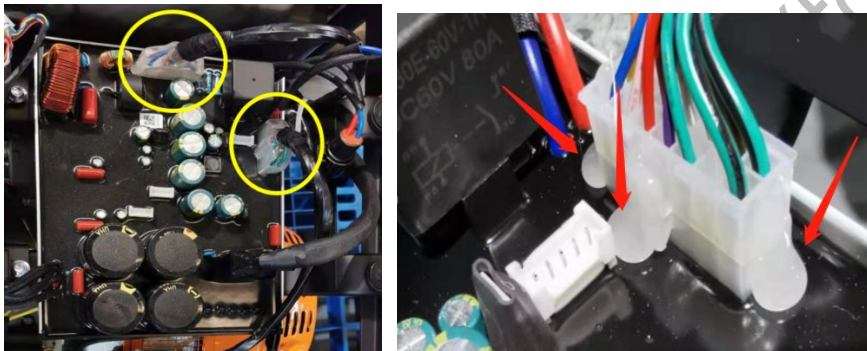

2. Check whether the cable connecting the power module and inverter is loose. If yes, apply the glue.

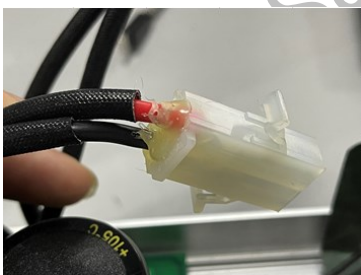



3. Clean the carburetor pipe. Or try to use a functioning carburetor to check whether the issue can be resolved.
4. Check whether the valve module is worn. If yes, replace it.



5. If the issue persists, provide the serial number of the product and video of the issue, and then contact DJI after-sales for analysis.



## 5. Must-Check Items of D9000i Generator for Dealers during Repair
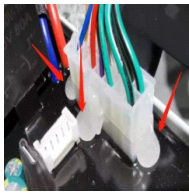
| Issue                                                                 | Possible Reason                              | Picture                                                                                                                                                                                                 | Troubleshooting                                                                                                                                               | Solution                                                                                                                                                                                  | Batches (check the sixth digit of the serial number of generator) |
|-----------------------------------------------------------------------|----------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------|
| Slow charging                                                         | The cable of the inverter is loose.          |                                      | Check whether the cable connectors marked with yellow circle on the inverter are loose. If yes, apply the glue by using hot glue gun and hot melt glue stick. | Apply the glue by using hot glue gun and hot melt glue stick as shown in the arrows. It is required to start applying glue from the upper end of the buckle until it flows to the bottom. | Before Feb 8, 2021                                                |
| Slow charging                                                         | The valve module is worn.                    |                                   | Check whether the valve module and spring base are worn. If yes, replace them together.                                                                       | Replace the valve module and spring base.                                                                                                                                                 | Before April 4, 2021                                              |
| The generator vibrates during charging or the charging speed is slow. | The cable of the step motor is disconnected. |  <p>Figure 1</p>  <p>Figure 2</p> | Check whether the glue is applied to the step motor (glue applied as shown in the figure 1; glue not applied as shown in the figure 2).                       | Replace the step motor.                                                                                                                                                                   | Before April 2, 2021                                              |


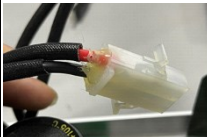
|                                   |                                         |                                                                                   |                                                                                                                                                             |                                                                                           |                        |
|-----------------------------------|-----------------------------------------|-----------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------|------------------------|
| Charging failure or slow charging | There is no input from the 4860 module. |  | Check whether the terminal between the inverter and 4860 module is applied with glue. If not, apply the glue by using hot glue gun and hot melt glue stick. | Refer to <i>How to apply glue to the cable terminal of the inverter and power module?</i> | Before August 10, 2021 |
|-----------------------------------|-----------------------------------------|-----------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------|------------------------|

## 6. How to apply glue to the cable terminal of the inverter and power module?

- Issue Description: The generator cannot be used to charge or the charging speed is slow.
- Reason: The connection of the cable terminal between the inverter and power module is poor. In this case, apply the glue.
- Tools: Hot glue gun and hot melt glue stick
- Operations:
  1. Position: Apply glue to the cable connectors between the inverter and power module as shown below.

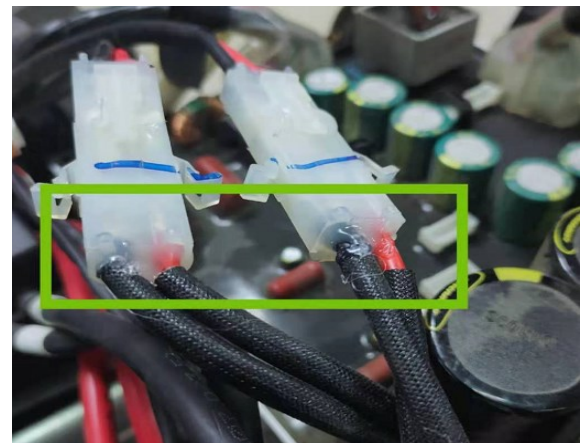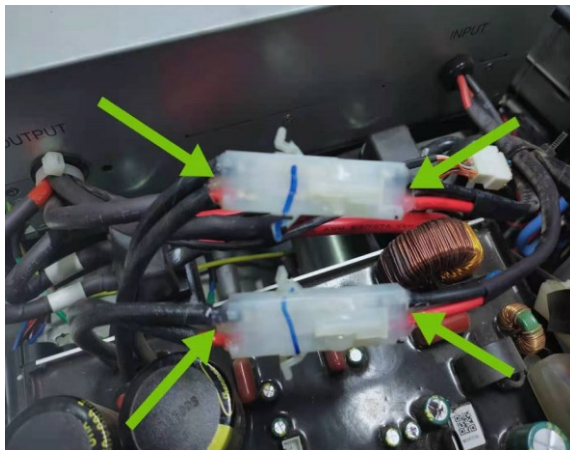

2. After the hot melt glue stick turns into molten form, apply glue to the inlet position of the DC cable. (Standard: The hot melt glue goes down along the inlet position.)
3. Inspection:
  - 1) Make sure that the corresponding inlet is sealed by the holt melt glue, as shown in arrow 1.
  - 2) Make sure that there is glue at the bottom of the core, as shown in arrow 2.
  - 3) It is not allowed to have hot melt glue enter the internal terminal, as shown in arrow 3.

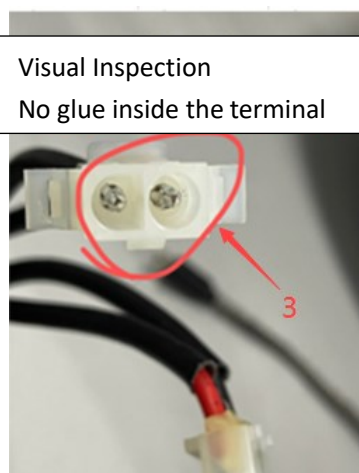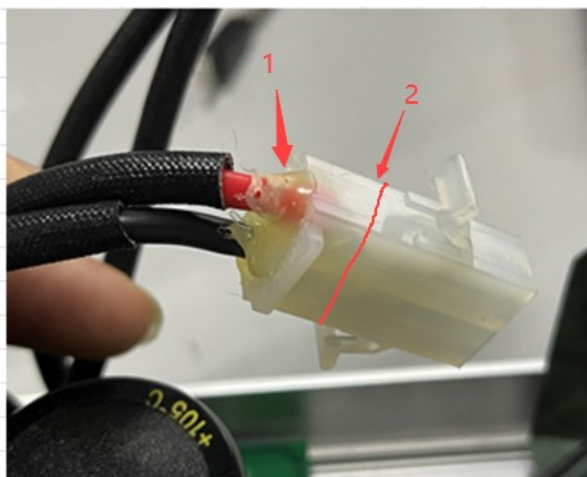

Visual Inspection  
No glue inside the terminal

DJI Agras After-Sales Documents (for Dealers)