
Hydronic Site with Hot Water Failure not resetting

The problem with the hot water failure not clearing comes from the HtClAlm folder and the inputs to the Reset block:

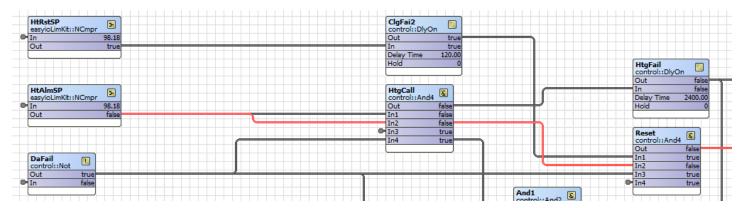

HtAlmSP will only be true if there is reason for a heat alarm, and if there is reason for a heat alarm then the controls should not reset.

The problem is the link highlighted in red which may have been modified for a water valve site.

The second input to HtgCall originally linked from Heat / And4.Out.

When that link is restored the reset functions correctly:

