

		Tesla, Inc. Service Bulletin		<i>Inspect and Replace the Hood Latch</i>	
SB-24-11-005 August 7, 2024					
Classification		Section/Group			
Campaign Bulletin		11 - Closures		Mobile Service	
				Cannot Perform	
				Configuration	
				All	
Model		Model Year		Country/Region	
Model 3		2020 - 2024		China	
Model Y		2020 - 2024			
Model S		2021 - 2024			
Model X		2021 - 2024			
				Build Location	
				Giga Shanghai, Fremont	
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.					

Campaign Bulletin: This campaign bulletin addresses a non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to the applicable vehicles.

Condition

On some vehicles, due to deformation of the two switch springs of the hood latch, the vehicle cannot accurately recognize the physical opening status of the hood, causing inability to issue a warning that the hood is not locked.

Correction

Confirm that the hood of the vehicle is closed and check the hood status displayed on the screen in this state. Replace the hood latch if necessary.

Correction Description	Correction	Time				
		2020 – 2023 Model 3	2024+ Model 3	Model Y	2021+ Model S	2021+ Model X
SB-24-11-005 Not Applicable	S012411005	0.06	0.06	0.06	0.06	0.06
Inspect Hood Latch, No Repairs Needed	S022411005	0.06	0.06	0.06	0.06	0.06
Inspect and Replace Hood Latch	S032411005	0.18	0.18	0.18	0.30	0.36

Part Number	Description	Quantity
Parts Required 1500397-00-F	HOOD LATCH DOUBLE PULL SINGLE ACTUATOR	1

This part numbers was current at the time of publication. Use the revisions listed or later, unless otherwise specified in the [Parts Catalog](#).

Procedure

1. Manually confirm that the hood is closed.
2. Check the status of the hood as shown on the touchscreen:
 - If the hood shows to be open, release the hood via the touchscreen.
 - If the hood cannot be released, discontinue this procedure, and close the Service Visit using correction code S012411005. Create another Service Visit to further inspect and repair the vehicle.
 - If the hood can be released, waiting for 10 seconds and then go to step 3.
 - If the hood shows to be closed, release the hood via the touch screen, waiting for 10 seconds, and then go to the next step.
3. Check the touchscreen for status and alerts.
 - If the hood is shown open with the alert as shown in Figure 1, discontinue this procedure and close the Service Visit using correction code S012411005.

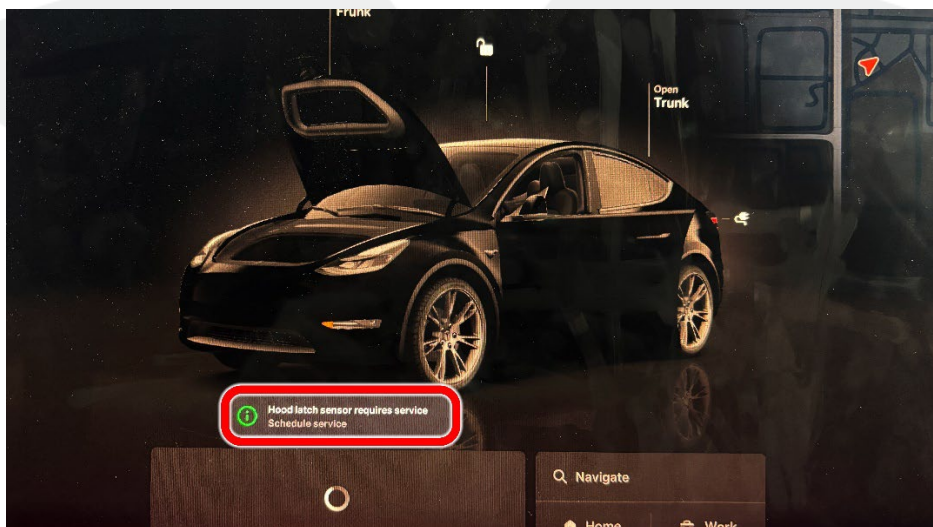


Figure 1 – Model Y shown, other models similar

 **NOTE:** If the customer wants to have the hood latch replaced, create another SV to replace the hood latch (refer to the Service Manual procedures shown below).

- [2017 – 2023 Model 3 Service Manual](#)
- [2024+ Model 3 Service Manual](#)
- [Model Y Service Manual](#)
- [2021+ Model S Service Manual](#)
- [2021+ Model X Service Manual](#)

- If the hood is shown open without any alerts, close the hood and confirm the status on the touchscreen again:
 - If the hood is still shown to be open, replace the hood latch (refer to the Service Manual procedures below) and close the Service Visit using correction code S032411005.
 - [2017 – 2023 Model 3 Service Manual](#)
 - [2024+ Model 3 Service Manual](#)
 - [Model Y Service Manual](#)
 - [2021+ Model S Service Manual](#)
 - [2021+ Model X Service Manual](#)
 - If the hood is shown closed, the system functions as intended. Close the Service Visit using correction code S022411005.

