



Operating manual Trouble shooting IRC5

Trace back information:

Workspace R17-1 version a8

Checked in 2017-03-29

Skribenta version 5.1.011

**Operating manual
Trouble shooting IRC5
RobotWare 6.05**

**Document ID: 3HAC020738-001
Revision: X**

The information in this manual is subject to change without notice and should not be construed as a commitment by ABB. ABB assumes no responsibility for any errors that may appear in this manual.

Except as may be expressly stated anywhere in this manual, nothing herein shall be construed as any kind of guarantee or warranty by ABB for losses, damages to persons or property, fitness for a specific purpose or the like.

In no event shall ABB be liable for incidental or consequential damages arising from use of this manual and products described herein.

This manual and parts thereof must not be reproduced or copied without ABB's written permission.

Keep for future reference.

Additional copies of this manual may be obtained from ABB.

Original instructions.

© Copyright 2005-2017 ABB. All rights reserved.

ABB AB, Robotics
Robotics and Motion
Se-721 68 Västerås
Sweden

Table of contents

Overview of this manual	7
1 Safety	11
1.1 Safety signals in the manual	11
1.2 Safety symbols on product labels	13
1.3 Safety during trouble shooting	19
1.4 Applicable standards	20
1.5 Safety tools	22
1.6 Safe trouble shooting	23
1.6.1 DANGER - Robot without axes' holding brakes are potentially lethal!	23
1.6.2 DANGER - Live voltage inside Drive Module!	24
1.6.3 WARNING - The unit is sensitive to ESD!	26
1.6.4 CAUTION - Hot parts may cause burns!	29
2 Introduction to trouble shooting	31
2.1 Overview of trouble shooting	31
2.2 Standard toolkit	33
2.3 Tips and tricks while trouble shooting	34
2.3.1 Trouble shooting strategies	34
2.3.2 Work systematically	36
2.3.3 Keeping track of history	37
2.4 Filing an error report	38
3 Trouble shooting by fault symptoms	41
3.1 Start-up failures	41
3.2 Controller not responding	43
3.3 Low Controller performance	44
3.4 All LEDs are off at controller	46
3.5 No voltage in service outlet	48
3.6 Problem starting the FlexPendant	50
3.7 Problem connecting FlexPendant to the controller	51
3.8 Erratic event messages on FlexPendant	52
3.9 Problem jogging the robot	53
3.10 Reflashing firmware failure	54
3.11 Inconsistent path accuracy	55
3.12 Oil and grease stains on motors and gearboxes	56
3.13 Mechanical noise	57
3.14 Manipulator crashes on power down	59
3.15 Problem releasing Robot brakes	60
3.16 Intermittent errors	62
3.17 Force starting of Boot Application	63
4 Trouble shooting by unit	65
4.1 Trouble shooting LEDs in the controller	65
4.2 Trouble shooting the FlexPendant	67
4.3 Trouble shooting communications	68
4.4 Trouble shooting fieldbuses and I/O units	69
4.5 Trouble shooting the computer unit	70
4.6 Trouble shooting the panel board	72
4.7 Trouble shooting the drive system	74
4.8 Trouble shooting the axis computer	76
4.9 Trouble shooting the system power supply	78
4.10 Trouble shooting the power distribution board	83
4.11 Trouble shooting the contactor interface board	88
4.12 Trouble shooting the customer I/O power supply	90

Table of contents

5	Trouble shooting by event log	93
5.1	Event log messages	93
5.2	How to read RAPID event log messages	94
5.3	1 xxxx	96
5.4	2 xxxx	122
5.5	3 xxxx	162
5.6	4 xxxx	217
5.7	5 xxxx	328
5.8	7 xxxx	371
5.9	9 xxxx	410
5.10	11 xxxx	452
5.11	12 xxxx	540
5.12	13 xxxx	543
5.13	15 xxxx	582
5.14	17 xxxx	583
6	Circuit diagrams	585
6.1	Circuit diagrams	585
Index		589

Overview of this manual

About this manual

This manual contains information, procedures and descriptions, for trouble shooting IRC5 based robot systems.

Usage

This manual should be used whenever robot operation is interrupted by malfunction, regardless of whether an error event log message is created or not.

Who should read this manual?

This manual is intended for the following personnel:

- Machine and robot operators qualified to perform very basic trouble shooting and reporting to service personnel.
- Programmers qualified to write and change RAPID programs.
- Specialized trouble shooting personnel, usually very experienced service personnel, qualified for methodically isolating, analyzing and correcting malfunctions within the robot system.

Prerequisites

The reader should:

- Have extensive experience in trouble shooting industrial electro-mechanical machinery.
- Have in depth knowledge of the robot system function.
- Be familiar with the actual robot installation at hand, its surrounding equipment and peripherals.

References

Reference:	Document ID
<i>Product manual - IRC5</i> IRC5 of design M2004	3HAC021313-001
<i>Product manual - IRC5</i> IRC5 of design 14	3HAC047136-001
<i>Operating manual - Emergency safety information</i>	3HAC027098-001
<i>Operating manual - General safety information</i>	3HAC031045-001
<i>Operating manual - IRC5 with FlexPendant</i>	3HAC050941-001
<i>Operating manual - RobotStudio</i>	3HAC032104-001
<i>Operating manual - Getting started, IRC5 and RobotStudio</i>	3HAC027097-001
<i>Technical reference manual - System parameters</i>	3HAC050948-001
<i>Application manual - MultiMove</i>	3HAC050961-001

The product documentation is available in several languages.

Continues on next page

Overview of this manual

Continued

Revisions

Revision	Description
-	First edition.
A	Information has been added. The document has been partly restructured.
B	Information on how to submit error report has been changed. Information on RAPID change logs have been added. Event log messages have been added.
C	Updated Event log messages.
D	Updated Event log messages.
E	Updated Event log messages.
F	Minor corrections. Updated Event log messages.
G	Minor corrections. Updated Event log messages.
H	New information in section Serial Measurement Unit regarding the battery pack. More detailed information about trouble shooting power supplies DSQC 604, 661 and 662. Removed safety I/O signals: DRV1PANCH1, DRV1PANCH2, DRV1SPEED. New drive system introduced. Drive System 04 and Drive System 09 are both described.
J	Released with RobotWare 5.13. The chapter <i>Safety</i> updated with: <ul style="list-style-type: none">Updated safety signal graphics for the levels Danger and Warning, see Safety signals in the manual on page 11.New safety labels on the manipulators, see Safety symbols on product labels on page 13.Updated the graphic in the section DANGER - Live voltage inside Drive Module! on page 24. The contents in the following sections were updated: <ul style="list-style-type: none">Corrections regarding drive system information in chapter <i>Descriptions and background information</i>.Restructured the chapters as per the new document structure.Updated the graphic in the <i>Recommended actions</i> of the section No voltage in service outlet on page 48.Updated the <i>Possible causes</i> in the section Problem starting the FlexPendant on page 50.Updated the graphics in the section <i>LEDs in the Control Module</i>.Updated the graphic in <i>Possible causes</i> of the section Problem releasing Robot brakes on page 60.
K	Updated Event log messages.
L	Released with RobotWare 5.14. Event number series on page 94 added.
M	Released with RobotWare 5.14.02. Updated Event log messages.
N	Released with RobotWare 5.15. Updated Event log messages.
P	Released with RobotWare 5.15.01. Updated the section Overview of trouble shooting on page 31 .

Continues on next page

Revision	Description
Q	<p>Released with RobotWare 5.60.</p> <ul style="list-style-type: none"> • The document has been partly restructured. • New main computer DSQC1000 is introduced. • Old main computer DSQC 639 is removed throughout the manual. • The dual controller is removed throughout the manual. • Updated Event log messages.
R	<p>Released with RobotWare 5.61.</p> <ul style="list-style-type: none"> • Added a note in the section Event number series on page 94. • Added Slovenian Event log messages. • Added the Event log message io_elogtext.xml. • Updated the name of the connectors and other minor updates in Trouble shooting the system power supply on page 78 and Trouble shooting the power distribution board on page 83.
S	<p>Released with RobotWare 6.0.</p> <ul style="list-style-type: none"> • Added information on Restarting a locked FlexPendant on page 67. • Added information on Type of event log messages on page 93. • Added the Event log message pymc_elogtext.xml.
T	<p>Released with RobotWare 6.01.</p> <ul style="list-style-type: none"> • Added the description of event log message types. See Type of event log messages on page 93. • Added a note on the possibility of a slight difference between the English event logs and translated event logs in Type of event log messages on page 93.
U	<p>Released with RobotWare 6.02.</p> <ul style="list-style-type: none"> • Added Safety tools on page 22.
V	<p>Released with RobotWare 6.03.</p> <ul style="list-style-type: none"> • Added event logs for functional safety, see 9 xxxx on page 410. • Added event logs for Remote Service Embedded (RSE), see 17 xxxx on page 583.
W	<p>Released with RobotWare 6.04.</p> <ul style="list-style-type: none"> • Updated event logs for RobotWare 6.04.
X	<p>Released with RobotWare 6.05.</p> <ul style="list-style-type: none"> • New main computer DSQC1024 is introduced. • Updated event logs for RobotWare 6.05. Added the event logs for Integrated Vision.

This page is intentionally left blank

1 Safety

1.1 Safety signals in the manual

Introduction to safety signals

This section specifies all dangers that can arise when doing the work described in the user manuals. Each danger consists of:

- A caption specifying the danger level (DANGER, WARNING, or CAUTION) and the type of danger.
- A brief description of what will happen if the operator/service personnel do not eliminate the danger.
- Instruction about how to eliminate danger to simplify doing the work.

Danger levels

The table below defines the captions specifying the danger levels used throughout this manual.

Symbol	Designation	Significance
	DANGER	Warns that an accident <i>will</i> occur if the instructions are not followed, resulting in a serious or fatal injury and/or severe damage to the product. It applies to warnings that apply to danger with, for example, contact with high voltage electrical units, explosion or fire risk, risk of poisonous gases, risk of crushing, impact, fall from height, and so on. xx0200000022
	WARNING	Warns that an accident <i>may</i> occur if the instructions are not followed that can lead to serious injury, possibly fatal, and/or great damage to the product. It applies to warnings that apply to danger with, for example, contact with high voltage electrical units, explosion or fire risk, risk of poisonous gases, risk of crushing, impact, fall from height, etc. xx0100000002
	ELECTRICAL SHOCK	Warns for electrical hazards which could result in severe personal injury or death. xx0200000024
	CAUTION	Warns that an accident <i>may</i> occur if the instructions are not followed that can result in injury and/or damage to the product. It also applies to warnings of risks that include burns, eye injury, skin injury, hearing damage, crushing or slipping, tripping, impact, fall from height, etc. Furthermore, it applies to warnings that include function requirements when fitting and removing equipment where there is a risk of damaging the product or causing a breakdown. xx0100000003
	ELECTROSTATIC DISCHARGE (ESD)	Warns for electrostatic hazards which could result in severe damage to the product. xx0200000023

Continues on next page

1 Safety

1.1 Safety signals in the manual

Continued

Symbol	Designation	Significance
 xx010000004	NOTE	Describes important facts and conditions.
 xx0100000098	TIP	Describes where to find additional information or how to do an operation in an easier way.

1.2 Safety symbols on product labels

Introduction to labels

This section describes safety symbols used on labels (stickers) on the product.

Symbols are used in combinations on the labels, describing each specific warning. The descriptions in this section are generic, the labels can contain additional information such as values.



Note

The safety and health symbols on the labels on the product must be observed. Additional safety information given by the system builder or integrator must also be observed.

Types of labels

Both the robot and the controller are marked with several safety and information labels, containing important information about the product. The information is useful for all personnel handling the robot system, for example during installation, service, or operation.

The safety labels are language independent, they only use graphics. See [Symbols on safety labels on page 13](#).

The information labels can contain information in text (English, German, and French).

Symbols on safety labels





Symbol	Description
	Warning! Warns that an accident <i>may</i> occur if the instructions are not followed that can lead to serious injury, possibly fatal, and/or great damage to the product. It applies to warnings that apply to danger with, for example, contact with high voltage electrical units, explosion or fire risk, risk of poisonous gases, risk of crushing, impact, fall from height, etc. <small>xx0900000812</small>
	Caution! Warns that an accident may occur if the instructions are not followed that can result in injury and/or damage to the product. It also applies to warnings of risks that include burns, eye injury, skin injury, hearing damage, crushing or slipping, tripping, impact, fall from height, etc. Furthermore, it applies to warnings that include function requirements when fitting and removing equipment where there is a risk of damaging the product or causing a breakdown. <small>xx0900000811</small>
	Prohibition Used in combinations with other symbols. <small>xx0900000839</small>

Continues on next page



1 Safety

1.2 Safety symbols on product labels

Continued

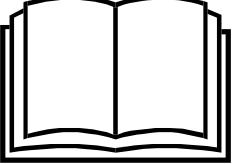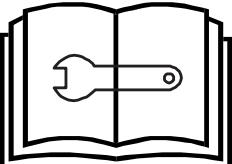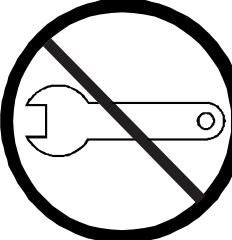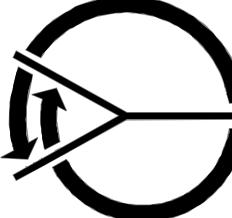Symbol	Description
 xx0900000813	See user documentation Read user documentation for details. Which manual to read is defined by the symbol: <ul style="list-style-type: none">• No text: <i>Product manual</i>.• EPS: <i>Application manual - Electronic Position Switches</i>.
 xx0900000816	Before disassemble, see product manual
 xx0900000815	Do not disassemble Disassembling this part can cause injury.
 xx0900000814	Extended rotation This axis has extended rotation (working area) compared to standard.
 xx0900000808	Brake release Pressing this button will release the brakes. This means that the robot arm can fall down.

Continues on next page



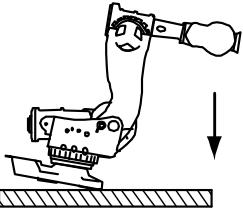
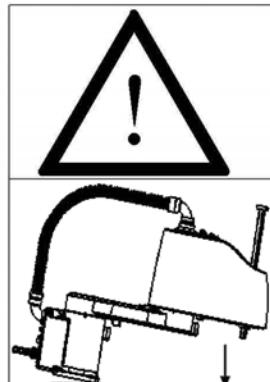
Symbol	Description
 xx0900000810	Tip risk when loosening bolts The robot can tip over if the bolts are not securely fastened.
 3HAC 057068-001	
 xx0900000817	Crush Risk of crush injuries.
 xx0900000818	Heat Risk of heat that can cause burns.

Continues on next page




1 Safety

1.2 Safety symbols on product labels

Continued

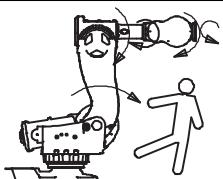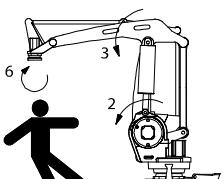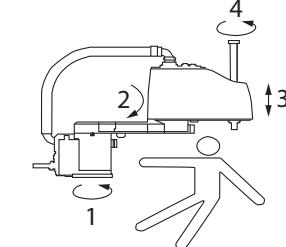Symbol	Description
 xx0900000819	Moving robot The robot can move unexpectedly.
 xx1000001141	
 xx1500002616	
 xx0900000820	Brake release buttons
 xx1000001140	
 xx0900000821	Lifting bolt

Continues on next page

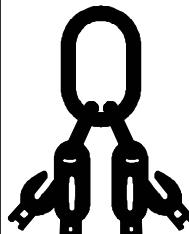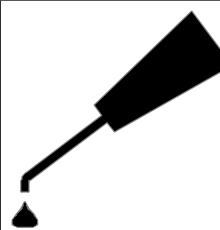
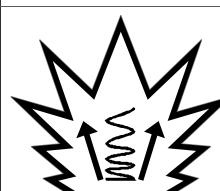
Symbol	Description
 xx1000001242	Chain sling with shortener
 xx0900000822	Lifting of robot
 xx0900000823	Oil Can be used in combination with prohibition if oil is not allowed.
 xx0900000824	Mechanical stop
 xx1000001144	No mechanical stop
 xx0900000825	Stored energy Warns that this part contains stored energy. Used in combination with <i>Do not disassemble</i> symbol.

Continues on next page

1 Safety

1.2 Safety symbols on product labels

Continued

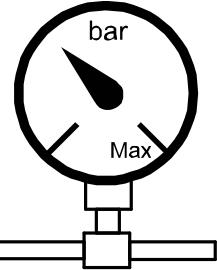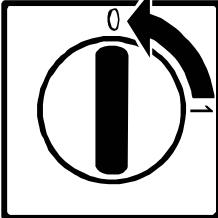Symbol	Description
 xx0900000826	Pressure Warns that this part is pressurized. Usually contains additional text with the pressure level.
 xx0900000827	Shut off with handle Use the power switch on the controller.
 xx1400002648	Do not step Warns that stepping on these parts can cause damage to the parts.

1.3 Safety during trouble shooting

General

All normal service work; installation, maintenance and repair work, is usually performed with all electrical, pneumatic and hydraulic power switched off. All manipulator movements are usually prevented by mechanical stops etc.

Trouble shooting work differs from this. While trouble shooting, all or any power may be switched on, the manipulator movement may be controlled manually from the FlexPendant, by a locally running robot program or by a PLC to which the system may be connected.

Dangers during trouble shooting

This implies that special considerations **unconditionally** must be taken when trouble shooting:

- All electrical parts must be considered as *live*.
- The manipulator must at all times be expected to perform any movement.
- Since safety circuits may be disconnected or strapped to enable normally prohibited functions, the system must be expected to perform accordingly.

1 Safety

1.4 Applicable standards

1.4 Applicable standards



Note

The listed standards are valid at the time of the release of this document. Phased out or replaced standards are removed from the list when needed.

Standards, EN ISO

The product is designed in accordance with the requirements of:

Standard	Description
EN ISO 12100	Safety of machinery - General principles for design - Risk assessment and risk reduction
EN ISO 13849-1	Safety of machinery, safety related parts of control systems - Part 1: General principles for design
EN ISO 13850	Safety of machinery - Emergency stop - Principles for design
EN ISO 10218-1	Robots for industrial environments - Safety requirements -Part 1 Robot
EN ISO 9787	Robots and robotic devices -- Coordinate systems and motion nomenclatures
EN ISO 9283	Manipulating industrial robots, performance criteria, and related test methods
EN ISO 14644-1 ⁱ	Classification of air cleanliness
EN ISO 13732-1	Ergonomics of the thermal environment - Part 1
EN IEC 61000-6-4 (option 129-1)	EMC, Generic emission
EN IEC 61000-6-2	EMC, Generic immunity
EN IEC 60974-1 ⁱⁱ	Arc welding equipment - Part 1: Welding power sources
EN IEC 60974-10 ⁱⁱ	Arc welding equipment - Part 10: EMC requirements
EN IEC 60204-1	Safety of machinery - Electrical equipment of machines - Part 1 General requirements
IEC 60529	Degrees of protection provided by enclosures (IP code)

ⁱ Only robots with protection Clean Room.

ⁱⁱ Only valid for arc welding robots. Replaces EN IEC 61000-6-4 for arc welding robots.

European standards

Standard	Description
EN 614-1	Safety of machinery - Ergonomic design principles - Part 1: Terminology and general principles
EN 574	Safety of machinery - Two-hand control devices - Functional aspects - Principles for design

Continues on next page

Other standards

Standard	Description
ANSI/RIA R15.06	Safety requirements for industrial robots and robot systems
ANSI/UL 1740	Safety standard for robots and robotic equipment
CAN/CSA Z 434-14	Industrial robots and robot Systems - General safety requirements

1 Safety

1.5 Safety tools

1.5 Safety tools

Safeguarding mechanisms

Your robot system can be equipped with a vast range of safeguards such as door interlocks, safety light curtains, safety mats, and others. The most common is the door interlock of the robot cell that temporarily stops the robot if you open it.

The controller has three separate safeguarding mechanisms, the *general mode safeguarded stop* (GS), the *automatic mode safeguarded stop* (AS) and the *superior safeguarded stop* (SS).

Safeguards connected to...	are...
the GS mechanism	always active regardless of the operating mode.
the AS mechanism	only active when the system is in automatic mode.
the SS mechanism	always active regardless of the operating mode.

Please consult your plant or cell documentation to see how your robot system is configured and where the safeguarding mechanisms are placed and how they work.

Safety supervision

The emergency stop and safeguarding mechanisms are supervised so that any failure is detected by the controller and the robot is stopped until the problem is solved.

Built-in stop functions

The controller continuously monitors hardware and software functionality. If any problems or errors are detected the robot is stopped until the problem has been solved.

If the failure is...	then...
simple and can easily be solved	a simple program stop is issued (SYSSTOP).
minor and can be solved	a SYSHALT is issued which results in a protective stop.
major, for instance concerns broken hardware	a SYSFAIL is issued which results in an emergency stop. The controller must be restarted in order to return to normal operation.

Restricting the robot's working range

The robot's working range can be restricted by means of mechanical stops or software functions, or by a combination of both.

Please consult your plant or cell documentation to see how your robot system is configured.

1.6.1 DANGER - Robot without axes' holding brakes are potentially lethal!

1.6 Safe trouble shooting

1.6.1 DANGER - Robot without axes' holding brakes are potentially lethal!

Description

Since the robot arm system is quite heavy, especially on larger robot models, it is dangerous if the holding brakes are disconnected, faulty, worn or in any way rendered non-operational.

For instance, a collapsing IRB 7600 arm system may kill or seriously injure a person standing beneath it.

Elimination

	Action	Info/illustration
1	If you suspect that the holding brakes are non-operational, secure the robot arm system by some other means before working on it.	Weight specifications etc. may be found in the <i>Product manual</i> of each robot model.
2	If you intentionally render the holding brakes non-operational by connecting an external voltage supply, the utmost care must be taken!  DANGER NEVER stand inside the robot working area when disabling the holding brakes unless the arm system is supported by some other means!  DANGER Under no circumstance stand beneath any of the robot's axes!	How to correctly connect an external voltage supply is detailed in the <i>Product manual</i> of each robot model.


1 Safety

1.6.2 DANGER - Live voltage inside Drive Module!

1.6.2 DANGER - Live voltage inside Drive Module!

Description


The Drive Module has live voltage potentially accessible directly behind the rear covers and inside the front cover, even when the main switches have been switched off.

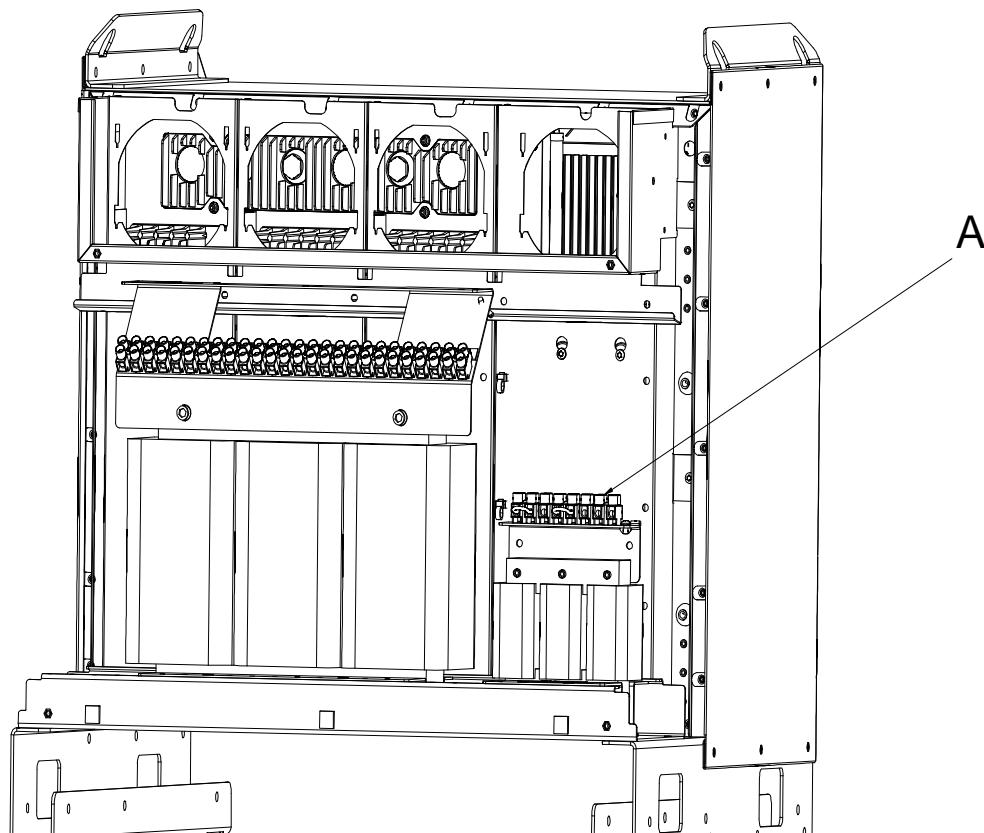

en1000000049

Continues on next page

1.6.2 DANGER - Live voltage inside Drive Module!

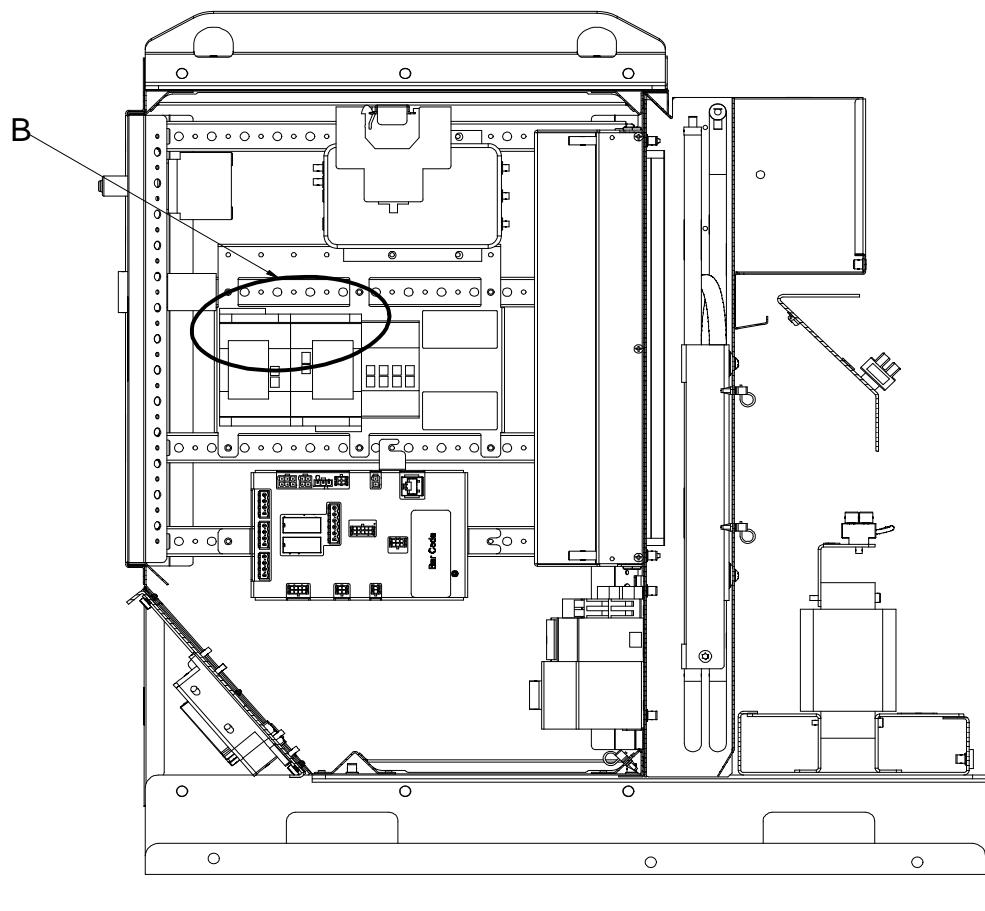Continued

en1000000050

A	Live voltage at transformer terminals even if the main power switches have been switched off.
B	Live voltage at Motors ON terminals even if the main power switches have been switched off.

Elimination

Read this information before opening the rear cover of either module.

Step	Action
1	Make sure the incoming mains power supply has been switched off.
2	Use a voltmeter to verify that there is not voltage between any of the terminals.
3	Proceed with the service work.

1 Safety

1.6.3 WARNING - The unit is sensitive to ESD!

Description

ESD (electrostatic discharge) is the transfer of electrical static charge between two bodies at different potentials, either through direct contact or through an induced electrical field. When handling parts or their containers, personnel not grounded may potentially transfer high static charges. This discharge may destroy sensitive electronics.


Elimination

Action	Note
1 Use a wrist strap.	Wrist straps must be tested frequently to ensure that they are not damaged and are operating correctly.
2 Use an ESD protective floor mat.	The mat must be grounded through a current-limiting resistor.
3 Use a dissipative table mat.	The mat should provide a controlled discharge of static voltages and must be grounded.

Location of wrist strap button

The location of the wrist strap button is shown in the following illustration.

IRC5

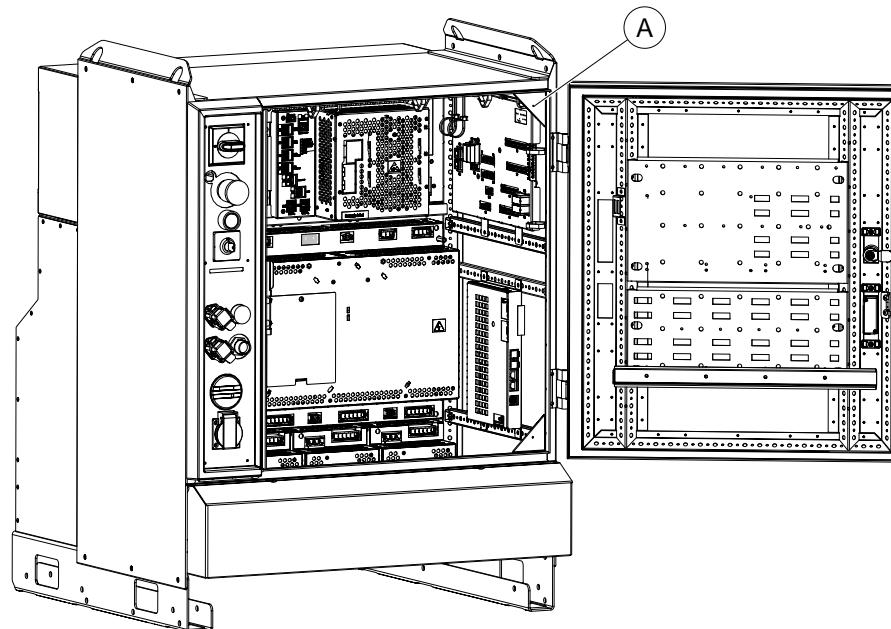

xx1300000856


A	Wrist strap button
---	--------------------

Continues on next page

1.6.3 WARNING - The unit is sensitive to ESD!

Continued

IRC5 Compact Controller

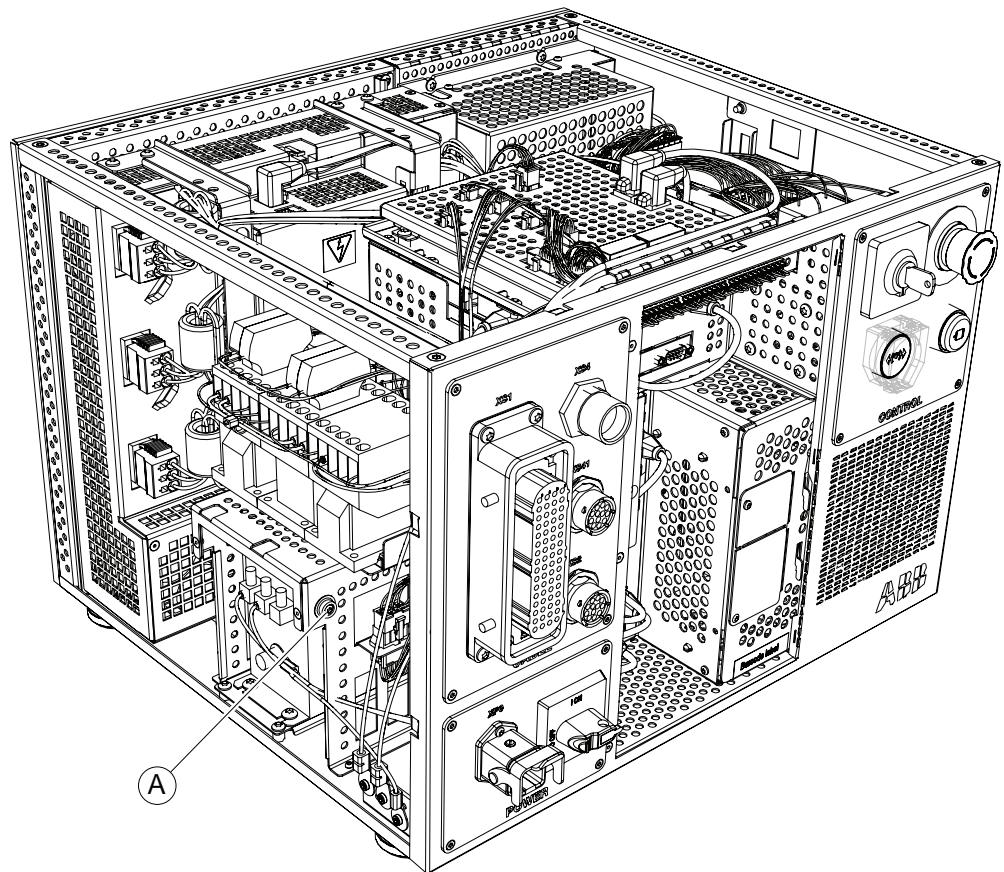

xx1400001622

A	Wrist strap button
---	--------------------


Continues on next page

1 Safety

1.6.3 WARNING - The unit is sensitive to ESD!

Continued

Panel Mounted Controller

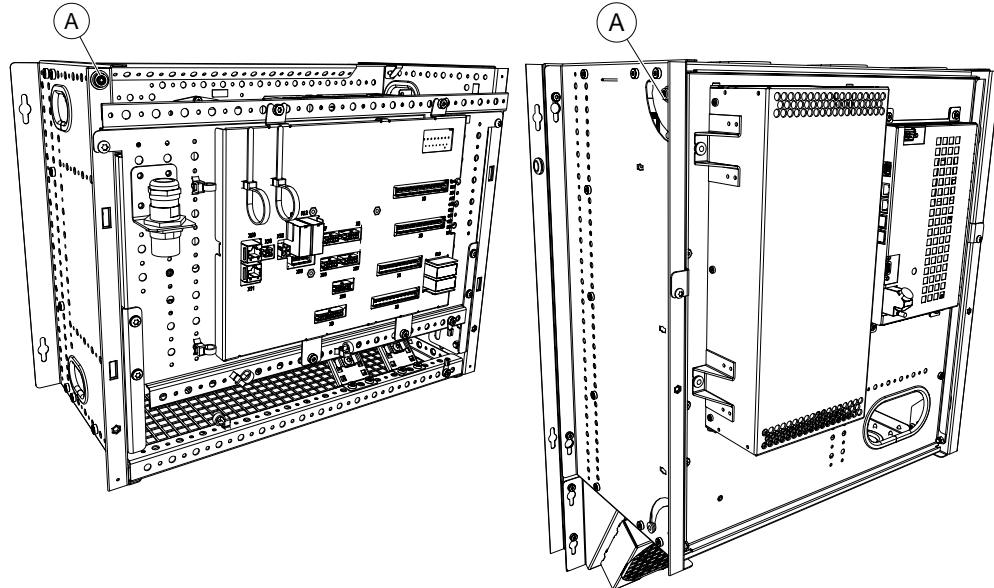

xx1300001960

A	Wrist strap button
---	--------------------

1.6.4 CAUTION - Hot parts may cause burns!

1.6.4 CAUTION - Hot parts may cause burns!**Description**

During normal operation, many robot parts become hot, especially the drive motors and gearboxes. Sometimes areas around these parts also become hot. Touching these may cause burns of various severity.

Because of a higher environment temperature, more surfaces on the robot get hot and may result in burns.

**Note**

The drive parts in the cabinet can be hot.

Elimination

The following instructions describe how to avoid the dangers specified above:

	Action	Information
1	Always use your hand, at some distance, to feel if heat is radiating from the potentially hot component before actually touching it.	
2	Wait until the potentially hot component has cooled if it is to be removed or handled in any other way.	
3	The bleeder can be hot, up to 80 degrees.	

This page is intentionally left blank

2 Introduction to trouble shooting

2.1 Overview of trouble shooting

How to use this manual when trouble shooting

The following table details how to put the information in this manual to best use during trouble shooting the robot system.

Type	Description
Troubleshooting by fault symptoms	<ul style="list-style-type: none"> Fault without event log messages Fault combinations
Troubleshooting by unit	<ul style="list-style-type: none"> FlexPendant Data communication Fieldbus and I/O units Power supply
Description and background information	<ul style="list-style-type: none"> Indications
Troubleshooting by event logs	<ul style="list-style-type: none"> How to read event log messages Event log messages

Trouble shooting manual

Troubleshooting by fault symptoms	<p>Each fault or error is first detected as a symptom, for which an error event log message may or may not be created. It could be an error event log message on the FlexPendant, an observation that the gearbox on axis 6 is getting hot or that the controller can not be started. The faults displaying an event log message are listed in the end of this manual.</p> <p>See Trouble shooting by fault symptoms on page 41.</p>
Troubleshooting by unit	<p>Describes how to troubleshoot if the following does not work correctly, for example:</p> <ul style="list-style-type: none"> FlexPendant computer unit fieldbus and I/O units power supply <p>See Trouble shooting by unit on page 65.</p>
Troubleshooting by event logs	<p>Lists all the available event log messages. These may be displayed either on the FlexPendant or using RobotStudio. Having access to all messages will be useful during trouble shooting.</p> <p>See Trouble shooting by event log on page 93.</p>

Additional information

In addition to the information given in this document, other documents may provide vital information, e.g. the Circuit Diagram.

Such useful documents are listed in the section [Circuit diagrams on page 585](#).

Read the event logs

The error event logs which may be viewed on either the FlexPendant or RobotStudio, contain lots of information about any malfunction detected by the system.

Continues on next page

2 Introduction to trouble shooting

2.1 Overview of trouble shooting

Continued

Read the circuit diagrams

The circuit diagrams contain a lot of information useful, or even essential, to a trained trouble shooter. See [Circuit diagrams on page 585](#).

Check the LEDs on the electronic units

If a fault is thought to be caused by an electronic unit (circuit board in the controller or other), the LEDs on the unit front may give leads.

2.2 Standard toolkit

General

Listed are tools required to perform the actual trouble shooting work. All tools required to perform any corrective measure, such as replacing parts, are listed in their Product Manual section respectively.

Contents, standard toolkit, IRC5

Tool	Remark
Screw driver, Torx	Tx10
Screw driver, Torx	Tx25
Ball tipped screw driver, Torx	Tx25
Screw driver, flat blade	4 mm
Screw driver, flat blade	8 mm
Screw driver, flat blade	12 mm
Screw driver	Phillips-1
Box spanner	8 mm

Contents, standard toolkit, trouble shooting

Qty	Art. no.	Tool	Rem.
-	-	Normal shop tools	Contents as specified above.
1	-	Multimeter	-
1	-	Oscilloscope	-
1	-	Recorder	-

2 Introduction to trouble shooting

2.3.1 Trouble shooting strategies

2.3 Tips and tricks while trouble shooting

2.3.1 Trouble shooting strategies

Isolate the fault!

Any fault may give rise to a number of symptoms, for which error event log messages may or may not be created. In order to effectively eliminate the fault, it is vital to distinguish the original symptom from the consequential ones.

A help in isolating the fault may be creating a historical fault log as specified in section [Make a historical fault log! on page 37](#).

Split the fault chain in two!

When trouble shooting any system, a good practice is to split the fault chain in two. This means:

- identify the complete chain.
- decide and measure the expected value at the middle of the chain.
- use this to determine in which half the fault is caused.
- split this half into two new halves, etc.
- finally, a single component may be isolated. The faulty one.

Example

A specific IRB 7600 installation has a 12 VDC power supply to a tool at the manipulator wrist. This tool does not work, and when checked, there is no 12 VDC supply to it.

- Check at the manipulator base to see if there is 12 VDC supply. Measurement show there are *no* 12 VDC supply. (Reference: Circuit Diagram in the *Product manual, IRC5*)
- Check any connector between the manipulator and the power supply in the controller. Measurement show there are *no* 12 VDC supply. (Reference: Circuit Diagram in the *Product manual, IRC5*)
- Check the power supply unit LED.

Check communication parameters and cables!

The most common causes of errors in serial communication are:

- Faulty cables (e.g. send and receive signals are mixed up)
- Transfer rates (baud rates)
- Data widths that are incorrectly set.

Check the software versions!

Make sure the RobotWare and other software run by the system are the correct version. Certain versions are not compatible with certain hardware combinations.

Also, make a note of all software versions run, since this will be useful information to the ABB support people.

Continues on next page

2 Introduction to trouble shooting

2.3.1 Trouble shooting strategies

Continued

How to file a complete error report to your local ABB service personnel is detailed in section [*Filing an error report on page 38.*](#)

2 Introduction to trouble shooting

2.3.2 Work systematically

2.3.2 Work systematically

Do not replace units randomly!

Before replacing *any part at all*, it is important to establish a probable cause for the fault, thus determining which unit to replace.

Randomly replacing units may sometimes solve the acute problem, but also leaves the trouble shooter with a number of units that may/may not be perfectly functional.

Replace one thing at a time!

When replacing a presumably faulty unit that has been isolated, it is important that **only one unit be replaced at a time**.

Always replace components as detailed in the Repairs section of the Product manual of the robot or controller at hand.

Test the system after replacing to see if the problem has been solved.

If replacing several units at once:

- it is impossible to determine which of the units was causing the fault.
- it greatly complicates ordering a new spare part.
- it may introduce new faults to the system.

Take a look around!

Often, the cause may be evident once you see it. In the area of the unit acting erroneously, be sure to check:

- Are the attachment screws secured?
- Are all connectors secured?
- Are all cabling free from damage?
- Are the units clean (especially for electronic units)?
- Is the correct unit fitted?

Check for tools left behind!

Some repair and maintenance work require using special tools to be fitted to the robot equipment. If these are left behind (e.g. balancing cylinder locking device or signal cable to a computer unit used for measuring purposes), they may cause erratic robot behavior.

Make sure all such tools are removed when maintenance work is complete!

2.3.3 Keeping track of history

Make a historical fault log!

In some cases, a particular installation may give rise to faults not encountered in others. Therefore, charting each installation may give tremendous assistance to the trouble shooter.

To facilitate trouble shooting, a log of the circumstances surrounding the fault gives the following advantages:

- it enables the trouble shooter to see patterns in causes and consequences not apparent at each individual fault occurrence
- it may point out a specific event always taking place just before the fault, for example a certain part of the work cycle being run.

Check up the history!

Make sure you always consult the historical log if it is used. Also remember to consult the operator, or similar, who was working when the problem first occurred.

At what stage did the fault occur?

What to look for during trouble shooting depends greatly of when the fault occurred: was the robot just freshly installed? Was it recently repaired?

The table gives specific hints to what to look for in specific situations:

If the system has just:	then:
been installed	Check: <ul style="list-style-type: none"> • the configuration files • connections • options and their configuration
been repaired	Check: <ul style="list-style-type: none"> • all connections to the replaced part • power supplies • that the correct part has been fitted
had a software upgrade	Check: <ul style="list-style-type: none"> • software versions • compatibilities between hardware and software • options and their configuration
been moved from one site to another (an already working robot)	Check: <ul style="list-style-type: none"> • connections • software versions

2 Introduction to trouble shooting

2.4 Filing an error report

2.4 Filing an error report

Introduction

If you require the assistance of ABB support personnel in trouble shooting your system, you may file a formal error report as detailed below.

In order for the ABB support personnel to better solve your problem, you may attach a special diagnostics file that the system generates on demand.


The diagnostics file includes:

- **Event log** A list of all system events.
- **Backup** A backup of the system taken for diagnostics purposes.
- **System information** Internal system information useful to ABB support personnel.

NOTE that it is not required to create or attach any additional files to the error report if not explicitly requested by the support personnel!

Creating the diagnostics file

The diagnostics file is created manually as detailed below.

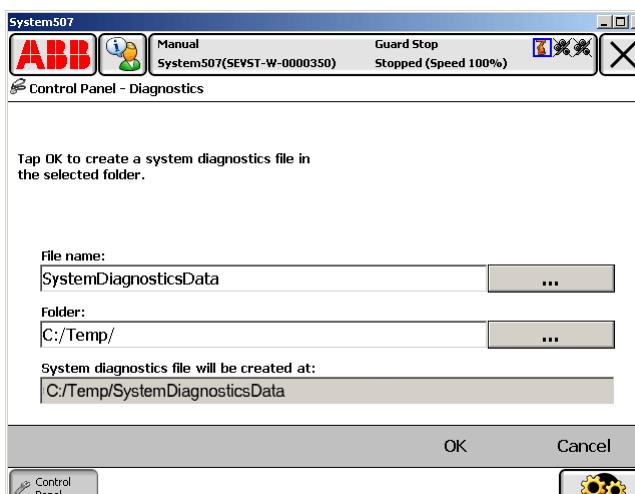	Action
1	<p>Tap ABB, then Control Panel and then Diagnostics. A display is shown:</p> 
2	<p>Specify the name you want for the diagnostics file, the save folder of it and tap OK. The default save folder is C:/Temp, but any folder may be selected, for instance an externally connected USB memory. This may take a couple of minutes, while "Creating file. Please wait!" is displayed.</p>
3	To shorten file transfer time, you may compress the data into a zip-file.

Continues on next page

Action	
4	Write a regular e-mail addressed to your local ABB support personnel, and make sure to include the following information: <ul style="list-style-type: none">• Robot serial number• RobotWare version• External options• A written fault description. The more detailed, the easier for the ABB support personnel to assist you.• if available, enclose the license key.• attach the diagnostics file!
5	Mail it!

This page is intentionally left blank

3 Trouble shooting by fault symptoms

3.1 Start-up failures

Introduction

This section describes possible faults during start-up and the recommended action for each failure.

Consequences

Problem starting the system

Symptoms and causes

The following are the possible symptoms of a start-up failure:

- LEDs not lit on any unit.
- Earth fault protection trips.
- Unable to load the system software.
- FlexPendant not responding.
- FlexPendant starts, but does not respond to any input.
- Disk containing the system software does not start correctly.

Recommended actions

The following are the recommended actions to be taken during a start-up failure:



Note

This may be due to a loss of power supply in many stages.

	Action	Info/illustration
1	Make sure the main power supply to the system is present and is within the specified limits.	Your plant or cell documentation can provide this information.
2	Make sure that the main transformer is correctly connected to the mains voltage levels at hand.	How to strap the mains transformer is detailed in the product manual for the controller.
3	Make sure that the main switches are switched on.	
4	Make sure that the power supply to the controller is within the specified limits.	If required, trouble shoot the power supply units as explained in section Trouble shooting the system power supply on page 78 .
5	If no LEDs lit, proceed to section All LEDs are off at controller on page 46 .	
6	If the system is not responding, proceed to section Controller not responding on page 43 .	
7	If the FlexPendant is not responding, proceed to section Problem starting the FlexPendant on page 50 .	

Continues on next page

3 Trouble shooting by fault symptoms

3.1 Start-up failures

Continued

	Action	Info/illustration
8	If the FlexPendant starts, but does not communicate with the controller, proceed to section <i>Problem connecting FlexPendant to the controller on page 51.</i>	

3.2 Controller not responding

Description

This section describes the possible faults and the recommended actions for each failure:

- Robot controller not responding
- LED indicators not lit

Consequences

System cannot be operated using the FlexPendant.

Possible causes

	Symptoms	Recommended action
1	Controller not connected to the mains power supply.	Ensure that the mains power supply is working and the voltage level matches that of the controller requirement.
2	Main transformer is malfunctioning or not connected correctly.	Ensure that the main transformer is connected correctly to the mains voltage level.
3	Main fuse (Q1) might have tripped.	Ensure that the mains fuse (Q1) inside the controller is not tripped

3 Trouble shooting by fault symptoms

3.3 Low Controller performance

3.3 Low Controller performance

Description

The controller performance is low, and seems to work irrationally.

If the controller is not responding at all, proceed as detailed in section [Controller not responding on page 43](#).

Consequences

These symptoms can be observed:

- Program execution is sluggish, seemingly irrational and sometimes stalls.

Possible causes

The computer system is experiencing too high load, which may be due to one, or a combination, of the following:

- Programs containing too high a degree of logical instructions only, causing too fast program loops and in turn, overloads the processor.
- The I/O update interval is set to a low value, causing frequent updates and a high I/O load.
- Internal system cross connections and logical functions are used too frequently.
- An external PLC, or other supervisory computer, is addressing the system too frequently, overloading the system.

Recommended actions

	Action	Info/illustration
1	<p>Check whether the program contains logical instructions (or other instructions that take "no time" to execute), since such programs may cause the execution to loop if no conditions are fulfilled.</p> <p>To avoid such loops, you can test by adding one or more WAIT instructions. Use only short WAIT times, to avoid slowing the program down unnecessarily.</p>	<p>Suitable places to add WAIT instructions can be:</p> <ul style="list-style-type: none">• In the main routine, preferably close to the end.• In a WHILE/FOR/GOTO loop, preferably at the end, close to the ENDWHILE/ENDFOR etc. part of the instruction.
2	<p>Make sure the I/O update interval value for each I/O board is not too low. These values are changed using RobotStudio.</p> <p>I/O units that are not read regularly may be switched to "change of state" operation as detailed in the RobotStudio manual.</p>	<p>ABB recommends these poll rates:</p> <ul style="list-style-type: none">• DSQC 327A: 1000• DSQC 328A: 1000• DSQC 332A: 1000• DSQC 377A: 20-40• All others: >100
3	<p>Check whether there is a large amount of cross connections or I/O communication between PLC and robot system.</p>	<p>Heavy communication with PLCs or other external computers can cause heavy load in the robot system main computer.</p>

Continues on next page

3 Trouble shooting by fault symptoms

3.3 Low Controller performance

Continued

Action	Info/illustration
4 Try to program the PLC in such a way that it uses event driven instructions, instead of looped instructions.	The robot system have a number of fixed system inputs and outputs that may be used for this purpose. Heavy communication with PLCs or other external computers can cause heavy load in the robot system main computer.

3 Trouble shooting by fault symptoms

3.4 All LEDs are off at controller

3.4 All LEDs are off at controller

Description

No LEDs at all are lit in the controller.


Consequences

The system cannot be operated or started at all.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- The system is not supplied with power.
- The main transformer is not connected for the correct mains voltage.
- Circuit breaker F6 (if used) is malfunctioning or open for any other reason.
- Contactor K41 is malfunctioning or open for any other reason.

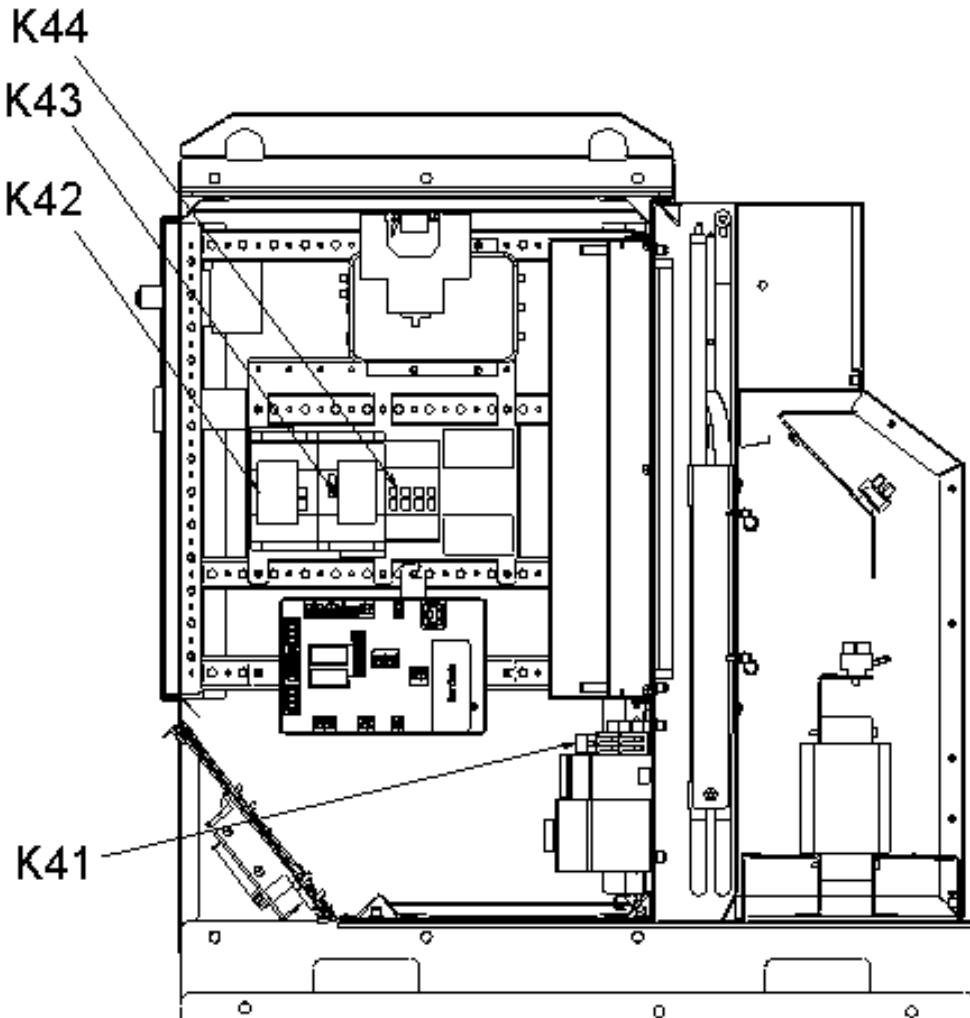

en1000000051

SK204A

Continues on next page

3 Trouble shooting by fault symptoms

3.4 All LEDs are off at controller

Continued

Recommended actions

	Action	Information
1	Make sure the main switch has been switched on.	
2	Make sure the system is supplied with power.	Use a voltmeter to measure incoming mains voltage.
3	Check the main transformer connection.	The voltages are marked on the terminals. Make sure they match the shop supply voltage.
4	Make sure circuit breaker F6 (if used) is closed in position 3.	The circuit breaker F6 is shown in the circuit diagram in the product manual for the controller.

3 Trouble shooting by fault symptoms

3.5 No voltage in service outlet

3.5 No voltage in service outlet

Description

Some controllers are equipped with service voltage outlet sockets, and this information applies to these modules only.

No voltage is available in the controller service outlet for powering external service equipment.


Consequences

Equipment connected to the controller service outlet does not work.

Probable causes

The symptom can be caused by (the causes are listed in order of probability):

- Tripped circuit breaker (F5)
- Tripped earth fault protection (F4)
- Mains power supply loss
- Transformers incorrectly connected

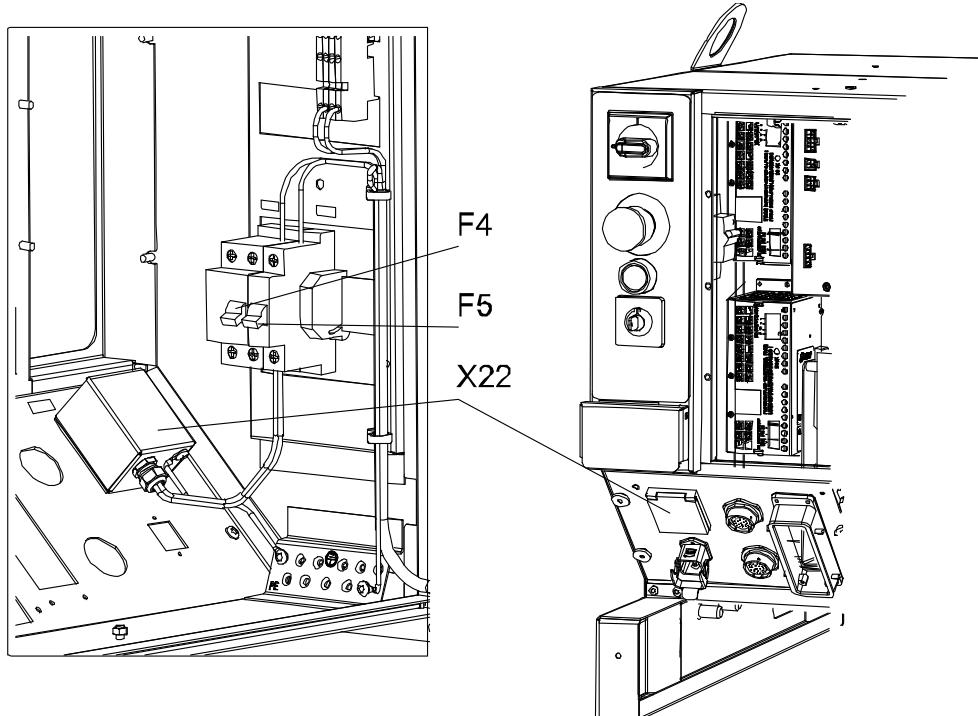

xx0500001403

Recommended actions


	Action	Information
1	Make sure the circuit breaker in the controller has not been tripped.	Make sure any equipment connected to the service outlet does not consume too much power, causing the circuit breaker to trip.

Continues on next page

3 Trouble shooting by fault symptoms

3.5 No voltage in service outlet

Continued

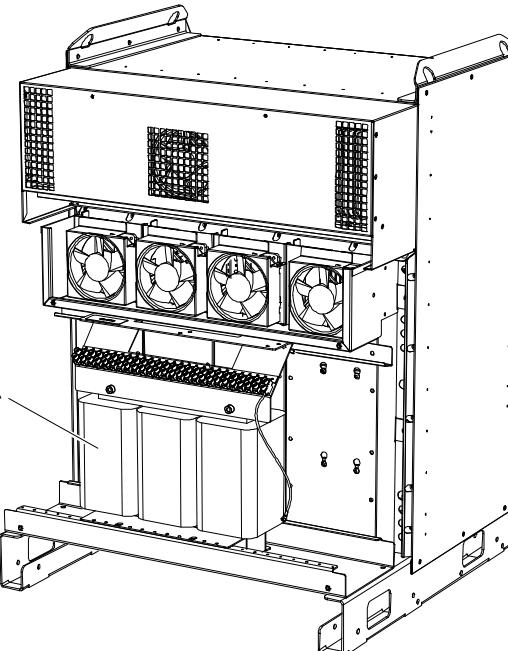Action	Information
2 Make sure the earth fault protection has not been tripped.	Make sure any equipment connected to the service outlet does not conduct current to ground, causing the earth fault protection to trip.
3 Make sure the power supply to the robot system is within specifications.	Refer to the plant documentation for voltage values.
4 Make sure the transformer (A) supplying the outlet is correctly connected, i.e. input and output voltages in accordance with specifications.	 <p>xx0500002028</p> <p>Refer to the plant documentation for voltage values.</p>

3 Trouble shooting by fault symptoms

3.6 Problem starting the FlexPendant

3.6 Problem starting the FlexPendant

Description

The FlexPendant is not responding, either completely or intermittently.

No entries are possible, and no functions are available.

If the FlexPendant starts but does not display a screen image, proceed as detailed in section [Problem connecting FlexPendant to the controller on page 51](#).

Consequences

The system cannot be operated using the FlexPendant.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- The system has not been switched on.
- The FlexPendant is not connected to the controller.
- The cable from the controller is damaged.
- The cable connector is damaged.
- FlexPendant power supply from controller is faulty.

Recommended actions

The following actions are recommended (listed in order of probability):

	Action	Information
1	Make sure the system is switched on and that the FlexPendant is connected to the controller.	How to connect the FlexPendant to the controller is detailed in <i>Operating manual - Getting started, IRC5 and RobotStudio</i> .
2	Inspect the FlexPendant cable for any visible damage.	If faulty, replace the FlexPendant.
3	If possible, test by connecting a different FlexPendant to eliminate the FlexPendant and cable as error sources.	
4	If possible, test the FlexPendant with a different controller to eliminate the controller as error source.	

3.7 Problem connecting FlexPendant to the controller

Description

The FlexPendant starts but does not display a screen image.

No entries are possible, and no functions are available.

See also section [Problem starting the FlexPendant on page 50](#).

Consequences

The system cannot be operated using the FlexPendant.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- The Ethernet network has problems.
- The main computer has problems.

Recommended actions

The following actions are recommended (listed in order of probability):

	Action	Information
1	Check all cables from power supply unit to main computer, making sure these are correctly connected.	
2	Make sure the FlexPendant has been correctly connected to the controller.	
3	Check all indication LEDs on all units in the controller.	All indication LEDs and their significance are specified in section Trouble shooting LEDs in the controller on page 65 .
4	Check all status signals on the main computer.	

3 Trouble shooting by fault symptoms

3.8 Erratic event messages on FlexPendant

3.8 Erratic event messages on FlexPendant

Description

The event messages displayed on the FlexPendant are erratic and do not seem to correspond to any actual malfunctions on the robot. Several types of messages can be displayed, seemingly erroneously.

This type of fault may occur after major manipulator disassembly or overhaul, if not performed correctly.

Consequences

Major operational disturbances due to the constantly appearing messages.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- Internal manipulator cabling not correctly performed. Causes may be: faulty connection of connectors, cable loops too tight causing the cabling to get strained during manipulator movements, cable insulation chafed or damaged by rubbing short-circuiting signals to earth.

Recommended actions

The following actions are recommended (listed in order of probability):

	Action	Information
1	Inspect all internal manipulator cabling, especially all cabling disconnected, connected re-routed or bundled during recent repair work.	Refit any cabling as detailed in the product manual for the robot.
2	Inspect all cable connectors to make sure these are correctly connected and tightened.	
3	Inspect all cable insulation for damage.	Replace any faulty cabling as detailed in the product manual for the robot.

3.9 Problem jogging the robot

Description

The system can be started but the joystick on the FlexPendant does not work.

Consequences

The robot can not be jogged manually.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- The joystick is malfunctioning.
- The joystick may be deflected.

Recommended actions

The following actions are recommended (listed in order of probability):

	Action	Information
1	Make sure the controller is in manual mode.	How to change operating mode is described in <i>Operating manual - IRC5 with FlexPendant</i> .
2	Make sure the FlexPendant is connected correctly to the Control Module.	
3	Reset the FlexPendant.	<p>Press Reset button located on the back of the FlexPendant.</p> <p> Note</p> <p>The Reset button resets the FlexPendant not the system on the Controller.</p>

3 Trouble shooting by fault symptoms

3.10 Reflashing firmware failure

3.10 Reflashing firmware failure

Description

When reflashing firmware, the automatic process can fail.

Consequences

The automatic reflashing process is interrupted and the system stops.

Possible causes

This fault usually occurs due to a lack of compatibility between hardware and software.

Consequences

The following actions are recommended (listed in order of probability):

	Action	Information
1	Check the event log for a message specifying which unit failed.	The logs may also be accessed from RobotStudio.
2	Was the relevant unit recently replaced? If YES; make sure the versions of the old and new unit is identical. If NO; check the software versions.	
3	Was the RobotWare recently replaced? If YES; make sure the versions of the old and new unit is identical. If NO; proceed below!	
4	Check with your local ABB representative for a firmware version compatible with your hardware/software combination.	

3.11 Inconsistent path accuracy

Description

The path of the robot TCP is not consistent. It varies from time to time, and is sometimes accompanied by noise emerging from bearings, gearboxes, or other locations.

Consequences

Production is not possible.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- Robot not calibrated correctly.
- Robot TCP not correctly defined.
- Parallel bar damaged (applies to robots fitted with parallel bars only).
- Mechanical joint between motor and gearbox damaged. This often causes noise to be emitted from the faulty motor.
- Bearings damaged or worn (especially if the path inconsistency is coupled with clicking or grinding noises from one or more bearings).
- The wrong robot type may be connected to the controller.
- The brakes may not be releasing correctly.

Recommended actions

In order to remedy the symptom, the following actions are recommended (the actions are listed in order of probability):

	Action	Info/Illustration
1	Make sure the robot tool and work object are correctly defined.	How to define these are detailed in <i>Operating manual - IRC5 with FlexPendant</i> .
2	Check the revolution counters' positions.	Update if required.
3	If required, recalibrate the robot axes.	How to calibrate the robot is detailed in <i>Operating manual - IRC5 with FlexPendant</i> .
4	Locate the faulty bearing by tracking the noise.	Replace faulty bearing as specified in the product manual for the robot.
5	Locate the faulty motor by tracking the noise. Study the path of the robot TCP to establish which axis, and thus which motor, may be faulty.	Replace the faulty motor/gearbox as specified in the product manual for the robot.
6	Check the trueness of the parallel bar (applies to robots fitted with parallel bars only).	Replace the faulty parallel bar as specified in the product manual for the robot.
7	Make sure the correct robot type is connected as specified in the configuration files.	
8	Make sure the robot brakes work properly.	Proceed as detailed in section Problem releasing Robot brakes on page 60 .

3 Trouble shooting by fault symptoms

3.12 Oil and grease stains on motors and gearboxes

Description

The area surrounding the motor or gearbox shows signs of oil leaks. This can be at the base, closest to the mating surface, or at the furthest end of the motor at the resolver.

Consequences

Besides the dirty appearance, in some cases there are no serious consequences if the leaked amount of oil is very small. However, in some cases the leaking oil lubricates the motor brake, causing the manipulator to collapse at power down.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- Leaking seal between gearbox and motor.
- Gearbox overfilled with oil.
- Gearbox oil too hot.

Recommended actions

In order to remedy the symptom, the following actions are recommended (the actions are listed in order of probability):

	Action	Information
1	 CAUTION Before approaching the potentially hot robot component, observe the safety information in section <i>CAUTION - Hot parts may cause burns! on page 29</i> .	
2	Inspect all seals and gaskets between motor and gearbox. The different manipulator models use different types of seals.	Replace seals and gaskets as specified in the product manual for the robot.
3	Check the gearbox oil level.	Correct oil level is specified in the product manual for the robot.
4	Too hot gearbox oil may be caused by: <ul style="list-style-type: none">• Oil quality or level used is incorrect.• The robot work cycle runs a specific axis too hard. Investigate whether it is possible to program small "cooling periods" into the application.• Overpressure created inside gearbox.	Check the recommended oil level and type as specified in the product manual for the robot. Manipulators performing certain, extremely heavy duty work cycles may be fitted with vented oil plugs. These are not fitted to normal duty manipulators, but may be purchased from your local ABB representative.

3.13 Mechanical noise

Description

During operation, no mechanical noise should be emitted from motors, gearboxes, bearings, or similar. A faulty bearing often emits scraping, grinding, or clicking noises shortly before failing.

Consequences

Failing bearings cause the path accuracy to become inconsistent, and in severe cases, the joint can seize completely.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- Worn bearings.
- Contaminations have entered the bearing races.
- Loss of lubrication in bearings.

If the noise is emitted from a gearbox, the following can also apply:

- Overheating.

Recommended actions

The following actions are recommended (listed in order of probability):

	Action	Information
1	 CAUTION Before approaching the potentially hot robot component, observe the safety information in section CAUTION - Hot parts may cause burns! on page 29 .	
2	Determine which bearing is emitting the noise.	
3	Make sure the bearing has sufficient lubrication.	As specified in the product manual for the robot.
4	If possible, disassemble the joint and measure the clearance.	As specified in the product manual for the robot.
5	Bearings inside motors are not to be replaced individually, but the complete motor is replaced.	Replace faulty motors as specified in the product manual for the robot.
6	Make sure the bearings are fitted correctly.	Also see the product manual for the robot for general instruction on how to handle bearings.

Continues on next page

3 Trouble shooting by fault symptoms

3.13 Mechanical noise

Continued

	Action	Information
7	Too hot gearbox oil may be caused by: <ul style="list-style-type: none">• Oil quality or level used is incorrect.• The robot work cycle runs a specific axis too hard. Investigate whether it is possible to program small "cooling periods" into the application.• Overpressure created inside gearbox.	<p>Check the recommended oil level and type as specified in the product manual for the robot.</p> <p>Manipulators performing certain, extremely heavy duty work cycles may be fitted with vented oil plugs. These are not fitted to normal duty manipulators, but may be purchased from your local ABB representative.</p>

3.14 Manipulator crashes on power down

Description

The manipulator is able to work correctly while Motors ON is active, but when Motors OFF is active, it collapses under its own weight.

The holding brake, integral to each motor, is not able to hold the weight of the manipulator arm.

Consequences

The fault can cause severe injuries or death to personnel working in the area or severe damage to the manipulator and/or surrounding equipment.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- Faulty brake.
- Faulty power supply to the brake.

Recommended actions

The following actions are recommended (listed in order of probability):

	Action	Information
1	Determine which motor(s) causes the robot to collapse.	
2	Check the brake power supply to the collapsing motor during the Motors OFF state.	Also see the circuit diagrams in the product manuals for the robot and the controller .
3	Remove the resolver of the motor to see if there are any signs of oil leaks.	If found faulty, the motor must be replaced as a complete unit as detailed in the product manual for the robot.
4	Remove the motor from the gearbox to inspect it from the drive side.	If found faulty, the motor must be replaced as a complete unit as detailed in the product manual for the robot.

3 Trouble shooting by fault symptoms

3.15 Problem releasing Robot brakes

3.15 Problem releasing Robot brakes

Description

When starting robot operation or jogging the robot, the internal robot brakes must release in order to allow movements.


Consequences

If the brakes do not release, no robot movement is possible, and a number of error log messages can occur.

Possible causes

The symptom can be caused by (the causes are listed in order of probability):

- Brake contactor (K44) does not work correctly.
- The system does not go to status Motors ON correctly.
- Faulty brake on the robot axis.
- Supply voltage 24V BRAKE missing.

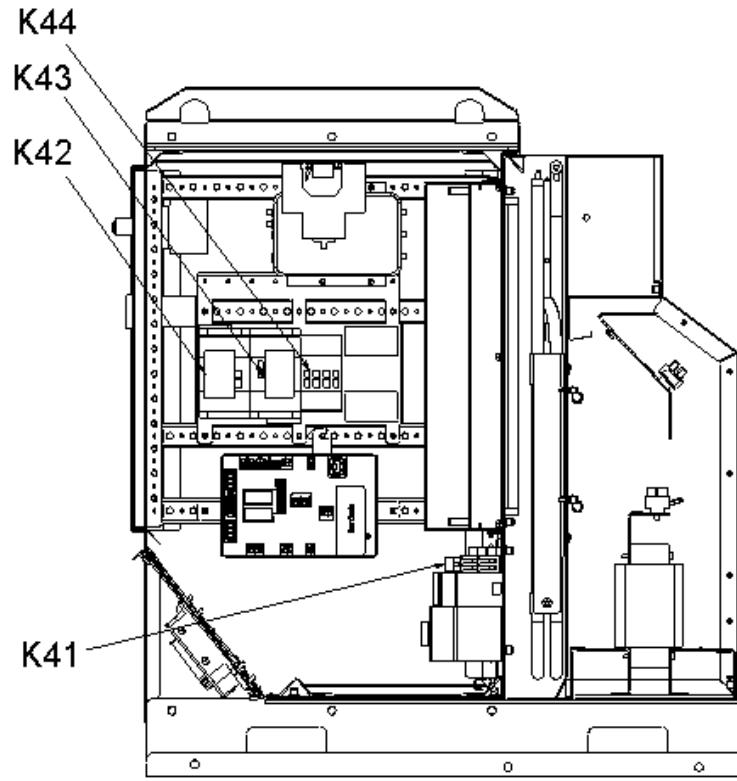

en1000000051

Continues on next page

Recommended actions

This section details how to proceed when the robot brakes do not release.

	Action	Information
1	Make sure the brake contactor is activated.	A 'tick' should be audible, or you may measure the resistance across the auxiliary contacts on top of the contactor.
2	Make sure the RUN contactors (K42 and K43) are activated. NOTE that both contactors must be activated, not just one!	A 'tick' should be audible, or you may measure the resistance across the auxiliary contacts on top of the contactor.
3	Use the push buttons on the robot to test the brakes. If just one of the brakes malfunctions, the brake at hand is probably faulty and must be replaced. If none of the brakes work, there is probably no 24V BRAKE power available.	The location of the push buttons differ, depending on robot model. Please refer to the product manual for the robot!
4	Check the power supply to make sure 24V BRAKE voltage is OK.	
5	A number of other faults within the system can cause the brakes to remain activated. In such cases, event log messages will provide additional information.	The event log messages can also be accessed using RobotStudio.

3 Trouble shooting by fault symptoms

3.16 Intermittent errors

3.16 Intermittent errors

Description

During operation, errors and malfunctions may occur, in a seemingly random way.

Consequences

Operation is interrupted, and occasionally, event log messages are displayed, that sometimes do not seem to be related to any actual system malfunction. This sort of problem sometimes affects the Emergency stop or Enable chains respectively, and may at times be very hard to pinpoint.

Probable causes

Such errors may occur anywhere in the robot system and may be due to:

- external interference
- internal interference
- loose connections or dry joints, e.g. incorrectly connected cable screen connections.
- thermal phenomena , e.g. major temperature changes within the workshop area.

Recommended actions

In order to remedy the symptom, the following actions are recommended (the actions are listed in order of probability):

	Action	Info/illustration
1	Check all the cabling, especially the cables in the Emergency stop and Enable chains. Make sure all connectors are connected securely.	
2	Check if any indication LEDs signal any malfunction that may give some clue to the problem.	All indication LEDs and their significance are specified in section Trouble shooting LEDs in the controller on page 65 .
3	Check the messages in the event log. Sometimes specific error combinations are intermittent.	The event log messages may be viewed either on the Flex-Pendant or using RobotStudio.
4	Check the robot's behavior, etc, each time that type of error occurs.	If possible, keep track of the malfunctions in a log or similar.
5	Check whether any condition in the robot working environment also changes periodically, e.g, interference from any electric equipment only operating periodically.	
6	Investigate whether the environmental conditions (such as ambient temperature, humidity, etc) has any bearing on the malfunction.	If possible, keep track of the malfunctions in a log or similar.

3.17 Force starting of Boot Application

Description

Robot Controller always runs in one of the following two modes:

- Normal operation mode (a user created system is selected to run)
- Boot Application mode (advanced maintenance mode)

In rare occasions, a serious error (in software or configuration of the selected system), may prevent the controller from starting properly in the normal operation mode. A typical case is when a controller is restarted after a network configuration change, causing the controller to be non responsive from FlexPendant, RobotStudio, or FTP. To rescue the robot controller from this situation, a new way (force starting of Boot Application through main power switch) to force start of the controller in Boot Application mode has been implemented.

Consequences

The system has startup problems or the FlexPendant cannot connect to the system.

Recommended action

Repeat the following action three times in a row:

- 1 Turn ON the main power switch.
- 2 Wait approximately for 20 seconds.
- 3 Turn OFF the main power switch.

The currently active system is de-selected and a forced start of Boot Application is done in the following startup. This makes it possible to rescue some data from a system that does not start properly.



Note

This action shall not affect any of the files in the directories belonging to the de-selected system and this action has no effect if the controller is already in the Boot Application mode.

This page is intentionally left blank

4 Trouble shooting by unit

4.1 Trouble shooting LEDs in the controller


General

The controller features a number of indication LEDs, which provide important information for trouble shooting purposes. If no LEDs light up at all when switching the system on, trouble shoot as detailed in section [All LEDs are off at controller on page 46](#)

All LEDs on the respective units, and their significance, are described in the following sections.

All units with LEDs are shown in the illustration below:

Units with LEDs in the controller

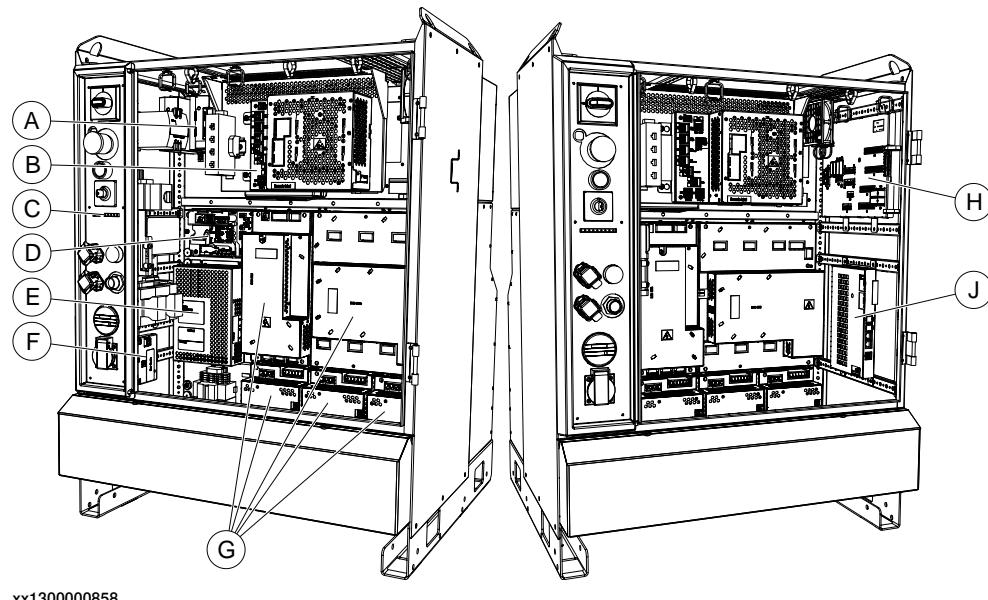

A	Customer I/O power supply	Trouble shooting the customer I/O power supply on page 90
B	Computer unit	Trouble shooting the computer unit on page 70
C	LED board	LED board on page 66
D	Power distribution board	Trouble shooting the power distribution board on page 83
E	System power supply	Trouble shooting the system power supply on page 78
F	Contactor interface board	Trouble shooting the contactor interface board on page 88
G	Drive system	Trouble shooting the drive system on page 74
H	Panel board	Trouble shooting the panel board on page 72
J	Axis computer	Trouble shooting the axis computer on page 76

Continues on next page

4 Trouble shooting by unit

4.1 Trouble shooting LEDs in the controller

Continued

LED board

The function of the LEDs on the LED board are identical to those on the panel board, see section [*Trouble shooting the panel board on page 72.*](#)

Should the LED board not be working, but the panel board is, the problem is the communication between these boards or the LED board itself. Check the cabling between them.

4.2 Trouble shooting the FlexPendant

General

The FlexPendant communicates, through the panel board, with the main computer. The FlexPendant is physically connected to the panel board through a cable in which the +24 V supply and two enabling device chains run and emergency stop.

Procedure

The procedure below details what to do if the FlexPendant does not work correctly.

	Action	Info/illustration
1	If the FlexPendant is completely is not responding, proceed as detailed in section Problem starting the FlexPendant on page 50 .	
2	If the FlexPendant starts, but does not operate correctly, proceed as detailed in section Problem connecting FlexPendant to the controller on page 51 .	
3	If the FlexPendant starts, seems to operate, but displays erratic event messages, proceed as detailed in section Erratic event messages on FlexPendant on page 52 .	
4	Check the cable for connections and integrity.	
5	Check the 24 V power supply.	
6	Read the error event log message and follow any instructions of references.	

Restarting a locked FlexPendant

In case the FlexPendant is locked by a software error or misuse you can unlock it either using the joystick, or using the reset button (located on the back on FlexPendant with USB port).

Use this procedure to unlock the FlexPendant using the joystick.

	Action	Information
1	Move the joystick to the right three times, with full deflection.	The joystick must be moved to its utmost limit. Therefore, use slow and distinct movements.
2	Move the joystick to the left once, with full deflection.	
3	Move the joystick down once, with full deflection.	
4	A dialog is displayed. Tap Reset.	The FlexPendant is restarted.

4 Trouble shooting by unit

4.3 Trouble shooting communications

Overview

This section details how to trouble shoot data communication in the Control and Drive Modules.

Trouble shooting procedure

When trouble shooting communication faults, follow the outline detailed below:

	Action	Info/illustrations
1	Faulty cables (e.g. send and receive signals are mixed up).	
2	Transfer rates (baud rates).	
3	Data widths that are incorrectly set.	

4.4 Trouble shooting fieldbuses and I/O units

Further information

Information about how to trouble shoot the fieldbuses and I/O units can be found in the manual for the respective fieldbus or I/O unit.


4 Trouble shooting by unit

4.5 Trouble shooting the computer unit

4.5 Trouble shooting the computer unit

Computer unit parts

The illustration below shows the placement of the parts in the computer unit.

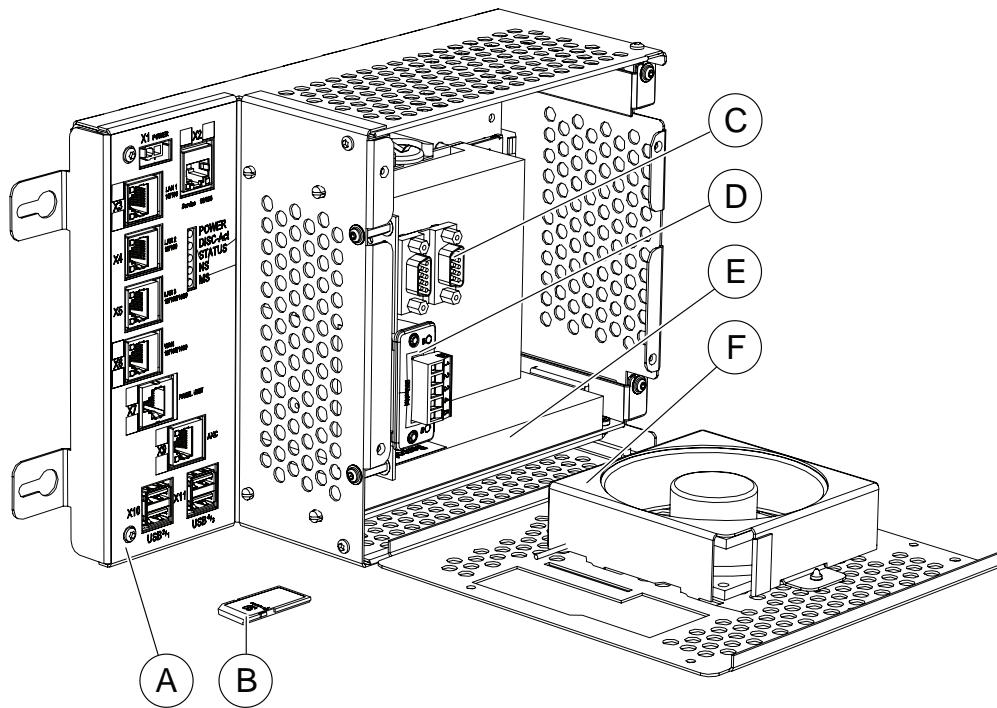

xx1300000851


	Description	Type
A	Computer unit	DSQC1000, DSQC1018, or DSQC1024
B	Mass Memory with boot loader 2GB	-
C	Expansion Board complete	DSQC1003
D	PROFINET Slave Fieldbus Adapter	DSQC 688
D	PROFIBUS Slave Fieldbus Adapter	DSQC 667
D	Ethernet/IP Slave Fieldbus Adapter	DSQC 669
D	DeviceNet Slave Fieldbus Adapter	DSQC1004
E	DeviceNet Master/Slave PClexpress	DSQC1006
E	PROFIBUS-DP Master/Slave PClexpress	DSQC1005
F	Fan with receptacle	-

For more information and spare part numbers, see *Product manual - IRC5*.

Continues on next page

LEDs

The illustration below shows the LEDs on the computer unit:

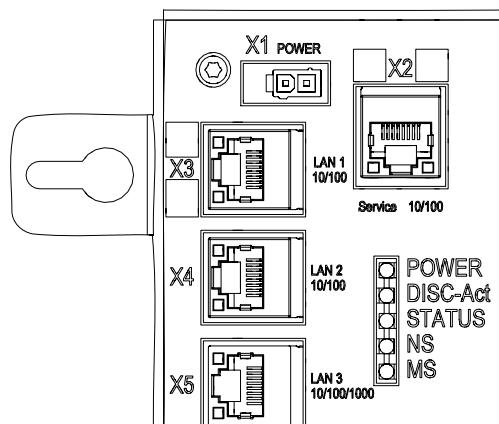

xx1300000857

Description	Significance
POWER (green)	<p>Normal startup:</p> <ul style="list-style-type: none"> OFF, During a normal startup the LED is off until COM Express module inside the computer unit is started. SOLID ON, After completion of startup LED is solid on. <p>Failure during startup (off between blinks). One to four short blinks, one second off. This is repeated until power off.</p> <ul style="list-style-type: none"> Internal fail of power, FPGA, and/or the COM Express module. Replace the computer unit. <p>Power failure during runtime (fast flashing between blinks). One to five blinks, 20 fast flashing blinks. This is repeated until power off.</p> <ul style="list-style-type: none"> Temporary voltage drop, cycle the power to the controller. Check the power supply voltage to the computer unit. Replace the computer unit.
DISC-Act (yellow)	(Disc activity.) Indicates that the computer is writing to the SD-card.
STATUS (red/green)	<p>Startup sequence:</p> <ol style="list-style-type: none"> 1 SOLID RED, loading bootloader. 2 FLASHING RED, loading image. 3 FLASHING GREEN, loading RobotWare. 4 SOLID GREEN, system ready. <p>Fault indication:</p> <ul style="list-style-type: none"> SOLID RED forever, check the SD-card. FLASHING RED forever, check the SD-card. FLASHING GREEN forever, view error messages on FlexPendant or CONSOLE.
NS (red/green)	(Network Status) Not used.
MS (red/green)	(Module Status) Not used.


For information about the LEDs on the AnybusCC slave fieldbus adapter and the PCIExpress master/slave fieldbus board, see the corresponding fieldbus manual.

4 Trouble shooting by unit

4.6 Trouble shooting the panel board

Location

The panel board unit, DSQC 643, is located as shown in the illustration below.

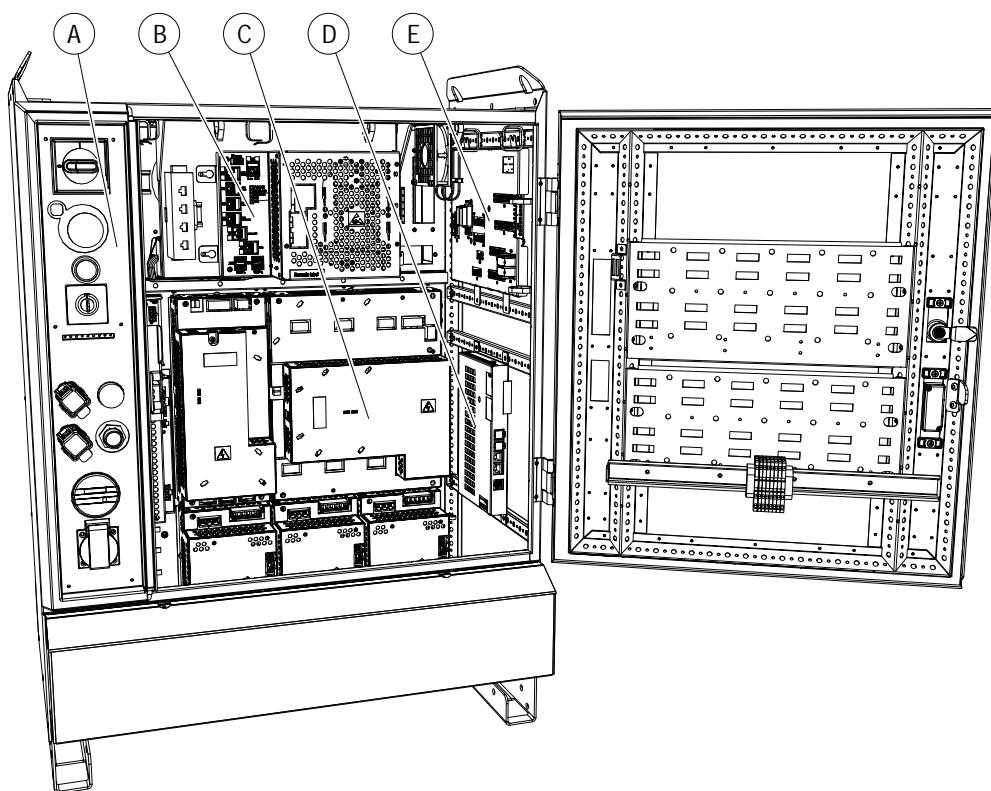


xx1300000679

A	Operator's panel
B	Computer unit
C	Drive system
D	Axis computer
E	Panel board unit

Continues on next page

LEDs

The illustration below shows the LEDs on the Panel board:

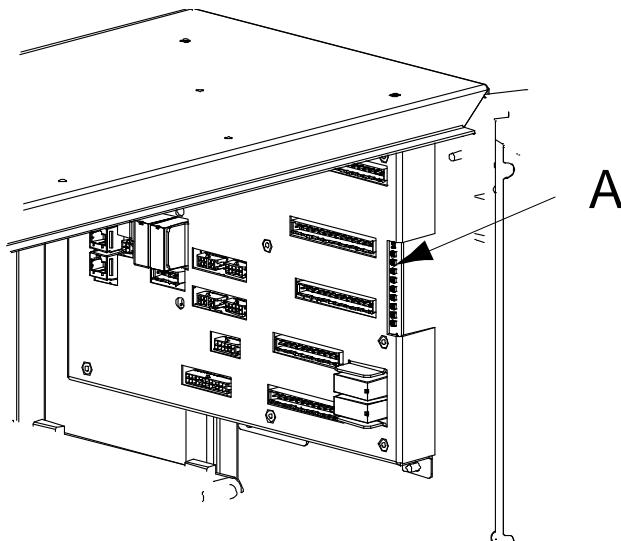

xx0400001076

A	Panel board LEDs
---	------------------

The panel board LEDs are described from top to bottom below:

Description	Significance
Status LED	GREEN flashing: serial communication error. GREEN steady: no errors found and system is running. RED flashing: system is in power up/self test mode. RED steady: other error than serial communication error.
Indication LED, ES1	YELLOW when Emergency stop (ES) chain 1 closed
Indication LED, ES2	YELLOW when Emergency stop (ES) chain 2 closed
Indication LED, GS1	YELLOW when General stop (GS) switch chain 1 closed
Indication LED, GS2	YELLOW when General stop (GS) switch chain 2 closed
Indication LED, AS1	YELLOW when Auto stop (AS) switch chain 1 closed
Indication LED, AS2	YELLOW when Auto stop (AS) switch chain 2 closed
Indication LED, SS1	YELLOW when Superior stop (SS) switch chain 1 closed
Indication LED, SS2	YELLOW when Superior stop (SS) switch chain 2 closed
Indication LED, EN1	YELLOW when ENABLE1=1 and RS-communication is OK


4 Trouble shooting by unit

4.7 Trouble shooting the drive system

4.7 Trouble shooting the drive system

Location

The illustration shows the location of drive units in the controller.

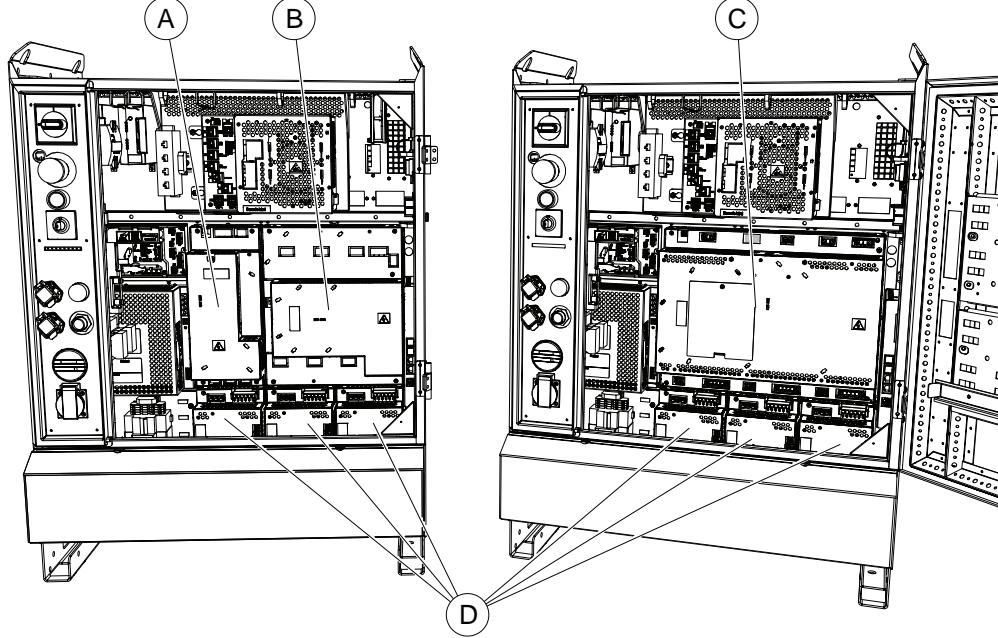


xx1300000808

A	Additional Rectifier Unit (only used for additional axes in combination with small robots)
B	Main Drive Unit for small robots
C	Main Drive Unit for large robots
D	Additional Drive Units (for additional axes)

Continues on next page

LEDs

The illustration below shows the indication LEDs on the Main Drive Unit and Additional Drive Units.

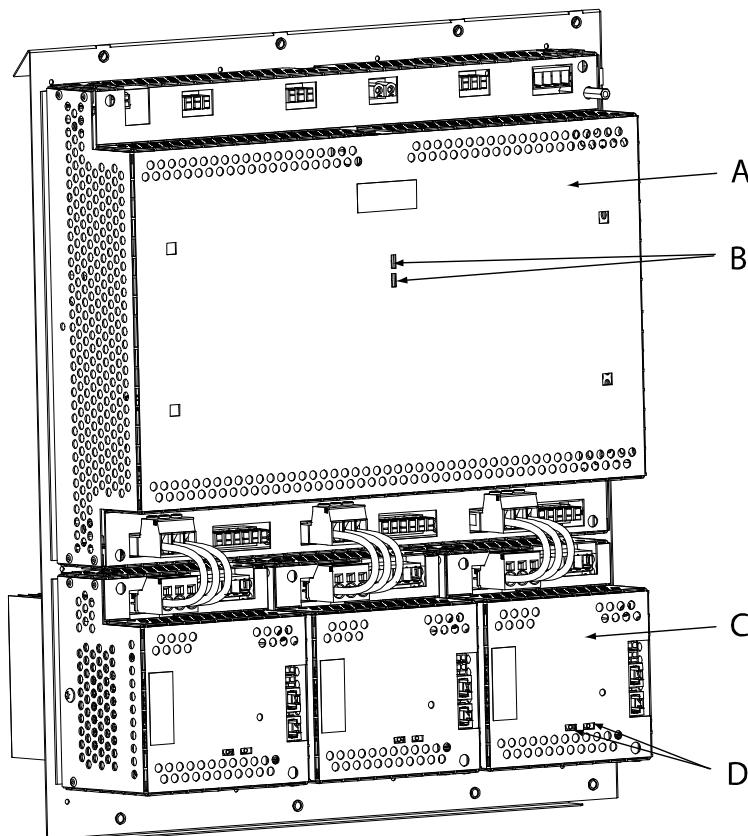

xx0800000486

A	Main Drive Unit
B	Main Drive Unit Ethernet LEDs
C	Additional Drive Unit
D	Additional Drive Unit Ethernet LEDs


Description	Significance
Ethernet LEDs (B and D)	Shows the status of Ethernet communication between an additional axis computer (2, 3 or 4) and the Ethernet board. <ul style="list-style-type: none">• GREEN OFF: 10 Mbps data rate has been selected.• GREEN ON: 100 Mbps data rate has been selected.• YELLOW flashing: The two units are communicating on the Ethernet channel.• YELLOW steady: A LAN link is established.• YELLOW OFF: A LAN link is <i>not</i> established.

4 Trouble shooting by unit

4.8 Trouble shooting the axis computer

Location

The illustration below shows the location of the axis computer, DSQC 668, in the controller.

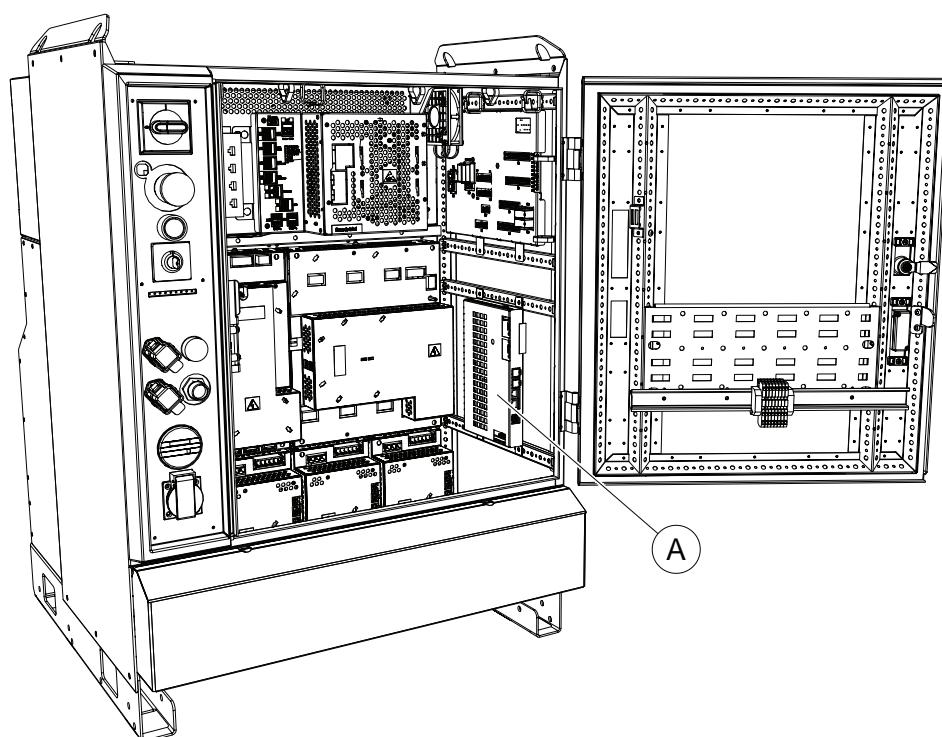


xx1300000809

A	Axis computer
---	---------------

Continues on next page

LEDs

The illustration below shows the LEDs on the Axis computer:

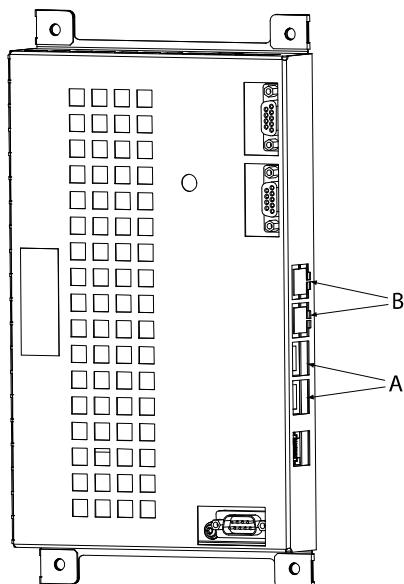

xx0800000485

A	Status LED
B	Ethernet LED


Description	Significance
Status LED	<p>Normal sequence during startup:</p> <ol style="list-style-type: none"> 1 RED steady: Default at power-up. 2 RED flashing: Establish connection to main computer and load program to axis computer. 3 GREEN flashing: Start-up of axis computer program and connect peripheral units. 4 GREEN steady. Start-up sequence ready. Application is running. <p>The following indicates errors:</p> <ul style="list-style-type: none"> • OFF: No power to axis computer or internal error (hardware/firmware). • RED steady (forever): The axis computer has failed to initialize basic hardware. • RED flashing (forever): Missing connection to main computer, main computer start-up problem or RobotWare installation problem. • GREEN flashing (forever): Missing connections to peripheral units or RobotWare start-up problem.
Ethernet LED	<p>Shows the status of Ethernet communication between an additional axis computer (2, 3 or 4) and the Ethernet board.</p> <ul style="list-style-type: none"> • GREEN OFF: 10 Mbps data rate has been selected. • GREEN ON: 100 Mbps data rate has been selected. • YELLOW flashing: The two units are communicating on the Ethernet channel. • YELLOW steady: A LAN link is established. • YELLOW OFF: A LAN link is <i>not</i> established.

4 Trouble shooting by unit

4.9 Trouble shooting the system power supply

Location

The illustration below shows the location of the system power supply, DSQC 661, in the controller.

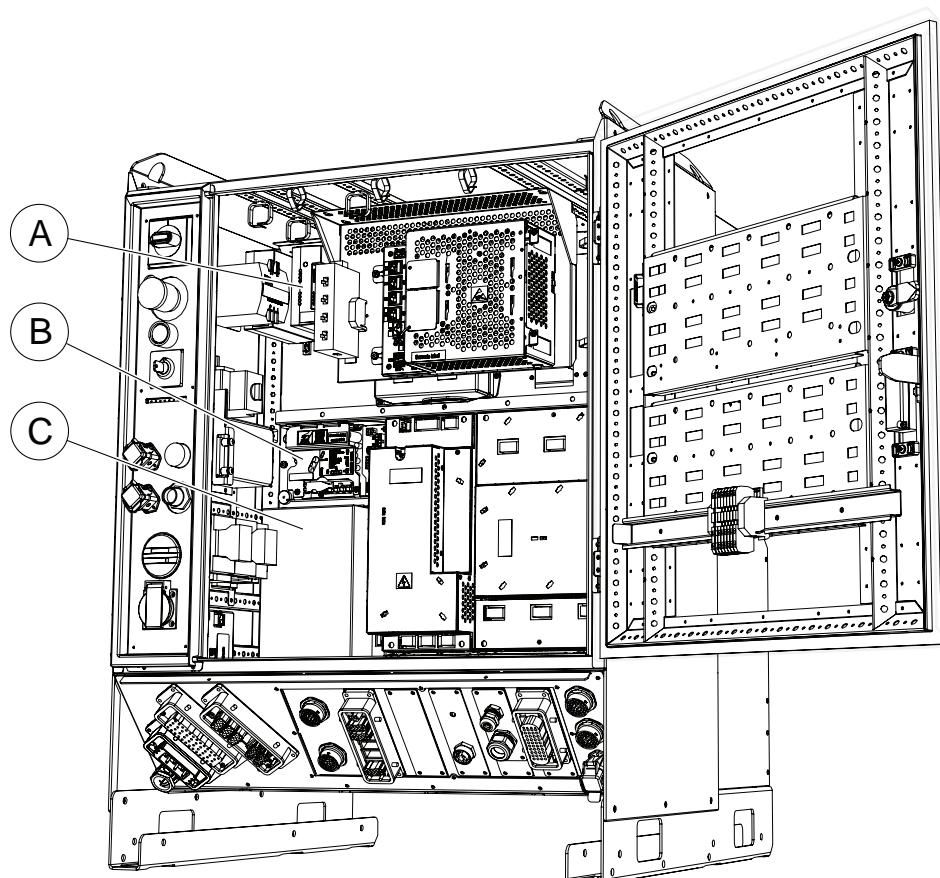


xx1300000813

A	Customer I/O power supply
B	Power distribution board
C	System power supply

Continues on next page

LEDs

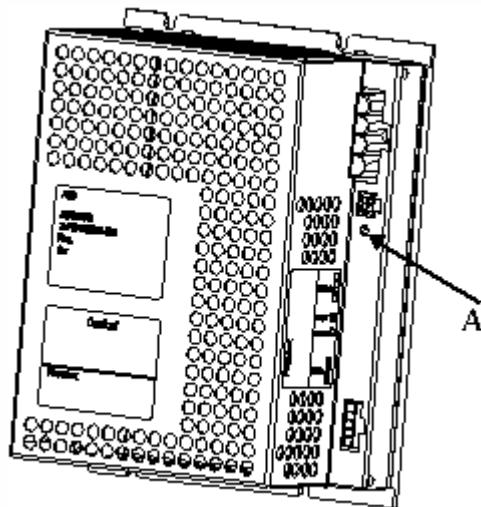

en1000000041

A	DC OK indicator
Description	Significance
DC OK indicator	GREEN: When all DC outputs are above the specified minimum levels. OFF: When one or more DC output/s below the specified minimum level.

Required test equipment

Equipment needed for trouble shooting:

- Ohmmeter
- Resistive load (e.g. main computer on +24V_PC)
- Voltmeter

Preparations

	Action
1	Check the FlexPendant for errors and warnings.
2	Make sure that the control system power supply is in run-time mode. Do this by waiting 30 seconds after power-on.

Continues on next page

4 Trouble shooting by unit

4.9 Trouble shooting the system power supply

Continued

Trouble shooting procedure

The trouble shooting table is supposed to be used as a detailed instruction together with the trouble shooting flowchart.

Test	Note	Action
1 Check the indicator LED on DSQC 661.	The indicator LED is labelled as DC OK led.	If the LED is: <ul style="list-style-type: none">• GREEN, the DSQC 661 should be working properly.• PULSING GREEN, the DC output is probably not connected to any unit (load) or there may be a short circuit on the output. Proceed with step 2.• OFF, either the DSQC 661 is faulty or it does not have sufficient input voltage. Proceed with step 4.
2 Check connection between DC output and the connected unit.	Make sure that the power supply is connected to DSQC 662. A minimum load of 2A is required on the DC output connector X2 for the DSQC 661 to work properly.	If the connection is OK, proceed with step 3. If the connection is faulty or the power supply is not connected to DSQC 662, repair connection/connect it. Verify that the fault has been fixed and restart this guide if necessary.
3 Check for short circuit on DC output.	Check both the DC output connector X2 on DSQC 661 and the input connector X1 on DSQC 662. Measure the resistance between voltage pins and ground. The resistance should not be <i>less than 10 ohms</i> .  Note Do not measure the resistance between pins. Dual pins are used for both power supply and ground. The DC output connector X2 is shown in the Circuit Diagram in <i>Product manual - IRC5</i> .	If no short circuit is found, proceed with step 4. If a short circuit is found on DSQC 661, proceed with step 10. If a short circuit is found on DSQC 662, get that unit working. Verify that the fault has been fixed and restart this guide if necessary.

Continues on next page

Test	Note	Action
4 Measure the DC voltage while the output is connected to DSQC 662 or some other load.	DSQC 661 requires a minimum load of 2A in order to deliver +24V. Measure the voltage using a voltmeter at the DC output connector X2. The voltage should be: $+24V < U < +27V$. If the voltage measured at the load falls below +24 V, voltage drops in the cables and connectors. The DC output connector X2 is shown in the Circuit Diagram in <i>Product manual - IRC5</i> .	If the correct voltage is detected and the DC OK led is green, the power supply is working properly. If the correct voltage is detected and the DC OK led is off, the power supply is regarded as faulty but does not have to be replaced instantly. If no or the wrong voltage is detected, proceed with step 5.
5 Measure the input voltage to the DSQC 661.	Measure the voltage using a voltmeter. Voltage should be: $172 < U < 276V$. The AC input connector X1 is shown in the Circuit Diagram in <i>Product manual - IRC5</i> .	If the input voltage is correct, proceed with step 10. If no or the wrong input voltage is detected, proceed with step 6.
6 Check switches Q1-2.	Make sure that they are closed. Their physical location is shown in the Circuit Diagram in <i>Product manual - IRC5</i> .	If the switches are closed, proceed with step 7. If the switches are open, close them. Verify that the fault has been fixed and restart this guide if necessary.
7 Check main fuse F2 and optional fuse F6 if used.	Make sure that they are open. Their physical location is shown in the Circuit Diagram in <i>Product manual - IRC5</i> .	If the fuses are open, proceed with step 8. If the fuses are closed, open them. Verify that the fault has been fixed and restart this guide if necessary.
8 Make sure that the input voltage to the cabinet is the correct one for that particular cabinet.		If the input voltage is correct, proceed with step 9. If the input voltage is incorrect, adjust it. Verify that the fault has been fixed and restart this guide if necessary.
9 Check the cabling.	Make sure that the cabling is correctly connected and not faulty.	If the cabling is OK, the problem is likely to be the transformer T1 or the input filter. Try to get this part of the supply working. Verify that the fault has been fixed and restart this guide if necessary. If the cabling is found unconnected or faulty, connect/replace it. Verify that the fault has been fixed and restart this guide if necessary.
10 The DSQC 661 may be faulty, replace it and verify that the fault has been fixed.	How to replace the unit is detailed in <i>Product manual - IRC5</i> .	


Continues on next page

4 Trouble shooting by unit

4.9 Trouble shooting the system power supply

Continued

Trouble shooting flowchart

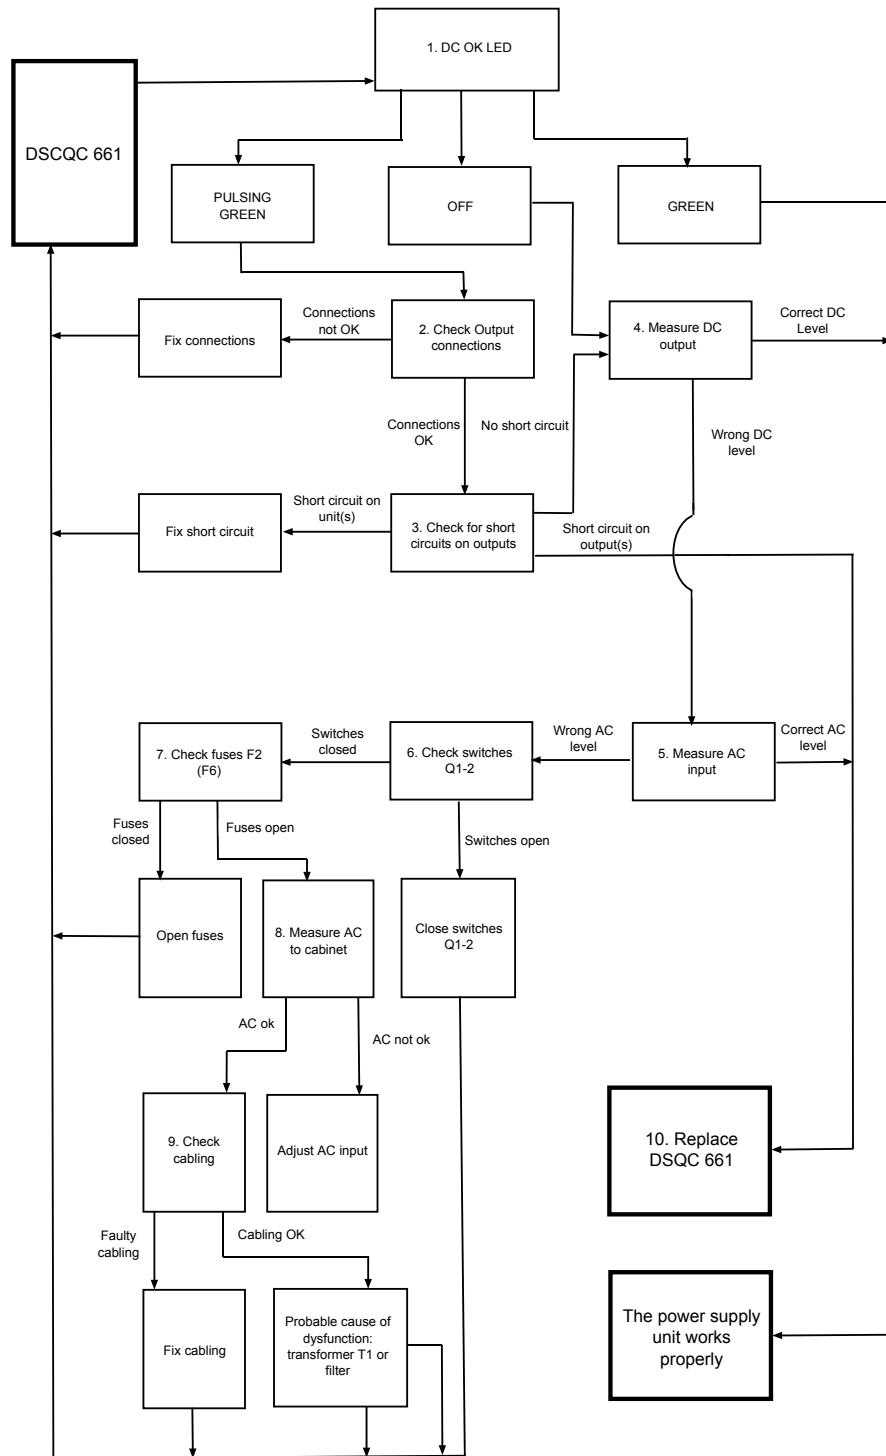


xx1200001313

4.10 Trouble shooting the power distribution board

Location

The power distribution board, DSQC 662, is located on the left side as shown in the illustration below.

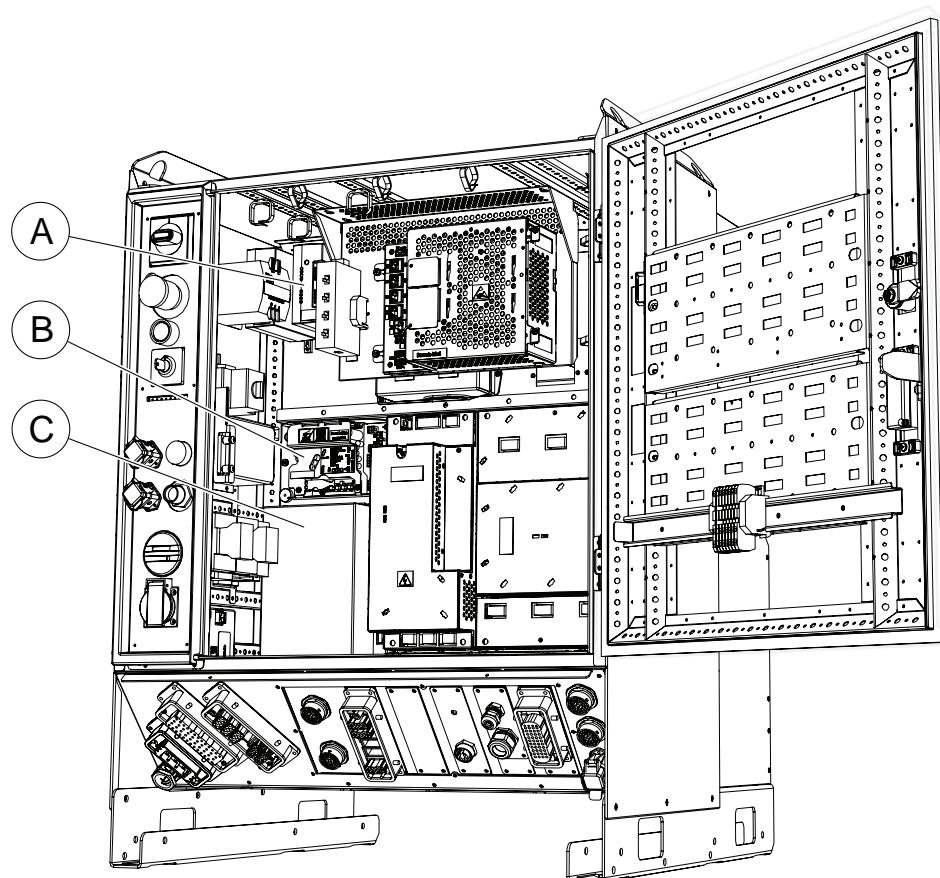

xx1300000813

A	Customer I/O power supply
B	Power distribution board
C	System power supply



CAUTION

Hot surface on top of the power distribution board unit.

Risk of burns. Be careful when removing the unit.

Do not route or place cables on top of the power distribution board.


Continues on next page

4 Trouble shooting by unit

4.10 Trouble shooting the power distribution board

Continued

LEDs

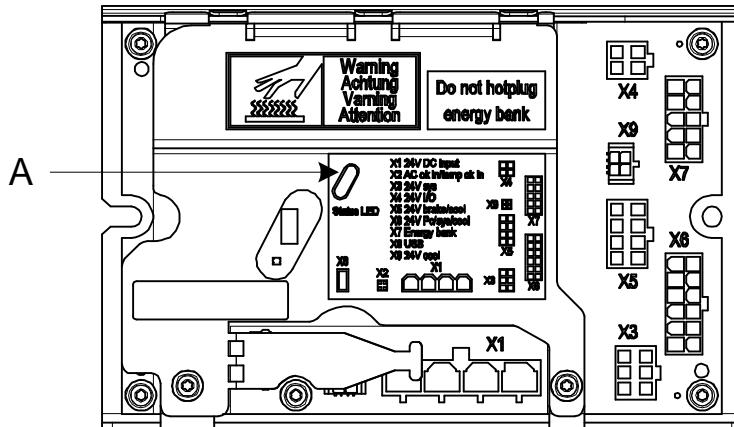

en1000000042

A	DCOK indicator
Description	Significance
DCOK indicator	GREEN: When DC output is above the specified minimum level. OFF: When the DC output below the specified minimum level.

Required test equipment

Equipment needed for trouble shooting:

- Ohmmeter
- Resistive load (e.g. main computer on +24V_PC)
- Voltmeter

Preparations

	Action	Note
1	Check the FlexPendant for errors and warnings.	
2	Make sure that the power distribution board is in run-time mode. Do this by waiting 1 minute after power-on.	<p>Note</p> <p>When the AC power has been cut off, the indicator LED (Status LED) on DSQC 662 will turn red and stay red until UltraCAP is empty. This may take a long time and is completely normal. It does not mean that there is something wrong with the 662.</p>

Continues on next page

Trouble shooting procedure

The trouble shooting table is supposed to be used as a detailed instruction together with the trouble shooting flowchart.

Test	Note	Action
1	Check the indicator LED on DSQC 662.	The indicator LED is labelled Status LED.
		If the LED is: <ul style="list-style-type: none"> • GREEN, the DSQC 662 should be working properly. • PULSING GREEN, a USB communication error has occurred. Proceed with step 2. • RED, the input/output voltage is low, and/or the logic signal ACOK_N is high. Proceed with step 4. • PULSING RED, one or more DC outputs are under specified voltage level. Make sure cables are properly connected to its respective units. Proceed with step 4. • PULSING RED/GREEN, a firmware upgrade error has occurred. This is not supposed to happen during runtime mode, proceed with step 6. • OFF, either the DSQC 662 is faulty or it does not have sufficient input voltage. Proceed with step 4.
2	Check USB connection on both ends.	If the connection seems OK, proceed with step 6. If there is a problem with the connection, proceed with step 3.
3	Try to fix the communication between the power supply and the computer by reconnecting the cable.	Make sure that the USB cable is properly connected on both ends. If the communication comes back up, verify that the fault has been fixed and restart this guide if necessary. If unable to fix the communication, proceed with step 6.
4	Disconnect one DC output at a time and measure its voltage.	Make sure that at least one unit is connected at all times. A minimum load of 0.5- 1A is required on at least one output for the DSQC 662 to work properly. Measure the voltage using a voltmeter. The voltage should be: +24V < U < +27V. The DC outputs are shown in the Circuit Diagram in <i>Product manual - IRC5</i> . If the correct voltage is detected on all outputs and the Status LED is green, the power supply is working properly. If the correct voltage is detected on all outputs and the Status LED is NOT green, the power supply is regarded as faulty but does not have to be replaced instantly. If no or the wrong voltage is detected, proceed with step 5.

Continues on next page

4 Trouble shooting by unit


4.10 Trouble shooting the power distribution board

Continued

	Test	Note	Action
5	Measure the input voltage to the DSQC 662 and the ACOK_N signal.	<p>Measure the voltage using a voltmeter. Input voltage should be: $24 < U < 27V$ and ACOK_N should be 0V.</p> <p>Make sure that connectors X1 and X2 are connected properly on both ends.</p> <p>The DC input connector X1 and ACOK_N connector X2 are shown in the Circuit Diagram in <i>Product manual - IRC5</i>.</p>	If the input voltage is correct, proceed with step 6. If no or the wrong input voltage is detected, troubleshoot DSQC 661.
6	The DSQC 662 may be faulty, replace it and verify that the fault has been fixed.	How to replace the unit is detailed in <i>Product manual - IRC5</i> .	

Continues on next page

Trouble shooting flowchart

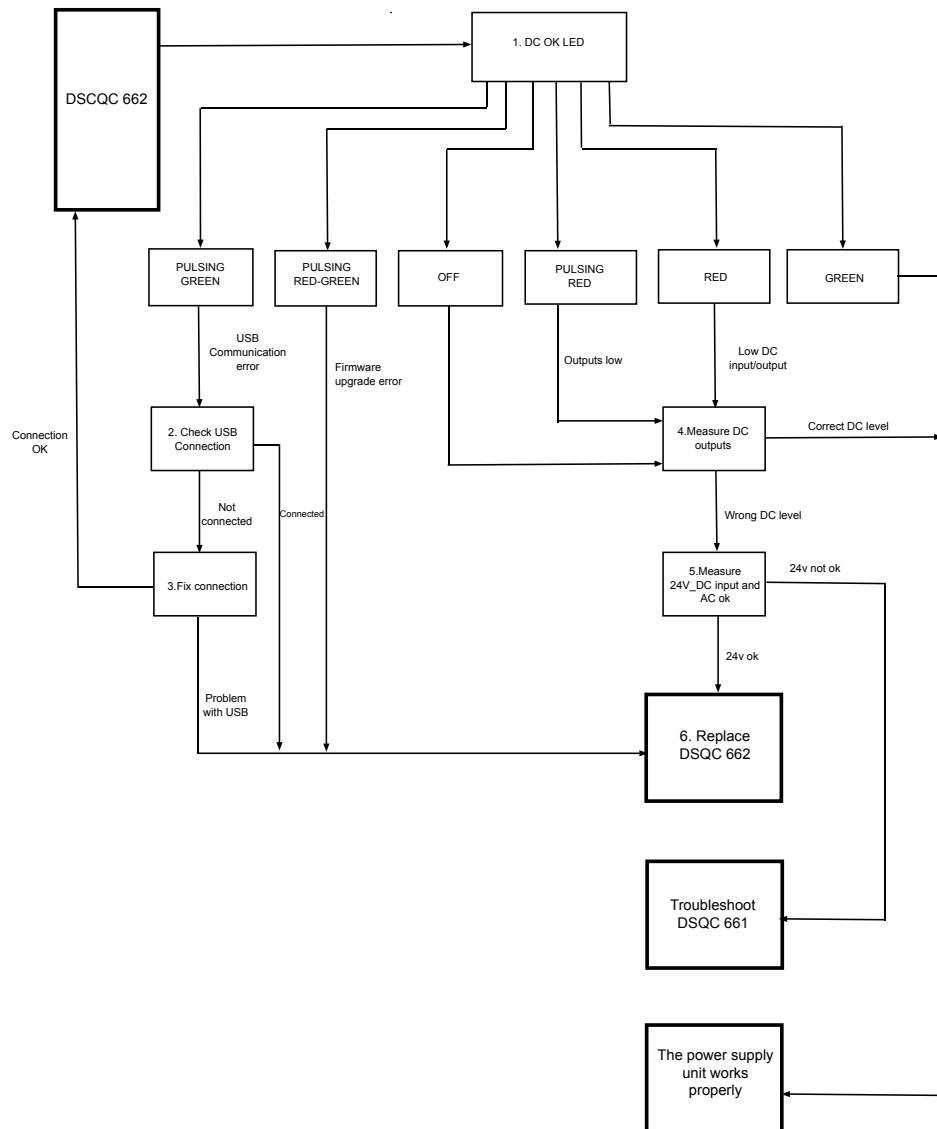


xx1200001314

4 Trouble shooting by unit

4.11 Trouble shooting the contactor interface board

Location

The illustration below shows the location of the contactor interface board, DSQC 611, in the controller.

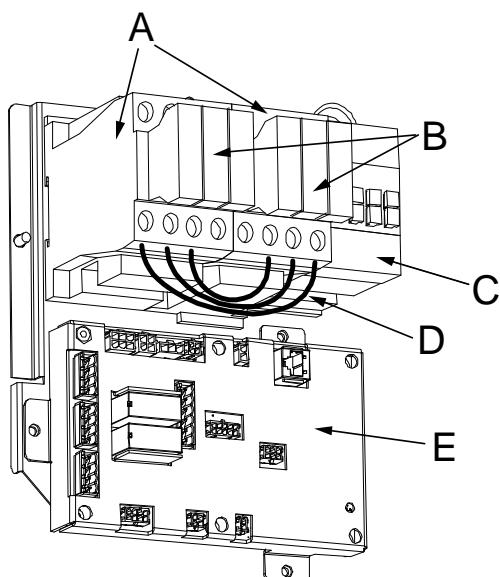


xx0400001058

A	MOTOR ON contactor K42
B	MOTOR ON contactor K43
C	Brake contactor
D	Jumpers (3pcs)
E	Contactor interface board

LEDs

The illustration below shows the LEDs on the Contractor interface board:

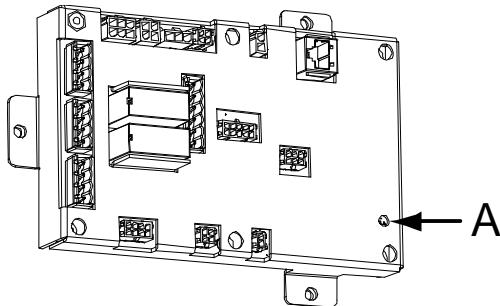

xx0400001091

A	Status LED
---	------------

Continues on next page

4.11 Trouble shooting the contactor interface board

Continued


Description	
Status LED	GREEN flashing: serial communication error. GREEN steady: no errors found and system is running. RED flashing: system is in power-up/self-test mode. RED steady: other error than serial communication error.

4 Trouble shooting by unit

4.12 Trouble shooting the customer I/O power supply

Location

The customer I/O power supply, DSQC 609, is located as shown in the figure below.

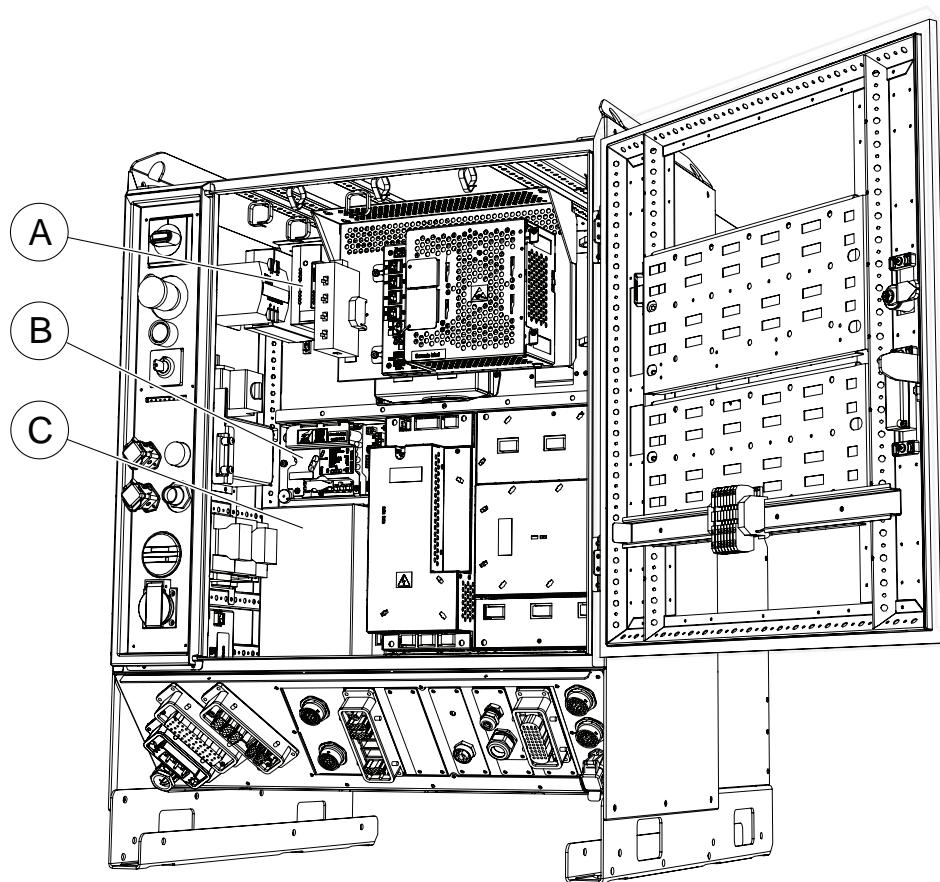

A	Customer I/O power supply
B	Power distribution board
C	System power supply



CAUTION


If there are two or more Customer I/O power supply units mounted in a row and too close to each other, there will be a heating problem and the units can be damaged.

To avoid damaging the Customer I/O power supply units, the units must be separated with 3 pcs of exterior support.

Continues on next page

LEDs

The illustration below shows the LEDs on the Customer Power Supply Module:

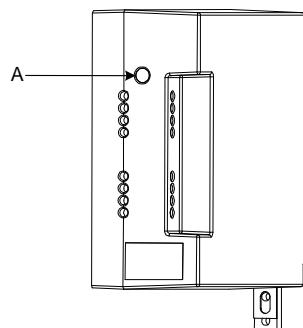

en1000000037

A	DCOK indicator
Description	Significance
DCOK indicator	GREEN: When all DC outputs are above the specified minimum levels. OFF: When one or more DC output/s below the specified minimum level.

This page is intentionally left blank

5 Trouble shooting by event log

5.1 Event log messages

Type of event log messages

The IRC5 supports three types of event log messages:

Type	Description
Information	These messages are used to log information into the event log, but that do not require specific actions on the part of the user. Informational messages do not take focus on a display device for the controller.
Warning	These messages are used to remind the user that something is not necessarily correct in the system but that operation continues. These messages are placed into the event log but do not take focus on a display device.
Error	These messages indicate something is seriously wrong with the system and that operation has stopped. They are used when an immediate action should be taken by the user.



Note

The message type is not contained in the actual message text, but in the code itself when the message is generated. Messages can only appear as one type and the message should be written to provide information about its type.



Note

The version of the translated event logs as shown in the translated manuals may differ slightly to the English version due to late corrections.

5 Trouble shooting by event log

5.2 How to read RAPID event log messages

5.2 How to read RAPID event log messages

Event number series

The event messages are divided into the following groups depending on which part of the robot system it refers to.



Note

Not all event log messages are translated to all languages. However, the English version of the manual contains all event log messages that are included in the related RobotWare release.

Number series	Type of event
1 xxxx	Operational events; events dealing with handling of the system.
2 xxxx	System events; events dealing with system functions, system states, and so on.
3 xxxx	Hardware events; events dealing with system hardware, manipulators as well as controller hardware.
4 xxxx	Program events; events dealing with RAPID instructions, data, and so on.
5 xxxx	Motion events; events dealing with the control of the manipulator movements and positioning.
7 xxxx	I/O events; events dealing with inputs and outputs, data buses, and so on.
8 xxxx	User events; events defined by the user.
9 xxxx	Functional safety events; events related to functional safety.
11 xxxx	Process events; application specific events, arc welding, spot welding, and so on. 0001 - 0199 Continous Application Platform 0200 - 0399 Discrete Application Platform 0400 - 0599 Arc 0600 - 0699 Spot 0700 - 0799 Bosch 0800 - 0899 Dispense 1000 - 1200 Pick and Place 1400 - 1499 Production manager 1500 - 1549 BullsEye 1550 - 1599 SmartTac 1600 - 1699 Production Monitor 1700 - 1749 TorchClean 1750 - 1799 Navigator 1800 - 1849 Arcitec 1850 - 1899 MigRob 1900 - 2399 PickMaster RC 2400 - 2449 AristoMig 2500 - 2599 Weld Data Monitor 2600 - 2649 GSI 2700 - 2702 Integrated Vision 4800 - 4814 Miscellaneous Process

Continues on next page

5 Trouble shooting by event log

5.2 How to read RAPID event log messages

Continued

Number series	Type of event
12 xxxx	Configuration events; events dealing with the configuration of the system.
13 xxxx	Paint
15 xxxx	RAPID
17 xxxx	Remote Service Embedded event logs which are generated during starting, registering, unregistering, losing connectivity, and so on.

5 Trouble shooting by event log

5.3 1 xxxx

5.3 1 xxxx

10002, Program pointer has been reset

Description

The program pointer of task *arg* has been reset.

Consequences

When started, program execution will start on the first instruction of the task's entry routine. NOTE that the manipulator may move to unexpected position when restarted!

Probable causes

The operator has probably requested this action manually.

10009, Work memory full

Description

The task *arg* has no memory left for new RAPID instructions or data.

Recommended actions

Save the program and then restart the system.

10010, Motors OFF state

Description

The system is in the Motors OFF state. It enters this state either after switching from Manual mode to Automatic, or after the Motors ON circuit has been opened during program execution.

Consequences

No operation will be possible until after closing the Motors ON circuit. The manipulator's axes are meanwhile held in position by mechanical holding brakes.

10011, Motors ON state

Description

The system is in the Motors ON state.

Consequences

The Motors ON circuit has been closed, enabling power supply to the manipulator's motors. Normal operation may be resumed.

10012, Safety guard stop state

Description

The system is in the Guard stop state. It enters this state either after switching from Automatic mode to Manual, or after the Motors ON circuit has been opened by an Emergency Stop, General Stop, Automatic Stop or Superior Stop, or in manual mode if enabling device was released.

Continues on next page

Consequences

No operation will be possible until after closing the Motors ON circuit. The manipulator's axes are meanwhile held in position by mechanical holding brakes.

Probable causes

Any safety device connected to the system's stop inputs have been opened. These are shown in the Circuit Diagram.

Recommended actions

1. Check which safety device caused the stop.
2. Close the device.
3. To resume operation, switch the system back to state Motors ON.

10013, Emergency stop state

Description

The system is in the Emergency stop state, since the Motors ON circuit has been opened by an Emergency Stop device.

Consequences

All program execution and thus robot actions are immediately halted. The robot axes are meanwhile held in position by mechanical holding brakes.

Probable causes

Any emergency stop device connected to the emergency stop input have been opened. These may be internal (on the controller or on the FlexPendant) or external (devices connected by the system builder). The internal devices are shown in the Circuit Diagram.

Recommended actions

1. Check which emergency stop device caused the stop.
2. Close/reset the device.
- 3) To resume operation, switch the system back to state Motors ON by pressing this button on the Control Module.

10014, System failure state

Description

Execution of all NORMAL tasks has been stopped due to malfunction.

Consequences

No start of program execution or manual manipulator jogging will be possible until after the system has been restarted.

Probable causes

A large number of malfunctions may cause this condition. Please use the FlexPendant or RobotStudio to check other event log messages for events occurring at this time!

Recommended actions

1. Determine what caused the stop by studying the event log.
2. Remedy the fault.
3. Restart the system as detailed in the Operator's Manual.

10015, Manual mode selected**Description**

The system is in the Manual mode.

Consequences

Programmed operation is possible, but only with a max. speed of 250 mm/s. The manipulator may also be jogged manually after pressing the enabling device on the FlexPendant.

10016, Automatic mode requested**Description**

The system has been ordered to go to the Automatic mode.

Consequences

The system will go to the Automatic mode after confirmed from FlexPendant.

10017, Automatic mode confirmed**Description**

The system is in the Automatic mode.

Consequences

The enabling device is disconnected. The robot can move without human intervention.

10018, Manual mode full speed requested**Description**

The system has been ordered to go to the Manual mode without any speed restraints.

Consequences

The system will go to the Manual mode full speed.

10019, Manual mode full speed confirmed**Description**

The system is in the Manual mode without any speed restraints.

Consequences

Programmed operation is possible while pressing the hold-to-run button on the FlexPendant. The manipulator may also be jogged manually after pressing the enabling device on the FlexPendant.

10020, Execution error state**Description**

The program execution in task *arg* has been stopped due to a spontaneous error.

Consequences

No program execution will be possible until the error has been removed.

Probable causes

A large number of malfunctions may cause this condition. Please use the FlexPendant or RobotStudio to check other event log messages for events occurring at this time!

Recommended actions

1. Determine what caused the stop by studying the event log.
2. Remedy the fault.
3. If necessary, move Program Pointer to main before pressing start button.

10021, Execution error reset**Description**

The program execution in task *arg* has left a spontaneous error state.

10024, Collision triggered**Description**

Some mechanical part of the manipulator has collided with a piece of fixed equipment in the cell.

Consequences

Manipulator movement is interrupted and program execution is stopped.

10025, Collision confirmed**Description**

The collision detection has been confirmed.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

Recommended actions

10026, Collision retraction

Description

The manipulator has attempted to back away from the obstacle, into which it collided, and succeeded.

Consequences

The system is ready to go back to normal operation.

10027, Collision retraction fail

Description

The manipulator has attempted to back away from the obstacle, into which it collided, and failed.

Consequences

The system is NOT ready to go back to normal operation.

Probable causes

This may be caused by the robot being stuck to the object into which it collided.

Recommended actions

- 1) Go to Manual Mode.
- 2) Manually run the robot away from the object.
- 3) Resume operation by restarting the program.

10030, All axes commutated

Description

After checking, the system has found all manipulator axes to be commutated.

Consequences

Normal operation is possible.

10031, All axes calibrated

Description

After checking, the system has found all manipulator axes to be calibrated.

Consequences

Normal operation is possible.

10032, All revolution counters updated

Description

After checking, the system has found all revolution counters for all manipulator axes to be updated.

Consequences

Normal operation is possible.

10033, All axes synchronized

Description

After checking, the system has found all manipulator axes to be synchronized.

Consequences

Normal operation is possible.

10034, Axis not commutated

Description

After checking, the system has found that one or more manipulator axes are not commutated.

Consequences

To enable operation, all manipulator axes must be commutated.

Probable causes

The manipulator drive motor and related units may have been altered, e.g. after replacing a faulty unit.

Recommended actions

Commutate the manipulator axes as detailed in the manipulator Product Manual.

10035, Axis not calibrated

Description

After checking, the system has found that one or more manipulator axes are not calibrated.

Consequences

To enable operation, all manipulator axes must be calibrated.

Probable causes

The manipulator drive motor and related units may have been altered, e.g. after replacing a faulty unit.

Recommended actions

Calibrate the manipulator axes as detailed in the manipulator Product Manual.

10036, Revolution counter not updated

Description

After checking, the system has found that the revolution counters of one or more manipulator axes are not updated.

Consequences

To enable operation, the revolution counters of all manipulator axes must be updated.

Probable causes

The manipulator drive motor and related units may have been altered, e.g. after replacing a faulty unit.

Continues on next page

Recommended actions

Update the revolution counters of all manipulator axes as detailed in the manipulator Product Manual.

10037, Axis not synchronized**Description**

After checking, the system has found that one or more manipulator axes are not synchronized.

Consequences

To enable operation, all manipulator axes must be synchronized.

Probable causes

The manipulator drive motor and related units may have been altered, e.g. after replacing a faulty unit.

Recommended actions

Synchronize the manipulator axes as detailed in the manipulator Product Manual.

10038, Robot memory is OK**Description**

During startup, the system has found that all data in the robot memory is OK.

Consequences

Operation is possible.

10039, Robot memory is not OK**Description**

During startup, the system has found that data in the robot memory is not OK.

Consequences

All data must be OK before automatic operation is possible. Manually jogging the robot is possible.

Probable causes

There are differences between the data stored in the robot and the controller. This may be due to replacement of SMB-board, controller or both.

Recommended actions

1) Update the robot memory as detailed in Operator's Manual, IRC5.

10040, Program loaded**Description**

A program or program module has been loaded into task arg.

After loading, arg bytes memory remain. The size of the loaded program is arg bytes.

10041, Program deleted**Description**

A program or program module was deleted from task arg.

Consequences

If the deleted program contained the task entry routine, the program will no longer be executable.

Probable causes

The program may have been removed manually.

Recommended actions

- 1) Define an entry routine in one of the task's remaining programs, or:
- 2) Load a program containing an entry routine.

10042, Axis synchronized**Description**

A fine calibration or update of revolution counter(s) was made.

10043, Restart failed**Description**

The task arg can't restart.

10044, Program Pointer updated**Description**

The task arg could have changed the Program Pointer position.

Recommended actions

10045, System restarted**Description**

System was restarted.

Recommended actions

10046, System reset**Description**

Loading the original system installation settings.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

Recommended actions

10048, Background task did stop

Description

The task *arg* stopped without reason.

Recommended actions

10051, Event routine error

Description

The task *arg* could not start the specified system event routine *arg*. The routine is either unknown to the system or the program is unlinkable.

Recommended actions

Insert the routine in a system module or correct the program.

10052, Regain start

Description

A regain movement has started.

Recommended actions

10053, Regain ready

Description

The regain movement is ready.

Recommended actions

10054, Regain rejected

Description

Regain on path not possible, as one client has already ordered it.

Recommended actions

A new regain movement is ordered during an already started regain movement. Reduce the number of start orders from e.g. system I/O

10055, Path process restarted

Description

The path process has been restarted.

Recommended actions

10060, Test of enable chain

Description

The enable chain is always tested at startup. If the test failed an error message concerning enable will follow.

Recommended actions

If enable chain test at startup failed the related error message will be "Enable chain timeout"

10061, A target has been modified

Description

A target in module *arg* in task *arg* has been modified or tuned. Start line *arg*, column *arg*, end line *arg*.

10062, A module has been edited.

Description

Module *arg* in task *arg* has been edited between lines: *arg*, *arg* by *arg*.

10063, Module has been edited

Description

Module *arg* in task *arg* has been edited.

10064, A module has been erased.

Description

Module *arg* in task *arg* has been erased.

10065, New user has started to modify RAPID.

Description

User *arg* has started with RAPID program modifications in task *arg*.

10066, Not possible to load system module

Description

System module *arg* in task *arg* cannot be loaded since the file is not found.

10067, Program Pointer Reset

Description

Unable to reset the program pointer for task *arg*.

Consequences

The program will not start.

Continues on next page

Probable causes

- No program is loaded.
- The main routine is missing.
- There are errors in the program.

Recommended actions

1. Load program if no program is loaded.
2. Check that the program has a main routine. If there is no main routine, add one.
3. Check for errors in the program and correct them.
4. See previous error messages in the Event log.

10068, Start Program**Description**

Unable to start program for task *arg*.

Consequences

The program will not execute.

10074, NFS server up**Description**

The control system communicates correctly with the NFS server *arg*.

10075, NFS server down**Description**

The control system is not able to communicate correctly with the NFS server *arg*.

Consequences

If the server *arg* is defined as TRUSTED, robot program execution will be stopped. If the server is defined as NON-TRUSTED, execution will proceed. These definitions are specified in the Application manual - Robot communication and I/O control.

Probable causes

If this message is displayed at first start-up, the server configuration may be incorrect. If displayed during operation, the previously working communication has been lost due to a broken connection. Also see the I/O event log!

Recommended actions

1. Check the NFS server configuration.
2. Check all communication hardware, cables and such.
3. Check NFS client configuration on the controller.

10076, FTP server up**Description**

The control system communicates correctly with the FTP server *arg*.

10077, FTP server down**Description**

The control system is not able to communicate correctly with the FTP server *arg*.

Consequences

If the server *arg* is defined as TRUSTED, robot program execution will be stopped. If the server is defined as NON-TRUSTED, execution will proceed. These definitions are specified in the Application manual - Robot communication and I/O control.

Probable causes

If this message is displayed at first start-up, the server configuration may be incorrect. If displayed during operation, the previously working communication has been lost due to a broken connection. Also see the I/O event log!

Recommended actions

1. Check the FTP server configuration.
2. Check all communication hardware, cables and such.
3. Check the FTP client configuration on the controller.

10078, A module has been edited**Description**

Module *arg* in task *arg* has been edited before line: *arg* by *arg*.

10079, A module has been edited**Description**

Module *arg* in task *arg* has been edited after line: *arg* by *arg*.

10080, An updated RAPID file is found**Description**

The SEMISTATIC task *arg* has an older version of a module installed than the source *arg*

Recommended actions

Restart the system with a "Reset RAPID" to install the newer version.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

10081, Background task arg

Description

Failed to load a newer version of a module. The source of the module is *arg*.

Recommended actions

See previous messages for the possible root cause or restart the system with a "Reset RAPID" to load the newer version.

10082, RAPID Task supervision

Description

Task *arg* is not running. The system will be set in SysFail state. It's now impossible to change to motors on *arg*.

Recommended actions

See previous messages for the cause. Restart the system to reset the error state.

10083, RAPID Task supervision

Description

Task *arg* is not running. The system will be set in motors off state. *arg*

Recommended actions

See previous messages for the cause.

10084, RAPID Task supervision

Description

Task *arg* is not running. All NORMAL tasks will also be stopped.

Recommended actions

See previous messages for the cause.

10085, RAPID Task supervision

Description

Task *arg* can't be stopped. The trustLevel is set to a safety level.

Recommended actions

If the task should be possible to stop change the trustLevel or task type in the system parameters menu.

10086, Robot is purged OK

Description

Purging pressure regained after a purge fault.

Recommended actions

10087, Purge state: *arg*.

Description

State changed.

Recommended actions

10090, Reset RAPID done

Description

Reset RAPID is done.

Consequences

After restart the system's state will be resumed except for manually loaded programs and modules. Static and semistatic tasks are restarted from the beginning, not from the state they had when the system was stopped.

Modules will be installed and loaded in accordance with the set configuration. System parameters will not be affected.

Probable causes

1. Reset RAPID was ordered by the user.
2. The system forced Reset RAPID due to inconsistent data, malfunction or unrecoverable task state.

10091, Restart not possible

Description

A restart after collision detection is not possible before acknowledge the error dialogue.

Recommended actions

10092, (Re)start not possible

Description

(Re)start is not possible due to lost contact with IO module *arg* configured with trustlevel.

Recommended actions

10093, (Re)start not possible

Description

(Re)start of task *arg* is not possible before a controller restart is done.

Recommended actions

The background task is configured with Trustlevel set to SysHalt

Continues on next page

10095, At least one task is unchecked in the task selection panel**Description**

One or more of the NORMAL tasks are unchecked in the task selection panel when performing a (re)start.

Recommended actions

10096, arg not active!**Description**

The workobject *arg* contains a coordinated mechanical unit which is not activated.

Recommended actions

Activate the mechanical unit and perform the operation again.

10097, Restart not possible**Description**

The task *arg* is set in blocked state and the program is for that reason not possible to restart from the current program position.

Recommended actions

The Program Pointer must be moved before restart.

10098, Restart not possible**Description**

The task *arg* has been in system failure state and the program is for that reason not possible to restart from the current program position.

Recommended actions

The Program Pointer must be moved before restart.

10099, Program start rejected**Description**

The system has performed a soft stop, and the program may not be restarted.

Consequences

The system goes to the Motors OFF state and cannot be started. The full meaning of this status is described in the Trouble shooting manual, IRC5.

Probable causes

The soft stop may be caused by opening the safety circuit.

Recommended actions

- 1) Check the safety circuits for an open switch.
- 2) Go to Motors ON and restart the program.

10106, Service Message**Description**

It's time for service for robot *arg* because it is *arg* days since the last service.

Recommended actions

10107, Service Message**Description**

It remains *arg* days for robot *arg* until it's time for service.

Recommended actions

10108, Service Message**Description**

It's time for service for robot *arg* cause it's *arg* hours of production since last service.

Recommended actions

10109, Service Message**Description**

It remains *arg* hours of production for robot *arg* to next service.

Recommended actions

10110, Service Message**Description**

The gearbox at *arg* of robot *arg* needs service.

Recommended actions

10111, Service Message**Description**

The gearbox at *arg* of robot *arg* has reached *arg* of its service interval.

Recommended actions

10112, Service Message**Description**

The system date and time has changed.

This could cause problems with the SIS calendar notification.

Recommended actions

The SIS parameters Calendar Limit and Calendar Warning might need to be changed

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

10115, Serial memory data are moved from robot memory to controller memory

Description

Serial memory data are moved from robot memory to controller memory by *arg*.

Recommended actions

10116, Serial memory data are moved from controller memory to robot memory

Description

Serial memory data are moved from controller memory to robot memory by *arg*.

Recommended actions

10117, Serial memory data in robot memory is cleared

Description

Serial memory data in robot memory is cleared by *arg*.

Recommended actions

10118, Serial memory data in controller memory is cleared

Description

Serial memory data in controller memory is cleared by *arg*.

Recommended actions

10120, Program stopped

Description

The task *arg* has stopped. The reason is that an external or internal stop after current instruction has occurred.

Recommended actions

10121, Program stopped

Description

The task *arg* has stopped. The reason is that the task has reached an exit instruction.

Recommended actions

10122, Program stopped

Description

The task *arg* has stopped. The reason is that the task is ready.

Recommended actions

10123, Program stopped

Description

The task *arg* has stopped. The reason is that the task is ready with this step.

Recommended actions

10124, Program stopped

Description

The task *arg* has stopped. The reason is that the task has reached a break instruction.

Recommended actions

10125, Program stopped

Description

The task *arg* has stopped. The reason is that an external or internal stop has occurred.

Recommended actions

10126, Program stopped

Description

The task *arg* has stopped. The reason is that an error has occurred.

Recommended actions

10127, Backward execution not possible

Description

The task *arg* has stopped. The reason is that it is not possible to execute backward past beginning of instruction list.

Recommended actions

10128, Backward execution not possible

Description

The task *arg* has stopped. The reason is that it is not possible to execute backward past the instruction.

Recommended actions

10129, Program stopped

Description

The task *arg* has stopped. The reason is that the event routine for RESET or POWER_ON is ready.

Continues on next page

Recommended actions**10130, Program stopped****Description**

The task *arg* has stopped. The reason is that the task is ready with this move step.

Recommended actions**10131, Program stopped****Description**

The task *arg* has stopped. The reason is that the routine called from system IO interrupt or a service routine is ready.

Recommended actions**10132, Program stopped****Description**

The task *arg* has stopped. The reason could not be determined.

Recommended actions**10133, Program stopped****Description**

The task *arg* has stopped. The reason is that the task is ready with the execution of the UNDO handlers.

10134, POWER_ON event routine stopped**Description**

The system was stopped while execution a POWER_ON event routine.

Consequences

WARNING: Moving program pointer will leave the system in an undefined state because many applications rely on the POWER_ON routine completion.

Probable causes

POWER_ON event routines can be stopped for many reasons. You may need to look for other event log messages but the normal ones are:

- 1) Stop button
- 2) Rapid Stop instruction
- 3) Execution error

Recommended actions

Unless there is an error then the POWER_ON routines will complete their task if you press start and when done then

execution will stop again, without any normal RAPID code being executed.

10135, Program stopped**Description**

The task *arg* has stopped. The reason is that an external or internal stop after current cycle has occurred.

Recommended actions**10136, Program stopped****Description**

The task *arg* has stopped. The reason is that the task has reached a stop instruction.

Recommended actions**10137, Program stopped****Description**

The task *arg* has stopped. The reason is that the task has reached a stop\AllMoveTask instruction.

Recommended actions**10138, Program stopped****Description**

The task *arg* has stopped. The reason is that an stop from system input has occurred.

Recommended actions**10140, Speed adjusted****Description**

The speed has been adjusted to *arg%* by *arg*.

10141, Program pointer moved to cursor**Description**

The program pointer of task *arg* in module *arg* has been moved to position *arg* by *arg*.

10142, Call routine**Description**

The program pointer in task *arg* has been moved to routine *arg* by *arg*.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

10143, Cancel call routine

Description

The execution of the called routine has been canceled in task *arg* by *arg*.

10144, Simulate of Wait instruction

Description

A wait instruction (WaitTime, WaitUntil, WaitDO, etc.) has been simulated in task *arg* by *arg*.

Recommended actions

10145, Task selection panel is set

Description

Task *arg* has been added in Task Selection Panel by *arg*.

Recommended actions

10146, Task selection panel is cleared

Description

Task *arg* has been removed in Task Selection Panel by *arg*.

Recommended actions

10147, Setting of variable

Description

Variable *arg* has changed to value *arg* by *arg*.

Recommended actions

10148, Setting of IO

Description

IO signal *arg* has changed value to *arg* by *arg*.

Recommended actions

10149, Program Pointer moved to routine

Description

The program pointer in task *arg* has been moved to routine *arg* by *arg*.

Recommended actions

10150, Program started

Description

Execution of task *arg* has been started from the first instruction of the task's entry routine. The originator could not be determined.

Continues on next page

Recommended actions

10151, Program started

Description

Execution of task *arg* has been started from the first instruction of the task's entry routine. The originator is an external client.

Recommended actions

10152, Program started

Description

Execution of task *arg* has been started from the first instruction of the task's entry routine. The start order was initiated by an action causing the UNDO handler to execute.

10153, Run mode is changed

Description

Run mode has been changed to single cycle by *arg*.

10154, Run mode is changed

Description

Run mode has been changed to contious mode by *arg*.

10155, Program restarted

Description

Execution of task *arg* has been restarted from where it was previously stopped. The originator could not be determined.

Recommended actions

10156, Program restarted

Description

Execution of task *arg* has been restarted from where it was previously stopped. The originator is an external client.

Recommended actions

10157, Program restarted

Description

Execution of task *arg* has been restarted from where it was previously stopped. The restart order was initiated by an action causing the UNDO handler to execute.

10158, Program started

Description

Stepwise forward execution of task *arg* has been started.

10159, Program started

Description

Stepwise backward execution of task *arg* has been started.

10170, Background task *arg*

Description

refuse to start. Task is empty.

Recommended actions

10171, Background task *arg*

Description

refuse to start. Wrong state.

Recommended actions

10172, Background task *arg*

Description

refuse to start. Can't set PP to the main routine.

Probable causes

The module that contains the main routine was not loaded since the module file is missing in the target directory.

The module that contains the main routine was not loaded since the configuration file has no entry for automatic loading of the module.

The main routine is missing.

The main entry is corrupted.

Recommended actions

Load the module manually or perform a system reset after the cause of the problem is removed.

10173, Background task *arg*

Description

refuse to start. Can't set the execution mode.

Recommended actions

10174, Background task *arg*

Description

refuse to start. The start order failed.

Recommended actions

10175, Background task *arg*

Description

refuse to start due to a syntax error.

Recommended actions

10176, Background task *arg*

Description

refuse to start. Can't load module.

Probable causes

The module file is missing in the target directory.

Recommended actions

1. Copy the module file to the target directory.
2. Reset the system.

10177, Task refuses to start

Description**Task *arg*:**

There is not sufficient program memory or the program memory is fragmented. Modules could be missing or data may not have been installed.

Recommended actions

1. Unload/reload modules and restart the system.
2. Split large data structures.
3. Do Reset RAPID.
4. Increase stack size for task.

10178, A static/semistatic task can't be stepped

Description

Task *arg* can't be started.

A static/semistatic task can only run in continuous mode.

Consequences

No tasks will be started.

Probable causes

Trying to step (forward or backward) a static/semistatic task.

Recommended actions

Start *arg* in continuous mode.

10185, Task could not be prepared for start

Description**Task *arg*:**

There is not sufficient program memory or the program memory is fragmented. Modules could be missing or data may not have been installed.

Recommended actions

1. Unload/reload modules and restart the system.
2. Split large data structures.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

3. Do Reset RAPID.

10190, Protected area not done

Description

A power fail did occur in the middle of a protected area for the task *arg*. The system is trying to selfheal.

Recommended actions

10191, Protected area not done

Description

A power fail did occur in the middle of a protected area for the task *arg*. A pending error is removed from the queue.

Recommended actions

10192, Protected area not done

Description

A power fail did occur in the middle of a protected area for the task *arg*. A pending exit is removed from the queue.

Recommended actions

10193, Protected area not done

Description

A power fail did occur in the middle of a protected area for the task *arg*. This may result in an extra program cycle.

Recommended actions

10194, Protected area not done

Description

A power fail did occur in the middle of a protected area for the task *arg*. The task will be restarted from the main routine.

Recommended actions

10195, Protected area not done

Description

A power fail did occur in the middle of a protected area for the task *arg*. All tasks are reset and all user programs are lost.

Recommended actions

Try to save the user program and restart the system.

10196, Protected area not done

Description

A power fail did occur in the middle of a protected area for the task *arg*.

Recommended actions

10200, Event logs are cleared

Description

User *arg* has cleared all event logs.

Recommended actions

10201, Event logs for one domain is cleared

Description

User *arg* has cleared domain *argX XXX*.

Recommended actions

10202, Date and/or time is changed

Description

Date and/or time is changed to *arg* by *arg*.

Recommended actions

10205, Configuration parameter changed

Description

A configuration parameter has been changed in domain:*arg*, type: *arg* by *arg*.

Recommended actions

10206, Configuration file has been loaded

Description

A configuration file *arg* has been loaded by *arg*.

Recommended actions

10210, Execution cancelled

Description

The restart will clear the execution in task *arg* of a POWER ON system event routine.

Continues on next page

Recommended actions**10211, Execution cancelled****Description**

The restart will clear the execution in task *arg* of a STOP system event routine.

Recommended actions**10212, Execution cancelled****Description**

The restart will clear the execution in task *arg* of an EMERGENCY STOP system event routine.

Recommended actions**10213, Execution cancelled****Description**

The restart will clear the execution in task *arg* of a START system event routine.

Recommended actions**10214, Execution cancelled****Description**

The restart will clear the execution in task *arg* of a RESTART system event routine.

Recommended actions**10215, Execution cancelled****Description**

The restart will clear the execution in task *arg* of a RESET system event routine.

Recommended actions**10216, Execution cancelled****Description**

The restart will clear the execution in task *arg* of an INTERNAL system event routine.

Recommended actions**10217, Execution cancelled****Description**

The restart will clear the execution in task *arg* of a USER routine.

Recommended actions**10218, Execution cancelled****Description**

The restart will clear the execution in task *arg*.

Recommended actions**10219, Execution cancelled****Description**

The restart will clear the execution in task *arg* of a STEP system event routine.

Recommended actions**10230, Backup step ready****Description**

The backup step Prepare is ready.

Recommended actions**10231, Backup step ready****Description**

The backup step Configuration is ready.

Recommended actions**10232, Backup step ready****Description**

The backup of Task is ready.

Recommended actions**10233, Backup step ready****Description**

The backup of Controller Settings is ready.

Recommended actions**10250, Restore step ready****Description**

The restore step Prepare is ready.

Recommended actions**10251, Restore step ready****Description**

The restore step Configuration is ready.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

Recommended actions

10252, Restore step ready

Description

The restore of Task is ready.

Recommended actions

10253, Restore step ready

Description

The restore of User Task is ready.

Recommended actions

10254, Restore step ready

Description

The restore of Controller Settings is ready.

Recommended actions

10255, Restore step ready

Description

The restore of Safety Settings is ready.

Recommended actions

10260, System diagnostics info generated

Description

System diagnostics information was successfully generated to file *arg*

10261, System diagnostics info unavailable

Description

User requested to save diagnostics system information to file *arg*. System was unable to fulfill this request.

Consequences

Diagnostics system information is normally used when reporting a problem with the system to ABB support.

Probable causes

The system is in such state that it is not possible to generate the requested information.

Please check that the device has enough space left.

Recommended actions

If you are experiencing a problem with the system contact ABB support.

10262, System log has been created

Description

A system log has been created.

A System Diagnostics has to be created using FlexPendant or RobotStudio.

Probable causes

The system log was triggered by the error event: *arg*

Recommended actions

Create a System Diagnostics and attach it to your error report if reported to ABB support.

10270, Cyclic Brake Check Done

Description

The Cyclic Brake Check has been done for all brakes supervised by Safety Controllers.

10271, Cyclic Brake Check Started

Description

The Cyclic Brake Check has been started.

10272, Brake Check Done

Description

The Brake Check has been done for all brakes.

10273, Brake Check Started

Description

The Brake Check has been started.

10274, Brake Maintenance

Description

The *arg* indicates that the mechanical brake for axis *arg* on mechanical unit *arg* is in need of brake maintenance.

Consequences

The brake maintenance is automatically started on axis *arg*. The brake will then be tested again.

10275, Brake Performance

Description

The *arg* shows that the mechanical brake for axis *arg* for mechanical unit *arg* is fully functional.

Continues on next page

10280, The coordinate system has been changed to World frame**Description**

The coordinate system has been changed to World frame in mechanical unit *arg* by *arg*.

10281, The coordinate system has been changed to Base frame**Description**

The coordinate system has been changed to Base frame in mechanical unit *arg* by *arg*.

10282, The coordinate system has been changed to Tool frame**Description**

The coordinate system has been changed to Tool frame in mechanical unit *arg* by *arg*.

10283, The coordinate system has been changed to Object frame**Description**

The coordinate system has been changed to Object frame in mechanical unit *arg* by *arg*.

10284, Non motion execution mode is set**Description**

The non motion execution mode has been set by *arg*.

Consequences

The mechanical unit will not move when executing.

10285, Non motion execution mode has been reset**Description**

The non motion execution mode has been reset by *arg*.

Consequences

The mechanical unit will move while executing.

10286, Payload has been changed**Description**

The payload has been changed to *arg* in task *arg* by *arg*.

10287, Total load has been changed**Description**

The total load has been changed to *arg* in task *arg* by *arg*.

10288, The Work Object has been changed**Description**

The Work object has been changed to *arg* in task *arg* by *arg*.

10289, The tool has been changed**Description**

The tool has been changed to *arg* in task *arg* by *arg*.

10290, The robot has been calibrated**Description**

The mechanical unit *arg*, axis *arg* has been calibrated by *arg*.

10291, Goto position**Description**

The functionality Goto position has been used by *arg*.

10292, Revolution Counter updated**Description**

The revolution counter for robot *arg*, axis *arg* has been updated by *arg*.

10293, Path Supervision is set to On**Description**

The Path supervision for task *arg* is set to On by user: *arg*.

10294, Path Supervision is set to Off**Description**

The Path supervision for task *arg* is set to Off by user: *arg*.

10295, The Sensitivity for Path Supervision is updated**Description**

The Sensitivity for task *arg* for Path Supervision is set to *arg%* by user: *arg*.

10296, Jog Supervision is set to On**Description**

The Jog supervision for task *arg* is set to On by user: *arg*.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

10297, Jog Supervision is set to Off

Description

The Jog supervision for task *arg* is set to Off by user: *arg*.

10298, The Sensitivity for Jog Supervision is updated

Description

The Sensitivity for task *arg* for Jog Supervision is set to *arg%* by user: *arg*.

10300, A Reset RAPID is ordered

Description

Reset RAPID has been ordered from the system.

Recommended actions

10301, Reset RAPID is ordered

Description

Reset RAPID has been ordered manually or automatically during a configuration.

Recommended actions

10304, An update has been ordered

Description

An update of program configuration is done.

Recommended actions

10350, Update of task failed

Description

The system could not update task *arg* to the new configuration.

Recommended actions

10351, A task is removed

Description

The task *arg* was removed because of configuration changes.

Recommended actions

10352, A task is added

Description

The task *arg* was installed because of configuration changes.

Recommended actions

10353, A task is reinstalled

Description

The task *arg* was reinstalled because of configuration changes.

Recommended actions

10354, Restore aborted due to lost system data.

Description

The system is using a backup of the system data, since the system data was not properly saved at last shutdown. Due to this, a previously ordered Restore from directory *arg* was attempted again, but was aborted.

Consequences

No RAPID programs or modules will be loaded.

Probable causes

The system data was not properly saved at last shutdown.

Recommended actions

After recovering from the system data loss by a (B)backup-Restart or system re-installation, please verify that the backup directory *arg* is OK, and perform the Restore again.

10355, Restore error

Description

Error during the restore of Task. Trying to load to unknown task, *arg*.

Consequences

Loading has been aborted for *arg*.

Probable causes

The current system doesn't have the same options as the one used to create the backup.

10400, User *arg* logged on

Description

User *arg* logged on using *arg*.

10401, User *arg* logged off

Description

User *arg* using *arg* logged off.

Continues on next page

10420, New unsafe robot path

Description

The robot path has been cleared after a target has been modified in task *arg*. The robot will for that reason move towards the position pointed out by the move instruction at the program pointer. Move instructions between the modified target and the program pointer will be skipped.

Consequences

The programmed speed is used for this movement.
The new untested path may contain obstacles that might cause a collision.

Recommended actions

Check your program pointer and move it if necessary.
Reduce the speed.

10421, Planned path not aborted

Description

A target that may be part of the planned robot path has been modified. The new target position will be used the next time the instruction with the target is executed.

Consequences

The current planned path is using the old target position.

Recommended actions

If the current planned path is unsafe, move the program pointer to abort it.

10450, Update package rejected by the controller

Description

It was not possible to prepare update of the current RobotWare system using update package with ID: *arg*. Error code is: *arg*.

Consequences

The system remains unchanged.

Recommended actions

Contact the package provider or ABB support.

10451, Update of RobotWare System failed

Description

It was not possible to apply update of the current RobotWare system using update package with ID: *arg*. Error code is: *arg*.

Consequences

The system remains unchanged.

Recommended actions

Contact the update Deployment Package provider or ABB support.

10452, Update of RobotWare System done

Description

Update of the current RobotWare system using the Deployment Package '*arg*' has been successful.

A file with update summary can be found at the following location: *arg*.

Backup of the system prior to the update is located at: *arg*.
Status code for auto restore of the backup: *arg*
(0=pending/1=failed/2=not requested).

Consequences

The current system has been updated as specified by the update package.

10453, Update package deleted

Description

Update package with the following ID: *arg* was deleted from the controller.

Consequences

Update package is no longer available. Disk space used by the package has been reclaimed.

10454, Incomplete update package deleted

Description

Incomplete update package with the following ID: *arg* was deleted from the controller.

Consequences

Disk space used by the update has been reclaimed.

10455, Update of RobotWare System error

Description

Update of the current RobotWare System did not complete properly.

Consequences

The current RobotWare system may be in an undefined state and it may need to be repaired.

Recommended actions

- 1) Manually check if all products in the current system have expected versions and then load a backup if desired.
- 2) Delete and re-install the current RobotWare system.
- 3) Use disk recovery functionality.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

11020, Backup error

Description

An error occurred while preparing to create a backup.
Unknown error.

Consequences

The backup request is aborted.
No backup was created.

Recommended actions

arg

11024, Backup error

Description

An error occurred while preparing to create a backup.
A directory/file couldn't be created.

Consequences

The backup request is aborted.
No backup was created.

Probable causes

You may not have write access to the backup drive.
The drive might be full.
If it is a network drive, you might have lost connection.

Recommended actions

- 1) Verify that the backup drive isn't write protected
 - 2) If it is a network drive, verify that controller hasn't lost contact
-

11025, Backup error

Description

An error occurred while preparing to create a backup.
The backup directory couldn't be created.

Consequences

The backup request is aborted.
No backup was created.

Probable causes

The path might be too long.
You may not have write access to the backup drive.
The drive might be full.
If it is a network drive, you might have lost connection.

Recommended actions

- 1) Verify that the backup drive isn't write protected
 - 2) If it is a network drive, verify that controller hasn't lost contact
-

11026, Backup error

Description

An error occurred while preparing to create a backup.
Error while creating the backinfo.txt file.

Consequences

The backup request is aborted.
No backup was created.

Probable causes

You may not have write access to the backup drive.
The drive might be full.
If it is a network drive, you might have lost connection.

Recommended actions

- 1) Verify that the backup drive isn't write protected
 - 2) If it is a network drive, verify that controller hasn't lost contact
-

11029, Backup error

Description

An error occurred while preparing to create a backup.
The given backup path is too long.

Consequences

The backup request is aborted.
No backup was created.

Probable causes

The given backup path has exceeded the maximum allowed
arg characters.

Recommended actions

Use a shorter path to create the backup.

11031, Backup error

Description

An error occurred while preparing to create a backup.
Error while searching for a file/entry.

Consequences

The backup request is aborted.
No backup was created.

Recommended actions

arg

11036, Backup error

Description

An error occurred while preparing to create a backup.
Write error.

Continues on next page

Consequences

The backup request is aborted.

No backup was created.

Probable causes

You may not have write access to the backup drive.
The drive might be full.
If it is a network drive, you might have lost connection.
Do not create a backup inside the HOME directory.

Recommended actions

arg

11037, Backup error

Description

An error occurred while preparing to create a backup.
At least one modules name is too long.

Consequences

The backup request is aborted.
No backup was created.

Recommended actions

arg

11039, Backup error

Description

An error occurred while preparing to create a backup.
The drive is full.

Consequences

The backup request is aborted.
No backup was created.

Recommended actions

arg

11041, Backup error

Description

An error occurred while preparing to create a backup.
Error while verifying the system.
system.xml isn't installed in the system

Consequences

The backup request is aborted.
No backup was created.

Probable causes

system.xml isn't installed in the system

Recommended actions

Reset the system.

11042, Backup error

Description

An error occurred while preparing to create a backup.

Error while verifying the system.

system.xml isn't present in the SYSTEM directory.

Consequences

The backup request is aborted.
No backup was created.

Probable causes

system.xml isn't present in the SYSTEM directory.

Recommended actions

Reset the system.

11043, Backup error

Description

An error occurred while preparing to create a backup.
Error while verifying the system.
linked_m.sys isn't present in the HOME directory.

Consequences

The backup request is aborted.
No backup was created.

Probable causes

linked_m.sys isn't present in the HOME directory.

Recommended actions

Reset the system.

11044, Backup error

Description

Error while verifying the backup path.

Consequences

The backup request is aborted.
No backup was created.

Probable causes

The backup path contains an invalid character.

Recommended actions

Verify the backup path.

11045, Backup error

Description

Error while creating the backup directory due to missing access rights.

Consequences

The backup request is aborted.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

No backup was created.

Probable causes

Missing access rights in the given backup path.

Recommended actions

Verify the access rights.

11120, Backup error

Description

Error during the backup step Configuration.

Unknown error.

Consequences

The backup request is aborted.

No backup was created.

11127, Backup error

Description

Error during the backup step Configuration.

Error while reading configuration parameters.

Consequences

The backup request is aborted.

No backup was created.

11128, Backup error

Description

Error during the backup step Configuration.

Error writing configuration parameters.

Consequences

The backup request is aborted.

No backup was created.

Probable causes

1) The destination is write protected.

2) The controller has lost contact with a mounted device (e.g.

NFS, FTP, USB).

Recommended actions

1) Verify that the destination isn't write protected.

2) Verify that controller hasn't lost contact with a mounted device.

11129, Backup error

Description

Error during the backup step Configuration.

The given backup path is too long.

Consequences

The backup request is aborted.

No backup was created.

Probable causes

The given backup path has exceeded the maximum allowed *arg* characters.

Recommended actions

Use a shorter path to where to create the backup.

11130, Backup error

Description

Error during the backup step Configuration.

No more objects.

Consequences

The backup request is aborted.

No backup was created.

11136, Backup error

Description

Error during the backup step Configuration.

Write error.

Consequences

The backup request is aborted.

No backup was created.

Probable causes

1) The destination is write protected.

2) The controller has lost contact with a mounted device (e.g. NFS, FTP, USB).

Recommended actions

1) Verify that the destination isn't write protected.

2) Verify that controller hasn't lost contact with a mounted device.

11220, Backup error

Description

Error during the backup of Task.

Unknown error.

Consequences

The backup request is aborted.

No backup was created.

Continues on next page

11222, Backup error

Description

Error during the backup of Task.

The backup already contains directories that are to be created.

Consequences

The backup request is aborted.

No backup was created.

Error while writing the backup.

Consequences

The backup request is aborted.

No backup was created.

Probable causes

- 1) The destination is write protected.
- 2) The controller has lost contact with a mounted device (e.g. NFS, FTP, USB).

Recommended actions

- 1) Verify that the destination isn't write protected.

- 2) Verify that controller hasn't lost contact with a mounted device.

11223, Backup error

Description

Error during the backup of Task.

The directory lacks at least one necessary item.

Consequences

The backup request is aborted.

No backup was created.

11229, Backup error

Description

Error during the backup step Prepare.

The given backup path is too long.

Consequences

The backup request is aborted.

No backup was created.

Probable causes

The given backup path has exceeded the maximum allowed *arg* characters.

Recommended actions

Use a shorter path to create the backup.

11224, Backup error

Description

Error during the backup of Task.

The directory does not exist.

Consequences

The backup request is aborted.

No backup was created.

11225, Backup error

Description

Error during the backup of Task.

Directory cannot be created.

Consequences

The backup request is aborted.

No backup was created.

Probable causes

- 1) The destination is write protected.
- 2) The controller has lost contact with a mounted device (e.g. NFS, FTP, USB).

Recommended actions

- 1) Verify that the destination isn't write protected.

- 2) Verify that controller hasn't lost contact with a mounted device.

11230, Backup error

Description

Error during the backup of Task.

No more objects.

Consequences

The backup request is aborted.

No backup was created.

11231, Backup error

Description

Error during the backup of Task.

The directory lacks at least one necessary item.

Consequences

The backup request is aborted.

No backup was created.

11226, Backup error

Description

Error during the backup of Task.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

11236, Backup error

Description

Error during the backup of Task.

Write error.

Consequences

The backup request is aborted.

No backup was created.

Recommended actions

Check: No space left on device. Corrupt device.

11237, Backup error

Description

Error during the backup of Task.

At least one modname is too long.

Consequences

The backup request is aborted.

No backup was created.

11238, Backup error

Description

Error during the backup of Task.

Low on program memory.

Consequences

The backup request is aborted.

No backup was created.

Probable causes

The backprocess needs program memory to store persistent variables.

Recommended actions

- 1) Stop the program before taking the backup.
- 2) Reduce the number of persistent variables in program.
- 3) Reduce the rapid program.

11261, Backup removed

Description

Error while creating a backup at path: *arg*

Consequences

The backup request is aborted.

No backup was created.

Probable causes

Check for other error messages regarding backup.

11262, Backup error

Description

Error during the backup of Controller Settings.

Consequences

The backup request is aborted.

No backup was created.

Probable causes

Check for other error messages regarding backup.

12020, Restore error

Description

Error during the restore step Prepare.

Unknown error.

Recommended actions

arg.

12023, Restore error

Description

Error during the restore step Prepare.

The directory lacks at least one necessary item.

Recommended actions

arg.

12024, Restore error

Description

Error during the restore step Prepare.

The directory does not exist.

Recommended actions

arg.

12029, Restore error

Description

Error during the restore step Prepare.

The path is too long.

Probable causes

The maximum allowed *arg* characters has been exceeded.

Recommended actions

Make sure no files with deep structures or long names have been added to the backup used to restore from.

Continues on next page

12030, Restore error**Description**

Error during the restore step Prepare.

No more objects.

Recommended actions

arg.

12031, Restore error**Description**

Error during the restore step Prepare.

The directory lacks at least one necessary item.

Recommended actions

arg.

12032, Restore error**Description**

Error during the restore step Prepare.

The system version doesn't match the backup.

Recommended actions

arg.

12033, Restore error**Description**

Error during the restore step Prepare.

Error restoring configuration parameters.

Recommended actions

arg.

12035, Restore error**Description**

Error during the restore step Prepare.

Mismatch between current system and the backup.

Recommended actions

arg.

12036, Restore error**Description**

Error during the restore step Prepare.

Write error.

Recommended actions

arg.

12120, Restore error**Description**

Error during the restore step Configuration.

Unknown error.

Probable causes

One possible reason could be that the system name contains unsupported characters.

12123, Restore error**Description**

Error during the restore step Configuration.

The directory lacks at least one necessary item.

12129, Restore error**Description**

Error during the restore step Prepare.

The path is too long.

Probable causes

The maximum allowed arg characters has been exceeded.

Recommended actions

Make sure no files with deep structures or long names have been added to the backup used to restore from.

12130, Restore error**Description**

Error during the restore step Configuration.

No more objects.

12131, Restore error**Description**

Error during the restore step Configuration.

The directory lacks at least one necessary item.

12134, Restore error**Description**

Error during the restore step Configuration.

Error restoring configuration parameters.

12136, Restore error**Description**

Error during the restore step Configuration.

Write error.

Continues on next page

5 Trouble shooting by event log

5.3 1 xxxx

Continued

Probable causes

There might be some files located in the target HOME directory that are in use. The restore operation cannot overwrite the file(s).

Recommended actions

Check if there are any open files, and if so, close them.

12220, Restore error

Description

Error during the restore of Task.

Unknown error.

12230, Restore error

Description

Error during the restore of Task.

No more objects

12231, Restore error

Description

Error during the restore of Task.

The directory lacks at least one necessary item.

12236, Restore error

Description

Error during the restore of Task.

Write error.

12320, Restore error

Description

Error during the restore of User Task.

Unknown error.

12323, Restore error

Description

Error during the restore of User Task.

The directory lacks at least one necessary item.

12338, Restore error

Description

Error during the restore of User Task.

Unknown task.

12341, Restore error

Description

Error during the restore of Controller Settings.

12342, Restore error

Description

Error during the restore of Safety Settings.

12510, Network subnet mask illegal

Description

The subnet mask *arg* for network interface *arg* is illegal.

Consequences

The network interface will not be configured, and may not be used.

Probable causes

The network subnet mask may be mistyped.

Recommended actions

- 1) Make sure the network subnet mask is correct.

12511, Network interface IP address illegal

Description

The network IP address *arg* for interface *arg* is illegal/missing.

Consequences

The interface will not be configured, and may not be used.

Probable causes

The network IP address may be mistyped or it already exists on the network.

Recommended actions

- 1) Make sure the interface IP address is correct and not a duplicate.

12512, Network gateway IP address illegal

Description

The gateway IP address *arg* is illegal/missing or the destination IP address *arg* is illegal.

Consequences

The network will not be reached, and may not be used.

Probable causes

The gateway IP and/or destination IP addresses may be mistyped.

Continues on next page

Recommended actions

- 1) Make sure the gateway IP and destination IP addresses are correct.

12513, No parameters from the DHCP server**Description**

The network interface *arg* has not received any parameters from the DHCP server.

Consequences

The interface will not be configured, and may not be used.

Probable causes

The LAN connection is not working -The DHCP server is not activated.

Recommended actions

- 1) Make sure the LAN cable is working and correctly connected.
- 2) Make sure the DHCP server is activated.
- 3) Set the LAN IP address manually.

12514, Network interface initialization error**Description**

The network interface *arg* could not be initialized.

Consequences

The interface will not be configured, and may not be used.

Probable causes

The network parameters may be wrong.

-Although unlikely, the hardware may be faulty, requiring replacement.

Recommended actions

- 1) Make sure the network parameters for the interface at hand are correct.
- 2) Isolate the cause, by replacing the suspected hardware.

12515, Network interface IP addresses overlap**Description**

The network IP address for '*arg*' is overlapping with IP address for '*arg*'.

Consequences

The interface will not be configured, and may not be used.

Probable causes

The network IP address and subnet mask overlaps with other IP address and subnet mask.

Recommended actions

- 1) Make sure the interface IP address and subnet mask are correct.

12610, Available RAM memory low**Description**

The available amount of RAM memory is low. Total RAM memory size: *arg* bytes. Free: *arg* bytes.

Consequences

The system may run out of memory.

Recommended actions

It is recommended to restart the system.

12611, Available RAM memory very low**Description**

The available amount of RAM memory is very low. Total RAM memory size: *arg* bytes. Free: *arg* bytes.

Consequences

The system may run out of memory. Memory allocation for non-production critical functionality will be rejected.

Recommended actions

It is highly recommended to restart the system.

12612, Available RAM memory too low**Description**

The available amount of RAM memory is too low. Total RAM memory size: *arg* bytes. Free: *arg* bytes.

Consequences

The system will enter System Failure State.

Recommended actions

Please restart the system.

12700, Missing time zone information**Description**

No time zone information has been specified.

Recommended actions

Please use the FlexPendant or RobotStudio to set the time zone for your location.

5 Trouble shooting by event log

5.4 2 xxxx

5.4 2 xxxx

20010, Emergency stop state

Description

The emergency stop circuit has previously been broken, and while broken, an attempt was made to operate the robot.

Consequences

The system remains in state "Waiting for Motors ON after emergency stop".

Probable causes

An attempt has been made to maneuver a control, before switching the system back to status Motors ON.

Recommended actions

1) To resume operation, switch the system back to state Motors ON by pressing the Motors ON button on the Control Module.

20011, Emergency stop state.

Description

Emergency stop reset is required.

Recommended actions

First release the Emergency stop button and then press the panel button.

20012, System failure state active

Description

Fatal non-recoverable system error. Controller restart is required.

Recommended actions

Turn the mains switch off and on again if the soft restart command is ignored or not possible to reach.

20025, Stop order timeout

Description

The stop order was carried out as a forced guard stop when no acknowledgement was received within the expected time.

Recommended actions

20030, Axis not commutated

Description

One or several internal drive unit axes are not commutated.

Recommended actions

20031, Axis not calibrated.

Description

One or several absolute/relative measurement axes are not calibrated.

Recommended actions

Check what axis that are not calibrated and calibrate them.

20032, Rev. counter not updated

Description

Revolution counter is not updated. One or several absolute measurement axes are not synchronized.

Recommended actions

Move the axes to the sync position and update the revolution counters.

20033, Axis not synchronized.

Description

One or several relative measurement axes are not synchronized.

Recommended actions

Order Motors On and synchronize all mechanical units in the list.

20034, Robot memory is not OK

Description

This action or state is not allowed since data in the robot memory is not OK.

Consequences

All data must be OK before automatic operation is possible.

Manually jogging the robot is possible.

Probable causes

There are differences between the data stored in the robot and the controller. This may be due to replacement of SMB-board, controller or both, or manually cleared robot memory.

Recommended actions

1) Update the robot memory as detailed in Operator's Manual, IRC5.

Continues on next page

20051, Not allowed command

Description

The command is only allowed when the client is in control of the resource (program/motion).

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Check if the client is in control, by checking "Write Access" in RobotStudio.
- 2) Check if the client who ought to be in control really is.

20054, Not allowed command

Description

The command is NOT allowed when the program is executing.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Make sure the program is not executing.

20059, Not allowed command

Description

The command is not allowed when the file containing system persistent data is invalid (the system has been started using last good auto saved system data).

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Revert to last auto saved system data (restart mode "Revert to last auto saved").
- 2) Reset the system (restart mode "Reset system").
- 3) Reinstall the system.

20060, Not allowed command

Description

The command is not allowed in Auto mode.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Make sure the system is NOT in Auto Mode.

20061, Not allowed command

Description

The command is not allowed when changing to Auto mode.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Make sure the system is NOT changing to Auto Mode.

20062, Not allowed command

Description

The command is not allowed in Manual mode.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Make sure the system is NOT in Manual Mode.

20063, Not allowed command

Description

The command is not allowed in Manual full speed mode.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Make sure the system is NOT in Manual full speed Mode.

20064, Not allowed command

Description

The command is not allowed when changing to Manual full speed mode.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Make sure the system is NOT changing to Manual full speed Mode.

20065, Not allowed command

Description

The command is only allowed in Manual mode (reduced or full speed).

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

1) Make sure the system is NOT in Auto mode or changing to Manual Mode (reduced or full speed).

20066, Not allowed command

Description

The system input action *arg* is not allowed in Manual full speed mode.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

1) Make sure the system is NOT in Manual full speed Mode.

20067, Not allowed command

Description

The system input action *arg* is not allowed when changing to Manual full speed mode.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

1) Make sure the system is NOT changing to Manual full speed Mode.

20068, Not allowed command

Description

The command is not allowed in current energy state.

Consequences

The system remains in the same status, and the requested action will not be performed.

Probable causes

The system is in an energy saving state.

20069, Not allowed command

Description

The command is not allowed when the robot is manually jogged.

Consequences

The system remains in the same status, and the requested action will not be performed.

Probable causes

The system is manually jogged.

20070, Not allowed command

Description

The command is not allowed in Motors ON state.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

1) Make sure the system is in Motors OFF state.

20071, Not allowed command

Description

The command is not allowed while changing to Motors ON state.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

1) Investigate by whom and why the action was requested, and, if required, correct the reason.

20072, Not allowed command

Description

The command is not allowed in Motors OFF state.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

1) Make sure the system is in Motors ON state.

20073, Not allowed command

Description

The command is not allowed while changing to Motors OFF state.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

1) Investigate by whom and why the action was requested, and, if required, correct the reason.

Continues on next page

20074, Not allowed command

Description

The command is not allowed in Guard Stop state.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Make sure the system is NOT in Guard Stop state.

20075, Not allowed command

Description

The command is not allowed in Emergency Stop state.

Consequences

Emergency stop reset is required.

Recommended actions

- 1) Make sure the system is NOT in Emergency Stop state.

20076, Not allowed command

Description

The command is not allowed in system failure state.

Consequences

A non-recoverable system error has occurred, and a controller restart is required.

Recommended actions

- 1) Make sure the system is NOT in Emergency Stop state.
- 2) Perform a restart as detailed in the Operator's Manual, IRC5.
- 3) If restarting is not possible, switch the main power OFF and then back ON.

20080, Not allowed command

Description

The command is not allowed when axis has not been commutated.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Commutate the axis as detailed in the Additional Axes Manual.
- 2) Investigate by whom and why the action was requested, and, if required, correct the reason.

20081, Not allowed command

Description

The command is not allowed when axis is not calibrated.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Calibrate the axis as detailed in the Calibration Pendulum Instruction or the Instructions for Level-meter calibration, depending on which equipment to be used.

20082, Not allowed command

Description

The command is not allowed when axis revolution counter is not updated.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Update the revolution counter as detailed in Operator's Manual, IRC5.

20083, Not allowed command

Description

The command is not allowed when axis is not synchronized.

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

- 1) Synchronize the axis as detailed in the Calibration Pendulum Instruction or the Instructions for Level-meter calibration, depending on which equipment to be used.

20084, Not allowed command

Description

This command is not allowed since data in the robot memory is not OK.

Consequences

All data must be OK before automatic operation is possible. Manually jogging the robot is possible.

Recommended actions

- 1) Update the robot memory as detailed in Operator's Manual, IRC5.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

20088, Automatic Mode Rejected

Description

The speed could not be set to 100% when automatic mode was requested.

Consequences

The system cannot enter automatic mode.

Probable causes

The speed could not be set to 100%.

Recommended actions

- 1) Switch back to manual mode.
- 2a) Set the speed in the QuickSet menu.
- 2b) or set System Parameter Controller/Auto Condition
Reset/AllDebugSettings/Reset to No if the system should be in debug mode when switching to auto.
- 3) Switch back to automatic mode and confirm.

20089, Automatic Mode Rejected

Description

The call chain was altered to begin at a routine other than main and could not be reset to main when automatic mode was requested.

Consequences

The system cannot enter automatic mode.

Probable causes

Program pointer could not be set to Main.

Recommended actions

- 1) Switch back to manual mode.
- 2a) Move PP to main.
- 2b) or if the program always shall start at the new routine, change System Parameter "Main entry" (Domain Controller, Type Task) to the new routine name.
- 2c) or set System Parameter Controller/Auto Condition
Reset/AllDebugSettings/Reset to No if the system should be in debug mode when switching to auto.
- 3) Switch back to automatic mode and confirm.

20092, Not allowed command

Description

Not allowed in state System IO Start Blocked.

Recommended actions

20093, Automatic Mode Rejected

Description

One or more of the NORMAL tasks were disabled and could not be enabled when automatic mode was requested.

Consequences

The system cannot enter automatic mode.

Probable causes

It is not possible to reset Task Selection Panel in synchronized block.

Recommended actions

- 1) Switch back to manual mode.
- 2a) Set PP to main.
- 2b) or step out of synchronized block.
- 2c) or set System Parameter Controller/Auto Condition
Reset/AllDebugSettings/Reset to No if the system should be in debug mode when switching to auto.
- 3) Switch back to automatic mode and confirm.

20094, Load name could not be found

Description

Load name *arg* could not be found.

Consequences

It is not possible to jog without a correct defined load.

Probable causes

The module with the load definition is probably deleted.

Recommended actions

Load module with load definition. Choose other load.

20095, Tool name could not be found

Description

Tool name *arg* could not be found.

Consequences

It is not possible to jog without a correct defined tool.

Probable causes

The module with the tool definition is probably deleted.

Recommended actions

Load module with tool definition. Choose other tool.

20096, WorkObject name could not be found

Description

WorkObject name *arg* could not be found.

Continues on next page

Consequences

It is not possible to jog without a correct defined workobject.

Probable causes

The module with the workobject definition is probably deleted.

Recommended actions

Load module with workobject definition. Choose other workobject.

20097, Not allowed to jog with LOCAL PERS Load**Description**

The object *arg* is of type LOCAL PERS and is not possible to jog.

Recommended actions

Change Load.

20098, Not allowed to jog with LOCAL PERS Tool**Description**

The object *arg* is of type LOCAL PERS and is not possible to jog.

Recommended actions

Change Tool.

20099, Not allowed to jog with LOCAL PERS Work Object**Description**

The object *arg* is of type LOCAL PERS and is not possible to jog.

Recommended actions

Change Work Object.

20101, FlexPendant (program) in control.**Description**

The FlexPendant programming window has focus and is in control of the program server.

Recommended actions

Change to the production window and perform the command again.

20103, Controller busy updating Task Selection Panel.**Description**

The Task Selection Panel is having an update. It is not possible to do the requested command.

Recommended actions

Perform the command again or restart the controller and perform the command again.

20104, The system path is too long.**Description**

The system path is too long. It is not possible for the system to act in a safe way.

Consequences

The system will enter system failure state.

Recommended actions

Move the system to a location with a shorter file path.

20105, Backup already in progress**Description**

A backup is already in progress.

Consequences

The command "Backup" from System Input Signal will be rejected.

Recommended actions

Use System Output Signal "Backup in progress" to control if a backup can be started.

20106, Backup path**Description**

There are errors in the backup path or the backup name in the configuration for the System Input Backup. The directory for the backup cannot be created. Backup path: *arg*. Backup name: *arg*.

Consequences

The command "Backup" from System Input Signal will be rejected.

Recommended actions

Verify that configured path and name for the System Input Backup are correct.

20111, FlexPendant (program) in control**Description**

The FlexPendant programming window has focus and is in control of the program server.

Recommended actions

Change to the production window and perform the command again.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

20120, System IO in control

Description

See Title.

Recommended actions

20126, Load data has changed

Description

The active load *arg* was removed and replaced with *arg*. The load data was located in task: *arg* connected to mechanical unit *arg*.

Consequences

The load definition for jogging may not be correct.

Probable causes

The load data was removed. The module containing the original tool definition may have been deleted.

Recommended actions

If you require the old definition, locate the program or module of the original load data and load it.

20127, Tool data has changed

Description

The active tool *arg* was removed and replaced with *arg*. The tool data was located in task: *arg* connected to mechanical unit *arg*.

Consequences

The tool definition for jogging may not be correct.

Probable causes

The tool data was removed. The module containing the original tool definition may have been deleted.

Recommended actions

If you require the old definition, locate the program or module of the original tool data and load it.

20128, Work object data has changed

Description

The active work object *arg* was removed and replaced with *arg*. The work object data was located in task: *arg* connected to mechanical unit *arg*.

Consequences

The work object definition for jogging may not be correct.

Probable causes

The work object data was removed. The module containing the original tool definition may have been deleted.

Continues on next page

Recommended actions

If you require the old definition, locate the program or module of the original work object data and load it.

20130, Active Task Menu is restored

Description

During a controller restart, the "Active Task Menu" is restored in Auto mode.

Consequences

If one or several tasks were unchecked, they are now checked again after the restart in Auto mode.

Probable causes

A controller restart has been performed.

Recommended actions

Go to manual mode.

2. Uncheck the unwanted tasks.

3. Go back to Auto mode.

20131, Automatic Mode Rejected

Description

One or more logical I/O signals were blocked and could not be unblocked when automatic mode was requested.

Consequences

The system cannot enter automatic mode.

Probable causes

Some blocked I/O signal could not be unblocked.

Recommended actions

1) Switch back to manual mode.

2a) Check Event Log for errors related to I/O,

2b) or set System Parameter Controller/Auto Condition

Reset/AllDebugSettings/Reset to No if the system should be in debug mode when switching to auto.

3) Switch back to automatic mode and confirm.

20132, Blocked I/O signals

Description

One or more logical I/O signals were blocked during startup in automatic mode.

Consequences

Blocked signals will be unblocked.

Probable causes

System was switched to automatic mode during a controller restart.

System parameter AllDebugSettings is set to Yes.

Recommended actions

None, system has automatically reset debug settings. To keep debug settings in auto:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to NO.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20133, Debug Settings in Auto

Description

One or more logical I/O signals were blocked during startup in automatic mode.

Consequences

Blocked I/O signals will stay blocked. System will not be in full production mode in auto.

Recommended actions

For full production mode:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to YES.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20134, Call Chain

Description

The call chain has been altered to begin at a routine other than main.

Consequences

Program pointer will be reset to main routine.

Probable causes

System was switched to automatic mode during controller restart. System parameter AllDebugSettings is set to Yes.

Recommended actions

For debug mode in auto:

- 1) Switch back to manual mode.
- 2) Set system parameter AllDebugSetting, reset to NO.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20135, Debug Settings in Auto

Description

The call chain has been altered to begin at a routine other than main.

Consequences

Program pointer will not be set to main. System will not be in full production mode in auto.

Recommended actions

For full production mode:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to YES.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20136, Reduced Speed

Description

The system was running at reduced speed during startup in automatic mode.

Consequences

Speed will be set to 100%.

Probable causes

System was switched to automatic mode during controller restart.

Recommended actions

None, system has automatically reset debug settings.

To keep debug settings in auto:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to NO.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20137, Debug Settings in Auto

Description

The system was running at reduced speed during startup in automatic mode.

Consequences

Speed will stay unchanged. System will not be in full production mode in auto.

Recommended actions

For full production mode:

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

- 1) Switch back to manual mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to YES.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

Recommended actions

20141, Motors Off rejected

Description

Motors Off, via System IO, was rejected.

Recommended actions

20142, Start rejected

Description

Start/restart of program, via System IO, was rejected.

Consequences

Program will not be possible to start.

Probable causes

- The reason could be that the robot is outside of regain distance.
- The program was executing.
- An ongoing Backup operation.

Recommended actions

- Jog robot into regain zone or move the program pointer.
- Stop program before activating System Input Start.

20143, Start at main rejected

Description

Start of program at main, via System IO, was rejected.

Consequences

Program will not be possible to start.

Probable causes

- The program was executing.
- An ongoing Backup operation.

Recommended actions

Stop program before activating System Input Start at Main.

20144, Stop rejected

Description

Stop of program, via System IO, was rejected.

Recommended actions

20145, Stop cycle rejected

Description

Stop of program after cycle, via System IO, was rejected.

20138, Disabled Tasks

Description

One or more of the NORMAL tasks were disabled during the startup when in automatic mode.

Consequences

All disabled normal tasks will be enabled.

Probable causes

System was switched to automatic mode during controller restart. System parameter AllDebugSettings is set to Yes.

Recommended actions

None, system has automatically reset debug settings. To keep debug settings in auto:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to NO.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20139, Debug Settings in Auto

Description

One or more of the NORMAL tasks were disabled during startup in automatic mode.

Consequences

Disabled tasks will stay disabled. System will not be in full production mode in auto.

Recommended actions

For full production mode:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to YES.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20140, Motors On rejected

Description

Motors On, via System IO, was rejected.

Continues on next page

Recommended actions

20146, Manual interrupt rejected

Description

Manual interrupt of program, via System IO, was rejected.

Consequences

The manual interrupt will not be executed.

Probable causes

- The program was executing.
- An ongoing Backup operation.

Recommended actions

Stop program before activating System Input Interrupt.

20147, Load and start rejected

Description

Load and start of program, via System IO, was rejected.

Consequences

Program will not be possible to start.

Probable causes

- The arguments for the System Input Load and Start are wrong.
- The module was loaded, but the system failed to set the program pointer.
- The program was executing.
- An ongoing Backup operation.

Recommended actions

Check the following:

- Correct arguments for System Input Load and Start.
- Defined and correct name of the program file to be loaded (including mass memory unit).
- Defined and correct name of the task that the program should be loaded in.
- Program stopped before activating System Input Load and Start.

20148, Confirm rejected

Description

Emergency Stop reset confirm, via System IO, was rejected.

Recommended actions

20149, Error reset rejected

Description

Program execution error reset, via System IO, was rejected.

Recommended actions

20150, Load failure

Description

Load of program, via System IO, failed.

Consequences

Program will not be possible to start.

Probable causes

- The arguments for the System Input Load are wrong.
- The module was loaded, but the system failed to set the program pointer.
- The program was executing.
- An ongoing Backup operation.

Recommended actions

Check the following:

- Correct arguments for System Input Load.
- Defined and correct name of the program file to be loaded (including mass memory unit).
- Defined and correct name of the task that the program should be loaded in.
- Program stopped before activating System Input Load.

20153, Motors On and Start rejected

Description

Motors On and Start/Restart of program, via System IO, was rejected.

Consequences

Program will not be possible to start.

Probable causes

- The reason could be that the robot is outside of regain distance.
- The program was executing.
- An ongoing Backup operation.

Recommended actions

- Jog robot into regain zone or move the program pointer.
- Stop program before activating System Input Motors On and Start.

20154, Stop instruction rejected

Description

Stop of program after instruction, via System IO, was rejected.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Recommended actions

20156, Undefined Argument

Description

Interrupt routine name for System IO Manual Interrupt is not defined.

Recommended actions

Configure the interrupt routine name.

20157, Undefined Argument

Description

Program name for System IO LoadStart is not defined.

Recommended actions

Configure the program name.

20158, No System Input signal

Description

A System Input has been configured to an I/O-signal that does not exist. System Input: *arg*. Signal Name: *arg*.

Consequences

The system goes to system failure state.

Recommended actions

Add signal *arg* to eio.cfg or remove System Input *arg* from eio.cfg. For every System Input a signal must be configured.

20159, No System Output signal

Description

A System Output has been configured to an I/O-signal that does not exist. System Output: *arg*. Signal Name: *arg*.

Consequences

The system goes to system failure state.

Recommended actions

Add signal *arg* to eio.cfg or remove System Output *arg* from eio.cfg. For every System Output a signal must be configured.

20161, Path not found

Description

The system module *arg* in task *arg* has a corresponding specification in the configuration for "Task modules" that point out a non-existing file path.

Recommended actions

View "Task modules" in the "System Parameter" menu and change the path in the item for this system module.

Continues on next page

20162, Write error

Description

A write error occur when the system try to save the system module *arg* at *arg* in task *arg*. Or the file system was full.

Recommended actions

View "Task modules" in the "System Parameter" menu and change the path in the item for this system module.

20164, Reconfig failed

Description

There are still some unsaved system modules.

Recommended actions

Read error descriptions in earlier messages. Try another system start.

20165, Program Pointer lost.

Description

Restart is no longer possible from current position.

Recommended actions

The program has to be started from the beginning.

20166, Refuse to save module

Description

The module *arg* is older than the source at *arg* in task *arg*.

Recommended actions

20167, Unsaved module

Description

The module *arg* is changed but not saved in task *arg*.

Recommended actions

20170, The system was stopped

Description

An error was detected, which stopped the system.

Consequences

The system goes to status SYS STOP and the robot is stopped along the path. The full meaning of this status is described in the Trouble Shooting Manual, IRC5.

Probable causes

A number of errors may cause this status transition.

Recommended actions

- 1) Check other event messages occurring at the same time to determine the actual cause.
- 2) Fix the cause of the fault.

20171, The system was halted**Description**

An error was detected, which halted the system.

Consequences

The system goes to status SYS HALT, the program and robot motion is stopped and the motors are switched OFF. The full meaning of this status is described in the Trouble Shooting Manual, IRC5.

Probable causes

A number of errors may cause this status transition.

Recommended actions

- 1) Check other event messages occurring at the same time to determine the actual cause.
- 2) Fix the cause of the fault.
- 3) Restart the program.

20172, The system has failed**Description**

An error was detected, which caused the system to fail.

Consequences

The system goes to system failure state. The program and robot motion is stopped and the motors are switched OFF. The full meaning of this status is described in the Trouble Shooting Manual, IRC5.

Probable causes

A number of errors may cause this status transition.

Recommended actions

- 1) Check other event messages occurring at the same time to determine the actual cause.
- 2) Fix the cause of the fault.
- 3) Perform a controller restart as detailed in the Operator's Manual, IRC5.

20176, Analog System Output Outside Limits**Description**

The value *arg* for the System Output *arg*, signal *arg*, is outside its limits (logical min: *arg* m/s, logical max: *arg* m/s).

Consequences

The new value is not set; the previous value of the analogue signal is preserved.

Probable causes

The logical upper and/or lower limit for the signal may be defined wrongly.

Recommended actions

Adjust the values of the logical upper and/or lower limit for the signal and restart the controller.

20177, Short circuit in Motor phase circuit**Description**

The motor or motor cable for joint *arg* in drive module *arg*, drive unit number *arg*, is a short circuit.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by a faulty motor or motor cable. It may also be caused by contamination in the contactors for the cables or a failure of the motor windings.

Recommended actions

- 1) Make sure the motor cable is correctly connected to the drive unit.
- 2) Check the cable and motor by measuring their resistance respectively. Disconnect before measuring.
- 3) Replace any faulty component.

20178, Wrong task name configured**Description**

Wrong task name *arg* configured for System Input *arg*.

Consequences

The digital input signal will not be connected to the specified event.

Recommended actions

Change the configuration and restart the controller.

20179, Disk memory critically low**Description**

The amount of free storage capacity on the disk has reached a critical level. It is now less than 10 Mb. Execution of RAPID programs is stopped.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Consequences

The disk memory is very close to being completely full. When this happens the system will not be able to function.

Probable causes

Too much data on the disk.

Recommended actions

- 1) Save the files on some other disk connected to the network.
- 2) Erase data from disk.
- 3) After removing files from the drive, restart the program.

20181, System Reset rejected.

Description

System Reset via System IO not allowed.

Recommended actions

20182, The System Input Signal QuickStop is ineffective.

Description

A stop action has already started.

Recommended actions

20184, Incorrect argument for System Inputs

Description

An undefined Start Mode has been declared for System IO.

Recommended actions

20185, Incorrect Name

Description

An undefined Name has been declared in current runchn_bool configuration.

Recommended actions

20187, Diagnostics record file created

Description

Due to any of a number of faults, a system diagnostics file was created at *arg*. This file contains internal debug info and is intended for trouble shooting and debugging purposes.

Consequences

The system will react to the error causing the stop as specified in its own event log text.

Probable causes

A number of errors may cause this. Faults causing the system to go to system failure state will generally also create a diagnostics record file.

Recommended actions

If required, the file may be appended to an error report sent to your local ABB representative.

20188, System data is not valid

Description

The contents of the file, *arg*, containing system persistent data is invalid. Internal error code: *arg*. The system has been started using last good system data saved earlier at *arg*.

Consequences

Any changes made in the system configuration or RAPID programs since *arg* will be rejected.

Recommended actions

- 1) Check other event messages occurring at the same time to determine the actual cause.
- 2) If acceptable, revert to the last auto saved system data.
- 3) Reinstall the system.
- 4) Check the available disk storage capacity. If required, erase data to increase free storage capacity.

20189, Robot data not valid

Description

Could not load the system independent robot data from file *arg*. The file exists but the content is not valid. Internal code: *arg*.

Recommended actions

Check other logged messages for needed actions. Make sure there is free memory left on the device.

20192, Disk memory low

Description

The amount of free storage capacity on the disk is less than 25 MB. When reaching 10 MB, execution of RAPID programs will be stopped.

Consequences

The disk memory is close to being completely full. When this happens the system will not be able to function.

Probable causes

Too much data on the disk.

Recommended actions

- 1) Save the files on some other disk connected to the network.

Continues on next page

2) Erase data from disk.

20193, Robot data update warning

Description

Axis sync values and service information data (SIS) was restored from backup.

The system independent robot data was not saved during system shutdown. The data was restored from latest backup.

Recommended actions

Make sure there is free memory left on the device.

The backup battery may be drained. Check the hardware log.

20194, System data backup could not be created

Description

The system was restored successfully but a backup of the current system data could not be created.

Recommended actions

Make sure there is free memory left on the device arg.

20195, System data from last shutdown is lost

Description

Normally, all system data is saved on shutdown. During the last shutdown saving data has failed. The system has been started using last good system data saved earlier at arg.

Consequences

Any changes made in system configuration or RAPID programs since arg will NOT be available after restart. Any such changes will have to be re-implemented.

Probable causes

The backup energy bank may have been drained at the time of the shutdown. The storage disk may be full.

Recommended actions

- 1) Check other event messages occurring at the same time to determine the actual cause.
- 2) If acceptable, restart using revert to last auto saved to accept the last good system data.
- 3) Reinstall the system.
- 4) Check the available disk storage capacity. If required, erase data to increase free storage capacity.

20196, Module saved

Description

During reconfiguration of the system a changed and not saved module was found.

The module was saved to arg.

Recommended actions

20197, System data from last shutdown cannot be found

Description

Normally, all system data is saved on shutdown. The file containing system persistent data cannot be found. The system has been started using last good system data saved earlier at arg.

Consequences

Any changes made in system configuration or RAPID programs since arg will NOT be available after restart. Any such changes will have to be re-implemented.

Probable causes

The file containing the saved system data may have been manually moved or deleted.

Recommended actions

- 1) Check the location and availability of the saved system data file.
- 2) If acceptable, restart using revert to last auto saved to accept the last good system data.
- 3) Reinstall the system.

20199, System SoftStop Rejected

Description

The System Input SoftStop is not allowed.

Recommended actions

20270, Access error

Description

Panel Module access error.

Recommended actions

Examine your I/O configuration files.

20280, Symbol conflict

Description

The signal arg defined in the IO configuration conflict with another program symbol with the same name.

Due on that fact the signal will not be mapped to a program variable.

Recommended actions

Rename the signal in the IO configuration.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

20281, IO configuration error

Description

arg arg with signal name *arg* has wrong signal type. Found *arg* expected *arg*.

Recommended actions

Change your configuration and restart the controller.

20282, Resource and index exist

Description

Resource *arg*.

Index *arg*.

Recommended actions

20283, Text database is full.

Description

Resource *arg*.

Index *arg*.

Recommended actions

20284, Wrong Signal Type For System Input

Description

The System Input *arg* is configured with an I/O-signal of wrong type.

The I/O-signal *arg* is of type *arg* and this System Input requires an I/O-signal of type *arg*.

Recommended actions

Change the configuration for the specified System Input.

20285, Wrong Signal Type For System Output

Description

The System Output *arg* is configured with an I/O-signal of wrong type.

The I/O-signal *arg* is of type *arg* and this System Output requires an I/O-signal of type *arg*.

Recommended actions

Change the configuration for the specified System Output.

20286, Not Unique I/O-Signal For System Output

Description

Each System Output must have a unique I/O-signal configured. It is not possible to configure same I/O-signal to several System Outputs.

System Output: *arg*.

Signal Name: *arg*.

Recommended actions

20287, Not Unique I/O-signal For System Input

Description

Each System Input must have a unique I/O-signal configured. It is not possible to configure same I/O-signal to several System Inputs.

System Input: *arg*.

Signal Name: *arg*.

20288, Unknown System Output Type

Description

The configured System Output type is unknown by the system.

Unknown System Output: *arg*.

Recommended actions

Verify that the System Output name is correctly spelled.

20289, Unknown System Input Type

Description

The configured System Input type is unknown by the system.

Unknown System Input: *arg*.

Recommended actions

Verify that the System Input name is correctly spelled.

20290, Unknown Mechanical Unit Name For System Output

Description

A System Output is configured with a mechanical unit name which is unknown by the system.

System Output: *arg*.

Mechanical unit name: *arg*.

Recommended actions

The specified mechanical unit must be configured in order to be used by System Outputs.

Verify that the mechanical unit name is correctly spelled.

20291, Unknown System Input Restriction Type

Description

The configured System Input Restriction Type is unknown by the system.

Unknown System Input Restriction: *arg*.

Continues on next page

Recommended actions

Verify that the System Input Restriction name is correctly spelled.

20292, Unknown System Input Restriction**Description**

The configured System Input Restriction is unknown by the system.

System Input Restriction Type: *arg*.

Unknown System Input Restriction: *arg*.

Recommended actions

Verify that the System Input Restriction name is correctly spelled.

20293, The Requested Action is Restricted**Description**

The requested *arg* is restricted by the system input *arg* set by I/O signal *arg*.

Consequences

The action called for will not take place.

Probable causes

System input *arg* may be set by external equipment, such as PLCs, etc. for a number of reasons.

Recommended actions

1) Investigate why the system input was set, and, if required, correct the reason.

20294, Action *arg* cannot be fulfilled.**Description**

The requested action cannot be fulfilled since the IO unit is not responding.

Consequences

It is not possible to decide if there are any restrictions set to the action.

Probable causes

The requested action will not be fulfilled until the I/O unit is enabled again.

Recommended actions

Never disable a unit with System Inputs/Outputs.

20295, Signal cannot be used as System Output.**Description**

The System Output *arg* is configured with an I/O-signal with wrong category. The I/O-signal *arg* belongs to category Safety and cannot be used as System Output.

Recommended actions

Choose another signal or set to another category.

20296, Wrong task name configured**Description**

Wrong task name *arg* configured for System Output *arg*.

Consequences

The digital output signal will not be connected to the specified event.

Recommended actions

Change the configuration and restart the controller.

20297, System Output Communication Failure**Description**

Unable to set the value of the I/O signal *arg* connected to the System Output *arg*.

Consequences

The system goes to status SYS HALT.

Probable causes

- The connection to the I/O unit may have been lost.

20298, Unknown Mechanical Unit Name For System Input**Description**

A System Input is configured with a mechanical unit name which is unknown by the system.

System Input: *arg*.

Mechanical unit name: *arg*.

Recommended actions

The specified mechanical unit must be configured in order to be used by System Inputs.

Verify that the mechanical unit name is correctly spelled.

20321, Not-a-Number**Description**

Not-a-Number was found in task *arg*.

A symbol of type '*arg*' was found holding an undefined number.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Consequences

The undefined number was replaced with 'arg'.

20322, Positive infinity

Description

Positive infinity was found in task *arg*.

A symbol of type 'arg' was found holding positive infinity.

Consequences

The positive infinity was replaced with 'arg'.

20323, Negative infinity

Description

Negative infinity was found in task *arg*.

A symbol of type 'arg' was found holding negative infinity.

Consequences

The negative infinity was replaced with 'arg'.

20324, Incorrect argument for System IO Signal

Description

arg set to signal *arg* has an incorrect argument.

Consequences

It will not be possible to use *arg*.

Probable causes

The configuration has probably been edited outside a proper configuration editor.

Recommended actions

The system IO signal must be reconfigured, preferably with the configuration editor on RobotStudio or on FlexPendant.

20325, SC *arg* supervision not activated

Description

There is no user configuration in Safety Controller (SC), i.e. safety supervision is disabled.

Consequences

SC cannot stop robot movement.

Probable causes

There is no user configuration in SC or there is no SC connected in the drive module *arg*.

Recommended actions

Download a new user configuration to SC. Activate the configuration by restarting the controller and enter the pin code.

20326, Incorrect argument for System IO Signal

Description

arg set to signal *arg* has an incorrect argument. The delay must not be a negative value.

Consequences

It will not be possible to use *arg*.

Recommended actions

The system IO signal must be reconfigured.

20350, Not a valid task name

Description

The task name *arg* cannot be used as a name of a task. It is either already used as an installed symbol, a reserved word in the system or too long (max. 16 characters).

Consequences

The task will not be installed in the system.

Recommended actions

Change the configuration of the task name and restart the controller.

20351, Max number of tasks exceeded

Description

The maximum number of tasks, *arg*, of the configuration type *arg* is exceeded.

Consequences

All configured tasks will not be installed.

Recommended actions

Change the configuration and restart the controller.

20352, Not a valid Motion Planner name

Description

The Motion Planner name for Mechanical Unit Group *arg* in *arg* is not correct.

The reason can be one of the following:

1. Empty name.
2. Not present in the Motion configuration.
3. Already in use by another Mechanical Unit Group.

Consequences

The system will not be able to use.

Recommended actions

Change the configuration and restart the controller.

Continues on next page

20353, Mechanical unit not found

Description

The mechanical unit *arg* in *arg* cannot be found in the list of configured mechanical units.

Consequences

It is not possible to execute any RAPID instructions that use the configured mechanical units.

Probable causes

The unit is probably not present in the Motion configuration.

Recommended actions

Change the configuration and restart the controller.

20354, The argument is undefined

Description

The configured argument *arg* for task *arg* is not a valid type.

Consequences

The behavior of the task will be undefined.

Recommended actions

Change the configuration and restart the controller.

20355, Mechanical Unit Group name not correct

Description

The configured name of *arg* in task *arg* is not correct.

The reason could be:

1. The argument is not used in the configuration.
2. The configured name is not a member of the Mechanical Unit Group.
3. The configured name is already used by another task.

Consequences

The task will not be installed or it will not be possible to execute RAPID motion instructions.

Recommended actions

Change the configuration and restart the controller.

20356, Maximum number of Motion tasks exceeded

Description

Only *arg* tasks are allowed to control mechanical units i.e. execute RAPID move instructions.

Recommended actions

Change the configuration and restart the controller.

20357, No configured Motion task

Description

No task is configured to control mechanical units i.e. execute RAPID move instructions.

Consequences

It is not possible to execute any RAPID move instructions.

Recommended actions

Reinstall the system and be sure to include a robot.

20358, No members of *arg* configured

Description

The configuration type is required in a multi robot system.

Consequences

It is not possible to execute any RAPID move instructions.

Recommended actions

Change the configuration and restart the controller.

20359, Cfg type *arg* is configured

Description

The type was found but not expected in a system with current options.

Recommended actions

Check if the right configuration file is loaded or remove all instances of the type.

Restart the controller.

20360, Unknown event in cfg type *arg*

Description

The event *arg* is not a system event.

Recommended actions

Change the configuration and restart the controller.

20361, Only shared modules in the shared task

Description

The module *arg* is not configured shared and cannot be loaded into the shared task.

Recommended actions

Change the configuration and restart the controller.

20362, Not defined task name

Description

The task *arg* in cfg type *arg* is not configured in the system.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Recommended actions

Change the configuration and restart the controller.

20363, Module not a system module

Description

The module *arg* loaded from the file *arg* is not a system module.

Recommended actions

Change the file suffix or add a module attribute to the module.
Load the module again or restart the controller.

20364, Max number of Mechanical Unit Groups exceeded

Description

The maximum number of Mechanical Unit Groups, *arg*, of the configuration type *arg* is exceeded.

Consequences

Exceeded instances are ignored.

Recommended actions

Change the configuration and restart the controller.

20365, Update of configuration is done

Description

All tasks are reset to its main routine due to configuration changes.

Recommended actions

20366, Type error in task configuration

Description

The task *arg* is configured with wrong type. Task configured to control mechanical units i.e. execute RAPID move instructions must be of type *arg*.

Consequences

The task will not be installed.

Recommended actions

Change the configuration and restart the controller.

20367, No configured mechanical units

Description

The instance *arg* of configuration type *arg* has no mechanical unit argument.

Consequences

It will not be possible to perform any actions against the motion system, i.e. execute RAPID move instructions.

Continues on next page

Recommended actions

Change the configuration and restart the controller.

20368, Not connected Mechanical Unit Group

Description

There is no Motion task connected with the Mechanical Unit Group *arg*.

Consequences

It will not be possible to use the mechanical units that belong to this group.

Probable causes

The cause of this error can be a missing RAPID task instance in the Controller domain of the configuration or a task that has not been configured as a Motion task.

Recommended actions

1. Add a Motion task instance that is connected to the Mechanical Unit Group.
2. Change an existing non Motion task to a Motion task.
3. Remove the Mechanical Unit Group.
4. Check for misspelled names.

20369, Confusing configuration of system parameters.

Description

There is a mixture of old and new structure of type System Misc.

Consequences

It is possible that not the correct parameters are configured.

Probable causes

Configuration of old and new structure has been loaded into the system.

Recommended actions

1. Check that the correct parameters are configured.
2. Update the parameters in System Misc with correct values.
3. Save the Controller domain and replace the old configuration file.

20370, Failed to read configuration data for regain distance

Description

The system failed to read the configuration data for the type <*arg*>. The regain distance is the limit when the system will warn before a start with regain movement.

Consequences

Default value for the regain distance will be used.

Probable causes

- The sys.cfg file loaded into the system does not contain any regain distance information.
- No sys.cfg file has been loaded due to file errors.

Recommended actions

- 1) Load a new sys.cfg file and restart the controller.

20371, A default Mechanical Unit Group is used**Description**

The configuration of task *arg* has no connection to *arg*. The attribute *arg* is required in a MultiMove system and is missing.

Consequences

The task performs no movement by the mechanical unit, but can read motion data. The RAPID functions may fail, if they read motion data and is connected to the wrong mechanical unit. The Mechanical Unit Group in *arg* has been connected to the task.

Probable causes

- The attribute was not specified when the configuration was created.
- The configuration file could have been created in a non-multi move system.

Recommended actions

- 1) Make sure the correct Mechanical Unit Group is connected to the task.

20372, Failed to read configuration data.**Description**

The system failed to read the configuration data for the type <*arg*>.

Consequences

Hotedit or modpos will not be possible.

Probable causes

- The sys.cfg file loaded into the system does not contain hotedit and modpos information.
- No sys.cfg file has been loaded due to file errors.

Recommended actions

- Load a new sys.cfg file and restart the controller.

20373, Missing task name**Description**

No task is given for module *arg* in cfg type *arg*.

Recommended actions

Change the configuration and restart the controller.

20380, No Motion Planner connected to mechanical unit**Description**

The mechanical unit *arg* has no Motion Planner connected.

Consequences

It is not possible to use this mechanical unit in any operations such as calibration or activation.

Probable causes

The cause of this error is probably an error in the configuration.

Recommended actions

Check the Motion and/or Controller configuration.

20381, Error when recreating path after power fail**Description**

The path wasn't successfully recreated.

Consequences

The Program Pointer must be moved before restarting the program. It's recommended to move the robot to a safe position though the robot might not follow the original path when restarted.

Probable causes

A number of errors may cause this. Faults causing the system to go to system failure state will generally also cause path recreate after power failure to fail.

Recommended actions

- 1) Check other event messages occurring at the same time to determine the actual cause.
- 2) Fix the cause of the fault.
- 3) Move the robot to a safe position before restarting. The robot may not follow the original path.

20390, Start rejected**Description**

Start/restart of program, via System IO, was rejected.

The reason is that write access is held by *arg* using *arg*.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Recommended actions

20391, Start at main rejected

Description

Start of program at main, via System IO, was rejected.
The reason is that write access is held by *arg* using *arg*.

Recommended actions

20392, Manual interrupt rejected

Description

Manual interrupt of program, via System IO, was rejected.
The reason is that write access is held by *arg* using *arg*.

Recommended actions

20393, Load and start rejected

Description

Load and start of program, via System IO, was rejected.
The reason is that write access is held by *arg* using *arg*.

Recommended actions

20394, Motors On and Start rejected.

Description

Motors On and Start/restart of program, via System IO, was rejected.

The reason is that write access is held by *arg* using *arg*.

Recommended actions

20395, Load rejected

Description

Load of program via System IO, was rejected.

The reason is that write access is held by *arg* using *arg*.

20396, Manual interrupt rejected

Description

Manual interrupt of program, via System IO, was rejected in task *arg*.

Manual interrupt is not allowed during synchronized movement.

20397, Manual interrupt rejected

Description

Manual interrupt of program, via System IO, was rejected in task *arg*.

The interrupt is connected to *arg*, which is not a valid RAPID procedure.

Consequences

arg will not be executed.

Probable causes

1. *arg* does not exist.
2. *arg* is not a procedure (PROC) that takes zero (0) parameters.

Recommended actions

Make sure that *arg* is an existing procedure (PROC) that takes zero (0) parameters.

20398, Automatic Mode Rejected

Description

A stopped static/semi-static task (alias background task) could not be started when automatic mode was requested.

Consequences

The system cannot enter automatic mode.

Probable causes

A stopped static/semi-static task could not be started.

Recommended actions

- 1) Switch back to manual mode.
- 2) Make sure that all static/semi-static tasks has a program/module containing the configured production entry.
- 3) Make sure that no static/semi-static task has any syntax errors.
- 4) Switch back to automatic mode and confirm.

20399, Static/Semi-static task started

Description

At least one static/semi-static task (alias background task) was not executing after startup in automatic mode.

Consequences

Execution was started in at least one static/semi-static task.

Probable causes

System was switched to automatic mode during a controller restart.

Recommended actions

None, system has automatically reset debug settings. To keep debug settings in auto:

- 1) Switch back to auto mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to NO.
- 3) Switch back to automatic mode and confirm.

Continues on next page

4) For more info, see the Technical Reference Manual - System Parameters.

20400, Debug Settings In Auto

Description

A static/semi-static task (alias background task) has been stopped.

Consequences

The static/semi-static task will not be started.

System will not be in full production mode in auto.

Recommended actions

For full production mode:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller/Auto Condition Reset/AllDebugSettings/Reset to Yes.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20401, Too many CFG instances

Description

There are too many instances *arg* of type *arg* in topic *arg*.

Consequences

The wrong instance may be used and cause unexpected behavior.

Probable causes

There are multiple instances of *arg* of type *arg* in topic *arg*.

Recommended actions

Remove all instances but one.

20402, Automatic Mode Rejected

Description

An active RAPID Spy session could not be deactivated when automatic mode was requested.

Consequences

The system cannot enter automatic mode.

Probable causes

RAPID Spy could not be deactivated.

Recommended actions

- 1) Switch back to manual mode.
- 2) Use an external client, e.g. RobotStudio, to deactivate RAPID Spy.
- 3) Switch back to automatic mode and confirm.

20403, RAPID Spy deactivated

Description

RAPID Spy was deactivated after startup in automatic mode.

Consequences

RAPID Spy was deactivated.

Probable causes

System was switched to automatic mode during controller restart.

Recommended actions

None, system has automatically reset debug settings. To keep debug settings in auto:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller / Auto Condition Reset / AllDebugSettings / Reset to NO.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20404, Debug Settings In Auto

Description

RAPID Spy is active.

Consequences

RAPID Spy will not be deactivated.

System will not be in full production mode in auto.

Recommended actions

For full production mode:

- 1) Switch back to manual mode.
- 2) Set system parameter Controller / Auto Condition Reset / AllDebugSettings / Reset to Yes.
- 3) Switch back to automatic mode and confirm.
- 4) For more info, see the Technical Reference Manual - System Parameters.

20408, PP to Main rejected

Description

Setting PP to Main, via System IO, was rejected.

The reason is that write access is held by *arg* using *arg*.

20409, PP to Main rejected

Description

Setting PP to Main, via System IO, was rejected.

Consequences

PP wasn't set to Main.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Probable causes

The reason could be that the program was executing or that no program is loaded containing the Main procedure.

Recommended actions

Make sure the program execution is stopped and that a program containing the Main procedure is loaded.

20410, Energy Saving has been reset

Description

Energy Saving has been reset. Before being reset, the system was in Energy Saving Mode: arg.

Consequences

The system is no longer in any Energy Saving mode.

Probable causes

The system has been restarted, intentional or caused by a power fail.

20411, Energy saving activated

Description

The robot system has entered an energy saving state.

Consequences

The robot system will not be able to perform any normal tasks.

20412, Energy saving deactivated

Description

The robot system has resumed from an energy saving state.

Consequences

The robot system will now be able to perform any normal tasks.

20413, Motors On failed

Description

Motors On failed when the controller was resuming from an energy saving state.

Consequences

The system will resume from energy saving state, but remain in Motors Off/Guard Stop.

Probable causes

The controller:

- is no longer in Auto mode,
- is in system failure state,
- is in emergency stop state.

20414, Program start failed

Description

Start of program execution failed when the controller was resuming from an energy saving state.

Consequences

The system will resume from energy saving state, but remain in stopped state.

Probable causes

The controller:

- is no longer in Auto mode,
- is in system failure state,
- is in emergency stop state.

20415, Motors On/Program Start failed

Description

Motors On and/or Start of program execution failed when the controller was resuming from an energy saving state.

Consequences

The system will resume from energy saving state, but remain in Motors Off.

Probable causes

The system is in Emergency Stop state.

Recommended actions

Make sure the emergency stop button has been released and that the emergency stop has been reset (pressing Motors On button or using System Input action 'Reset Emergency Stop').

20416, Energy saving blocked

Description

The robot system has been blocked from entering an energy saving state.

Consequences

The robot system will not be able to enter an energy saving state until being unblocked.

20417, Energy saving unblocked

Description

The robot system has left blocked state.

Consequences

The robot system will now be able to enter an energy saving state.

Continues on next page

20418, Energy saving already active

Description

The robot system has already entered energy saving state. There is no support for switching between energy saving modes. To enter a different energy saving mode, the robot system must first be resumed.

Consequences

The robot system will remain in the previously entered saving mode.

Probable causes

The robot system has already entered energy saving state.

Recommended actions

To enter a different energy saving mode, the robot system must first be resumed.

For other users:

- Reinstall the system.

20441, Failed to initialize firmware patch

Description

Failed to initialize the firmware patch handling for hardware boards.

Consequences

No firmware patches for hardware boards will be applied.

Probable causes

The firmware patch file was invalid:*arg*.

Recommended actions

Correct the patch file. Use the schema hw_compatibility.xsd to verify.

20425, Write Access rejected

Description

Requesting Write Access, via System IO, was rejected.

Consequences

Write Access was not granted.

Probable causes

The reason could be that another client already holds write access or that the system isn't in Auto mode.

Recommended actions

Make sure that no other client, e.g. RobotStudio, holds write access and that the system is in Auto mode.

20443, Multiple firmware upgrade restarts

Description

A new restart to firmware upgrade mode was ordered after two consecutive upgrade restarts.

Consequences

No further restart to firmware upgrade mode was performed.

Probable causes

Firmware upgrade of a hardware board has most likely failed. The board's firmware or hardware may be corrupt.

Recommended actions

Check the event log for previous error messages.

20426, Write Access rejected

Description

Requesting Write Access, via System IO, was rejected.

The reason is that write access is held by *arg* using *arg*.

20444, The SD card was removed

Description

The SD card was removed.

Consequences

The system will enter system failure state.

Probable causes

The SD card was removed or there is a glitch in the contact between the SD card and the connector.

Recommended actions

Perform a restart as detailed in the Operator's Manual, IRC5.

20440, Failed to initialize FW upgrade framework

Description

The firmware upgrade framework for hardware boards could not be initialized.

Consequences

No firmware upgrade of hardware boards will be performed.

Probable causes

An invalid xml file in the controller installation:*arg*.

Recommended actions

For developers:

- Correct the file. Use the hw_compatibility.xsd schema to verify.

20445, The USB to Serial adapter was removed

Description

The USB to Serial adapter was removed.

Consequences

The USB to serial port is not accessible.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Probable causes

The USB to Serial adapter was removed or there is a glitch in the contact between the USB to Serial adapter or the connector.

Recommended actions

Perform a restart as detailed in the Operator's Manual, IRC5.

20446, Failed to access the HOME directory

Description

The system failed to access the HOME directory during startup.

The system has tried to create a new HOME directory to recover.

Consequences

The system has entered system failure state.

If a new HOME directory was created: *arg* then it will be empty.

Probable causes

The HOME directory was missing or renamed before the reboot of the system.

Recommended actions

1. Check the contents in the HOME directory for any missing file or folder.
2. Copy any missing contents to the HOME directory from a Backup and reboot the system or do a restore from a Backup to recover.

20450, SC *arg* CBC Speed exceeded

Description

Cyclic Brake Check (CBC) speed limit is exceeded in Safety Controller (SC) on mechanical unit *arg*. Either CBC test interval has expired or a previous brake check failed.

Recommended actions

Decrease speed and execute Brake check.

20451, SC *arg* Not synchronized

Description

Safety Controller (SC) *arg* is not synchronized with supervised mechanical units.

Recommended actions

Move all mechanical units supervised by Safety Controller *arg* to the synchronization positions defined in the safety configuration.

20452, SC *arg* Synchronized

Description

Safety Controller (SC) *arg* is now synchronized to supervised mechanical units. Safety supervision can be used.

20453, SC *arg*: Wrong Sync. Position

Description

The positions of the supervised mechanical units do not match the synchronization positions defined in the safety configuration for Safety Controller (SC) *arg* on axis *arg*.

Recommended actions

- Check that all supervised mechanical units are positioned at the configured synchronization position.
- Check that the synchronization switch is working properly.
- Check that motor calibration and revolution counters are updated and correct.
- Check that the synchronization position in the safety configuration is correct.
- Check for configuration error.
- Download motor calibration values.
- Check if axis 4 or 6 is configured as independent, if YES, check that the EPS configuration is configured likewise.

20454, SC *arg* Servo-Lag Limit exceeded

Description

Safety Controller (SC) *arg* detected a too big difference between the ordered and actual position, for mechanical unit *arg* on axis *arg*.

Recommended actions

- Check for collision.
- If using external axis, check Servo Lag settings in the safety configuration.
- If using Soft Servo, Check that the Operational Safety Range (OSR) Tolerance in the safety configuration is not set too low.
- Verify that revolution counters are updated.
- Check for communication problems to the main computer, axis computer or the serial measurement board.
- Check if tool weight is correctly defined.

20455, SC *arg* Incorrect Position Value

Description

Incorrect position value from serial measurement board detected by Safety Controller (SC) *arg* on mechanical unit *arg*.

Recommended actions

- Check resolver and resolver connections.

Continues on next page

- Replace serial measurement board.
- Replace resolver.

20456, SC arg Reference Data Timeout

Description

The robot controller has stopped sending reference data to Safety Controller (SC) arg.

Recommended actions

- 1) Check previous error logs for possible causes.
- 2) Restart the robot controller.

20457, SC arg Changed safety configuration

Description

The safety configuration for Safety Controller (SC) arg has changed contents or does not fit with the used hardware.

Probable causes

- New safety configuration has been downloaded, the normal case.
- The configuration does not fit with the used hardware. Typically when the event message with request for new pin code is repeated.
- Corrupt safety configuration. Typically when the event message with request for new pin code is repeated.

Recommended actions

- 1) Check for new event messages that indicates if a new safety configuration has been downloaded.
- 2) If no new safety configuration has been downloaded and this event message comes after a restart, download a new safety configuration to the Safety Controller.
- 3) Create and download a new safety configuration if this event message comes after every restart and there is a request for new pin code again.

20458, SC arg Internal Failure

Description

Internal Failure in Safety Controller (SC) arg.

Recommended actions

- Check Safety Controller cabling.
- Check Safety Controller health on LED.
- Replace Safety Controller if remaining error.

20459, SC arg Input/Output Failure

Description

I/O Error on Safety Controller (SC) arg.

Recommended actions

- Check Safety Controller cabling.
- Check Safety Controller health.

Restart robot controller, after performing recommended actions.

20460, SC arg safety configuration not found

Description

Failed to retrieve safety configuration for Safety Controller (SC) arg.

Recommended actions

- Restart robot controller.
- Download a safety configuration to the SC.
- Reinstall system.

20461, SC arg Robot Configuration not found

Description

Failed to retrieve robot configuration for Safety Controller (SC) arg.

Recommended actions

- Restart robot controller.
- Reinstall system.

20462, SC arg Calibration Offset not found

Description

Failed to retrieve motor calibration offsets for Safety Controller (SC) arg.

Recommended actions

- Download new calibration offsets to the SC.

20463, SC arg safety configuration downloaded

Description

Download of safety configuration was successful for Safety Controller (SC) arg.

20464, SC arg OSR Limit exceeded

Description

Safety Controller (SC) arg detected a too big difference between the ordered and actual position inside Operational Safety Range (OSR), for mechanical unit arg on axis arg.

Recommended actions

- Check for collision.
- Check that Operational Safety Range (OSR) Tolerance in the safety configuration is not set too low.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

- Synchronize the Safety Controller, if the revolution counters have been updated since last synchronization.

20465, SC arg SAS Speed exceeded

Description

Safe Axis Speed (SAS) violation on mechanical unit *arg* axis *arg* on Safety Controller (SC).

Recommended actions

Decrease speed on axis *arg*.

20466, SC arg Input/Output Failure

Description

I/O Error on Safety Controller (SC) *arg* I/O *arg* Type *arg*.

Type 1: Input.

Type 2: Output.

Probable causes

- Wrong connection to I/O terminals on SC.
- Two channel I/O mismatch.

Recommended actions

- Check SC cabling.
- Check SC health.

Restart robot controller, after performing recommended actions.

20467, SC arg STS speed exceeded

Description

Safe reduced Tool Speed (STS) in Safety Controller (SC) on mechanical unit *arg* too high. Cause *arg*.

Probable causes

- 1) Tool0 speed.
- 2) Elbow speed.
- 3) Tool speed.
- 4) Additional axis speed.

Recommended actions

Reduce tool speed.

20468, SC arg STZ violation

Description

Safe Tool Zone (STZ) *arg* is violated on mechanical unit *arg*. Tool *arg* was active.

Cause *arg*.

Probable causes

- 1) Exceeded speed.
- 2) Wrong tool position.
- 3) Wrong tool orientation.

Continues on next page

- 4) Wrong elbow position.
- 11) Wrong tool point 1 position.
- 12) Wrong tool point 2 position.
- 13) Wrong tool point 3 position.
- 14) Wrong tool point 4 position.
- 15) Wrong tool point 5 position.
- 16) Wrong tool point 6 position.
- 17) Wrong tool point 7 position.
- 18) Wrong tool point 8 position.

Recommended actions

- Reduce speed.
- Move robot tool to safe position.
- Adjust tool orientation.

20469, SC arg SAR violation

Description

Safe Axis Range (SAR) *arg* is violated on mechanical unit *arg* axis *arg*.

Recommended actions

Move mechanical unit to safe position.

20470, SC arg Synchronization Pre-warning

Description

Synchronization required for mechanical units supervised by Safety Controller (SC) *arg* in less than *arg* hour(s).

Recommended actions

Perform synchronization before the time limit expires.

20471, SC arg Synchronization Timeout

Description

Synchronization time limit expired for Safety Controller (SC) *arg*. Last synchronization was *arg* hours ago.

Recommended actions

Perform synchronization.

20472, SC arg New safety configuration

Description

Safety Controller (SC) *arg* has received a new safety configuration. A new PIN-code is needed to activate.

Recommended actions

- 1) Log in as a user with safety configuration grants.
- 2) Enter new PIN-Code for the Safety Controller in the Control Panel.

20473, SC arg Dual Computer mismatch

Description

Safety Controller (SC) *arg* have had conflicting values for a Safety Output for too long.

Consequences

The Safety Controller has entered a Safe State and issue an error after 10 minutes of internal mismatch, if recommended actions are not performed.

Probable causes

- The mechanical unit have been parked at a position on, or close to, a supervised or monitored function limit for too long time.
- Internal computation error in Safety Controller.

Recommended actions

Move all mechanical units' axes and tools well inside or outside monitored and supervised function limits.

20474, SC arg I/O Supply Failure

Description

I/O supply voltage level for Safety Controller (SC) *arg* is out of range.

Probable causes

Either the voltage is out of limits or the voltage is missing.

Recommended actions

- 1) Connect 24V supply with correct voltage level to I/O supply terminals.
- 2) Restart robot controller.

20475, SC arg Synchronization rejected

Description

Safety Controller (SC) *arg* is not correctly configured for synchronization.

Probable causes

- Safety configuration PIN is not set or is incorrect.
- Safety configuration is empty.
- Safety configuration is corrupt or missing.
- Safety Controller connected to the wrong SMB bus.
- I/O power supply missing.

Recommended actions

Verify and check possible causes.

20476, SC arg Disabled

Description

Safety Controller (SC) *arg* is disabled.

Consequences

All safety supervision has been disabled in the Safety Controller.
Risk for safety hazards.

Recommended actions

Download a safety configuration to the Safety Controller.

20477, SC arg SMB Communication Failure

Description

Safety Controller (SC) *arg* failed to communicate with serial measurement board (SMB).

Recommended actions

- 1) Make sure that the cabling from SMB to Safety Controller is connected to the right SMB connector and functional.
- 2) Restart the robot controller.

20478, SC arg Main Supply Failure

Description

The main power supply voltage for Safety Controller (SC) *arg* is out of range.

Probable causes

Either the voltage is out of limit or the voltage is missing.

Recommended actions

- 1) Check Safety Controller cabling.
- 2) Check voltage from power supply.
- 3) Restart robot controller.

20479, SC arg Additional Axis missing

Description

An additional axis that is supervised by Safety Controller (SC) *arg* is no longer present in the system configuration.

Recommended actions

Reinstall the supervised additional axis, or download a safety configuration without supervision of the additional axis.

20480, SC arg SST violation

Description

Safe Stand Still (SST) *arg* in Safety Controller (SC) is violated on mechanical unit *arg* axis *arg*.

Recommended actions

- Verify RAPID program.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

- Verify process equipment.
- Check that movement is not ongoing when SST is active.
- Check previous event messages.

20481, SC arg OVR active

Description

Override Operation (OVR) active on Safety Controller (SC) *arg*. SafeMove will stop the robot after approximately 20 minutes with OVR active.

Speed is limited to 250 mm/s or 18 degrees/s.

Recommended actions

Deactivate signal connected to OVR input.

20482, SC arg OVR time out

Description

Override Operation (OVR) has been active too long time on Safety Controller (SC) *arg*.

Recommended actions

- 1) Restart robot controller.
- 2) Toggle signal connected to OVR input.
- 3) Activate Confirm stop by pressing Motors On push button.
- 4) Jog robot back into working area.
- 5) Deactivate signal connected to OVR input.

20483, SC arg CBC soon required

Description

Cyclic Brake Check (CBC) required in less than *arg* hours.

Recommended actions

Perform a brake check before the time limit expires.

20484, SC arg CBC needs to be done

Description

Cyclic Brake Check (CBC) time limit expired in Safety Controller (SC) or last brake check failed.

Recommended actions

Perform a brake check.

20485, SC arg Too low brake torque

Description

Too low brake torque in Safety Controller (SC) on mechanical unit *arg* axis *arg*.

Probable causes

- Axis has not been tested.
- Worn out brake(s).

Continues on next page

Recommended actions

- Check that the failing axis is activated.
- If failing axis is activated replace brake(s) as soon as possible.

20486, SC arg CBC interrupted or incorrect

Description

Safety Controller (SC) has detected that the last Cyclic Brake Check (CBC) on mechanical unit *arg* was interrupted or incorrect.

Recommended actions

- Check previous event messages.
- Perform a new brake check only if needed, typically if event message 20485 also has been displayed.

20487, SC arg Unsynchronized speed exceeded

Description

Exceeded axis speed when Safety Controller (SC) *arg* was unsynchronized.

Recommended actions

Jog mechanical unit to synch position with low axis speed.
Reduce speed to 250 mm/s or 18 degrees/s.

20488, SC arg Unsynchronized time limit expired

Description

Available time to move the robot when unsynchronized has expired for Safety Controller (SC) *arg*.

Recommended actions

- 1) Do a Confirm stop by pressing the Motors ON push button or activate system input.
- 2) Synchronize SC *arg*.

20489, SC arg has been disabled

Description

Safety Controller (SC) *arg* has been disabled and no supervision functions are active.

Probable causes

Either a system reset has been performed or it's the first startup of SC.

Recommended actions

Download a configuration to SC *arg*.

20490, SC arg OVR Speed exceeded

Description

Override (OVR) Speed limit exceeded on mechanical unit *arg*.

Probable causes

If Override (OVR) is active, then OVR speed limitations will be active.

Recommended actions

- Decrease speed.
- Deactivate OVR.

20491, SC arg Override active during startup

Description

Override digital input was active during startup on SC arg.

20492, SC arg SST violation in Brake test

Description

Movement detected during Brake test on Safety Controller (SC) arg. Mechanical unit arg. Axis arg.

Probable causes

- Interrupted braketest.
- Worn out Brakes.

Recommended actions

- Restart CBC.
- Replace Brake.

20493, SC arg SBR triggered

Description

Safe Brake Ramp (SBR) on Safety Controller (SC) was interrupted by a Class 0 stop due to slow deceleration on mechanical unit arg. This is normal and occurs in cases when a stop1 is to slow. Check for other safety controller event messages.

Recommended actions

- Change parameter value for SBR in Motion configuration.
- Trigger a new stop to test the Brake Ramp.
- If this happens frequently, check the Application manual for mechanical units' configuration.

20494, SC arg Tool change incorrect

Description

Incorrect tool change with Tool arg on mechanical unit arg.

Recommended actions

- Check if correct tool.
- Decrease speed if needed.
- Perform a new tool change.

20501, ES panel open

Description

The emergency stop panel has previously been broken, and while broken, an attempt was made to operate the robot.

Consequences

The system remains in the Emergency Stop status.

Probable causes

An attempt has been made to maneuver a control, e.g. the enabling device.

Recommended actions

- 1) To resume operation, first reset the emergency stop panel button.
- 2) Then switch the system back to state Motors ON by pressing the Motors ON button on the Control Module.

20502, ES pendant open

Description

The emergency stop pendant has previously been broken, and while broken, an attempt was made to operate the robot.

Consequences

The system remains in the Emergency Stop status.

Probable causes

An attempt has been made to maneuver a control, e.g. the enabling device.

Recommended actions

- 1) To resume operation, first reset the emergency stop pendant button.
- 2) Then switch the system back to state Motors ON by pressing the Motors ON button on the Control Module.

20503, ES ext.cat.0 open

Description

The emergency stop external has previously been broken, and while broken, an attempt was made to operate the robot.

Consequences

The system remains in the Emergency Stop status.

Probable causes

An attempt has been made to maneuver a control, e.g. the enabling device.

Recommended actions

- 1) To resume operation, first reset the emergency stop external button.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

2) Then switch the system back to state Motors ON by pressing the Motors ON button on the Control Module.

20505, Delayed stop open

Description

Delayed stop open.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) To resume operation, first reset the delayed stop button.
- 2) Then switch the system back to state Motors ON by pressing the Motors ON button on the Control Module.

20506, Test Stop open

Description

The Test Mode Safeguarded Stop circuit has been broken.

Consequences

The system goes to status SYS HALT.

Probable causes

One or more of the switch connected in series with the Test Mode Safeguarded Stop circuit have been opened, which may be causes by a large number of faults. This is only possible while in the Manual operational mode.

Recommended actions

- 1) Locate the switch, reset it and restart the controller.
- 2) Check cables and connections.

20507, Hardware chain open

Description

Relays (KA16 and KA17) on Safety Interface Board (SIB) not activated.

Consequences

Motor on command rejected.

Recommended actions

Press motor ON button to close the chain.

20521, Test Stop conflict

Description

Status conflict for the Test Stop chain.

Consequences

The system goes to status SYS HALT.

Recommended actions

Please check the two-channel safety guard that caused the status conflict.

20525, ES panel conflict

Description

Status conflict for the Emergency Stop panel chain.

Consequences

The system goes to status emergency stop.

Recommended actions

Please check the two-channel safety guard that caused the status conflict.

20526, ES pendant conflict

Description

Status conflict for the Emergency Stop pendant chain.

Consequences

The system goes to status emergency stop.

Recommended actions

Please check the two-channel safety guard that caused the status conflict.

20527, ES ext.cat.0 conflict

Description

Status conflict for the Emergency Stop ext.cat.0 chain.

Consequences

The system goes to status emergency stop.

Recommended actions

Please check the two-channel safety guard that caused the status conflict.

20528, HV Interlock input conflict

Description

Only one of the two input signals in the high voltage chains is opened.

Consequences

Paint enable chain opens.

Recommended actions

Please check the two-channel safety guard that caused the status conflict.

Continues on next page

20529, Cabin Interlock input conflict

Description

Only one of the two input signals in cabin interlock chains is opened.

Consequences

Paint enable chain opens.

Recommended actions

Check cables and connections.

20531, Delayed Stop conflict

Description

Status conflict for the delayed stop circuit.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check cables and connections.

20534, Mode selector conflict

Description

Any of the connections to the mode selector are faulty.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check cables and connections.

20535, AUX Interlock conflict

Description

Only one of the two AUX interlock chains was opened. Normally used on CBS door interlock.

Consequences

Paint enable chain opens.

Recommended actions

Check cables and connections.

20536, Motor on chain conflict

Description

Only one of the two motor on chain signals in run chain is opened.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check cables and connections.

20550, Glitch test fault

Description

Status active when firmware on Process Interface Board (PIB) did not detect any glitch test pulse for 30 seconds.

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check other error messages for primary fault reason.
2. Check for communication problems between PIB and Main Computer (MC).

20556, Enable 2 AXC 1 open

Description

Status active when enable from Axis Computer 1 open.

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check other error messages for primary fault reason.
2. If no other error messages, please check line voltage for one phase missing.

20557, Enable 2 AXC 2 open

Description

Status active when enable from Axis Computer 2 open.

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check other error messages for primary fault reason.
2. If no other error messages, please check line voltage for one phase missing.

20558, Manipulator fault

Description

Status active when power to manipulator arg connected to Manipulator Interface Board (MIB) arg is lost, or manipulator's enable chain conditions is not OK.

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check the power to the manipulator.
2. Check that the enable chain on Manipulator Controller Board (MCOB/MCB) is OK.
3. Check for over temperature in Manipulator motors.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

4. Check manipulator signals through Power Distribution Board (PDB). See the Circuit Diagram.

20559, Collision sensor active

Description

Status active when digital collision sensor on Manipulator Controller Board (MCOB) *arg* is active.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check the collision sensors connected to MCOB.

20560, Axis limit on MCOB

Description

Status active when limit sensor on Manipulator Controller Board (MCOB) *arg* is active.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check the limit sensors connected to MCOB.

20561, Manipulator software has opened enable chain

Description

Status active when Manipulator Controller Board (MCOB/MCB) *arg* software has opened the enable chain.

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check other error messages for primary fault reason.
2. Check for brake fault.

20562, Reset ES fault

Description

Status active when Reset Emergency Stop input is activated for more than 3 seconds.

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check the connection of external reset of Emergency Stop.
2. Check the motor on push button.

20563, Servo disconnect open

Description

Status active when Servo disconnect switch on system *arg* is off.

Consequences

The system goes to status SYS HALT.

Recommended actions

If Servo disconnect switch is not installed, check the disable link on Manipulator Interface Board (MIB).

20564, Brake rel. on axes 1 & 7

Description

Status active when manual brake release on axes 1 and 7 enabled.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check switch for manual brake release of axes 1 and 7.

20565, External enable 1 open

Description

Status active when external enable 1 on Manipulator Controller Board (MCOB) *arg* is open.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check connection on MCCB X25.

20566, External enable 2 open

Description

Status active when external enable 2 on Manipulator Controller Board (MCOB) *arg* is open.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check connection on MCCB X43.

20567, Power low on MCOB

Description

Status active when power below 16V on Manipulator Controller Board (MCOB) *arg*.

Continues on next page

Consequences

The system goes to status SYS HALT.

Recommended actions

Check power on MCOB.

20568, Hardware enable open on MCOB/MCB**Description**

Status active when firmware on Manipulator Controller Board (MCOB/MCB) arg has opened the enable chain.

Consequences

The system goes to status SYS HALT.

20569, Watchdog fault on MCOB/MCB**Description**

Status active when watchdog on Manipulator Controller Board (MCOB/MCB) arg fails.

Consequences

The system goes to status SYS HALT.

20570, FlexPendant wiring error**Description**

Status active when Process Interface Board (PIB) detects fault on emergency stop pendant and enabling device signals (glitch test).

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check cables and connections to FlexPendant.
2. Check Pendant Interface Board (TIB) and Manipulator Interface Board (MIB).

20571, HV Interlock open**Description**

Paint system High Voltage (HV) interlock is opened by external interlock connection.

Consequences

Paint enable chain opens.

Recommended actions

Check manual switch for disconnecting of the HV system.

20572, Cabin Interlock open**Description**

Cabin Interlock is opened by external interlock connection.

Consequences

Paint enable chain opens.

Recommended actions

Check cabin ventilation and other cabin safety functions.

20573, Controller ID is Missing**Description**

Controller ID is the controller's unique identity. It is by default equal to the serial number of the controller's cabinet. The software configuration of the controller is missing this identity information.

Probable causes

This may happen if the storage media of the controller has been replaced or reformatted.

Recommended actions

Read the serial number of the controller from the controller cabinet to find out what the controller ID should be. Use RobotStudio tools to set this value for the controller.

20574, Process Interlock open**Description**

Process Interlock is opened by external interlock connection.

Consequences

Paint enable chain opens.

Recommended actions

Check manual switch for disconnecting of the process system.

20575, AUX Interlock open**Description**

AUX Interlock is opened by external interlock connection.

Normally used for Cartridge Bell System (CBS).

Consequences

Paint enable chain opens.

Recommended actions

Check cables and equipment connected to AUX inputs.

20576, System 2 Interlock open**Description**

System 2 Interlock is opened. Normally used for Cartridge Bell System (CBS) or paint pumps.

Consequences

Paint enable chain opens.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Recommended actions

Check cables and equipment connected to system 2.

20577, HV ON open

Description

High Voltage (HV) switch on operating panel is opened.

Consequences

Paint enable chain opens.

Recommended actions

Give acknowledge on motor ON and switch on the HV key to close the HV interlock chain.

20581, SPI communication towards SIB is down

Description

Status active when cyclic enable 1 test fails from Safety Interface Board (SIB).

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check status on Serial Peripheral Interface (SPI) status.
2. Check cables between Process Interface Board (PIB) and SIB.

20582, SPI communication towards MIB is down

Description

Status active when cyclic enable 1 test fails from Manipulator Interface Board (MIB) *arg.*

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check cables and Serial Peripheral Interface (SPI) status.
2. Check cables between SIB and Manipulator Interface Board (MIB).

20583, Watchdog towards PIB software fails

Description

Status active when firmware on Process Interface Board (PIB) discover watchdog fault between PIB firmware and PIB software.

Consequences

The system goes to status SYS HALT.

Probable causes

Too high processor load on PIB software.

20584, Fault on internal SPI

Description

Status active when firmware on Process Interface Board (PIB) discover watchdog fault towards Safety Interface Board (SIB) and Manipulator Interface Board (MIB).

Consequences

The system goes to status SYS HALT.

Probable causes

Serial Peripheral Interface (SPI) communication is down on SPI 1.

Recommended actions

Check cables between PIB, SIB and MIB.

20585, Enable chain opened from IPS

Description

Status active when enable chain is opened from signal Safety/PibSw/Enable.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check the actuator connected to signal Safety/PibSw/Enable.

20586, Watchdog fault towards PIB firmware

Description

Status active when software on Process Interface Board (PIB) discover watchdog fault towards PIB firmware caused by fault on FPGA.

Consequences

The system goes to status SYS HALT.

20587, Watchdog fault towards PIB firmware

Description

Status active when software on Process Interface Board (PIB) discover watchdog fault towards PIB firmware caused by fault on the In-System Micro Controller.

Consequences

The system goes to status SYS HALT.

Probable causes

Firmware not running.

Continues on next page

20588, Watchdog fault between PIB and MC

Description

Process Interface Board (PIB) has detected a watchdog fault towards Main Computer (MC).

Consequences

The system goes to status SYS HALT.

Probable causes

1. Broken Ethernet cable between PIB and MC.
2. High network load.

Recommended actions

If problem persists:

1. Check MC.
2. Check Ethernet cable between PIB and MC.
3. Restart the controller.

20589, Watchdog fault between PIB and MCOB

Description

Status active when agent connection on CAN between Process Interface Board (PIB) and Manipulator Controller Board (MCOB) is down.

Consequences

The system goes to status SYS HALT.

Recommended actions

1. Check CAN cables.
2. Check MCOB status.

20590, Open circuit mask not set

Description

The open circuit mask for brakes on Manipulator Controller Board (MCOB/MCB) *arg* is not set. The mask should be set from Process Interface Board (PIB) during start-up.

Consequences

This message will be given every time the brakes are released, until the open circuit mask on MCOB/MCB is set.

Probable causes

IPS configuration on PIB is not loaded or configuration file for brake settings is missing.

Recommended actions

1. Check that IPS configuration is loaded during start-up.
2. Check that IPS configuration file for brake settings are installed on PIB.

20591, FlexPendant hot plug timeout

Description

The FlexPendant hot plug button is pressed for too long time.

Consequences

The system goes to status SYS HALT.

Recommended actions

Press motor ON button to close the chain.

20592, External process enable open

Description

Status active when external process enable connection on Manipulator Controller Board (MCB) *arg* is open.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check connection on MCB X2.

20593, IO power low on MCB

Description

Status active when IO power below 16V on Manipulator Controller Board (MCB) *arg*.

Consequences

The system goes to status SYS HALT.

Recommended actions

Check power on MCB.

20594, Communication fault between PIB and MC

Description

Process Interface Board (PIB) has detected a communication fault towards Main Computer (MC).

Consequences

The system goes to system failure state.

Probable causes

1. Broken Ethernet cable between PIB and MC.
2. High network load.

Recommended actions

1. Check Ethernet cable between PIB and MC.
2. Check MC.
3. Restart the controller.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

20600, Unofficial RobotWare release

Description

The current RobotWare is not an officially supported release. Unofficial RobotWare releases may only be used for time-limited test and validation purposes.

Consequences

ABB will not provide long-term support on unofficial releases.

Recommended actions

If this is a production system, install an official RobotWare release as soon as possible.

20601, Too long paths when unpacking RobotWare files

Description

The RobotWare installation package was not properly unpacked on the controller. Some files in the package have a path that is too long and could not be handled by the controller software. During the installation process the controller software was upgraded to handle longer paths, so a re-installation of the system should solve the problem.

Consequences

Some RobotWare files are missing on the controller and your system may not be able to operate properly.

Recommended actions

Re-install the system by using SystemBuilder. If the error is still present after the re-installation, contact customer support.

20602, Unofficial RobotWare image

Description

The current RobotWare main computer image is not the original, and is hence not officially supported.

Consequences

ABB will not provide long-term support on unofficial RobotWare releases.

Probable causes

The officially released main computer image has been replaced, e.g., for the purpose of collecting diagnostic data for a specific problem.

Recommended actions

If this is a production system, install an official RobotWare release as soon as possible.

20610, Motor phase short circuit

Description

The drive unit for joint *arg* has reported short circuit. The joint is connected to drive module *arg* with unit position *arg* and node *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state with zero torque.

Probable causes

- 1) Short circuit in cables or connectors between the phases or to ground.
- 2) Short circuit in motor between the phases or to ground.

Recommended actions

- 1) Check/replace cables and connectors.
- 2) Check/replace motor.

20620, The system has entered an internal test mode

Description

A feature to perform ABB Robotics internal tests has been enabled in *arg*.

Consequences

The system may not behave as expected.

Recommended actions

Restart the controller when the test has been performed. If this was an unexpected message, please contact your contact your local ABB representative for assistance.

20630, Camera job missing Output to Rapid

Description

The camera *arg* has a job loaded that is not created with the "Use Output to Rapid" functionality. The "Use Output to Rapid" functionality will be disabled until the next state change from program mode to run mode.

Consequences

All functionality that requires the use of output to Rapid, e.g. CamGetResult, is turned off. CamGetParameter is not affected and will still work.

Probable causes

- The "Use Output to Rapid" configuration parameter is set to Yes, but was supposed to be set to No.
- The job loaded into the camera is not correct or is not compatible with this version of RobotWare.

Continues on next page

Recommended actions

- Set the camera in program mode. Load a valid job into the camera or use Robot Studio to create one.
- In RobotStudio in the "Vision"-tab, select "Output to RAPID" to convert parameters to RAPID variables and save the job.
- Set the "Use Output to Rapid" configuration parameter to No, if that functionality is not intended to be used.

20631, Communication failure with camera**Description**

The robot controller failed to communicate with camera *arg*.

Consequences

Camera results may be lost.

Recommended actions

- Check camera status.
- Check cabling between the robot controller and the camera.

20632, IP address of the camera has changed**Description**

The IP address of the camera *arg* has changed. It is necessary to restart the controller to use the Integrated Vision functionality.

Recommended actions

Restart the controller.

20633, Integrated Vision not installed**Description**

The option Integrated Vision is not installed on this system.

Consequences

No communication with the camera is possible.

Probable causes

The Integrated Vision functionality have been used or configured without the Integrated Vision option installed.

Recommended actions

- 1) If the Integrated Vision option is needed: configure a new system with this option, and install the system.
- 2) If the Integrated Vision option is not needed: remove the use of Integrated Vision functionality, i.e. RAPID or configuration data.

20634, No result for current camera job**Description**

The robot controller did not receive any result for camera *arg*.

Consequences

The robot controller will not recognize any positional data in the image.

Probable causes

No part tools have been defined for the current job loaded in camera *arg*.

Recommended actions

Use RobotStudio to add a Part Location Tool or a Part Inspection Tool to the job. Follow the instruction in the RobotStudio context menu and save the job.

20635, Too many cameras connected**Description**

Number of cameras connected to the robot controller is *arg*. Max number of cameras for a robot controller is *arg*.

Consequences

The robot controller will not communicate with all the cameras.

Probable causes

Maximum number of cameras for a robot controller have been exceeded.

Recommended actions

Reduce the number of cameras connected to the robot controller.

20636, Duplicated camera name**Description**

The camera configuration is invalid. The camera name *arg* have been used for more than one camera.

Consequences

The robot controller will not communicate with cameras with the same name.

Probable causes

Two or more cameras with the same name have been configured.

Recommended actions

Rename the cameras so that they have unique names and restart the controller.

20637, Camera permission denied**Description**

Permission denied to login to the camera with ip address *arg* using username *arg*.

Continues on next page

5 Trouble shooting by event log

5.4 2 xxxx

Continued

Consequences

The robot controller cannot login to the camera.

Probable causes

Username and/or password is not correct.

Recommended actions

From RobotStudio Integrated Vision Add-In use "Set Controller User" to select camera login credentials to be used by the controller.

20638, Option missing

Description

You are trying to use functionality that require the RobotWare Option *arg*.

Recommended actions

Check the options of your system.

Correct your system options and reset the system.

20639, Camera connection up

Description

The robot controller communicates correctly with the camera *arg* with IP address *arg*.

20640, Camera connection down

Description

The connection to camera *arg* with IP address *arg* has been lost.

Consequences

The robot controller cannot access the camera.

Recommended actions

Check cabling and camera settings.

20641, New camera detected

Description

A new camera with mac address *arg* has been detected.

20650, DryRun aborted

Description

DryRun was aborted when program execution reached end of main without reaching position where program pointer was placed when DryRun started.

Consequences

All signals value might not have been updated as planned and PP might be in wrong place.

Probable causes

The program pointers original position could not be reached while restarting execution in DryRun mode from the beginning of the routine.

Recommended actions

Move PP to Main to restart the production cycle and refresh all signal values.

20651, Image request timed out

Description

An image request for camera *arg* has timed out.

Consequences

- If the camera is still processing the image then new commands towards the camera may not respond and also timeout.
- If/when the current processing image completes it will insert the results into the database.

Probable causes

- The timeout set in configuration for the maximum time for image requests may be set too low.
- The camera may be in an error state.
- The communication with the camera is down.

Recommended actions

- If the image processing time is larger than the maximum time set in configuration for image requests, then adjust the configuration.
- Start and try again.
- If the problem remain, restart the camera.

20652, Camera job is not valid

Description

The job loaded into the camera *arg* is not correct or is not compatible with this version of RobotWare.

Consequences

The camera will reset to program mode.

Probable causes

- The job loaded into the camera is not correct or is not compatible with this version of RobotWare.
- The "Use Output to Rapid" configuration parameter is set to Yes, but was supposed to be set to No.

Recommended actions

- If the usage of output to Rapid functionality, e.g. CamGetResult, is not intended to be used, then set the "Use Output to Rapid" configuration to No.

Continues on next page

- If the "Use of Output to Rapid" functionality is needed then a correct job has to be loaded into the camera.
- Make sure that the fields in the "Output to Rapid" tab is saved before loading the job.

5 Trouble shooting by event log

5.5 3 xxxx

5.5 3 xxxx

31810, DeviceNet master/slave board is missing

Description

The DeviceNet master/slave board does not work.

Consequences

No communication on the DeviceNet network is possible.

Probable causes

The DeviceNet master/slave board is either malfunctioning or missing.

Recommended actions

- 1) Make sure a DeviceNet master/slave board is installed.
- 2) Replace the board if faulty.

31910, PROFIBUS master board is missing

Description

The PROFIBUS master board does not work.

Consequences

No communication on the Profibus is possible.

Probable causes

The PROFIBUS master board is either malfunctioning or missing.

Recommended actions

- 1) Make sure a PROFIBUS master board is installed.
- 2) Replace the board if faulty.

31911, Profibus board update error

Description

The RobotWare software was not able to download new driver software to the PROFIBUS master board. The *arg* channel (*ch arg*) of the Profibus board could not be programmed. Internal error code:*arg*.

Consequences

No communication on the Profibus is possible.

Probable causes

The RobotWare software may be corrupt or the board hardware may be malfunctioning.

Recommended actions

- 1) Restart the controller to reattempt downloading the software.
- 2) Reinstall the present system files.
- 3) Create and run a new system to download the driver software.
- 4) Replace the board if faulty.

31912, PROFIBUS master board failure

Description

The PROFIBUS master board did not start up correctly.

Consequences

No communication on the Profibus is possible.

Probable causes

The PROFIBUS master board hardware may be malfunctioning.

Recommended actions

- 1) Restart the controller.
- 2) Replace the PROFIBUS master board if faulty.

31913, PROFIBUS master board internal error

Description

The PROFIBUS master board reported internal error *arg*.

Consequences

No communication on the PROFIBUS network is possible.

Probable causes

The PROFIBUS master board hardware may be malfunctioning.

Recommended actions

- 1) Restart the controller.
- 2) Replace the PROFIBUS master board if faulty.

31914, PROFIBUS network startup error

Description

- PROFIBUS network startup error *arg*. Check cabling, terminators and modules then restart.

Recommended actions

31915, PROFIBUS network error

Description

PROFIBUS master network error.

Internal error

Error code *arg*.

Consequences

Certain expected associated errors may be delayed.

Probable causes

Faulty PROFIBUS cabling, terminators and/or module(s).
Duplicated PROFIBUS addresses.

Continues on next page

Recommended actions

Check cabling, terminators and modules.

31916, PROFIBUS network OK**Description**

- PROFIBUS regained contact on the master network.

Recommended actions

31917, PROFIBUS master board exception**Description**

A fatal error has occurred on the PROFIBUS master board. *arg* channel in task *arg*. Parameters *arg*.

Consequences

No communication on the Profibus is possible.

Probable causes

The PROFIBUS master board hardware may be malfunctioning.

Recommended actions

- 1) Restart the controller.
- 2) Replace the PROFIBUS master board if faulty.

32501, Main computer fpga not reachable**Description**

The system cannot contact the fpga on the main computer.

Consequences

No communication with the safety system is possible. The system goes to system failure state.

Probable causes

The main computer fpga is malfunctioning.

Recommended actions

- 1) Replace the unit if faulty.

32530, No Communication With The Safety System**Description**

There is no serial communication between the safety system and the robot communication card.

Consequences

The system goes to system failure state.

Probable causes

Probably hardware fault in cable between safety system and Robot Communication Card. The safety system, or its power supply, may also be faulty.

Recommended actions

- 1) Restart the controller to resume operation.
- 2) Make sure the cable between robot communication card and safety system is working and correctly connected.
- 3) Check the safety system power supply.
- 4) Replace the unit if faulty.

32540, Drive unit firmware re-flash started**Description**

In drive module *arg*, a required upgrade of the firmware in the drive unit at unit position *arg* has started. The old firmware revision *arg* is replaced with revision *arg*.

Recommended actions

Wait for the firmware upgrade process to complete. Do not turn off system power!

32541, Drive unit firmware re-flash complete**Description**

In drive module *arg*, the upgrade of the firmware in the drive unit with unit position *arg* is completed. New revision is *arg*.

32542, Drive unit hardware not supported**Description**

In drive module *arg*, the system cannot use the drive unit with hardware identity *arg* because the hardware revision *arg* is not supported.

Consequences

The system is unable to use the drive unit. The system goes to system failure state.

Probable causes

The RobotWare version is too old to support the drive unit.

Recommended actions

- 1) Upgrade the system to a RobotWare version supporting the drive unit revision.
- 2) Replace the drive unit to one with compatible revision.

32543, Drive unit firmware re-flash failed**Description**

In drive module *arg*, the upgrade of the firmware in the drive unit at unit position *arg* failed.

Consequences

The required upgrade of the drive unit firmware is not performed.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Recommended actions

- 1) Check other hardware event log messages for detailed explanation of the error condition.
- 2) Try again by restart the controller using the main power switch.

32544, Drive unit firmware file not found

Description

The file *arg*, required to upgrade a drive unit's firmware, is not found.

Consequences

The required upgrade of the drive unit firmware is not performed.

Probable causes

The RobotWare installation does not contain the firmware file.

Recommended actions

Reinstall the system.

32545, Drive unit firmware file type error

Description

The file *arg*, required to upgrade a drive unit's firmware, is of wrong type.

Consequences

The required upgrade of the drive unit firmware is not performed.

Probable causes

The RobotWare installation is faulty.

Recommended actions

Reinstall the system.

32546, Drive unit firmware file error

Description

The file *arg*, required to upgrade a drive unit's firmware, is not usable because it failed the integrity check.

Consequences

The required upgrade of the drive unit firmware is not performed.

Probable causes

The RobotWare installation is faulty.

Recommended actions

Reinstall the system.

32550, Firmware re-flash started

Description

A required update of the *arg* firmware has started. File used: [*arg*].

Recommended actions

Wait for the re-flash to complete.

32551, Firmware re-flash completed

Description

The update of *arg* firmware has completed successfully.

32552, Firmware re-flash failed

Description

The update of *arg* firmware failed.

Internal error code:*arg*.

Recommended actions

- 1) Check other error messages for detailed explanation.
- 2) Restart the controller.
- 3) Reinstall the system.
- 4) Replace the *arg*.

32553, Firmware file is corrupt

Description

The firmware file [*arg*] is corrupt. Internal error code:*arg*.

Recommended actions

Reinstall the system.

32554, Firmware file not found

Description

The firmware file [*arg*] is not found.

Recommended actions

Reinstall the system.

32555, Safety System Unit Not Supported

Description

The system cannot use the safety system unit *arg*, revision *arg*.

Consequences

The system is unable to use the affected hardware.

Recommended actions

- 1) Change the affected hardware to a compatible version.

Continues on next page

32560, Axis computer firmware re-flash started

Description

In drive module *arg*, a required upgrade of the firmware in the axis computer *arg* with hardware identity *arg* has started. The old firmware revision *arg* is replaced with revision *arg*.

Recommended actions

Wait for the firmware upgrade process to complete. Do not turn off system power!

32561, Axis computer firmware re-flash complete

Description

In drive module *arg*, the upgrade of the firmware in the axis computer *arg* with hardware identity *arg* is completed. New revision is *arg*.

32562, Axis computer communication error

Description

The system failed to communicate with the axis computer in drive module *arg* when trying to read firmware information.

Consequences

The system is unable to determine if an upgrade is required of the firmware in the affected drive module. The system goes to system failure state.

Probable causes

This may be due to a cable break, bad connector or high levels of interference in the cable between the main computer and the axis computer.

Recommended actions

- 1) Make sure the cable between the main computer and the axis computer is not damaged and that both connectors are correctly connected.
- 2) Make sure no extreme levels of electromagnetic interference are emitted close to the robot cabling.

32563, Axis computer hardware not supported

Description

In drive module *arg*, the system cannot use the axis computer with hardware identity *arg* because the hardware revision *arg* is not supported.

Consequences

The system is unable to use the axis computer. The system goes to system failure state.

Probable causes

The RobotWare version is too old to support the axis computer unit.

Recommended actions

- 1) Replace the axis computer to one with compatible revision.
- 2) Upgrade the system to a RobotWare version supporting the axis computer revision.

32564, Axis computer firmware re-flash failed

Description

In drive module *arg*, the upgrade of the firmware in the axis computer *arg* with hardware identity *arg* failed.

Consequences

The required upgrade of the axis computer firmware is not performed.

Recommended actions

- 1) Check other hardware event log messages for detailed explanation of the error condition.
- 2) Retry again by restarting the controller using the main power switch.

32565, Axis computer firmware file not found

Description

The file *arg*, required to upgrade an axis computer's firmware, is not found.

Consequences

The required upgrade of the axis computer firmware is not performed.

Probable causes

The RobotWare installation does not contain the firmware file.

Recommended actions

Reinstall the system.

32567, Axis computer firmware file type error

Description

The file *arg*, required to upgrade an axis computer firmware, is of wrong type.

Consequences

The required upgrade of the axis computer's firmware is not performed.

Probable causes

The firmware file is corrupt.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Recommended actions

Reinstall the system.

2) Reinstall the system.

32568, Axis computer firmware file error

Description

The file *arg*, required to upgrade an axis computer's firmware, is not usable because it failed the integrity check.

Consequences

The required upgrade of the axis computer firmware is not performed.

Probable causes

The firmware file is corrupt.

Recommended actions

Reinstall the system.

32573, Unable to download firmware file

Description

The firmware file *arg* is not found. Internal error code:*arg*.

Recommended actions

Reinstall the system.

32574, Corrupt axis computer hardware

Description

The *arg* flash memory has a corrupt content. Internal error code:*arg*.

Recommended actions

- 1) Check other hardware event log messages for detailed explanation of the error condition.
 - 2) Restart the controller.
 - 3) If failure occurs again, replace the axis computer.
-

32575, Found no axis computer board

Description

System failed to detect any connected axis computer.

Recommended actions

- 1) Check system for axis computer board.
 - 2) Check Ethernet cables between the main computer and the axis computer.
 - 3) Restart the controller.
-

32576, Axis firmware: No communication

Description

The system failed to communicate with axis board *arg* when trying to check the firmware version.

Consequences

The system is unable to check and if necessary upgrade the firmware in the affected axis computer.

Recommended actions

- 1) Check system for axis computer board.
 - 2) Check Ethernet cables between the main computer and the axis computer.
 - 3) Restart the controller.
-

32577, Axis computer hardware data error

Description

In drive module *arg*, the axis computer has corrupt information stored on the unit.

32570, Firmware re-flash started

Description
A required update of the *arg* firmware has started. Replacing old firmware version: [*arg*].

Recommended actions
Wait for the re-flash to complete.

32571, Firmware re-flash completed

Description
The update of *arg* firmware has completed successfully. New version: [*arg*]. Internal code:[*arg*]

32572, Firmware re-flash failed

Description
The upgrade of *arg* firmware failed.
Current version:*arg*. Internal error code:*arg*.

Recommended actions
1) Check other hardware eventlog messages for detailed explanation of the error condition.

Continues on next page

Consequences

The system goes to system failure state.

Probable causes

The integrity check of the axis computer information stored on the unit has failed.

Recommended actions

- 1) Retry again by restarting the controller using the main power switch.
- 2) Replace the faulty axis computer.

32580, Firmware re-flash started**Description**

A required update of the *arg* firmware has started. Internal code: *[arg]*.

File: *[arg]*.

Recommended actions

Wait for the re-flash to complete.

32581, Firmware re-flash completed**Description**

The update of *arg* firmware has completed successfully. Internal code: *[arg]*

Recommended actions

No action required.

32582, Firmware re-flash failed**Description**

The update of *arg* firmware failed.

Internal error code: *arg*.

Recommended actions

- 1) Check other error messages for detailed explanation.
- 2) Reinstall the system.

32583, Firmware file corrupt**Description**

The update of *arg* firmware failed.

The firmware file *[arg]* is corrupt.

Internal error code: *arg*.

Recommended actions

Reinstall the system.

32584, Firmware file not found**Description**

The update of *arg* firmware failed.

The firmware file *[arg]* is not found.

Internal error code: *arg*.

Recommended actions

Reinstall the system.

32585, No Safety System Found By Axis Computer**Description**

Axis computer failed to detect the safety system.

Recommended actions

- 1) Check communication cables between the axis computer and the safety system.
- 2) Check power supply to the safety system.
- 3) Restart the controller.

32590, Firmware re-flash started**Description**

A required update of the *arg* firmware in drive module *arg* has started.

File: *[arg]*.

Recommended actions

Wait for the re-flash to complete, this will take approximately 3.5 minutes.

32591, Firmware re-flash completed**Description**

The update of *arg* firmware in drive module *arg* has successfully completed.

Recommended actions

No action required.

32592, Firmware re-flash failed**Description**

The update of *arg* firmware in drive module *arg* has failed.

Recommended actions

- 1) Check other error messages for detailed explanation.
- 2) Reinstall the system.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

32593, Firmware file corrupt

Description

The update of *arg* firmware in drive module *arg* has failed.

The firmware file [*arg*] is corrupt.

Recommended actions

Reinstall the system.

Consequences

Joint not synchronized.

Probable causes

1) Joint missing or not active.

2) Measurement system error.

Recommended actions

1) Check if joint active.

2) Check configuration files.

3) Check measurement system.

32594, Firmware file not found

Description

The update of *arg* firmware in drive module *arg* has failed.

The firmware file [*arg*] is not found.

Recommended actions

Reinstall the system.

33601, Anybus module is missing

Description

The Anybus module is missing.

Consequences

No communication with the Anybus module is possible.

Probable causes

The Anybus module is either malfunctioning or missing.

Recommended actions

1) Make sure a Anybus module is installed.

2) Replace the module if faulty.

32601, Interbus master/slave board is missing

Description

The Interbus master/slave board does not work.

Consequences

No communication on the Interbus is possible.

Probable causes

The Interbus master/slave board is either malfunctioning or missing.

Recommended actions

1) Make sure an Interbus master/slave board is installed.

2) Replace the board if faulty.

34100, Drive system not supported

Description

The configured drive system in drive module *arg* is not of type Drive System '04.

Consequences

The system goes to system failure state.

Probable causes

1) Wrong drive module key used, i.e., the configuration does not match hardware.

2) Wrong hardware used in the system.

Recommended actions

1) Reinstall the system with a drive module key that matches the hardware.

2) Replace the drive module with one that supports Drive System '04.

34101, Drive system not supported

Description

The configured drive system in drive module *arg* is not of type Drive System '09.

Consequences

The system goes to system failure state.

33503, Revolution counter update failure

Description

Update of the revolution counter for joint *arg* failed.

Continues on next page

Probable causes

- 1) Wrong drive module key used, i.e., the configuration does not match hardware.
- 2) Wrong hardware used in the system.

Recommended actions

- 1) Reinstall the system with a drive module key that matches the hardware.
- 2) Replace the drive module with one that supports Drive System '09.

34200, Lost communication with all drive units

Description

In drive module *arg*, the axis computer has lost communication with all drive units.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state with zero torque.

Probable causes

Communication problem between drive units and the axis computer.

Recommended actions

- 1) Check that all cables are properly connected.
- 2) Check that the drive units have logic power.
- 3) Check/replace Ethernet cables.
- 4) Check for other hardware event log messages.
- 5) Check the event log for power supply unit error messages.
- 6) Check the cabling between the power supply unit and the drive unit.
- 7) Check the 24V output from the power supply unit.

34202, Lost communication with drive unit

Description

In drive module *arg*, the axis computer has lost communication with the drive unit at unit position *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state with zero torque.

Probable causes

Communication problem between the drive unit and the axis computer.

Recommended actions

- 1) Check that all cables are properly connected.
- 2) Check that the drive unit has logic power.
- 3) Check/replace Ethernet cables.

- 4) Check for other hardware event log messages.
- 5) Check the event log for power supply unit error messages.
- 6) Check the cabling between the power supply unit and the drive unit.
- 7) Check the 24V output from the power supply unit.

34203, Motor current too high

Description

The motor current is too high for joint *arg*, connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

- 1) The motor configuration is incorrect.
- 2) The axis load may be too high or the motor may have stalled (maybe due to a collision).
- 3) The motor is too small for the drive unit.
- 4) Short circuit between motor phases or ground.

Recommended actions

- 1) Check that the motor configuration is correct.
- 2) Check that the robot has not collided.
- 3) If possible, reduce the speed of the user program.
- 4) Check that the axis load is not too high for the motor.
- 5) Verify that the maximum motor current is not too small compared to the maximum current of the drive unit.
- 6) Check the motor cable and motor by measuring their resistance respectively. Disconnect before measuring.

34251, Incoming mains phase missing

Description

In drive module *arg*, the rectifier unit at drive unit position *arg* has detected a power loss in one phase.

Consequences

The system may stop with DC link too low voltage.

Probable causes

- 1) Incoming mains voltage loss of one phase.
- 2) Some malfunction in cabling or internal 3-phase components.
- 3) The rectifier unit is faulty.

Recommended actions

- 1) Check all incoming mains phases to the cabinet.
- 2) Check all internal 3-phase components (main switch, mains filter, fuse, contactors) and cabling in the drive module.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

34252, Incoming mains missing

Description

In drive module *arg*, the rectifier unit at drive unit position *arg* has detected a mains voltage loss.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

- 1) Incoming mains voltage loss.
- 2) Some malfunction in the cabling or in internal 3-phase components.
- 3) The rectifier unit is faulty.

Recommended actions

- 1) Check the incoming mains voltage.
- 2) Check all the internal 3-phase components (main switch, mains filter, fuse, contactors) and cabling in the drive module.

34255, Rectifier temperature error

Description

In drive module *arg*, the rectifier unit at drive unit position *arg* has reached a too high temperature level.

Consequences

No operation will be possible until the rectifier has cooled down. The system goes to Motors Off state.

Probable causes

- 1) The cooling fans may be faulty or the air flow may be obstructed.
- 2) The ambient temperature may be too high.
- 3) The system may be running with a too high torque for extended periods of time.

Recommended actions

- 1) Verify that the fans are running and that the air flow is not obstructed.
- 2) Verify that the ambient temperature does not exceed the cabinet's temperature rating.
- 3) If possible, rewrite the user program to reduce the amount of hard acceleration and hard deceleration.
- 4) Reduce the static torque due to gravity or external forces.

34256, Rectifier temperature warning

Description

In drive module *arg*, the rectifier unit at drive unit position *arg* is approaching a too high temperature level.

Consequences

It is possible to continue but the margin to maximum allowed temperature is too low to sustain long term operation.

Probable causes

- 1) The cooling fans may be faulty or the air flow may be obstructed.
- 2) The ambient temperature may be too high.
- 3) The system may be running with a too high torque for extended periods of time.

Recommended actions

- 1) Verify that the fans are running and that the air flow is not obstructed.
- 2) Verify that the ambient temperature does not exceed the cabinet's temperature rating.
- 3) If possible, rewrite the user program to reduce the amount of hard acceleration and hard deceleration.
- 4) Reduce the static torque due to gravity or external forces.

34257, Open circuit in bleeder resistor circuit

Description

In drive module *arg*, the bleeder resistor connected to the rectifier unit at drive unit position *arg* has too high resistance (open circuit).

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

WARNING HIGH VOLTAGE: THE DC LINK WILL NOT BE DISCHARGED WHEN THE SYSTEM IS POWERED OFF.

Probable causes

This may be caused by a faulty bleeder resistor cable or a faulty bleeder resistor.

Recommended actions

- WARNING HIGH VOLTAGE CAN BE PRESENT.**
- 1) Make sure the bleeder resistor cable is properly connected to the rectifier unit.
 - 2) Disconnect the bleeder and check the cable and measure the bleeder resistance. The expected resistance should be approximately *arg* ohms.

34258, Short circuit in bleeder resistor circuit

Description

In drive module *arg*, the bleeder resistor connected to the rectifier unit at drive unit position *arg* is indicating a short circuit.

Continues on next page

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

WARNING HIGH VOLTAGE: THE DC LINK WILL NOT BE DISCHARGED WHEN THE SYSTEM IS POWERED OFF.

Probable causes

This may be caused by a faulty bleeder resistor cable or a faulty bleeder resistor.

Recommended actions

WARNING HIGH VOLTAGE CAN BE PRESENT.

- 1) Make sure the bleeder resistor cable is correctly connected to the rectifier unit.
- 2) Disconnect the bleeder and check the cable and measure the bleeder resistance. The expected resistance should be approximately arg ohms.
- 3) Check for bleeder short circuit against ground.

34261, Rectifier startup error

Description

In drive module arg , the inrush control relay in the rectifier unit at drive unit position arg indicates an error.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

This may be caused by a faulty rectifier inrush control relay.

Recommended actions

Restart the controller and try again. If the problem remains then replace the unit.

34262, Incoming mains frequency warning

Description

In drive module arg , the incoming mains voltage has wrong frequency. The rectifier unit at drive unit position arg has reported the problem.

Consequences

The system may stop with DC link voltage too low.

Probable causes

- 1) The incoming mains frequency is not within specification.
- 2) Short circuit between motor phases or ground.

Recommended actions

- 1) Check and adjust incoming mains frequency.
- 2) Check the motor cable and motor by measuring their resistance respectively. Disconnect before measuring.

34263, Rectifier startup error

Description

In drive module arg , the dc-link in the rectifier unit at drive unit position arg has too low voltage.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

- 1) Low AC-voltage level to rectifier input.
- 2) This may be caused by a faulty rectifier inrush control resistor.
- 3) A short circuit is present on the dc-link.

Recommended actions

- 1) Restart the controller and try again.
- 2) Check incoming mains voltage.
- 3) Check all internal 3-phase components (main switch, mains filter, fuse, contactors) and cabling in the drive module.
- 4) If new installed system with mains transformer - check transformer voltage selection.
- 5) If drive unit has additional axes - check dc-link wiring.
- 6) If the problem remains then replace the unit.

34264, Rectifier inrush limitation active in Motors On

Description

In drive module arg , the inrush control resistor in the rectifier unit at drive unit position arg is wrongly engaged.

Consequences

The system goes to Motors Off state to protect the hardware.

Probable causes

This error occur when the DC link voltage becomes too low and all mains phases are missing.

Recommended actions

- 1) Check the hardware event log for other errors.
- 2) Check incoming mains voltage.
- 3) Check that the correct voltage is selected with jumpers on the transformer (optional).
- 4) Check all internal 3-phase components (main switch, mains filter, fuse, contactors) and cabling in the drive module.

34265, DC link short circuit error

Description

In drive module arg , the DC link in the rectifier unit at drive unit position arg is short circuit.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

- 1) DC link cables for an additional drive unit is damaged or wrongly connected.
- 2) Internal error in rectifier unit or drive unit.

Recommended actions

Check DC link cables and connectors.

- 2) Disconnect unused drive unit(s).

34268, Rectifier charging error

Description

In drive module arg , the dc-link in the rectifier unit at drive unit position arg has too low voltage.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

- 1) Low AC-voltage level to rectifier input.
- 2) This may be caused by a faulty rectifier bleeder.
- 3) The bleeder resistor or its wiring is faulty.
- 4) A short circuit is present on the dc-link.

Recommended actions

- 1) Restart the controller and try again.
- 2) Check incoming mains voltage.
- 3) If new installed system with mains transformer - check transformer voltage selection.
- 4) Check bleeder resistor and its wiring.
- 5) If the problem remains then replace the unit.

34300, Unknown drive unit type

Description

In drive module arg , the drive unit at unit position arg has an unknown hardware identity arg .

Consequences

No operation will be possible until the fault is corrected. The system goes to system failure state.

Probable causes

The drive unit is either unsupported or faulty.

Recommended actions

- 1) Verify that the drive unit is supported by the RobotWare version. Upgrade RobotWare if needed.
- 2) Replace drive unit.

34303, Motor current warning

Description

For joint arg , the current controller detected a too large torque current deviation for the motor. The joint is connected to drive module arg in the drive unit at unit position arg and node arg .

Consequences

Operation will be possible but system is close to a stopping error.

34267, Too many rectifiers connected

Description

In drive module arg the system has detected more rectifiers than the system can handle. The limit was reached when drive unit at unit position arg was detected.

Consequences

No operation will be possible until the fault is corrected. The system goes to system failure state.

Probable causes

- 1) Too many drive unit that are equipped with rectifiers are connected.

Recommended actions

- 1) Verify that the proper drive units' types are connected to the drive unit communication link.

Continues on next page

Probable causes

- 1) The motor data in the configuration files may be wrong.
- 2) The motor cables are not correctly connected or damaged.
- 3) Short circuit in motor cable between phase to phase or phase to ground.
- 4) The DC link voltage may be too low.
- 5) The incoming mains voltage is not within specification.

Recommended actions

- 1) Verify that the motor data in the configuration file is correct for this joint. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Verify that the motor cables are not damaged or badly connected.
- 3) Verify that the motor cables has no short circuits internally or to ground.
- 4) Verify that no DC link errors are present in the event log.
- 5) Verify that the incoming mains voltage is within the specification.

34304, Motor current warning

Description

For joint *arg*, the current controller detected a too large current deviation for the motor. The joint is connected to drive module *arg* in the drive unit at unit position *arg* and node *arg*.

Consequences

Operation will be possible but system is close to a stopping error.

Probable causes

- 1) The motor data in the configuration files may be wrong.
- 2) The motor cables are not correctly connected or damaged.
- 3) Short circuit in motor cable between phase to phase or phase to ground.
- 4) The DC link voltage may be too low.
- 5) The incoming mains voltage is not within specification.

Recommended actions

- 1) Verify that the motor data in the configuration file is correct for this joint. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Verify that the motor cables are not damaged or badly connected.
- 3) Verify that the motor cables has no short circuits internally or to ground.
- 4) Verify that no DC link errors are present in the event log.
- 5) Verify that the incoming mains voltage is within the specification.

34306, Drive unit temperature error

Description

The drive unit for joint *arg* has reached a too high temperature level. The joint is connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

- 1) The cooling fans may be faulty or the air flow may be obstructed.
- 2) The cooling fins are covered by dust reducing the cooling effect.
- 3) The ambient temperature may be too high.
- 4) The joint may be running with a too high torque for extended periods of time.

Recommended actions

- 1) Verify that the fans are running and that the air flow is not obstructed.
- 2) Clean the cooling fins.
- 3) Verify that the ambient temperature does not exceed the cabinet's temperature rating.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration and hard deceleration.
- 5) Reduce the static torque due to gravity or external forces.

34307, Drive unit temperature warning

Description

The drive unit for joint *arg* is approaching a too high temperature level. The joint is connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

It is possible to continue but the margin to maximum allowed temperature is too low to sustain long term operation.

Probable causes

- 1) The cooling fans may be faulty or the air flow may be obstructed.
- 2) The cooling fins are covered by dust reducing the cooling effect.
- 3) The ambient temperature may be too high.
- 4) The joint may be running with a too high torque for extended periods of time.

Recommended actions

- 1) Verify that the fans are running and that the air flow is not obstructed.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

- 2) Clean the cooling fins.
- 3) Verify that the ambient temperature does not exceed the cabinet's temperature rating.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration and hard deceleration.
- 5) Reduce the static torque due to gravity or external forces.

34308, Drive unit critical temperature error

Description

The drive unit for joint *arg* has reached a critical high temperature level. The joint is connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state with zero torque.

Probable causes

- 1) The cooling fans may be faulty or the air flow may be obstructed.
- 2) The cooling fins are covered by dust reducing the cooling effect.
- 3) The ambient temperature may be too high.
- 4) The joint may be running with a too high torque for extended periods of time.

Recommended actions

- 1) Verify that the fans are running and that the air flow is not obstructed.
- 2) Clean the cooling fins.
- 3) Verify that the ambient temperature does not exceed the cabinet's temperature rating.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration and hard deceleration.
- 5) Reduce the static torque due to gravity or external forces.

34309, Drive transistor current too high

Description

The drive unit transistor current is too high for joint *arg*. The joint is connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

- 1) The motor configuration is incorrect.
- 2) The axis load may be too high or the motor may have stalled (maybe due to a collision).

Continues on next page

- 3) Short circuit between motor phases or ground.

Recommended actions

- 1) Check that the motor configuration is correct.
- 2) Check that the robot has not collided.
- 3) If possible, reduce the speed of the user program.
- 4) Check that the axis load is not too high for the drive unit.
- 5) Check the motor cable and motor by measuring their resistance respectively. Disconnect before measuring.

34311, Drive inverter saturated warning

Description

The drive unit for joint *arg* has reached maximum output voltage. The joint is connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

Operation will be possible but system is close to a stopping error.

Probable causes

- 1) The motor is not properly connected to the drive unit.
- 2) The motor data in the configuration is not correct.
- 3) The DC link voltage is too low.
- 4) Short circuit between motor phases or ground.

Recommended actions

- 1) Check motor cables and connectors.
- 2) Check configuration of motor parameters.
- 3) Check for other hardware event log messages.
- 4) Check incoming mains voltage to the rectifier unit, adjust the mains tolerance min value.
- 5) Check the motor cable and motor by measuring their resistance respectively. Disconnect before measuring.

34312, Missing drive unit

Description

For joint *arg*, the system cannot find configured drive unit. The joint is configured for drive module *arg*, in the drive unit at unit position *arg*.

Consequences

The system goes to system failure state.

Probable causes

A joint is configured but drive unit is not found.

Recommended actions

- 1) Verify that the drive module contains the drive unit for the configured joint.

- 2) Verify that the configuration for the drive unit position is correct.
- 3) Verify that the cables between drive units are correctly inserted in the correct connector position.
- 4) If the cable is correctly connected, then it may be damaged and should be replaced.
- 5) Check the event log for power supply unit error messages.
- 6) Check the cabling between the power supply unit and the drive unit.
- 7) Check the 24V output from the power supply unit.

34313, Wrong type of drive unit

Description

In drive module *arg*, the hardware identity for drive unit at unit position *arg* is different from the one specified in the configuration. Installed drive unit hardware identity is *arg*, and the configured identity is *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to system failure state.

Probable causes

The drive unit type does not match the one specified in the installation key.

Recommended actions

- 1) Verify that the drive unit position is correct, i.e., the Ethernet cables are correctly connected.
- 2) Verify that the drive module key match the installed hardware.
- 3) Replace the drive unit with the one specified in the drive module key.

34314, Missing drive unit node

Description

For joint *arg*, the drive unit does not support the node number configured. The joint is configured for drive module *arg*, in the drive unit at unit position *arg* with node *arg*.

Consequences

The system goes to system failure state.

Probable causes

The configured drive unit node is not supported for the configured type of drive unit.

Recommended actions

Check the drive unit node number in the configuration.

34316, Motor current error

Description

For joint *arg*, the current controller detected a too large torque current deviation for the motor. The joint is connected to drive module *arg* in the drive unit at unit position *arg* and node *arg*.

Consequences

The system goes to Motors Off state.

Probable causes

- 1) The motor data in the configuration files may be wrong.
- 2) The motor cables are not correctly connected or damaged.
- 3) Short circuit in motor cable between phase to phase or phase to ground.
- 4) The DC link voltage may be too low.
- 5) The incoming mains voltage is not within specification.

Recommended actions

- 1) Verify that the motor data in the configuration file is correct for this joint. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Verify that the motor cables are not damaged or badly connected.
- 3) Verify that the motor cables has no short circuits internally or to ground.
- 4) Verify that no DC link errors are present in the event log.
- 5) Verify that the incoming mains voltage is within the specification. Change the mains tolerance min so that it reflects the actual mains voltage.

34317, Motor current error

Description

For joint *arg*, the current controller detected a too large current deviation for the motor. The joint is connected to drive module *arg* in the drive unit at unit position *arg* and node *arg*.

Consequences

The system goes to Motors Off state.

Probable causes

- 1) The motor data in the configuration files may be wrong.
- 2) The motor cables are not correctly connected or damaged.
- 3) Short circuit in motor cable between phase to phase or phase to ground.
- 4) The DC link voltage may be too low.
- 5) The incoming mains voltage is not within specification.

Recommended actions

- 1) Verify that the motor data in the configuration file is correct for this joint. How to check the configuration file is detailed in the Trouble Shooting Manual.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

- 2) Verify that the motor cables are not damaged or badly connected.
- 3) Verify that the motor cables has no short circuits internally or to ground.
- 4) Verify that no DC link errors are present in the event log.
- 5) Verify that the incoming mains voltage is within the specification. Change the mains tolerance min so that it reflects the actual mains voltage.

34318, Drive inverter saturated error

Description

The drive unit for joint *arg* has reached maximum output voltage. The joint is connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

The system goes to Motors Off state

Probable causes

- 1) The motor is not properly connected to the drive unit.
- 2) The motor data in the configuration is not correct.
- 3) The DC link voltage is too low.
- 4) Short circuit between motor phases or ground.

Recommended actions

- 1) Check motor cables and connectors.
- 2) Check configuration of motor parameters.
- 3) Check for other hardware event log messages.
- 4) Check incoming mains voltage to the rectifier unit.
- 5) Check the motor cable and motor by measuring their resistance respectively. Disconnect before measuring.

34319, Drive unit critical error

Description

The drive unit for joint *arg* gives an unspecified error, but is likely due to over temperature or short circuit. The joint is connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state with zero torque.

Probable causes

- 1) The cooling fans may be faulty or the air flow may be obstructed.
- 2) The cooling fins are covered by dust reducing the cooling effect.
- 3) The ambient temperature may be too high.

- 4) The joint may be running with a too high torque for extended periods of time.
- 5) Short circuit in cables or connectors between the phases or to ground.

- 6) Short circuit in motor between the phases or to ground.

Recommended actions

- 1) Verify that the fans are running and that the air flow is not obstructed.
- 2) Clean the cooling fins.
- 3) Verify that the ambient temperature does not exceed the cabinet's temperature rating.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration and hard deceleration.
- 5) Reduce the static torque due to gravity or external forces.
- 6) Check/replace cables and connectors.
- 7) Check/replace motor.

34320, Too many drive nodes connected

Description

In drive module *arg* the system has detected more drive nodes than the system can handle. The error occurred when drive unit at unit position *arg* was detected.

Consequences

No operation will be possible until the fault is corrected. The system goes to system failure state.

Probable causes

- 1) Too many drive units is connected to the drive unit communication link.
- 2) The connected drive units can be of wrong types, and may be equipped with too many drive nodes.

Recommended actions

- 1) Verify that the proper drive unit types are connected to the drive unit communication link.
- 2) Disconnect unused drive unit(s).

34321, Drive unit configuration error

Description

In drive module *arg* the drive unit at position *arg* has a configuration error due to a mismatch between the drive unit and measurement system. The drive unit can only support *arg* joints having same measurement excitation. The error occurred when adding joint *arg* to the system.

Consequences

No operation will be possible until the fault is corrected. The system goes to system failure state.

Continues on next page

Probable causes

Too many joints are using same measurement excitation and all are using same drive unit.

Recommended actions

- 1) Move the joint *arg* or another joint with same node excitation to the other excitation (EXC1 - EXC2), by reroute the joint measurement node connection both in hardware and in configuration.
- 2) Restart the controller.

34322, Drive unit configuration error

Description

In drive module *arg* the drive unit at position *arg* is using wrong rectifier.

Consequences

No operation will be possible until the fault is corrected. The system goes to system failure state.

Probable causes

A drive unit must always configure a rectifier with lower or same unit position as the inverter. There must not be any other rectifier with unit position between the configured rectifier and drive unit.

Recommended actions

- 1) Check that configuration file for additional axis is of type drive system 09.
- 2) Change used rectifier (dc_link) in the additional axis configuration.
- 3) Remove unused rectifier mounted between configured rectifier and drive unit.

34400, DC link voltage too high

Description

In drive module *arg*, the drive unit at unit position *arg* has a DC link voltage that is too high.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

WARNING HIGH VOLTAGE: THE DC LINK MAY BE DISCHARGED VERY SLOWLY (APPROXIMATELY 1 HOUR) WHEN THE SYSTEM IS POWERED OFF.

Probable causes

- 1) The bleeder resistor is not connected or faulty.
- 2) The user program may contain too much deceleration of the manipulator's axes. This fault is more likely if the system contains additional axes.

Recommended actions

WARNING HIGH VOLTAGE CAN BE PRESENT.

- 1) Make sure the bleeder resistor cable is properly connected to the rectifier unit.
- 2) Disconnect the bleeder and check the cable and measure the bleeder resistance. The expected resistance should be approximately *arg* ohms.
- 3) Rewrite the user program to reduce the amount of hard decelerations.

34401, DC link voltage too low warning

Description

In drive module *arg*, the drive unit at unit position *arg* has a DC link voltage that is close to minimum limit.

Consequences

Operation will be possible but the system is close to a stopping error.

Probable causes

The incoming mains voltage to the rectifier unit is out of specification.

Recommended actions

- 1) Check for other hardware event log messages regarding mains voltage problem.
- 2) Check incoming mains voltage. Change the mains tolerance min so that the mains voltage is inside the specified interval.
- 3) Check that the correct voltage is selected with jumpers on the transformer (optional).
- 4) Check all internal 3-phase components (main switch, mains filter, fuse, contactors) and cabling in the drive module.

34402, DC link voltage too low

Description

In drive module *arg*, the DC link voltage is too low for the drive unit at unit position *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

The incoming mains voltage to the rectifier unit is out of specification.

Recommended actions

- 1) Check for other hardware event log messages regarding mains voltage problem.
- 2) Check incoming mains voltage. Change the mains tolerance min so that the mains voltage is inside the specified interval.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

- 3) Check that the correct voltage is selected with jumpers on the transformer (optional).
- 4) Check all internal 3-phase components (main switch, mains filter, fuse, contactors) and cabling in the drive module.

34404, DC link voltage is critically high

Description

In drive module *arg*, the drive unit at unit position *arg* has a DC link voltage that is critically high.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state with zero torque.
WARNING HIGH VOLTAGE: THE DC LINK MAY BE DISCHARGED VERY SLOWLY (APPROXIMATELY 1 HOUR)
WHEN THE SYSTEM IS POWERED OFF.

Probable causes

- 1) The bleeder resistor is not connected or faulty.
- 2) The user program may contain too much deceleration of the manipulator's axes. This fault is more likely if the system contains additional axes.

Recommended actions

- WARNING HIGH VOLTAGE CAN BE PRESENT.
- 1) Make sure the bleeder resistor cable is properly connected to the rectifier unit.
 - 2) Disconnect the bleeder and check the cable and measure the bleeder resistance. The expected resistance should be approximately *arg* ohms.
 - 3) Rewrite the user program to reduce the amount of hard decelerations.

34405, DC link voltage too high warning

Description

In drive module *arg*, the drive unit at unit position *arg* has a DC link voltage that is close to maximum limit.

Consequences

Operation will be possible but the system is close to a stopping error.

WARNING HIGH VOLTAGE: THE DC LINK MAY BE
DISCHARGED VERY SLOWLY (APPROXIMATELY 1 HOUR)
WHEN THE SYSTEM IS POWERED OFF.

Probable causes

- 1) The bleeder resistor is not connected or faulty.
- 2) The user program may contain too much deceleration of the manipulator's axes. This fault is more likely if the system contains additional axes.

Continues on next page

Recommended actions

- WARNING HIGH VOLTAGE CAN BE PRESENT.
- 1) Make sure the bleeder resistor cable is properly connected to the rectifier unit.
 - 2) Disconnect the bleeder and check the cable and measure the bleeder resistance. The expected resistance should be approximately *arg* ohms.
 - 3) Rewrite the user program to reduce the amount of hard decelerations.

34406, Drive unit power supply error

Description

In drive module *arg*, the drive unit with unit position *arg* has detected problem with the logic power.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state with zero torque.

Probable causes

The 24V logic supply to the drive is temporary or constantly lost.

Recommended actions

- 1) Check the event log for power supply unit error messages.
- 2) Check the cabling between the power supply unit and the drive unit.
- 3) Check the 24V output from the power supply unit.

34407, Drive unit internal error

Description

In drive module *arg*, the drive unit at unit position *arg* has indicated an internal error.

Consequences

The system goes to system failure state with zero torque.

Probable causes

An internal error has occurred in the drive unit firmware.

Recommended actions

Restart the controller by using the main power switch.

34408, Drive unit hardware data error

Description

In drive module *arg*, the drive unit at unit position *arg* has corrupt information stored on the unit.

Consequences

The system goes to system failure state.

Probable causes

The integrity check of the drive unit information stored on the drive unit has failed.

Recommended actions

- 1) Retry again by restarting the controller using the main power switch.
- 2) Replace the faulty drive unit.

34409, Drive unit startup error

Description

The system has failed to complete the initialization phase of a drive unit. The drive unit is located in drive module *arg* at unit position *arg*.

Consequences

The system goes to system failure state.

Probable causes

The system has failed to complete the initialization phase of the drive unit.

Recommended actions

- 1) Retry by restarting the controller using the main power switch.
- 2) Check for other hardware event log messages.

34410, Too many drive units connected

Description

In drive module *arg* the system has detected more drive units than the system can handle. The maximum number of drive units supported is *arg*, but *arg* was detected.

Consequences

No operation will be possible until the fault is corrected. The system goes to system failure state.

Probable causes

- 1) Too many drive unit that are connected.

Recommended actions

- 1) Disconnect unused drive unit(s).

34411, DC link error

Description

The system has detected an unexpected low DC bus voltage in a drive unit that is not used by any joints. The drive unit is located in drive module *arg* at unit position *arg*.

Consequences

No operation will be possible until the fault is corrected. The system goes to Motors Off state.

Probable causes

- 1) Incoming mains are missing.
- 2) The DC bus cable is faulty connected to the drive unit.
- 3) Short circuit on a DC bus. It can be both inside the drive unit and in the cables.

Recommended actions

- 1) Check incoming mains.
- 2) Check DC cabling.
- 3) Check if there are any short circuit.
- 4) Replace the drive unit(s).

34423, Incompatible drive unit types

Description

The configured drive system in drive module *arg* contains incompatible drive unit types.

Consequences

The system goes to system failure state.

Probable causes

Drive units of type DSQC462 are not compatible with any other drive unit types and may not be used in the same drive module.

Recommended actions

- 1) Check the configuration to make sure that only compatible drive unit types are use within the same drive module.

37001, Motors ON contactor activation error

Description

Motors ON contactor *arg* in drive module *arg* failed to close when ordered.

Consequences

The mechanical unit cannot be run manually or automatically.

Probable causes

- 1) The run chain for the contactor is open.
- 2) There are problems in the contactor itself, either mechanical or electrical.
- 3) The FlexPendant enabling device may have been toggled too quickly, or the system may not be configured correctly. On rare occasions, this fault may occur in combination with other faults, in which case this may be found in the error log.

Recommended actions

- 1) To resume normal operation, first acknowledge the error, then release the enabling device and press it again after approx. one second.
- 2) Check cables and connections on the safety system.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

3) Check any other error log messages coinciding in time with this one for clues.

4) Check the system motion configuration regarding Motors ON relay. How to check the configuration file is detailed in the Trouble Shooting Manual.

Warning: Further use of robot is not permitted until the fault is found and eliminated.

37043, Safety signals overloaded

Description

The AC_ON or SPEED signals draw too much current.

Consequences

The safety system shuts down the signals, causing the system to go to either system failure state (for AC_ON) or status SYS HALT (for SPEED).

Probable causes

A load connected to the circuit may be too high, or the safety system may be malfunctioning. See the circuit diagram!

Recommended actions

- 1) Check all loads connected to the AC_ON and SPEED circuits
- 2) Check the safety system cabling and connectors, and replace any faulty unit if required.

37044, Overload on Panel Board digital output signals

Description

The panel board user digital outputs draw too much current.

Consequences

The panel board shuts down the signals, causing the system to go to status SYS HALT.

Probable causes

A load connected to the circuit may be too high, or the panel board may be malfunctioning. See the circuit diagram!

Recommended actions

- 1) Check all loads connected to the user digital outputs
- 2) Check the panel board cabling and connectors, and replace any faulty unit if required.

37045, Faulty external computer fan

Description

The external computer fan in the control module spins too slowly.

Consequences

No system consequence. The control module temperature will rise.

Probable causes

Faulty fan, cabling or power supply. See the circuit diagram!

Recommended actions

- 1) Check the cabling to the external computer fan.
- 2) Check the fan, and replace any faulty unit if required.

37046, Safety signals overloaded

Description

The 24 V PANEL supply draws too much current.

Consequences

The safety system shuts down the signal, causing the system to go to status SYS HALT.

Probable causes

A load connected to the circuit may be too high, or the safety system unit may be malfunctioning. See the circuit diagram!

Recommended actions

- 1) Check all loads connected to the 24V PANEL circuit.
- 2) Check cabling on the safety system.

37049, Activation contactor activation error

Description

The activation relay for mechanical unit *arg* failed to close.

Consequences

The mechanical unit cannot be run manually or automatically.

Probable causes

The activation relay configured within the system may be faulty, or the system may not be configured correctly.

Recommended actions

- 1) Check the contactor and make sure its connections are connected correctly.
- 2) Check the system motion configuration regarding the activation relay. How to check the configuration file is detailed in the Trouble Shooting Manual.

37050, Overtemperature in main computer

Description

The temperature in the main computer unit or the main computer processor is too high.

Consequences

The system might get damaged.

Continues on next page

Probable causes

The unit may be overloaded, its fans may be malfunctioning or the air flow may be restricted.

Recommended actions

- 1) Make sure the fans are operating.
- 2) Check that air flow to the unit fans is not restricted.

37053, Check the CMOS battery voltage level

Description

The CMOS battery on the computer board might be empty.

Consequences

After restart of the system, the system time will be reset.

The system will also use an erroneous setup or no restart will be possible.

Probable causes

- 1) The system time has never been set.
- 2) The CMOS battery is faulty/empty.

Recommended actions

- 1) Set the system time, restart the system with power switch and check if this event message is reported again.
- 2) If this error is reported again, replace the CMOS battery and set the system time.

37054, Faulty computer unit fan

Description

The fans in the computer unit spin too slowly.

Consequences

No system consequence. The computer unit temperature will rise.

Probable causes

Faulty fan, cabling or power supply. See the circuit diagram!

Recommended actions

- 1) Check the cabling to the computer unit fan.
- 2) Check the fan.
- 3) Check the fan power supply.
- 4) Replace the faulty component if required.

37056, Cooling fan error

Description

Cooling unit fan has stopped or is rotating very slowly (Less than \arg rpm).

Recommended actions

- 1) Check the fan cables.
- 2) Replace the fan.

37062, Computer module power supply warning

Description

The \arg V voltage of the computer module power supply is \arg V, which is out of the allowed range.

Consequences

Probable causes

The power supply unit, cabling, input voltage to the power supply or the output load may cause the faulty voltage level. See the Trouble Shooting Manual and circuit diagram!

Recommended actions

- 1) Check all cabling to the power supply unit.
- 2) Measure the output and input voltage levels.
- 3) Replace the faulty unit if required.

37069, Faulty backup Power Supply

Description

The backup energy bank in the control module supplying the backup voltage is faulty.

Consequences

After switching the power off, no system data changes will be saved, unless "Shutdown main computer" has been done first.

Probable causes

This may be caused by a faulty backup energy bank, cabling or charger.

Recommended actions

- Do "Shutdown main computer" before turning the main power off or wait until battery has been charged!
- 1) Check the backup energy bank cabling and connectors.
 - 2) Check the backup energy bank.
 - 3) Check the power supply.
 - 4) Replace the faulty unit if required.

37070, Overtemperature in Control Module Power Supply

Description

The temperature in the control module power supply is too high.

Consequences

The system is shut down immediately.

Probable causes

This may be caused by poor cooling, too high a load on the power supply or by a faulty power supply.

Recommended actions

- 1) Check the cooling fan.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

2) Check the output power.

3) Replace any faulty unit if required.

2) Replace MIB if faulty.

3) Replace PIB if faulty.

37074, Purge pressure too low

Description

Purge system number *arg* associated with manipulator interface board (MIB) *arg*.

Recommended actions

Check the purge air supply and search for leaks in:

- 1) The purge unit.
- 2) The flexible hose conduit.
- 3) The manipulator itself.

37075, Purge pressure too high

Description

Purge system number *arg* associated with manipulator interface board (MIB) *arg*.

Recommended actions

Check the purge unit and the air supply.

37080, Purge configuration not valid

Description

The purge time key on manipulator interface board (MIB) *arg* X19 is not valid.

Consequences

Default time (300s) is used.

Probable causes

Faulty or missing purge time key.

Recommended actions

- 1) Check that the purge time key is correctly mounted.
- 2) Replace purge time key.

37081, Purge timers differ

Description

Unacceptable divergence between CPLD and FPGA firmware on manipulator interface board (MIB) *arg* purge timers.

Consequences

The purge timer will be restarted.

Recommended actions

Replace MIB if faulty.

37082, Divergence between PIB and MIB outputs

Description

Process interface board (PIB) and manipulator interface board (MIB) *arg* are not agreed concerned to output status for purge relay and power relay.

Consequences

Purge sequence is restarted.

37083, Glitch in purge system

Description

Purge fault reported from manipulator interface board (MIB) *arg*. The purging system has detected pressure not OK from sensors. Motors and paint equipments are switched off and main computer may be informed to disconnect the serial measurement unit (SMU). Depends on signal timing.

Consequences

Motors and paint equipments are turned off, run chain opened and maybe also disconnected SMU.

37078, Purge timers differ

Description

Unacceptable divergence between process interface board (PIB) and manipulator interface board (MIB) *arg* purge timers.

Consequences

The purge timer will be restarted.

Recommended actions

- 1) Check Serial Peripheral Interface (SPI) cables.

Continues on next page

Recommended actions

- 1) Check air supply.
- 2) Check that air outlet is not blocked.
- 3) Check purge sensors and cabling for purge sensors.

37090, Temp. too high, sensor arg**Description**

System overheat detected on manipulator controller board (MCOB) *arg*. Sensors 1-7: motor 1-7. Sensor 8: Serial measurement board. Run chain has been opened.

Recommended actions

Wait until the overheated motor or equipment has cooled down.

37094, Activate connection error**Description**

Could not activate *arg*. Connection relay input *arg* indicates no connection.

Recommended actions

- 1) Check that if mechanical unit is connected.
- 2) Check the connection relay input signal setup.

37095, Brake power fault**Description**

The supervision of brake power on manipulator controller board (MCOB) *arg* has detected fault on the power signal and turned ON all brakes.

Recommended actions

- 1) Check brake power on MCOB.
- 2) Check brake power relay in cabinet.
- 3) Check for disturbances on the brake power signal on MCOB.
- 4) Check for short circuit on brakes.

37096, Brake power fault**Description**

The supervision of brake power on manipulator controller board (MCOB/MCB) *arg* has detected fault on the power signal and turned ON all brakes.

Recommended actions

- 1) Check brake power on MCOB/MCB.
- 2) Check brake power from power supply in cabinet.
- 3) Check for disturbances on the brake power signal on MCOB/MCB.
- 4) Check for short circuit on brakes.

37097, Brake short circuit fault**Description**

The supervision of brakes on manipulator controller board (MCOB/MCB) *arg* has detected a short circuit on axis *arg* and turned ON all brakes.

Recommended actions

- 1) Check for short circuit on brakes.

37098, Brake open circuit fault**Description**

The supervision of brakes on manipulator controller board (MCOB/MCB) *arg* has detected an open circuit on axis *arg* and turned ON all brakes.

Recommended actions

- 1) Check for open circuit on brakes.

37099, Temp. too high, sensor arg**Description**

System overheat detected on manipulator controller board (MCOB/MCB) *arg*. Sensors supervised on motors, Serial measurement unit (SMU) or process equipment. Run chain has been opened.

Sensors 1-8: Robot motors 1-8. Sensor 9: SMU. Sensors 10-14: Process 1-5. Please refer to current robot configuration for more details.

Recommended actions

Wait until the overheated motor or equipment has cooled down.

37100, I/O node flash disk error**Description**

Flash name: *arg*.

Flash disk function: *arg*.

Error description: *arg*

Recommended actions

Report error.

37101, Brake Failure**Description**

The brakes for mechanical unit *arg* fail to engage.

Consequences

The mechanical unit may collapse when the motors are turned off.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Probable causes

The configuration of brake relay may be incorrect, or the brake relay may be faulty. If an external brake relay is being used, the relay must be correctly defined in the motion configuration file.

Recommended actions

- 1) Check that the external brake relay (if used) is correctly defined in the configuration file.
- 2) Check that the corresponding I/O signal is correctly defined in the I/O configuration file. How to check the configuration files is detailed in the Trouble Shooting Manual.

37102, Power supply warning, faulty 24V COOL level

Description

The 24V COOL output of the control module power supply is out of range.

Consequences

No system consequence.

Probable causes

The control module power supply unit cabling or the output load may cause the faulty voltage level. The power supplies are shown in the Trouble Shooting Manual and the circuit diagram!

Recommended actions

- 1) Check all cabling to the control module power supply unit.
- 2) Check the output voltage level, and replace any faulty unit if required.

37103, Power supply warning, faulty 24V SYS level

Description

The 24V SYS output of the control module power supply is out of range.

Consequences

No system consequence.

Probable causes

The control module power supply unit, cabling or the output load may cause the faulty voltage level. The power supplies are shown in the Trouble Shooting Manual and the circuit diagram!

Recommended actions

- 1) Check all cabling to the control module power supply unit.

- 2) Check the output voltage level, and replace any faulty unit if required.

37104, There is no backup voltage available!

Description

The backup energy bank maintaining the backup voltage is not functional.

Consequences

After switching the power off, a B type restart must be performed. No system data changes will be saved at power off.

Probable causes

This may be caused by a faulty backup energy bank, cabling or charger.

Recommended actions

- Before working on the system, perform a controlled shutdown to ensure all system data is correctly saved.
- 1) Check the cables and connectors of the backup energy bank.
 - 2) Check the backup energy bank.
 - 3) Check the power supply.
 - 4) Replace the faulty unit if required.

37105, Regained communication with Power Supply

Description

The main computer has regained communication with the control module power supply.

37106, Low backup energy bank voltage level

Description

The voltage in the computer unit backup energy bank is too low to be functional.

Consequences

No system consequence. No system data changes will be saved at power off.

Probable causes

This may be caused by a faulty backup energy bank, cabling or charger.

Recommended actions

Before working on the system, perform a controlled shutdown to ensure all system data is correctly saved.

- 1) Check the cables and connectors of the backup energy bank.
- 2) Check the backup energy bank.
- 3) Check the power supply.
- 4) Replace the faulty unit if required.

Continues on next page

37107, Faulty backup energy bank

Description

The backup energy bank in the control module maintaining the backup voltage is not functional.

Consequences

If switching the power off, a B type restart must be performed. No backup will be made at power off.

Probable causes

This may be caused by a faulty backup energy bank, cabling or charger.

Recommended actions

Before working on the system, perform a controlled shutdown to ensure all system data is correctly saved.

- 1) Check the backup energy bank cable and connector.
- 2) Check the backup energy bank.
- 3) Replace the faulty unit if required.

37108, Lost communication: Power supply and computer

Description

The main computer has lost communication with the control module power supply.

Consequences

The main computer cannot retrieve status info or switch the power supply off. No system data changes will be saved at power off.

Probable causes

The USB cable from the main computer to the control module power supply may be faulty or disconnected, or the power supply may be faulty.

Recommended actions

Before working on the system, perform a controlled shutdown to ensure all system data is correctly saved.

- 1) Check the cabling and connectors to the control module power supply.
- 2) Check the power supply unit, and replace any faulty unit if required.

37109, Brake Release Failure

Description

The brakes for mechanical unit *arg* fail to release.

Consequences

The mechanical unit may not move when the motors are turned on.

Probable causes

The configuration of brake relay may be incorrect, or the brake relay may be faulty. If an external brake relay is being used, the relay must be correctly defined in the motion configuration file.

Recommended actions

- 1) Check that the external brake relay (if used) is correctly defined in the configuration file.
- 2) Check that the corresponding I/O signal is correctly defined in the I/O configuration file. How to check the configuration files is detailed in the Trouble Shooting Manual.
- 3) Check I/O signals are correctly connected.

37200, Power fault: Emergency Stop supply

Description

Power fault on 24V emergency stop supply. Feedback from safety interface board (SIB).

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Check power supply.

37201, Power fault: 24V Fail-safe supply

Description

Power fault on 24V fail-safe supply. Feedback from safety interface board (SIB).

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Check power supply.

37202, Power fault: 24V I/O supply

Description

Power fault on 24V I/O supply. Feedback from safety interface board (SIB).

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Check power supply.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

37203, Power fault: 24V SYS supply

Description

Power fault reported when 24V SYS < 18V. Feedback from manipulator interface board (MIB) arg.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
 - 2) Check power supply.
-

37204, Power fault: 24V I/O supply

Description

Power fault reported when 24V I/O < 18V. Feedback from manipulator interface board (MIB) arg.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
 - 2) Check power supply.
-

37205, Power fault: 12V Purge supply

Description

Power fault reported when 12V purge < 10.8V. Feedback from manipulator interface board (MIB) arg.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
 - 2) Check power supply.
-

37206, Power fault: 12V FlexPendant supply

Description

Power fault on 12V FlexPendant supply. Feedback from pendant interface board (TIB).

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
 - 2) Check power supply.
-

37207, Battery charge low

Description

Less than 2 months until the battery backup to serial measurement board (SMB) is discharged. Counting from first time this message was displayed. The battery is mounted on manipulator interface board (MIB).

Recommended actions

Replace battery mounted on MIB.

37208, Overtemperature in transformer

Description

The temperature in the transformer is too high.

Consequences

The system goes to status SYS HALT.

Probable causes

The unit may be overloaded, its fans may be malfunctioning or the air flow may be restricted.

Recommended actions

- 1) Make sure the fans are operating.
 - 2) Check that air flow to the unit fans is not restricted.
-

37209, Overtemperature in cabinet

Description

The temperature in the cabinet is too high.

Consequences

The system goes to status SYS HALT.

Probable causes

The unit may be overloaded, its fans may be malfunctioning or the air flow may be restricted.

Recommended actions

- 1) Make sure the fans are operating.
 - 2) Check that air flow to the unit fans is not restricted.
-

37210, Fault on contactor KM1

Description

A fault is observed on motor contactor KM1.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
 - 2) Check contactor.
-

Continues on next page

37211, Fault on contactor KM2

Description

A fault is observed on motor contactor KM2.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Check contactor.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37212, Fault on contactor KM101

Description

A fault is observed on motor contactor KM101.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Check contactor.

37216, Brake chain 1 feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on brake chain 1 feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37213, Fault on contactor KM102

Description

A fault is observed on motor contactor KM102.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Check contactor.

37217, Brake chain 2 feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on brake chain 2 feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37214, Run chain 1 feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on run chain 1 feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37218, Cabin Interlock chain 1 feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on cabin interlock chain 1 feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37215, Run chain 2 feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on run chain 2 feedback signals.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

37219, Cabin Interlock chain 2 feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on cabin interlock chain 2 feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37220, HV Interlock chain 1 feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on high voltage (HV) interlock chain 1 feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37221, HV Interlock chain 2 feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on high voltage (HV) interlock chain 2 feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37222, System 2 Interlock chain feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on system 2 interlock chain feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37223, Main relay chain feedback conflict

Description

Safety interface board (SIB) and manipulator interface board (MIB) *arg* reports divergence on main relay chain feedback signals.

Consequences

The system goes to status SYS HALT.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.
- 3) Replace MIB if faulty.

37224, Cabin Interlock chain 1 conflict

Description

Divergence on cabin interlock chain 1 between input and output signals on safety interface board (SIB).

Consequences

Paint enable chain opens.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.

37225, Cabin Interlock chain 2 conflict

Description

Divergence on cabin interlock chain 2 between input and output signals on safety interface board (SIB).

Consequences

Paint enable chain opens.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.

37226, HV Interlock chain 1 conflict

Description

Divergence on high voltage (HV) interlock chain 1 between input and output signals on safety interface board (SIB).

Consequences

Paint enable chain opens.

Continues on next page

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.

37227, HV Interlock chain 2 conflict**Description**

Divergence on high voltage (HV) interlock chain 2 between input and output signals on safety interface board (SIB).

Consequences

Paint enable chain opens.

Recommended actions

- 1) Check cables and connections.
- 2) Replace SIB if faulty.

37228, Cabin Interlock chain conflict from SIB**Description**

Only one of the two cabin interlock chains is opened. Reported from safety interface board (SIB).

Consequences

Paint enable chain opens.

Recommended actions

Replace SIB if faulty.

37229, HV Interlock chain conflict from SIB**Description**

Only one of the two high voltage (HV) interlock chains is opened. Reported from safety interface board (SIB).

Consequences

Paint enable chain opens.

Recommended actions

Replace SIB if faulty.

37230, Brake Performance Warning**Description**

The cyclic brake check indicates that the brake for the mechanical unit *arg* axis no *arg* has not full braking torque.

Consequences

This is only a warning and no immediate action need to be taken.

37231, Brake Performance Error**Description**

The function Cyclic Brake Check has found that the mechanical brake for the mechanical unit *arg* axis no *arg* has too low braking torque.

Consequences

WARNING: The brake performance is too low for this axis. Until the brake is verified to have sufficient/approved braking torque, it is only possible to move the robot with the specified manual reduced speed ("Reduced max speed (mm/s)") according to the setup in the configurator for Cyclic Brake Check.

Recommended actions

- 1) Run the Cycle Brake Check once more.
- 2) Replace the motor with its brake.

37232, Cyclic Brake Check Configuration Error**Description**

The cyclic brake check has found that the mechanical brake for the mechanical unit *arg* axis no *arg* has no defined brake torque requirement level.

Consequences

The cyclic brake check will continue but no valid brake check will be done for this axis.

Probable causes

The motion configuration data are not correct specified for this axis.

Recommended actions

The motion configuration data are not correct specified for this axis:

- 1) Specify a value for parameter `max_static_arm_torque` if axis shall be tested.
- 2) Deactivate Cyclic Brake Check in the configuration if the axis should not be tested. Parameter 'Deactivate Cyclic Brake Check for axis', topic Motion, type 'Arm'.

37233, Cyclic Brake Check Configuration Error**Description**

The cyclic brake check has found that the mechanical brake for the mechanical unit *arg* axis no *arg* should be tested according to the configuration. But the actual mechanical unit cannot be included in the Safety Controller, because activation/deactivation at runtime is allowed.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Consequences

The cyclic brake check will continue with other mechanical units.

Probable causes

The motion configuration data are not correct specified for this axis.

Recommended actions

The motion configuration data are not correct specified for this axis:

- 1) Cyclic Brake Check has been specified but should not be done for this axis
- 2) The mechanical unit must be active at startup and deactivation must not be allowed

37234, Brake Performance Warning

Description

The Brake Check indicates that the mechanical brake for the mechanical unit *arg* axis no *arg* has not full braking torque.

Consequences

This is only a warning and no immediate action need to be taken.

37235, Brake Performance Error

Description

The Brake Check has found that the mechanical brake for the mechanical unit *arg* axis no *arg* has too low braking torque.

Consequences

WARNING: The brake performance is too low for this axis.

Recommended actions

- 1) Run the Brake Check once more.
- 2) Replace the motor with its brake.

37236, Brake Check Configuration Error

Description

The Brake Check has found that the mechanical brake for the mechanical unit *arg* axis no *arg* should be tested. The actual mechanical unit cannot be included in the test, because activation/deactivation at runtime is allowed.

Consequences

The Brake Check will continue with other mechanical units.

Probable causes

The motion configuration data are not correct specified for this axis.

Recommended actions

The motion configuration data are not correct specified for this axis:

- 1) Brake Check has been specified but should not be done for this axis.
- 2) The mechanical unit must be active at startup and deactivation must not be allowed.

37237, Brake Check Configuration Error

Description

The brake check has found that the mechanical brake for the mechanical unit *arg* axis no *arg* has no defined brake torque requirement level.

Consequences

The brake check will continue but no valid brake check will be done for this axis.

Probable causes

The motion configuration data are not correct specified for this axis.

Recommended actions

The motion configuration data are not correct specified for this axis:

- 1) Specify a value for parameter max_static_arm_torque if axis shall be tested.
- 2) Deactivate BrakeCheck in the configuration if the axis should not be tested. Parameter 'Deactivate Cyclic Brake Check for axis', topic Motion, type 'Arm'.

37240, Cabin Interlock chain conflict from MIB

Description

Only one of the two cabin interlock chains is opened. Reported from manipulator interface board (MIB) *arg*.

Consequences

Paint enable chain opens.

Recommended actions

Replace MIB if faulty.

37241, HV Interlock chain conflict from MIB

Description

Only one of the two high voltage (HV) chains is opened. Reported from manipulator interface board (MIB) *arg*.

Consequences

Paint enable chain opens.

Continues on next page

Recommended actions

Replace MIB if faulty.

37242, Run chain conflict from SIB**Description**

Only one of the two run chain feedback signals from safety interface board (SIB) was opened.

Consequences

The system goes to status SYS HALT.

Recommended actions

Replace SIB if faulty.

37243, Brake chain conflict from SIB**Description**

Only one of the two brake chain signals from safety interface board (SIB) was opened.

Consequences

The system goes to status SYS HALT.

Recommended actions

Replace SIB if faulty.

37244, Run chain conflict from MIB arg**Description**

Only one of the two run chain feedback signals from manipulator interface board (MIB) was opened.

Consequences

The system goes to status SYS HALT.

Recommended actions

Replace MIB if faulty.

37245, Brake chain conflict from MIB arg**Description**

Only one of the two brake chain feedback signals from manipulator interface board (MIB) was opened.

Consequences

The system goes to status SYS HALT.

Recommended actions

Replace MIB if faulty.

37246, Emergency Stop relay conflict**Description**

Only one of the two emergency stop chains was opened internal on safety interface board (SIB).

Consequences

The system remains in the Emergency Stop status.

Recommended actions

1) Press emergency stop and reset emergency stop once again.

2) Replace SIB if faulty.

37247, Circulation Fan arg malfunction**Description**

Circulation fan for the drive systems at the cabinet rear side has stopped or is rotating very slowly.

Consequences

The drive systems temperature will rise.

Probable causes

Faulty fan, cabling or power supply. See the circuit diagram!

Recommended actions

- 1) Check the fan cables.
- 2) Check the power supply.
- 3) Check the fan.

37248, Circulation Fan arg malfunction**Description**

Circulation fan in the cabinet front door has stopped or is rotating very slowly.

Consequences

The temperature in the cabinet will rise.

Probable causes

Faulty fan, cabling or power supply. See the circuit diagram!

Recommended actions

- 1) Check the fan cables.
- 2) Check the power supply.
- 3) Check the fan.

37249, Glitch in Emergency Stop circuits**Description**

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in ES_INPUT circuits.

Consequences

Motors and paint equipments are maybe switched off.

Recommended actions

Check cables and connections on the safety system for ES_INPUT.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

37250, Glitch in Auto Mode Stop circuit

Description

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in MODE_STOP circuits.

Consequences

Motors are maybe switched off.

Recommended actions

Check cables and connections on the safety system for Auto_Mode_Stop (or Test_Mode_Stop / Enabling Device).

-
- 2) Check for other error messages for external connections (interlocks).

37254, Glitch in Run Chain on MIB

Description

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in manipulator interface board (MIB) Run_Chain circuits.

Consequences

Motors for CBS and CBS motion are maybe switched off.

Recommended actions

- 1) Check cables and connections on the safety system.
- 2) Check for other error messages for external connections (interlocks).

37251, Glitch in Delayed Stop circuit

Description

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in DLY_STOP circuits.

Consequences

Motors are maybe switched off.

Recommended actions

Check cables and connections on the safety system for DLY_STOP.

37255, Glitch in Cabin Interlock circuit

Description

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in cabin interlock circuits.

Consequences

Paint equipments are maybe switched off.

Recommended actions

Check cables and connections on the safety system for cabin interlock.

37252, Glitch in General Mode Stop circuit

Description

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in GM_STOP circuits.

Consequences

Motors are maybe switched off.

Recommended actions

Check cables and connections on the safety system for GM_STOP.

37256, Glitch in High Voltage Interlock circuit

Description

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in high voltage interlock circuits.

Consequences

High voltage is maybe switched off.

Recommended actions

Check cables and connections on the safety system for HV interlock.

37253, Glitch in Run Chain on SIB

Description

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in safety interface board (SIB) Run_Chain circuits.

Consequences

Motors are maybe switched off.

Recommended actions

- 1) Check cables and connections on the safety system.

37257, Glitch in System 2 Interlock circuit

Description

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in system 2 interlock circuits.

Continues on next page

Consequences

Paint equipments are maybe switched off.

Recommended actions

Check cables and connections on the safety system for system 2 interlock.

37258, Glitch in Process Interlock circuit**Description**

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in process interlock circuits.

Consequences

Paint equipments are maybe switched off.

Recommended actions

Check cables and connections on the safety system for process interlock.

37259, Glitch in AUX Interlock circuit**Description**

Two or several status changes detected on signal within few milliseconds. This message is most likely caused by bad connections in AUX run chain circuits. Normally used for Cartridge Bell System (CBS) doors.

Consequences

System 2 Motors and motion are maybe switched off.

Recommended actions

Check cables and connections on the safety system for AUX run chain.

37260, Brake driver fault**Description**

The supervision of brakes on manipulator controller board (MCOB) *arg* has detected a driver fault on axis *arg* and turned ON all brakes.

Recommended actions

1) Check/exchange MCOB.

37261, Circulation Fan malfunction**Description**

Circulation fan for the PDB has stopped or is rotating very slowly.

Consequences

The power distribution board (PDB) temperature will rise.

Probable causes

Faulty fan, cabling or power supply. See the circuit diagram!

Recommended actions

- 1) Check the fan cables.
- 2) Check the power supply.
- 3) Check the fan.

37262, Divergence between PSA outputs and SIB inputs**Description**

Paint Safety Adapter has tried to turn off an interlock input, but the feedback is still active.

Consequences

Paint enable chain opens.

Recommended actions

Check cables and connectors. Change hardware.

37263, PSA disabled from superior system**Description**

Paint Safety Adapter has been disabled from the superior control system.

Consequences

Paint enable chain opens.

37501, Filesystem unknown: USB Device**Description**

The filesystem type on the USB device with logical unit *arg* is not supported.

Consequences

The USB device with the logical unit *arg* cannot be accessed. The filesystem is of type *arg*. The file(s) on the USB device with logical number *arg* will not be accessible.

Probable causes

The filesystem is formatted with an unsupported file system type.

Recommended actions

Format the USB device with the FAT32 filesystem.

37502, Mass storage device removed**Description**

The mass storage device was removed.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Consequences

The system goes to system failure state. The filesystem on the mass storage device could be corrupt. The file(s) on the mass storage device could be corrupt. The file(s) on the mass storage device will not be accessible.

Probable causes

The mass storage device was removed or there was a malfunction of the mass storage device.

Recommended actions

Check that the mass storage device firmly is in place. If the problem persists, try with another device.

37503, Mass storage file system error

Description

Mass storage file system error.

Consequences

An error was detected in the filesystem. The error was corrected. The correction could lead to missing file(s).

Probable causes

The mass storage device was removed or there was a malfunction of the mass storage device.

Recommended actions

If the problem persists, try with another device.

37504, Mass storage file system error

Description

Mass storage file system error.

Consequences

The system goes to system failure state. The filesystem on the mass storage device could be corrupt. The file(s) on the mass storage device could be corrupt.

Probable causes

The mass storage device was removed or there was a malfunction of the mass storage device.

Recommended actions

If the problem persists, try with another device.

37505, USB mass storage write during shutdown

Description

There was a write to the USB mass storage during shutdown.

Consequences

The previous shutdown time could be longer than usual.

Probable causes

There was an active write to the USB mass storage unit during shutdown.

Recommended actions

None, the previous shutdown time could be longer than usual.

38100, Configuration failure

Description

Drive module has detected configuration failure at measurement link.

Drive module: *arg.*

Measurement link: *arg.*

Board position: *arg*

Recommended actions

- Check configuration for measurement link.
- Check configuration for measurement board.
- Check configuration for measurement nodes.

38101, SMB Communication Failure

Description

A transmission failure has been detected between the axis computer and the serial measurement board on measurement link *arg* in drive module *arg*.

Consequences

The system goes to system failure state and loses its calibration information.

Probable causes

This may be caused by bad connections or cables (screening), especially if non-ABB cables are used for additional axes.

Possible causes are also faulty serial measurement board or axis computer.

Recommended actions

- 1) Reset the robot's revolution counters as detailed in the robot Product Manual.
- 2) Make sure the cable between serial measurement board and axis computer is connected correctly, and that it meets the specification set by ABB.
- 3) Make sure the cable screen is correctly connected at both ends.
- 4) Make sure no extreme levels of electromagnetic interference are emitted close to the robot cabling.
- 5) Make sure the serial measurement board and axis computer are fully functional. Replace any faulty unit.

Continues on next page

38102, Internal failure

Description

The measurement system has detected a hardware or software fault on measurement link *arg* in drive module *arg*.

Consequences

The system goes to system failure state and loses its calibration information.

Probable causes

This may be caused by some temporary disturbance in the robot cell or by a faulty axis computer.

Recommended actions

- 1) Restart the controller.
- 2) Reset the robot's revolution counters as detailed in the robot Product Manual.
- 3) Make sure no extreme levels of electromagnetic interference are emitted close to the robot cabling.
- 4) Make sure the axis computer is fully functional. Replace any faulty unit.

38103, Lost communication with the SMB

Description

The communication has been lost between the axis computer and the serial measurement board on measurement link *arg* in drive module *arg*.

Consequences

The system goes to system failure state and loses its calibration information.

Probable causes

This may be caused by bad connections or cables (screening), especially if non-ABB cables are used for additional axes.

Possible causes are also faulty serial measurement board or axis computer.

Recommended actions

- 1) Reset the robot's revolution counters as detailed in the robot Product Manual.
- 2) Make sure the cable between serial measurement board and axis computer is connected correctly, and that it meets the specification set by ABB.
- 3) Make sure the cable screen is correctly connected at both ends.
- 4) Make sure no extreme levels of electromagnetic interference are emitted close to the robot cabling.
- 5) Make sure the serial measurement board and axis computer are fully functional. Replace any faulty unit.

38104, Overspeed During Teach Mode

Description

Joint *arg* connected to drive module *arg* has exceeded the maximum speed for teach mode operation.

Consequences

The system goes to status SYS HALT.

Probable causes

The robot may have been moved manually while in state Motors OFF. The error may also be caused by a maladjustment in the relation, commutation, between motor shaft and resolver on an additional axis, primarily during installation.

Recommended actions

- 1) Press the Enabling Device to attempt resuming operation.
- 2) Check other event log messages occurring at the same time to determine the actual cause.
- 3) Perform a re-commutation of the motor at hand. How to do this is specified in the Additional Axes Manual.

38105, Data not found

Description

Configuration data for measurement board not found.

System will use default data.

Drive module: *arg*.

Measurement link: *arg*.

Board node: *arg*

Recommended actions

Check configuration.

38200, Battery backup lost

Description

The battery backup to serial measurement board (SMB) *arg* in the robot connected to drive module *arg* on measurement link *arg* has been lost.

Consequences

When the SMB battery power supply is interrupted, the robot will lose the revolution counter data. This warning will also repeatedly be logged.

Probable causes

This may be due to an SMB battery that is discharged or not connected. For some robot models, the SMB battery power is supplied through a jumper in the robot signal cable (refer to the IRC5 circuit diagram), and disconnecting the cable interrupts the battery power supply. Some earlier robot versions used

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

rechargeable batteries, and these must be charged for at least 18 hours before working correctly.

Recommended actions

- 1) Make sure a charged SMB battery is connected to the board.
- 2) NOTE! Disconnecting the robot signal cable may disconnect the SMB battery power supply, triggering the battery warning to be logged.
- 3) Reset the battery power warning by updating the revolution counters as detailed in the Calibration or Product Manual.
- 4) Replace the battery if discharged.

38201, Serial Board not found

Description

Serial measurement board not found on measurement link.

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Recommended actions

- Check system configuration parameters.
- Check connections and cables to serial measurement board.
- Replace serial measurement board.

38203, SMB offset X error

Description

Offset error for X signal at serial measurement board.

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Recommended actions

- Replace serial measurement board.

38204, SMB offset Y error

Description

Offset error for Y signal at serial measurement board.

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Recommended actions

- Replace serial measurement board.

38205, SMB Linearity Error

Description

Linearity error for X-Y signal difference at serial measurement board.

System may still operate with warning.

System will not function with error.

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Recommended actions

- Replace serial measurement board.

38206, SMB Linearity X Error

Description

Linearity error for X signal on serial measurement board.

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Recommended actions

- Replace serial measurement board.

38207, SMB Linearity Y Error

Description

Linearity error for Y signal at serial measurement board.

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Recommended actions

- Replace serial measurement board.

38208, Resolver error

Description

Too high voltage from X or Y resolver signals.

Sum of squared X and Y exceeds max.

Joint: *arg.*

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Board node: *arg.*

Recommended actions

- Check resolver and resolver connections.
- Replace serial measurement board.
- Replace resolver.

38209, Resolver error

Description

Too low voltage from X or Y resolver signals.

Sum of squared X and Y too low.

Continues on next page

Joint: *arg.*
Drive module: *arg.*
Measurement link: *arg.*
Measurement board: *arg.*
Board node: *arg.*
Recommended actions
- Check resolver and resolver connections.
- Replace serial measurement board.
- Replace resolver.

38210, Transmission fault

Description
Serial measurement board SMS communication failed.
Status: *arg.*
Drive module: *arg.*
Measurement link: *arg.*
Measurement board: *arg.*
Board node: *arg.*
Recommended actions
- Restart the controller.
- Check cable and connectors for SMB communication.
- Replace the serial measurement board.

38211, Measurement functionality error

Description
The serial measurement board does not support 7 axes.
Drive module: *arg.*
Measurement link: *arg.*
Measurement board: *arg.*
Recommended actions
- Check configurations of the 7th axis.
- Replace serial measurement board to a board with 7 axes functionality.

38212, Data not found

Description
Configuration data for serial measurement board not found.
System will use default data.
Drive module: *arg.*
Measurement link: *arg.*
Measurement board: *arg.*
Recommended actions
- Check configuration.

38213, Battery charge low

Description
Battery on serial measurement board will soon be depleted.
Replace battery at a suitable opportunity.
Drive module: *arg.*
Measurement link: *arg.*
Measurement board: *arg.*
Recommended actions
- Do not turn off the controller until the battery is replaced.
- Replace battery on serial measurement.

38214, Battery failure

Description
Transportation shut down of battery failed. The battery will still be in normal mode.
Drive module: *arg.*
Measurement link: *arg.*
Measurement board: *arg.*
Recommended actions
- Retry shut down.
- Replace serial measurement board.

38215, Battery supervision failure

Description
Failure occurred during reset of battery supervision circuit in serial measurement board.
Drive module: *arg.*
Measurement link: *arg.*
Measurement board: *arg.*
Recommended actions
- Repeat update of revolution counter for joint connected to the SMB.
- Replace serial measurement board.

38216, SMB functionality error

Description
The serial measurement board does not support needed functionality. The needed functionality is available in DSQC633C or better SMB.
Drive module: *arg.*
Measurement link: *arg.*
Measurement board: *arg.*

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Consequences

The motion performance will be lower compared with what it should be with DSQC633C or better SMB.

Recommended actions

- Replace serial measurement board with a board with at least DSQC633C functionality.

38217, SMB functionality error

Description

The serial measurement board does not support needed functionality. The needed functionality is available in DSQC633D or better SMB.

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Consequences

The motion performance will be lower compared with what it should be with DSQC633D or better SMB.

Recommended actions

- Replace serial measurement board with a board with at least DSQC633D functionality.

38218, EIB encoder high temperature

Description

The temperature of the motor encoder is too high.

Joint: *arg.*

Drive module: *arg.*

Measurement link: *arg.*

Measurement board: *arg.*

Board node: *arg.*

Consequences

The life time of the encoder can be reduced.

Recommended actions

- Stop robot and wait for motor/encoder to cool down.
- Reduce ambient temperature.
- Change robot program to avoid high speeds and torques.

38230, PMC card not connected correctly

Description

The PMC card that is configured in the motion configuration is not connected or is not working correctly.

Consequences

The application that needs this PMC card cannot be run.

Probable causes

The PMC card is not connected or the card is broken.

Recommended actions

Please check the PMC card that is attached to the axis computer in the drive module *arg.*

38231, PMC card cannot be started

Description

The PMC card that is configured in the motion configuration is not set up correctly and cannot be started.

Consequences

The application that uses this PMC card cannot be run.

Probable causes

The error is probably an error in the motion configuration.

Recommended actions

Please check the limits for channels for this card in the motion configuration.

38232, PMC max channels reached

Description

The PMC card that is configured in the motion configuration is not set up correctly and cannot be started.

Consequences

The application that uses this PMC card cannot be run.

Probable causes

The error is probably an error in the motion configuration.

Recommended actions

Please check the limits for channels for this card in the motion configuration.

38233, Force sensor safety channel error

Description

The safety channel in the cable between the force sensor and measurement board is under configured safety channel voltage level. The force sensor is connected to the axis computer in drive module *arg.*

Consequences

The system will go to SYS HALT and the application that uses this sensor cannot be run until cable is connected or replaced. Safety channel supervision can be disconnected in the motion configuration.

Probable causes

- 1) The cable is not attached correctly.

Continues on next page

- 2) The cable has damage to the connectors or the cable itself.
- 3) The sensor cable does not have safety channel.

Recommended actions

Assure that the cable is connected properly and inspect the connectors at both ends of the cable and the cable itself. Replace if damaged.

Consequences

System will stop.

Recommended actions

Check the load that was applied to the force/torque sensor. Check that the cable, sensor and measurement board is not damaged. Increase the system parameter: time in saturation before error

38234, Max Force or Torque reached

Description

The measured force or torque in the force sensor attached to the axis computer in drive module *arg* has higher value than it is configured for.

Consequences

The system will not stop due to this.

Probable causes

The applied force or torque on the sensor is higher than configured. Too high ordered reference can be the cause. The configuration might also be faulty.

Recommended actions

Check the force and torque references in the program and if the environment have applied too high force or torque to the sensor.

38237, Configuration error for Force Measurement Board

Description

The configuration input values for the Force Measurement Board connected to the force sensor is erroneous. The board is connected to drive module *arg*, link *arg*.

Consequences

The system goes to system failure state.

Recommended actions

Check the configuration.

38238, Force Sensor has too noisy signals

Description

The force sensor detected signals with noise level higher than expected.

Task: *arg*.

Program Ref. *arg*.

Consequences

The force control application cannot be run.

Probable causes

The cause of noisy signals can be from tool vibrations attached to the sensor.

It can also be an electrically issue such as bad grounding or insufficient shielding of other devices, for instance an electrical tool causing electrical disturbances on the measurements.

Recommended actions

If the probable cause is vibrations the recommended action is to try build the tool in such a way that it reduces the vibration.

It can also be tested to run the RAPID instruction that fails with the vibrating tool turned off during the FCCalib or FCLoadId.

If there are no visible vibrations then it should be investigated if this is an electrical disturbance problem.

Use TuneMaster to compare signals 1001-1006 when:

- robot is in motors off state
- robot is run by slow jogging.
- the electrical tool is running.

38235, Saturation warning of force sensor input

Description

The analog input values of the measurement board connected to the force sensor have saturated and the time in saturation has reached the warning level.

The measurement board is connected to the axis computer in drive module *arg*

Recommended actions

Check the load that was applied to the force/torque sensor. Check that the cable, sensor and measurement board is not damaged.

Increase the system parameter: time in saturation before warning

38236, Saturation error of force sensor input

Description

The analog input values of the measurement board connected to the force sensor have saturated and the time in saturation has reached the error level. The measurement board is connected to the axis computer in drive module *arg*

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

The level of sensitivity for the check can be changed by parameter Noise Level that belongs to the type FC Sensor, in the topic Motion. It is however only recommended to change this level if the investigation of the cause has been done and shows that the level is only a bit too low.

39401, Torque Current Reference Error

Description

The torque-current reference is increasing too quickly for joint *arg*, connected to drive module *arg*.

Consequences

Probable causes

The resolver feedback may be poor or the speed loop gain may be badly adjusted.

Recommended actions

- 1) Check the resolver cable and the resolver grounding for this joint. If this joint is an additional axis, then check that the motor data in the configuration file is correct. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Reduce the gain of the speed loop.

39402, Motor Angle Reference Warning

Description

The motor angle reference is increasing too quickly for joint *arg*, connected to drive module *arg*.

Consequences

Probable causes

The resolver feedback may be poor or the speed loop gain may be badly adjusted.

Recommended actions

- 1) Check the resolver cable and the resolver grounding for this joint. If this joint is an additional axis, then check that the motor data in the configuration file is correct. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Reduce the gain of the speed loop.

39403, Torque Loop Undercurrent

Description

The torque-current controller detected too low current for joint *arg*, connected to drive module *arg*.

Consequences

Probable causes

The motor data in the configuration files may be wrong or the DC bus voltage may be too low.

Continues on next page

Recommended actions

- 1) Check that the motor data in the configuration file is correct for this joint. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Check that no DC bus errors are present in the event log.
- 3) Check that the incoming mains voltage is within the specification.
- 4) Check that the motor cables are not damaged or badly connected.

39404, Torque Loop Overcurrent

Description

The field-current controller detected too high current for joint *arg*, connected to drive module *arg*.

Consequences

Probable causes

The motor data in the configuration files may be wrong.

Recommended actions

- 1) Check that the motor data in the configuration file is correct for this joint. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Check that no DC bus errors are present in the event log.
- 3) Check that the incoming mains voltage is within the specification.
- 4) Check that the motor cables are not damaged or badly connected.

39405, Maximum PWM Reached in Torque Controller

Description

The torque-current control loop has been saturated for joint *arg*, connected to drive module *arg*.

Consequences

Probable causes

The mains voltage may be too low or the motor windings or motor cables may be broken.

Recommended actions

- 1) Check that no DC bus errors are present in the event log.
- 2) Check that the incoming mains voltage is within specified limits.
- 3) Check the motor cables and motor windings for open circuits.

39406, Field Loop overcurrent

Description

The field-current control loop has produced too high current for joint *arg*, connected to drive module *arg*.

Consequences

Probable causes

The motor data in the configuration files may be wrong.

Recommended actions

- 1) Check that no DC bus errors are present in the event log.
- 2) Check that the incoming mains is within specified limits.
- 3) Check the motor cables and motor windings.

39407, Drive Unit has the wrong type code

Description

The type code in drive unit for joint *arg* in drive module *arg* is different from the one specified in the configuration file. Installed drive unit type is *arg*, and the configured type is *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The configuration file may contain incorrect values, the configuration key may be incorrect or the hardware may be of the wrong type. If the drive unit was recently replaced, a drive unit with the wrong type code may have been fitted or the key was not replaced with one for the correct hardware/software combination.

Recommended actions

- 1) Make sure the values in the configuration file match the installed hardware.
- 2) Make sure the configuration key match the installed hardware/software combination. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 3) If the drive unit was recently replaced, make sure a unit of the correct type code is used.

39408, Rectifier Unit has the wrong type code

Description

The type code for rectifier unit *arg* in drive module *arg* is different from the one specified in the configuration file. Installed rectifier unit type is *arg*, and the configured type is *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to system failure state.

Probable causes

The configuration file may contain incorrect values, the configuration key may be incorrect or the hardware may be of the wrong type. If the rectifier unit was recently replaced, a rectifier unit with the wrong type code may have been fitted or the key was not replaced with one for the correct hardware/software combination.

Recommended actions

- 1) Make sure the values in the configuration file match the installed hardware.
- 2) Make sure the configuration key match the installed hardware/software combination. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 3) If the rectifier unit was recently replaced, make sure a unit of the correct type code is used.

39409, Capacitor Unit has the wrong type code

Description

The type code for capacitor unit *arg* in drive module *arg* is different from the one specified in the configuration file. Installed capacitor unit type is *arg*, and the configured type is *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The configuration file may contain incorrect values, the configuration key may be incorrect or the hardware may be of the wrong type. If the capacitor unit was recently replaced, a capacitor unit with the wrong type code may have been fitted or the key was not replaced with one for the correct hardware/software combination.

Recommended actions

- 1) Make sure the values in the configuration file match the installed hardware.
- 2) Make sure the configuration key match the installed hardware/software combination. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 3) If the capacitor unit was recently replaced, make sure a unit of the correct type code is used.

39410, Drive Unit communication warning

Description

Many communication errors are being detected between the axis computer and drive unit number *arg* in drive module *arg*. (error rate per time unit)

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Consequences

If the number of communication errors increases further, there is a risk that the controller will be forced to stop.

Probable causes

External noise may interfere with the communication signals.

Recommended actions

- 1) Check the communication link cable between the axis computer and the main drive unit is correctly connected.
- 2) Check that the module is properly grounded.
- 3) Check for external electromagnetic noise sources close to the drive module.

39411, Too Many communication errors

Description

Four or more consecutive communication packets have been lost between the axis computer and drive unit *arg* in drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

There may be a break in the communication link cable between the axis computer and the main drive unit, the drive module may be incorrectly grounded or excessive noise may interfere with the communication signals.

Recommended actions

- 1) Check the communication link cable between the axis computer and the main drive unit is correctly connected.
- 2) Check that the module is properly grounded.
- 3) Check for external electromagnetic noise sources close to the drive module.

39412, Too Many Missed Reference Updates

Description

Too many missed communication packets have been detected for joint *arg*, in drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

There may be a break in the communication link cable between the axis computer and the main drive unit, the drive module may be incorrectly grounded or excessive noise may interfere with the communication signals.

Recommended actions

- 1) Check the communication link cable between the axis computer and the main drive unit is correctly connected.
- 2) Check that the module is properly grounded.
- 3) Check for external electromagnetic noise sources close to the drive module.

39413, Drive Software Not Synchronized

Description

The axis computer software in drive module *arg* has become unsynchronized with the drive software for joint *arg*. This is an unstable software state.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

There may be glitches in the system timing.

Recommended actions

- 1) Restart the controller.
- 2) If the problem persists, contact your local ABB representative.

39414, Unknown Capacitor Type Code

Description

The type code for the capacitor unit *arg* in drive module *arg* is not recognised by the system.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The wrong type of capacitor unit may have been fitted or the capacitor version used is not supported by the software.

Recommended actions

- 1) Check the type of capacitor unit fitted. Replace if it is the wrong type.
- 2) If the problem persists, contact your local ABB representative.

39415, Communication with the Drive Unit Lost

Description

Communication with drive unit number *arg* in drive module *arg* has been lost.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Continues on next page

Probable causes

There may be a break in the communication link cable between the axis computer and the main drive unit, the drive module may be incorrectly grounded or excessive noise may interfere with the communication signals.

Recommended actions

- 1) Check the communication link cable between the axis computer and the main drive unit is correctly connected.
- 2) Check that the module is properly grounded.
- 3) Check for external electromagnetic noise sources close to the drive module.

39416, Drive Unit Not Responding

Description

The main drive unit in drive module *arg* is not responding.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

There may be a break in the communication link cable between the axis computer and the main drive unit, or there may be a lock-up in the software.

Recommended actions

- 1) Check the communication link cable between the axis computer and the main drive unit is correctly connected.
- 2) Restart the controller.
- 3) If the problem persists, contact your local ABB representative.

39417, Cannot find Drive Software Version File

Description

The system cannot locate a valid drive version file on the disk. The file may have been erased my mistake. Without this file it is not possible to check if the drive unit software needs updating.

Recommended actions

Contact your local ABB representative.

39418, Unknown Drive Unit type code

Description

The type code for the drive unit *arg* in drive module *arg* is not recognized by the system. Installed drive unit type is *arg*, and the configured type is *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The connection to the drive unit may be bad or the hardware may be faulty.

Recommended actions

- 1) Make sure the cable connections on the drive unit are correct.
- 2) Make sure the drive unit is one supported by this controller.
- 3) If the drive unit was recently replaced, make sure a unit of the correct type code is used.

39419, Unknown Rectifier type code

Description

The type code for the rectifier unit *arg* in drive module *arg* is not recognized by the system. Installed rectifier unit type is *arg*, and the configured type is *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The connection to the drive unit may be bad or the hardware may be faulty.

Recommended actions

- 1) Make sure the cable connections on the rectifier unit are correct.
- 2) Make sure the rectifier unit is one supported by this controller.
- 3) If the rectifier unit was recently replaced, make sure a unit of the correct type code is used.

39420, Drive Unit built in test failure

Description

Drive unit number *arg* in drive module *arg* has detected an internal hardware failure.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The test software is not working correctly, or the actual hardware is faulty.

Recommended actions

- 1) Perform a shutdown and then restart the controller.
- 2) If the problem persists, isolate the faulty drive unit and replace it.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

39421, Drive Unit configuration test failure

Description

Drive unit number *arg* in drive module *arg* has detected an internal error.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The connection to the drive unit may be bad or incorrect hardware may have been fitted.

Recommended actions

- 1) Perform a shutdown and then restart the controller.
- 2) If the problem persists, isolate the faulty drive unit and replace it.

39422, Drive Unit watchdog timeout

Description

The time limit for watchdog timer for drive unit number *arg* in drive module *arg* has expired.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The connection to the drive unit may be bad or incorrect hardware may have been fitted. It may also be caused by an internal error in the drive unit.

Recommended actions

- 1) Perform a shutdown and then restart the controller.
- 2) If the problem persists, isolate the faulty drive unit and replace it.

39423, Drive Unit Internal Warning

Description

Internal measurement warning for drive unit number *arg* in drive module *arg*.

Supervision code = *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

There may be problems with the control cable, the DC link connection (bus bar or cable) or internal hardware.

Recommended actions

- 1) Check the control cables and DC link connection (bus bar or cable) are correctly inserted for this unit.
- 2) Restart the controller.

39424, Drive Unit internal error

Description

Internal measurement warning for drive unit number *arg* in drive module *arg*.

Supervision Code = *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The connection to the drive unit may be bad or incorrect hardware may have been fitted. It may also be caused by faulty control cable, DC link connection (bus bar or cable) or internal hardware.

Recommended actions

- 1) Make sure the control cables and DC link connection (bus bar or cable) are correctly connected for this unit.
- 2) Perform a shutdown and then restart the controller.
- 3) If the problem persists, isolate the faulty unit and replace it.

39425, Drive Unit measurement failure

Description

A current measurement circuit in drive unit number *arg*, drive module *arg*, attached to joint *arg* has failed.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by a faulty or lacking DC link connection between the rectifier and drive units.

Recommended actions

- 1) Make sure the DC link connection (bus bar or cable) is correctly connected between the rectifier and drive unit.
- 2) Check the indication LEDs on the rectifier and drive units. The significance of the LEDs is described in the Trouble Shooting Manual.

Continues on next page

39426, Rectifier internal failure

Description

The rectifier on communication link *arg* attached to drive module *arg* has detected an internal failure.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by a faulty or lacking signal connection between the rectifier and drive units.

Recommended actions

- 1) Make sure the signal cable is correctly connected between the rectifier and drive unit.
- 2) Check the indication LEDs on the rectifier and drive units. The significance of the LEDs is described in the Trouble Shooting Manual.

39427, Rectifier communication missing

Description

The communication with the rectifier on drive communication link *arg*, drive module *arg* has been lost.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by a faulty or lacking signal connection between the rectifier and drive units.

Recommended actions

- 1) Make sure the signal cable is correctly connected between the rectifier and drive unit.
- 2) Perform a shutdown and then restart the controller.
- 3) If the problem persists, isolate the faulty unit and replace it.

39428, Rectifier startup error

Description

The rectifier on drive communication link *arg*, drive module *arg* has detected a startup error.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by an internal error in the rectifier unit.

Recommended actions

- 1) Make sure the signal cable is correctly connected between the rectifier and drive unit.
- 2) Perform a shutdown and then restart the controller.
- 3) If the problem persists, isolate the faulty rectifier unit and replace it.

39431, Update of Drive Unit Software in Progress

Description

The drive unit software in drive module *arg* is being updated. Please wait for the upgrade to be completed. This will take approximately 3.5 minutes.

NOTE: Please do not turn off the power or restart the controller until the download is complete.

Recommended actions

Please wait...

39432, Incompatible boot version in drive unit

Description

The boot version in drive module *arg* is version *arg*, which is not allowed. The latest allowed boot version is *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The boot version is not compatible with the hardware version.

Recommended actions

- 1) Replace the drive unit with one using a boot version equal to or greater than the latest allowed one.

39434, Drive Unit Start Failure

Description

The drive unit in drive module *arg* failed to start. drive boot status = *arg*. drive dsp1 status = *arg*.

Consequences

The robot cannot be operated.

Probable causes

A number of errors may cause this.

Recommended actions

- 1) Switch the main power off to the module and then switch it back on. Note that a normal restart will NOT suffice!
- 2) If the problem persists, replace the drive unit.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

39435, Cannot find additional axis drive unit

Description

The system cannot detect an additional axis drive for joint *arg* in drive module *arg*.

Consequences

System goes to SYS_FAIL.

Probable causes

This can be due to:

- 1) Having an additional axis configured but not having a drive unit in the drive module.
- 2) Having an external drive unit but not connecting the cable to the X*arg* connector position on the main drive unit.
- 3) Damaged cable between the additional axis drive and the main drive unit.

Recommended actions

- 1) Check the drive module contains enough additional axis drives.
- 2) Check that the configuration key does not define more external drive units than are connected in the drive module
- 3) Check the cable between the additional axis drive unit and to the main drive unit is correctly inserted in the right connector position.
- 4) If the cable exists and is correctly inserted, then it may be damaged and should be replaced.

39440, Open circuit in bleeder resistor circuit

Description

The bleeder resistor connected to the rectifier on drive link *arg*, drive module *arg*, is an open circuit.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by a faulty bleeder resistor cable or bleeder resistor.

Recommended actions

- 1) Make sure the bleeder resistor cable is correctly connected to the rectifier unit.
- 2) Make sure the cable and resistor is working correctly by measuring their resistance respectively. Disconnect before measuring.
- 3) Replace any faulty component.

39441, Short circuit in bleeder resistor circuit

Description

The bleeder resistor connected to the rectifier on drive link *arg*, drive module *arg*, is a short circuit.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by a faulty bleeder resistor cable or bleeder resistor.

Recommended actions

- 1) Make sure the bleeder resistor cable is correctly connected to the rectifier unit.
- 2) Make sure the cable and resistor is working correctly by measuring their resistance respectively. Disconnect before measuring.
- 3) Replace any faulty component.

39442, Bleeder Resistance Too Low

Description

The bleeder resistance is too low for the rectifier on drive communication link *arg*, drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The bleeders may have the wrong resistance value or one of the bleeders may have failed, causing a short circuit.

Recommended actions

- 1) Check the bleeder resistors to see that they are the correct resistance value for this drive module configuration.
- 2) Check that none of the resistors have failed. How to check the configuration file is detailed in the Trouble Shooting Manual.

39443, Bleeder Resistor Overload Warning

Description

The power consumed by the bleeder resistors is approaching overload for the rectifier on drive communication link *arg*, drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Continues on next page

Probable causes

The user program may contain too much hard braking of the manipulators, which is more likely if the system contains additional axes.

Recommended actions

- 1) Rewrite the user program to reduce the amount of hard braking.

39444, Bleeder resistor overload error

Description

The bleeder resistors have been overloaded for the rectifier on drive communication link *arg*, drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The user program may contain too much hard braking or too high a payload of the manipulators. This is more likely if the system contains additional axes.

Recommended actions

- 1) Rewrite the user program to reduce the amount of hard braking.

39450, Faulty Fan Unit Power Supply

Description

The power supply for the fan unit in drive module *arg* is not within its allowed voltage limits.

Consequences**Probable causes**

The main fan power supply unit may be faulty or the supply to this power supply unit may not be within its allowed voltage limits.

Recommended actions

- 1) Check the fan cable is correctly inserted.
- 2) Check that all fans are working. 3) Check the input voltage to the main fan power supply unit. Replace any faulty unit.

39451, Fan Unit Malfunction

Description

The fan unit in drive module *arg* has malfunctioned.

Consequences**Probable causes**

The fan unit may be faulty, a loss of power supply or the fan power cable may not be connected correctly.

Recommended actions

- 1) Make sure the fan cable is correctly connected.
- 2) Make sure all fans are working and that air flow is not obstructed.
- 3) Measure the output voltage from the drive unit supplying the fan. Replace any faulty unit.

39452, Axis Computer Cooling Fan Malfunction

Description

The cooling fan for the axis computer in drive module *arg* has malfunctioned.

Recommended actions

- 1) Check that the fan cable is correctly inserted.
- 2) Replace the faulty fan unit.

39453, Transformer Cooling Fan Malfunction

Description

The cooling fan for the transformer supplying drive module *arg* has malfunctioned.

Recommended actions

- 1) Check if fan cable is correctly inserted.
- 2) Replace the faulty fan unit.

39460, DC Link Voltage Too Low

Description

The DC link voltage is too low for the rectifier on drive communication link *arg*, drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The DC link bus bar may be incorrectly connected or the three-phase mains power may be interrupted while the robot is in the Motors ON state. The mains contactor may also have been opened whilst the robot is in Motors ON state (breaking the safety chain). The incoming main power supply may also be too low.

Recommended actions

- 1) Make sure the DC link bus bar is correctly connected.
- 2) Make sure the mains supply has not been interrupted.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

- 3) Make sure the safety chain has not been broken.
- 4) Make sure the output voltage of the drive module power supply is within acceptable limits as specified in the Product Manual.

39461, DC Link Voltage Too High

Description

The DC link voltage is too high for the rectifier on drive communication link *arg*, drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The user program may contain too much hard braking of the manipulators, which is more likely if the system contains additional axes. The brake resistors may also be faulty.

Recommended actions

- 1) Check the bleeder resistors to see that they are the correct resistance value for this drive module configuration.
- 2) Check that none of the resistors have failed.
- 3) If possible, rewrite the user program to reduce the amount of hard braking.

39462, DC Link Voltage at Critical

Description

The DC link voltage is critically high for the rectifier on drive communication link *arg*, drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The user program may contain too much hard braking of the manipulators, which is more likely if the system contains additional axes. The brake resistors may also be faulty.

Recommended actions

- 1) Check the bleeder resistors to see that they are the correct resistance value for this drive module configuration.
- 2) Check that none of the resistors have failed.
- 3) Rewrite the user program to reduce the amount of hard braking.

39463, Motor Phase Short Circuit Warning

Description

A brief short circuit was detected in the motor/motor cable for the motor attached to joint *arg* in drive module *arg*.

Consequences

Probable causes

This may be due to dust or metal fragments contaminating the contacts or motor windings.

Recommended actions

No action is required if the problem does not persist.

39464, Short circuit in Motor phase circuit

Description

The motor or motor cable for joint *arg* in drive module *arg*, drive unit number *arg*, is a short circuit.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by a faulty motor or motor cable. It may also be caused by contamination in the contactors for the cables or a failure of the motor windings.

Recommended actions

- 1) Make sure the motor cable is correctly connected to the drive unit.
- 2) Check the cable and motor by measuring their resistance respectively. Disconnect before measuring.
- 3) Replace any faulty component.

39465, Motor current warning

Description

The motor current is higher than the allowed for joint *arg* in drive module *arg*, drive unit number *arg*.

Consequences

Probable causes

The motor load may be too high or the motor may have stalled (maybe due to a collision).

Recommended actions

- 1) Check that the robot has not collided with anything.
- 2) If possible, reduce the speed of the user program.
- 3) If the axis is an additional axis, check that the motor load is not too high for the drive unit.

Continues on next page

39466, Motor Current Overload

Description

The motor current is too high for joint *arg* in drive module *arg*, drive unit number *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The motor load may be too high or the motor may have stalled (maybe due to a collision).

Recommended actions

- 1) Check that the robot has not collided.
- 2) If possible, reduce the speed of the user program.
- 3) If the axis is an additional axis, check that the motor load is not too high for the drive unit.

39467, Drive Unit Temperature Warning

Description

The temperature has risen above the warning level in drive unit number *arg*, drive module *arg*, which is the lowest abnormal level of three.

Consequences**Probable causes**

The ambient temperature may be too high, the cooling fans may have failed or the user program may consume more current than the drive system can supply.

Recommended actions

- 1) Check that the fans are running and that the air flow is not obstructed.
- 2) Check that the ambient temperature does not exceed the cabinet rating.
- 3) If the system contains additional axes then check that motors are not too large for the drive units.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration.

39468, Drive Unit Temperature Alarm

Description

The temperature has risen above the alarm level in drive unit number *arg*, drive module *arg*, which is the second abnormal level of three.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The ambient temperature may be too high, the cooling fans may have failed or the user program may consume more current than the drive system can supply.

Recommended actions

- 1) Check that the fans are running and that the air flow is not obstructed.
- 2) Check that the ambient temperature does not exceed the cabinet rating.
- 3) If the system contains additional axes then check that motors are not too large for the drive units.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration.

39469, Drive Unit Temperature Critical

Description

The temperature has risen above the critical level in drive unit number *arg*, drive module *arg*, which is the top abnormal level of three.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The ambient temperature may be too high, the cooling fans may have failed or the user program may consume more current than the drive system can supply.

Recommended actions

- 1) Check that the fans are running and that the air flow is not obstructed.
- 2) Check that the ambient temperature does not exceed the cabinet rating.
- 3) If the system contains additional axes then check that motors are not too large for the drive units.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration.

39470, Power Semiconductor Warning

Description

The power semiconductor is approaching overload for joint *arg*, in drive unit number *arg*, drive module *arg*.

Consequences**Probable causes**

The motor load may be too high, the motor may have stalled (maybe due to a collision), the motor load may be too high or there may not be enough cooling.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Recommended actions

- 1) Check that the robot has not collided.
- 2) Check that the fans are running and that the air flow is not obstructed.
- 3) Check that the ambient temperature does not exceed the cabinet rating.
- 4) If the system contains additional axes then check that motors are not too large for the drive units.
- 5) If possible, rewrite the user program to reduce the amount of hard acceleration.

39471, Power Semiconductor Overload Error

Description

The power semiconductor has been overloaded for joint *arg*, in drive unit number *arg*, drive module *arg*.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The motor load may be too high, the motor may have stalled (maybe due to a collision), the motor load may be too high or there may not be enough cooling.

Recommended actions

- 1) Check that the robot has not collided.
- 2) Check that the fans are running and that the air flow is not obstructed.
- 3) Check that the ambient temperature does not exceed the cabinet rating.
- 4) If the system contains additional axes then check that motors are not too large for the drive units.
- 5) If possible, rewrite the user program to reduce the amount of hard acceleration.

39472, Incoming Mains Phase Missing

Description

The rectifier connected to communication link *arg* in drive module *arg* detects a power loss in one phase.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by an actual mains power loss, some malfunction in the Motors ON contactors or its cabling or in another part of the three phase chain inside the cabinet. On

rare occasions, this fault may occur in combination with other faults, in which case this may be found in the error log.

Recommended actions

- 1) Make sure the mains switch is closed and that there is mains voltage present. No volts means the problem is in mains cable connector or the factory power supply.
- 2) If the voltage is OK, disconnect the input mains cable and measure the resistance of all three phases across all the components in the 3 phase supply chain. Start from the contactor closest to the rectifier and work backwards towards the mains switch. The contactors can be closed manually to perform the test. Refer to the electrical drawings for the cabinet.
- 3) Check the indication LEDs on the rectifier unit. The significance of these is described in the Trouble Shooting Manual.
- 4) If the voltage is OK, check any other error log messages coinciding in time with this one for clues.

39473, All Incoming Mains Phases Missing

Description

The rectifier connected to communication link *arg* in drive module *arg* detects a power loss in one or more phases.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

This may be caused by an actual mains power loss, some malfunction in the Motors ON contactors or its cabling or in another part of the three phase chain inside the cabinet. On rare occasions, this fault may occur in combination with other faults, in which case this may be found in the error log.

Recommended actions

- 1) Make sure the mains switch is closed and that there is mains voltage present. No volts means the problem is in mains cable connector or the factory power supply.
- 2) If the voltage is OK, disconnect the input mains cable and measure the resistance of all three phases across all the components in the 3 phase supply chain. Start from the contactor closest to the rectifier and work backwards towards the mains switch. The contactors can be closed manually to perform the test. Refer to the electrical drawings for the cabinet.
- 3) Check the indication LEDs on the rectifier unit. The significance of these is described in the Trouble Shooting Manual.
- 4) If the voltage is OK, check any other error log messages coinciding in time with this one for clues.

Continues on next page

39474, Rectifier Current Warning

Description

The rectifier connected to drive communication link *arg* in drive module *arg* is approaching overload.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The total motor current may be greater than that which the rectifier can supply.

Recommended actions

- 1) If possible, rewrite the user program to reduce the amount of hard acceleration.

39475, Rectifier Current Error

Description

The rectifier connected to drive communication link *arg* in drive module *arg* has reached overload.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The total motor current may be greater than that which the rectifier can supply.

Recommended actions

- 1) If possible, rewrite the user program to reduce the amount of hard acceleration.

39476, Rectifier Temperature Warning

Description

The temperature in the rectifier unit connected to drive communication link *arg* in drive module *arg* is approaching a too high a level.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The cooling fans may be faulty or the air flow may be obstructed. The ambient temperature may be too high or the system may be running with a too high load for extended periods.

Recommended actions

- 1) Check that the fans are running and that the air flow is not obstructed.

2) Check that the ambient temperature does not exceed the cabinet rating.

3) If the system contains additional axes then check that motors are not too large for the drive units.

4) If possible, rewrite the user program to reduce the amount of hard acceleration.

39477, Rectifier Temperature Error

Description

The temperature in the rectifier unit connected to drive communication link *arg* in drive module *arg* has reached a too high a level.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The cooling fans may be faulty or the air flow may be obstructed. The ambient temperature may be too high or the system may be running with a too high load for extended periods.

Recommended actions

- 1) Check that the fans are running and that the air flow is not obstructed.
- 2) Check that the ambient temperature does not exceed the cabinet rating.
- 3) If the system contains additional axes then check that motors are not too large for the drive units.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration.

39478, Internal Motor PTC Temperature Error

Description

The temperature in one or more robot motors connected to drive module *arg* has reached a too high a level.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The motor may have stalled (possibly due to a collision), the motor may be overloaded or the ambient temperature may be higher than the rated level for the robot.

Recommended actions

- 1) Check that the robot has not collided.
- 2) Check that the ambient temperature does not exceed the robot rating.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

- 3) Allow the robot to cool down, and then run the system again.
Replace any motors damaged by the excessive heat.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration.

39479, External Motor PTC Temperature Error

Description

One or more additional axis motors connected to drive module *arg* has reached a too high a level.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The motor may have stalled (possibly due to a collision), the motor may be overloaded or the ambient temperature may be higher than the rated level for the robot.

Recommended actions

- 1) Check that the additional axis has not collided.
- 2) Check that the ambient temperature does not exceed the rating.
- 3) Allow the motor to cool down, and then run the system again.
Replace any motors damaged by the excessive heat.
- 4) If possible, rewrite the user program to reduce the amount of hard acceleration.

39482, Mains Voltage Too High

Description

The mains voltage detected in drive module *arg* is too high.

Consequences

The robot cannot be operated.

Probable causes

The mains transformer may be incorrectly wired or the external supply voltage may be too high.

Recommended actions

- 1) Measure the incoming mains voltage at the main contactor in the drive module. Make sure it is within the range specified for this module.
- 2) Check the wiring of the mains transformer as detailed in the robot Product Manual.

39483, DC Link Short Circuit

Description

A short circuit has been detected on the DC link of drive module *arg*.

Consequences

The robot cannot be operated.

Probable causes

The DC bus bar may be badly connected or its contact surfaces may be contaminated causing a short circuit.

Recommended actions

- 1) Check that all DC link bus bars have been correctly connected.
- 2) Check that all contacts are free from contamination.

39484, Run chain open in motor on state

Description

Run chain *arg* is open when system is in motor on state. The problem occurred in drive system *arg*.

Consequences

System goes to SYS_HALT.

Probable causes

- 1) Cables and connections on the safety system are unplugged or damaged.
- 2) The contactor for this run chain in the drive module may be stuck due to mechanical problem in contactor itself.
- 3) The help contactor on the contactor can suffer from bad galvanic behavior or faulty cable to the safety system.

Recommended actions

- 1) Check if a motor contactor is stuck.
- 2) Replace faulty motor contactor.

39485, Run chain close in motor off state

Description

Run chain *arg* is open when system is in motor on state. The problem occurred in drive system *arg*.

Consequences

System goes to SYS_HALT.

Probable causes

- 1) The contactor for this run chain placed in the drive module has been pulled down manually.
- 2) The contactor has been welded in close position.

Recommended actions

- 1) If the contactor is not released and stays in pulled position, shut down the system and replace the contactor.
- 2) If the contactor has been pulled down manually, take this message as a warning only.

Continues on next page

39486, DC Link Not Connected

Description

The DC Link connection to the drive serving joint *arg* in drive module *arg*, drive unit number *arg* is missing or is not properly connected.

Consequences

The system goes to SYS_HALT.

Probable causes

- 1) The DC bus bar is either missing or is not properly connected.
- 2) If the bus bar is correctly connected. The drive unit reporting the error may have a fault.

Recommended actions

- 1) Check the DC bus bar is properly connected to all the drive units

2) Check if the power supply unit LED is red. The full meaning of all LED indications are described in the Trouble Shooting Manual, IRC5.

39502, Logic Voltage to Rectifier Error

Description

The 24V to the rectifier in drive module *arg* is out of range.

Consequences**Probable causes**

The cable between the drive unit and the rectifier may be badly connected, or the power supply voltage to the drive unit may be out of range.

Recommended actions

- 1) Check that the power cable between the power supply unit and the rectifier unit has been connected correctly.
- 2) Check the 24 V voltage in the power cable to the drive unit.

39500, Logic Voltage to Drive Unit Warning

Description

The 24V supply from the drive module power supply to the main drive unit in drive module *arg* is out of range.

Consequences**Probable causes**

The 24V supply from the drive module power supply may be out of range.

Recommended actions

- 1) Make sure the power cable from the drive module power supply to the main drive unit is connected correctly.
- 2) Check if the power supply unit LED is red. The full meaning of all LED indications are described in the Trouble Shooting Manual, IRC5.

39503, Power Supply Overtemperature

Description

The temperature in the drive module power supply of drive module *arg* has reached a critical level.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The fan unit may be faulty, the cooling air flow may be obstructed or the ambient temperature may be too high.

Recommended actions

- 1) NOTE! Do not try to restart the controller for approx. ten minutes to let it cool down.
- 2) Make sure the fans are running and that the air flow is not obstructed.
- 3) Make sure the ambient temperature does not exceed the drive module rating.
- 4) Make sure the power supply connectors are correctly connected to the axis computer.

39501, Logic Voltage to Drive Unit Error

Description

The 24V supply to the main drive unit in drive module *arg* is out of range.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Probable causes

The 24V supply from the power supply unit may be out of range.

Recommended actions

- 1) Make sure the power cable from the power supply unit to the main drive unit is connected correctly.

39504, Power Supply to Brakes Overload

Description

The brake power circuit in drive module *arg* draws too much current.

Consequences

No operation will be possible until after correcting the fault. The system goes to status SYS HALT.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

Probable causes

The brake power cable may be faulty (short circuit), or additional axis motors with brakes consuming too much power may be used. The fault may also occur if the cable from the power supply unit is not correctly connected to the drive module.

Recommended actions

- 1) Make sure the power supply cable is correctly connected to the drive module.
- 2) Check the brake supply cable for short circuits.
- 3) Make sure the total current consumed by additional axes' motors does not exceed the specification for the drive module.
- 4) Make sure the power supply connectors are correctly connected to the axis computer.
- 5) Make sure the 24 V BRAKE voltage is within specified limits.
See the circuit diagram in the Product Manual, IRC5.

39505, Mains Voltage to Power Supply Lost

Description

The mains power supply to the power supply unit in drive module *arg* is missing.

Consequences

No operation will be possible until after correcting the fault. The system goes to system failure state.

Probable causes

The main power switch on the drive module may be turned off. The incoming mains cable may be faulty (break), or the circuit breaker for the power supply may have tripped. The fault may also occur if the connector from the power supply unit is not correctly connected to the axis computer.

Recommended actions

- 1) Check that the main power switch is turned on for the drive module and restart the controller.
- 2) Check that the connector from the power supply unit is correctly connected to the axis computer.
- 3) Measure the voltage at the mains contactor to ensure that the mains is present.
- 4) Check that the power supply fuses/circuit breakers in the drive module have not tripped.

39506, DC bus status not ok

Description

The DC bus of one or more drive units connected to drive module *arg* has been unexpectedly switched off.

Consequences

System goes to status SYS HALT.

Continues on next page

Probable causes

This may be due to bad cables or internal errors in the drive unit.

Recommended actions

- 1) Check all cables connected to the drive unit.
- 2) Restart the controller.
- 3) Replace the drive unit if faulty.

39520, Communication lost with Drive Module

Description

The main computer has lost contact with drive module *arg*.

Consequences

The system goes to status SYS HALT No operation will be possible until the fault has been corrected.

Probable causes

This may be due to a cable break, badly connected connector or high levels of interference in the cable.

Recommended actions

- 1) Make sure the cable between control module and drive module is not damaged and that both connectors are correctly connected.
- 2) Make sure no extreme levels of electromagnetic interference are emitted close to the robot cabling.

39521, Drive Module Communication Warning

Description

There are a large number of communication errors being detected on the Ethernet link to drive module *arg*.

This can be due to external noise sources interfering with the cable.

Recommended actions

Check that there are no electromagnetic interference sources running near the cable or the drive or computer modules.

39522, Axis computer not found

Description

The axis computer in drive module *arg* is not connected to the main computer.

Consequences

The system goes to system failure state. No operation will be possible until the fault has been corrected.

Probable causes

This may be due to a cable break, badly connected connectors, or loss of power supply.

Recommended actions

- 1) Make sure that the cable between the main computer and the axis computer is not damaged and that both connectors are correctly connected.
- 2) Make sure that the power supply to the axis computer is working correctly.
- 3) Restart the controller.

39523, Unused Axis computer connected**Description**

Axis computer in the drive module *arg* is connected to the main computer but not in use.

Probable causes

This can be due to configuration problem.

Recommended actions

- 1) Disconnect the unused axis computer or setup the system to use the axis computer.
- 2) Restart the controller.

39524, Drive Module Command timeout**Description**

Drive module *arg* does not respond to command *arg*. The system has stopped the program for safety reasons.

Recommended actions

- 1) Check that drive module is powered on.
- 2) Check the cable between the main computer and axis computer.
- 3) Restart the controller.

39525, Drive Module startup error**Description**

The system has failed to complete the initialization phase of drive module *arg*.

Consequences

The system goes to system failure state.

Probable causes

The system has failed to complete the initialization phase of the drive module.

Recommended actions

- 1) Retry by restarting the controller using the main power switch.
- 2) Check for other hardware event log messages.

39526, Axis computer not found in Multi Move system**Description**

The axis computer in drive module *arg* is not connected to the main computer.

Consequences

The system goes to system failure state. No operation will be possible until the fault has been corrected.

Probable causes

This may be due to a cable break, badly connected connectors, missing axis computer switch, or loss of power supply.

Recommended actions

- 1) Make sure that the main power switch on drive module *arg* has been switched ON.
- 2) Make sure that the cable from the main computer through the switch to the drive module is not damaged and that both connectors are correctly connected.
- 3) Make sure that the cable is connected to the correct port on the axis computer switch.
- 4) Make sure that the power supply unit in drive module *arg* is working correctly.
- 5) Restart the controller.

39527, Axis computer not found in single Multi Move system**Description**

The axis computer in drive module *arg* is not connected to the main computer.

Consequences

The system goes to system failure state. No operation will be possible until the fault has been corrected.

Probable causes

This may be due to a cable break, badly connected connectors, missing axis computer switch, or loss of power supply.

Recommended actions

- 1) Make sure that the cable from the main computer through the switch to the axis computer is not damaged and that all connectors are correctly connected.
- 2) Make sure that the power supply to the axis computer is working correctly.
- 3) Restart the controller.

Continues on next page

5 Trouble shooting by event log

5.5 3 xxxx

Continued

39530, Axis Computer Lost Communication With Safety System

Description

Communication has been lost between axis computer and the safety system in drive module *arg*.

Consequences

System goes to system failure state.

Probable causes

This may be due to a faulty communication cable or connection between the axis computer and the safety system. It may also be due to severe interference or if the safety system has lost its power.

Recommended actions

1) Check cable between the axis computer and the safety system is intact and correctly connected.

- 2) Check power supply connected to the safety system.
- 3) Make sure no extreme levels of electromagnetic interference are emitted close to the robot cabling.

39531, Run chain glitch test not running

Description

The glitch test of the run chain has not been performed. The problem was discovered by the safety system connected to the axis computer in drive module *arg*.

Consequences

System goes to status SYS HALT.

Probable causes

This may be due internal errors.

Recommended actions

Contact your local ABB support office.

5.6 4 xxxx

40001, Argument error

Description

The optional argument *arg* has been used more than once in the same routine call.

Recommended actions

- 1) Make sure the optional parameter is not used more than once in the same routine call.

40002, Argument error

Description

The argument *arg* has been specified for more than one parameter.

Recommended actions

The parameter list, from which the parameter is selected, contains parameters mutually exclusive.

- 1) Make sure the argument is used for one parameter only.

40003, Argument error

Description

An argument for the required parameter *arg* was expected, but the optional argument *arg* was found.

Recommended actions

- 1) Make sure all arguments are specified in the same order as the parameters for the routine called.

40004, Argument error

Description

The argument for REF parameter *arg* is not a data reference.

Recommended actions

- 1) Make sure the argument is a data or a parameter reference.

40005, Argument error

Description

The argument for INOUT parameter *arg* is not a variable or persistent reference, or it is read-only.

Recommended actions

- 1) Make sure the argument is a variable or a persistent variable parameter or a persistent parameter reference and that it is NOT read-only.
- 2) Also make sure the argument is NOT written within brackets () .

40006, Argument error

Description

Parameter *arg* is missing an optional argument value.

Recommended actions

The only parameters that may be specified by a name only are "switch" parameters. All others must be assigned a value.

- 1) Make sure parameter has a value.

40007, Argument error

Description

The optional argument *arg* is not found in its correct position in the argument list.

Recommended actions

- 1) Make sure all arguments are specified in the same order as the parameters for the routine called.

40008, Argument error

Description

A reference to the optional parameter *arg* is missing.

Recommended actions

Each optional parameter must have a reference argument, specified with a leading backslash character (\).

- 1) Change the required argument into an optional argument.

40009, Argument error

Description

A reference to the required parameter *arg* in a conditional argument is missing.

Recommended actions

Each conditional value for an optional parameter must refer to an optional parameter in the calling routine.

- 1) Change the conditional value.

40010, Argument error

Description

A reference to the required parameter *arg* in an optional argument is missing.

Recommended actions

Each required parameter must have a reference argument, specified with a leading backslash character (\).

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

- 1) Change the optional argument into a required argument.

40011, Argument error

Description

The required argument *arg* is not found in its correct position in the argument list.

Recommended actions

Make sure all arguments are specified in the same order as the parameters for the routine called.

40012, Argument error

Description

The "switch" argument *arg* has a value.

Probable causes

An argument corresponding to a "switch" parameter may not be assigned a value.

Recommended actions

- 1) Remove the value.

40013, Argument error

Description

The call to routine *arg* has too few arguments.

Recommended actions

A routine call must supply values for all required parameters of the routine being called. The argument list must have as many arguments, as the parameter list has parameters.

- 1) Add more arguments to fit the parameter list.

40014, Argument error

Description

The call to routine *arg* has too many arguments.

Recommended actions

No arguments, more than those defined by the called routine parameter list, must be supplied. The argument list must have as many arguments, as the parameter list has parameters.

- 1) Remove excessive arguments from the argument list.

40015, Data declaration error

Description

The number of array dimensions is *arg*, but may be 1, 2 or 3 only.

Recommended actions

- 1) Change the dimension expression.

Continues on next page

40016, Data declaration error

Description

Too many dimensions in array definition.

Recommended actions

An array may have at most 3 dimensions. Rewrite the program so that no more than 3 dimensions are needed.

40017, Type error

Description

Indexed data *arg*, *arg* is not of array type.

Recommended actions

Only data that have been declared to be arrays may be indexed.

- 1) Remove the index or indices.
- 2) Declare the data to be an array.

40018, Type error

Description

Data *arg*, *arg* is not of record type.

Recommended actions

Components are only available for data of record type.

- 1) Check the type and name of the referenced data.

40019, Limit error

Description

Task *arg*: Error when creating the persistent variable *arg*. The error occurred when the persistent variable was to be inserted into the database.

Program ref: *arg*.

Consequences

The created persistent variable cannot be used in a RAPID program.

Probable causes

The program memory is full or fragmented.

Recommended actions

Check if large data structures could be split into smaller blocks. Use of installed modules can save program memory.

40020, Data declaration error

Description

Expression *arg* is not a constant expression.

Recommended actions

Any expression contained within a data declaration must be a constant expression.

1) Make sure no expression contains variables or persistent references, or function calls.

40021, Instruction error

Description

Missing expression in RETURN instruction.

Probable causes

A RETURN instruction within a function must specify a value to be returned.

Recommended actions

1) Add a value expression.

40022, Type error

Description

Illegal combination of operand types *arg* and *arg* for the '*' operator.

Recommended actions

Allowed operand type combinations are: "num""*""num", "num""*""pos", "pos""*""num", "pos""*""pos" and "orient""*""orient".

1) Check the operand types.

40023, Instruction error

Description

Cannot transfer control into another instruction list.

Recommended actions

It is not possible to jump into a program flow instruction.

1) Make sure that the label is located in the same instruction list as the GOTO instruction, at the same or an outer level.

40024, Type error

Description

Illegal type *arg* for left operand of binary '+' or '-' operator.

Recommended actions

Allowed operand types for the binary "+" operator are "num", "pos" and "string", and for the binary "-" operator "num" and "pos".

1) Check the operand types.

40025, Type error

Description

Illegal type *arg* for operand of unary '+' or '-' operator.

Recommended actions

Allowed operand types for the unary "+" and "-" operators are "num" and "pos".

1) Check the operand types.

40026, Type error

Description

Illegal type *arg* for right operand of binary '+' or '-' operator.

Recommended actions

Allowed operand types for the binary "+" operator are "num", "pos" and "string", and for the binary "-" operator "num" and "pos".

1) Check the operand types.

40027, Type error

Description

Illegal type *arg* for left operand of '/', 'DIV' or 'MOD' operator.

Recommended actions

Allowed operand type for the "/", "DIV" or "MOD" operators is "num".

1) Check the operand types.

40028, Type error

Description

Illegal type *arg* for right operand of '/', 'DIV' or 'MOD' operator.

Recommended actions

Allowed operand type for the "/", "DIV" or "MOD" operators is "num".

1) Check the operand types.

40029, Type error

Description

Illegal type *arg* for left operand of '<', '<=' , '>' or '>=' operator.

Recommended actions

Allowed operand type for the "<", "<=", ">" or ">=" operators is "num".

1) Check the operand types.

40030, Type error

Description

Illegal type *arg* for right operand of '<', '<=' , '>' or '>=' operator.

Recommended actions

Allowed operand type for the "<", "<=", ">" or ">=" operators is "num".

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

1) Check the operand types.

40031, Type error

Description

Illegal type *arg* for left operand of "*" operator.

Recommended actions

Allowed operand types for the "*" operator are "num", "pos" or "orient".

1) Check the operand types.

40032, Type error

Description

Illegal type *arg* for right operand of "*" operator.

Recommended actions

Allowed operand types for the "*" operator are "num", "pos" or "orient".

1) Check the operand types.

40033, Type error

Description

Illegal type *arg* for operand of 'NOT' operator.

Recommended actions

Allowed operand type for the "NOT" operator is "bool".

1) Check the operand types.

40034, Type error

Description

Illegal type *arg* for left operand of 'OR', 'XOR' or 'AND' operator.

Recommended actions

Allowed operand type for the "OR", "XOR" or "AND" operators is "bool".

1) Check the operand types.

40035, Type error

Description

Illegal type *arg* for right operand of 'OR', 'XOR' or 'AND' operator.

Recommended actions

Allowed operand type for the "OR", "XOR" or "AND" operators is "bool".

1) Check the operand types.

40036, Type error

Description

Incorrect number of indices in index list for array *arg* with *arg* dimension(s).

Recommended actions

1) Make sure that the number of indices in the index list corresponds to the number of dimensions of the indexed data array.

40037, Data declaration error

Description

LOCAL illegal in routine constant declaration.

Recommended actions

Only program data declarations may have the LOCAL attribute. Remove the LOCAL attribute or move the declaration outside of the routine.

40038, Data declaration error

Description

LOCAL illegal in routine variable declaration.

Recommended actions

Only program data declarations may have the LOCAL attribute. Remove the LOCAL attribute or move the declaration outside of the routine.

40039, Name error

Description

Constant name *arg* ambiguous.

Recommended actions

Routine data must have names that are unique within the routine. Program data must have names that are unique within the module. Rename the data or change the conflicting name.

40040, Name error

Description

Global constant name *arg* ambiguous.

Recommended actions

Global data must have names that are unique among all the global types, data, global routines and modules in the entire program. Rename the data or change the conflicting name.

Continues on next page

40041, Name error

Description

Global persistent name *arg* ambiguous.

Recommended actions

Global data must have names that are unique among all the global types, data, global routines and modules in the entire program. Rename the data or change the conflicting name.

40042, Name error

Description

Global routine name *arg* ambiguous.

Recommended actions

Global routines must have names that are unique among all the global types, data, global routines and modules in the entire program. Rename the routine or change the conflicting name.

40043, Name error

Description

Global variable name *arg* ambiguous.

Recommended actions

Global data must have names that are unique among all the global types, data, global routines and modules in the entire program. Rename the data or change the conflicting name.

40044, Name error

Description

Label name *arg* ambiguous.

Recommended actions

Labels must have names that are unique within the routine. Rename the label or change the conflicting name.

40045, Name error

Description

Module name *arg* ambiguous.

Recommended actions

Modules must have names that are unique among all the global types, global data, global routines and modules in the entire program. Rename the module or change the conflicting name.

40046, Name error

Description

Parameter name *arg* ambiguous.

Recommended actions

Parameters must have names that are unique within the routine. Rename the parameter or change the conflicting name.

40047, Name error

Description

Persistent name *arg* ambiguous.

Recommended actions

Program data must have names that are unique within the module. Rename the data or change the conflicting name.

40048, Name error

Description

Routine name *arg* ambiguous.

Recommended actions

Routines must have names that are unique within the module. Rename the routine or change the conflicting name.

40049, Name error

Description

Variable name *arg* ambiguous.

Recommended actions

Routine data must have names that are unique within the routine. Program data must have names that are unique within the module. Rename the data or change the conflicting name.

40050, Type error

Description

Operand types *arg* and *arg* for binary '+' or '-' operator not equal.

Recommended actions

The two operands of the '+' and '-' operators must have equal type. Check the operand types.

40051, Type error

Description

Operand types *arg* and *arg* for '=' or '<>' operator not equal.

Recommended actions

The two operands of the '=' and '<>' operators must have equal type. Check the operand types.

40052, Instruction error

Description

RETURN with expression only allowed in function.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

In a procedure or trap the return instruction must not specify a return value expression. Remove the expression.

40054, Type error

Description

Different dimension of array type (*arg*) and aggregate (*arg*)

Recommended actions

Make sure that the number of expressions in the aggregate is the same as the dimension of the data array.

40055, Type error

Description

Assignment target type *arg* is not value or semi-value type.

Recommended actions

The type, of the data to be assigned a value, must be a value or semi-value type. Data of non-value types may only be set by special type specific predefined instructions or functions.

40056, Type error

Description

Type *arg* for left operand of '=' or '<>' operator not value or semi-value type.

Recommended actions

The '=' and '<>' operators may only be applied to expressions of value or semi-value type. If comparisons are to be made, special type specific predefined functions are needed.

40057, Type error

Description

Type *arg* for right operand of '=' or '<>' operator not value or semi-value type.

Recommended actions

The '=' and '<>' operators may only be applied to expressions of value or semi-value type. If comparisons are to be made, special type specific predefined functions are needed.

40058, Type error

Description

TEST expression type *arg* not value or semi-value type.

Recommended actions

The TEST instruction may only be applied to an expression of value or semi-value type. If comparisons are to be made, special type specific predefined functions are needed.

Continues on next page

40059, Data declaration error

Description

Place holder for value expression not allowed in definition of named constant.

Recommended actions

Complete the data declaration or change the data name to a place holder.

40060, Data declaration error

Description

Place holder for array dimension not allowed in definition of named constant or variable.

Recommended actions

Complete the data declaration or change the data name to a place holder.

40061, Routine declaration error

Description

Place holder for parameter array dimensions not allowed in definition of named routine.

Recommended actions

Complete the parameter declaration or change the routine name to a place holder.

40062, Name error

Description

Place holder for parameter name not allowed in definition of named routine.

Recommended actions

Complete the routine declaration or change the routine name to a place holder.

40063, Data declaration error

Description

Place holder for initial value expression not allowed in definition of named persistent.

Recommended actions

Complete the data declaration or change the data name to a place holder.

40064, Routine declaration error

Description

Place holder for parameter not allowed in definition of named routine.

Recommended actions

Complete the parameter declaration, remove the place holder or change the routine name to a place holder.

40065, Reference error

Description

Place holder for type not allowed in definition of named data, record component or routine.

Recommended actions

Complete the data or routine declaration or change the data or routine name to a place holder.

40066, Data declaration error

Description

Place holder for initial value expression not allowed in definition of named variable.

Recommended actions

Complete the data declaration or change the data name to a place holder.

40067, Type error

Description

Too few components in record aggregate of type *arg*.

Recommended actions

Make sure that the number of expressions in the aggregate is the same as the number of components in the record type.

40068, Type error

Description

Too many components in record aggregate of type *arg*.

Recommended actions

Make sure that the number of expressions in the aggregate is the same as the number of components in the record type.

40069, Reference error

Description

Data reference *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred data is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40070, Reference error

Description

Function reference *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred function is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40071, Reference error

Description

Label reference *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred label is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40072, Reference error

Description

Procedure reference *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred procedure is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40073, Reference error

Description

Trap reference *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred trap is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40074, Reference error

Description

arg not entire data reference.

Recommended actions

The specified name identifies an object other than data. Check if the desired data is hidden by some other object with the same name.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40075, Reference error

Description

arg not function reference.

Recommended actions

The specified name identifies an object other than a function. Check if the desired function is hidden by some other object with the same name.

40076, Reference error

Description

arg not label reference.

Recommended actions

The specified name identifies an object other than a label. Check if the desired label is hidden by some other object with the same name.

40077, Reference error

Description

arg not optional parameter reference in conditional argument value.

Recommended actions

The specified name identifies an object other than an optional parameter. Change the name to refer to an optional parameter.

40078, Reference error

Description

arg not optional parameter reference.

Recommended actions

The specified name identifies an object other than an optional parameter. Change the name to refer to an optional parameter.

40079, Reference error

Description

Task *arg*: *arg* is not a procedure reference.

Recommended actions

The specified name identifies an object other than a procedure. Check if the desired procedure is hidden by some other object with the same name.

40080, Reference error

Description

arg not required parameter reference.

Recommended actions

The specified name identifies an object other than a required parameter. Change the name to refer to a required parameter.

40081, Reference error

Description

arg not trap reference.

Recommended actions

The specified name identifies an object other than a trap. Check if the desired trap is hidden by some other object with the same name.

40082, Reference error

Description

arg not type name.

Recommended actions

The specified name identifies an object other than a type. Check if the desired type is hidden by some other object with the same name.

40083, Type error

Description

arg not value type.

Recommended actions

Only variables that lack initial value, and 'VAR' mode parameters may be of semi-value or non-value type.

40086, Reference error

Description

Reference to unknown label *arg*.

Recommended actions

The routine contains no label (or other object) with the specified name.

40087, Reference error

Description

Reference to unknown optional parameter *arg*.

Recommended actions

The called routine contains no optional parameter (or other object) with the specified name.

Continues on next page

40089, Reference error

Description

Reference to unknown record component *arg*.

Recommended actions

The record type contains no record component with the specified name.

40090, Reference error

Description

Reference to unknown required parameter *arg*.

Recommended actions

The called routine contains no required parameter (or other object) with the specified name.

40092, Reference error

Description

Unknown type name *arg*.

Recommended actions

No data type (or other object) with the specified name is visible from this program position.

40093, Instruction error

Description

Assignment target is read only.

Recommended actions

The data to be assigned a value may not be a constant, read only variable or read only persistent.

40094, Data declaration error

Description

Persistent declaration not allowed in routine.

Recommended actions

Persistents may only be declared at module level. Move the persistent declaration from the routine.

40095, Instruction error

Description

RAISE without expression only allowed in error handler.

Recommended actions

Add an error number expression to the RAISE instruction.

40096, Instruction error

Description

RETRY only allowed in error handler.

Recommended actions

The RETRY instruction may only be used in error handlers. Remove it.

40097, Instruction error

Description

TRYNEXT only allowed in error handler.

Recommended actions

The TRYNEXT instruction may only be used in error handlers. Remove it.

40098, Parameter error

Description

'switch' parameter must have transfer mode IN.

Recommended actions

Remove the parameter transfer mode specifier. If IN transfer mode is not sufficient, change the data type of the parameter.

40099, Parameter error

Description

'switch' parameter cannot be dimensioned.

Recommended actions

Remove the array dimension specification, or change the data type of the parameter.

40100, Parameter error

Description

'switch' only allowed for optional parameter.

Recommended actions

Change the parameter into an optional parameter, or change the data type of the parameter. If the object is not a parameter, change the data type.

40101, Type error

Description

Type mismatch of expected type *arg* and found type *arg*.

Recommended actions

The expression is not of the expected data type.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40102, Type error

Description

Type mismatch of aggregate, expected type *arg*.

Recommended actions

The aggregate does not match the expected data type.

40103, Type error

Description

Persistent *arg*, *arg* type mismatch.

Recommended actions

There is already a persistent data with the same name but with another data type. Rename the persistent, or change its data type.

40104, Data declaration error

Description

Cannot determine array dimensions (circular constant references?).

Recommended actions

Check that any referred constants are correctly defined. If so, the program is too complex. Try to rewrite the declarations.

40105, Data declaration error

Description

Cannot determine type of constant value (circular constant references?).

Recommended actions

Check that any referred constants are correctly defined. If so, the program is too complex. Try to rewrite the declarations.

40106, Data declaration error

Description

Cannot evaluate constant value expression (circular constant references?).

Recommended actions

Check that any referred constants are correctly defined. If so, the program is too complex. Try to rewrite the declarations.

40107, Data declaration error

Description

Cannot determine type of variable value (circular constant references?).

Recommended actions

Check that any referred constants are correctly defined. If so, the program is too complex. Try to rewrite the declarations.

40108, Type error

Description

Unknown aggregate type.

Recommended actions

An aggregate may not be used in this position since there is no expected data type. Declare data with the desired data type and aggregate value. Use the name of the data instead of the aggregate.

40109, Type definition error

Description

Cannot determine type of record component *arg* (circular type definitions?).

Recommended actions

Check that the type of the component is correctly defined. If so, it could be a circular definition, the type of a component could not refer to its own record type.

40110, Reference error

Description

Record name *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred record name is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40111, Name error

Description

Global record name *arg* ambiguous.

Recommended actions

Global type must have names that are unique among all the global types, data, global routines and modules in the entire program. Rename the record or change the conflicting name.

40112, Reference error

Description

Alias name *arg* is ambiguous.

Continues on next page

Recommended actions

At least one other object sharing the same name as the referred alias name is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40113, Name error

Description

Global alias name *arg* ambiguous.

Recommended actions

Global type must have names that are unique among all the global types, data, global routines and modules in the entire program. Rename the alias or change the conflicting name.

40114, Type definition error

Description

Type reference of alias name *arg* is an alias type.

Recommended actions

Check that the type of the component is correctly defined. If so, it could be a circular definition. The type of a component could not refer to its own record type.

40115, Type definition error

Description

Cannot determine type of alias *arg* (circular type definitions?).

Recommended actions

Check that the type of the alias is correctly defined. If so, it could be a circular definition, the type of an alias could not refer to a record that use this alias as a component.

40116, Reference error

Description

Record component name *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred component is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40117, Type definition error

Description

Place holder for record component not allowed in definition of named record.

Recommended actions

Complete the definition or change the data name to a place holder.

40119, Reference error

Description

Cannot use the semi-value type *arg* for record components.

Recommended actions

40120, Reference error

Description

Illegal reference to installed task object *arg* from shared object.

Recommended actions

Install the referred object shared, or install the referring Real object/ archive or RAPID module in each task (not shared).

40121, Reference error

Description

Cannot use semi-value type for arrays.

Recommended actions

40122, Reference error

Description

arg not procedure reference.

Recommended actions

The specified name identifies an object other than a procedure. Check if the desired procedure is hidden by some other object with the same name.

40123, Argument error

Description

Argument for 'PERS' parameter *arg* is not a persistent reference or is read only.

Recommended actions

Make sure the argument is just a persistent or persistent parameter reference and that it is writable. Do not use () around the argument.

40124, Argument error

Description

Argument for 'VAR' parameter *arg* is not variable reference or is read only.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Make sure the argument is just a variable or variable parameter reference and that it is writable. Do not use () around the argument.

40125, Instruction error

Description

The Interrupt number is not static variable reference, or it is shared, or it is read only.

Recommended actions

Make sure the interrupt number is just a variable or variable parameter reference. The variable must be static and not shared. The variable may not be read only.

40126, Value error

Description

Integer value *arg* is too large.

Recommended actions

The value of the expression must be an integer value. The current value is outside the integer range.

40127, Value error

Description

arg is not an integer value.

Recommended actions

The value of the expression must be an exact integer value. The current value has a fraction part.

40128, Reference error

Description

Reference to unknown entire data *arg*.

Recommended actions

No data (or other object) with the specified name is visible from this program position.

40129, Reference error

Description

Reference to unknown function *arg*.

Recommended actions

No function (or other object) with the specified name is visible from this program position.

40130, Reference error

Description

Reference to unknown procedure *arg*.

Recommended actions

No procedure (or other object) with the specified name is visible from this program position.

40131, Reference error

Description

Reference to unknown trap *arg*.

Recommended actions

No trap (or other object) with the specified name is visible from this program position.

40135, Syntax error

Description

Expected *arg*.

Recommended actions

40136, Syntax error

Description

Unexpected *arg*.

Recommended actions

40137, Syntax error

Description

Expected *arg* but found *arg*.

Recommended actions

40138, Syntax error

Description

Syntax error, stack backed up.

Recommended actions

40139, Syntax error

Description

Syntax error, parsing terminated.

Continues on next page

Recommended actions**40140, Numerical value for symbol *arg* is out of range****Description**

Numerical value for symbol *arg* is out of range.

Recommended actions

Make the value smaller

40141, String too long**Description**

The string *arg* is too long.

Recommended actions

Make the string shorter.

40142, TxId is out of range**Description**

The Text identifier *arg* is out of range.

Recommended actions**40143, Aggregate is out of range****Description**

The aggregate *arg* is out of range.

Recommended actions

Make the aggregate smaller

40144, Integer out of range**Description**

The integer *arg* is out of range.

Recommended actions

Make the integer smaller.

40145, Parser stack is full**Description**

The parser stack is full.

Recommended actions

Reduce program complexity

40146, Not enough heap space**Description**

There is not enough heap space to fulfill the action.

Recommended actions

Rewrite your program.

40147, Identifier is reserved word in current language**Description**

The identifier *arg* is a reserved word in current language.

Recommended actions

Change the name of the identifier

40148, Identifier too long**Description**

The name of the identifier *arg* is too long.

Recommended actions

Rename the identifier with a shorter name.

40149, Placeholder too long**Description**

The placeholder *arg* is too long.

Recommended actions

Rename the placeholder with a shorter name.

40150, Unexpected unknown token**Description**

Unexpected unknown token.

Recommended actions

Remove the unknown token.

40152, Data declaration error**Description**

TASK illegal in routine variable declaration

Recommended actions

Only program data declarations may have the TASK attribute.

Remove the TASK attribute or move the declaration outside of the routine.

40155, Argument error**Description**

Task *arg*: Argument for 'PERS' parameter *arg* is not persistent reference or is read only.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Make sure the argument is just a persistent or persistent parameter reference and that it is writable. Do not use () around the argument.

40156, Argument error

Description

Task *arg*: Argument for 'VAR' parameter *arg* is not variable reference or is read only.

Recommended actions

Make sure the argument is just a variable or variable parameter reference and that it is writable. Do not use () around the argument.

40157, Instruction error

Description

Task *arg*: Interrupt number is not a static variable reference, is shared, or is read only.

Recommended actions

Make sure the interrupt number is just a variable or variable parameter reference. The variable must be static and not shared. The variable may not be read only.

40158, Value error

Description

Task *arg*: Integer value *arg* too large.

Recommended actions

The value of the expression must be an integer value. The current value is outside the integer range.

40159, Value error

Description

Task *arg*: *arg* not integer value.

Recommended actions

The value of the expression must be an exact integer value. The current value has a fraction part.

40160, Errors in RAPID program

Description

Task *arg*: There are errors in the RAPID program.

Recommended actions

Check for RAPID errors using Check program in the Program editor and correct the program.

40161, Option is missing

Description

The instruction *arg* requires the option *arg*.

Consequences

The program will not execute properly.

Probable causes

The system image doesn't include the required option.

Recommended actions

Update the system image with the required option.

40162, Errors in RAPID program

Description

Task *arg*: There are errors in the RAPID program.

Recommended actions

Take the following actions to be able to debug the program:

- 1) Change the type of the task to NORMAL.
- 2) Restart the controller.
- 3) Check for RAPID errors and correct the program.

40163, Module error

Description

The module *arg* has too many lines to be loaded. Maximum number of lines allowed in a module is *arg*.

Consequences

Module (or program if the module was part of a program) cannot be loaded.

Probable causes

The module has too many lines.

Recommended actions

Split the module in two or several smaller modules.

40165, Reference error

Description

Task *arg*: Reference to unknown entire data *arg*.

Recommended actions

No data (or other object) with the specified name is visible from this program position.

40166, Reference error

Description

Task *arg*: Reference to unknown function *arg*.

Continues on next page

Recommended actions

No function (or other object) with the specified name is visible from this program position.

40168, Reference error**Description**

Task *arg*: Reference to unknown procedure *arg*.

Recommended actions

No procedure (or other object) with the specified name is visible from this program position. To avoid run time errors like this, add code in error handler to handle this. ERRNO will be set to "ERR_REFUNKPRC".

40170, Reference error**Description**

Task *arg*: Reference to unknown trap *arg*.

Recommended actions

No trap (or other object) with the specified name is visible from this program position.

40171, Reference error**Description**

Task *arg*: Reference to unknown data (or other object) found during execution of module *arg*.

Recommended actions

Check the program for unresolved references.

40172, Reference error**Description**

Task *arg*: Reference to unknown module *arg*.

Recommended actions

No module (or other object) with the specified name is visible from this program position. Check the program for incorrect module reference or if the module is missing.

40173, Reference error**Description**

Task *arg*: Reference to object *arg* that is not a module.

Recommended actions

The specified name identifies an object other than a module. Check the program for incorrect module reference.

40174, Reference error**Description**

Task *arg*: Reference to module *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred module is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40175, Reference error**Description**

Task *arg*: Reference to procedure *arg* is ambiguous.

Recommended actions

At least one other object sharing the same name as the referred procedure is visible from this program position. Make sure that all object names fulfill the naming rules regarding uniqueness.

40191, Instruction error**Description**

Task *arg*: Variable and trap routine already connected.

Recommended actions

It is not legal to connect a specific variable with a trap routine more than once.

40192, Argument error**Description**

Task *arg*: *arg* is second present conditional argument for excluding parameters.

Recommended actions

Arguments may not be present for more than one parameter from a list of parameters that exclude each other.

40193, Execution error**Description**

Task *arg*: Late binding procedure call error *arg*.

Recommended actions

There is an error in the procedure call instruction. See previous message for the actual cause.

40194, Value error**Description**

Task *arg*: Division by zero.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Cannot divide by 0. Rewrite the program so that the divide operation is not executed when the divisor is 0.

40195, Limit error

Description

Task *arg*: The configured maximum number of RETRYs (*arg* retries) is exceeded.

Recommended actions

The error correction performed before the RETRY instruction is executed, is probably not enough to cure the error. Check the error handler.

40196, Instruction error

Description

Task *arg*: Attempt to execute place holder.

Recommended actions

Remove the place holder or the instruction containing it, or make the instruction complete. Then continue execution.

40197, Execution error

Description

Task *arg*: Function does not return any value.

Program ref: *arg*.

Recommended actions

The end of the function has been reached without a RETURN instruction being executed. Add a RETURN instruction specifying a function return value.

40198, Value error

Description

Task *arg*: Illegal orientation value *arg*.

Recommended actions

Attempt to use illegal orientation (quaternion) value.

40199, Value error

Description

Task *arg*: Illegal error number *arg* in *arg*.

Recommended actions

Use error numbers in the range 1-90 or book error numbers with the instruction BookErrNo.

40200, Limit error

Description

Task *arg*: No more interrupt number available.

Recommended actions

There is a limited number of interrupt numbers available. Rewrite the program to use fewer interrupt numbers. This message may also occur as a consequence of a system error.

40202, Type error

Description

Task *arg*: Dimensions *arg* and *arg* of conformant array dimension number *arg* are incompatible.

Recommended actions

The array is not of the expected size. Array assignment may only be performed on arrays of identical size.

40203, Reference error

Description

Task *arg*: Optional parameter *arg* not present.

Recommended actions

The value of a non-present optional parameter may not be referred. Use the predefined function 'Present' to check the presence of the parameter before using its value.

40204, Value error

Description

Task *arg*: Array index *arg* for dimension number *arg* out of bounds (1-*arg*).

Recommended actions

The array index value is non-positive or violates the declared size of the array.

40205, Value error

Description

Task *arg*: RAPID String *arg* too long.

Recommended actions

String value exceeds the maximum allowed length. Rewrite the program to use strings of less length.

40206, Interrupt queue full

Description

Execution of all normal tasks has stopped. Too many interrupts has occurred in *arg* while executing a trap routine.

Continues on next page

Consequences

The system goes to blocked state and cannot be restarted before moving the program pointer to an arbitrary position.

Probable causes

Too many interrupts has occurred while executing a trap routine. This can be caused by heavy CPU load.

Recommended actions

- 1) Minimize execution time in the trap routine.
- 2) Disable/enable interrupts while executing a trap routine using the Isleep or Iwatch commands.

40207, Value error**Description**

Task *arg*: Illegal error number *arg* in *arg*.

Recommended actions

Error numbers used in an ERROR handler must be positive.

40208, Error event queue full**Description**

Task *arg*: The program was already executing an error event when a new event occurred.

Recommended actions

Attend the cause of the error event and restart the program.

40209, Error context already consumed**Description**

An error event in task *arg* has occurred. The context of the RAPID instruction that has generated this event is however already consumed. No error handling is therefore possible to execute.

Recommended actions

Attend the cause of the error event and restart the program.

40210, Interrupt removed from queue**Description**

All interrupts have been deleted from the interrupt queue in task *arg*.

Consequences

No trap routines, connected with the interrupt, may be executed.

Probable causes

- The program has been stopped.
- A service routine or an event routine may be executing.
- The program is executing in step mode.

Recommended actions

40221, Execution error**Description**

Task *arg*: Execution aborted.

Recommended actions

Execution was aborted due to a fatal error.

40222, Limit error**Description**

Task *arg*: Execution stack overflow.

Recommended actions

The program is too complex to execute. Probably the program contains recursive routines.

40223, Execution error**Description**

The execution of task *arg* has been stopped by a runtime error.

Consequences

The program execution is immediately halted.

Probable causes

The program error is considered UNRECOVERABLE so no error recovery attempt by an error handler routine (if used) was allowed. The actual cause of the error may vary, and is likely to be specified in an event log message logged simultaneously as this one.

Recommended actions

- 1) Check other event log messages logged simultaneously to determine the actual cause.

40224, Execution error**Description**

Task *arg*: Illegal return code *arg* from ReaL routine This is always caused by an internal error in the ReaL routine.

Recommended actions

40225, Execution error**Description**

Task *arg*: Execution could not be restarted Execution of the program could not be continued after power failure.

Recommended actions

Restart the program.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40226, Name error

Description

Task *arg*: Procedure name *arg* is not a RAPID identifier excluding reserved words.

Recommended actions

The procedure name, must be a legal RAPID identifier not equal to any of the reserved words of the RAPID language. Change the name expression.

40227, Limit error

Description

Task *arg*: Runtime stack overflow The program is too complex to execute. Probably the program contains recursive routines.

Recommended actions

40228, Execution error

Description

The execution of task *arg* has been stopped by a runtime error *arg*.

Consequences

The program execution is immediately halted.

Probable causes

The program error is considered RECOVERABLE but the error was not recovered. The actual cause of the error may vary, and is likely to be specified in an event log message logged simultaneously as this one.

Recommended actions

1) Check other event log messages logged simultaneously to determine the actual cause.

40229, Execution error

Description

Task *arg*: Unhandled error.

Recommended actions

An error occurred in called instruction but was not handled by any ERROR clause in the program. Check the previous error or warning in the common log for the cause.

40230, Execution error

Description

Task *arg*: Unhandled non-fatal runtime error.

Recommended actions

A non-fatal runtime error has occurred but was not handled by any ERROR clause.

40241, Value error

Description

Task *arg*: Array dimension number *arg* out of range (1-*arg*).

Recommended actions

The value of the 'DimNo' parameter of the 'Dim' function must be an integer value in the specified range.

40242, Type error

Description

Task *arg*: Data is not an array.

Recommended actions

The 'DatObj' parameter of the 'Dim' function must be an array.

40243, Value error

Description

Task *arg*: Unknown interrupt number.

Recommended actions

Check that the specified interrupt variable has been initialized by CONNECT, and that the interrupt has been defined using the ISignalDI or other interrupt definition instruction.

40244, Value error

Description

Task *arg*: Object *arg* is of non-value type.

Recommended actions

Use expression or data object of value or semi-value type.

40245, Parameter error

Description

Parameters in *arg* and *arg* is not matching (late binding).

Recommended actions

Make sure that all procedures that are called from the same late binding node have matching parameters. I.e. they should be matching concerning base type, mode and required/optional parameters.

Continues on next page

40246, Cannot Deactivate Safe Interrupt**Description**

Task: *arg*: It is not possible to deactivate a Safe Interrupt with the instruction ISleep.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40247, Persistent variable size error**Description**

Persistent variable *arg*: has changed size and must be reinitialized.

Recommended actions

Reload all modules in all tasks accessing the persistent variable.

40251, Name error**Description**

Task *arg*: Ambiguous symbol name *arg*.

Recommended actions

Installed objects must have names that are unique. Rename the object or change the conflicting name.

40252, Limit error**Description**

Task *arg*: Error *arg* when creating sdb entry for *arg*.

Recommended actions

An error occurred when the persistent was to be inserted into the shared database. Probably the database is full.

40253, Type definition error**Description**

Task *arg*: Alias *arg* of alias *arg* not allowed.

Recommended actions

It is not possible to define an alias type equal to another alias type. Instead, define two alias types equal to the same atomic or record type.

40254, Symbol definition error**Description**

Task *arg*: 'ANYTYPE#' parameter *arg* cannot be dimensioned.

Recommended actions

Remove the dimension specification. 'ANYTYPE#' includes array types.

40255, Symbol definition error**Description**

Task *arg*: 'ANYTYPE#' only allowed for parameter (not for *arg*).

Recommended actions

Use another type.

40256, Parameter error**Description**

Task *arg*: 'alt' must not be set for first optional parameter *arg* in alternatives list.

Recommended actions

Make sure that only the second and following in each list of excluding optional parameters are marked as alternatives.

40257, Parameter error**Description**

Task *arg*: REF mode parameter *arg* cannot be dimensioned.

Recommended actions

Remove the array dimension specification, or change the mode of the parameter.

40258, Parameter error**Description**

Task *arg*: 'switch' parameter *arg* cannot be dimensioned.

Recommended actions

Remove the array dimension specification, or change the data type of the parameter.

40259, Parameter error**Description**

Task *arg*: 'switch' parameter *arg* must have transfer mode IN (specified value *arg*).

Recommended actions

Remove the parameter transfer mode specifier. If IN transfer mode is not sufficient, change the data type of the parameter.

40260, Symbol definition error**Description**

Task *arg*: 'switch' only allowed for optional parameter (not for *arg*).

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Change the parameter into an optional parameter, or change the data type of the parameter. If the object is not a parameter, change the data type.

40261, Type definition error

Description

Task *arg*: Value type class for *arg* must be one of REAL_SYMVALTYP_VAL, _SEMIVAL, _NONVAL or _NONE (specified value *arg*).

Recommended actions

Change the value type class.

40262, Data declaration error

Description

Task *arg*: Too many array dimensions for *arg* (specified value *arg*).

Recommended actions

An array may have at most 3 dimensions.

40263, Name error

Description

Task *arg*: Symbol name *arg* is not a RAPID identifier excluding reserved words.

Recommended actions

The names of installed objects, including parameters and components, must be legal RAPID identifiers not equal to any of the reserved words of the RAPID language. Change the name.

40264, Symbol definition error

Description

Task *arg*: Missing C function for *arg*.

Recommended actions

A C-function that executes the Real function being defined, must be specified.

40265, Symbol definition error

Description

Task *arg*: Missing value initialization function for *arg*.

Recommended actions

A value initialization function must be specified.

40266, Reference error

Description

Task *arg*: *arg* is not a data type name (object *arg*). The specified name identifies an object other than a type.

Recommended actions

40267, Reference error

Description

Task *arg*: *arg* is not a value data type (object *arg*). Only record components, alias types, variables and 'VAR' mode parameters may be of semi-value or non-value type.

Recommended actions

40268, Symbol definition error

Description

Task *arg*: Missing value conversion function for *arg*.

Recommended actions

A value conversion function must be specified for a semi-value type.

40269, Symbol definition error

Description

Task *arg*: Not enough memory for value of data *arg*.

Recommended actions

More memory required.

40270, Type definition error

Description

Task *arg*: Private type *arg* can only be semi-value or non-value type (specified value *arg*).

Recommended actions

Change the value type class.

40271, Type definition error

Description

Task *arg*: Private type *arg* size must be multiple of 4 (specified value *arg*).

Recommended actions

All RAPID types must have a size that is a multiple of four.

Change the specified type size.

Continues on next page

40272, Type error

Description

Task *arg*: Persistent type mismatch for *arg*.

Recommended actions

There is already a persistent data with the same name but with another data type. Rename the persistent, or change its data type.

40273, Reference error

Description

Task *arg*: Unknown data type name *arg* for *arg*.

Recommended actions

There is no data type (or other object) with the specified name.

40274, Parameter error

Description

Task *arg*: Unknown parameter transfer mode *arg* for *arg*.

Recommended actions

The specified parameter transfer mode is not one of IN, 'VAR', 'PERS', 'INOUT' or REF. Use corresponding REAL_SYMPARMOD_x.

40275, Symbol definition error

Description

Task *arg*: Unknown symbol definition type *arg* The symbol definition type tag does not specify one of the allowed symbol types (REAL_SYMDEF_x).

Recommended actions

40277, Undo Aborted

Description

Task *arg*: The program execution was stopped while processing the UNDO statements. UNDO was not fully executed. The routine *arg* was executing when UNDO was stopped.

Recommended actions

If the processing of UNDO takes too long, try to remove time-consuming instructions such as TPWrite from the UNDO-clause. If the undo processing never seems to finish, make sure any loops in the undo-statements are correct.

40278, Undo Aborted

Description

Task *arg*: The processing of UNDO was aborted due to an EXIT-statement in the routine *arg*. UNDO was not fully executed.

Recommended actions

40279, Undo Aborted

Description

Task *arg*: The processing of UNDO was aborted due to a run-time error in routine *arg*. UNDO was not fully executed.

Recommended actions

Investigate the cause of the error.

40280, Undo Aborted

Description

Task *arg*: The instructions BREAK, RAISE, RETURN and STOP are not allowed to use in an undo-clause or any routine that is called from an undo-clause. The instruction *arg* was found in UNDO context when executing the routine *arg*.

Recommended actions

Avoid executing the instruction when in undo-context.

40281, Undo Aborted

Description

Task *arg*: The program execution of UNDO statements was aborted due to edit operation.

40301, File access error

Description

Task *arg* is trying to access file *arg*, but failing.

Consequences

No data in the file may be accessed.

Probable causes

File may be write protected.

Recommended actions

- 1) Check if the file is write protected, and in such case change the setting.

40302, File access error

Description

Task *arg* is trying to access file *arg*, but does not find file or directory.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Consequences

If the missing file is a module, no automatic loading to a task is possible.

Probable causes

- File may not have been correctly copied to the target directory.
- File or directory may have incorrect name.

Recommended actions

- 1) Make sure the file and directory names are correct.

40303, File access error

Description

Task *arg* is trying to access file *arg*, but failing.

Consequences

No data in the file may be accessed.

Probable causes

No storage space available on device.

Recommended actions

- 1) Make sure there is enough storage space available.

40304, File access error

Description

Task *arg* is trying to access file *arg*, but failing.

Consequences

No data in the file may be accessed.

Probable causes

- File may be write protected.
- File or directory may have incorrect name.
- No storage space available on device.

Recommended actions

- 1) Check if the file is write protected, and in such case change the setting.
- 2) Make sure the file and directory names are correct.
- 3) Make sure there is enough storage space available.

40322, Load error

Description

Task *arg*: RAPID syntax error(s) in file *arg*.

Recommended actions

The source file to be loaded contains RAPID syntax errors. Correct the source file.

40323, Load error

Description

Task *arg*: Syntax error(s) in header in file *arg*.

Recommended actions

The source file to be loaded contains syntax error in the file header. Correct the source file. The syntax errors are logged in a separate file.

40324, Load error

Description

Task *arg*: Keywords not defined in specified language (file *arg*).

Recommended actions

Cannot load RAPID source code in the national language specified in the file header.

40325, Load error

Description

Task *arg*: A big enough free program memory block is not available. The ordered operation could not be completed.

Probable causes

The program memory is full or fragmented.

Recommended actions

Check if large data structures could be split into smaller blocks. Use of installed modules can save program memory.

40326, Load error

Description

Task *arg*: Parser stack full (file *arg*).

Recommended actions

The program is too complex to load.

40327, Load error

Description

Task *arg*: Not current RAPID version (file *arg*).

Recommended actions

Cannot load RAPID source code of the version specified in the file header.

40328, Load error

Description

Task: *arg*.

Program memory is full. *arg*.

Continues on next page

Recommended actions

The module *arg* could not be loaded because the program memory is full.

Recovery: *arg*.

40329, Module installation failure

Description

Task: *arg*.

It is not possible to install a module from file *arg*.

Consequences

The module will not be installed.

Probable causes

There can be several different reasons.

- 1) The RAPID module may have RAPID errors.
- 2) The file might not exist.

Recommended actions

- 1) Check the event messages in the Elog domain RAPID.

Correct the RAPID errors and Reset RAPID.

- 2) Or make sure the correct file is available to load. Reset RAPID.

40330, RAPID errors in installed module

Description

Task: *arg*. Module (line/column): *arg* There is an error with symbol: *arg*.

Consequences

The module will not be installed.

40331, Type error

Description

Operand types *arg* and *arg* for the '/', 'DIV' or 'MOD' operator not equal.

Recommended actions

The two operands of the '/', 'DIV' or 'MOD' operators must have equal type. Check the operand types.

40332, Type error

Description

Operand types *arg* and *arg* for the '<', '<=' or '>' or '>=' operator not equal.

Recommended actions

The two operands of the '<', '<=' or '>' or '>=' operators must have equal type. Check the operand types.

40351, Memory allocation error

Description

Task *arg*: Failed to allocate hash table, use linear list.

Recommended actions

40352, Memory allocation error

Description

Task *arg*: Failed to update persistent expression, keep old one.

Recommended actions

40353, Mechanical Unit *arg* Missing!

Description

The mechanical unit component of the workobject *arg* is faulty.

Probable causes

- No mechanical unit is defined.
- The mechanical unit defined cannot be found.
- The robot cannot move the workobject by itself.

Recommended actions

Check the mechanical unit component of the workobject.

40354, A copy of a dynamic loaded module has been saved

Description

Task: *arg*.

A dynamic loaded module *arg* has been changed. The module is lost when PP is set to main. A copy of the changed module is saved on *arg*.

Probable causes

- A dynamic loaded module has been changed.
- PP is set to main.
- The dynamic loaded module is removed.
- A copy of the changed module is saved.

Recommended actions

If the changes shall be saved, replace the original file with the copy.

40355, A Stop/QStop event routine has been stopped

Description

Task: *arg*.

A *arg* event routine has been stopped by an external stop command. Any running Stop/QStop event routines will be

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

stopped after *arg* ms when controller receives second stop command.

Recommended actions

Keep all event routines short and free from RAPID instructions of type WaitTime, WaitDI, etc.

40357, Missing Error Handler

Description

There is no error handler that deals with the process error for task *arg*.

Consequences

The program will not be able to execute past the next move instruction.

Probable causes

The error handler is missing.

Recommended actions

Add an error handler. The error handler should include the StartMove (StartMoveRetry) instruction.

40358, RMQ message discarded

Description

A RMQ message was discarded in task *arg*. *arg* received a RMQ message that couldn't be handled.

Consequences

The RMQ message was discarded without any notification to the sender.

Probable causes

There can be several different reasons.

- 1) No interrupt is connected to the type of the received message.
- 2) No interrupt could be created because the interrupt queue was full.
- 3) The received message was corrupt.

Recommended actions

Make sure that the task has connected an interrupt to all types of messages that is possible to receive. Read about IRMQMessage in the RAPID reference manual.

40359, An event routine has been stopped

Description

Task: *arg*.

A *arg* event routine has been stopped by an external stop command.

Recommended actions

Keep all event routines short and free from RAPID instructions of type WaitTime, WaitDI, etc.

40502, Digital Input Break

Description

Task: *arg*.

A digital input interrupted the execution.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40504, Parameter error

Description

Task: *arg*

arg

arg

arg.

Recommended actions

Recovery: *arg*.

40506, System Access Error

Description

Task: *arg*.

arg

arg

arg.

Recommended actions

Recovery: *arg*.

40507, Limit Error

Description

Task: *arg*.

Cannot step further back on path *arg*.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40508, Orientation Value Error

Description

Task: *arg*.

Wrong orientation value in *arg*.

Program ref: *arg*.

Continues on next page

Recommended actions

All used orientations must be normalized, i.e. the sum of the quaternion elements squares must equal 1.

40511, Parameter Error**Description**

Task: *arg*.

The parameter *arg* in *arg* is specified with a negative value.

Program ref: *arg*.

Recommended actions

The parameter must be set to a positive value.

40512, Missing External Axis Value**Description**

Some active external axis have incorrect or no order value.

Recommended actions

Reprogram the position.

40513, Mechanical Unit Error**Description**

Task: *arg*.

Not possible to activate or deactivate mechanical unit. Previous message may contain more information.

Program ref: *arg*.

40514, Execution Error**Description**

Task: *arg*.

The robot is too far from path to perform StartMove of the interrupted movement.

Program ref: *arg*.

Recommended actions

Position the robot to the interrupted position in the program.

Recovery: *arg*.

40515, Type Error**Description**

Task: *arg*.

Illegal data type of argument for parameter *arg*.

Recommended actions

Change the parameter to a legal type. Make sure the value type is value or semi-value.

40518, Type Error**Description**

Task: *arg*.

Expected type differs from read type in *arg*.

Program ref: *arg*.

Recommended actions

Check the type in the argument.

40519, End Of File**Description**

Task: *arg*.

End of file was found before all bytes were read in *arg*.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40522, Limit Error**Description**

Task: *arg*.

Stop watch overflow.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40523, Mechanical Unit Conflict**Description**

Not possible to activate mechanical unit *arg* since mechanical unit *arg* is already active.

Recommended actions

Check the Motion Configuration. Active mechanical units cannot have the same *arg*:

- 1) Physical Axis
- 2) Logical Axis
- 3) Drive Unit Configuration.

40524, Conveyor Access Error**Description**

Task: *arg*.

The conveyor is not activated.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40525, Conveyor Access Error

Description

Task: *arg.*

No single number defined.

Program ref: *arg.*

- The maximum number of simultaneously opened files is exceeded.

- The disk is full.

Recommended actions

- Check the path or filename.
- If the I/O device reference is already in use, close it or use another.
- Check the disk space.

Recovery: *arg.*

40526, Conveyor Access Error

Description

Task: *arg.*

The mechanical unit *arg* is not a single.

Program ref: *arg.*

40530, Parameter Error

Description

Task: *arg.*

The number of characters, parameter *arg* in WriteBin, you want to write to the serial channel is greater than the size of the array containing the characters to be written.

Program ref: *arg.*

Recommended actions

Make the array bigger or decrease the parameter.

40527, File Access Error

Description

Task: *arg.*

Unable to open *arg*.

Program ref: *arg.*

Probable causes

- The I/O device reference is already in use.

Recommended actions

- If the I/O device reference is already in use, close it or use another.

Recovery: *arg.*

40531, Parameter Error

Description

Task: *arg.*

The array *arg* in WriteBin is smaller than 0 or greater than 255.

Program ref: *arg.*

Recommended actions

Change the size of the array to be 0 - 255.

40528, File Access Error

Description

Task: *arg.*

File or serial channel is not open.

Program ref: *arg.*

Probable causes

- The I/O device reference is not open, or has already been closed

Recommended actions

- Check that device is open.

Recovery: *arg.*

40534, Timeout

Description

Task: *arg.*

A timeout interrupted the execution.

Program ref: *arg.*

Recommended actions

Recovery: *arg.*

40529, File Access Error

Description

Task: *arg.*

Could not access the file *arg*.

Program ref: *arg.*

Description

Task: *arg.*

The data you was trying to read in the file was not a numeric type.

Program ref: *arg.*

Recommended actions

Recovery: *arg.*

Continues on next page

40536, System Access Error

Description

Task: *arg*.

Too many pending read requests.

Program ref: *arg*.

Directory *arg* is not accessible.

Program ref: *arg*.

Recommended actions

Check the directory you are trying to open.

Recovery: *arg*.

40537, File Access Error

Description

Task: *arg*.

The serial channel is not open, or you are trying to use the instruction on a file.

Program ref: *arg*.

Recommended actions

- Open the serial channel.

- Check that the instruction is used on a serial channel.

Recovery: *arg*.

40542, File Access Error

Description

Task: *arg*.

Could not access the file system *arg*.

Program ref: *arg*.

Recommended actions

- Check the path and filename.

Recovery: *arg*.

40538, Max Time Expired

Description

Task: *arg*.

The programmed waiting time has expired.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40543, File Access Error

Description

Task: *arg*.

You cannot open *arg*.

Program ref: *arg*.

Probable causes

There are too many directories already open.

Recommended actions

Close one of the already open directories.

Recovery: *arg*.

40539, System Access Error

Description

Task: *arg*.

Not allowed option in this task.

Program ref: *arg*.

40544, File Access Error

Description

Task: *arg*.

Could not create the directory *arg*.

Program ref: *arg*.

Recommended actions

- Check the path.
- Check write and execute permission for the directory under which the new directory should be created.

Recovery: *arg*.

40540, File Access Error

Description

Task: *arg*.

arg is not a directory.

Program ref: *arg*.

Recommended actions

Check that the path is the correct path to the directory you want to open.

Recovery: *arg*.

40545, File Access Error

Description

Task: *arg*.

Could not remove the directory *arg*.

Program ref: *arg*.

Recommended actions

- Check the path.

40541, File Access Error

Description

Task: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

- Check write and execute permission for the directory under which the directory you want to remove is located.

Recovery: *arg.*

Program ref: *arg.*

Probable causes

Data of type *mecunit* has been declared in the program.

Recommended actions

Remove the declaration of *mecunit* data in the program and use one of the predefined data of type *mecunit* (automatic defined by the system).

40546, File Access Error

Description

Task: *arg.*

Could not remove the file *arg.*

Program ref: *arg.*

Recommended actions

- Check the path.
- Check if you have write permission for the file.
- Check write and execute permission for the directory under which the file you want to remove is located.

Recovery: *arg.*

40555, I/O Error

Description

Task: *arg.*

Unable to read I/O signal.

Program ref: *arg.*

40547, File Access Error

Description

Task: *arg.*

Could not rename the file *arg.*

Program ref: *arg.*

Recommended actions

- Check the path.
- Check write permission for the file you want to rename.
- Check write and execute permission for the directory under which the file you want to rename is located.

Recovery: *arg.*

40556, I/O Error

Description

Task: *arg.*

Unable to write I/O signal.

Program ref: *arg.*

40557, I/O Error

Description

Task: *arg.*

Configuration error for I/O signal.

Program ref: *arg.*

Recommended actions

Check the I/O signal configuration or alias definition.

40548, File Access Error

Description

Task: *arg.*

Could not copy the file *arg.*

Program ref: *arg.*

Recommended actions

- Check the path.
- Check write permission for the directory that you want to copy the file to.
- Check the available space.

Recovery: *arg.*

40558, I/O Error

Description

Task: *arg.*

Unable to read the I/O signal *arg* in I/O device *arg*.

Program ref: *arg.*

40559, I/O Error

Description

Task: *arg.*

Unable to write to the I/O signal *arg* in I/O device *arg*.

Program ref: *arg.*

40549, System Access Error

Description

Task: *arg.*

Unknown mechanical unit *arg*. The data of type *mecunit* is unknown for the system.

40560, System Access Error

Description

Task: *arg.*

Can't save program module *arg*.

Continues on next page

Program ref: *arg.*

40561, System Access Error

Description

Task: *arg.*

arg is not a module name.

Program ref: *arg.*

Consequences

You cannot unload, save or erase this module.

Recommended actions

Check the name of the module.

Program ref: *arg.*

Recommended actions

Check the value of the arguments.

40566, Parameter Error

Description

Task: *arg.*

All arguments must be $> arg$ and $<= arg$.

Program ref: *arg.*

Recommended actions

Check the value of the arguments.

40562, Parameter Error

Description

Task: *arg.*

Unknown axis number for the mechanical unit *arg*.

Program ref: *arg.*

Recommended actions

Check the value for argument AxisNo.

Recovery: *arg.*

40567, Parameter Error

Description

Task: *arg.*

Quaternion error.

Program ref: *arg.*

Recommended actions

Check the aom component of loaddata.

40563, System Access Error

Description

Task: *arg.*

Mechanical unit *arg* is not active.

Program ref: *arg.*

Recommended actions

Activate the mechanical unit.

Recovery: *arg.*

40568, Parameter Error

Description

Task: *arg.*

Axis may not have a value less than 0.

Program ref: *arg.*

Recommended actions

Change to a positive value.

40564, Argument Error

Description

Task: *arg.*

Orientation definition error. GripLoads attach frame in tool or work object (user + object) is unnormalized.

Program ref: *arg.*

Recommended actions

Check the orientation. All used orientations must be normalized i.e. the sum of the quaternion elements squares must equal 1.

40569, Argument Error

Description

Task: *arg.*

The argument AccMax must be set if the argument AccLim is set to TRUE.

Program ref: *arg.*

Recommended actions

Set a value to argument AccMax.

40570, Argument Error

Description

Task: *arg.*

The argument DecelMax must be set if argument DecelLim is set to TRUE.

Program ref: *arg.*

40565, Parameter Error

Description

Task: *arg.*

Both arguments must be > 0 .

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Set a value to argument DecelMax.

40571, Argument Error

Description

Task: *arg*.

The value of parameter AccMax is too low.

Program ref: *arg*.

Recommended actions

Increase the value of parameter AccMax.

Recovery: *arg*.

40572, Argument Error

Description

Task: *arg*.

The value of parameter DecelMax is too low.

Program ref: *arg*.

Recommended actions

Increase the value of parameter DecelMax.

Recovery: *arg*.

40573, Argument Error

Description

Task: *arg*.

The value of argument On is too low.

Program ref: *arg*.

Recommended actions

Increase the value of argument On.

Recovery: *arg*.

40574, Search Warning

Description

Task: *arg*.

Number of hits during search was *arg*. Before performing next search, make sure that TCP is moved back to the start position of the search path.

Program ref: *arg*.

Consequences

If no repositioning is done, before restart of circular search, movement that can cause damage might occur.

Recommended actions

Recovery: *arg*.

40576, ParId Error

Description

Task: *arg*.

The array size of argument AxValid is not equal to number of axes.

Program ref: *arg*.

Recommended actions

Check the size of the array.

40577, ParId Error

Description

Task: *arg*.

Function ParIdRobValid needs to be executed before function ParIdPosValid.

Program ref: *arg*.

Probable causes

Function ParIdRobValid needs to be executed before function ParIdPosValid.

Recommended actions

Check that function ParIdRobValid has been executed before ParIdPosValid.

40578, ParId Error

Description

Task: *arg*.

The optional argument PayLoad is missing. For PayLoad identification the argument must be given.

Program ref: *arg*.

Recommended actions

Give a value to the argument PayLoad.

40579, ParId Error

Description

Task: *arg*.

The optional argument PayLoad may only be used for PayLoad identification.

Program ref: *arg*.

Recommended actions

Remove the argument PayLoad.

40580, ParId Error

Description

Task: *arg*.

Faulty state for LoadldInit.

Continues on next page

Program ref: *arg.*

Recommended actions

Check the whole ParId sequence.

40581, ParId Error**Description**

Task: *arg.*

Faulty state for ParIdMoveSeq.

Program ref: *arg.*

Recommended actions

Check the whole ParId sequence.

40582, ParId Error**Description**

Task: *arg.*

Faulty state for LoadIdInit.

Program ref: *arg.*

Recommended actions

Check the whole ParId sequence.

40583, ParId Error**Description**

Task: *arg.*

Backward execution not allowed.

Program ref: *arg.*

40584, ParId Error**Description**

Task: *arg.*

ParIdMoveSeq / Parameter NextMove: Faulty array size.

Program ref: *arg.*

Recommended actions

Check the size of the array.

40585, ParId Error**Description**

Task: *arg.*

Missed argument WObj in LoadId for PayLoad with roomfix TCP.

Program ref: *arg.*

Recommended actions

Add argument WObj.

40586, ParId Error**Description**

Task: *arg.*

Not allowed argument WObj. The argument is only to be used for PayLoad with roomfix TCP.

Program ref: *arg.*

Recommended actions

Remove argument WObj.

40587, ParId error**Description**

Task: *arg.*

ParIdMoveSeq / Parameter MoveData: Faulty array size.

Program ref: *arg.*

Recommended actions

Check the size of the array.

40588, ParId Error**Description**

Task: *arg.*

ParIdMove / Parameter StartIndex: Faulty StartIndex.

Program ref: *arg.*

Recommended actions

Check the StartIndex.

40589, ParId Error**Description**

Task: *arg.*

ParIdMove / Parameter StartIndex: Point at negative move type.

Program ref: *arg.*

40590, ParId error**Description**

arg

arg.

Recommended actions

arg.

40591, Argument Error**Description**

Task: *arg.*

Unknown type of parameter identification.

Program ref: *arg.*

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Check the argument ParIdType.

Any type of program stop during load identification is not allowed.

Program ref: *arg.*

40592, Program Stop During Load Identification

Description

Task: *arg.*

No type of program stop is allowed during load identification.

Program ref: *arg.*

Recommended actions

Restart the program execution again for load identification from beginning.

40597, Speed Override

Description

Task: *arg.*

Speed override is not 100 percent.

Program ref: *arg.*

Recommended actions

- Change the speed override to 100.
- Restart the program execution again for load identification from beginning.

40598, Program Stop during Load Identification

Description

No type of Program Stop is allowed during the Load Identification movements.

Consequences

It is not possible to complete the Load Identification sequence. Note that some axes for the actual mechanical unit are now in independent mode.

Probable causes

Interrupt of the Load Identification sequence with Program Stop or release of the Enable Device.

Recommended actions

- 1) Restart the program. It will then be possible to return to the Load Identification start position. Then the movement sequence can be started again.
- 2) Also possible to cancel the Service Routine to completely skip the Load Identification.

40599, Program Stop during Load Identification

Description

No type of Program Stop is allowed during the Load Identification movements.

Consequences

It is not possible to complete the Load Identification sequence. Note that some axes for the actual mechanical unit are now in independent mode.

40594, User Error During Load Identification

Description

Task: *arg.*

Error resulting in raise of PP to the beginning of the load identification procedure.

Program ref: *arg.*

Recommended actions

Start the identification procedure from the beginning again.

Recovery: *arg.*

Recommended actions

- 1) Restart the program. It will then be possible to return to the Load Identification start position. Then the movement sequence can be started again.
- 2) Also possible to cancel the Service Routine to completely skip the Load Identification.

40595, Argument Error

Description

Task: *arg.*

Unknown type of load identification.

Program ref: *arg.*

Recommended actions

Check the argument LoadIdType.

Description

No type of Program Stop is allowed during the Load Identification movements.

Consequences

It is not possible to complete the Load Identification sequence. Note that some axes for the actual mechanical unit are now in independent mode.

40596, Program Stop During Load Identification

Description

Task: *arg.*

Continues on next page

Probable causes

A program stop caused errors in the measurements, and this was detected when restarting the Load Identification movements.

Recommended actions

- 1) Restart the program. It will then be possible to return to the Load Identification start position. Then the movement sequence can be started again.
- 2) Also possible to cancel the Service Routine to completely skip the Load Identification.

40603, Argument Error**Description**

Argument *arg* may not have a negative value.

Recommended actions

Set argument *arg* to a positive value.

40607, Execution Error**Description**

Task: *arg*.

Not allowed to change run mode from forward to backward or vice versa when running a circular movement.

Program ref: *arg*.

Recommended actions

If possible, select the original run mode and press start to continue the stopped circular movement. If this is not possible, move robot and program pointer for a new start.

40608, Argument Error**Description**

Task: *arg*.

Orientation definition error in *arg*.

Program ref: *arg*.

Recommended actions

All used orientations must be normalized i.e. the sum of the quaternion elements squares must equal 1.

40609, Argument Error**Description**

Task: *arg*.

Argument \WObj specifies a mechanical unit with too long name.

Program ref: *arg*.

Recommended actions

Use max. 16 characters to specify the name of a mechanical coordinated unit.

40611, Execution Error**Description**

Task: *arg*.

Not allowed to step backwards with this move instruction.

Program ref: *arg*.

Consequences

Step backwards to a position defined with another tool or work object could result in faulty path.

Recommended actions

Check tool and work object.

40612, Argument Error**Description**

Task: *arg*.

No argument programmed for the name of the output signal.

Program ref: *arg*.

Recommended actions

Possible to set one position fix I/O such as digital, group of digital or analog output signals during the robot movement.

40613, Argument Error**Description**

Task: *arg*.

Optional argument *arg* can only be combined with output signal argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the arguments.

40614, Argument Error**Description**

Task: *arg*.

Argument *arg* is not 0 or 1.

Program ref: *arg*.

Recommended actions

Digital signals can only be set or checked to 0 or 1.

40615, Argument Error**Description**

Task: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Argument *arg* is not an integer value.

Program ref: *arg*.

Recommended actions

Digital group of in/out signals, process identity or process selector can only have an integer value.

40616, Argument Error

Description

Task: *arg*.

Argument *arg* is outside allowed limits.

Program ref: *arg*.

Recommended actions

Used group of digital in/out signals can only be set or checked within 0 to *arg* according to configuration in system parameters.

Recovery: *arg*.

40617, Argument Error

Description

Task *arg*: One of the arguments SetValue, SetDvalue, CheckValue or CheckDvalue is outside allowed limits.

Program ref: *arg*.

Probable causes

The analog signal can only be set/checked within *arg* and *arg* according to the I/O system parameter configuration.

Recommended actions

Check the RAPID program or the I/O configuration.

Recovery: *arg*.

40620, Argument Error

Description

Task: *arg*.

Argument *arg* have too large negative value.

Program ref: *arg*.

Recommended actions

Set argument *arg* to *arg* or more.

40622, Argument Error

Description

Task: *arg*.

The value of argument Time is too low for cyclic interrupts.

Program ref: *arg*.

Recommended actions

Change the value for Time, to a value greater than or equal to 0.1 s.

40623, Argument Error

Description

Task: *arg*.

The value of argument Time is too low for single interrupts.

Program ref: *arg*.

Recommended actions

Change the value for Time to a value greater than or equal to 0.01 s.

40624, Argument Error

Description

Task: *arg*.

Argument *arg* is not between 0 and 2.

Program ref: *arg*.

Recommended actions

Specify the flank to generate the interrupt.

0 = Negative flank (high -> low).

1 = Positive flank (low -> high).

2 = Both negative and positive flank.

40625, Limit Error

Description

Task: *arg*.

The robot is outside its limits.

Program ref: *arg*.

Probable causes

- Axis outside working area.
- Limits exceeded for at least one coupled joint.

Recommended actions

Recovery: *arg*.

40631, Instruction Error

Description

Task: *arg*.

Too many move instructions in sequence with concurrent RAPID program execution.

Program ref: *arg*.

Recommended actions

Edit the program to max. 5 MoveX \Conc in sequence on the basic execution level of the program.

Recovery: *arg*.

Continues on next page

40632, Instruction Error

Description

Task: *arg.*

No move instructions with concurrent RAPID program execution are allowed within the StorePath-RestoPath part of the program.

Program ref: *arg.*

Recommended actions

Edit the program so it does not contain any MoveX \Conc instructions within the StorePath-RestoPath part of the program.

40634, Reference Error

Description

Task: *arg.*

The signal *arg* is unknown in the system.

Program ref: *arg.*

Probable causes

If the signal is defined in the RAPID program, it must be connected to the configured signal with instruction AliasIO.

Recommended actions

All signals (except AliasIO signals) must be defined in the system parameters and cannot be defined in the RAPID program.

Recovery: *arg.*

40636, Sensor Error

Description

Task: *arg.*

No measurement from sensor.

Program ref: *arg.*

Recommended actions

Requested data is not available.

Recovery: *arg.*

40637, Sensor Error

Description

Task: *arg.*

Not ready yet.

Program ref: *arg.*

Recommended actions

Requested function is not ready yet.

Recovery: *arg.*

40638, Sensor Error

Description

Task: *arg.*

General error.

Program ref: *arg.*

Recommended actions

General error has occurred which is not specifically connected to the requested action. Read the block "Error log" if the function is available.

Recovery: *arg.*

40639, Sensor Error

Description

Task: *arg.*

Sensor busy, try later.

Program ref: *arg.*

Recommended actions

The sensor is busy with another function.

Recovery: *arg.*

40640, Sensor Error

Description

Task: *arg.*

Unknown command.

Program ref: *arg.*

Recommended actions

The function requested from the sensor is unknown.

Recovery: *arg.*

40641, Sensor Error

Description

Task: *arg.*

Illegal variable or block number.

Program ref: *arg.*

Recommended actions

Requested variable or block is not defined in the sensor.

Recovery: *arg.*

40642, Sensor Error

Description

Task: *arg.*

External alarm.

Program ref: *arg.*

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Alarm from external equipment.

Recovery: *arg.*

40643, Sensor Error

Description

Task: *arg.*

Camera alarm.

Program ref: *arg.*

Recommended actions

Some error has been detected in the camera. Run Camcheck to test if the camera is OK.

Recovery: *arg.*

40644, Sensor Error

Description

Task: *arg.*

Temperature alarm.

Program ref: *arg.*

Recommended actions

The camera is overheated it needs more cooling air or water.

Recovery: *arg.*

40645, Sensor Error

Description

Task: *arg.*

Value out of range.

Program ref: *arg.*

Recommended actions

The value of the data sent to the sensor is out of range.

Recovery: *arg.*

40646, Sensor Error

Description

Task: *arg.*

Camera check failed.

Program ref: *arg.*

Recommended actions

The CAMCHECK function failed. The camera is broken. Send it for repair.

Recovery: *arg.*

40647, Sensor Error

Description

Task: *arg.*

Communication time out.

Program ref: *arg.*

Recommended actions

Increase the time out time and check the connections to the sensor.

Recovery: *arg.*

40648, Search Error

Description

Task: *arg.*

Not allowed to do StorePath while searching is active on motion base path level.

Program ref: *arg.*

Consequences

Program is stopped.

Probable causes

Executing of instruction StorePath while searching is active.

Recommended actions

Not possible to use StorePath in TRAP, event or service routine while searching is active on motion base path level. If using interrupts in the program for execution of TRAPs, such interrupt must be deactivated during any search. E.g. ISleep - SearchL - IWatch.

40649, Path Limitation

Description

Task: *arg.*

arg is already done or executing. Instruction *arg* must first be executed, before a new *arg* can be done.

Program ref: *arg.*

Recommended actions

Check the RAPID program.

40650, Wrong Combination Of Parameters

Description

Task: *arg.*

Optional parameters and switches are not used in a correct combination.

Program ref: *arg.*

Continues on next page

Recommended actions

- No optional parameters and no switch keep the old coordinate system.
- The switch Old has the same function.
- RefPos or RefNum has to be defined with Short, Fwd or Bwd.

40651, Use Numeric Input

Description

Task: *arg*.

Use numeric input for the position instead of a robtarget.

Program ref: *arg*.

Recommended actions

The position cannot be defined with a robtarget for robot axes.
Use the optional parameter for numeric input of the position.

40652, Axis Is Moving

Description

Task: *arg*.

A Robot axis, an external axis or an independent axis is moving.

Program ref: *arg*.

Recommended actions

All Robot axes, external axes and independent axes have to stand still. Use MoveL with Fine argument for the Robot and external axes. Use IndRMove for the independent axes.

Recovery: *arg*.

40654, Axis Not Active

Description

Task: *arg*.

The axis destination position to move to is undefined (9E9) or the axis to move is not active at present.

Program ref: *arg*.

Probable causes

- 1) The position to move to has been programmed with no active mechanical unit.
- 2) The position to move to has been modified with the mechanical unit deactivated.
- 3) The mechanical unit is not active at present.

Recommended actions

The mechanical unit has to be activated before modifying or moving to the destination position.

Recovery: *arg*.

40655, Axis Is Not Independent

Description

Task: *arg*.

The axis is not in independent mode.

Program ref: *arg*.

Consequences

It is only possible to get the status from an axis in independent mode.

Recommended actions

Set the axis to independent.

Recovery: *arg*.

40658, Parameter Error

Description

Task: *arg*.

Parameter *arg* can only be used, if parameter *arg* is greater than zero.

Program ref: *arg*.

Recommended actions

Parameter *arg* has effect only in the first TriggX instruction, in a sequence of several TriggX instructions, that controls the speed proportional AO signal.

40661, Search Error

Description

Task: *arg*.

The signal *arg* for the SearchX instruction is already set to the specified value (high or low) at the start of searching, or the I/O-device for the signal isn't up and running for the occasion. Before performing next search, make sure that TCP is moved back to the start position of the search path.

Program ref: *arg*.

Consequences

If no repositioning is done, before restart of circular search, movement that can cause damage might occur.

Recommended actions

Recovery: *arg*.

40662, Invalid Worldzone Type

Description

Task: *arg*.

The switch *arg* must be associated with a *arg* worldzone.

Program ref: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

If use of switch \Temp, the datatype must be wztemporary in WorldZone. If use of switch \Stat, the datatype must be wzstationary in WorldZone.

40663, World Zone Not In Use

Description

Task: *arg*.

The argument *arg* of the instruction *arg* refers to a not used worldzone.

Program ref: *arg*.

Recommended actions

The worldzone must have been defined and activated by a WZLimSup or WZDOSet instruction.

40664, World Zone Already In Use

Description

Task: *arg*.

The '*arg*' worldzone has already been defined and activated. A world zone can only be defined once.

Program ref: *arg*.

Recommended actions

Use a worldzone with another name.

40665, Too Many World Zones

Description

Task: *arg*.

It is not possible to add the world zone *arg*. The world zone table is full.

Program ref: *arg*.

Recommended actions

Check the RAPID program to see if any word zone might be removed.

40666, Illegal World Zones

Description

Task: *arg*.

Worldzone '*arg*' is defined locally in current routine.

Program ref: *arg*.

Recommended actions

Define the world zone as global or local in module.

40667, Illegal World Zones

Description

Task: *arg*.

WorldZone *arg* is not entire data reference.

Program ref: *arg*.

Recommended actions

Check the value of argument WorldZone.

40668, Shapedata Not In Use

Description

Task: *arg*.

The '*arg*' argument of the instruction *arg* must refer to a defined shapedata.

Program ref: *arg*.

Recommended actions

A shapedata is used to store a volume definition. It must have been defined by WZBoxDef, WZSphDef or WZCylDef before it can be used by WZLimSup or WZDOSet.

40669, World Zone Too Small

Description

Task: *arg*.

At least one side or radius is less than the minimal allowed in instruction *arg*.

Program ref: *arg*.

Recommended actions

Check previous volume definition instruction.

40670, Invalid World Zone

Description

Task: *arg*.

The index of the world zone argument *arg* in *arg* is not a valid index defined by WZLimSup or WZDOSet.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

40671, Illegal Use Of World Zone

Description

Task: *arg*.

The argument '*arg*' for *arg* must be a temporary world zone.

Program ref: *arg*.

Recommended actions

Check the argument.

Continues on next page

40672, World Zone Already In Use

Description

Task: *arg*.

It is not possible to add the world zone *arg*. Another world zone with the same name is already defined in the system.

Program ref: *arg*.

Recommended actions

Check the name of the world zone.

40673, I/O Access Error

Description

Task: *arg*.

The signal given in parameter *arg* is write protected for RAPID access.

Program ref: *arg*.

Recommended actions

Select other user signal or change the access mode for the signal.

40674, I/O Access Error

Description

Task: *arg*.

The I/O signal *arg* is not write protected for user access from FlexPendant or RAPID.

Program ref: *arg*.

Recommended actions

Change the access mode to type ReadOnly for the signal in the I/O configuration.

40675, Execution Error

Description

Not allowed changing the run mode from forward to backward or vice versa when running an invisible trap routine.

Recommended actions

If possible, select the original run mode and press start to continue.

40676, Parameter Error

Description

Task: *arg*.

The DeltaJointVal for robot axis *arg* is ≤ 0 .

Program ref: *arg*.

Recommended actions

Check the value for DeltaJointVal. The DeltaJointVal for all axes to supervise must be > 0 mm or degrees.

40677, Parameter Error

Description

Task: *arg*.

The DeltaJointVal for external axis *arg* is ≤ 0 .

Program ref: *arg*.

Recommended actions

Check the value for DeltaJointVal. The DeltaJointVal for all axes to supervise must be > 0 mm or degrees.

40678, Parameter Error

Description

Task: *arg*.

LowJointVal is higher than or equal to HighJointVal for robot axis *arg*.

Program ref: *arg*.

Recommended actions

Check the values for HighJointVal and LowJointVal. The HighJointVal must be higher than the LowJointVal for all axes with defined high or/and low limits.

40679, Parameter Error

Description

Task: *arg*.

LowJointVal is higher than or equal to HighJointVal for external axis *arg*.

Program ref: *arg*.

Recommended actions

Check the values for HighJointVal and LowJointVal. The HighJointVal must be higher than the LowJointVal for all axes with defined high or/and low limits.

40680, Parameter Error

Description

Task: *arg*.

Error in used WZHomeJointDef. It is not allowed to specify supervision of not active axis *arg*.

Program ref: *arg*.

Recommended actions

Set the argument MiddleJointVal to 9E9 for the actual axis.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40681, Parameter Error

Description

Task: *arg*.

Error in used WZLimJointDef. It is not allowed to specify limitation of not active axis *arg*.

Program ref: *arg*.

Recommended actions

Set the argument LowJointVal and HighJointVal to 9E9 for the actual axis.

40698, Read error

Description

Task *arg* is trying to read file *arg*, but is failing.

Consequences

It was not possible to read/load *arg*.

Probable causes

If trying to access file on FTP mounted disc, make sure that the size of *arg* isn't larger than the maximum file size configured in the FTP protocol settings.

40699, Program Memory Full

Description

The task *arg*, has only *arg* bytes in its program memory.

Consequences

It was not possible to load module *arg*.

Recommended actions

- 1) Remove some other module and try again.
- 2) Check if large data structures could be split into smaller blocks.
- 3) Use of installed modules can save program memory.

40700, Syntax Error

Description

Task: *arg*.

Syntax error. *arg*.

40701, Program Memory Full

Description

The task *arg* , has only *arg* free bytes in its user space.

Consequences

The ordered operation could not be completed.

Recommended actions

- 1) Remove some modules and try again.

Continues on next page

- 2) Check if large data structures could be split into smaller blocks.

- 3) Use of installed modules can save program memory.

40702, File Not Found

Description

Task: *arg*.

The file *arg* was not found.

Program ref: *arg*.

Recommended actions

- Check the file path and the file name.
- Check if the file exists.

Recovery: *arg*.

40703, Unload Error

Description

Task: *arg*.

The program module could not be unloaded. The reason is that the module is changed but not saved.

Program ref: *arg*.

Recommended actions

The instruction UnLoad: Use the optional switch ErrIfChanged, without recover from this situation, in an Error handler.

Recovery: *arg*.

40704, UnLoad Error

Description

Task: *arg*.

arg The program module couldn't be unloaded.

Program ref: *arg*.

Probable causes

- Module not loaded with Load instr.
- Not same file path as used for Load

Recommended actions

- Check if the program module has been loaded with the instruction Load.
- Check if the file path and name are the same in the UnLoad and Load instruction.

Recovery: *arg*.

40705, Syntax Error

Description

Task: *arg*.

Syntax error *arg*.

Recommended actions

More syntax errors will follow this.

40706, Load Error**Description**

Task: *arg*.

The program module is already loaded.

Program ref: *arg*.

Probable causes

The module name in the head of the file *arg* already exists in the program memory.

Recommended actions

Recovery: *arg*.

40707, I/O Device Name Invalid**Description**

Task: *arg*.

The I/O device name *arg* does not exist.

Program ref: *arg*.

Recommended actions

- Check if the I/O device name is misspelled.
- Check if the I/O device is defined.

Recovery: *arg*.

40708, I/O Device Is Not Enabled**Description**

Task: *arg*.

I/O device *arg* was not enabled.

Program ref: *arg*.

Probable causes

The maximum period of waiting time was too short.

Recommended actions

Increase the waiting time or make a retry.

Recovery: *arg*.

40709, I/O Device Is Not Deactivated**Description**

Task: *arg*.

I/O device *arg* was not deactivated.

Program ref: *arg*.

Probable causes

The maximum period of waiting time was too short.

Recommended actions

Increase the waiting time or make a retry.

Recovery: *arg*.

40710, Argument Error**Description**

Task: *arg*.

The argument *arg* is an expression value, is not present or is of the type switch.

Program ref: *arg*.

Recommended actions

Change the parameter *arg* to a valid one.

Recovery: *arg*.

40711, Alias Type Error**Description**

Task: *arg*.

The data types for the arguments FromSignal and ToSignal must be the same and must be of signalxx type.

Program ref: *arg*.

Recommended actions

Change the type to a valid one (signalai/ao, signaldi/do, signalgi/go).

Recovery: *arg*.

40712, Event Routine Error**Description**

Task: *arg*.

Too many event routines, the routine *arg* will not be executed.

Recommended actions

Encapsulate the routine in one of the others that are specified for the same event.

40713, Alias Define Error**Description**

Task: *arg*.

The signal in argument FromSignal: *arg*, must be defined in the I/O configuration and the signal in argument ToSignal: *arg*, must be declared in the RAPID program and not defined in the I/O configuration.

Program ref: *arg*.

Recommended actions

Check the I/O configuration and the RAPID program.

Recovery: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40714, Argument Error

Description

Task: *arg.*

Orientation definition error in *arg.*

Program ref: *arg.*

Recommended actions

This is probably an off-line generated "dummy" position (undefined orientation), which needs to be modified with modpos.

40720, Alias I/O Installation

Description

The system could not refresh all I/O signals as RAPID symbols.

Consequences

No I/O signals can be used in a RAPID program.

Probable causes

- Incorrect I/O configuration.
- Incorrect task configuration.

Recommended actions

Restart the controller.

40721, I/O Installation

Description

Task *arg*: The system could not refresh all I/O signals as RAPID symbols.

Consequences

No I/O signals can be used in a RAPID program.

Probable causes

- Incorrect I/O configuration.
- Incorrect task configuration.

Recommended actions

Restart the controller.

40722, Mechanical Units

Description

The system could not refresh all mechanical units as RAPID symbols.

Consequences

No mechanical units can be used in a RAPID program.

Probable causes

- Incorrect Motion configuration.
- Incorrect task configuration.

Recommended actions

Restart the controller.

40723, Camera Installation

Description

Task *arg*: The system could not refresh all camera units as RAPID symbols.

Consequences

No camera units can be used in a RAPID program.

Probable causes

- Incorrect camera configuration.
- Incorrect task configuration.

Recommended actions

Restart the controller.

40724, Save or Erase Error

Description

Task: *arg*.

The program module *arg* could not be saved or could not be erased.

Program ref: *arg*.

Recommended actions

- Check the spelling of the module name
- Check if the module is loaded.

Recovery: *arg*.

40726, Reference Error

Description

Task: *arg*.

The reference to the load session is not valid.

Program ref: *arg*.

Recommended actions

Check if the specified reference is the same as in StartLoad

Recovery: *arg*.

40727, Save Error

Description

Task: *arg*.

Missing file source *arg*.

Program ref: *arg*.

Recommended actions

Use FilePath argument to specify the file destination.

Recovery: *arg*.

Continues on next page

40728, Frame Error

Description

Task: *arg*.

Unable to calculate new frame.

Program ref: *arg*.

Probable causes

The positions have not the required relations or are not specified with enough accuracy.

Recommended actions

Check if the positions are too close or not specified with enough accuracy.

Recovery: *arg*.

40731, Value Error

Description

Task: *arg*.

The value of the argument *arg* for signal *arg* is above its maximum logical value.

Program ref: *arg*.

Recommended actions

Change the argument or change the maximum logical value parameter for the signal.

Recovery: *arg*.

40732, Value Error

Description

Task: *arg*.

The value of the argument *arg* for signal *arg* is below its minimum logical value.

Program ref: *arg*.

Recommended actions

Change the argument or change the min logical value parameter for the signal.

Recovery: *arg*.

40733, Value Error

Description

Task: *arg*.

The value of the argument *arg* for signal *arg* is below the value for argument *arg*.

Program ref: *arg*.

Recommended actions

Change the values of the arguments.

40734, Symbol Definition Error

Description

Task: *arg*.

The string in text table *arg* at index *arg* is too long.

Program ref: *arg*.

Recommended actions

Change the file for the text table and perform a system reset.

40735, Argument Error

Description

The axis is not defined.

Recommended actions

The axis has to be defined, before this instruction is executed.

40736, Mechanical Unit Error

Description

Task: *arg*.

It is not possible to define a payload on the robot with this instruction.

Program ref: *arg*.

Recommended actions

Use the instruction GripLoad instead of MechUnitLoad.

40737, Symbol Definition Error

Description

Task: *arg*.

The requested text or text package does not exist. Text table *arg*, Index *arg*.

Program ref: *arg*.

Recommended actions

Check the arguments.

Recovery: *arg*.

40738, I/O Error

Description

Unable to access the I/O signal *arg* on I/O device *arg*.

Impossible to restart.

Probable causes

The connection with the I/O module is broken.

Recommended actions

Re-establish the connection with the I/O device. To make it possible to restart the program move PP to a safe restart position.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40739, Parameter Error

Description

Task: *arg*.

None of the option arguments DO1, GO1, GO2, GO3 or GO4 are specified.

Program ref: *arg*.

Recommended actions

Specify at least one of the arguments.

40740, Execution Error

Description

The PERS variable specified in the instruction TriggStopProc cannot be updated, because it does not exist anymore.

Probable causes

The program module with the PERS variable is probably removed from the program memory.

Recommended actions

Check if the module with the PERS variable is removed, if so put it back.

40741, Context Error

Description

Task: *arg*.

Instruction *arg* may only be used in an event routine.

Program ref: *arg*.

Recommended actions

Remove the instruction.

40742, Parameter Error

Description

Task: *arg*.

The timing parameter DipLag is larger than the system parameter Event preset time.

Program ref: *arg*.

Recommended actions

Increase the system parameter Event preset time or check the equipment dip lag (delay) compensation.

Recovery: *arg*.

40743, Parameter Error

Description

Task: *arg*.

Not a valid subtype in argument *arg*.

Program ref: *arg*.

Continues on next page

Recommended actions

Check the argument.

40744, Parameter Error

Description

Task: *arg*.

Invalid value in *arg* in argument *arg*.

Program ref: *arg*.

Recommended actions

Check the argument.

40745, Parameter Error

Description

Task: *arg*.

arg is less than *arg* in argument *arg*.

Program ref: *arg*.

Recommended actions

Check the argument.

40746, Parameter Error

Description

Task: *arg*.

arg TRUE in parameter *arg* in combination with conveyor coordination.

Program ref: *arg*.

Recommended actions

Cannot use fine points when leaving conveyors after coordinated stop point. Use a zone instead.

40747, Access Error

Description

Task: *arg*.

Cannot read or write to the system parameter *arg*. The parameter is internal and protected from reading and writing.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40748, Value Error

Description

Task: *arg*.

The data to write from parameter CfgData to the system parameter, is outside valid limits.

Program ref: *arg*.

Recommended actions

Recovery: *arg.*

40749, Execution Error**Description**

Task: *arg.*

It is not possible to execute StartMove when the robot is moving.

Program ref: *arg.*

Recommended actions

Recovery: *arg.*

40752, Argument Error**Description**

Task: *arg.*

Some load session with StartLoad - WaitLoad has not been finished.

Program ref: *arg.*

Recommended actions

Finish the load session with WaitLoad, cancel it with CancelLoad or set PP to main.

Recovery: *arg.*

40753, Memory Fault**Description**

Task: *arg.*

Because of power fail in executed Load or StartLoad ... WaitLoad instruction, the RAPID program memory is inconsistent. *** TO REPAIR DO ADVANCED RESTART "Reset RAPID" ***

Program ref: *arg.*

Recommended actions

Important to do Reset RAPID, because the RAPID program memory is destroyed:

- Faulty init value of PERS variables
- Reduction of the available program memory size.

40754, Argument Error**Description**

Task: *arg.*

There are no arguments given.

Program ref: *arg.*

Recommended actions

If you want a limitation set the optional argument On with a value, otherwise set to Off.

40755, Context Error**Description**

Task: *arg.*

Instruction *arg* may only be used in a trap routine.

Program ref: *arg.*

Recommended actions

Remove the instruction.

40756, Context Error**Description**

Task: *arg.*

Instruction *arg* may only be used in a trap routine ordered through instruction *arg*.

Program ref: *arg.*

Recommended actions

Check that INTNO has the interrupt number used by *arg*.

40757, Argument Error**Description**

Task: *arg.*

The load session you are trying to cancel is not in use.

Program ref: *arg.*

Recommended actions

Recovery: *arg.*

40758, I/O Error**Description**

Unable to access the I/O signal *arg* I/O device *arg*.

Probable causes

The connection with the I/O module is broken.

Recommended actions

Re-establish the connection with the I/O device.

40759, Parameter Error**Description**

Task: *arg.*

The argument Data in *arg* has improper data type.

Program ref: *arg.*

Recommended actions

Check the data type. Non-value and semi-value types may not be used.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40761, Parameter Error

Description

Task: *arg*.

The argument *arg* has a negative value.

Program ref: *arg*.

Recommended actions

Set the value positive or to zero.

40762, Value Error

Description

Task: *arg*. The value of argument *arg* forces the robot out of workspace.

Program ref: *arg*.

Recommended actions

Decrease the value.

40763, Execution Error

Description

Task: *arg*. The instruction *arg* cannot be executed while the system is in a stop state.

Program ref: *arg*.

40764, Switch Argument Error

Description

Task: *arg*. The instruction *arg* must be used with one switch argument.

Program ref: *arg*.

Recommended actions

Use one of the switch Total or Free.

40765, Argument Error

Description

Task: *arg*.

In the instruction *arg* the argument *arg* is not an open directory.

Program ref: *arg*.

Recommended actions

Open the directory before trying to read it.

Recovery: *arg*.

40766, Parameter Error

Description

Task: *arg*.

In the instruction *arg* the argument *arg* can't be used without the argument *arg*.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

40767, Search Error

Description

Task: *arg*.

Object of the type *arg* could not be searched for.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

40768, Symbol Access Error

Description

Task: *arg*.

No system symbol *arg* is accessible in the system.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40769, Symbol Read Access Error

Description

Task: *arg*.

The symbol *arg* is not a readable object.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

40770, Symbol Type Error

Description

Task: *arg*.

The symbol *arg* is of type *arg* and not the expected type *arg*.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

Recovery: ERR_SYMBOL_TYPE.

40771, Symbol Access Error

Description

Task: *arg*.

The symbol *arg* is not accessible in this scope.

Program ref: *arg*.

Continues on next page

Recommended actions

Recovery: *arg.*

40772, I\O Error**Description**

Task: *arg.*

The *arg* instruction has lost contact with the conveyor.

Program ref: *arg.*

40773, Instruction Interrupted**Description**

Task: *arg.*

The instruction *arg* was interrupted, reason unknown.

Program ref: *arg.*

40774, Object Dropped**Description**

Task: *arg.*

The object that the instruction *arg* was waiting for has been dropped.

Program ref: *arg.*

Probable causes

Start window passed or Checkpoint not satisfied.

Recommended actions

If Checkpoint not used, Checkpoint Distance and Checkpoint

Window Width must be set to zero. Rerun the instruction

Recovery: *arg.*

40775, Conveyor Error**Description**

Task: *arg.*

Another *arg* instruction is waiting for a distance to the object.

Program ref: *arg.*

40776, Conveyor Error**Description**

Task: *arg.*

Another *arg* instruction is waiting for the object.

Program ref: *arg.*

40777, Conveyor Error**Description**

Task: *arg.*

The *arg* instruction is already connected.

Program ref: *arg.*

Recommended actions

Recovery: *arg.*

40778, Value Error**Description**

Task: *arg.*

Booking of the new error number *arg* failed. The init value must be -1 or the old number.

Program ref: *arg.*

Recommended actions

Check the init value of the new errnum variable.

40779, Error Number Local**Description**

Task: *arg.*

The RAPID user error number *arg* must not be declared as local in routine.

Program ref: *arg.*

Recommended actions

Check the errnum declaration.

40780, Data Object Error**Description**

Task: *arg.*

There is no valid data object for the argument *arg* of the instruction *arg*.

Program ref: *arg.*

Recommended actions

Check if there is a right data object.

40781, File Error**Description**

Task: *arg.*

The parameter *arg* does not correspond to any loaded text file.

Program ref: *arg.*

Recommended actions

Check if the text file is (correct) installed.

40782, Mode Error**Description**

Task: *arg.*

File or serial channel is not opened for writing.

Program ref: *arg.*

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Check how the file or serial channel was opened.

40783, Mode Error

Description

Task: *arg*.

File or serial channel is not opened in a character-based mode.

Program ref: *arg*.

Recommended actions

Check how the file or serial channel was opened.

40784, Mode Error

Description

Task: *arg*.

File or serial channel is not opened in a binary mode.

Program ref: *arg*.

Recommended actions

Check how the file or serial channel was opened.

40785, Mode Error

Description

Task: *arg*.

File or serial channel is not opened for reading.

Program ref: *arg*.

Recommended actions

Check how the file or serial channel was opened.

40786, Read Error

Description

Task: *arg*.

One or more bytes is not read properly. The value of the read data might be inconsistent.

Program ref: *arg*.

Consequences

Because the checksum for the received message is not the same as calculated at sending, the message data cannot be used.

Probable causes

The reason can be:

- Communication problem
- Different WriteAnyBin
- ReadAnyBin software version between the sending WriteAnyBin and the receiving ReadAnyBin

Recommended actions

Error Recovery for communication problem: *arg*.

40787, User Frame Error

Description

Task: *arg*.

Not possible to get the coordinated user frame.

Program ref: *arg*.

40788, Axis Error

Description

Task: *arg*.

The single axis is not init correctly.

Program ref: *arg*.

40789, Limitation Error

Description

Task: *arg*.

The string length of the argument for the file path is too long.

Program ref: *arg*.

Probable causes

The maximum allowed string length for the full system file path is *arg* characters.

Recommended actions

Shorten the length of the path.

40790, Value Error

Description

Task: *arg*.

The RAPID string is too long.

Program ref: *arg*.

Probable causes

String value exceeds the maximum allowed length.

Recommended actions

Rewrite the program to use strings of less length.

Recovery: *arg*.

40791, I/O Error

Description

Task: *arg*.

No space left on device (file name *arg*).

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

Continues on next page

40792, I/O Error

Description

Task: *arg.*

File open/access error for path *arg.*

Program ref: *arg.*

Recommended actions

- Check permission, is the file write protected?
- Check if the file or directory exists.
- Check if there is any space left on device.

Recovery: *arg.*

40793, Error Installing Text Table

Description

Task: *arg.*

No or faulty text resource name or index number in the text file.

Program ref: *arg.*

Consequences

The contents of some of the text tables may have been destroyed.

Recommended actions

Correct the error, reset the system and try again.

40794, Error Installing Text Table

Description

Task: *arg.*

The specified index within the text resource already exists in the system.

Program ref: *arg.*

Probable causes

- Error in the index numbering.
- The file has been installed twice.

Recommended actions

If error in the index, correct it, reset the system and try again.

40795, Error Installing Text Table

Description

Task: *arg.*

System memory for text tables is full.

Program ref: *arg.*

Recommended actions

Reduce the amount of user defined text string installed from RAPID. Reset the system and try again.

40796, Overload Error

Description

Task: *arg.*

The system is overloaded so the actual order cannot be ready in time.

Program ref: *arg.*

Recommended actions

Reduce the main computer load, for example by:

- Add WaitTime in RAPID loops
- Increase filter time for I/O signals
- Avoid cyclic interrupts

40797, I/O Error

Description

Unable to access the I/O signal *arg* on I/O device *arg.*

Probable causes

The connection with the I/O module is broken.

Recommended actions

Re-establish the connection with the I/O device.

40798, System Access Error

Description

arg.

40799, Execution Error

Description

Task: *arg.*

TestSignRead is using a channel without a defined signal.

Program ref: *arg.*

Recommended actions

Use TestSignDefine to define a signal to the channel.

40800, Tool Error

Description

Task: *arg.*

The component robhold in the tool has not got the correct value.

Program ref: *arg.*

Recommended actions

Change the value of robhold. If the robot is holding the tool the value should be TRUE. If the robot is not holding the tool, i.e. a stationary tool, the value should be FALSE.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

40801, Calculation error

Description

Task: *arg.*

Cannot calculate the tool frame.

Program ref: *arg.*

Probable causes

It is not possible to calculate the tool frame with the selected approach points.

Recommended actions

Select new approach points as accurate as possible.

40802, Execution Error

Description

Task: *arg.*

Not possible to do subscribe.

Program ref: *arg.*

Probable causes

There is no memory left to make another subscription on this variable.

Recommended actions

To continue, PP must be moved to main!

40803, Error message too long

Description

The length of the following error message was too long and has been cut. This means you will not be able to read the whole message.

40804, Argument Error

Description

Task: *arg.*

The argument "type" in stoppointdata may not be followtime in the instructions MoveJ, MoveAbsJ and MoveExtJ.

Program ref: *arg.*

Recommended actions

Change "type" to inpos or stoptime.

40805, Motion Error

Description

Task: *arg.*

Error from MocGenInstr. Ref to former message for reason.

Program ref: *arg.*

40806, IOF Error

Description

Task: *arg.*

Error from IofGenInstr. Ref to former message for reason.

Program ref: *arg.*

40807, File Error

Description

Task: *arg.*

The file *arg* already exists.

Program ref: *arg.*

Recommended actions

To be able to rename or copy: Change the file name or remove the existing file.

Recovery: *arg.*

40811, No Contact With I/O Device

Description

Task: *arg.*

There is no contact with I/O device.

Program ref: *arg.*

Probable causes

- The device may have been deactivated.
 - No power to the I/O device.
-

40812, Execution Error

Description

Task: *arg.*

Not allowed to run this program in non_motion_execution_mode.

Program ref: *arg.*

Recommended actions

Change mode.

40813, Execution Error

Description

Task: *arg.*

The task is not allowed to execute the instruction *arg.*

Program ref: *arg.*

Probable causes

The task is not configured to control mechanical units.

Recommended actions

Change the configuration or remove the instruction.

Continues on next page

40814, Execution Error**Description**

Task: *arg*.

StartMove could not get the regain distance.

Program ref: *arg*.

Probable causes

Application error.

Recommended actions

Please restart the path.

Recovery: *arg*.

40815, Non Existing Axis Number**Description**

Task: *arg*.

Unknown axis number for the mechanical unit *arg*.

Program ref: *arg*.

Recommended actions

Check the value for the argument Axis.

40816, RolGenInstr Error**Description**

Task: *arg*.

Error from instruction RolGenInstr. Ref. to former user or internal error message for reason.

Program ref: *arg*.

Recovery: *arg*.

41000, Item source exists**Description**

Item source *arg* already exists. Two item sources may not have the same name.

41001, Not a valid name**Description**

Choose *arg* or *arg*.

41002, Buffer size exceeded**Description**

Fatal internal error for item source *arg*. Try first by restarting the controller or second by resetting the system. Please report this error.

41003, Item source not defined**Description**

The item source object has not been defined.

41004, Itmsrc internal error**Description**

Internal error for item source *arg*. Error type: *arg*.

41005, Flush item source first**Description**

Item source *arg* must be flushed before it is used.

41006, Ack item target first**Description**

Item target must be acknowledged before executing the GetItmTgt(s) instruction again. Error occurred for item source *arg*.

41007, Item target buffer full**Description**

Item target buffer full for item source *arg*.

41008, Conveyor I/O init error**Description**

Error in the initialization of the I/O signal for item source *arg*, for conveyor *arg*. I/O signal name *arg*.

41009, Conveyor does not exist**Description**

Error for item source *arg*. The conveyor *arg* does not exist.

41010, No conveyor name given**Description**

Error for item source *arg*. No conveyor name specified.

41011, Conveyor limits error**Description**

Error for item source *arg*, conveyor *arg*. The limits are incorrectly specified.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41012, Conveyor data are defined late

Description

Error for item source *arg*, conveyor *arg*. The ItmSrcCnvDat instruction must be called before the ItmSrcFlush instruction.

Recovery: *arg*.

41050, Profile not activated

Description

Profile record not ready

Consequences

Profile data not activated

Probable causes

Try to activate recorded profile too early

Recommended actions

Instruction RecordProfile must be called before ActivateProfile

41101, Correction Not Connected

Description

Task: *arg*.

Cannot write to correction descriptor.

Program ref: *arg*.

Recommended actions

Check that the current correction descriptor is connected.

Recovery: *arg*.

41051, Recorded profile not stored

Description

No valid profile data to store.

Consequences

Nothing stored.

Probable causes

Try to store a recorded profile not existing or not activated.

Recommended actions

Instruction ActivateProfile must be called before StoreProfile.

41102, No Corrections Connected

Description

Task: *arg*.

Correction unable to be read.

Program ref: *arg*.

Probable causes

No correction descriptor connected.

Recommended actions

Check if any correction generator is connected.

Recovery: *arg*.

41200, Servo Tool Open Error

Description

Task: *arg*.

Not possible to open servo gun in motors off state.

Program ref: *arg*.

Recommended actions

Retry after setting motors on.

Recovery: *arg*.

41201, Servo Tool Close Error

Description

Task: *arg*.

Not possible to close servo gun in motors off state.

Program ref: *arg*.

Recommended actions

Retry after setting motors on.

Recovery: *arg*.

41202, Servo Tool Calibration Error

Description

Task: *arg*.

Not possible to calibrate servo gun in motors off state.

41100, Too Many Corrections

Description

Task: *arg*.

Max 5 correction descriptors are allowed to be connected.

Program ref: *arg*.

Recommended actions

Check number of connected descriptors.

Recommended actions

Retry after setting motors on.

Recovery: *arg*.

Continues on next page

Program ref: *arg.*

Recommended actions

Retry after setting motors on.

Recovery: *arg.*

41203, Servo Tool Error**Description**

Task: *arg.*

Servo tool *arg* does not exist.

Program ref: *arg.*

Recommended actions

Check mechanical unit name.

Recovery: *arg.*

41204, Servo Tool error**Description**

Task: *arg.*

Emergency stop when executing instruction in background task.

Program ref: *arg.*

Recommended actions

Retry after emergency stop reset.

Recovery: *arg.*

41205, Servo Tool Error**Description**

Task: *arg.*

Not possible to close servo gun. The gun is not open.

Program ref: *arg.*

Recommended actions

Retry after opening the gun.

Recovery: *arg.*

41206, Servo Tool Parameter Error**Description**

Task: *arg.*

The parameter PrePos must be a positive value.

Program ref: *arg.*

Recommended actions

Change the parameter value.

Recovery: *arg.*

41207, Servo Tool Init Error**Description**

Task: *arg.*

The position for servo tool *arg* is not initialized.

Program ref: *arg.*

Recommended actions

Change the parameter value or perform a tip change calibration.

Recovery: *arg.*

41208, Servo Tool Synchronization Error**Description**

Task: *arg.*

The tips for servo tool *arg* are not synchronized.

Program ref: *arg.*

Recommended actions

Synchronize via ManServiceCalib or perform a tool change calibration.

Recovery: *arg.*

41209, Servo Tool Activation Error**Description**

Task: *arg.*

Servo tool *arg* is not activated.

Program ref: *arg.*

Recommended actions

Use ActUnit to activate.

Recovery: *arg.*

41210, Servo Tool Error**Description**

Task: *arg.*

Not possible to execute instruction in motors off state for servo tool *arg*.

Program ref: *arg.*

Recommended actions

Retry after setting motors on.

Recovery: *arg.*

41211, Servo Tool Error**Description**

Task: *arg.*

Not possible to perform a recalibration of the gun *arg*.

Program ref: *arg.*

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Retry after checking values.

Recovery: *arg.*

41212, Servo Tool Error

Description

Task: *arg.*

Not possible to change force. The gun is not closed.

Program ref: *arg.*

Recommended actions

Retry after closing the gun.

Recovery: *arg.*

41300, Argument Error

Description

The argument Joint must be between 1 and *arg.*

Recommended actions

Check and change the value.

41301, Argument Error

Description

The argument Type doesn't correspond to a service value.

41302, Argument Error

Description

The argument Type does not correspond to a service value.

41303, Argument Error

Description

The argument Robot must be between 1 and *arg.*

Recommended actions

Check and change the value.

41304, Argument Error

Description

The argument Level doesn't correspond to a service level.

41400, Parameter Error

Description

Task: *arg.*

Faulty AxisNo.

Program ref: *arg.*

Recommended actions

Check and change the value. Press Start to continue.

41401, I/O Error

Description

Unable to access the I/O signal. Signal and I/O device unknown.

Probable causes

The connection with the I/O module is broken.

Recommended actions

Re-establish the connection with the I/O device.

41404, Parameter Error

Description

Task: *arg.*

Argument On or Off missing.

Program ref: *arg.*

Recommended actions

Check the RAPID program. One of the switch On or Off must be given.

41405, Parameter Error

Description

Task: *arg.*

Argument *arg* not allowed together with argument Off.

Program ref: *arg.*

Recommended actions

Check and change the RAPID program.

41406, Parameter Error

Description

Task: *arg.*

This TuneType is only valid for option Advanced Shape Tuning.

Program ref: *arg.*

Recommended actions

Change TuneType or install option.

41407, Parameter Error

Description

Task: *arg.*

Symbol *arg* is read-only.

Program ref: *arg.*

Recommended actions

Recovery: *arg.*

Continues on next page

41408, Parameter Error

Description

Task: *arg*.

The symbol *arg* was not found.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41409, Parameter Error

Description

Task: *arg*.

Ambiguous symbol *arg*.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

41410, Parameter Error

Description

Task: *arg*.

Search error for symbol *arg*.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41411, Parameter Error

Description

Task: *arg*.

Unknown module name *arg*.

Program ref: *arg*.

Probable causes

The module does not exist.

Recommended actions

Check and change the RAPID program.

41412, Parameter Error

Description

Task: *arg*.

Ambiguous module *arg*.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

41413, Parameter Error

Description

Task: *arg*.

Ambiguous routine name *arg*.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

41414, Parameter Error

Description

Task: *arg*.

Unknown routine name *arg*.

Program ref: *arg*.

Probable causes

The routine does not exist.

Recommended actions

Check and change the RAPID program.

41415, Parameter Error

Description

Task: *arg*.

The module name *arg* does not exist.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

Recovery: *arg*.

41416, Parameter Error

Description

Task: *arg*.

The symbol *arg* is not a module.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

Recovery: *arg*.

41417, System Access Error

Description

Task: *arg*.

Cannot convert date.

Program ref: *arg*.

Recommended actions

Restart the controller and retry.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41419, Parameter Error

Description

Task: *arg*.

arg must be num, bool or string.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

41420, Parameter Error

Description

Task: *arg*.

The argument type of *arg* is not compatible with cfg type.

Expected *arg*.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41421, Parameter Error

Description

Task: *arg*.

Unknown cfg domain in argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

Recovery: *arg*.

41422, Parameter error

Description

Task: *arg*.

Unknown cfg type in argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

Recovery: *arg*.

41423, Parameter Error

Description

Task: *arg*.

Unknown cfg instance in argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

Recovery: *arg*.

41424, Parameter Error

Description

Task: *arg*.

Unknown cfg attribute in argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.

Recovery: *arg*.

41425, Parameter Error

Description

Task: *arg*.

The path '*arg*' in argument *arg* is incorrect.

Program ref: *arg*.

Recommended actions

Check and change the path.

Recovery: *arg*.

41426, I/O Error

Description

Unable to access the I/O signal. Signal and I/O device unknown.

Consequences

Impossible to restart.

Probable causes

The connection with the I/O module is broken.

Recommended actions

Re-establish the connection with the I/O device. To make it possible to restart the program move PP to a safe restart position.

41427, Argument Error

Description

Task *arg*: The delaytime has to be positive.

Program ref: *arg*.

Recommended actions

Change the value of delaytime.

41428, Axis Error

Description

Task: *arg*.

The single axis is not init correctly. The sensor is not activated.

Program ref: *arg*.

Continues on next page

41429, Axis Error

Description

Task: *arg.*

The single axis is not init correctly. The sensor process is not init correctly.

Program ref: *arg.*

41430, Argument Error

Description

Task: *arg.*

Orientation definition error in *arg.*

Program ref: *arg.*

Recommended actions

Check orientation. All used orientations must be normalized i.e. the sum of the quaternion elements squares must equal 1.

41431, System Access Error

Description

Task: *arg.*

Unknown LOGSRV instance.

Program ref: *arg.*

Recommended actions

Restart the controller and retry.

41432, System Access Error

Description

Task: *arg.*

Cannot set test signals.

Program ref: *arg.*

Recommended actions

Restart the controller and retry.

41433, Parameter Error

Description

Task: *arg.*

Unknown mechanical unit.

Program ref: *arg.*

Recommended actions

Check if the mechanical unit exists in the system.

Recovery: *arg.*

41434, Parameter Error

Description

Task: *arg.*

Argument Axis is out of range.

Program ref: *arg.*

Recommended actions

Check and change the value of the argument axis.

Recovery: *arg.*

41435, Parameter Error

Description

Task: *arg.*

Argument Channel is out of range.

Program ref: *arg.*

Recommended actions

Check and change the value of argument Channel.

41437, System Access Error

Description

Task: *arg.*

Cannot reset all test signals.

Program ref: *arg.*

Recommended actions

Restart the controller and retry.

41438, Undefined Load

Description

Task: *arg.*

WARNING! Argument *arg* has undefined load (mass=0).

Program ref: *arg.*

Consequences

IMPORTANT TO DEFINE CORRECT LOAD to avoid mechanical damages of the robot.

Recommended actions

Define the actual load for the tool or the grip load before program movement or jogging. A good motion performance requires a correctly defined load.

41439, Undefined Load

Description

Task: *arg.*

WARNING! Argument *arg* has undefined load center of gravity.

Program ref: *arg.*

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Consequences

IMPORTANT TO DEFINE CORRECT LOAD to avoid mechanical damage of the robot.

Recommended actions

Define the actual center of gravity for the tool load or the grip load before program movement or jogging (cog.x, cog.y and cog.z cannot be 0 mm at the same time). Load identification can be done with the service routine LoadIdentify.

41440, Argument Is Missing

Description

Task: *arg*.

One of the switch parameter *arg* or *arg* has to be defined.

Program ref: *arg*.

Consequences

The called RAPID routine could not be executed.

Recommended actions

An argument of the data type switch must be specified.

41441, UnLoad Error

Description

Task: *arg*.

Module loaded with path *arg* is active and therefore cannot be erased.

Program ref: *arg*.

Probable causes

Instruction UnLoad or WaitLoad is executed in the same module as the module that should be removed. Instruction UnLoad or WaitLoad is in a trap that is executed earlier than expected. If there is a CONNECT to a trap routine in the module, an IDDelete on the trap has to be done before the module can be unloaded.

Recommended actions

Check that the module does not contain routines or data that are still active, for example CONNECT.

Recovery: *arg*.

41442, Reference Error

Description

Task: *arg*.

The reference in argument *arg* is not an entire persistent variable.

Program ref: *arg*.

Recommended actions

It is not possible to use record component or array element in arg. *arg*. It is only possible to use entire persistent variables for Tool, WObj or Load in any motion instruction.

41443, Argument Error

Description

Task: *arg*.

Argument Tool has negative load of the tool.

Program ref: *arg*.

Recommended actions

Define the correct load of the tool before use of the tool for jogging or program movement. Load identification of the tool can be done with the service routine LoadIdentify.

41444, Argument Error

Description

Task: *arg*.

Argument Tool has at least one inertia data component with negative value.

Program ref: *arg*.

Recommended actions

Define all inertia data components (ix, iy or iz) to actual positive values.

41445, Argument Error

Description

Task: *arg*.

No \WObj specified for movement with stationary TCP.

Program ref: *arg*.

Recommended actions

Add argument \WObj for actual work object. If not movement with stationary TCP, change the component "robhold" in argument Tool to TRUE (robot holds the tool).

41446, Argument Error

Description

Task: *arg*.

It is undefined if the robot holds the tool or the work object.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Mismatch of component robhold in the tool and the work object.

Continues on next page

Recommended actions

Check if mismatch between argument Tool and argument \WObj for data component robhold.

41447, Argument Error**Description**

Task: *arg*.

Argument *arg* has at least one data component with negative value.

Program ref: *arg*.

Recommended actions

Set all data components in argument *arg* to positive values.

41448, Argument Error**Description**

Task: *arg*.

Argument *arg* may not have a negative value.

Program ref: *arg*.

Recommended actions

Set argument *arg* to a positive value.

41449, Value Error**Description**

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

41450, Argument Error**Description**

Task: *arg*.

Argument \WObj specifies a mechanical unit name, which is not activated or is unknown in the system.

Program ref: *arg*.

Recommended actions

The mechanical unit name defined in \WObj must correspond to the name earlier defined in the system parameters and must be activated.

41451, Argument Error**Description**

Task: *arg*.

Argument *arg* contains an illegal interrupt number.

Program ref: *arg*.

Probable causes

Input interrupt number is illegal because it has not been allocated by the instruction CONNECT.

Recommended actions

Use the instruction CONNECT to allocate and connect an interrupt number to a trap routine.

41452, Argument Error**Description**

Task: *arg*.

Argument *arg* contains an interrupt number, which is already in use for other purposes.

Program ref: *arg*.

Recommended actions

Before reuse of an interrupt variable in the program, it must have been cancelled with the instruction IDDelete.

41453, Type Error**Description**

Task: *arg*.

Illegal data type of argument *arg*.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

41454, Reference Error**Description**

Task: *arg*.

Trigg parameter number *arg*, reference to undefined trigg data.

Program ref: *arg*.

Recommended actions

Define trigg data by executing instruction TriggIO, TriggInt, TriggEquip, TriggSpeed or TriggCheckIO before current instruction.

41455, System Access Error**Description**

Task: *arg*.

Operative system get time failed.

Program ref: *arg*.

Recommended actions

Restart the controller and retry.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41456, Argument Error

Description

Task: *arg*.

Argument *arg* not within range.

Program ref: *arg*.

Recommended actions

The argument must be in range *arg*.

41457, Argument Error

Description

Task: *arg*.

Missing optional argument.

Program ref: *arg*.

Recommended actions

Add one of the optional arguments *arg* or *arg*.

41458, Argument Error

Description

Task: *arg*.

Argument *arg* or *arg* not within range.

Program ref: *arg*.

Recommended actions

Check and change the value of the argument.

41459, Argument Error

Description

Task: *arg*.

Argument *arg* not within range.

Program ref: *arg*.

Recommended actions

Check and change the value of the argument.

41460, Argument Error

Description

Task: *arg*.

Argument *arg* or *arg* or *arg* not within range.

Program ref: *arg*.

Recommended actions

Check and change the argument.

41461, Value Error

Description

Task: *arg*.

Illegal value of argument *arg*.

Program ref: *arg*.

Recommended actions

The index must be an integer and in range 1 to 1024.

41462, Value Error

Description

Task: *arg*.

Illegal value of argument for parameter *arg*.

Program ref: *arg*.

Recommended actions

The value must be an integer and in the correct range.

41463, Argument Switch Is Missing

Description

Task: *arg*.

There is an argument missing.

Program ref: *arg*.

Recommended actions

One of the switch parameters \Hex1, \Long4, \Float4 or \ASCII has to be defined.

41464, Index Too High

Description

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

41465, The String Is Empty

Description

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check the argument, and use a non-empty string.

41466, The Variables Are Equal

Description

Task: *arg*.

The argument FromRawData and ToRawData are equal.

Program ref: *arg*.

Continues on next page

Recommended actions

Check and change the RAPID program.

41467, Value Error**Description**

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the value. It must be an integer and in range 0 to 255.

41468, Value Error**Description**

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the value. NoOfBytes must be an integer and in range 1 to 1024, and not higher than RawData length.

41469, Value Error**Description**

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check the value. NoOfBytes must not be higher than RawData length.

41470, Argument Error**Description**

Task: *arg*.

Argument *arg* or *arg* not within range.

Program ref: *arg*.

Recommended actions

Check and change the value of the argument.

41471, Instruction Error**Description**

Task: *arg*.

You are not allowed to deactivate I/O device *arg*.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41472, Instruction Error**Description**

Task: *arg*.

There is no client e.g. a FlexPendant taking care of instruction.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41473, System Access Error**Description**

It was not possible to send data using SCWrite to external computer. Failed to send variable *arg*.

41474, Value Error**Description**

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check the value: *arg* *arg* must be a positive integer.

41475, Wrong size of task list**Description**

Task: *arg*.

The task list has wrong number of elements. It must not have less than 1 or more than *arg*.

Program ref: *arg*.

Recommended actions

Check and change the number of arguments in the task list.

41476, Non-consistent task list**Description**

Task: *arg*.

arg in the task list is not one of the tasks that are configured in the system (max *arg* tasks can be configured).

Program ref: *arg*.

Recommended actions

Add the task to the system (in Controller configuration) or remove it from the task list.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41477, TimeOut

Description

Task: *arg*.

The time set in argument *arg* in instruction WaitSyncTask has expired.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41480, UnpackRawBytes Error

Description

Task: *arg*.

The number of bytes to unpack is too high, and has been reduced. Length: *arg*.

Program ref: *arg*.

Consequences

The string has been filled with data, but only the valid amount.

Probable causes

The value used in *arg* optional argument is too high.

Recommended actions

Check the RAPID program. Use function *arg* to get the current length of valid bytes in the rawbytes variable.

41483, Argument Error

Description

Task: *arg*.

The value of the ID is negative or is not an integer.

Program ref: *arg*.

Recommended actions

Check the value of the optional argument ID. The value must be a nonnegative integer.

41484, TimeOut

Description

Task: *arg*.

The time set in argument *arg* in instruction SyncMoveOn has expired.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41486, Instruction Error

Description

Task: *arg*.

The instruction *arg* is only available if there is a TCP-robot defined in the program task.

Program ref: *arg*.

Recommended actions

- Check the configuration.
- The instruction must be removed, if the task is not supposed to have a TCP-robot.

41487, Instruction Error

Description

Task: *arg*.

The instruction *arg* only works if the TCP-robot is active.

Program ref: *arg*.

Recommended actions

Activate the TCP-robot in the task.

41488, Value Error

Description

Task: *arg*.

There is no TCP-robot defined in the program task. One or several robot axis value input is not equal to 9E9.

Program ref: *arg*.

Recommended actions

Change the robot axis value to 9E9.

41489, Value error

Description

Task: *arg*.

The robot axis *arg* is not moveable and therefore must not be supervised.

Program ref: *arg*.

Recommended actions

Change the value of axis *arg* to 9E9.

41490, TimeOut

Description

Task: *arg*.

The time set in argument *arg* in instruction SyncMoveOff has expired.

Program ref: *arg*.

Continues on next page

Recommended actions

Recovery: *arg.*

41491, Instruction Error

Description

Task: *arg.*

The instruction *arg* is not available if there is a TCP-robot defined in the program task.

Program ref: *arg.*

Recommended actions

- Check the configuration.
- The instruction must be removed, if the task is supposed to have a TCP-robot.

41492, Instruction Error

Description

Task: *arg.*

The instruction *arg* only works if the mechanical unit is active.

Program ref: *arg.*

Recommended actions

Activate the mechanical unit in the task.

41493, Execution Error

Description

Task: *arg.*

There is no TCP-robot available in the task.

Program ref: *arg.*

Recommended actions

To be able to run the instruction a TCP-robot must be available in the task.

41494, Instruction error

Description

Task: *arg.*

The task does not control mechanical unit: *arg.*

Program ref: *arg.*

Recommended actions

Check the configuration.

41495, Move PP Error

Description

Task: *arg.*

Not ready with the switch from independent to synchronized mode.

Program ref: *arg.*

Consequences

Restart of current instruction is blocked. The system can either be in synchronized motion mode or still in independent motion mode.

Probable causes

Stop of program when having an active instruction. Then a PP movement within program has been done.

Recommended actions

Move PP to start the program again. PP must be moved in all program tasks. To have a well-defined state of the system you should move PP to main.

41496, Move PP Error

Description

Task: *arg.*

Not ready with the switch from synchronized to independent mode.

Program ref: *arg.*

Consequences

Restart of current instruction is blocked. The system can either be in synchronized motion mode or still in independent motion mode.

Probable causes

Stop of program when having an active instruction. Then a PP movement within program has been done.

Recommended actions

Move PP to start the program again. PP must be moved in all program tasks. To have a well-defined state of the system you should move PP to main.

41497, Move PP Notification

Description

Task: *arg.*

Instruction *arg* was active in this task. Moving PP within the program can be dangerous in some cases.

Program ref: *arg.*

Consequences

Moving PP in the RAPID program can result in unsynchronized RAPID tasks or/and collision between robots.

Probable causes

PP movement within RAPID program when having active *arg* instruction.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Move PP to suitable position in this program task.

41498, No Defined UserFrame In Mechanical Unit arg!

Description

The workobject *arg* contains a coordinated mechanical unit which has no defined user frame.

Recommended actions

Check the mechanical unit component of the workobject.

41499, Synchronized Mode

Description

Task: *arg*.

System is in synchronized mode. Instruction must have an ID.

Program ref: *arg*.

Recommended actions

Add switch \ID with an identification number to the instruction.

41500, Independent Mode

Description

Task: *arg*.

System is in independent mode. Instruction must not have an ID.

Program ref: *arg*.

Recommended actions

Remove switch \ID from the instruction.

41501, Illegal Id

Description

Task: *arg*.

ErrorId has wrong value. It must be an integer in interval *arg* - *arg*.

Program ref: *arg*.

Recommended actions

Change the value.

41502, Illegal Domain

Description

Task: *arg*.

Domain *arg* cannot be used.

Program ref: *arg*.

Recommended actions

Choose another Elog Domain.

Continues on next page

41503, Illegal Error Type

Description

Task: *arg*.

Error type TYPE_ALL cannot be used.

Program ref: *arg*.

Recommended actions

Use another Error Type.

41504, No Mechanical Unit Stated

Description

Task: *arg*.

No TCP in the system and no mechanical unit added to the instruction.

Program ref: *arg*.

Recommended actions

Add a mechanical unit that exists in the task, to the instruction.

41505, Mechanical Unit Not In Task

Description

Task: *arg*.

The mechanical unit stated does not exist in the task.

Program ref: *arg*.

Recommended actions

Add another mechanical unit to the instruction.

41506, Task Does Not Read a TCP Robot

Description

Task: *arg*.

The read task does not read a tcp robot.

Program ref: *arg*.

Recommended actions

Change the configuration or add a mechanical unit, that exists in the task, to the instruction.

41507, Task Reads Other Mechanical Unit

Description

Task: *arg*.

Task reads another mechanical unit than the one stated in the instruction.

Program ref: *arg*.

Recommended actions

Change mechanical unit in the instruction.

41508, LoadId Error

Description

Task: *arg.*

Load Identification is not available for this robot type.

Program ref: *arg.*

Recommended actions

Check next Event Log message, for the next user action to do.

41509, LoadId Error

Description

Task: *arg.*

Not valid load identification position.

Program ref: *arg.*

Recommended actions

Change the position for the robot. Check next Event Log message, for the next user action to do.

41510, LoadId Error

Description

Task: *arg.*

Not allowed to identify (or use) tool0.

Program ref: *arg.*

Recommended actions

Set the tool that should be identified, active in the jogging window. Check next Event Log message, for the next user action to do.

41511, LoadId Error

Description

Task: *arg.*

Not allowed to identify load0.

Program ref: *arg.*

Recommended actions

Use another load for identification. Check next Event Log message, for the next user action to do.

41512, Internal Error

Description

Task: *arg.*

Measurement axes > 2 at the same time.

Program ref: *arg.*

Recommended actions

Check next Event Log message, for the next user action to do.

41513, LoadId Error

Description

Task: *arg.*

Selection of PayLoad out of limits.

Program ref: *arg.*

Recommended actions

Select a PayLoad in the system. Press Start to continue.

41514, LoadId Error

Description

Task: *arg.*

wobj0 cannot be active for roomfix TCP.

Program ref: *arg.*

Recommended actions

Select another Work Object. Check next Event Log message, for the next user action to do.

41515, LoadId Error

Description

Task: *arg.*

Selection of method out of limits.

Program ref: *arg.*

Recommended actions

Select one of the identification methods given. Press Start to continue.

41516, LoadId Error

Description

Task: *arg.*

The configuration angle is not adequate.

Program ref: *arg.*

Consequences

It is not possible to run the identification.

Probable causes

The selected value of the configuration angle is less than 30, or has another value that is not possible to use for identification.

Recommended actions

Select a configuration angle between +/- 30 and +/- 90 degrees. Press Start to continue.

41517, LoadId Error

Description

Task: *arg.*

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

PP has been moved to the beginning of the Load Identification routine and is now ready for a new restart.

Program ref: *arg*.

Probable causes

Service routine was stopped during measurement, interrupted with cancel by the user or interrupted because some type of other error. Check former Event Log message for reason.

Recommended actions

- 1) Start service routine again
- 2) Use Debug - Cancel Call Routine to quit execution of service routine. NOTE: Cancel Call Routine will result in a lost Program Pointer. Use Debug - PP to Main to get a new Program Pointer.

41518, LoadId Error

Description

Task: *arg*.

Selection of MechUnit out of limits.

Program ref: *arg*.

Recommended actions

Select one of the Mechanical Units displayed. Press Start to continue.

41519, LoadId Error

Description

Task: *arg*.

Mass must be > 0 kg.

Program ref: *arg*.

Recommended actions

Specify the mass to something greater than 0. Press Start to continue.

41520, Error Recovery Constant Not Booked

Description

Task: *arg*.

Error recovery constant *arg* is not booked.

Program ref: *arg*.

Recommended actions

Use instruction BookErrNo to book the constant or use an error recovery constant booked by the system (cannot be used with ErrRaise).

41521, Task Status Error

Description

Task: *arg*.

Continues on next page

None of the tasks in the task list is a NORMAL, activated task.

Program ref: *arg*.

Recommended actions

Check in the Task Selection Panel that at least one of the tasks in the task list are selected = activated. Check in the .cfg-file that at least one of the tasks selected is NORMAL.

41522, Wrong Error Recovery Constant Used

Description

Task: *arg*.

Error recovery constant *arg* has been booked by the system.

The constant cannot be used with instruction ErrRaise.

Program ref: *arg*.

Recommended actions

Book a new error recovery constant with instruction BookErrNo.

41523, Argument Error

Description

Task: *arg*.

Argument *arg* is not an integer or is negative.

Program ref: *arg*.

Recommended actions

Change the value of the argument to a non-negative integer.

41524, Instruction Error

Description

Task: *arg*.

The program is executing in an UNDO handler. It is not allowed to execute the instruction *arg* in an UNDO handler.

Program ref: *arg*.

Recommended actions

Remove the instruction.

41525, Instruction Error

Description

Task: *arg*.

The program is executing in an EVENT routine. It is not allowed to execute the instruction *arg* in an EVENT routine.

Program ref: *arg*.

Recommended actions

Remove the instruction.

41526, Instruction Error

Description

Task: *arg*.

Instruction *arg* may only be used in an ERROR handler.

Program ref: *arg*.

Recommended actions

Remove the instruction or move it to an ERROR handler.

41527, Argument Switch Is Missing

Description

Task: *arg*.

There is an argument missing.

Program ref: *arg*.

Recommended actions

One of the switch parameters \Continue or \BreakOff in *arg* has to be defined.

41528, Instruction Error

Description

Task: *arg*.

Instruction *arg* may only be used in a no-stepin routine.

Recommended actions

Remove the instruction or move it to a no-stepin routine.

41529, Instruction Error

Description

Task: *arg*.

The switch \Inpos is only allowed when the task is in control of a mechanical unit.

Program ref: *arg*.

Recommended actions

Remove the switch \Inpos from the instruction

41530, Instruction error

Description

Task: *arg*.

It is not possible to execute the instruction *arg*, while the coordinated workobject has a reference to the mechanical unit *arg*, located in another task.

Program ref: *arg*.

Recommended actions

Change to a workobject with reference to a mechanical unit located in the same task as the TCP robot. Function CalcJointT

can be used even when the coordinated workobject is located in another task if:

- Switch \UseCurWObjPos is used.
- The coordinated workobject is standing still.

41531, Task Not In TaskList

Description

Task: *arg*.

arg is not one of the tasks in the TaskList, or there is a mismatch between the task lists in the different tasks.

Program ref: *arg*.

Recommended actions

- Add current task to the TaskList.
- Check that the task lists in the different tasks are similar. When using PERS variables, it might be necessary to unload the modules containing the task lists, and then reload them again.

41532, Mismatch of task list

Description

Task: *arg*.

Failed to synchronize because of:

- 1) The task list, *arg*, does not match with the task lists with the same SyncID in the other tasks, or a task name is used multiple times in the task list.
- 2) Not the same active tasks in task selection panel in the first executed instruction as in the following instructions.

Program ref: *arg*.

Consequences

The program execution is immediately halted.

Probable causes

The reason for this error is one of the following:

- 1) task lists do not have the same content for the same SyncID or a task name is used multiple times.
- 2) One or several tasks has been enabled/disabled in the task selection panel after first instruction was executed.

Recommended actions

- 1) Check and modify task lists and SyncIDs, or the same error will occur again.
- 2) Start again. The instructions will be executed with the current status of the task selection panel.

41533, Mismatch Of SyncID

Description

Task: *arg*.

SyncID *arg* does not match with SyncID in the other task/tasks.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Program ref: *arg.*

Probable causes

Use of task lists that are non-global can cause this error.

Recommended actions

Change SyncID and check the task lists. PP must be moved to main in all tasks before you can continue.

41534, Inconsistent Synch Data

Description

Task: *arg.*

Inconsistent synchdata in TaskList *arg.*

Program ref: *arg.*

Recommended actions

Change content of the TaskList. PP must be moved to main in all tasks before you can continue.

41535, Unexpected SyncMoveOn

Description

Task: *arg.*

Unexpected SyncMoveOn (SyncID *arg*). The system is already in synchronized mode.

Program ref: *arg.*

Probable causes

The program task is already in synchronized mode because SyncMoveOn has already been executed. Use of task lists that are non-global can cause this error.

Recommended actions

PP must be moved to main in all task before you can continue the program execution. Remove the SyncMoveOn instruction. Every SyncMoveOn must be followed by a SyncMoveOff instruction. Check your task lists.

41536, Unexpected SyncMoveOn

Description

Task: *arg.*

Unexpected SyncMoveOn (SyncID *arg*). The system is waiting for a SyncMoveOff.

Program ref: *arg.*

Recommended actions

Remove the SyncMoveOn instruction. Every SyncMoveOn must be followed by a SyncMoveOff instruction.

41537, Unexpected SyncMoveOff

Description

Task: *arg.*

Unexpected SyncMoveOff (SyncID *arg*). The system is waiting for a SyncMoveOn.

Program ref: *arg.*

Recommended actions

Remove the SyncMoveOff instruction. Every SyncMoveOn must be followed by a SyncMoveOff instruction.

41538, Wrong TaskList

Description

Task: *arg.*

The task, *arg*, in the TaskList is a read task and cannot be synchronized.

Program ref: *arg.*

Recommended actions

Change the TaskList or the configuration.

41539, Speed Too High

Description

Task: *arg.*

Speed is over *arg* mm/s. This is too fast when Stiff Stop (switch \Stop) is used.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Recommended actions

Change the speed, or change type of stop.

41540, Wrong Mechanical Unit

Description

Task: *arg.*

The task reads the control task, *arg*, which does not control the mechanical unit *arg*.

Program ref: *arg.*

Recommended actions

Change \MechUnit or the configuration.

41541, Not Allowed From a Read Task

Description

Task: *arg.*

The instruction is not allowed to execute in a read task.

Program ref: *arg.*

Continues on next page

Recommended actions

Remove the instruction.

41542, Program Stop**Description**

Task: *arg*.

Not possible to regain to path because of program stop in the system.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41543, Argument Error**Description**

Task: *arg*.

A loaddata has been defined, but is no longer available in the system.

Program ref: *arg*.

Probable causes

The reason for this error is one of the following:

- 1) The instruction GripLoad might have been run in a module that is no longer available in the system.
- 2) A movement instruction with an optional argument Tload might have been run in a module that is no longer available in the system.

Recommended actions

Be sure to run GripLoad load0, to reset loaddata. If using Tload optional argument in movement instructions, run SetSysData load0 to reset loaddata.

41544, Obsolete Instruction**Description**

Task: *arg*.

The procedure *arg* is obsolete. It will work for now, but might be removed in a later release. Use *arg* instead and you will have the same functionality.

Program ref: *arg*.

41545, Argument Error**Description**

Task: *arg*.

The argument *arg* may not be of type LOCAL PERS.

Program ref: *arg*.

Recommended actions

Remove the directive LOCAL from the data declaration.

41546, Argument Error**Description**

Task: *arg*.

The object *arg* does not exist in the system or is of type LOCAL PERS.

Program ref: *arg*.

Recommended actions

- Declare the object
- Remove the directive LOCAL from the data declaration

41547, Argument Error**Description**

Task: *arg* The \Corr switch cannot be used without the option Path Offset.

Program ref: *arg*.

Recommended actions

Remove the argument or install the option.

41548, Module Error**Description**

Task: *arg*.

The module you are trying to erase, *arg*, is active and thus cannot be removed.

Program ref: *arg*.

Recommended actions

Check that the module you want to erase is not active.

41549, Unexpected SyncMoveOn or SyncMoveOff**Description**

Task: *arg*.

Wrong path level. It is not possible to use SyncMoveOn or SyncMoveOff on StorePath level. Used *arg: arg*.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

41550, PathRecorder Start/Stop Error**Description**

Task: *arg*.

Unable to execute *arg*.

Program ref: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Ensure that a backward motion has not been initiated with PathRecMoveBwd without being terminated with PathRecMoveFwd.

41551, PathRecorder Move Error

Description

Task: *arg*.

Unable to execute *arg*. The given identifier cannot be reached.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The reason for this error is one of the following:

- 1) The PathRecorder has not been started.
- 2) The program pointer has been moved manually.
- 3) The limit of *arg* recorded move instructions has been exceeded.
- 4) Program execution has been limited by a WaitSyncTask or SyncMoveOff.

Recommended actions

Check RAPID program.

41552, PathRecorder Path Level Error

Description

Task: *arg*.

Cannot execute *arg* on current path level.

Program ref: *arg*.

Recommended actions

- Switch to trap-level.
- Execute StorePath to switch path level.

41553, Destroyed Data

Description

System data *arg* in one of the tasks has been changed. It is NOT allowed to change this data.

Recommended actions

The system has restored the data when it was started, but the program has to be checked. Remove where *arg* has been assigned a value.

41554, Synchronized Mode

Description

Task: *arg*.

Continues on next page

It is not possible to use the optional parameter \Conc when the system is in synchronized mode.

Program ref: *arg*.

Recommended actions

Remove the optional parameter \Conc from any move instruction used in synchronized mode.

41555, No Contact With I/O Device

Description

Task: *arg*.

There is no contact with the I/O device *arg*.

Program ref: *arg*.

Probable causes

The I/O device may have been deactivated. No power to the I/O device.

Recommended actions

Recovery: *arg*.

41556, No Contact With I/O Device

Description

Task: *arg*.

There is no contact with I/O device.

Program ref: *arg*.

Probable causes

The I/O device may have been deactivated. No power to the I/O device.

Recommended actions

Recovery: *arg*.

41557, Mechanical Unit not stopped

Description

Task: *arg*.

Not allowed to change run mode, if not all Motion tasks are stopped.

Program ref: *arg*.

Recommended actions

Do program stop and try again.

41558, Argument Switch Missing

Description

Task: *arg*.

An argument is missing to instruction *arg*.

Program ref: *arg*.

Recommended actions

Add switch SyncOrgMoveInst or SyncLastMoveInst to the instruction.

2) Program Pointer at circular instruction in combination with done MODPOS of any previous move instruction.

Program ref: *arg*.

41559, Not PERS variable**Description**

Task: *arg*.

The task list, *arg*, is either LOCAL or TASK persistent. It is not allowed. It has to be global.

Program ref: *arg*.

Recommended actions

Change the task list to PERS.

Consequences

The Program may not be started from the current position, because there is a risk that the robot might perform an unexpected movement.

Probable causes

One of following:

- 1) The RAPID program is missing an error handler or the error handler does not handle this specific error.
- 2) MODPOS operation done when not running in step or move step mode.

41560, No Start of Movement**Description**

Task: *arg*.

It was not possible to start the movement.

Program ref: *arg*.

Probable causes

- 1) There has been an emergency stop.
- 2) There was another error in the system.

Recommended actions

- 1) Reset the emergency stop, if there has been one.
- 2) Check former error messages for reason.

Recovery: *arg*.

Recommended actions

One of following:

- 1) Edit the program.
- 2) Move the program pointer to be able to start the program.

41563, Argument Error**Description**

Task: *arg*.

The mechanical unit *arg* specified in the WObj for this MOVE instruction is the same mechanical unit *arg* as the robot for this program task.

Program ref: *arg*.

Consequences

It is not possible that the robot moves the work object itself.

Recommended actions

Edit the used wobjdata.

41564, Not allowed to run from a Motion Task**Description**

Task: *arg*.

The instructions StopMove, StartMove and StopMoveReset with the option parameter \AllMotionTasks are not allowed to run from a Motion task.

Program ref: *arg*.

Probable causes

It is only allowed to do stop and restart of all movements in the system from a supervision program task running as a read (or background) program task.

Recommended actions

Remove the instruction.

41561, No Text in Function Key**Description**

Task: *arg*.

The instruction TPReadFK has no text in either of the function keys.

Program ref: *arg*.

Consequences

When the instruction is executing there will be no button available to press.

Recommended actions

Put a text in at least one of the function keys TPFK1 .. TPFK5

41562, Risk for faulty circular movement**Description**

Task: *arg*.

Risk for faulty circular movement because of:

- 1) An asynchronous process error has occurred and was not handled in any error handler.

It is only allowed to do stop and restart of all movements in the system from a supervision program task running as a read (or background) program task.

Recommended actions

Remove the instruction.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41565, Not allowed value

Description

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the value. It must be an integer between *arg* and *arg*.

41566, Signal exceeds max number of allowed bits

Description

Task: *arg*.

The signal *arg* is too big.

Program ref: *arg*.

Recommended actions

Group signals consisting of 23 bits or less can be represented by the num data type, and group signals of 32 bits or less can be represented by the dnum data type, if they are used in a RAPID program.

41567, Digital Output Break

Description

Task: *arg*.

A digital output interrupted the execution.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41568, Specified name is not a network

Description

Task: *arg*.

The network name *arg* doesn't exist.

Program ref: *arg*.

Probable causes

The I/O device name is misspelled or not defined.

Recommended actions

Recovery: *arg*.

41569, Socket error

Description

Task: *arg*.

The socket is already connected and cannot be used to listen for incoming connections.

Continues on next page

Program ref: *arg*.

Recommended actions

Use another socket to listen for incoming connections.

41570, Socket error

Description

Task: *arg*.

The socket cannot accept incoming connection requests since it is not set to listen state.

Program ref: *arg*.

Probable causes

SocketAccept is used before SocketListen.

Recommended actions

Set socket to listen for incoming connections before trying to accept.

41571, Socket error

Description

Task: *arg*.

The address and port is already in use and cannot be used by this socket.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41572, Socket error

Description

Task: *arg*.

Unexpected error creating socket. Check log for further messages of possible cause.

Program ref: *arg*.

Recommended actions

Move program pointer to main and restart program.

41573, Socket error

Description

Task: *arg*.

No more sockets can be created. The maximum number of concurrent sockets is 32.

Program ref: *arg*.

Recommended actions

Close one or more sockets, to allow a new socket to be created.

41574, Socket error

Description

Task: *arg.*

The socket must be created before it can be used in any socket instruction.

Program ref: *arg.*

Probable causes

The reason for this error is one of the following:

- 1) Socket not created at all.
- 2) PP movements has been done.
- 3) Start of program after power fail.
- 4) The socket has been closed after SocketCreate.

Recommended actions

Insert a SocketCreate instruction at a suitable place in the program before the socket is used.

Recovery: *arg.*

41575, Socket error

Description

Task: *arg.*

The specified address is invalid. The only valid addresses are the LAN address of the controller or the service port address, 192.168.125.1.

Program ref: *arg.*

Recommended actions

Specify the LAN address or the service port address.

41576, Socket error

Description

Task: *arg.*

The specified port is invalid.

Program ref: *arg.*

Recommended actions

It is recommended that a port number in the range 1025-4999 is used.

41577, Socket error

Description

Task: *arg.*

The timeout specified in the instruction is too low. The timeout is specified in seconds and must not be zero.

Program ref: *arg.*

Recommended actions

Use a timeout value greater than zero.

41578, Socket error

Description

Task: *arg.*

Unexpected error when connecting socket. Check event log for other messages for possible cause.

Program ref: *arg.*

Recommended actions

Move program pointer to Main and restart program.

41579, Socket error

Description

Task: *arg.*

The connection was refused by the remote host.

Program ref: *arg.*

41580, Socket error

Description

Task: *arg.*

The socket is already connected and cannot be connected again.

Program ref: *arg.*

Probable causes

SocketConnect has already been executed for the specified socket.

Recommended actions

Close the socket and recreate before connecting.

41581, Socket error

Description

Task: *arg.*

The instruction was not finished within the timeout period.

Program ref: *arg.*

Recommended actions

Use a higher timeout value or use an error handler to retry the instruction.

Recovery: *arg.*

41582, Socket error

Description

Task: *arg.*

Empty data was specified to be sent or as storage in receive.

Program ref: *arg.*

Recommended actions

Use a string, rawbyte or byte array with size greater than zero.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41583, Socket error

Description

Task: *arg.*

The specified data is too big.

Program ref: *arg.*

Recommended actions

A socket can handle at most 1024 bytes in one instruction.

41584, Socket error

Description

Task: *arg.*

The specified string or data to be sent is empty.

Program ref: *arg.*

Recommended actions

Check that the data is correct.

41585, Socket error

Description

Task: *arg.*

The number of bytes to send has to be a value bigger than zero.

Program ref: *arg.*

Recommended actions

Change the value for the optional parameter NoOfBytes to a value bigger than zero.

41586, Socket error

Description

Task: *arg.*

The specified number of bytes to be sent is longer than the length of the actual data.

Program ref: *arg.*

Recommended actions

Change the value for the optional parameter NoOfBytes to be less than or equal to the actual data. If all data should be sent remove the optional parameter.

41587, Socket error

Description

Task: *arg.*

An unexpected error occurred when sending data. Check the event log for other messages for the possible cause.

Program ref: *arg.*

Recommended actions

Move the program pointer to Main and restart the program.

Continues on next page

41590, Socket error

Description

Task: *arg.*

The byte array is invalid. A byte array can only contain integers between 0 and 255.

Program ref: *arg.*

Recommended actions

Change the byte array to contain valid data or use rawbytes to send complex data.

41591, Socket error

Description

Task: *arg.*

Unexpected error when trying to get socket state.

Program ref: *arg.*

Recommended actions

Move program pointer to Main and restart program.

41592, Socket error

Description

Task: *arg.*

No data was received.

Program ref: *arg.*

Probable causes

The connection may have been closed by the remote host.

Recommended actions

Move program pointer to Main and restart program.

41593, Socket error

Description

Task: *arg.*

The data received is too long to be stored in a string. The maximum length of data that can be stored in a string is 80 characters.

Program ref: *arg.*

Recommended actions

Use a byte array or rawbytes to receive data longer than 80 bytes.

41594, Socket error

Description

Task: *arg.*

The socket is not connected.

Program ref: *arg.*

Probable causes

For client, use SocketConnect before receiving/sending/peeking data. For server, use SocketAccept before receiving/sending/peeking data.

Recommended actions

Use SocketConnect or SocketAccept to connect socket before trying to receive/send/peek.

41595, Socket error**Description**

Task: *arg.*

The connection has been closed by the remote host.

Program ref: *arg.*

Recommended actions

Use error handler to re-establish connection before retrying to send/receive/peek.

Recovery: *arg.*

41596, Socket error**Description**

Task: *arg.*

Unexpected error binding socket.

Program ref: *arg.*

Recommended actions

Move program pointer to Main and restart program.

41597, Socket error**Description**

Task: *arg.*

The socket has already been bound to an address and cannot be bound again.

Program ref: *arg.*

Recommended actions

Close socket and recreate before trying to bind socket to a new address.

41598, Socket error**Description**

Task: *arg.*

Unexpected error trying to listen for connections.

Program ref: *arg.*

Recommended actions

Move program pointer to Main and restart program.

41599, Socket error**Description**

Task: *arg.*

The socket has not been bound to an address.

Program ref: *arg.*

Recommended actions

Use SocketBind to specify which address to listen for incoming connections.

41600, Socket error**Description**

Task: *arg.*

The specified client socket is already in use. The client socket must not be created before calling SocketAccept.

Program ref: *arg.*

Probable causes

SocketAccept has already been executed for the specified socket.

Recommended actions

Close the client socket before using it in the call to SocketAccept, or remove multiple SocketAccept with same client socket.

41601, Socket error**Description**

Task: *arg.*

Unexpected error accepting connection.

Program ref: *arg.*

Recommended actions

Move program pointer to Main and restart program.

41602, Socket error**Description**

Task: *arg.*

Unexpected error receiving data.

Program ref: *arg.*

Recommended actions

Move program pointer to Main and restart program.

41603, Socket error**Description**

Task: *arg.*

The socket has already been created. A socket can only be created once and must be closed before it can be created again.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Program ref: *arg.*

Recommended actions

Use another socket or close socket before creating.

41604, Socket error

Description

Task: *arg.*

The socket is already listening for incoming connections. A socket can only be used once to listen for incoming connections.

Program ref: *arg.*

Probable causes

Multiple use of `SocketListen` with same socket.

Recommended actions

Use another socket or close socket before using it again.

41605, Socket error

Description

Task: *arg.*

The socket is not valid anymore.

Program ref: *arg.*

Consequences

The program execution is immediately halted.

Probable causes

The socket used is not valid.

1) The *arg* has probably been copied with instruction *arg*. Then the original *arg* has been closed with *arg*. If using the copied *arg* you will have this problem.

2) A module that has been installed shared has a declaration of a variable of the data type `socketdev`. The variable has been used when creating a new socket. When moving PP to main, the `socketdev` variable keeps its value, but is not valid anymore.

Recommended actions

Use socket instructions when handling data types of *arg*. Do not declare and use `socketdev` variables in a shared module.

41606, Socket error

Description

Task: *arg.*

The socket type is of the type datagram protocol UDP/IP. Current instruction *arg* is only supported for stream type protocol TCP/IP.

Program ref: *arg.*

Consequences

The program execution is immediately halted.

Probable causes

The socket type used is not valid.

Recommended actions

Check how the socket was created.

41607, Socket error

Description

Task: *arg.*

The socket type is of the type stream type protocol TCP/IP. Current instruction *arg* is only supported for datagram protocol UDP/IP.

Program ref: *arg.*

Consequences

The program execution is immediately halted.

Probable causes

The socket type used is not valid.

Recommended actions

Check how the socket was created.

41611, UIMsgBox - No user or program action defined

Description

Task: *arg.*

The instruction `UIMsgBox` or function `UIMessageBox` has no user or program action defined. None of the option arguments `\Buttons`, `\BtnArray`, `\MaxTime`, `\DIBreak` or `\DOBBreak` are used.

Program ref: *arg.*

Consequences

The RAPID program will be executed for ever.

Recommended actions

Use one or several of the arguments `\Buttons`, `\BtnArray`, `\MaxTime`, `\DIBreak` or `\DOBBreak`.

Recovery: *arg.*

41612, MinValue greater than MaxValue

Description

Task: *arg.*

In function *arg*, the argument `\MinValue` is greater than `\MaxValue`.

Program ref: *arg.*

Consequences

Not possible to continue the program execution.

Continues on next page

Recommended actions

Change the RAPID program so argument \.MaxValue is greater than \.MinValue.

Recovery: *arg*.

41613, InitValue not within specified value range**Description**

Task: *arg*.

In function *arg*, the argument \InitValue is not specified within the range \.MaxValue ... \.MinValue.

Program ref: *arg*.

Consequences

Not possible to continue the program execution.

Recommended actions

Change the argument \InitValue so it's inside the value range.

Recovery: *arg*.

41614, InitValue is not an integer**Description**

Task: *arg*.

In function *arg*, the argument \InitValue is not an integer value as specified in argument \AsInteger.

Program ref: *arg*.

Consequences

The program execution cannot continue.

Recommended actions

Change the argument \InitValue to an integer.

Recovery: *arg*.

41615, Reference Error**Description**

Task: *arg*.

The datapos *arg* is undefined.

Program ref: *arg*.

Recommended actions

All datapos is retrieved with the function GetNextSym.

41616, Reference Error**Description**

Task: *arg*.

The taskid *arg* is unknown in the system.

Program ref: *arg*.

Recommended actions

Program tasks must be defined in the system parameter and not in the RAPID program. (Taskid can be used as a parameter when declaring a routine).

41617, Too intense frequency of Write Instructions**Description**

A high usage frequency of user interface write instructions, such as TPWrite, has forced the program execution to slow down.

Recommended actions

Decrease the usage frequency of user interface write instructions. Add wait instructions, such as WaitTime, when many write instructions are used in conjunction.

41618, Argument error buttondata**Description**

Task: *arg*.

The argument Buttons of type buttondata has not allowed value. Only allowed to use the predefined data of type buttondata.

Program ref: *arg*.

Probable causes

Buttondata must be:

- an integer
- have a value within the predefined range

Recommended actions

Edit the program.

41619, Argument error icondata**Description**

Task: *arg*.

The argument Icon of type icondata has not allowed value. Only allowed to use the predefined data of type icondata.

Program ref: *arg*.

Probable causes

Icondata must be:

- an integer
- have a value within the predefined range.

Recommended actions

Edit the program.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41620, Socket Error

Description

Task: *arg*.

The Socket Messaging subsystem is overloaded.

Program ref: *arg*.

Probable causes

This can happen if sockets are created and closed frequently and very rapidly.

Recommended actions

Try to rewrite the program in such a way that sockets are reused instead of closed and then recreated.

41621, StorePath Error

Description

Task: *arg*.

Instruction *arg* is used with *arg* switch in one or several tasks together with *arg* without *arg* switch.

Program ref: *arg*.

Consequences

The program execution is immediately halted.

Probable causes

Error in the RAPID programs.

Recommended actions

Check that no mix of StorePath and StorePath \KeepSync is used. Change the program. PP must be moved in all tasks before you can continue.

41622, Unexpected instruction

Description

Task: *arg*.

The instruction *arg* can only be used in between instruction *arg* and instruction *arg* (on store path level).

Program ref: *arg*.

Consequences

The program execution is immediately halted.

Probable causes

Error in the RAPID program.

Recommended actions

Check and change the RAPID program. PP must be moved in all tasks before you can continue.

41623, Faulty use of *arg*

Description

Task: *arg*.

Instruction *arg* is used multiple times, or the instruction is used when already in synchronized motion mode. *arg* suspends synchronized coordinated movements. *arg* resumes synchronized coordinated movements.

Program ref: *arg*.

Consequences

The program execution is immediately halted.

Probable causes

Error in the RAPID program.

Recommended actions

Check and change the RAPID program. PP must be moved in all tasks before you can continue.

41625, Unexpected *arg*

Description

Task: *arg*.

Instruction *arg* is used directly after instruction *arg*, or the system is not in synchronized motion mode. A change to independent motion mode cannot be done.

Program ref: *arg*.

Consequences

The program execution is immediately halted.

Probable causes

Error in the RAPID program.

Recommended actions

Check and change the RAPID program. PP must be moved in all tasks before you can continue.

41626, Unexpected *arg* *arg*

Description

Task: *arg* Instruction *arg* *arg* is used in independent motion mode.

Program ref: *arg*.

Consequences

The program execution is immediately halted.

Probable causes

Error in the RAPID program.

Recommended actions

Check and change the RAPID program. PP must be moved in all tasks before you can continue.

Continues on next page

41627, Faulty use of arg

Description

Task: *arg*.

arg is used on store path level and system was not in synchronized motion mode before *arg*.

Program ref: *arg*.

Consequences

The program execution is immediately halted.

Probable causes

Error in the RAPID program.

Recommended actions

Check and change the RAPID program. PP must be moved in all tasks before you can continue.

41630, Unsafe Synchronization

Description

Task: *arg*.

To reach safe synchronization functionality, variable *arg* should be used only one time, not in several *arg* or *arg* instructions.

Program ref: *arg*.

Consequences

Program tasks/movements may not always be synchronized.

Probable causes

Use of *arg* several times in the same program.

Recommended actions

Check and change the RAPID program.

41631, Instruction Error

Description

Task: *arg*.

The program is executing in an EVENT routine. It is not allowed to execute the current instruction in an EVENT routine with shelf *arg*.

Program ref: *arg*.

Recommended actions

Remove the instruction

41632, Argument does not exist

Description

Task: *arg*.

Only TP_LATEST is supported in TPSHOW instruction.

Program ref: *arg*.

Consequences

Using other argument than TP_LATEST, nothing will happen.

Recommended actions

Remove the instruction.

41633, Can only be used in an UNDO handler

Description

Task: *arg*.

The instruction *arg* can only be used in an UNDO handler.

Program ref: *arg*.

Consequences

Program execution will be stopped.

Recommended actions

Use another instruction and/or move this instruction to the UNDO handler.

41634, Unknown Task Name

Description

Task: *arg*.

The task name *arg* is unknown in the system.

Program ref: *arg*.

Consequences

It is not possible to execute this instruction with a task name that is not found in the system.

Probable causes

- 1) The program task is not defined in the system parameters.
- 2) The task name is wrong spelled.

Recommended actions

Recovery: *arg*.

41635, Unexpected SyncMoveOff

Description

Task: *arg*.

Unexpected SyncMoveOff (SyncID *arg*). The system is already in unsynchronized mode.

Program ref: *arg*.

Probable causes

Use of task lists that are non-global can cause this error.

Recommended actions

Remove the SyncMoveOff instruction. Every SyncMoveOn must be followed by one SyncMoveOff instruction. Check your task lists.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41636, Unexpected SyncMoveOff

Description

Task: *arg*.

Unexpected SyncMoveOff (Syncld *arg*) from Task not included in synchronized group.

Program ref: *arg*.

Probable causes

Use of task lists that are non-global can cause this error.

Recommended actions

Remove the SyncMoveOff instruction. Every SyncMoveOn must be followed by one SyncMoveOff instruction. Check your task lists.

41637, Task not active in task selection panel anymore

Description

Task: *arg*.

The task *arg* is not active in the task selection panel anymore. The task *arg* was active in task selection panel at start from main. Because of that not possible to pass this *arg* instruction.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The task *arg* has been deactivated in the task selection panel.

Recommended actions

- 1) Activate task *arg* in the task selection panel.
- 2) To permanent skip task *arg* for the rest of this cycle run the service routine SkipTaskExec. After that restart the instruction *arg*.

41638, Not allowed task activation

Description

Task: *arg*.

The task *arg* is active in the task selection panel. This task was not active in the task selection panel when start from main was done. It is not allowed to add tasks in the task selection panel after start from main.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

- 1) The task *arg* was not active when start from main was done.

2) Deactivation of task *arg* with service routine *arg*, but not deactivating the task in the task selection panel.

3) Activation of task *arg* that earlier was deactivated in task selection panel and deactivated with service routine *arg*.

Recommended actions

Move PP to main to reset tasks used at start from main. Then use the task selection panel to select which tasks that you want to execute.

41640, Move PP Warning

Description

Task: *arg*.

Move of program pointer when path is stored may cause problems if moved to a place after the path restore.

Consequences

Path may unintentionally stay in a stored state.

Probable causes

Stop of program when having a stored path. Then a PP movement within the program has been done.

Recommended actions

Ensure that restore of path is not skipped by moving PP to a RestoPath instruction if necessary.

41641, Move PP Warning

Description

Task: *arg*.

Move of program pointer when stop motion is active may cause problems if moved to a place after stop motion deactivation.

Consequences

Restart of motion may be blocked. Program execution may be waiting at motion instructions.

Probable causes

Stop of program when stop motion is active. Then a PP movement within the program has been done.

Recommended actions

Ensure that stop motion deactivation is not skipped.

41642, Argument Error

Description

Task: *arg*.

Argument *arg* not within range.

Program ref: *arg*.

Recommended actions

arg must be > 0 when *arg* = 0.

Continues on next page

41643, Argument Error

Description

Task: *arg*.

Argument *arg* not within range.

Program ref: *arg*.

Recommended actions

arg must be an integer when *arg* < 0

41644, Argument Error

Description

Task: *arg*.

Argument *arg* not within range.

Program ref: *arg*.

Recommended actions

arg must greater or equal to 0.

41645, Program Stopped from RAPID

Description

Task: *arg*.

Program and movement are stopped with System Stop from RAPID.

Program ref: *arg*.

Consequences

Due to a programmed System Stop in RAPID both program execution and movements are stopped. The problem causing the stop has preferable been presented in another log.

Recommended actions

Find out why the program has been stopped (maybe in other logs), correct the problem and restart the program.

41646, Program Blocked from RAPID

Description

Task: *arg*.

Program and movement are stopped and blocked with System Stop RAPID Block from RAPID.

Program ref: *arg*.

Consequences

Due to a programmed System Stop RAPID Block in RAPID both program execution and movements are stopped. The problem causing the stop has preferable been presented in another log. If the robot is performing a circular movement, the robot has to be moved to the beginning of the circular movement before restarting the program.

Recommended actions

Find out why the program has been blocked (maybe in other logs), correct the problem and move program pointer in all Motion tasks before restarting the program.

41647, Program Halted from RAPID

Description

Task: *arg*.

Program and movement are halted with System Halt from RAPID.

Program ref: *arg*.

Consequences

Due to a programmed System Halt in RAPID both program execution and movements are stopped. The problem causing the stop has preferable been presented in another log.

Recommended actions

Find out why the program has been halted (maybe in other logs), correct the problem and turn motors on before restarting the program.

41648, Execution Error

Description

Task: *arg*.

Not allowed to change run mode from forward to backward, from continues to stepwise or vice versa.

Program ref: *arg*.

Recommended actions

Select the original run mode and continue program execution.

41649, Incorrect Error Message

Description

Task: *arg*.

At least one of the arguments in the instruction *arg* exceeds the limitations described in the manual.

Program ref: *arg*.

Probable causes

The arguments to instruction *arg* contain limitations both on each string and the total amount of characters used in the instruction. This is described in the manual.

Recommended actions

Consult the manual and correct the arguments.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41650, Task already stopped by another task

Description

The non-Motion task *arg* has executed a StopMove instruction. No stop action has, however, been taken because the Motion task *arg* was already stopped by task *arg*.

Program ref: *arg*.

Consequences

The Motion task must be started, with the instruction StartMove, from the task that stopped it or the switch \AllMotionTasks has to be used in StartMove from this task.

41651, Ignored StartMove actions for task

Description

The non-Motion task *arg* has executed a StartMove instruction. The Motion task *arg* has, however, not been started.

Program ref: *arg*.

Consequences

No movements can be performed if the Motion task has been stopped by another non-Motion task.

Probable causes

- 1) The Motion task has not been stopped.
- 2) The Motion task was stopped by another non-Motion task *arg*. This time the cause was *arg*.

Recommended actions

Use the switch \AllMotionTasks in StartMove if this instruction should start a movement that is stopped by another non-Motion task.

41652, Forced StartMove action

Description

The non-Motion task *arg* has executed a StartMove instruction. The instruction discovered that the Motion task *arg* has been stopped by this task. That Motion task will be started to prevent inexplicable stopped movements.

Program ref: *arg*.

Probable causes

- 1) The Motion task has been stopped with the switch \AllMotionTasks active in the StopMove instruction but not in the StartMove instruction.
- 2) The StopMove instruction has been executed in synchronized mode and the StartMove in independent mode.

41653, Argument error CalcJointT

Description

Task: *arg*.

It is not possible to execute the function CalcJointT with argument \UseCurWObjPos, if the coordinated workobject moved by some mechanical unit is located in the same task as the TCP robot or if the workobject is not moved by any mechanical unit at all.

Program ref: *arg*.

Recommended actions

Remove the argument \UseCurWObjPos, so can the function CalcJointT be executed and the calculation can be done with data solely from the RAPID program.

41654, Execution error CalcJointT

Description

Task: *arg*.

It was not possible to execute the function CalcJointT with argument \UseCurWObjPos, because the mechanical unit *arg* was moving at the time of execution of CalcJointT.

Program ref: *arg*.

Recommended actions

Function CalcJointT with argument \UseCurWObjPos can only be executed without error, if the coordinated workobject moved by another task is standing still.

Recovery: *arg*.

41655, Argument not a Motion task

Description

Task: *arg*.

The function/instruction *arg* has been used with an argument that refer to a task, *arg*. That task is not a Motion task (controlling mechanical units) and can therefore not be used.

Program ref: *arg*.

Probable causes

arg with argument \TaskRef or \TaskName can only be used without errors if the task that the arguments refer to is a Motion task.

Recommended actions

Change the argument \TaskRef or \TaskName or remove it and restart the program execution.

Recovery: *arg*.

Continues on next page

41656, Not allowed value

Description

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check and change the value. It must be between *arg* and *arg*.

41657, File Access Error

Description

Task: *arg*.

Could not access the file/device *arg*.

Program ref: *arg*.

Probable causes

- The path or filename is wrong.
- The maximum number of simultaneously opened files is exceeded.
- The disk is full.
- Function does not support check of selected device.

Recommended actions

- Check the path or filename.
- Check the disk space.

Recovery: *arg*.

41658, Program task is in StopMove state

Description

Task: *arg*.

No movement will be performed in this Motion task, because the task is currently set in StopMove state ordered by some non-Motion task.

Consequences

Not possible to start any movements.

Probable causes

Some non-Motion task connected to this Motion task has set the task in StopMove state.

Recommended actions

To perform movements in this Motion task, the StopMove state must be reset by the responsible non-Motion task with one of the following actions:

- 1) Execute StartMove.
- 2) Start the non-Motion task from main. a) Do power off-on if semi static non-Motion task. b) Do installation start if static non-Motion task. c) Set PP to main if normal non-Motion task.

41660, No space left for the new view

Description

Task: *arg*.

Maximum number of views has been exceeded. There is no space left on the FlexPendant for the new view.

Program ref: *arg*.

Consequences

The view will not be launched.

Probable causes

Too many open views.

Recommended actions

Close one view and try again.

Recovery: *arg*.

41661, Assembly could not be found

Description

Task: *arg*

- 1) The assembly could not be found, or does not exist.
- 2) The FlexPendant Interface option is missing. Status *arg*.

Program ref: *arg*.

Consequences

The view will not be launched.

Probable causes

- 1) The assembly *arg* could not be found.
- 2) The system image does not include the required option FlexPendant Interface.

Recommended actions

- 1) Check inparameters. Make sure that the modules been loaded correctly to the robot controller.

- 2) Check that FlexPendant Interface option is used.

Recovery: *arg*.

41662, Assembly could not be loaded

Description

Task: *arg*.

The assembly was found but could not be loaded. Status *arg*.

Program ref: *arg*.

Consequences

The view will not be launched.

Recommended actions

Make sure that the loaded modules are executable files for the FlexPendant.

Recovery: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41663, Instance could not be created

Description

Task: *arg*.

The assembly exist but no new instance could be created.

Status *arg*.

Program ref: *arg*.

Consequences

The view will not be launched.

Recommended actions

Make sure that the loaded modules are executable files for the FlexPendant.

Recovery: *arg*.

41664, The typename is invalid for this assembly

Description

Task: *arg*.

The inparameter *arg* is invalid. The typename does not match the assembly. Status *arg*.

Program ref: *arg*.

Consequences

The view will not be launched.

Recommended actions

Check the inparameters.

Recovery: *arg*.

41665, arg does not match assembly to load

Description

Task: *arg* The type or name of the assembly does not match with the used *arg*. Status *arg*.

Program ref: *arg*.

Consequences

The view will not be launched.

Probable causes

Use of *arg* without setting it to 0 first.

Recommended actions

Set *arg* to 0 before using it.

Recovery: *arg*.

41666, Fatal UIShow error

Description

Task: *arg*.

Unknown error code *arg* received.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Report this to ABB Robotics.

41667, Fatal UI error

Description

Task: *arg*.

Instruction or function used with switch *arg* and without optional argument *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

An illegal combination of optional arguments and switches was used.

Recommended actions

Correct the RAPID program.

41670, Entire Array Not Allowed As Argument

Description

Task: *arg*.

The argument *arg* is of data type any type and can for that reason only be checked during runtime. An entire array cannot be used as argument even if the array is of right data type.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Replace the array with a valid argument.

41671, Too high poll rate

Description

Task: *arg*.

The specified poll rate is too high for the robot system.

Program ref: *arg*.

Consequences

The system can be overloaded.

Recommended actions

Change instruction WaitUntil, argument \PollRate to a value greater than or equal to 0.01 s.

Continues on next page

41672, Invalid Combination

Description

Task: *arg*.

Invalid combination of parameters in Trigg.

Program ref: *arg*.

Recommended actions

Either run Trigg without \Time optional argument, or use TriggRampAO with optional argument \Time to specify that the RampLength is seconds instead of distance.

Recovery: *arg*.

41673, Index Out Of Bounds

Description

Task: *arg*.

Index for cfg instance was out of bounds.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.
Recovery: *arg*.

41677, Device access error

Description

Task: *arg*.

Unable to write to file: *arg*, the disc is full.

Program ref: *arg*.

Recommended actions

Make sure there are enough free space on the disc.
Recovery: *arg*.

41674, Value Out Of Bounds

Description

Task: *arg*.

Parameter *arg* is not in the range of 0 to 100.

Program ref: *arg*.

Recommended actions

Check and change the RAPID program.
Recovery: *arg*.

41678, Device access error

Description

Task: *arg*.

Unable to write to file: *arg*, The file is write-protected.

Program ref: *arg*.

Recommended actions

Remove the write protection of the file or select a different filename.
Recovery: *arg*.

41675, Not Integer

Description

Task: *arg*.

Parameter *arg* is not an integer.

Program ref: *arg*.

Recommended actions

Check the RAPID program, or use ERROR handler
Recovery: *arg*.

41680, String too long

Description

Task: *arg*.

The string *arg* exceeds the maximum number of characters allowed for a module.

Program ref: *arg*.

Recommended actions

Change the string for module name.
Recovery: *arg*.

41676, Device access error

Description

Task:*arg* Unable to open File or Serial channel, '*arg*' does not exist.

Program ref: *arg*.

Recommended actions

Check file or serial channel name.

41682, Too many subscriptions from I/O

Description

Task: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

The number of simultaneous subscriptions on signal events has been exceeded.

Program ref: *arg*.

Recommended actions

Remove some subscriptions on signals or change the time for the event. (i.e. any ISignalXX or TriggIO)

41683, Argument Error

Description

Task: *arg*.

The argument *arg* must be given when searching for a not named parameter.

Program ref: *arg*.

Recommended actions

Add the parameter *arg* to the instruction.

41684, Value Error

Description

Task: *arg*.

The argument *arg* is outside the range of value type unsigned long.

Program ref: *arg*.

Probable causes

The value is too large.

Recommended actions

Use a smaller value for *arg*.

41685, Not valid value

Description

Task: *arg*.

A wrong combination of switch and value is used. The signal can have values between:

Min: *arg*.

Max: *arg*.

Switch and value used: *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Wrong value used, or wrong switch used.

Recommended actions

Change the value used, or change the switch argument.

41687, File Open Error

Description

Task: *arg*.

Unable to open *arg*.

Program ref: *arg*. An unknown error occurred while opening the file.

Probable causes

- If the file was located on an USB disk, check that the disk is not removed, or has too many files in root folder.
- Check that the given file is not a directory.

Recommended actions

Do a check of Probable Causes.

Recovery: *arg*.

41688, Invalid Argument

Description

Task: *arg*.

Inparameter *arg* is declared as a PERS.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Using a PERS in argument *arg* to instruction *arg*.

Recommended actions

Replace the PERS with a valid argument.

41690, Parameter Error

Description

Task: *arg*.

The argument *arg* is of the type *arg* and is not valid to use.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Check the data type. Non-value, semi-value types or motsetdata data type cannot be used.

41691, RMQ Error - Client name not valid

Description

Task: *arg*.

The name *arg* cannot be found. It is not a valid RMQ client name.

Program ref: *arg*.

Continues on next page

Probable causes

A non-valid name is used.

Recommended actions

Change name to search for.

Recovery: *arg*.

41692, RMQ Error - Not valid Slot**Description**

Task: *arg*.

The *arg* used is not valid.

Program ref: *arg*.

Consequences

Communication with client with current *arg* is no longer possible.

Probable causes

- 1) The *arg* has not been initialized.
 - 2) The destination slot is not valid anymore. This can happen if a remote client has disconnected from the controller.
 - 3) Instruction RMQSendWait was restarted after a power fail.
- When the instruction is restarted, the *arg* is set to 0.

Recommended actions

Recovery: *arg*.

41693, RMQ Error - Max size for message exceeded**Description**

Task: *arg*.

The size of the data in *arg* exceeds maximum size.

Program ref: *arg*.

Consequences

The message will not be sent.

Probable causes

Trying to send larger messages than *arg*. Due to limitations in RMQ, such big messages cannot be sent.

Recommended actions

Send smaller messages.

Recovery: *arg*.

41694, RMQ Error - Not equal data types**Description**

Task: *arg*.

The data type in the rmqmessage is of the type *arg* and the data type in argument Data is of the type *arg*.

Program ref: *arg*.

Consequences

No data can be fetched.

Probable causes

- 1) The data type in the rmqmessage is of type *arg* and the data type used in argument Data is of type *arg*.
- 2) If the data types has equal names, the structure of the data can be different.

Recommended actions

1) Use data type *arg* in argument Data.

2) Check that the data types are equal defined in both sender and receiver code.

Recovery: *arg*.

41695, RMQ Error - Not equal dimensions on data**Description**

Task: *arg*.

The data types are equal, but the dimensions differs between the data in the message and the parameter used in argument *arg*.

Program ref: *arg*.

Consequences

The data could not be copied.

Recommended actions

Use a parameter in argument *arg* with equal dimensions as the data in the message.

Recovery: *arg*.

41696, RMQ Error - Not valid use of instruction**Description**

Task: *arg*.

The instruction *arg* is only supported on TRAP level.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Instruction *arg* is used either on user execution level or normal execution level.

Recommended actions

Remove instruction, or move it to a TRAP routine.

41697, RMQ Error - No RMQ configured**Description**

Task: *arg*.

No RMQ is configured for task *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

No configuration has been added for the RAPID Message Queue.

Recommended actions

Add configuration for the RAPID Message Queue.

41698, RMQ Error - Faulty use of instruction

Description

Task: *arg*.

Instruction *arg* can only be used on normal level, not in a TRAP routine or service routine.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Instruction *arg* used on wrong level.

Recommended actions

Use instruction on normal level.

41699, RMQ Error - Max size for message exceeded

Description

Task: *arg*.

The size of the data in *arg* exceeds maximum size.

Program ref: *arg*.

Consequences

The message will not be sent.

Probable causes

Trying to send larger messages than allowed. The receiving client is not configured to receive the size of the message sent.

Recommended actions

Change the size of the RMQ for the receiver, or send smaller messages.

Recovery: *arg*.

41700, RMQ Error - Interrupt setup failed

Description

Task: *arg*.

Two different interrupt identities cannot be used for the same data type in instruction *arg*. Each data type need a unique interrupt identity and unique TRAP routine.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Same data type is used in two *arg* instructions with two different interrupt identities.

Recommended actions

A unique interrupt identity is needed for each data type when order and enable interrupts for a specific data type.

41701, RMQ Error - No message to collect

Description

Task: *arg*.

Instruction *arg* failed. There was no message to collect.

Program ref: *arg*.

Consequences

No message was collected.

Probable causes

- 1) This can happen if the power fail occur between the trap was ordered and the instruction *arg* was executed.
- 2) If multiple use of *arg* in a TRAP routine.
- 3) If using *arg* in a TRAP routine that execute without any new message in the RMQ.

Recommended actions

Recovery: *arg*.

41702, RMQ Error - *arg* not valid

Description

Task: *arg*.

Use of non-valid data in argument *arg*.

Program ref: *arg*.

Consequences

The program execution is immediately stopped

Probable causes

Use of a variable *arg* that not contain any valid data. The variable has only been initialized, no valid data has been copied to the variable.

Recommended actions

Check the RAPID program.

Continues on next page

41703, RMQ Error - Data could not be copied

Description

Task: *arg*.

The data type *arg* exceeds the maximum size supported for the RMQ configured for task *arg*.

Program ref: *arg*.

Consequences

No message has been received.

Probable causes

The RMQ of the receiving task is not configured for the size of the data sent. The sending client have sent data that is bigger than the size the RMQ for task *arg* can receive.

Recommended actions

Increase the size of the RMQ for task *arg*. Or, send less data.

Recovery: *arg*.

2) The client has received the message, and in the answer sent a data type not matching with the specified data type used in *arg* of instruction *arg*.

3) The client has received the message. The answer is delayed so the time out time for instruction *arg* expired.

Recommended actions

1) Check the client program.

2) Increase the waiting time for instruction *arg*.

Recovery: *arg*.

41704, RMQ Error - Full Queue

Description

Task: *arg*.

The client named *arg* cannot receive more messages.

Program ref: *arg*.

Consequences

The sent message will be thrown.

Probable causes

The client does not receive in the same pace as the sender is sending messages. If using instruction *arg*, you might need a wait time between each *arg* instruction.

Recommended actions

The client should receive messages to make room for new messages. Or the sender should limit the number of messages sent.

Recovery: *arg*.

41706, RMQ Error - Max Time Expired

Description

Task: *arg*.

The programmed waiting time has expired.

Program ref: *arg*.

Consequences

No message has been received.

Probable causes

The time out time for instruction *arg* expired.

Recommended actions

Increase the waiting time for instruction *arg*.

Recovery: *arg*.

41707, RMQ Error - Instruction invalid in current mode

Description

Task: *arg*.

arg is only allowed when RMQ is configured in *arg* mode.

Program ref: *arg*.

Consequences

The program execution is immediately stopped.

Probable causes

The RMQ is configured in *arg* mode.

Recommended actions

Change the configuration of the RAPID Message Queue in *arg* to *arg* mode, or use an instruction that is allowed in the current mode.

41705, RMQ Error - Max Time Expired

Description

Task: *arg*.

The programmed waiting time has expired.

Program ref: *arg*.

Consequences

There is no guarantee that the message has arrived to the client.

Probable causes

1) The client that should receive the message is not interested of receiving data of the specified data type. The message has been discarded.

41708, RMQ Error - Invalid message

Description

Task: *arg*.

The received RMQ message was invalid.

Program ref: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Consequences

The received RMQ message was discarded.

Probable causes

A received RMQ message had a corrupt header or data part.

Recommended actions

Recovery: *arg.*

41711, Value is not percent

Description

Task: *arg.*

The value of argument *arg* is not a valid percent.

Program ref: *arg.*

Recommended actions

Check that the value is in the range of 0 to 100.

41712, Argument Error

Description

Task: *arg.*

Tooldata *arg* has been defined, but is no longer available in the system.

Program ref: *arg.*

Probable causes

Tooldata might have been defined in a module that is no longer available in the system.

41713, Argument Error

Description

Task: *arg.*

Wobjdata *arg* has been defined, but is no longer available in the system.

Program ref: *arg.*

Consequences

Wobjdata might have been defined in a module that is no longer available in the system.

41714, Too many error events

Description

Execution of task *arg* has stopped. There are too many unhandled error events in queue. The system can only handle one error event at a time.

Consequences

The system goes to blocked state and cannot be restarted before moving the program pointer to an arbitrary position.

Probable causes

A power off or restart of the controller occurred while handling a process error.

Recommended actions

Never restart the controller while handling a process error. If a restart is needed, first move PP to Main in all tasks to reset the process error.

41715, Invalid Direction

Description

Task: *arg.*

The argument *arg* must be either CSS_X, CSS_Y, CSS_Z, CSS_XY, CSS_XZ, CSS_YZ, CSS_XYZ, CSS_XYZR.

Program ref: *arg.*

Recommended actions

Check the value of *arg.*

41716, Invalid Offset Direction

Description

Task: *arg.*

The argument *arg* must be either CSS_POSX, CSS_NEGX, CSS_POSY, CSS_NEGY, CSS_POSZ, CSS_NEGZ.

Program ref: *arg.*

Recommended actions

Check the value of *arg.*

41717, Too Low Value

Description

Task: *arg.*

The value of argument *arg* is too low.

Program ref: *arg.*

Recommended actions

Increase the value of *arg.*

41718, Invalid Dimensions

Description

Task: *arg.*

Dimension *arg* on searched symbol is incompatible with dimension *arg* in argument.

Program ref: *arg.* A dimension of '{0}' means given symbol is of non-array type.

Recommended actions

Recovery: *arg.*

Continues on next page

41719, Illegal Parameter

Description

Task: *arg*.

The symbol in argument *arg* is an array from a parameter.
Arrays from parameters are illegal to use in
SetDataVal/GetDataVal.
Program ref: *arg*.

41720, Path Not In Stop Point

Description

Task: *arg*.

The path did not finish for the following task(s): *arg* make sure
the task is running.

Program ref: *arg*.

Probable causes

The task is not running or the movement has been stopped.

Recommended actions

Recovery: *arg*.

41721, Invalid Argument

Description

Task: *arg*.

The type *arg* in argument *arg* is invalid.

Program ref: *arg*.

Recommended actions

Change the type to a valid one (*arg*).

41722, Too High Value

Description

Task: *arg*.

The value of argument *arg* is too high. The value must be
between *arg* and *arg*.

Program ref: *arg*.

41723, Network is in error state

Description

Task: *arg*.

The I/O device *arg* cannot be activated. The network *arg* is in
error state.

Program ref: *arg*.

Consequences

Device *arg* could not be activated.

Probable causes

Network is in error state.

Recommended actions

Recovery: *arg*.

41724, Current Work Object is Invalid

Description

Task: *arg*.

Cartesian Soft Servo Activation is not allowed with a moving
work object. Only a programmed user frame is allowed.

Program ref: *arg*.

41725, Invalid Configuration Settings

Description

Task: *arg*.

The configuration parameters for Cartesian Soft Servo are
invalid. The current combination can lead to unstable behavior.

Program ref: *arg*.

Recommended actions

Change the configuration for Cartesian Soft Servo

41726, Ignored StopMoveReset actions for task

Description

Task: *arg*.

The StopMoveReset instruction had no impact on the system.

Program ref: *arg*.

Consequences

The StopMove was not reset.

Probable causes

- 1) The Motion task has not been stopped.
- 2) The Motion task was stopped by another non-Motion task:
arg. This time the cause was *arg*.

Recommended actions

Use the switch \AllMotionTasks in StopMoveReset if this
instruction should reset a StopMove from another non-Motion
task.

41727, The size cannot be represented in a num

Description

Task: *arg*.

When using instruction *arg* to read the size of the file system,
it was detected that the value is too big to be set in a num.

Program ref: *arg*.

Consequences

The size cannot be read.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Probable causes

The value cannot be represented in a num.

Recommended actions

Use a switch to specify another unit to show the size in.

Recovery: *arg*.

41730, Signal exceeds max number of allowed bits

Description

Task: *arg*.

The signal *arg* is too big. If using signals over 23 bits, use the data type triggiosdnum that accept signals up to 32 bits.

Program ref: *arg*.

Recommended actions

Group signals can have 23 bits or less if using datatype triggios in *arg* instruction.

41731, Signal name undefined

Description

Task: *arg*.

The signal *arg* is unknown in the system.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The signal must be defined in the system parameters.

Recommended actions

Define the signal in the system parameters.

41732, Too many trigs used

Description

Task: *arg*.

Too many trigs has been set up for instruction *arg*. The limit is *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Remove some trig actions in *arg* instruction.

41737, Instruction order Error

Description

Task: *arg*.

Continues on next page

The instruction *arg* needs to be executed before instruction *arg*.

Program ref: *arg*.

Probable causes

Instruction *arg* was executed before instruction *arg*.

Recommended actions

Execute instructions in right order.

Recovery: *arg*.

41738, Wrist Interpolation option needed

Description

Task: *arg*.

Instruction *arg* is used with a switch that requires option Wrist Interpolation.

Program ref: *arg*.

Consequences

The program execution is immediately stopped.

Probable causes

Missing a RobotWare option.

Recommended actions

Do not use any of the following switches: *arg*.

41739, StorePath required

Description

Task: *arg*.

Instruction *arg* is executing in an error handler or a trap routine.

Use *arg* before using a movement instruction on other level than base.

Program ref: *arg*.

Probable causes

A movement instruction executed without having the path stored.

Recommended actions

Execute *arg* before using movement instruction *arg*. Read Programming type examples in the RAPID manual to see how to use movement instructions in TRAP routines and error handlers.

41740, Load Identification failed

Description

Task: *arg*.

WARNING! Not possible to identify the mass for the *arg* because of too small weight for automatic load identification.

Program ref: *arg*.

Recommended actions

Do a manually estimation of the actual load and manually edit the RAPID program.

41741, Calculation overflow

Description

Task: *arg*.

The calculation result is not within the range 0 - 4294967295.

Program ref: *arg*.

Consequences

The calculation will return error.

Probable causes

The values in the operation is probably too big.

Recommended actions

Recovery: *arg*.

41742, Negative subtraction

Description

Task: *arg*.

The subtraction result is negative.

Program ref: *arg*.

Consequences

The calculation will return error.

Probable causes

The first value in the subtraction is smaller than the second value.

Recommended actions

Make sure the first value is larger than the second upon subtraction.

Recovery: *arg*.

41743, Division with zero

Description

Task: *arg*.

Division with zero.

Program ref: *arg*.

Consequences

Calculation will return error.

Probable causes

Division with zero.

Recommended actions

Recovery: *arg*.

41744, Instruction Error

Description

Task: *arg*.

The program is executing in an ERROR handler. It is not allowed to execute the instruction *arg* in an ERROR handler.

Program ref: *arg*.

Recommended actions

Remove the instruction

41745, Instruction Error

Description

Task: *arg*.

The program is executing in a BACKWARD handler. It is not allowed to execute the instruction *arg* in a BACKWARD handler.

Program ref: *arg*.

Recommended actions

Remove the instruction

41746, Instruction Error

Description

Task: *arg*.

The program is executing at USER level, i.e. in an event routine or a service routine. It is not allowed to execute the instruction *arg* at USER level.

Program ref: *arg*.

Recommended actions

Remove the instruction

41747, Process signal off

Description

Task: *arg*.

The process signal *arg* is set to off (0).

Program ref: *arg*.

Consequences

A recoverable error ERR_PROCSIGNAL_OFF is thrown.

Probable causes

The optional argument \ProcSignal has been used for the instruction ProcerrRecovery. The signal makes it possible for the user to turn on/off the instruction ProcerrRecovery.

Recommended actions

Add an error handler for ERR_PROCSIGNAL_OFF error or remove the optional argument \ProcSignal from the instruction call.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41748, Value Error

Description

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Recommended actions

Check the RAPID program.

Recovery: *arg*.

41749, Value Error

Description

Task: *arg*.

The value for parameter *arg* is out of limit.

Program ref: *arg*.

Probable causes

The value is too large.

Recommended actions

Use a smaller value for *arg*.

Recovery: *arg*.

41750, Not allowed value

Description

Task: *arg*.

Illegal value in argument *arg*.

Program ref: *arg*.

Probable causes

1) The system has interpreted the expression as a num data type, and the value is above the maximum integer value for num (value 8388608).

2) The system has interpreted the expression as a dnum data type, and the value is above the maximum integer value for a dnum (value 4503599627370496).

Recommended actions

Check and change the value. The parameter name *arg* can give you information about how the system interpreted the indata.

41751, Array size error

Description

Task: *arg*.

The array *arg* is not big enough to fit *arg* number of elements.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Change the size of the array to fit all elements.

41752, Num Limit Error

Description

Task: *arg*.

The value for parameter *arg* is out of limit.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41753, Invalid path level

Description

Task: *arg*.

Program ref: *arg* *arg* requires the robot to run at the first path level.

Consequences

The program execution is stopped immediately.

Probable causes

Executing *arg* on wrong path level.

Recommended actions

Check the RAPID program.

41754, Path Recorder cleared

Description

Task: *arg*.

WARNING! Path Recorder is cleared. The stored path is cleared before doing friction identification.

Program ref: *arg*.

41755, Path time too long

Description

Task: *arg*.

Execution time is too long for friction tuning. *arg* > *arg*, which is the maximum time in seconds.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Increase speed or shorten the length of the path.

Continues on next page

41756, Missing FrIdlInit

Description

Task: *arg*.

arg must be executed before *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

41757, Mechanical unit not found

Description

Task: *arg*.

Mechanical unit *arg* not found.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Specify another mechanical unit.

41758, Array too small

Description

Task: *arg*.

The array used is too small. The size of the array *arg* must be equal to *arg*, the number of robot axes.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Increase the size of the array *arg*.

41759, Signal exceeds max number of allowed bits

Description

Task: *arg*.

The signal *arg* is too big.

Program ref: *arg*.

Recommended actions

Group signals consisting of 23 bits or less can be used in IF statements and assigned to the num datatype. Group signals consisting of 24 - 32 bits cannot be used in IF statements.

Instead use the functions *arg* or *arg*.

41760, *arg* when in synchronized mode

Description

Task: *arg* *arg* cannot be used together with synchronized movement.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Remove any SyncMoveOn between *arg* and *arg*.

41761, Value out of range

Description

Task: *arg*.

The integer value *arg* cannot be copied to a *arg* datatype. The value is out of limit for the data type *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Use a variable of the type *arg* instead of a variable of type *arg*.

41762, The argument string value is invalid

Description

Task: *arg*.

The argument string *arg* is invalid and cannot be converted.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

- 1) The only valid letter characters is a-f and A-F and only for HexToDec.
- 2) The ., - and + characters is not valid for HexToDec.
- 3) The - character is not valid for DecToHex.
- 4) The value is not a valid integer.

Recommended actions

Edit the argument value string so it gets valid and can be converted.

41763, The argument string value is too high

Description

Task: *arg*.

The argument string *arg* value exceeds the highest supported value in the system.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Program ref: *arg*.

Consequences

The argument value string is converted but it is set to the highest supported value (9223372036854775807).

Probable causes

The argument string value exceeds the highest supported value.

Recommended actions

Edit the argument value string so it does not exceed the highest supported value.

41764, Wrong combination in *arg*

Description

Task: *arg*.

When using instruction *arg*, you cannot add a dnum variable/persistent to a num variable/persistent.

Program ref: *arg*.

Probable causes

The value to be added is of the type dnum, and the variable/persistent that should be changed is a num.

Recommended actions

Read about *arg* in RAPID reference manual

41765, The argument value is too high

Description

Task: *arg*.

Too high value in argument *arg*.

Program ref: *arg*.

Probable causes

The argument value exceeds the highest supported value. (*arg*)

Recommended actions

Decrease the value for argument *arg*.

Recovery: *arg*.

41766, The precision will be lost

Description

Task: *arg*.

Optional argument *arg* is used, and the group signal has *arg* bits. This can cause loss of precision in the variable used in optional argument *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Argument *arg* is used, and it is a risk that the precision of the value is lost. Group signals consisting of 23 bits or less can be represented by the num data type, and group signals of 32 bits or less can be represented by the dnum data type, if they are used in a RAPID program

Recommended actions

To avoid loss of precision in the used variable in *arg*, use optional argument *arg* instead.

41767, Instruction Error

Description

Task: *arg*.

The instruction *arg* is used from a non-Motion task, and the Motion task that task *arg* is connected to does not control a TCP-robot.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

arg is used in a non-Motion task that is connected to a Motion task that does not control a TCP-robot.

Recommended actions

- Check the configuration.
- The instruction must be removed. The non-Motion task *arg* is connected to a Motion task that does not control a TCP-robot.

41768, Switch is missing

Description

Task: *arg*.

The switch *arg* is required when executing instruction/function.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Add switch when using instruction/function.

41769, Service data not found

Description

Task: *arg*.

The service data for the mechanical unit *arg* could not be found.

Program ref: *arg*.

Consequences

No service data is read.

Continues on next page

Probable causes

There is no such service data present for this mechanical unit.

Recommended actions

Check that the specified service data is defined for the mechanical unit.

41770, System Access Error**Description**

Task: *arg*.

Unknown camera unit *arg*. The data of type cameradev is unknown for the system.

Program ref: *arg*.

Probable causes

Data of type cameradev has been declared in the program.

Recommended actions

Remove the declaration of cameradev data in the program and use one of the predefined data of type cameradev (automatically defined by the system).

41771, Cancel load of job**Description**

The ongoing loading of the job *arg* for camera *arg* has been cancelled.

Consequences

The job may or may not have been successfully loaded into the camera.

Probable causes

There has been a PP movement in the RAPID program before the job was loaded correctly into the camera. A job is not completely loaded into the camera before the instruction *arg* has been executed.

Recommended actions

Load a new job into the camera named *arg*.

41772, Parameter Error**Description**

Task: *arg*.

None of the optional arguments listed below are specified in instruction.

Program ref: *arg* Missing one of these optional arguments:

arg

arg

arg.

Consequences

The program execution is stopped immediately.

Recommended actions

Specify at least one of the arguments.

41773, Timeout**Description**

Task: *arg*.

A timeout interrupted the execution of instruction using camera *arg*.

Program ref: *arg*.

Recommended actions

Use a higher timeout value or use an error handler to retry instruction.

Recovery: *arg*.

41774, Type error**Description**

Task: *arg*.

It is not possible to set value *arg* into a variable of current type (*arg*). Check the used optional argument, and use an argument with proper type.

Program ref: *arg*.

Probable causes

Wrong argument type used.

Recommended actions

Check the RAPID program, and use other type of variable to store the data in.

Recovery: *arg*.

41775, Ongoing request towards camera**Description**

Task: *arg*.

It is not allowed to have several parallel requests towards a camera.

Program ref: *arg*.

Consequences

The request was not performed.

Probable causes

There are more than one request towards the camera named *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Wait for a while, and then try again. If trying to access the same camera from different tasks, instruction WaitTestAndSet can be used to prevent access of the camera at the same time.

Recovery: *arg.*

41776, No more data available

Description

Task: *arg.*

No more data available for camera *arg.*

Program ref: *arg.*

Consequences

No data could be read.

Probable causes

The reasons are:

- 1) No more data is available.
- 2) There is no result matching the used *arg.*

Recommended actions

- 1) Check that the camera has requested an image.
- 2) Check that the result map configured from "output to RAPID" is complete. If a *arg* is used, check that it is the correct variable that is used.

Recovery: *arg.*

41777, The camera is not connected

Description

Task: *arg.*

The camera *arg* is not connected.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Probable causes

The reasons for this error can be:

- 1) The camera is not connected to the controller.
- 2) There is no power to the camera.
- 3) The camera's IP address is not valid.
- 4) The camera does not have a name.
- 5) The camera is not connected to the proper network interface. Normally only the service port is supported.

Recommended actions

- 1) Check cabling between robot controller and camera.
- 2) Check that the LED power and link indicators on the camera are active.
- 3) Use RobotStudio to check that the IP address has been configured correctly.

Continues on next page

4) Set a valid name to the camera.

41778, Failed to load job

Description

Task: *arg.*

Failed to load the job named *arg* for camera *arg*.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Probable causes

- 1) The job *arg* is incorrect or unavailable.
- 2) The camera *arg* is out of memory.

Recommended actions

Check that the job named *arg* exists on the camera.

41779, Parameter cannot be modified

Description

Task: *arg.*

The parameter written to the camera *arg* with instruction *arg* cannot be modified, the parameter is not recognized or RAPID data used is of wrong data type.

Program ref: *arg.*

Consequences

Parameter not modified.

Probable causes

The reasons are:

- 1) Wrong optional RAPID argument used.
- 2) Value is out of range.
- 3) A cell with specified name does not exist.
- 4) The cells needs to be of type EditInt, EditFloat or EditString.
- 5) Trying to set wrong type to the cell, e.g. setting a string value to a parameter that is not a string.

Recommended actions

Check the RAPID program, and use an optional argument of correct data type and a value within the supported range.

Recovery: *arg.*

41780, Camera is in program mode

Description

Task: *arg.*

The operation failed because the camera *arg* is in program mode.

Program ref: *arg.*

Probable causes

The function or instruction can only be used if the camera is in running mode.

Recommended actions

To change to running mode, use instruction *arg*.

Recovery: *arg*.

41781, Camera is in running mode

Description

Task: *arg*.

The operation failed because the camera *arg* is in running mode.

Program ref: *arg*.

Probable causes

The function or instruction can only be used if the camera is in program mode.

Recommended actions

To change to program mode, use instruction *arg*.

Recovery: *arg*.

41782, Camera does not support this

Description

Task: *arg*.

The operation failed because the camera does not support current action (used switch *arg*).

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Using functionality not supported by this camera type.

Recommended actions

Check what functionality the camera support.

41783, Communication timeout

Description

Task: *arg*.

The communication towards the camera *arg* timed out.

Program ref: *arg*.

Consequences

The camera is in an undefined state. The order against the camera may or may not have been performed.

Probable causes

The camera is not responding.

Recommended actions

Check the connection between the camera and controller.

Restart the camera and try again.

Recovery: *arg*.

41784, Communication error

Description

Task: *arg*.

Communication error with camera *arg*. The camera is probably disconnected.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41785, Failed to request image

Description

Task: *arg*.

Failed to request image from camera *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

- 1) When using optional argument \AwaitComplete, the Trigger setting of the camera job has to be set to External.
- 2) The camera has to be set to Run Mode.
- 3) The camera has no job loaded.

Recommended actions

- 1) Go to RobotStudio -> Integrated Vision tab -> Setup Image and change the Trigger property to External and save the job.
- 2) Run the instruction CamSetRunMode.
- 3) Load a job into the camera.

Recovery: *arg*.

41786, Parameter out of range

Description

Task: *arg*.

The value used for the parameter *arg* for camera *arg* is out of range.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The parameter value cannot be set.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Check the value used.

41787, Parameter cannot be read

Description

Task: *arg*.

The parameter *arg* cannot be read or recognized.

Program ref: *arg*.

Probable causes

The parameter cannot be accessed. A parameter with the specified name does not exist.

Recommended actions

Check that the name *arg* is a proper one.

Recovery: *arg*.

41788, No ongoing load of camera task

Description

Task: *arg*.

There is no ongoing loading of a task to camera *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

No load order has been requested for camera *arg*.

Recommended actions

Check that *arg* has been used before current instruction.

41789, No more data available

Description

Task: *arg*.

No more data available for camera *arg*.

Program ref: *arg*.

Consequences

No data could be read.

Probable causes

There is no result matching the used *arg*.

Recommended actions

Recovery: *arg*.

41790, No results in image

Description

Task: *arg*.

An image was acquired with camera *arg* but the output contained no result.

Program ref: *arg*.

Probable causes

- 1) The part is not present, not sufficiently visible or otherwise not detectable in the field of view of the camera.
- 2) The Output to Rapid configuration is not setup correctly.

Recommended actions

Check the following and acquire a new image:

- 1) Verify that the part is in the field of view.
- 2) Check that the image settings and vision tool settings contained in the active vision job are ok.
- 4) Verify that the lighting has not changed since setting up the vision job.
- 5) Verify that the desired vision outputs have been configured in RobotStudio -> Integrated Vision tab -> Output to Rapid.

Recovery: *arg*.

41791, SoftMove is not allowed with zero mass

Description

Task: *arg*.

The current load data that is used when CSSAct is called has a mass of *arg* Kg. SoftMove need to have an accurate load definition. This is normally set by the load definition that is part of the tool definition.

Program ref: *arg*.

Consequences

When SoftMove detects a mass less or equal to 0.001 Kg it will not allow activation. Hence CSSAct instruction will not be possible to run with tool0.

Probable causes

Current tool when the instruction CSSAct was run is tool0 or another tool with too small mass. The current tool is set by a move instruction or by jogging prior to the CSSAct instruction.

Recommended actions

Use as accurate tool definition as possible. Use the load identification. If simple tests of SoftMove is done with only the mounting flange as tool then a tool definition similar to tool0 needs to be created but with a mass greater than 0.002 Kg.

41792, Instruction not allowed

Description

Task: *arg*.

The instruction *arg* can only be executed on normal level in a Motion task.

Continues on next page

Consequences

Program execution will stop.

Probable causes

Instruction *arg* is used from a TRAP or a background task.

41793, TrigInt stop error

Description

No more trig restart actions can be stored. Instructions that can cause this problem is: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

When using movement instructions that use interrupts at a specified position on the robot's movement path, and the events received after a stop is more than the system can handle, this error stops the execution.

Recommended actions

Try to increase the length of the movements, or reduce the speed on the movement can be a solution to this problem.

Report this problem to ABB Robotics if this happens.

41794, Search error

Description

Task: *arg*.

The search instruction *arg* has detected that the path and the search object has been removed.

Program ref: *arg*.

Consequences

The position cannot be read by the instruction *arg*. The program execution is stopped immediately.

Probable causes

- 1) A TRAP executes a *arg* instruction just before the signal change.
- 2) A TRAP executes a *arg* instruction, and when the instruction *arg* is ready (no signal detection occurred), *arg* detects that the search object has been removed.

Recommended actions

Use error handling with long jump in the TRAP to brake off the *arg* instruction, or rewrite the RAPID program. See documentation of instruction *arg* how to implement error handling with long jump.

41795, Wrong payload mode

Description

Task: *arg*.

Wrong payload mode.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

- 1) If using \TLoad optional argument in a movement instruction, the configuration parameter ModalPayloadMode should be set to NO.
- 2) If using GripLoad instruction, the configuration parameter ModalPayloadMode should be set to YES.
- 3) If using LoadId instruction and the configuration parameter ModalPayloadMode is set to NO, PayLoad identification is not possible.

Recommended actions

Check the value of the configuration parameter ModalPayLoadMode for domain SYS, type SYS_MISC.

41796, Argument Error

Description

Task: *arg*.

The mass is negative in used loaddata.

Program ref: *arg*.

Recommended actions

Define the correct load of the load before use of it for jogging or program movement. Load identification of the load can be done with the service routine LoadIdentify.

41797, Signal not accessible

Description

Task: *arg*.

The I/O signal *arg* is not accessible.

Program ref: *arg*.

Probable causes

The reason for this error is one of the following: * The real input or output, on the I/O device, represented by the I/O signal is not valid. * The I/O device is not running * Error in the configuration of the I/O signal

Recommended actions

Recovery: *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41798, No TCP robot found

Description

Task: *arg*.

This task does not control a mechanical unit that is a TCP robot.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

No TCP robot found for this task.

Recommended actions

Check the RAPID program. Instruction *arg* can only be used in a RAPID task that controls a TCP robot.

41799, Speed value too low

Description

Task: *arg*.

The speed value (*arg*) used in argument *arg* is too low.

Program ref: *arg*.

Consequences

It is not possible to use current speed value.

Probable causes

A value that is below the minimum value for speed has been used.

Recommended actions

Increase the speed value in argument *arg*.

Recovery: *arg*.

41800, Manual action needed

Description

Task: *arg*.

Start of robot movements has been ordered from task *arg*.

Reactivation of the enable device is needed when in manual reduced or manual full speed mode.

Probable causes

An order to activate robot movements has been executed in manual reduced or manual full speed mode.

Recommended actions

Release and reactivate enable device. Start RAPID program execution again. NOTE: If using a MultiMove system, all robots and external axis will start their movements after next program start.

41801, In synchronized mode

Description

Task: *arg*.

Not possible to execute *arg* in synchronized mode.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The system is in synchronized mode on basic path level or on store path level.

Recommended actions

Remove synchronization before executing current instruction.

41802, Not supported instruction or function

Description

Task: *arg*.

The RAPID instruction or function *arg* is not supported in this release of RobotWare.

Program ref: *arg*.

Probable causes

Use of a function or instruction that is not supported in current release of RobotWare.

Recommended actions

Remove RAPID instruction or function *arg* from your RAPID program.

41803, Argument Error

Description

Task: *arg*.

The logical output value calculated by the argument ScaleValue in TriggSpeed instruction and the programmed speed in current instruction exceeds the maximum physical output value for the analog signal used in AOp argument in TriggSpeed instruction.

Program ref: *arg*.

Probable causes

Logical analog output exceeds physical output value. • Logical output value = Scale value * programmed TCP speed in mm/s.
• Physical output value for analog signal = According definition in configuration for actual analog output signal. The analog signal can only be set within *arg* and *arg* according to the I/O system parameter configuration.

Continues on next page

Recommended actions

Decrease the value used in ScaleValue or decrease the programmed speed in current instruction. Another solution is to change configured value for the analog output signal.

Recovery: *arg.*

41804, Not allowed command

Description

Task: *arg.*

Not allowed to change non-motion execution setting in Manual full speed mode.

Program ref: *arg.*

Consequences

The system remains in the same status, and the requested action will not be performed.

Recommended actions

Make sure that change of non-motion execution setting is not done in Manual full speed Mode.

41805, Illegal dimension

Description

Task: *arg.*

The dimension *arg* used for argument *arg* is not valid. Required dimension: *arg.*

Program ref: *arg.*

Probable causes

Wrong dimensions or wrong values on optional arguments are used.

Recommended actions

Check and change the RAPID program.

Recovery: ERR_ARRAY_SIZE.

41806, The matrix A is singular

Description

Task: *arg.*

The matrix used in argument A is singular, and the linear equation system cannot be solved.

Program ref: *arg.*

Recommended actions

Modify the matrix A.

Recovery: *arg.*

41807, Not enough memory

Description

Task: *arg.*

The memory allocated is not enough to complete the current calculation.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Probable causes

The memory allocated at startup is too small to handle the calculation.

Recommended actions

Use smaller sizes of the matrix used in the instruction. If this is not possible, report the problem to ABB Robotics.

41810, Only allowed for 6 axis robot

Description

Task: *arg.*

The instruction *arg* with switch *arg* is only allowed for a 6 axis robot.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Probable causes

Instruction *arg* used with switch *arg*.

Recommended actions

Remove *arg* or the switch *arg*.

41811, Not allowed to reset signal

Description

Task: *arg.*

The instruction *arg* can only be used to reset a signal that has been connected to a configured signal with instruction *arg*.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Probable causes

The signal named *arg* is configured in the I/O configuration and cannot be reset.

Recommended actions

Check the RAPID program and the argument used in instruction *arg*.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

41812, Domain not valid or not in use

Description

Task: *arg*.

The domain *arg* used in instruction *arg* is not valid or is not in use.

Program ref: *arg*.

Probable causes

A domain that is not valid or a domain not in use has been used in instruction *arg*.

Recommended actions

Recovery: *arg*.

41813, File or directory access error

Description

Task: *arg*.

Unable to open file *arg* for writing, or directory specified does not exist.

Program ref: *arg*.

Probable causes

File may be write protected. File or directory may have incorrect name. The directory specified does not exist. No storage space available on device.

Recommended actions

- 1) Check if the file is write protected, and in such case change the setting.
- 2) Make sure the file and directory names are correct.
- 3) Make sure that the directory exist.
- 4) Make sure there is enough storage space available.

Recovery: *arg*.

41814, Reference Error

Description

Task: *arg*.

The reference in argument *arg* is not an entire persistent variable.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

It is not possible to use record component or array element in *arg*. *arg* . It is only possible to use entire persistent variables for *arg*.

41815, Reference error in Cyclic bool

Description

Task: *arg*.

The argument *arg* is not valid as a condition.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

An invalid argument has been used in the condition part of SetupCyclicBool.

Recommended actions

Consult the manual and replace *arg* with a valid argument.

41816, Too many connected Cyclic bool

Description

Task: *arg*.

It is only allowed to setup *arg* number of cyclic bools.

Consequences

The program execution is stopped immediately. The given condition will not be connected to *arg*.

Probable causes

The maximum number of cyclic bools (*arg*) has already been setup.

Recommended actions

Remove all cyclic bools not used for the moment and try again.

41817, I/O Error in Cyclic bool

Description

Failure while evaluating a logical expression setup with RAPID instruction SetupCyclicBool. The signal *arg* is unknown to the system.

Consequences

The program execution is stopped immediately.

Probable causes

- 1) Connection has been lost with the I/O device.
- 2) If the signal is defined in the RAPID program, it must be connected to the configured signal with instruction AliasIO.

Recommended actions

- 1) Re-establish the connection with the I/O device.
- 2) Re-connect the RAPID program defined signal using AliasIO.

Continues on next page

41818, SDB Error in Cyclic bool

Description

Failure while evaluating a logical expression setup with RAPID instruction SetupCyclicBool. The persistent variable *arg* is unknown to the system.

Consequences

The program execution is stopped immediately.

Probable causes

The module containing the declaration of *arg* has probably been unloaded.

Recommended actions

- 1) Reload the module containing the declaration of *arg*.
- 2) Disconnect the logical expression containing using RemoveCyclicBool.

41819, Integer Error in Cyclic bool

Description

Failure while adding or evaluating a logical expression, setup with RAPID instruction SetupCyclicBool. The persistent variable *arg* doesn't have an integer value.

Consequences

The program execution is stopped immediately.

Probable causes

arg doesn't have an integer value.

Recommended actions

Make sure that *arg* has an integer value.

41820, Invalid EGM identity

Description

Task: *arg*.

The EGM identity *arg* is not valid.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The EGM identity *arg* had not been initialized by means of the RAPID instruction EGMGetId.

Recommended actions

Initialize the EGM identity *arg* using the RAPID instruction EGMGetId.

41821, No EGM signals specified

Description

Task: *arg*.

No EGM input signal was specified in *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes**Recommended actions**

At least one signal has to be specified in *arg*.

41822, No data from the UdpUc device

Description

Task: *arg*.

No expected data packets have been received for the EGM instance *arg* during *arg* seconds. Rapid Ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

- 1) Check the connection between the controller and the UdpUc device "arg".
 - 2) Check that the UdpUc device "arg" is working properly.
 - 3) Increase the value (*arg*) for \CommTimeout in EGMSsetupUC.
- Recovery: ERR_UDPUC_COMM

41823, Invalid frame type

Description

Task: *arg*.

The frame type *arg* is not allowed together with the RAPID instruction *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Correct the used frame type.

41824, Not possible to open the UdpUc device

Description

It was not possible to open the external device *arg* that was specified in the RAPID instruction *arg*.

Consequences

The program execution is stopped immediately.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Recommended actions

Check if

- 1) The device name is spelled correctly.
- 2) The device is connected.
- 3) The device is up and running.

41825, EGM not connected

Description

The state of the EGM instance with EGM identity *arg* is not connected.

Consequences

The program execution is stopped immediately.

Recommended actions

Use the instructions EGMLGetId and/or EGMSsetupAI, EGMSsetupAI, EGMSsetupAO or EGMSsetupUC, to connect EGM. For more information see the User Manual for EGM.

41826, EGM mode mismatch

Description

There is an EGM mode mismatch for EGM identity *arg*. It is important to use the same EGM mode (Joint or Pose) for EGMSsetupAI, EGMSsetupAO, EGMSsetupGI, EGMSsetupUdpUc, EGMActXX and EGMRunXX.

Consequences

The program execution is stopped immediately.

Recommended actions

Use EGMSsetupAI, EGMSsetupAO, EGMSsetupGI and EGMSsetupUdpUc with the \Joint switch together with EGMActJoint and EGMRunJoint. Use EGMSsetupAI, EGMSsetupAO, EGMSsetupGI and EGMSsetupUdpUc with the \Pose switch together with EGMActPose and EGMRunPose.

41827, TCP robot missing

Description

It is not allowed to use EGM in a RAPID task without TCP robot.

Consequences

The program execution is stopped immediately.

Recommended actions

Use EGM in RAPID tasks with TCP robot only.

41828, Too many EGM instances

Description

Task: *arg*.

There are no more EGM instances available. The maximum number per RAPID task is *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

You have to disconnect an EGM instance using EGMLReset before you can connect another.

41829, EGM state change error

Description

The state of the EGM instance with EGM identity *arg* could not be changed to *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

- 1) Try to reset the EGM instance using the RAPID instruction EGMLReset.
- 2) Move PP to Main to reset all EGM instances

41830, Error sending EGM UdpUc message

Description

It was not possible to write the whole UdpUc message to the external device *arg* that is connected to EGM. *arg* of *arg* were sent.

Consequences

The program execution is stopped immediately.

Recommended actions

- 1) Check the connection between the controller and the external device *arg*.
- 2) Check the UDP server application on the external device *arg*.
- 3) Restart the controller and/or the external device *arg*.

41831, ContactL Warning

Description

Task: *arg*.

No hit during ContactL. Before performing next instruction, make sure that TCP is moved back to the start position of the ContactL path.

Program ref: *arg*.

Consequences

If no repositioning is done, before restart of ContactL, movement that can cause damage might occur.

Continues on next page

Recommended actions

Recovery: *arg.*

41840, Argument error**Description**

Task: *arg.*

No valid triggdata in TriggArray argument.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Recommended actions

Define triggdata by executing instruction TriggIO, TriggInt, TriggEquip, TriggSpeed or TriggCheckIO before current instruction.

41841, Argument error**Description**

Task: *arg.*

The size of the array used in argument *arg* is *arg*. The max size of the array is limited to *arg* elements.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Recommended actions

Check and change the RAPID program.

41842, Argument error**Description**

Task: *arg.*

Instruction *arg* used with argument *arg* and one of the optional arguments T2, T3, T4, T5, T6, T7 or T8.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Probable causes

An illegal combination of arguments was used.

Recommended actions

Correct the RAPID program.

41843, Instruction not allowed in TRAP or service routine**Description**

Task: *arg* It is not allowed to use the RAPID instruction *arg* in a TRAP or a service routine.

Program ref: *arg.*

Consequences

The program execution is stopped immediately.

Recommended actions

Remove the instruction from your RAPID program.

41844, Search Error**Description**

Task: *arg.*

The persistent variable *arg* for the SearchX instruction is already set to the specified value (high or low) at the start of searching. Before performing next search, make sure that TCP is moved back to the start position of the search path.

Program ref: *arg.*

Consequences

If no repositioning is done, before restart of circular search, movement that can cause damage might occur.

Recommended actions

Recovery: *arg.*

41845, Outside reach Error**Description**

Task: *arg.*

The position (robtarget) is outside the robot's working area.

Program ref: *arg.*

Probable causes

- The robtarget used is outside reach.

Recommended actions

Use a robtarget that is within the robot's working area.

Recovery: *arg.*

41846, Signal not writeable**Description**

Task: *arg.*

The I/O signals bit(s) is set by a device transfer operation. The signal *arg* is read only.

Program ref: *arg.*

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

Consequences

The program execution is stopped immediately.

Probable causes

The I/O signals bit(s) is set by a device transfer operation.

Recommended actions

Check the I/O configuration for I/O signals and device transfer.

Change signal used in RAPID program.

41847, Signal not writeable

Description

The I/O signals bit(s) is set by a device transfer operation. The signal *arg* is read only.

Consequences

The program execution is stopped immediately.

Probable causes

The I/O signals bit(s) is set by a device transfer operation.

Recommended actions

Check the I/O configuration for I/O signals and device transfer.

Change signal used in RAPID program.

41848, Too low visualization time

Description

Task: *arg*.

The specified visualization time is too low.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Check the RAPID documentation regarding the minimum visualization time. Increase the visualization time used in the RAPID program.

41849, Bad combination of values used in arguments

Description

Task: *arg*.

The specified visualization time *arg* is equal or higher than the timeout *arg* for the instruction.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Recommended actions

Change the visualization time used in the RAPID program, or change the maximum period of waiting time permitted.

41850, User interface already active

Description

Task: *arg*.

A message is already active on the FlexPendant. A message launched by instruction *arg* must be aborted before launching a new message.

Program ref: *arg*.

Consequences

The message will not be presented on the FlexPendant. This error can be handled in an error handler.

Probable causes

A *arg* message is already active on the FlexPendant.

Recommended actions

Recovery: *arg* The current active *arg* message can be deactivated with instruction *arg*.

41851, Wrong value type used

Description

Task: *arg*.

Wrong value type used in optional argument *arg*. The only valid types are bool, num or dnum, or any alias type of those three base types.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Wrong value type used.

Recommended actions

Change type used in optional argument *arg*.

41852, Wrong signal value for signal *arg*

Description

It is not possible to set the I/O signal *arg* to value *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The I/O signal *arg* is configured wrong, or the value that should be set is wrong. The signal value that is used has been read from a persistent variable specified in one of the setup instructions used for Trigg defining conditions and actions for

Continues on next page

setting a digital, a group of digital, or an analog output signal at a fixed position. The error is detected when the actual signal setting should be done.

Recommended actions

Check the I/O configuration for I/O signal. Check the value of the persistent variable that is used in *arg* for the setup instruction(s) for Trigg.

41860, Evaluation error in Cyclic bool

Description

Failure while evaluating the Cyclic bool *arg*.

Consequences

The evaluation of *arg* has been stopped immediately.

Probable causes

- 1) The module containing the declaration of *arg* has been unloaded.
- 2) An I/O signal needed to evaluate the logical expression connected to *arg* has been lost (see earlier error logs).
- 3) The I/O signal that is updated with the cyclic bool value has been lost.

Recommended actions

- 1) Reload the module containing the declaration of *arg*.
- 2) Re-establish the connection with the I/O device.
- 3) Re-connect the RAPID program defined signal using AliasIO.

41861, Cyclic bool has been removed

Description

Failure while evaluating the Cyclic bool *arg*.

Consequences

The evaluation of *arg* has been stopped immediately and the Cyclic bool has been removed.

Probable causes

- 1) The module containing the declaration of *arg* has been unloaded.
- 2) An I/O signal needed to evaluate the logical expression connected to *arg* has been lost (see earlier error logs).
- 3) The I/O signal that is updated with the cyclic bool value has been lost.

Recommended actions

- 1) Reload the module containing the declaration of *arg*.
- 2) Re-establish the connection with the I/O device.
- 3) Re-connect the RAPID program defined signal using AliasIO.
- 4) Re-connect the logical expression.

41862, ASCII log setup failed

Description

Not possible to setup ASCII log for the cyclic bool *arg*.

Probable causes

The cyclic bool is not active when activation of ASCII log is done with RAPID instruction StartAsciiLog.

Recommended actions

Use RAPID instruction SetupCyclicBool using cyclic bool *arg* before using StartAsciiLog.

41863, Mechanical unit not TCP robot

Description

Task: *arg*

The mechanical unit *arg* is not a TCP robot. *arg* can only be used if the mechanical unit is a TCP robot.

Program ref: *arg*

Consequences

The program execution is stopped immediately.

Recommended actions

Use *arg* with TCP robot only.

41864, Argument error

Description

Task: *arg*

Bad combination of switches.

The switch *arg* can only be combined with switch *arg*.

Program ref: *arg*

Consequences

The program execution is stopped immediately.

Recommended actions

Correct the RAPID program.

41865, Invalid MAC address

Description

Task: *arg*.

Invalid MAC address *arg*.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The format might be wrong.

Recommended actions

Check the MAC address and correct the address used.

Continues on next page

5 Trouble shooting by event log

5.6 4 xxxx

Continued

The length of the MAC-address in format XX:XX:XX:XX:XX:XX.

41880, AliasCamera Define Error

Description

Task: *arg*.

The camera in argument CameraName or FromCamera: *arg*, must be defined in the Communication configuration (SIO,cfg) and the camera in argument ToCamera: *arg*, must be declared in the RAPID program and not defined in the Communication configuration (SIO,cfg).

Program ref: *arg*.

Recommended actions

Check the Communication configuration and the RAPID program.

Recovery: *arg*.

41881, Persistent boolean Break

Description

Task: *arg*.

A value change on a persistent boolean variable interrupted the execution.

Program ref: *arg*.

Recommended actions

Recovery: *arg*.

41882, Error in Cyclic bool

Description

Task: *arg*.

The condition used in SetupCyclicBool is too complex.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

The condition used in SetupCyclicBool in SetupCyclicBool is too complex.

Recommended actions

Divide the expression into two subexpressions to make each subexpression less complex than the original expression.

41883, arg file is corrupted

Description

Task: *arg*.

The file has been edited or a previous *arg* has been interrupted, and then the file was corrupted.

Program ref: *arg*.

Consequences

The file has been renamed to *arg*.

The *arg* will be created again next time the routine is executed.

All history will be lost in *arg*, but can be found in the file *arg* in the HOME: directory.

Probable causes

File edited or corrupted by a previous interrupted run of the routine.

41884, CyclicBrakeCheck Error

Description

Task: *arg*.

SafeMove option or the EPS option is a requirement if running CyclicBrakeCheck.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Using CyclicBrakeCheck without required options.

Recommended actions

Use BrakeCheck to test brakes when not having any SafeMove option or EPS option.

41885, BrakeCheck Error

Description

Task: *arg*.

When having a SafeMove option or the EPS option, CyclicBrakeCheck should be used to test brakes.

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

Use of BrakeCheck routine when CyclicBrakeCheck should be used.

Recommended actions

Use CyclicBrakeCheck to test brakes.

41886, CyclicBrakeCheck Error

Description

Task: *arg*.

CyclicBrakeCheck is already active.

The CyclicBrakeCheck routine cannot be executed from several tasks or execution levels at the same time.

Continues on next page

Currently task *arg* is executing CyclicBrakeCheck on execution level *arg* (LEVEL_NORMAL=0, LEVEL_SERVICE=2).
Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

More than one call to procedure CyclicBrakeCheck.

Recommended actions

- 1) Check that only one task is executing CyclicBrakeCheck routine if using a multimove system.
- 2) If calling CyclicBrakeCheck from a service routine, check that the execution of CyclicBrakeCheck on normal level has been ended.
To cancel an active CyclicBrakeCheck, move program pointer to cursor or move program pointer to main.

BrakeCheck is already active.

The BrakeCheck routine cannot be executed from several tasks or execution levels at the same time.

Currently task *arg* is executing BrakeCheck on execution level *arg* (LEVEL_NORMAL=0, LEVEL_SERVICE=2).

Program ref: *arg*.

Consequences

The program execution is stopped immediately.

Probable causes

More than one call to procedure BrakeCheck.

Recommended actions

- 1) Check that only one task is executing BrakeCheck routine if using a multimove system.
- 2) If calling BrakeCheck from a service routine, check that the execution of BrakeCheck on normal level has been ended.
To cancel an active BrakeCheck, move program pointer to cursor or move program pointer to main.

41887, BrakeCheck Error

Description

Task: *arg*.

5 Trouble shooting by event log

5.7 5 xxxx

5.7 5 xxxx

50021, Joint position error

Description

Actual position of joint *arg* is too far away from the ordered position.

Recommended actions

Check tuning parameters, external forces or hardware.

50022, Too low DC-link voltage

Description

The drive units cannot detect the dc link voltage, or the voltage is too low.

This can occur if the DC link bus bar is not correctly inserted or if the mains contactors do not close properly.

Recommended actions

Check the DC bus bar is correctly inserted between the drive unit and the rectifier.

Check that the motors on contactors are closed and that there is voltage on the side connected to the rectifier.

50024, Corner path failure

Description

Task: *arg*.

Corner path executed as stop point due to some of the following reasons:

- Time delay.
- Closely programmed points.
- System requires high CPU-load.

Program ref. *arg*.

Recommended actions

- Reduce the number of instructions between consecutive move instructions.
- Reduce speed, use wider spaced points, use /CONC option.
- Increase ipol_prefetch_time.
- If the stop comes at the first movement after a finepoint, increase the configuration parameter 'Interpolation Buffer Startup Adjust' in topic Motion and type Motion Planner.

50025, Restart interrupted

Description

Current position is too far from path.

Recommended actions

Make a new restart with regain.

Continues on next page

50026, Close to singularity

Description

Task: *arg*.

Robot too close to singularity.

Program ref. *arg*.

(Internal code: *arg*).

Recommended actions

Modify the robot path away from the singularity or change the jogging mode for the robot to joint/axis jogging.

In the case when the robot position is dependent on an additional axis being jogged then that dependency may also need to be relaxed, that is by changing the jogging coordinate system for the robot from world to base.

50027, Joint Out of Range

Description

Position for *arg* joint *arg* is out of working range.

Recommended actions

Use the joystick to move the joint into its working range.

50028, Jog in wrong direction

Description

Position for *arg* joint *arg* is out of working range.

Recommended actions

Use the joystick to move the joint in opposite direction.

50031, Command not allowed

Description

System parameters cannot be changed in MOTORS ON state.

Recommended actions

Change to MOTORS OFF.

50032, Command not allowed

Description

An attempt was made to calibrate while in MOTORS ON state.

Recommended actions

Change to MOTORS OFF.

50033, Command not allowed

Description

An attempt was made to commutate the motors in MOTORS ON state.

Recommended actions

Change to MOTORS OFF.

50035, Command not allowed

Description

An attempt was made to synchronize in MOTORS ON state.

Recommended actions

Change to MOTORS OFF.

50036, Correct regain impossible

Description

A stop occurred with too many close points with corner zones. At restart the robot will move to a point farther forward in the program.

Recommended actions

Reduce the number of close points, increase the distance between them or reduce the speed.

50037, MOTORS ON order ignored

Description

MOTORS ON order ignored since the previous stop was not yet acknowledged.

Recommended actions

Order MOTORS ON again.

50042, Could not create path

Description

The path could not be created.

Recommended actions

- Increase the distance between close points.
- Decrease speed.
- Change acceleration.

50050, Position outside reach

Description

Position for *arg* joint *arg* is outside working area.

Joint 1-6 : Number of the axis which causes the error.

Joint 23: Combination of axis 2 and 3 causes the error.

Probable causes

The reason may be that ConfL_Off is used and a movement is too large, more than 90 degrees for an axis.

Recommended actions

- Check work object or working range.
- Move the joint in joint coordinates.
- Check Motion configuration parameters.
- Insert intermediate points on large movements.

50052, Joint speed error

Description

The speed of joint *arg* is wrong relative the ordered speed due to error in system or collision.

Recommended actions

- Check the tune parameters, external forces on the joint and hardware.
- Reduce programmed speed.

50053, Too large revolution counter difference

Description

Too large revolution counter difference for joint *arg*. The system has detected too large a difference between the actual revolution counter value on the serial measurement board and the value anticipated by the system.

Consequences

The robot is not calibrated and may be jogged manually, but no automatic operation is possible.

Probable causes

The position of the robot arm may have been changed manually while the power supply was switched off. The serial measurement board, resolver or cables may also be faulty.

Recommended actions

- 1) Update the revolution counter.
- 2) Check resolver and cables.
- 3) Check the serial measurement board to determine whether it is faulty. Replace the unit if faulty.

50055, Joint load too high

Description

Actual torque on joint *arg* too high. Might be caused by incorrect load data, too high acceleration, high external process forces, low temperature or hardware error.

Recommended actions

- Check load data.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

- Reduce acceleration or speed.
- Check hardware.

50056, Joint collision

Description

Actual torque on joint *arg* is higher than ordered while at low or zero speed. Might be caused by jam error (the arm has got stuck) or hardware error.

Recommended actions

Check that arm is not stuck.
Check hardware.
Check for other hardware event logs.

50057, Joint not synchronized

Description

The position of joint *arg* after power down/failure is too far away from the position before the power down/failure.

Recommended actions

Make a new update of the revolution counter.

50058, Tool coordinate system error

Description

The z-direction of the tool coordinate system is almost parallel with the path direction.

Recommended actions

Change the tool coordinate system to achieve at least 3 degrees deviation between z-direction and path direction.

50060, Incorrect tool

Description

The definition of stationary tool is not valid.

Recommended actions

Check the tool and object data.

50063, Circle uncertain

Description

Task: *arg*.

The points are misplaced, reason *arg*:

- 1) End point too close to start point.
- 2) Circle point too close to start point.
- 3) Circle point too close to end point.
- 4) Uncertain reorientation.
- 5) Circle too large > 240 degrees.

Program ref. *arg*.

Continues on next page

Recommended actions

Check the points of the circle and the end point of the move instruction before. The points of the circle can be verified by stepping through the circle in manual mode.

50065, Kinematics error

Description

The destination of the movement is outside the reach of the robot or too close to a singularity. Robot *arg*.

Recommended actions

Change the destination position.

50066, Robot not active

Description

Attempt to coordinate motion or calculate position of deactivated robot *arg*.

Recommended actions

Activate robot via the Motion Unit key, then Jogging window, or program. Check work object and program.

50067, Unit not active

Description

Attempt to coordinate motion or calculate position of deactivated single unit *arg*.

Recommended actions

Activate unit via Motion Unit key, then Jogging window, or program. Check work object and program.

50076, Orientation not correct

Description

Orientation is incorrectly defined.

Recommended actions

Make an accurate normalization of the quaternion elements.

50078, Too many close positions

Description

Too many consecutive closely spaced positions.

Recommended actions

Increase the distance between consecutive close positions.

50079, Cannot use wrist weaving

Description

Wrist weaving not possible.

Recommended actions

Use smaller weaving amplitude or a larger TCP.

50080, Position not compatible**Description**

The desired position cannot be reached with the given robot configuration. Robot *arg*.

Recommended actions

Modify the robot position in the program.

50082, Path calculation time exceeded**Description**

The path calculation time for mechanical units running in motion planner *arg* exceeds internal limit. The motion task did not execute within its time limit.

Probable causes

The CPU load is too high. Could for example be generated by too frequent EIO communication.

Recommended actions

- 1) Set system parameter 'High Interpolation Priority' for the affected motion planner.
- 2) Try to reduce the CPU load by one or more of the following actions:
 - Reduce speed.
 - Change AccSet.
 - Avoid singularity (SingArea\Wrist).
 - If the error comes directly after start from finepoint, increase the configuration parameter 'Interpolation Buffer Startup Adjust' in topic Motion and type Motion Planner.

50085, Too many user frames**Description**

For mechanical unit *arg* more than one user frame has been defined.

Recommended actions

Take away one user frame or define one more mechanical unit.

50086, Singularity problem**Description**

Too close to wrist singularity with respect to numerical resolution for joint 4 of *arg*.

Recommended actions

Change destination position a few increments.

50087, Singularity problem**Description**

Too close to wrist singularity with respect to numerical resolution for joint 6 of *arg*.

Recommended actions

Change destination position a few increments.

50088, Restart not possible**Description**

It is not possible to restart the path due to a previous error.

Recommended actions

Move the program pointer to clear the path and start a new movement.

50089, Weaving changed**Description**

Task: *arg*.

The ordered weaving is not achieved due to:

- High weaving frequency.
- Not allowed shift of weave method or
- that SingArea/Wrist is used with wrist weave.

Program ref. *arg*.

Recommended actions

Increase weave length or period time.

Don't shift between arm and wrist weave.

Use SingArea/Off with wrist weave.

50091, Restart not possible**Description**

Restart no longer possible. Change of unit state made restart of program impossible.

Recommended actions

Move the program pointer and start a new movement.

50092, Axis computer response**Description**

Incorrect response from axis computer.

Recommended actions

Check Motion configuration parameters.

Check axis computer hardware.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50094, TuneServo not possible

Description

Tuning is not implemented for the specified joint.

Recommended actions

Verify that a parameter and/or joint that can be used with TuneServo is chosen.

50096, TuneServo not allowed

Description

Tuning is not allowed for the specified joint.

Recommended actions

Verify that a parameter and/or joint that can be used with TuneServo is chosen.

50124, Zone converted to fine point

Description

Task: *arg*.

Corner path executed as stop point because the calculated time margin for next segment is 0.

This can be caused by:

- Closely programmed points.
- System requires high CPU-load.

Program ref. *arg*.

Recommended actions

- Reduce the number of instructions between consecutive move instructions.
- Reduce speed, use wider spaced points, use /CONC option.
- Increase ipol_prefetch_time.
- If the stop comes at the first movement after a finepoint, increase the configuration parameter 'Interpolation Buffer Startup Adjust' in topic Motion and type Motion Planner.

50132, Commutation failed

Description

Commutation failed for joint *arg*.

Recommended actions

- Make a new commutation.
- Restart the controller.

50133, Test signal error

Description

No test signals are available for robot *arg*.

Recommended actions

Verify that correct test signals are defined.

Continues on next page

50134, Corr. vector warning

Description

Sensor correction vector calculations failed due to previous error.

Recommended actions

50135, SoftAct not possible

Description

Soft servo is not possible to activate.

Recommended actions

Verify that a joint that can be used with SoftAct is chosen.

50138, Arm check point limit

Description

The robot *arg* has reached the limit for arm check point.

Recommended actions

Use the joystick to move the involved joint into the working range again.

50139, Arm check point limit

Description

Jogging was made in wrong direction when arm check point was out of working range for robot *arg*.

Recommended actions

Use the joystick to move the joint in opposite direction.

50140, Payload too large

Description

Heavy payload caused static torque limit to be exceeded on joint *arg*.

Recommended actions

Check and reduce payload for arm and/or wrist. Reduce joint working range to decrease static torque due to gravity.

50142, Motion configuration

Description

Configuration of the manipulator failed.

arg

arg.

Recommended actions

Check the parameter values under system parameters: Motion.

If mismatch between INT/EXT parameters i.e. wrong MOC.cfg loaded.

Use correct parameters and reset the system.

50143, Robot axes configuration

Description

Actual configuration is not the same as ordered and/or movement of any robot axis is larger than 90 degrees. Robot *arg*, axis *arg*.

Recommended actions

Use SingArea_Wrist, ConfL_Off, modify position or insert intermediary point.

Proceeding in Auto mode will not be possible without correcting the configuration. To be able to move to the position anyway change to Manual mode and repeat start.

50144, Displacement frame uncertain

Description

Calibration of displacement frame uncertain for robot *arg*, due to one or several of:

- Wrong TCP.
- Reference points inaccurate.
- Reference points badly spaced.

Recommended actions

If estimated error is unacceptable:

- Verify that correct TCP is used.
- Try more than 3 reference points.
- Be careful when positioning robot to reference points.

50145, Kinematic limitation

Description

Kinematic limitation for robot *arg*, no solution found.

- Long segment.
- Position close to singularity.
- Joint 1, 2 or 3 out of range.
- Position outside reach.

Recommended actions

- Insert an intermediary point to reduce the length of the segment.
- Use MoveAbsJ.
- Check working range.

50147, Power fail restart failed

Description

Re-creation of the path failed.

Recommended actions

Move the program pointer and start a new movement.

50153, Command not allowed

Description

Task: *arg*.

The given instruction, or command, was not allowed since the robot program was executing in a hold state.

(Internal code: *argarg*).

Program ref. *arg*.

Recommended actions

Modify program or stop program execution before issuing command.

50156, Not an independent joint

Description

Joint *arg* is not configured as an independent joint.

Recommended actions

Modify the program or configure the joint as an independent joint.

50157, Corr. vector warning

Description

Sensor correction vector X calculations failed due to previous error.

Recommended actions

50158, Sensor process missing

Description

Sensor process missing during initialization. Named sensor process *arg* could not be found or initialized.

Recommended actions

Check process name in Motion and Process configuration files.

50159, No external process

Description

Attempt to coordinate motion or calculate position of single *arg* without an external process.

Recommended actions

Check process name in Motion and Process configuration files.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50160, Cannot reach position

Description

Programmed position of independent joint *arg* is outside working range and thus cannot be reached.

Recommended actions

- Change the position.
- Check the joint working area limits.
- Check the used work object.

50163, Position adjustment

Description

External position adjustment too large. TCP speed, orientation speed, or external position speed exceed allowed robot performance.

Recommended actions

- Reduce programmed TCP- and orientation speeds.
- Modify the path.
- WaitWObj closer to sync.
- Run in AUTO.

50164, Deactivation not possible

Description

Deactivation of mechanical unit may not be done while in independent mode.

Recommended actions

Make sure that independent mode is not used and try to deactivate again.

50167, Warning: new sync

Description

Warning: a new object sync signal has arrived while conveyor is active and program is running.

Recommended actions

50168, New sync on *arg*

Description

New object sync arrived while conveyor was tracking the previous object. Cannot track two objects simultaneously.

Recommended actions

Reduce speed of conveyor. Increase programmed speed.

50172, MoveJ not allowed

Description

MoveJ not allowed with work object coordinated with external position mechanical unit.

Recommended actions

Change interpolation mode or work object.

50173, Finepoint necessary

Description

Use finepoint when changing tool or work object coordination when work object is coordinated with external position mechanical unit.

Recommended actions

Create a finepoint and then change the tool.

50174, WObj not connected

Description

The WObj is not connected to the conveyor *arg*. Robot TCP cannot be coordinated to work object. Object can be dropped because of time synchronization fault on conveyor node.

Recommended actions

- Check for missing WaitWObj.
- Check for DropWObj occurring before end of coordination.
- Check for time synchronization fault, see status on conveyor node.

50175, Conveyor moving

Description

Conveyor *arg* moving while attempt to coordinate robot TCP to conveyor work object while in prohibited mode.

Recommended actions

It is not possible to coordinate to conveyor while in Manual Reduced Speed, or stepping in Auto, and the conveyor is moving.

50176, Conveyor not active

Description

Conveyor *arg* was not active when attempt to coordinate robot TCP to conveyor work object.

Recommended actions

Make sure conveyor mechanical unit is active. Check for finepoint for last coordinated motion before DeactUnit.

Continues on next page

50177, Unable to restart

Description

Conveyor *arg* moving while attempting to restart or before pressing Stop or stepping through program.

Recommended actions

Make sure conveyor is standing still. Move the program pointer and start a new movement.

50178, Non optimal movement

Description

Required torque too high. Manual adjustment of acceleration or speed is needed.

Recommended actions

Reduce acceleration (AccSet 50 100) in this movement, restore it afterwards (AccSet 100 100). Optimize performance by search for max acceleration 50-99. Alternatively, reduce speed.

50181, Out of coupled range

Description

Joint *arg* and *arg* are out of coupled working range.

Recommended actions

Use the joystick to move joints into their coupled working range.

50182, Jog in wrong direction

Description

Joint *arg* and *arg* are out of coupled working range.

Recommended actions

Use the joystick to move joints into their coupled working range.

50183, Robot outside work area

Description

The robot has reached the World Zone *arg*, *arg*.

Recommended actions

Check the reason of the World Zone. Use the joystick to move the robot out of the World Zone if needed.

50184, Corr. vector warning

Description

Sensor correction vector calculations failed due to previous error.

Recommended actions

50185, Corr. vector warning

Description

Sensor correction vector calculations failed due to previous error.

Recommended actions

50188, Non optimal movement

Description

Required torque too high. Manual adjustment of weave frequency or amplitude is needed.

Recommended actions

Reduce weave frequency or weave amplitude in this movement. Alternatively, reduce speed.

50189, Relay signal not found

Description

The signal *arg* for relay *arg* is not found in the I/O configuration. The mechanical unit using this relay is ignored.

Recommended actions

Check I/O signal definitions and System Parameters definition in topic Motion, Type: Relay.

50190, Permanent interpolator lock error

Description

Scanned number of active joints not equal to expected number of joints.

Recommended actions

Check configuration of the unit that is using general kinematics.

50191, Too many TCP speeds

Description

The number of TCP speeds in one segment is too large. Maximum number of TCP speeds is *arg*.

Recommended actions

Check if one segment has too many TCP speeds set or if a sequence of segments have increasing DipLag.

50192, Jogging error

Description

Jogging is started too soon after program stop.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

Recommended actions

Try to jog the robot again.

50193, Joint not synchronized

Description

The speed of joint *arg* before power down/failure was too high.

Recommended actions

Make a new update of the revolution counter.

50194, Internal position error

Description

Error caused by internal numerical limitation. Joint number *arg*.

Calculated reference position = *arg*.

Recommended actions

- Adjust the system parameters in Uncal ctrl master 0.

- If TuneServo is used, adjust parameter 'Tune_df'.

50195, Cannot move independent

Description

Joint *arg* cannot be moved in independent mode.

Recommended actions

Make sure that independent mode is not used when trying to move joint.

50196, Calibration failed

Description

Points 0 and 1 too close.

Recommended actions

Make a new calibration with larger distance between points 0 and 1.

50197, Calibration failed

Description

Points 0, 1 and 2 on a line or point 2 too close to points 0 or 1.

Recommended actions

Make a new calibration with points moved so that 0, 1 and 2 are not on a line or with larger distance between point 2 and points 0 and 1.

50198, Calibration failed

Description

Internal error during calibration due to unknown origin switch.

Recommended actions

- Report the occurrence to ABB.

- Make a new calibration.

50200, Torque error

Description

Torque calculation error due to high speed for mechanical unit *arg*. Internal info code *arg*.

Recommended actions

- Check load data.

- Reduce speed.

50201, Orientation outside reach

Description

The error of the programmed orientation exceeds the acceptance limit.

Recommended actions

- Adjust robtarget orientation.

- Adjust/check orientations of currently used frames: tool frame, base frame, user frame, object frame.

- It is possible (but not recommendable) to switch off the orientation supervision using the corresponding system parameter. Please see system parameters documentation for details (Topic Motion/Type Robot).

50203, Measurement node used

Description

The measurement node for joint *arg* is already used.

Recommended actions

Select another node.

50204, Motion supervision

Description

Motion supervision triggered for axis *arg* on mechanical unit *arg*.

Consequences

The movement of mechanical unit *arg* is halted immediately. It then returns to a position on the path on which it was running. If Collision Error Handling is not configured, the execution will stop and it will remain in status Motors ON, awaiting a start request. If Collision Error Handling is configured, the execution will continue into an error handler.

Continues on next page

Probable causes

Triggering of the motion supervision may be caused by a collision, incorrect load definition or forces in external process.

Recommended actions

- 1) If execution is stopped, acknowledge the fault, and resume operation by pressing the Start button on the FlexPendant.
- 2) Make sure any loads are defined and identified correctly.
- 3) If the mechanical unit is exposed to forces from the external processes, use RAPID command or system parameters to raise the supervision level.
- 4) Consider to configure Collision Error Handling in topic Controller, type 'General Rapid' and add an error handler for collision errors.

50205, Data logger error

Description

arg

Recommended actions

Solution:

arg.

50207, Add intermediate point

Description

Intermediate point not coordinated to external pos mechanical unit is necessary when changing conveyor.

Recommended actions

Create an intermediate point then change the conveyor.

50208, Missing function

Description

Friction compensation cannot be activated for joint *arg*.

Recommended actions

Install the option Advanced Shape Tuning.

50209, Kinematic limitation

Description

No acceptable solution found. Residual: *arg* deg in orientation, *arg* mm in x, *arg* mm in y, *arg* mm in z.

Recommended actions

Insert an intermediary point. Check singularity. Increase position and orientation tolerance. Use MoveAbsJ. Check working range.

50210, Load identification fail

Description

Cannot perform load identification because configuration angle is too small.

Recommended actions

- Increase configuration angle.

50214, Work area configuration failed

Description

Possibly the defined work area is larger than max allowed area for robot *arg*.

Recommended actions

Adjust the work area parameters in robot system parameters and try again.

50215, Load identification fail

Description

Axis *arg* will move outside working range.

Recommended actions

Move the axis to a position further from the working range limit.

50218, Path not finished

Description

Task: *arg*.

Previous motion path was not finished before new motion was sent.

Program ref. *arg*.

Recommended actions

Use StorePath when in Trap routines. Move the program pointer and start a new movement.

50220, No input signal

Description

No input signal to contactor relay for mechanical unit *arg*.

Recommended actions

Ensure that an input signal is connected and configured.

50221, Object outside limit

Description

Object on conveyor *arg* is outside maximum distance or minimum distance limits. Object Dropped.

Recommended actions

Check limits or reduce conveyor speed.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50222, Mismatch type - MechUnit

Description

Mismatch between selected identification type and selected mechanical unit.

Recommended actions

Make sure that selected type corresponds to selected mechanical unit and try again.

50224, Cannot define load

Description

It is not allowed to define a load on axis *arg* for mechanical unit *arg* or the interpolation is not stopped in a finepoint.

Recommended actions

Change axis number, mechanical unit or change the move before to finepoint.

50225, Old boot safe area lost

Description

Error in boot safe memory area.

- Area updated with new data.
- System unsynchronized.

Recommended actions

Update all revolution counters.

50226, Motor reference error

Description

Calculation time for motor references exceeds internal limits.

Recommended actions

- Reduce load on main computer.
- Restart the controller.

50227, Test signal error

Description

Invalid channel number *arg*.

Recommended actions

Allowed channel numbers are 1 - 12 for test signals and 1 - 6 for data log signals.

50228, Test signal error

Description

Unknown test signal number *arg*.

Recommended actions

Make sure that a valid test signal number is defined.

Continues on next page

50229, Test signal error

Description

Unknown mechanical unit *arg*.

Recommended actions

Check spelling or configuration.

50230, Test signal error

Description

Invalid axis number *arg* for mechanical unit *arg*.

Recommended actions

Check mechanical unit and axis number.

50231, Test signal warning

Description

Mechanical unit *arg* not active.

Consequences

Logged signals for deactivated units may be invalid.

Recommended actions

Activate mechanical unit to avoid this warning.

50234, Overflow during logging

Description

An overflow occurred when logging test signals or data log signals.

Recommended actions

- Define fewer signals.
- Reduce load on main computer.
- Reduce network load.

50235, No Motion interrupts received

Description

The system has not generated motion interrupts within timeout.

Consequences

The system goes to system failure state.

Probable causes

High system interrupt load or in rare cases hardware error.

Recommended actions

- 1) Restart the controller to resume operation.
- 2) Check any other error log messages coinciding in time with this one for clues.
- 3) Replace the main computer if faulty.

50239, Optimal Emergency Stop change

Description

Optimal Emergency Stop changed to Electrical brake mode because of acceleration limitation.

Recommended actions

Limit acceleration in the program.

- Check that the hard drive isn't full.
- Install more memory.

50245, Command not allowed

Description

Cannot set non motion execution mode when in MOTORS ON state.

Recommended actions

Change to MOTORS OFF.

50240, Optimal Emergency Stop change

Description

Optimal Emergency Stop changed to Electrical brake mode because of torque limitation.

Recommended actions

Check load data.

50246, Linked motor error

Description

Large position offset between follower axis and master axis.

Recommended actions

Start linked motor service program. Jog the follower axis to same position as the master axis.

50241, Missing function

Description

Absolute Accuracy not purchased.

Recommended actions

Change robot system parameter 'Use Robot Calibration' to uncalib.

50247, Clear of Path failed

Description

The movement has to be stopped when the path is to be cleared.

Recommended actions

Use StopMove before the ClearPath instruction. Move the program pointer and start a new movement.

50242, Unsync due to CFG data

Description

- Mismatch between controller and cfg data for joint arg (calibration offset or calibration position), or
- Valid flags for calibration offset or commutation offset not true in cfg.

Recommended actions

Update measurement system:
- Update revolution counter.
- Recalibrate joint.
- Change cfg data.

50248, Servo Tool error

Description

Error for tool arg in state arg
arg
arg
arg.

50249, Programmed force reduced

Description

Programmed tip force too high for tool arg. Requested motor torque (Nm) = arg. Force was reduced to max motor torque.

Recommended actions

- 1) Reduce programmed tip force.
- 2) Check force vs torque calibration in system parameters.
- 3) Check max motor torque in system parameters.

50243, No acceleration limit

Description

Acceleration limitation is not implemented for robot arg.

50244, AbsAcc calibration failed

Description

Could not perform an AbsAcc calibration for robot arg, returned status arg.

Recommended actions

- Restart the controller.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50250, Calibration force reduced

Description

Requested calibration force too high for tool arg. Requested motor torque (Nm) = arg. Force was reduced to max motor torque.

Recommended actions

- 1) Check calibration forces in system parameters.
 - 2) Check force vs torque calibration in system parameters.
 - 3) Check max motor torque in system parameters.
-

50251, Tool opening failed

Description

An ordered tool axis movement of arg was detected during tool opening.

Recommended actions

Make sure the tool opening is ready before executing next tool axis movement. Decrease the system parameter 'post sync time'.

50252, Tool opening failed

Description

An ordered tool axis movement of arg was detected during tool opening in calibration.

Recommended actions

Make sure no movements of the tool axis are ordered during calibration.

50253, Cannot deactivate unit

Description

Deactivation of mechanical unit may not be done while in process mode.

Recommended actions

Make sure to leave process mode before deactivating mechanical unit.

50254, Linked motor error

Description

Too large speed for follower axis when follower axis is in jog mode.

Recommended actions

Start linked motor service program. Reset jog mode.

50256, Sync pos warning

Description

Sensor movement outside limits. The sensor start pos should be arg than arg and found arg.

Recommended actions

Check programmed sensor position in robttarget. Start sync earlier or change robttarget.

50257, Sync speed warning

Description

Programmed speed outside limits. The speed should be arg than arg and found arg.

Recommended actions

- Check programmed robot speed.
 - Check sensor teach pos.
 - Check sensor nominal speed.
-

50258, Sensor direction error

Description

Programmed sensor pos speed arg and found sensor speed arg in opposite direction.

Recommended actions

- Check programmed sensor positions in robttarget.
 - Start sync earlier or reduce waitsensor distance.
-

50259, Sensor max distance error

Description

Distance between sensor position and programmed position too large. arg.

Recommended actions

- Check programmed sensor positions in robttarget.
 - Check sensor speed.
 - Start sync earlier or reduce waitsensor distance.
-

50260, Sensor Check dist error

Description

Distance sensor pos to programmed pos arg too large arg.

Recommended actions

- Check programmed sensor positions in robttarget.
 - Check sensor speed.
 - Increase max deviation.
-

Continues on next page

50261, WZone outside work area

Description

The definition of minimum limit for the World Zone *arg* is outside work area for: *argargarg...*

Recommended actions

Change the definition of the World Zone so the limit will be inside work area or insert 9E9 to remove an axis from test by the WZone.

50262, WZone outside work area

Description

The definition of maximum limit for the World Zone *arg* is outside work area for: *argargarg...*

Recommended actions

Change the definition of the World Zone so the limit will be inside work area or insert 9E9 to remove an axis from test by the WZone.

50263, Duty factor warning

Description

The duty factor for the gearbox of joint *arg* of robot *arg* is too high. Continued running without adjustment may cause damage to motor and gearbox. Contact your local ABB service support center.

Recommended actions

Reduce the speed or increase the wait time.

50265, Thickness out of reach

Description

Servo tool: *arg* Programmed thickness *arg* mm is out of reach.

Recommended actions

- Adjust programmed thickness.
- Check working range (min. stroke)

50266, Close request failed

Description

Not allowed to close servo tool: *arg* in reverse direction.

Pre-close position: *arg* mm.

Programmed thickness: *arg* mm.

Recommended actions

- Adjust pre-close position.
- Adjust programmed thickness.

50267, Open request failed

Description

Not allowed to open servo tool: *arg* in reverse direction.

Recommended actions

Check that programmed robtarget positions of the servo tool are larger than programmed thickness.

50268, Calibration failed

Description

Not allowed to calibrate servo tool: *arg* from negative position.

Recommended actions

Adjust servo tool position before calibration.

50269, Tune value out of limit

Description

Tune value for servo tool: *arg* is out of limit. Parameter: *arg*.

Recommended actions

Adjust tune value.

50271, Poor event accuracy

Description

Task: *arg*.

The system is presently configured with time event supervision, and now an event could not be accurately activated.

Program ref. *arg*.

Recommended actions

Decrease the programmed speed or increase the distance between the programmed positions. Turn off this check by changing the system parameters.

50272, Motion configuration

Description

Failed to read *arg* data for *arg*, from the configuration file.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

Check both configuration data for the current instance and any instances below in the structure.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50273, Motion configuration

Description

Incorrect configuration parameter *arg* for *arg*. The configuration parameter could for instance be an unknown type or a numerical value that is out of range.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50274, Motion configuration

Description

Failed to read or create *arg* with the name: *arg*. If the current instance exists it is read, else it is created. In other words, the instance could not be read or created.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50275, Motion configuration

Description

Failed to read next *arg* name, previous name is *arg*. The previous instance is ok, but the next instance cannot be read. Check also the configuration error log for more details.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50276, Motion configuration

Description

Standard servo queue length (*arg*) out of range (min=1, max=*arg*).

Recommended actions

Check std_servo_queue_length in the configuration file.

Use correct parameters and reset the system.

50277, Motion configuration

Description

Number of joints (*arg*) in dynamic group override. Allowed number is *arg*.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50278, Motion configuration

Description

Failed to configure servo gun (*arg*).

Recommended actions

Check the servo gun data in the configuration file.

Use correct parameters and reset the system.

50279, Motion configuration

Description

Servo tool change requires option Servo Tool Change.

Without this option, installation of this mechanical unit is not allowed.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50280, System configuration

Description

Mechanical unit *arg* is defined in more than one RAPID program.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50281, Process failed

Description

Task: *arg*.

A process in the task *arg* has failed. This is caused by a failure of a process in this task or a synchronized task if MultiMove is used.

arg.

Recommended actions

Check other messages occurring at the same time for the reason.

Recovery: *arg*.

50282, Record not ready

Description

Record not ready to activate.

Recommended actions

Make sure that record is finished before activating.

Check sensor_start_signal.

Continues on next page

50283, Unknown record file name

Description

Record file name: *arg* is unknown.

Recommended actions

Check file name or existence with file manager.

Record a new file.

Recommended actions

Check all programs that the semi coordinated movement is separated with finepoints and WaitSyncTask instructions before and after the movement and that the unit is not moved between.

Note that WaitSyncTask also is needed after the semi coordination before SyncMoveOn and SyncMoveResume.

Check that the unit is moved to the wanted position before the semi coordinated movement. After SyncMoveOff,

SyncMoveSuspend, ActUnit, DeactUnit or ClearPath the unit must be moved (with a new movement instruction) to a position to define the frame so the other task can read it. The position can be a new position, or the current position of the unit.

Check if the program for the unit is active in the task selection panel.

50284, Cannot activate Mechanical Unit

Description

The mechanical unit *arg* cannot be activated because it is not connected to a RAPID task.

Recommended actions

Check that the connection between mechanical unit and RAPID task is done correctly in the Controller configuration.

50288, Sync ID mismatch

Description

The specified id number for the move instruction has to be equal for all cooperating program tasks.

Current id number mismatch *arg*, *arg*.

Recommended actions

Verify that the specified id numbers are equal and that all PP are synchronized before program start.

50285, DitherAct not possible

Description

Dithering is not possible to activate.

Recommended actions

Verify that a joint that can be used with DitherAct is chosen.

50286, Mix of coordinated frames

Description

Task: *arg*.

More than one unit move frames, reason *arg*:

- 1) It is not allowed to have a chain of coordinated frames.
- 2) It is not allowed to exchange the unit that control the frame in a corner zone.

Program ref. *arg*.

Recommended actions

- 1) Rearrange the units so that all units, which perform coordinated movements, are following the same unit.
- 2) Insert a finepoint or a not coordinated movement between the two coordinated movements.

50287, Unit not stopped in a controlled position

Description

The robot *arg* is semi coordinated to unit *arg* from another task and the unit has been moved or the regain to the path failed.

Consequences

Program run or restart will be interrupted.

50289, Point type mismatch at sync

Description

The move instructions with syncId = *arg*, have a mix between finepoints and zonepoints.

Recommended actions

Make sure that the move instruction in all cooperating program tasks specifies the same kind of point type, either finepoints or zonepoints.

50290, Service unavailable

Description

Unable to obtain correct license.

Recommended actions

Please check the license settings.

50294, Transmission error of data

Description

Transmission of data between controller and robot memory has failed.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

Probable causes

Cable, or transmission electronics failed. Electrical interference high.

Recommended actions

- Restart try once more.
- Check cables.
- Check SMB-board.
- Check drive module.

50295, Motion data missing

Description

Data in robot and controller memory missing for mechanical unit *arg*.

Probable causes

Configuration file missing. New SMB-board together with new controller.

Recommended actions

- Load new configuration files.

50296, Robot memory data difference

Description

Data in robot memory is not same as in controller for mechanical unit *arg*.

Probable causes

Not the same data or serial number in robot and controller memory. Robot (SMB-board) or controller exchanged or configuration parameters changed.

Recommended actions

Check status via the FlexPendant and check if right configuration data (serial number) loaded in controller. Check that serial number belongs to the robot connected to the controller. If not, replace configuration files or manually transfer data from robot to controller memory if controller has been exchanged.

If serial measurement board is replaced with board from another robot (serial numbers not the same), clear first robot memory via the FlexPendant and then transfer data from controller to robot.

50297, Memory updated in robot

Description

Data for mechanical unit *arg* is moved from controller to robot memory.

Probable causes

Recommended actions

50298, Memory updated in controller

Description

Data for mechanical unit *arg* is moved from robot to controller memory.

Probable causes

Recommended actions

50299, Speed control warning

Description

Speed for unit *arg* is reduced due to limiting unit *arg*.

Task: *arg* Instruction line: *arg*.

Probable causes

Programmed speed too high on this unit or movement too long on limiting unit.

Recommended actions

Change path or programmed speed.

Set speed control off.

50300, Robot memory not used

Description

Robot memory is not used for this mechanical unit.

Probable causes

Additional axes can't and should not use the robot memory.

Recommended actions

50301, All robot data missing

Description

All data is missing in robot memory at SMB-board *arg*, link *arg*, drive module *arg*.

Probable causes

An error in robot memory or communication has occurred. The data has been cleared.

Recommended actions

If proper data exists in controller - transfer the data to robot memory. If still problem - check communication cable to SMB-board. Replace SMB-board.

Continues on next page

50302, Sensor data missing

Description

No serial number is defined for mechanical unit *arg* in robot memory.

Probable causes

The robot memory has been cleared or new SMB-board has been installed.

Recommended actions

If proper data exists in controller - transfer the data to robot memory.

50303, Controller data missing

Description

No serial number is defined for mechanical unit *arg* in controller.

Probable causes

The controller memory has been cleared or new controller has been installed.

Recommended actions

If proper data exists in robot memory - transfer the data to controller memory.

50305, Old SMB board used

Description

Old SMB board used without data memory.

Probable causes**Recommended actions**

Replace board with a new with data memory or set parameter 'Use old SMB' in configuration MOTION/ROBOT.

50306, Load identification error

Description

Cannot perform load identification because configuration angle makes inertia matrix singular.

Recommended actions

- Move axis 6 on the robot about 30 degrees in any direction.

50307, Extended working range

Description

The option Extended working range has been installed.
Make sure that the mechanical stop has been removed.

50308, In Position timeout

Description

Task: *arg*.

Program ref. *arg*.

Condition for finepoint not fulfilled within *arg* seconds.

Recommended actions

Check tuning of additional axes, In Position Conditions (In Position Range, Zero Speed) and check if disturbance of resolver cables.

50309, AbsAcc error

Description

Data moved from robot to controller memory. AbsAcc data not valid in robot memory. AbsAcc cleared in controller for mechanical unit *arg*.

Recommended actions

Load new AbsAcc data if data available.

50310, Independent joint not active

Description

Mechanical unit *arg* with independent joint is not active.

Recommended actions

Activate the mechanical unit before executing the independent joint instruction.

50311, Cannot activate Mechanical Unit in task

Description

The mechanical unit *arg* cannot be activated in specified task.

Recommended actions

Check the connection between mechanical unit and RAPID task in the Controller configuration.

50312, Mechanical Unit already active in other task

Description

Cannot activate mechanical unit *arg*, since it is already active in another RAPID task.

50313, Independent move reset failed

Description

Independent reset movement failed for *arg*, a synchronized movement (MoveL/MoveJ) of the servo tool occurred during the independent reset movement.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

Recommended actions

Make sure the synchronized speed of the servo tool is zero during execution of independent reset movements.

50314, Independent move outside reach

Description

Programmed independent move position for arg is outside reach.

Programmed position = arg mm.

Recommended actions

Adjust independent move position.

Check working range of the servo tool.

50315, Corner path failure

Description

Task: arg.

Interpolation and process stopped before the corner path due to some of the following reasons:

- Time delay.
- Closely programmed points.
- System requires high CPU-load.

arg.

Recommended actions

- Reduce the number of instructions between consecutive move instructions.
- Reduce speed, use wider spaced points, use /CONC option.
- Increase ipol_prefetch_time.

Recovery: arg.

50316, Absolute accuracy not activated

Description

Absolute accuracy function not activated for robot arg.

Consequences

Robot positioning will not be absolute accurate.

Recommended actions

Switch AbsAcc on by changing robot system parameter 'Use Robot Calibration' to calib.

Verify status in jogging window.

50317, Disconnecting the Drive Module not allowed

Description

An attempt was made to disconnect drive module arg, which is not allowed.

Consequences

The system goes to state Motors OFF, and then disconnects the drive module.

Probable causes

Disconnecting drive modules is only allowed in the Motors OFF state.

Recommended actions

Make sure that the system is in Motors OFF state before disconnecting the drive module.

50318, Reconnecting the Drive Module not allowed

Description

Drive module should not be reconnected since the system is not in the state Motors OFF.

Consequences

An attempt was made to reconnect drive module arg, which is not allowed.

Probable causes

Reconnecting drive modules is only allowed in the Motors OFF status.

Recommended actions

Make sure that the system is in Motors OFF state before reconnecting the drive module.

50319, Cannot activate Mechanical Unit

Description

An attempt was made to activate mechanical unit arg, which failed.

Consequences

The mechanical unit remains deactivated.

Probable causes

The mechanical unit is connected to drive module arg which is disconnected.

Recommended actions

- 1) Reconnect the drive module.
- 2) Retry to activate the mechanical unit.

50320, Drive Module has been disconnected

Description

Drive module arg has been disconnected.

Continues on next page

Consequences

No mechanical units connected to the drive module may be operated.

50321, Drive Module has been reconnected**Description**

Drive module *arg* has been reconnected after being disconnected.

Consequences

All mechanical units connected to drive module *arg* may be operated.

50322, Mechanical Unit not connected to Motion task**Description**

Cannot activate mechanical unit *arg*, since it is not connected to any motion task.

Recommended actions

Check the connection between mechanical unit and RAPID task in the Controller configuration.

50323, Failed to read force sensor**Description**

Failed to return calibrated force sensor reading.

Probable causes

Force control system not calibrated.

Recommended actions

Use the instruction FCCalib before using this instruction.

50324, Force control calibration failed**Description**

Failed to calibrate the force control system.

Probable causes

The system is not in position control.

Recommended actions

Make sure the robot is in position control mode before using the FCCalib instruction.

50325, Failed to activate force control**Description**

Activation of force control failed.

Probable causes

The system is either not calibrated or we are already in force control. Another reason for this could be incorrect arguments.

Recommended actions

Only use the FCAct or FCPress1LStart instruction when the force control system is calibrated and we are in position control. Check all arguments to the activation instruction.

50326, Failed to deactivate force control**Description**

Failed to return to position control.

Probable causes

Cannot set position control if the robot is moving due to external forces or ordered references.

Recommended actions

Stop any active references and remove any external forces and try again.

50327, Failed to start references**Description**

Failed to start the user specified references.

Probable causes

Only allowed to start references when in force control.

Recommended actions

Must activate force control before trying to start references.

50328, Parameter error in FCRefSprForce or FCRefSprTorque**Description**

Error in parameter 'Stiffness' in instruction FCRefSprForce or FCRefSprTorque.

Recommended actions

Change the parameter 'Stiffness' in instruction FCRefSprForce or FCRefSprTorque to a value larger than zero.

50329, Parameter error in FCRefSprForce**Description**

Error in parameter 'MaxForce' in instruction FCRefSprForce.

Recommended actions

Change the parameter 'MaxForce' in instruction FCRefSprForce to a value larger than zero.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50330, Parameter error in FCRefSprTorque

Description

Error in parameter 'MaxTorque' in instruction FCRefSprTorque.

Recommended actions

Change the parameter 'MaxTorque' in instruction FCRefSprTorque to a value larger than zero.

50333, Error FCRefLine, FCRefRot or FCRefCircle

Description

The parameter 'Distance' in instruction FCRefLine or instruction FCRefRot and the parameters Radius and Speed in instruction FCRefCircle have to be larger than zero.

Recommended actions

Change the parameters above according to the manual.

50335, Parameter error in FCRefSpiral

Description

Not allowed parameter value used in function FCRefSpiral.

Probable causes

Error in parameter values of function FCRefSpiral.

Recommended actions

Modify the parameter values in function FCRefSpiral.

50336, Parameter error in FCGetProcessData

Description

Failed to retrieve process information.

Probable causes

Using the optional parameter 'DataAtTrigTime' in instruction FCGetProcessData. If no trig has occurred this error is reported.

Recommended actions

Remove the optional parameter.

50337, Force sensor not setup

Description

Error in the force sensor parameters.

Recommended actions

Check the force sensor configuration parameters.

50338, Parameter error in FCCondAdvanced

Description

Error in parameter 'LogicCond' in instruction FCCondAdvanced.

Recommended actions

Modify the parameter 'LogicCond' in instruction FCCondAdvanced.

50339, Parameter error in FCCondTime

Description

Error in parameter 'Time' in instruction FCCondTime.

Recommended actions

Change the parameter 'Time' in instruction FCCondTime to a value larger than zero.

50340, Error in force control box definition

Description

An error in the parameter 'Box' in either FCCondPos or FCSupvPos.

Recommended actions

Change the parameter 'Box' in either FCCondPos or FCSupvPos.

50341, Error in force control cylinder definition

Description

An error in the parameter 'Cylinder' in either FCCondPos or FCSupvPos.

Recommended actions

Change the parameter 'Cylinder' in either FCCondPos or FCSupvPos.

50342, Error in force control sphere definition

Description

An error in the parameter 'Sphere' in either FCCondPos or FCSupvPos.

Recommended actions

Change the parameter 'Sphere' in either FCCondPos or FCSupvPos.

50343, Error in force control cone definition

Description

An error in the parameters for either FCCondOrient or FCSupvOrient.

Recommended actions

Change the parameters in either FCCondOrient or FCSupvOrient.

Continues on next page

50344, Joints outside limits in force control

Description

One or more joints are outside their working range in force control.

Recommended actions

Modify the program to avoid the physical joint limits.

50345, Force control supervision error

Description

The user specified supervision has triggered. The type is *arg*.

Types:

- 1: TCP position.
- 2: Tool orientation.
- 3: TCP speed.
- 4: Reorientation speed.
- 5: Force.
- 6: Torque.
- 7: Teach TCP speed.
- 8: Teach Reorientation speed.

Consequences

The robot will stop.

Recommended actions

Deactivate force control.

Modify the supervision or the program.

50346, Motor temperature error

Description

Motor temperature for joint *arg* is too high.

Consequences

It is not possible to continue until the motor has cooled down.

50348, Test signal error

Description

Definition of a test signal failed for *arg*, axis *arg* on channel *arg*.

Probable causes

The test signal number does not correspond to an actual test signal.

50349, Synchronization ID Warning

Description

Two consecutive synchronized move instructions in *arg* have the same synchronization ID value *arg*.

Consequences

If the ID value is repeated for more than one move instruction it can be very difficult to keep track of which move instructions are synchronized. This can, for example, cause problems when modifying positions.

Recommended actions

Change the synchronized move instruction *arg* in *arg* so that it has a unique synchronization ID value.

50350, Software Equalizing Not Allowed

Description

It is not possible to run Software Equalizing since Independent Move is active.

Recommended actions

Make sure independent move is not active when executing a Software Equalizing servo spot.

50351, Independent Move not allowed

Description

It is not possible to execute an Independent Move when Software Equalizing is active.

Recommended actions

Make sure Software Equalizing is off when executing an Independent Gun Move.

50352, Number of move instruction mismatch

Description

Using the path recorder within synchronized motion requires:
That Tool offset must be present for all or none cooperating program tasks.

That all cooperating program tasks move backwards/forwards the same number of move instructions.

Recommended actions

Verify that the all tasks or none of the tasks use the optional argument Tool Offset.

Verify that the pathrec identifier moving towards are at the same position in all tasks within the synchronized block.

50353, Failed to read data from encoder card

Description

The system has failed to read data from one encoder card.

Consequences

The tracking accuracy during acceleration and deceleration might be reduced.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

Probable causes

Wrong unit name has probably been specified in the process parameter for *arg*.

Recommended actions

1) Check that the correct unit name is specified in the process parameter eio unit name for *arg*.

50354, Ordered force reference is too large

Description

The ordered force reference is larger than the configured maximum value.

Consequences

The ordered force reference has been reduced to the configured value.

Recommended actions

To allow a larger reference force the system parameters need to be updated. Note that there is an absolute limit of force reference size that depends on the robot type.

50355, Ordered torque reference is too large

Description

The ordered torque reference is larger than the configured maximum value.

Consequences

The ordered torque has been reduced to the configured maximum value.

Recommended actions

To allow a larger reference torque the system parameters need to be updated.

50356, Ordered MaxForce is too large

Description

The parameter 'MaxForce' in instruction FCRefSprForce is larger than the configured maximum value.

Consequences

The parameter 'MaxForce' has been reduced to the configured maximum value.

Recommended actions

To allow a larger value the system parameters need to be updated.

50357, Ordered MaxTorque is too large

Description

The parameter 'MaxTorque' in instruction FCRefSprTorque is larger than the configured maximum value.

Consequences

The parameter 'MaxTorque' has been reduced to the configured maximum value.

Recommended actions

To allow a larger value the system parameters need to be updated.

50358, Close to singularity when in force control

Description

Close to singularity when in force control mode for robot *arg*.

Recommended actions

Modify path away from the singularity or change to joint interpolation.

50359, Path Recorder on StorePath level not allowed

Description

The path recorder can only be used on base path level. The path recorder has been stopped.

Recommended actions

Stop path recorder before StorePath, restart it after RestoPath.

50361, Brake release error

Description

Too large position error of joint *arg* after brake release.

Recommended actions

Try once more. Check cables. Check hardware. Check tuning if error on additional axis.

50362, Brake release time out

Description

Joint *arg* was not in position after max time for brake release.

Recommended actions

Try once more. Check cables. Check hardware. Check tuning if error on additional axis.

50363, SyncMoveOn failed

Description

Starting synchronized movements failed due to an internal error.

Continues on next page

Consequences

It is not possible to restart the programs from the current position.

Recommended actions

Move the program pointers and try again.

50364, Axis in current vector mode**Description**

Warning: Joint *arg* is configured in *arg* data as a current vector axis. Drive system will be disconnected for this axis during normal operation.

Recommended actions

Run service program to activate the current vector.

Set configuration data for the drive system parameter 'current_vector_on' to FALSE, for normal operation.

50366, Reference Error**Description**

An error has occurred in the reference calculation in motion planner *arg*. Internal status *arg*.

Consequences

The controller goes to Motors Off.

Recommended actions

Check the error logs for previous errors that could be causing this problem.

Try to restart the program possibly after moving the program pointer.

Restart the controller.

50367, Sensor Sync machine stop**Description**

Sensor Sync device *arg* has set machine stop signal *arg*.

Recommended actions

Do not restart robot before machine is open. Sensor sync is disabled.

50368, Too Short distance between equidistant events**Description**

The events are too close together. End of internal resources (events).

Task: *arg*.

Program ref. *arg*.

Recommended actions

Increase the distance between equidistant events or use intermediate positions to decrease segment length.

50369, Calibration using stored offset failed**Description**

Failed to calibrate the sensor using stored offset.

Consequences

The force control system is not calibrated. It is not possible to activate force control.

Probable causes

Calibration using stored offset is only possible if a normal calibration has been performed earlier.

50370, Transfer of data to robot memory failed**Description**

Transfer of data from controller to robot memory not allowed or interrupted for mechanical unit *arg* due to disconnect of SMB.

Probable causes

SMB was disconnected before or during calibration or manual move of data to robot memory.

Recommended actions

Retry to calibrate or manually move data from controller to robot memory when SMB is reconnected.

50371, The programmed speed is too high**Description**

The speed change functionality is only allowed for low programmed speed.

Probable causes

The programmed speed is too high.

Recommended actions

Lower the programmed speed or modify the configuration parameters.

50372, Contact force too high**Description**

The contact force is too high during the recover phase.

Probable causes

The programmed path in the recover function causes too high contact forces.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

Recommended actions

Check and modify the recover function or allow higher contact force.

50373, Too high Event Preset Time

Description

The configured Event Preset Time is too high. The maximum value is *arg*.

Consequences

The Event Preset Time is reduced to the maximum value.

Probable causes

This error can occur for robots with a low 'Dynamic Resolution' and a high 'Event Preset Time'. The reason is a computer memory limitation.

Recommended actions

Reduce the 'Event Preset Time' in the configuration parameters to a value no higher than *arg*.

50374, FC SpeedChange program stop error

Description

FC SpeedChange cannot stop robot at recover state.

Recommended actions

Move program pointer, jog robot away from current position and restart the program.

50375, Dynamic load too high

Description

Required torque for robot *arg* axis *arg* too high.

Recommended actions

If weaving one of these actions may help:

- Reduce weave frequency or weave amplitude for this movement.
- Reduce process speed.
- Increase zone size if small zones are used.
- Increase distance between programmed points if they are close.

If Conveyor Tracking: Reduce conveyor speed.

50376, Geometric interpolation failed

Description

Task. *arg*.

Failed to interpolate the desired geometry.

Program ref. *arg*.

(Internal code: *arg*).

Continues on next page

Recommended actions

Increase the zone size, move the programmed point, change tool orientation or change interpolation method.

50377, Only allowed in position control

Description

The instruction is only allowed when the robot is in position control mode.

Probable causes

The error depends on calling an instruction that is only allowed to be used in position control while in force control mode.

Recommended actions

Call the instruction only when the robot is in position control mode.

50378, Error in FCSetMaxForceChangeTune

Description

Incorrect value of the parameter 'ForceChange' in instruction FCSetMaxForceChangeTune.

Consequences

The program will stop.

Probable causes

The parameter must be set larger than zero and less than the configured value.

Recommended actions

Change the parameter value.

50379, Active mechanical units have changed

Description

When calling RestoPath all mechanical units have to be in the same active state as when StorePath was called.

Recommended actions

Make sure that all mechanical units that were active when calling StorePath still are and that no other mechanical unit is active when calling RestoPath.

50380, Checksum error

Description

Data in robot memory for mechanical unit *arg* has erroneous checksum.

Probable causes

New SMB-board. System shut down before data save finished.

Recommended actions

- Load new configuration files.

50381, Speed too low**Description**

Task. *arg.*

The speed is too low (numerical resolution).

Program ref. *arg.*

Recommended actions

Increase the programmed speed.

Check also the other synchronized tasks in a MultiMove application.

50382, Weave pattern error**Description**

Calculation of weave pattern has failed due to an internal error.

Recommended actions

Try to restart.

50383, Cartesian Soft Servo configuration error**Description**

Some configuration parameter for Cartesian Soft Servo is not valid.

Consequences

The system will not start.

Probable causes

Some configuration parameter has been set to a value that is not allowed.

Recommended actions

Verify that any modified parameter are within allowed limits.

50384, Cartesian Soft Servo quaternions invalid**Description**

The quaternions of the tool, workobject or the argument RefOrient in the CSSAct instruction are invalid.

Consequences

Cartesian Soft Servo will not activate.

Recommended actions

Check the quaternions of the tool, workobject or the argument RefOrient in the CSSAct instruction.

50385, Cartesian Soft Servo activation failed**Description**

The instruction CSSAct failed.

Probable causes

Cartesian Soft Servo already active.

Recommended actions

Cartesian Soft Servo needs to be deactivated before it can be activated.

50386, Cartesian Soft Servo offset activation failed**Description**

The instruction CSSForceOffsetAct failed.

Consequences

Force offset was not activated.

Probable causes

CSSForceOffsetAct instruction is only allowed when Cartesian Soft Servo is active.

Recommended actions

Activate Cartesian Soft Servo with the instruction CSSAct before using the instruction CSSForceOffsetAct .

50387, Cartesian Soft Servo close to unstable**Description**

Cartesian Soft Servo is close to unstable.

Consequences

The robot is halted as a security measure.

Probable causes

The system damping is too low.

Recommended actions

The damping is calculated from a ratio of stiffness.

Change the value of 'Stiffness' or 'StiffnessNonSoftDir' in the CSSAct instruction. If that does not help increase the value of the configuration parameter 'Damping stability limit' or change the parameter 'Stiffness to damping ratio'.

50388, Cartesian Soft Servo position supervision error**Description**

The user defined position supervision in Cartesian Soft Servo mode triggered.

Consequences

The robot halts.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

Probable causes

The position error is larger than the allowed range specified in the configuration.

Recommended actions

Increase the allowed position error in the configuration or modify the program.

50389, Cartesian Soft Servo singularity

Description

The robot is too close to singularity which effects the Cartesian Soft Servo behavior.

Consequences

The robot behavior will be different from specified.

Recommended actions

Modify the program to avoid the singularity.

50390, Cartesian Soft Servo speed supervision

Description

The user defined speed supervision in Cartesian Soft Servo mode triggered.

Consequences

The robot halts.

Probable causes

The speed error is larger than the allowed range specified in the configuration.

Recommended actions

Increase the allowed speed error in the configuration or modify the program.

50391, Cartesian Soft Servo movement not allowed

Description

Jogging or a programmed movement has been detected.

Consequences

The ordered movement is ignored.

Recommended actions

Movement during Cartesian Soft Servo is only allowed if the switch AllowMove has been used in the CSSAct instruction.

50392, SafeMove communication error

Description

Communication with SafeMove controller on drive module *arg* has failed.

Continues on next page

Consequences

Brake tests cannot be done.

Recommended actions

Check if SafeMove hardware is connected.

50393, Force offset applied in non-soft direction

Description

The force-offset direction in CSSForceOffsetAct is not the same as the soft direction specified by CSSAct.

Consequences

The robot will not become easier to push in the soft direction. There can also be position deviations from the programmed path in the non-soft directions.

Recommended actions

Make sure the direction given in CSSForceOffsetAct is compatible with the direction given in CSSAct.

50394, The Path for the Unit is cleared

Description

The robot *arg* is semi coordinated to unit *arg* from another task and the path for the unit has been cleared.

This can happen after a modpos, SyncMoveOff, SyncMoveSuspend, ActUnit, DeactUnit, ClearPath or if the unit has no move instruction with a well-defined position before starting the semi coordinated movement.

The position of unit *arg* cannot be read from other tasks.

Consequences

Program run or restart will be interrupted.

Recommended actions

- 1) If the programmed position of the unit is moved by modpos when the robot is semi coordinated to the unit, then step the unit to the new position to define the path and move the PP in the robot program to be able to restart the program.
- 2) Make sure that the unit *arg* has a move instruction with a finepoint to a well-defined position and that all programs has a WaitSyncTask before and after the semi coordinated movement.
- 3) Make sure that the unit is not moved during the semi coordinated movement. Note that WaitSyncTask also is needed after the semi coordination, before SyncMoveOn and SyncMoveResume.

50396, Default FC force supervision error

Description

The default force supervision has triggered because the programmed or measured external forces are larger than the safety limit for the robot type.

Consequences

The robot will stop.

Recommended actions

Modify the program to decrease the total external force acting on the robot.

50397, Path frame rotation speed error

Description

The rotation speed of the path frame is too high when using FC Machining with ForceFrameRef set to FC_REFFRAME_PATH.

Consequences

The robot will stop.

Recommended actions

Reduce programmed speed, increase corner zones, or decrease the distance between the programmed path and the surface.

50398, AbsAcc circle begins with a frame change

Description

Task: arg.

When having the AbsAcc option, MoveC instructions that are coordinated to another robot must use the same tool and work object as the previous move instruction.

Consequences

The robot will stop.

Recommended actions

Change the move instruction before arg so that they both use the same frames. Alternatively, add a (redundant) MoveL to the start point of the circle arc, using the same frames as the MoveC instruction.

50399, AbsAcc circle is first movement instruction

Description

Task: arg.

When having the AbsAcc option, MoveC cannot be the first movement instruction.

Consequences

The robot will stop.

Recommended actions

Add a movement instruction before arg, using the same tool and frames.

50400, Motion configuration error

Description

The parameter 'Disconnect at Deactivate' for measurement channel was inconsistent for measurement link arg. All channels on the same link have to have the same setting for this parameter.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50401, Startup synchronization failed

Description

The system relay 'arg' is defined but no response was received during the startup (waited for arg minutes).

Recommended actions

Make sure that the in_signal of the relay is configured and connected and startup all synchronized systems simultaneously.

50402, Correction is not ended in a finepoint

Description

Task: arg.

The last move instruction with correction specified has to be a finepoint.

Program ref. arg.

Recommended actions

Change the zone parameter to fine.

50403, AW board not connected

Description

During startup, no communication was established with unit <arg> on bus <arg>.

Consequences

It is not possible to access the unit or signals on the unit, since it is currently not communicating with the controller.

Probable causes

The unit is either not connected to the system, or it is connected, but has been assigned the wrong address.

Recommended actions

1) Make sure all unit addresses match the configuration.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

- 2) Make sure all addresses are unique, and not used by more than one unit.
- 3) Change the address and/or connect the missing unit.
- 4) If you changed the address, the power supply to the unit must be cycled (switched OFF and then back ON), to make sure the address has been changed.

50404, Additional axis movement during Wrist Interpolation

Description

Task: *arg*.

Program ref. *arg*.

An additional axis is programmed to move during wrist interpolation.

Consequences

The task execution will stop.

Recommended actions

Make sure that no additional axis is programmed to move while doing wrist interpolation.

50405, Coordinated movement during Wrist Interpolation

Description

Task: *arg*.

Program ref. *arg*.

Attempt to do wrist interpolation against a moving frame.

Consequences

The task execution will stop.

Recommended actions

Remove movement coordination while doing the wrist interpolation.

50406, Wrist Interpolation point not on circle plane

Description

Task: *arg*.

Program ref. *arg*.

The target *arg* is not on the circle plane. The deviation is *arg* mm.

p1 = starting point

p2 = circle point

p3 = end point.

Consequences

For a cutting process, the cut hole will not be circular.

Recommended actions

If a circular arc is intended, then change the corresponding target so that it is on the circle plane.

50407, Wrist axis locked

Description

Task: *arg*.

Program ref. *arg*.

Cannot do wrist interpolation using *arg* because axis *arg* is locked.

Consequences

The task execution will stop.

Recommended actions

Change to another wrist axis combination that does not involve the locked axis. Note that the robot must have at least two movable wrist axes to do wrist interpolation.

50408, Wrist joint limit

Description

Task: *arg*.

Program ref. *arg*.

Cannot do wrist interpolation because robot axis *arg* will violate a joint limit.

Consequences

The task execution will stop.

Recommended actions

Choose another robot configuration or another wrist axis combination.

50409, Wrist Interpolation not possible

Description

Task: *arg*.

Program ref. *arg*.

The programmed wrist interpolation is not kinematically possible using *arg*.

Consequences

The task execution will stop.

Recommended actions

Choose another robot configuration or another wrist axis combination. Possible wrist axis combinations are: Wrist45, Wrist46, and Wrist56.

Continues on next page

50410, Collinear targets in wrong order

Description

Task: *arg*.

Program ref. *arg*.

The programmed targets are collinear, but the end point is between the start point and the circle point.

Consequences

The task execution will stop.

Recommended actions

If a straight line is intended, then let the circle point and the end point swap places with each other.

50411, Maximum allowed programmed TCP load exceeded

Description

The currently defined TCP load for robot *arg* exceeds the maximum allowed load for the robot model.

Consequences

The robot will stop.

Probable causes

The combination of the current tool load *arg*, payload *arg* and the additional arm loads *arg*, *arg* exceeds the maximum load allowed for the robot model.

Recommended actions

Make sure that the total TCP load is inside the load diagram for the robot.

50412, Error in speed change tuning instruction

Description

The speed change tuning instruction resulted in an error.

Consequences

The robot will stop.

Probable causes

The speed change tuning instruction was not allowed, or the parameters given were invalid.

Recommended actions

Check the values for the parameter and tuning type, and make sure the correct force control option is installed and configured correctly.

50413, Bleeder resistor overload error

Description

In drive module *arg*, the bleeder resistor connected to the rectifier unit at drive unit position *arg* was overloaded.

Consequences

No operation will be possible until the bleeder resistor has cooled down. The system goes to Motors Off state.

Probable causes

- 1) The user program may contain too much deceleration of the manipulator's axes. This fault is more likely if the system contains additional axes.
- 2) Bleeder resistor has wrong resistance.
- 3) Short circuit in motor cable between phase to phase or phase to ground.

Recommended actions

- 1) Rewrite the user program to reduce the amount of hard decelerations.
- 2) Disconnect the bleeder and check the cable and measure the bleeder resistance. The expected resistance should be approximately *arg* ohms.
- 3) Verify that the motor cables has no short circuits internally or to ground.

50414, Bleeder resistor overload warning

Description

In drive module *arg*, the bleeder resistor connected to the rectifier unit at drive unit position *arg* is close to overload.

Consequences

Operation will be possible but system is close to a stopping error.

Probable causes

- 1) The user program may contain too much deceleration of the manipulator's axes. This fault is more likely if the system contains additional axes.
- 2) Bleeder resistor has wrong resistance.
- 3) Short circuit in motor cable between phase to phase or phase to ground.

Recommended actions

- 1) Rewrite the user program to reduce the amount of hard decelerations.
- 2) Disconnect the bleeder and check the cable and measure the bleeder resistance. The expected resistance should be approximately *arg* ohms.
- 3) Verify that the motor cables has no short circuits internally or to ground.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50415, Motor temperature error

Description

Motor temperature for joint *arg* is too high.

Consequences

It is not possible to continue until the motor has cooled down.
The system goes to Motors Off state.

Probable causes

The user program may contain too much hard acceleration and deceleration of the joint. Gravity torque or external forces for the joint can also be too high.

Recommended actions

Rewrite the user program to reduce the motor utilization.
If error occurs in spite of cold motor due to extra cooling or low ambient temperature, the sensitivity of the thermal supervision can be reduced. Decrease the system parameter 'Thermal Supervision Sensitivity Ratio' in topic Motion and type Arm in steps of 0.1.
WARNING! : With too low value the supervision is deactivated and the motor can be overheated and destroyed!

- 2) Short circuit in the manipulator using long motor cables.

Recommended actions

- 1) If possible, rewrite the user program to reduce the amount of hard acceleration and hard deceleration.
- 2) Reduce the static torque due to gravity or external forces.
- 3) Check for short circuit in the motor cable or in the motor.
- 4) Check for other hardware event logs.

50418, Drive unit overload warning

Description

The drive unit for joint *arg*, connected to drive module *arg* with the drive unit at unit position *arg* and node *arg* is approaching a too high temperature level.

Consequences

It is possible to continue but margin to max temperature is too low for long term operation.

Probable causes

- 1) The joint may be running with a too high torque for extended periods of time.
- 2) Short circuit in the manipulator using long motor cables.

Recommended actions

- 1) If possible, rewrite the user program to reduce the amount of hard acceleration and hard deceleration.
- 2) Reduce the static torque due to gravity or external forces.
- 3) Check for short circuit in the motor cable or in the motor.
- 4) Check for other hardware event logs.

50416, Motor temperature warning

Description

The motor temperature for joint *arg* is close to maximum value.

Consequences

It is possible to continue but the margin to maximum allowed temperature is too low to sustain long term operation.

Probable causes

The user program may contain too much hard acceleration and hard deceleration of the joint. The gravity torque or external forces for the joint can also be too high.

Recommended actions

Rewrite the user program to reduce the motor utilization.

50419, Common base_frame error

Description

Task: *arg*.

The base_frame is moved by another task than the robot and could not be solved, reason *arg*:

- 1) SingArea\Wrist not supported with MoveC.
- 2) The base_frame must be moved by first synchronized motion_group.
- 3) Only one common base_frame can be handled.
- 4) AbsAcc not supported with MoveC.
- 5) The common base_frame can only be solved in synchronized move.

Program ref. *arg*.

Recommended actions

- 1) Use SingArea\Off. The CirPathMode can also be used.
- 2,3) Check controller and motion configuration.
- 4) Use MoveL or remove AbsAcc.
- 5 Use MoveAbsJ.

50417, Drive unit overload error

Description

The drive unit for joint *arg* has reached a too high temperature level. The joint is connected to drive module *arg* with the drive unit at unit position *arg* and node *arg*.

Consequences

No operation will be possible until the drive has cooled down.
The system goes to Motors Off state.

Probable causes

- 1) The joint may be running with a too high torque for extended periods of time.

Continues on next page

50420, IndCnv Mechanical Unit Error

Description

The mechanical unit *arg* is not correctly configured for IndCnv functionality.

Consequences

Program execution is stopped.

Probable causes

The mechanical unit *arg* consists of more than one single.

The single connected to *arg* is not of type 'FREE_ROT'.

The single connected to *arg* is not defined as an Indexing Move single.

Recommended actions

Make sure mechanical unit *arg* consists of only one single.

Make sure configuration parameter Motion/Single

Type/Mechanics is of type 'FREE_ROT'.

Make sure configuration parameter Motion/Single Type/Indexing Move is TRUE.

Consequences

The program execution is stopped.

Recommended actions

Increase system parameter "Motion/Single Type/Time before indexing move" to at least *arg* (ms).

Remove or decrease robot acceleration limitations if possible.

Please consult the Conveyor Tracking application manual for further actions.

50424, IndCnv Robot type not supported

Description

The IndCnv functionality does not support the installed robot type.

Consequences

The program execution is stopped.

50425, Friction FFW parameter is not On

Description

Tuning friction parameters requires Friction FFW On to be set to True.

Consequences

Friction tuning for joint *arg* will have no effect.

Recommended actions

Set parameter 'Friction FFW On' to True for joint *arg* in the type *arg* that belongs to the topic Motion.

50426, Out of interpolation objects

Description

The maximum number of available interpolation objects has been reached. This can occur if the dynamic performance is set to a very low value e.g. by use of the AccSet or PathAccLim command.

Consequences

The program execution is stopped and the system goes to motors off state.

Recommended actions

Increase the number of objects by increasing the value of the 'Use Additional Interp. Object Batch' system parameter by 1, in the corresponding instance of type Motion Planner in the topic Motion.

50421, IndCnv Tracking Single Error

Description

The single *arg* is not configured as an Indexing Move single

Consequences

Program execution is stopped.

Recommended actions

Make sure configuration parameter Process/Can

Interface/Single To Track refers to a single with Motion/Single Type/Indexing Move set to TRUE.

50422, IndCnv and Independent joint error

Description

Independent joint instructions are not allowed when single *arg* is in indexing mode.

Consequences

Program execution is stopped.

Recommended actions

Execute the RAPID instruction IndCnvReset before using the axis as an independent joint.

50423, IndCnv Time before indexing move too low

Description

The time between trig signal and start of indexing movement is configured too low.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50427, Joint not synchronized after calibration

Description

After fine calibration of joint *arg* which is using alternative calibration position, the joint has not been moved to normal synchronize position for updating the revolution counter.

Consequences

The system will unsynchronize the joint next time the system makes a restart or power up.

Recommended actions

Clear the revolution counter in normal position for clearing revolution counter.

- Check the Ethernet cabling and connector on both main and axis computer.

- Reduce load on main computer.

50431, Predicted Collision

Description

Predicted a collision between objects '*arg*' and '*arg*'.

Consequences

The robots stop immediately.

Probable causes

RobotWare has predicted that one or more robots are about to collide.

Recommended actions

- Jog the robot in another direction if the problem occurred during jogging.
- Change the robot program to increase the clearance between the involved objects.
- Decrease the safety distance for the involved objects (in the Collision Avoidance configuration file).
If you are sure that the involved objects are not about to collide, then try the following:
 - Check that the Collision Avoidance configuration for the involved objects is correct.
 - Check that the base-frame definition of the involved robots are correct.
 - Turn off Collision Avoidance.

50429, CSS parameter damping obsolete

Description

The CSS parameters regarding damping is obsolete. The damping is now in all directions set by the stiffness to damping ratio. To change the behavior of the non-soft directions, use the parameters stiffness non soft directions.

Recommended actions

Change the damping parameters to stiffness non soft directions according to description in the manual.

If you are sure that the involved objects are not about to collide, then try the following:

- Check that the Collision Avoidance configuration for the involved objects is correct.
- Check that the base-frame definition of the involved robots are correct.
- Turn off Collision Avoidance.

50430, Underrun in the Axis computer

Description

The axis computer in drive module *arg* has detected underrun of data from the main computer and therefore stopped the execution.

Consequences

The system goes to SYS HALT.

Probable causes

- There is a communication error/glitch between the main computer and the axis computer.
- A previous error has put the system in a high CPU load state.
- High load in the main computer, for example generated by too frequent EIO communication.

Description

The mechanical units *arg* and *arg* have identical base frames.

Consequences

Since the base frames are identical, Collision Avoidance can only check for robot self-collisions. Hence, collision checks between robots and between robot and environment will not be done.

Probable causes

The base frames are not properly defined.

Recommended actions

Define the base frames, for example using the base-frame calibration routine.

Recommended actions

- Check for other error logs.

Continues on next page

50433, Position changed to inside working area

Description

The joint *arg* is outside its normal working area when an Independent Reset instruction is executed.

Consequences

The position is moved to inside the normal working area.

Probable causes

The joint has been moved too far away in independent mode. The configured normal working area is too small.

Recommended actions

To avoid warning - move the joint back to inside its normal working area before the instruction IndReset executed or PP to Main is done.

Increase the normal working area.

50434, Position changed to inside working area

Description

The joint *arg* is outside its normal working area when an Independent Reset instruction is executed with argument Old.

Consequences

The position is moved to inside the normal working area.

Probable causes

The joint has been moved too far away in independent mode before IndReset Old.

The configured normal working area is too small.

Recommended actions

To avoid warning - move the joint back to inside its normal working area before the instruction IndReset Old executed or PP to Main is done.

Increase the normal working area.

50435, Inconsistent configuration parameter

Description

The joint *arg* has an inconsistent value in the configuration parameter "arg" in instance *arg*.

Consequences

System cannot start up.

Probable causes

Two or more joints has different values on same configuration parameter.

Recommended actions

Set the same value/name on the parameter for all joints that are pointing to the same instance or hardware.

50436, Robot configuration error

Description

It is not possible to reach the programmed position with given robot configuration.

Task: *arg*.

Program ref. *arg*.

Probable causes

The programmed position is such that the robot cannot reach the given robot configuration or must pass through a singular point to reach the position.

Recommended actions

Step through the program in manual mode and modify the faulty points. Note that it is possible to continue in manual mode as only first try is stopped. The movement can also be changed by use of SingArea\Wrist, ConfL\Off or be replaced by MoveJ.

50437, Follower axis is connected to wrong Motion Planner

Description

The follower axis *arg* is connected to a motion planner with a lower number than its corresponding master axis *arg*.

Consequences

The performance of the Electronically Linked Motors will be decreased compared to the normal setup.

Recommended actions

Change the Motion configuration in such a way that the follower axis *arg* is in the same motion planner or in a motion planner with a higher number than the master axis *arg*.

50438, Motor off sequence has timed out

Description

The mechanical unit *arg* has not been able to finish the motor off sequence during configured time.

Consequences

The brake sequence can be ended before the axes standing still.

Recommended actions

- 1) If the time to brake axis is longer than the default value of 5 seconds, increase the value by setting the system parameter 'Max Brake Time' in topic Motion and type Brake to a higher value.
- 2) Restart the controller.
- 3) Try again.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50439, Soft servo activation failure

Description

The joint *arg* has not been able to set to soft servo mode. The reason for this is that the axis has reached its maximum torque level a short time before or during activation.

Consequences

The system makes an emergency stop and the soft activation command is canceled.

Recommended actions

- Find the reason for the high torque.
- Check if any collision has occurred.
- Check load data.
- Reduce acceleration or speed to reduce speed.
- Check hardware.
- Move the program pointer and restart.

Program ref. *arg*.

Robot: *arg*.

Axis: *arg*.

Probable causes

The programmed position is such that at least one robot axis cannot move from the current position to the given robot configuration or must pass through a singular point to reach the position.

Recommended actions

Step through the program in manual mode and modify the faulty points. Note that it is possible to continue in manual mode as only first try is stopped. The movement can also be changed by use of SingArea\Wrist, ConfL\Off or be replaced by MoveJ.

50440, Correction generator lost

Description

Correction generator has been removed.

Probable causes

Instruction CorrDiscon or CorrClear during robot movement.

Recommended actions

Wait until robot reach finepoint or start movement without \Corr.

50443, Lack of Internal Event Objects

Description

Too few internal event objects were allocated to execute the instruction.

Consequences

The movement of all mechanical units was halted immediately.

Probable causes

Not enough event objects were allocated.

Recommended actions

Allocate more event objects by increasing the system parameter 'Number of Internal Event Objects' in topic Motion and type Motion Planner and restart the controller.

50441, Low voltage on battery inputs

Description

The serial measurement board on drive module *arg*, link *arg* and board number *arg* indicates low voltage. If main power is switched off the revolution counters will be lost.

Battery voltage: *arg* V.

External voltage: *arg* V.

Probable causes

The battery is not connected or discharged. If external power supply is used, too low voltage is present.

Recommended actions

- Replace battery.
- If external power supply is used - check cables and power source.

50444, Manipulator supervision

Description

Loose arm detection triggered for axis *arg* on mechanical unit *arg*.

Consequences

The movement of mechanical unit *arg* is halted immediately. It then returns to a position on the path on which it was running. There, it will remain in status Motors ON, awaiting a start request.

Probable causes

Triggering of the manipulator supervision may be caused by a detection of loose arm, collision, incorrect load definition or forces in external process.

Recommended actions

- 1) If any of the parallel arms has come loose reattach them if possible, then acknowledge the fault, and resume operation by pressing the Start button on the FlexPendant.

50442, Robot axis configuration error

Description

It is not possible to reach the programmed position with given robot configuration.

Task: *arg*.

Continues on next page

- 2) If possible, acknowledge the fault, and resume operation by pressing the Start button on the FlexPendant.
- 3) Make sure any loads are defined and identified correctly.
- 4) If the mechanical unit is exposed to forces from the external processes, use RAPID command or system parameters to raise the supervision level.

50445, Sync on/off not allowed while External Motion Interface is active

Description

Switching synchronized motion on or off while External Motion Interface is activated is not allowed.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

SyncMoveOn or SyncMoveOff was executed while External Motion Interface was active.

Recommended actions

SyncMoveOn and SyncMoveOff are not allowed to be executed while External Motion Interface is active. Check the application that is utilizing the External Motion Interface functionality, and correct the RAPID program.

50446, External Motion Interface ramp time increased

Description

External Motion Interface ramp time was increased in order to avoid over-speed when ramping down correction arg.

New ramp time: arg seconds.

Consequences

The user defined ramp time was increased to avoid over-speed.

Recommended actions

Increase the maximum allowed correction speed to allow faster ramp-down, or increase the user defined ramp time.

50447, Incorrect mechanical units for External Motion Interface

Description

One or more specified mechanical units for correction arg are not allowed in External Motion Interface.

Consequences

The correction will not be activated.

Probable causes

An attempt was made to activate an External Motion Interface correction with mechanical units that are not active, or do not belong to the same motion task.

Recommended actions

Check the application that is utilizing the External Motion Interface functionality, and change the activation parameters to the correct mechanical unit(s).

50448, Error in External Motion Interface input

Description

Illegal format for the External Motion Interface input for correction arg.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

The format of the input written to External Motion Interface was illegal. Two possible reasons are:

- The quaternions that are used by External Motion Interface are not properly normalized.
- Other illegal numerical values used as input to External Motion Interface.

Recommended actions

Make sure that the External Motion Interface input data is correct, and restart the program.

50449, Mechanical unit close to joint bound

Description

The movement created by the External Motion Interface correction arg is causing mechanical unit arg joint arg to move too close to its joint bound.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

One or more axes is approaching its joint bound.

Recommended actions

Avoid moving too close to the joint bounds, or decrease the maximum allowed correction speed to decrease safe stop distance.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50450, External Motion Interface activation error

Description

The activation of External Motion Interface correction arg failed.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

Communication with the source of External Motion Interface input, for example a sensor or other device, could not be set up correctly.

Recommended actions

Check for possible other error messages regarding sensor or communication errors.

50451, External Motion Interface deactivation

error

Description

The deactivation of External Motion Interface correction arg failed.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

Communication with the source of External Motion Interface input, for example a sensor or other device, could not be deactivated correctly.

Recommended actions

Check for possible other error messages regarding sensor or communication errors.

50452, External Motion Interface cyclic error

Description

Cyclic execution of External Motion Interface correction arg failed.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

Communication with the External Motion Interface input source, for example a sensor or other device, has failed.

Recommended actions

Check for possible other error messages regarding sensor or communication errors.

50453, Move not allowed in External Motion Interface

Description

External Motion Interface correction arg is not setup to allow RAPID movement instructions or jogging.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

The application utilizing the External Motion Interface functionality does not allow RAPID movement instructions or jogging.

Recommended actions

Make sure no other movements are ordered while External Motion Interface is active.

50454, External Motion Interface position supervision

Description

The position is outside the allowed range for External Motion Interface correction arg, mechanical unit arg joint arg.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

The deviation of the position from the path or the latest finepoint exceeded the maximum allowed value.

Recommended actions

Check the application that is utilizing the External Motion Interface functionality to increase the maximum allowed position value, or modify the programmed positions to be closer to the goal position.

50455, External Motion Interface speed supervision

Description

The speed was outside the allowed range for External Motion Interface correction arg, mechanical unit arg joint arg.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

The speed was outside the allowed range.

Continues on next page

Recommended actions

Check the application that is utilizing the External Motion Interface functionality to increase the maximum allowed speed value.

50456, Close to singularity while External Motion Interface active**Description**

The robot in External Motion Interface correction *arg* is too close to a singularity.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

The robot is close to a singularity, or too small numerical tolerance have been specified in the configuration parameters.

Recommended actions

Avoid moving too close to the singularity.

50457, External Motion Interface configuration failed**Description**

The system could not read the configuration parameters for External Motion Interface correction *arg*.

Consequences

The task execution will stop.

Probable causes

There are incorrect or missing parameters in the configuration for the correction.

Recommended actions

Check the configuration parameters for type 'External Motion Interface Data' under topic Motion.

50458, Programmed speed too high**Description**

The programmed speed is too high for External Motion Interface correction *arg*.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

External Motion Interface correction is not allowed when the programmed speed is too high.

Recommended actions

Decrease the programmed path speed.

50459, External Motion Interface input out of bounds**Description**

The External Motion Interface input for correction *arg* was outside bounds for mechanical unit *arg* joint *arg*.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

The specified External Motion Interface input was outside the joint bounds for a robot or additional axis.

Recommended actions

Make sure the input is inside the bounds, and restart the program.

50460, External Motion Interface deactivation not allowed**Description**

External Motion Interface correction *arg* cannot be deactivated while mechanical units are moving.

Consequences

The program execution is stopped, and the system goes to motors off state.

Probable causes

An attempt is made to deactivate a correction, while one or more mechanical units are moving.

Recommended actions

Make sure all movements and other External Motion Interface corrections have finished before deactivating.

50461, Too many continuous log signals**Description**

The maximum number of continuous log signals have been reached. No additional log signals can be defined.

Consequences

The required log signal will not be defined.

Probable causes

To avoid high CPU load the maximum number of continuous log signals is limited to *arg*. All log signals except binary IO signals are categorized as continuous.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

Recommended actions

Delete any unnecessary log signals.

50462, Cartesian speed too high

Description

Too high speed has been detected for the wrist center point or the arm check point for robot *arg*.

Consequences

The system makes an emergency stop.

Probable causes

- External interference forces has caused the robot to move too fast.
- Check error log for other causes.

Recommended actions

Reduce speed of robot.

50463, Log server communication error

Description

Sending logged test-signals over the network failed.

Internal error code: *arg*.

Consequences

Logging is deactivated and all defined test-signals are removed.

Probable causes

Client was shut down without disconnecting properly, network errors, or too high CPU load on the robot controller.

Recommended actions

Check Ethernet connections.

Define fewer test-signals.

50464, A collision has occurred

Description

Task: *arg*.

A collision has occurred for task *arg*. This can be handled in a RAPID error handler. If it is not handled, the RAPID execution will stop.

arg.

Recommended actions

Check other messages occurring at the same time for the reason.

Recovery: *arg*.

50465, Tuning of robot stiffness parameters is recommended

Description

No tuned system parameters for 'Motion Process Mode' on robot *arg* found.

Recommended actions

Use the robot variant of the TuneMaster application to tune and set 'Motion Process Mode' parameters for *arg*.

50466, Measurement Channel Conflict

Description

Joint *arg* is using the same measurement channel *arg* as another joint. This is only allowed when they also share the same drive system.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50467, Brake Relay Conflict

Description

Mechanical unit *arg* shares brake relay with mechanical unit *arg*, but 'Activate at Start Up' and 'Deactivation Forbidden' is missing.

This configuration can cause unexpected movement of the axis at program start due to brakes being released while the axis is not being controlled.

Recommended actions

Check the configuration file.

Use correct parameters and reset the system.

50468, Cartesian speed limits changed

Description

Cartesian speed limits have been changed for robot *arg*. The current 'Global Speed Limit' is *arg* m/s and 'Arm Check Point Speed Limit' is *arg* m/s.

The previous 'Global Speed Limit' was *arg* m/s and 'Arm Check Point Speed Limit' was *arg* m/s. Note that every robot type has a maximum limit that cannot be exceeded even if an attempt is made to configure a higher value.

Recommended actions

Verify that these limits are correct.

Continues on next page

50469, I/O controlled axis configuration failed

Description

Mechanical unit *arg* IO signal *arg* missing.

Consequences

Mechanical unit *arg* can't be used.

Probable causes

The required IO signal *arg* is not defined.

Recommended actions

The required IO signal *arg* must be defined.

50470, I/O controlled axis not ready for activation

Description

The IO signal *arg* is low.

Consequences

Mechanical unit *arg* can't be used.

Probable causes

The IO signal *arg* must be high for activation.

Recommended actions

The IO signal *arg* must be set.

50471, I/O controlled axis not ready

Description

The IO signal *arg* is low.

Consequences

Mechanical unit *arg* can't be used.

Probable causes

The IO signal *arg* must be high.

Recommended actions

The IO signal *arg* must be set.

50472, Absolute accuracy data missing

Description

Absolute accuracy is activated but no data exists for robot *arg*.

Consequences

Robot positioning will not be absolute accurate.

Recommended actions

Make sure that absacc.cfg is loaded into controller memory.

Verify that data exists in a backup.

50473, Ascii Log Configuration Failed

Description

Ascii Log Setup file *arg* not found or incorrect.

Consequences

Ascii Log function can't be used.

Probable causes

The required Ascii Log Setup file *arg* is missing or incorrect.

Recommended actions

Verify the Setup file name and directory.

50474, Target in a singularity

Description

The robot target is near singular because joint *arg* is too close to *arg* degrees.

Recommended actions

During program execution, use SingArea instruction or MoveAbsJ.

During jogging, use axis by axis.

50475, Target in a singularity

Description

The robot target is near singular because the TCP is too close to the arm-angle reference direction.

Recommended actions

During program execution, use MoveAbsJ or use a different reference direction.

During jogging, use axis by axis or use a different reference direction.

50476, AxisCal error

Description

Data moved from robot to controller memory. AxisCal data not valid in robot memory. AxisCal cleared in controller for mechanical unit *arg*.

Recommended actions

Load new AxisCal data if data available.

50477, Axis Calibration data missing

Description

Mechanical unit *arg* is calibrated with axis calibration but configuration parameters are missing from controller.

Consequences

Cannot execute the axis calibration service routine.

Recommended actions

Make sure that axis calibration configuration is loaded into controller memory.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

Verify that data exists in a backup.

50478, Could not deactivate lead-through

Description

Could not deactivate lead-through mode because one or more joints were moving.

Consequences

The controller goes to Motors Off.

Probable causes

One or more joints were being moved in lead-through mode when the deactivation command was sent. The controller will deactivate lead-through mode when the user jogs or starts a program.

Recommended actions

Make sure that the system is standing still when deactivating lead-through mode.

50479, Cannot jog joints in independent mode

Description

An attempt was made to jog one or more joints in independent mode.

Consequences

Joints in independent mode cannot be jogged.

Recommended actions

Make sure that independent mode is not used when trying to jog. Use IndReset to reset joint or PP to Main to reset all joints.

50480, I/O controlled axis RefSync failed

Description

Internal error during refsync or robot moving.

Consequences

I/O controlled axis feedback pos and pos ref are not synchronized.

Recommended actions

- Wait until zero speed and check internal error.
- Make a new RefSync.

50481, I/O controlled axis not synchronized

Description

Refsync not finished when the IO signal arg is changed.

Consequences

I/O controlled axis arg feedback pos and pos ref are not synchronized.

Recommended actions

Run Refsyncon before change of arg signal or check internal error.

50482, Search speed not reached

Description

A collision search hit was detected on the servo gun before the full search speed was reached.

Consequences

The accuracy of the results may be unreliable.

Recommended actions

Check that there is enough time to accelerate and that nothing obstructs the servo gun.

50483, Movement in wrong direction

Description

Moving from current to target position when opening arg gave a movement in wrong direction.

Consequences

The opening sequence will start with a closing movement.

Probable causes

The motion force control has to move the mechanical unit back to the starting position it had when taking over from the position control, before handing back the control to the position control. In this case the starting position for the force movement is more closed than current position is and that will lead to closing movement before position control can take over.

The situation indicate that there was a collision with the plate during the closing movement, that the plate thickness is not correct, or that the calibration is not correct.

Recommended actions

- 1) Make sure that the proper configuration is made, e.g. plate thickness.
- 2) Make sure that the calibration is correct.

50484, Stop-point too far away from circle

Description

Task: arg

Program ref. arg

The detected stop-point during execution of a SearchC instruction is too far away from the circle-arc. This can happen if a large zone is used in the preceding movement-instruction.

Consequences

It will not be possible to run the movement backwards.

Continues on next page

Probable causes

A too large zone was used in the movement-instruction preceding the SearchC.

Recommended actions

Use a smaller zone in the movement-instruction preceding the SearchC.

50485, Using old arm-angle definition

Description

The 7-axis robot *arg* is configured to use the old definition of the arm-angle.

Consequences

This definition of the arm-angle is obsolete and will be removed in a future release. Using the old arm-angle definition can in some cases lead to incorrect movement of the robot.

Recommended actions

Change the configuration parameter Arm-Angle definition to 'New'. Convert robtargs in the RAPID program to the new arm-angle definition.

50486, Load supervision

Description

A mismatch between the expected and actual joints torques for the mechanical unit *arg* has been detected during the last *arg* minutes.

Consequences

There is a risk of overloading the mechanical structure.

Probable causes

The load on the mechanical unit is bigger than expected.

Recommended actions

Make sure all loads are defined correctly.

50487, Motion configuration

Description

Update of configuration parameter *arg* for *arg* failed.

The changes will not take effect until the controller is restarted.

Recommended actions

- Restart the controller.

50488, Using old target definition

Description

The target for robot *arg* is using the old definition for cfx.

This is not compatible with the new arm angle definition.

Recommended actions

Convert robtargs in the RAPID program to the new arm-angle definition (recommended) or change the configuration parameter Arm-Angle definition in topic Motion and type 'Robot' to 'Old'.

50489, Trigg distance larger than movement length

Description

A triggdata has been setup with a distance larger than the movement length.

Recommended actions

- 1) Check for programmed points too close to each other.
- 2) Check the Distance parameter in instructions like TriggInt, TriggEquip, TriggIO and other Trigg instructions.

50490, Measurement error detected

Description

A measurement error was detected for joint *arg* while robot was in battery mode (power off).

Consequences

The joint is unsynchronized.

Probable causes

The joint may have moved quickly while in battery mode.

Recommended actions

- 1) Update the revolution counter for the joint.
- 2) Make sure that the robot is fixed while being transported so that quick movements are avoided.

50491, Dual-arm base frame error

Description

The mechanical units *arg* and *arg* are a dual-arm system, but have different base frame data.

Consequences

Coordination between the two arms will not work. Collision prediction will not work.

Probable causes

The base frame data are different for the two units.

Recommended actions

Give both units the same base frame configuration data.

Continues on next page

5 Trouble shooting by event log

5.7 5 xxxx

Continued

50492, Error during jogging

Description

An attempt was made to jog in some mode other than axis by

axis, while one or more revolution counters were not updated.

Recommended actions

- 1) Use axis by axis jogging.
- 2) Update revolution counters.

5.8 7 xxxx

71001, Duplicate address

Description

The I/O configuration is invalid.

The same addresses have been given for I/O device *arg* and I/O device *arg*.

I/O devices connected to the same network must have unique addresses.

This I/O device has been rejected.

Recommended actions

- 1) Check that addresses are correct.
- 2) Check that the I/O devices are connected to the correct network.

71003, I/O device undefined

Description

The I/O configuration for I/O signal *arg* is invalid.

Consequences

This I/O signal has been rejected, and no functions depending on it will work.

Probable causes

The I/O device *arg* is unknown. All I/O signals must refer to an existing/defined I/O device.

Recommended actions

- 1) Make sure the I/O device is defined.
- 2) Make sure the I/O device name is correctly spelt.

71005, Invalid filter time

Description

The I/O configuration for I/O signal *arg* is invalid.

The passive filter time should either be 0 ms or in the range [*arg*, *arg*] ms.

This I/O signal has been rejected.

Recommended actions

Correct the passive filter time for the I/O signal.

71006, Invalid filter time

Description

The I/O configuration for I/O signal *arg* is invalid.

The active filter time should either be 0 ms or in the range [*arg*, *arg*] ms.

This I/O signal has been rejected.

Recommended actions

Correct the active filter time for the I/O signal.

71007, Logical values out of range

Description

The I/O configuration for I/O signal *arg* is invalid.

The logical minimum value must be less than the logical maximum value.

This I/O signal has been rejected.

Recommended actions

Correct the logical values for the I/O signal so that the minimum value becomes less than the maximum value.

71008, Physical values out of range

Description

The I/O configuration for I/O signal *arg* is invalid.

The physical minimum value must be less than the physical maximum value.

This I/O signal has been rejected.

Recommended actions

Correct the physical values for the I/O signal so that the minimum value becomes less than the maximum value.

71017, Cross connection without actor I/O signal

Description

The I/O configuration of cross connection *arg* is invalid.

The parameter Actor *arg* have been omitted.

Rules:

- 1) All cross connections must specify at least one actor signal, i.e. parameter Actor I/O signal 1 must always be specified.
- 2) For each operator specified an actor I/O signal must follow, e.g. if parameter Operator 2 is specified then parameter Actor 3 must also be specified.

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Correct the cross connection so the required actor I/O signal is specified.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71019, Cross connection with undefined I/O signal

Description

The I/O configuration of cross connection *arg* is invalid.

The parameter Actor *arg* contains a reference to an undefined I/O signal *arg*.

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

- 1) Make sure the I/O signal is defined.
- 2) Make sure the I/O signal name is correctly spelled.

71020, Cross connection without resultant I/O signal

Description

The I/O configuration of cross connection *arg* is invalid.

The parameter Resultant have been omitted.

All cross connections must specify a resultant I/O signal.

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Correct the cross connection so that the required resultant I/O signal are specified.

71021, Duplicate cross connection with same resultant I/O signals

Description

The I/O configuration of cross connection *arg* is invalid.

The cross connection has the same resultant I/O signal *arg* as cross connection *arg*.

Having more than one cross connection that result in the setting of the same signal may cause unpredictable behaviors, as you cannot control their order of evaluation.

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Make sure that the I/O signal is not specified as the resultant of several cross connections.

71037, Closed chain in cross connection

Description

The I/O configuration is invalid.

The I/O signal *arg* is part of a cross connection chain that is closed (i.e. forms a circular dependence that cannot be evaluated).

The complete cross connection configuration has been rejected.

Recommended actions

Correct the configuration for the cross connections where the I/O signal above is part.

71038, Cross connection max depth exceeded

Description

The I/O configuration is invalid.

The I/O signal *arg* is part of a cross connection chain that is too deep.

The maximum depth of a cross connection chain is *arg*.

The complete cross connection configuration has been rejected.

Recommended actions

Make the cross connection less deep.

71045, Invalid filter specification

Description

The I/O configuration for I/O signal *arg* is invalid.

No filter times can be specified for this type of I/O signal.

This I/O signal has been rejected.

Recommended actions

Set filter time to 0 or remove the statement.

71049, Analog I/O signal inverted

Description

The I/O configuration for I/O signal *arg* is invalid.

Analog I/O signals must not be inverted.

Only digital and group I/O signals can be inverted.

This I/O signal has been rejected.

Recommended actions

Remove the invert for the I/O signal (or change the signal type).

71050, Cross connection with non-digital actor I/O signal

Description

The I/O configuration of cross connection *arg* is invalid.

The parameter Actor *arg* refer to an I/O signal *arg* that is not digital.

Continues on next page

Only digital I/O signals can be cross connected.

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Remove the non-digital I/O signal from the cross connection.

71052, Max number of cross connections exceeded

Description

The I/O configuration is invalid.

The maximum number of cross connections, *arg*, in the I/O system has been exceeded.

Consequences

Not all the cross connections have been accepted.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of cross connections) so that the maximum limit is not exceeded.

71054, Invalid signal type

Description

The I/O configuration for I/O signal *arg* is invalid.

The specified signal type *arg* is invalid/unknown.

Valid signal types are:

- DI (Digital input).
- DO (Digital output).
- AI (Analog input).
- AO (Analog output).
- GI (Group input).
- GO (Group output).

This I/O signal has been rejected.

Recommended actions

Correct the signal type of the I/O signal.

71058, Lost communication with I/O device

Description

The previously working communication with I/O device *arg* with address *arg* on network *arg* has been lost.

Consequences

It is not possible to access the I/O device itself or I/O signals on the I/O device since it is currently not communicating with the controller.

Probable causes

The I/O device may have been disconnected from the system.

Recommended actions

- 1) Make sure that the network cable is connected to the controller.
- 2) Make sure the I/O device has is correctly powered.
- 3) Make sure the cabling to the I/O device is correctly connected.

71076, Communication error from rtp1

Description

No response from the serial line.

Recommended actions

Check the device or connection.

71077, Communication error from rtp1

Description

Not possible to deliver the received message.

Recommended actions

Check the communication flow.

71078, Communication error from rtp1

Description

The response from the device has an invalid frame sequence.

Recommended actions

Check for noise on the serial line.

71080, Max number of device predefined types exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of device predefined types in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of device predefined types) so that the maximum limit is not exceeded.

71081, Max number of physical I/O signals exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of physical I/O signals (bit-mappings) in the I/O system has been exceeded.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

Recommended actions

Modify the configuration of the I/O system (by reducing the number of physical I/O signals) so that the maximum limit is not exceeded.

71082, Max number of user I/O signals exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of user I/O signals in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of I/O signals) so that the maximum limit is not exceeded.

71083, Max number of symbols exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of symbols in the I/O system has been exceeded.

The number of symbols is the sum of all named configuration instances:

- Industrial Networks
- I/O Devices
- Device Trust Levels
- I/O Signals
- Commands
- Access Levels
- Signal Safe Levels
- Cross Connections
- Routes

Recommended actions

Modify the configuration of the I/O system (by reducing the number of symbols) so that the maximum limit is not exceeded.

71084, Max number of subscribed I/O signals exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of subscribed I/O signals in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of subscriptions) so that the maximum limit is not exceeded.

71085, Max number of I/O devices exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of I/O devices in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of I/O devices) so that the maximum limit is not exceeded.

71098, NFS server lost

Description

The contact with the NFS server *arg* is lost.

Recommended actions

- 1) The NFS server.
- 2) The network connection.
- 3) The NFS client.

71099, Trusted NFS server lost

Description

The contact with the trusted NFS server *arg* is lost.

Recommended actions

- 1) The NFS server.
- 2) The network connection.
- 3) The NFS client.

71100, Max number of Industrial Networks exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of Industrial Networks in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of Industrial Networks) so that the maximum limit is not exceeded.

71101, Network undefined

Description

The I/O configuration for I/O device *arg* is invalid.

The network *arg* cannot be found in the system. An I/O device must refer to a defined network.

Installed Industrial Networks are:*argargarg*

Continues on next page

Consequences

This I/O device has been rejected, and no functions depending on it will work.

Recommended actions

- 1) Make sure the network is defined.
- 2) Make sure the network name is correctly spelled.

71114, Invalid IP address

Description

The IP address *arg* is not valid.

Recommended actions

Check the Communication configuration.

71115, Invalid subnet mask

Description

The subnet mask *arg* is not valid.

Recommended actions

Check the Communication configuration.

71116, Not allowed to deactivate I/O device

Description

The I/O configuration of I/O device *arg* is invalid.

I/O devices with a Device Trust Level containing the parameter Deny Deactivate is not allowed to be deactivated.

Consequences

This I/O device has been rejected, and no functions depending on it will work.

Recommended actions

Correct the configuration of the I/O device by either activating it or changing the Device Trust Level.

71122, Incorrect IP address

Description

The address *arg* in protocol *arg* is not a correct IP address.

Recommended actions

Correct the address.

71123, No transmission protocol

Description

The transmission protocol *arg* given for application protocol *arg* could not be found.

Recommended actions

Change the transmission protocol.

71125, Mount permission denied

Description

Permission was denied to mount the directory *arg* on the server *arg*.

Recommended actions

Change the User or Group ID.

71126, Directory not exported

Description

Mounting directory *arg* as *arg* failed since it is not exported on the server computer *arg*.

Protocol: *arg*.

Recommended actions

Export the directory on the server computer.

71128, Ethernet not installed

Description

The Ethernet Services option has to be installed when using remote mounted disk.

Recommended actions

Restart the controller and install the Ethernet Services option.

71129, Too many remote disks

Description

The maximum number of remote mounted disks have been exceeded.

The maximum number is *arg*.

Recommended actions

Reduce the number of remote mounted disks.

71130, Too many remote servers

Description

The maximum number of servers for remote mounted disks has been exceeded.

The maximum number is *arg*.

Recommended actions

- 1) Reduce the number of servers.

71131, Could not mount directory

Description

Mounting directory *arg* on the computer *arg* failed.

Protocol: *arg*.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

Recommended actions

Check the server setup.

It is not allowed to define cross connections where user-defined I/O signals affect internal I/O signals.

71141, Default value for I/O signal out of range

Description

The I/O configuration for I/O signal *arg* is invalid.

The default value is out of range.

This I/O signal has been rejected.

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Correct the cross connection so that there are no internal I/O signals in the resultant expression.

Recommended actions

Change the default value for the I/O signal.

71165, FTP server went down

Description

The inter-process communication (IPC) queue *arg* was full, when sending to trap routine.

Description

The connection to a non-trusted FTP server has been lost.

IP address: *arg*.

Recommended actions

Check cable and FTP server settings.

71156, IPC queue full

Description

The inter-process communication (IPC) queue *arg* was full, when sending to trap routine.

Description

The connection to a trusted FTP server has been lost.

IP address: *arg*.

Recommended actions

Check cable and FTP server settings.

71158, Address out of range

Description

The I/O configuration is invalid.

The address of I/O device *arg* is invalid (out of range).

This I/O device has been rejected.

Description

No matching transmission protocol was found in the communication configuration.

Recommended actions

Change the transmission protocol.

71167, Wrong transmission protocol

Recommended actions

- 1) Change the address.
- 2) Check the address syntax.

71163, I/O signal on internal I/O device

Description

The I/O configuration is invalid.

The user-defined I/O signal *arg* must not be connected to the internal I/O device *arg*

User defined I/O signals are not allowed to be connected to internal I/O devices.

This I/O signal has been rejected.

Description

The option Ethernet Services with FTP is not installed on this system.

Recommended actions

Restart the controller and install the Ethernet Services with FTP option.

71164, Internal I/O signal in cross connection

Description

The I/O configuration of cross connection *arg* is invalid.

The Actor *arg* *arg* is a user-defined I/O signal whereas the resultant I/O signal *arg* is an internal I/O signal.

71182, I/O signal undefined

Description

The I/O configuration of cross connection *arg* is invalid.

The parameter Resultant contains a reference to an undefined I/O signal *arg*.

Continues on next page

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Correct the cross connection so that the resultant I/O signal refers to an existing I/O signal.

The I/O device uses an input size of *arg* bits, the controller can handle maximum *arg* bits.

The I/O device uses an output size of *arg* bits, the controller can handle maximum *arg* bits.

Recommended actions

Check configuration for the physical I/O device.

71183, Cross connection with invalid operator

Description

The I/O configuration of cross connection *arg* is invalid.

The parameter Operator *arg* contains an invalid/unknown operator *arg*.

Valid values for the logical operator are:

- AND
- OR

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Correct the operator.

71196, Invalid encoding type

Description

The I/O configuration for I/O signal *arg* is invalid.

The encoding type *arg* is not valid for signal type *arg*.

Valid encoding types are:

- UNSIGNED
- TWO_COMP

This I/O signal has been rejected.

Recommended actions

Correct the encoding type for the I/O signal.

71185, Duplicate name

Description

The I/O configuration is invalid.

The identifier *arg* has already been used as the name of another configuration instance.

The following configuration instances must have unique names:

- Industrial Networks
- I/O Devices
- Device Trust Levels
- I/O Signals
- Commands
- Access Levels
- Signal Safe Levels
- Cross Connections
- Routes

Recommended actions

- 1) Rename one of the configuration instances in I/O configuration.
- 2) Restart the controller.

71201, Unknown network

Description

The I/O configuration is invalid.

The network *arg* cannot be found in the system.

Installed Industrial Networks are:*argargargarg*

Consequences

This network has been rejected, and no functions depending on it will work.

Recommended actions

- 1) Make sure the system has been configured with the desired network.
- 2) Make sure the network option at hand is installed.
- 3) Check the I/O configuration for network.

71205, Could not mount directory

Description

Mounting directory *arg* on the computer *arg* failed.

Protocol: *arg*.

Recommended actions

- 1) Check the FTP server setup.
- 2) Check the FTP client configuration.
- 3) Check communication hardware, cabling.

71193, Invalid physical I/O mapping

Description

I/O mapping error on I/O device *arg*.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71220, No PROFIBUS option has been installed

Description

A PROFIBUS board has been fitted, but no PROFIBUS option has been installed.

Consequences

No communication on the PROFIBUS network is possible. There may be consequential errors from configuring the PROFIBUS network when no such option has been installed.

Probable causes

An attempt may have been made to add the PROFIBUS functionality, without installing the option correctly.

Recommended actions

1) If the PROFIBUS option is required: configure a new system with this option, and install the system.

2) If the PROFIBUS option is not required: configure a new system without this option, and install the system.

71221, PROFIBUS firmware file not found

Description

The PROFIBUS firmware file was not found or not readable.

The board firmware may be out of date.

Recommended actions

Reinstall the system.

71222, PROFIBUS configuration file not found

Description

The binary PROFIBUS configuration file was not found.

- File: *arg*
- Path: *arg*.

Recommended actions

- 1) Make sure the file exists.
- 2) Change the path in the I/O configuration.

71223, PROFIBUS configuration file parse error

Description

The binary PROFIBUS configuration file is corrupt.

- Internal error: *arg*
- File: *arg*
- Path: *arg*.

Recommended actions

Recreate and download the binary configuration file using the external PROFIBUS configuration tool.

71224, PROFIBUS board has been re-flashed

Description

The firmware of the PROFIBUS board has been updated.

71228, PROFIBUS binary configuration fault

Description

The configuration data in the binary file is not accepted by the device at address *arg*.

Recommended actions

- 1) Make sure the intended configuration bin file is loaded on the robot controller.
- 2) Make sure the correct I/O device is connected to the network.
- 3) Make sure the input and output size in the configuration is correct.
- 4) Restart the controller.

71229, PROFIBUS binary parameter fault

Description

The parameter data in the binary file is not accepted by the device at address *arg*.

Recommended actions

Make the parameter data in the binary file match the parameters for the device and restart the controller.

71230, Device configuration error

Description

The device *arg* is configured in the I/O configuration but is missing or incorrect in the PROFIBUS binary file.

Recommended actions

- 1) Make sure the device is present in the PROFIBUS binary file.
- 2) Check that the PROFIBUS address in the I/O configuration matches the address in the binary file.
- 3) Make sure remaining fields in the binary file match the I/O configuration.

71231, Wrong PROFIBUS device is connected

Description

PROFIBUS device *arg* at address *arg* has the wrong identity number. Reported identity number is *arg*. Expected identity number is *arg*.

Consequences

The robot controller will not be able to activate the device.

Probable causes

- The I/O device at address *arg* may be the wrong type of device.

Continues on next page

-The configuration may be incorrect, i.e. an incorrect binary configuration file and in some cases incorrect I/O configuration.

Recommended actions

- 1) Make sure the I/O configuration is correct.
- 2) Make sure the PROFIBUS binary file is correct.
- 3) Replace the I/O device.

71241, Too many I/O devices on network

Description

The I/O configuration for I/O device *arg* is invalid.

The number of I/O devices on network *arg* must not exceed *arg*.

This I/O device has been rejected.

Recommended actions

Reduce the number of defined I/O devices and restart the controller.

71261, Transport layer failure

Description

The physical channel for transport layer *arg* is invalid.

Recommended actions

Verify that the physical channel is valid, see manual.

71262, Industrial network communication failure

Description

Communication with '*arg*' master failed on I/O device with mac id *arg*.

Recommended actions

- 1) Check the connection to the gateway.

71263, CAN communication failure

Description

CAN communication failed due to *arg*.

Code: *arg*

71273, I/O device configuration mismatch

Description

I/O device *arg* with address *arg* is configured in the I/O configuration, but it cannot be found in the network specific configuration.

Probable causes

- 1) The address of the I/O device in the I/O configuration is not the same as in the network specific configuration.

2) The I/O device has not been configured at all in the network specific configuration.

Recommended actions

- 1) Check I/O device configuration in the I/O configuration
- 2) Check network specific configuration.

71276, Communication established with I/O device

Description

Communication established with I/O device *arg* with address *arg* on network *arg*.

71278, Mount permission denied

Description

Permission was denied to mount the directory *arg* on the server *arg*.

Recommended actions

Check the username and password.

71288, Mount path is too large

Description

Mount path is too large. Mount path consists of FTP server mount point and server path.

- Max length: *arg*
- Protocol used: *arg*

Recommended actions

Change FTP server mount point or server path.

71289, Memory partition is too big

Description

The memory partition for communication purposes cannot be allocated. The requested partition *arg* kB. System partition will be used.

Recommended actions

Decrease commPartSize.

71290, Could not add FTP device

Description

Adding the FTP device *arg* to the operating system failed.

Application protocol *arg*.

Recommended actions

Change the local path of the configuration of the FTP device.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71291, Invalid local path

Description

Local path of the FTP device *arg* is invalid.

Recommended actions

Local path must end with :

71293, Invalid input size

Description

On DeviceNet I/O device *arg* the connection input size does not match the I/O device.

Recommended actions

- 1) Change size in I/O configuration.
- 2) Check module.
- 3) Use DN_Generic device template.

71294, Invalid output size

Description

On DeviceNet I/O device *arg* the connection output size does not match the I/O device.

Recommended actions

- 1) Change size in I/O configuration.
- 2) Check module.
- 3) Use DN_Generic device template.

71295, Invalid input size

Description

On DeviceNet I/O device *arg* the connection 2 input size does not match the I/O device.

Recommended actions

- 1) Change size in I/O configuration.
- 2) Check module.

71296, Invalid output size

Description

On DeviceNet I/O device *arg* the connection 2 output size does not match the I/O device.

Recommended actions

- 1) Change size in I/O configuration.
- 2) Check module.

71297, Invalid connection type

Description

The DeviceNet I/O device *arg* does not support *arg* connection.

Recommended actions

- 1) Change connection type in I/O configuration.
- 2) Use DN_Generic device template.

71298, Duplicated address

Description

The address *arg* for the DeviceNet master on network DeviceNet is occupied by the I/O device *arg* on the network.

Recommended actions

- 1) Change master address in I/O configuration.
- 2) Disconnect I/O device occupying the address from the network.
- 3) Restart the controller.

71299, No power on DeviceNet network

Description

The 24 V power supply from the DeviceNet power supply is missing.

Consequences

No communication on the DeviceNet network is possible.

Probable causes

The power supply unit, cabling, input voltage to the power supply or the output load may cause the power loss. See the Trouble Shooting Manual and Circuit Diagram!

Recommended actions

- 1) Check all cabling to the power supply unit.
- 2) Measure the output and input voltage levels.
- 3) Replace the faulty I/O device if required.

71300, DeviceNet network communication warning

Description

A minor number of communication errors occurred on the DeviceNet network.

Consequences

Normal operation will be maintained, even on the DeviceNet.

Probable causes

The fault may be caused by interference, power supply units and cables, or communication cables.

Recommended actions

- 1) Make sure any terminating resistors are correctly connected.
- 2) Make sure all communication cables and connectors are working correctly and of the recommended type.
- 3) Check network topology and cable length.

Continues on next page

4) Make sure the DeviceNet Power Supply unit is working correctly. Replace any faulty unit.

- Actual: *arg*

71301, Bus off, DeviceNet network communication failure

Description

A major number of communication errors occurred on DeviceNet network.

Consequences

All communication on the DeviceNet Bus has stopped.

Probable causes

The fault may be caused by interference, power supply units and cables, or communication cables.

Recommended actions

- 1) Make sure the DeviceNet power supply unit is working correctly. Replace any faulty I/O device.
- 2) Make sure any terminating resistors are correctly connected.
- 3) Make sure all communication cables and connectors are working correctly and of the recommended type.
- 4) Check network topology and cable length.
- 5) Restart the controller.

- Configuration: *arg*

- Actual: *arg*

Consequences

It is not possible to access the I/O device or I/O signals on it.

Recommended actions

- 1) Change vendor id in I/O configuration.
- 2) Check that the type of I/O device is correct.

71304, Invalid DeviceNet device type

Description

The device type read from DeviceNet I/O device *arg* doesn't match value in device I/O configuration.

- Configuration: *arg*
- Actual: *arg*

Consequences

It is not possible to access the I/O device or I/O signals on it.

Recommended actions

- 1) Change device type in I/O configuration.
- 2) Check that the type of I/O device is correct.
- 3) Check for a duplicate DeviceNet address in the connected I/O units.

71305, Invalid DeviceNet product code

Description

The product code read from DeviceNet I/O device *arg* doesn't match value in I/O device configuration.

- Configuration: *arg*
- Actual: *arg*

Consequences

It is not possible to access the I/O device or I/O signals on it.

Recommended actions

- 1) Change product code in I/O configuration.
- 2) Check that the type of I/O device is correct.
- 3) Check for a duplicate DeviceNet address in the connected I/O units.

71306, DeviceNet unknown error

Description

An unknown error is reported from I/O device *arg* error code *arg*.

Recommended actions

- 1) Restart the controller.
- 2) Report the problem to ABB.

71302, No DeviceNet option has been installed

Description

A DeviceNet master/slave board has been fitted, but no DeviceNet option has been installed.

Consequences

No communication on the DeviceNet is possible. There may be consequential errors from configuring DeviceNet when no such option has been installed.

Probable causes

An attempt may have been made to add the DeviceNet functionality, without installing the option correctly.

Recommended actions

- 1) If the DeviceNet option is required: configure a new system with this option, and install the system.
- 2) If the DeviceNet option is not required: configure a new system without this option, and install the system.

71303, Invalid DeviceNet vendor id

Description

The vendor id read from DeviceNet I/O device *arg* doesn't match value in I/O device configuration.

- Configuration: *arg*

- Actual: *arg*

Consequences

It is not possible to access the I/O device or I/O signals on it.

Recommended actions

- 1) Change vendor id in I/O configuration.
- 2) Check that the type of I/O device is correct.

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71307, DeviceNet generic connection 1

Description

On DeviceNet I/O device *arg* connection 1 configuration is generic.

Real values:

- Connection 1 type: *arg*
- Connection 1 input size: *arg*
- Connection 1 output size: *arg*

Recommended actions

- 1) Update your current I/O device configuration.

71308, DeviceNet generic connection 2

Description

On DeviceNet I/O device *arg* connection 2 configuration is generic.

Real values:

- Connection 2 type: *arg*
- Connection 2 input size: *arg*
- Connection 2 output size: *arg*

Recommended actions

- 1) Update your current I/O device configuration.

71309, DeviceNet generic device identification

Description

On DeviceNet I/O device *arg* identity configuration is generic.

Real values:

- Vendor Id: *arg*
- Product code: *arg*
- Device type: *arg*

Recommended actions

- 1) Update your current I/O device configuration.

71310, DeviceNet I/O device connection error

Description

DeviceNet I/O device *arg* is occupied by another master.

Recommended actions

- 1) Check I/O configuration.
- 2) Cycle power on I/O device.

71311, Unable to establish communication on the DeviceNet network

Description

Unable to establish communication on the DeviceNet network because no I/O devices are physically connected.

Continues on next page

Recommended actions

- 1) Check cables and connectors.
- 2) Connect I/O devices to network.
- 3) Restart the controller.
- 4) Remove I/O devices on the DeviceNet network from the I/O configuration.

71312, DeviceNet I/O device explicit connection not enabled

Description

DeviceNet I/O device *arg* does not have the explicit message connection enabled.

Recommended actions

Change I/O configuration.

71313, Device command order number not unique

Description

The I/O configuration is invalid.

The device command <*arg*> connected to the I/O device <*arg*> has the same order number <*arg*> as the device command <*arg*>.

The order number of device commands connected to the same I/O device must be unique.

This device command has been rejected.

Recommended actions

Modify the I/O configuration so that device commands on the same I/O device have unique order numbers.

71315, Max number of device commands exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of device commands in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of device commands) so that the maximum limit is not exceeded.

71317, I/O device reset

Description

The I/O device *arg* on the network *arg* has been reset through the device command *arg*, to make sure that the device command values are activated.

This causes the I/O device to loose contact while it is restarted but it will regain contact.

Probable causes

A device command for reset has been defined for the I/O device in the configuration of the I/O system.

71320, Max number of I/O access levels exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of I/O access levels in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of I/O access levels) so that the maximum limit is not exceeded.

71321, Invalid I/O access level

Description

The I/O configuration is invalid.

The I/O signal *arg* has a reference to an invalid/undefined I/O access level *arg*.

All I/O signals must either omit the access level or refer to an existing access level.

This I/O signal has been rejected.

Recommended actions

Change I/O access level to one that exist or define a new I/O access level.

71323, Invalid bit values

Description

The I/O configuration for I/O signal *arg* is invalid.

The minimum bit value *arg* must not be less than *arg*.

The maximum bit value *arg* must not exceed *arg*.

The minimum bit value must be less than the maximum bit value.

This I/O signal has been rejected.

Recommended actions

- 1) Check that the I/O signal is configured with the correct encoding type.
- 2) Check that the min and max bit values are correct.

71324, Physical limitation values out of range

Description

The I/O configuration for I/O signal *arg* is invalid.

The physical limitation minimum value must be less than the physical limitation maximum value.

This I/O signal has been rejected.

Recommended actions

Correct the physical limitation values for the I/O signal so that the minimum value becomes less than the maximum value.

71325, Invalid network configuration

Description

The I/O configuration for network *arg* is invalid.

User-defined (externally loaded) Industrial Networks must not be specified with the name Local.

This network has been rejected.

Recommended actions

Change the name of the network.

71326, Invalid device predefined type configuration

Description

The I/O configuration for device predefined type *arg* is invalid.

User-defined (externally loaded) device predefined types must not be specified for the Local network.

This device predefined type has been rejected.

Recommended actions

Change the device predefined type.

71328, Invalid name

Description

The I/O configuration is invalid.

The configuration instance *arg* does not comply with the rules of RAPID identifiers.

This configuration instance has been rejected.

Recommended actions

Correct the name of the configuration instance so that it complies with the following rules:

Rules of RAPID identifiers:

- 1, The length must not exceed 16 characters.
- 2, The first character must be a letter (a-z or A-Z).
- 3, Subsequent characters must be letters (a-z or A-Z), digits (0-9) or underscores (_).

71329, Invalid network connection

Description

The I/O configuration for network *arg* is invalid.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

Invalid connection *arg* is selected for the network.

Valid connections are: *arg*.

Consequences

This network has been rejected, and no functions depending on it will work.

Recommended actions

Select a valid connection for the network.

71331, Invalid network

Description

The I/O configuration for network *arg* is invalid.

The name of the network is not valid.

Installed valid networks are: *arg*.

Consequences

This network has been rejected, and no functions depending on it will work.

Recommended actions

Correct the name for the network.

71332, Invalid recovery time

Description

The I/O configuration for the I/O device *arg* is invalid.

The value of the recovery time parameter *arg* is incorrect.

The recovery time (how often to try regaining contact with lost I/O devices) must not be less than *arg* milliseconds.

This I/O device has been rejected.

Recommended actions

Correct the recovery time for the I/O device.

71333, Invalid DeviceNet baud rate

Description

The I/O configuration for DeviceNet network is invalid.

The value of the DeviceNet baud rate parameter is incorrect.

Valid DeviceNet baud rates are:

- 125

- 250

- 500

This network has been rejected.

Recommended actions

Correct the baud rate for the DeviceNet network.

71336, Device command without path

Description

The I/O configuration is invalid.

Continues on next page

No path is defined for the device command <*arg*>.

This device command has been rejected.

Recommended actions

Define a path for the device command.

71338, Invalid device command service identifier

Description

The I/O configuration is invalid.

The service identifier <*arg*> is not valid for the device command <*arg*>.

Valid service identifiers are:

<*arg*>

This device command has been rejected.

Recommended actions

Correct the service identifier for the device command.

71339, Device command without reference to I/O device

Description

The I/O configuration is invalid.

The device command *arg* has no reference to an I/O device.

The device command must have a reference to an existing I/O device.

Consequences

This device command has been rejected, and no functions depending on it will work.

Recommended actions

Define an I/O device reference for the device command.

71340, Device command with reference to non-existing I/O device

Description

The I/O configuration is invalid.

The device command *arg* has a reference to an invalid/unknown I/O device *arg*.

The device command must have a reference to an existing I/O device.

Consequences

This device command has been rejected, and no functions depending on it will work.

Recommended actions

Correct the I/O device for the device command.

71344, Device map undefined

Description

The I/O configuration for I/O signal *arg* is invalid.

Device map is undefined or empty.

A Device map must be specified for all physical I/O signals (i.e. signals connected to an I/O device).

This I/O signal has been rejected.

Recommended actions

Define a device map for the I/O signal.

- "1,4-3,7"

71349, Invalid signal size

Description

The I/O configuration for I/O signal *arg* is invalid.

There is a mismatch between the signal type and the size of the signal.

The signal size *arg* is given by the device map: *arg*.

This I/O signal has been rejected.

Recommended actions

Correct either the signal type or the device map so that the following rules are fulfilled:

- The size of digital I/O signals must be exactly one bit.
- The size of analog and group I/O signals must be between 1 and 32 bits.

71346, Device map out of range

Description

The I/O configuration for I/O signal *arg* is invalid.

The device map *arg* is invalid since bit *arg* is out of range.

All bits in the device map must be in the range [0, *arg*].

This I/O signal has been rejected.

Recommended actions

Correct the device map.

71350, Invalid network

Description

The I/O configuration is invalid.

The device predefined type *arg* has an invalid/unknown type of network *arg*.

Installed valid Industrial Networks are:*argargarg*.

Consequences

This device predefined type has been rejected, and no functions depending on it will work.

Recommended actions

Correct the network for the device predefined type.

71347, Device map with overlapping segments

Description

The I/O configuration for I/O signal *arg* is invalid.

The device map *arg* contains segments (e.g. bit *arg*) that overlap each other.

This I/O signal has been rejected.

Recommended actions

Correct the device map.

71348, Device map with unexpected character

Description

The I/O configuration for I/O signal *arg* is invalid.

Found unexpected end or character at position *arg* in the device map: *arg*.

This I/O signal has been rejected.

Recommended actions

Correct the device map so that is comply with the following syntax:

- {bit} = ([0-9]+)
- {range} = ([0-9]+[-][0-9]+)
- {segment} = ({bit} | {range})
- {device map} = ({segment}[.])*{segment}

Examples of valid device maps:

- "1"
- "0-7, 15-8"

Description

The I/O configuration is invalid.

The unit type *arg* has an invalid/unknown type for connection 1 *arg*.

The type for connection 1 must be one of the following:

- POLLED
- STROBE
- COS
- CYCLIC
- COS_ACKSUP
- CYCLIC_ACKSUP

This unit type has been rejected.

Recommended actions

Correct the connection 1 type of the unit type.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71352, Invalid connection 2 type

Description

The I/O configuration is invalid.

The unit type *arg* has an invalid/unknown type for connection 2 *arg*.

The type for connection 2 must either be omitted or one of the following:

- POLLED
- STROBE
- COS
- CYCLIC
- COS_ACKSUP
- CYCLIC_ACKSUP

This unit type has been rejected.

Recommended actions

Correct the connection 2 type of the unit type.

Recommended actions

- 1) Check that the I/O device is connected to the correct network and that the bus type of that network is correct.
- 2) Check that the I/O device refers to the correct unit type and that the bus type of that unit type is correct.

71357, Duplicated I/O devices on network Local

Description

The I/O configuration for I/O device *arg* is invalid.

There is already another user-defined I/O device connected to the network Local.

Only one user-defined I/O device may be connected to the network Local.

This I/O device has been rejected.

Recommended actions

Correct the I/O configuration.

71354, I/O device without reference to network

Description

The I/O configuration is invalid.

No reference to a network is defined for the I/O device *arg*.

This I/O device has been rejected.

Recommended actions

Define a network reference for the I/O device.

71361, Cross connection with non-digital resultant I/O signal

Description

The I/O configuration of cross connection *arg* is invalid.

The parameter Resultant refer to an I/O signal *arg*, that is not digital.

Only digital I/O signals can be cross connected.

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Remove the non-digital I/O signal from the cross connection.

71355, Invalid Device Trust Level

Description

The I/O configuration is invalid.

I/O device *arg* has an invalid/unknown Device Trust Level: *arg*.

Installed valid Device Trust Levels are:*arg*

Consequences

This I/O device has been rejected, and no functions depending on it will work.

Recommended actions

Correct the Device Trust Level for the I/O device.

71362, I/O signal mapped outside the I/O device data area

Description

Cannot change physical state of I/O signal *arg* to VALID.

The reason is that the I/O signal is mapped to bit(s) that lies outside the data area of the I/O device it is assigned to.

I/O signal assigned to I/O device *arg*.

I/O signal mapped to bit(s): *arg*.

Output data area size for the I/O device is *arg* bits.

Input data area size for the I/O device is *arg* bits.

Consequences

The physical state of this I/O signal remains NOT VALID.

Recommended actions

- 1) Check that the device mapping of the I/O signal is correct.
- 2) Check that the I/O signal is assigned to the correct I/O device.

71356, Bus type mismatch

Description

The I/O configuration is invalid.

Device *arg* refers to a network and a unit type with different bus types.

This I/O device has been rejected.

Continues on next page

3) Check the I/O configuration Connection Input/Output size on the I/O device.

71363, Internal slave configuration invalid

Description

The I/O device *arg* configured on the master address is not valid as an internal slave.

Recommended actions

- 1) Change the address on the I/O device.
- 2) Use DN_Slave device template.

71364, User I/O queue overload

Description

The user I/O queue handling I/O signal changes has been overloaded.

Consequences

The system will go to status SYS STOP.

Probable causes

This is caused by too frequent signal changes or too large bursts of signal changes, generated by input I/O signals or cross connections between I/O signals.

Recommended actions

- Check the cross connections. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Check the frequency of input I/O signals from any external equipment connected to the system. Make sure it is not abnormal, and change if required.
 - 3) If an extremely heavy I/O load is normal and required, investigate whether programming delays in the RAPID application may solve the problem.

71365, Safety I/O queue overload

Description

The safety I/O queue handling safety I/O signals has been overloaded.

Consequences

The system will go to status SYS HALT.

Probable causes

This is caused by too frequent signal changes of safety I/O signals. Sometimes this may be due to erratic ground connection in I/O signals from external equipment.

Recommended actions

- 1) Repeated safety input I/O signals will cause the system to halt. See the error log for other faults that may cause the condition.
- 2) Check the grounding of each signal from any external equipment affecting the safety I/O signals.
- 3) Check the frequency of input I/O signals from any external equipment connected to the system. Make sure it is not abnormal, and change is required.

71366, Cross connection I/O queue overload

Description

The cross connection I/O queue handling I/O signals has been overloaded.

Consequences

The system will go to status SYS STOP.

Probable causes

This is caused by too frequent signal changes or too large bursts of signal changes, generated by I/O signals being actors in cross connections.

Recommended actions

- Check the cross connections. How to check the configuration file is detailed in the Trouble Shooting Manual.
- 2) Check the frequency of I/O signals being actors in cross connections.
 - 3) If an extremely heavy I/O load is normal and required, investigate whether programming delays in the RAPID application may solve the problem.

71367, No communication with I/O device

Description

During start-up, no communication was established with I/O device *arg* with address *arg* on the network *arg*.

Consequences

It is not possible to access the I/O device or I/O signals on it, since it is currently not communicating with the controller.

Probable causes

The I/O device is either not connected to the system, or it is connected, but has been assigned the wrong address.

Recommended actions

- 1) Make sure all I/O device addresses match the configuration.
- 2) Make sure all addresses are unique, and not used by more than one I/O device.
- 3) Change the address and/or connect the missing I/O device.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

4) If you changed the address, the power supply to the I/O device must be cycled (switched OFF and then back ON), to make sure the address has been changed.

71379, Unknown communication physical channel connector

Description

The connector *arg* defined for the physical channel *arg* is unknown.

Consequences

The physical channel will not be available for use.

Probable causes

- The connector defined in the physical channel configuration may be misspelt or refers to a connector not available for use.
- Connector configuration is missing.

Recommended actions

- 1) Make sure the connector defined in the physical channel configuration is referring to an available connector.
- 2) Make sure the option Multiple Serial Ports is installed if required by the used configuration.
- 3) Reinstall the system to make sure the system configuration files are OK.

71380, Communication connector driver is already in use

Description

The connector *arg* cannot use the driver *arg*. The driver is already in use by connector *arg*.

Consequences

The connector and the physical channel using the connector will not be available for use.

Probable causes

- The configuration files may have been faulty.
- A configuration file with improperly configured Physical Channels may have been loaded.

Recommended actions

- 1) Make sure physical connector configuration is valid.
- 2) Reinstall the system to make sure the system configuration files are OK.

71381, Communication connector is already in use

Description

The physical channel *arg* cannot use connector *arg*. The connector is already in use by physical channel *arg*.

Consequences

The connector and the physical channel using the connector will not be available for use.

Probable causes

Several physical channels may have been assigned to the same connector in the configuration.

Recommended actions

Make sure each connector is used by one physical channel only.

71382, DeviceNet watchdog time has expired

Description

The system has not received any reply from the DeviceNet I/O device, and the watchdog timer has timed out.

Consequences

The DeviceNet network is not running, and no communication on the DeviceNet network will be possible. The system goes to system failure state. The full meaning of this status is described in the Trouble Shooting Manual, IRC5.

Probable causes

The I/O load on the DeviceNet network may be too high, for instance if a RAPID program is trying to set I/O signals at a rate that exceeds the bandwidth available on the DeviceNet network.

Recommended actions

Reduce the I/O load on the DeviceNet network.

71383, User defined I/O devices can't be connected to the network Local

Description

The I/O configuration for I/O device *arg* is invalid.
No user-defined I/O device may be connected to the network Local.

This I/O device has been rejected.

Recommended actions

Correct the I/O configuration.

Continues on next page

71385, Request message resource exhausted

Description

Unable to handle more concurrent I/O requests.

Out of concurrent I/O request using delay, pulse, or timeout argument.

Consequences

I/O request cannot be fulfilled.

Probable causes

Too many I/O instructions with pulse or delay argument.

Too many process instructions with pulse, delay or timeout.

Recommended actions

- 1) Reduce the number of concurrent I/O instructions with pulse or delay argument.
- 2) Reduce the number of concurrent process instructions that use pulse, delay or timeout argument.

71390, The DeviceNet network has recovered from bus off

Description

The DeviceNet network has recovered from bus off state.

71391, System Signal configuration

Description

There was an error during the configuration of the System I/O Signal *arg*.

Consequences

The system will go to system failure state.

Probable causes

All errors during configuration of System I/O Signals are considered fatal and the system will go to system failure state.

Recommended actions

- 1) Check the connection of the I/O device to which the System Signal is connected.
- 2) Check the configuration of the I/O device.

71392, Invalid output size

Description

On DeviceNet I/O device *arg* the connection output size *arg* does not match the I/O device. When using strobe connection the only valid output sizes are 1 or -1.

Recommended actions

- 1) Change size in configuration.
- 2) Check module.

- 3) Use DN_Generic device template.

71393, Error when allocating generic size

Description

Failed to allocate generic *arg* size (-1) on DeviceNet I/O device *arg*.

Probable causes

The DeviceNet I/O device *arg* cannot be configured with a generic *arg* size (-1).

Recommended actions

- 1) Update your current unit type configuration with new *arg* size.
- 2) Use DN_Generic device template.

71394, Invalid physical communication channel

Description

The communication channel *arg* is out of range.

Consequences

The communication channel *arg* is unavailable.

Probable causes

Adapter board DSQC 1003 not installed or the communication channel *arg* is out of range.

Recommended actions

- 1) Check the allowed minimum and maximum of connectors.
- 2) Check hardware required.

71395, No transport protocol

Description

The transport protocol *arg* for channel *arg* is missing.

Consequences

The transport instance *arg* is unavailable.

Probable causes

The option holding the transport protocol *arg* is not installed or the protocol name is faulty.

Recommended actions

- 1) Install missing option.
- 2) Change the transport protocol name.

71396, No transmission protocol

Description

The transport protocol *arg* is missing or the name of the transport protocol is faulty for *arg*.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

Consequences

The application protocol instance *arg* is unavailable.

Probable causes

The option holding the transport is not installed or the application name is faulty.

Recommended actions

- 1) Install the option.
- 2) Change the name of the transport in the configuration.

71397, No application protocol

Description

The application protocol *arg* is missing or the name is faulty.

Consequences

The application instance *arg* is unavailable.

Probable causes

The option holding the application protocol is not installed or the protocol name is faulty.

Recommended actions

- 1) Install the option.
- 2) Change the name of the application protocol.

71398, Communication error from bosv24

Description

No response from the serial line.

Recommended actions

Check the device or connection.

71399, Communication error from bosv24

Description

Not possible to deliver the received message.

Recommended actions

Check the communication flow.

71400, Communication error from bosv24

Description

The response from the device has an invalid frame sequence.

Recommended actions

Check for noise on the serial line.

71401, No option exists for the *arg* Anybus module.

Description

An *arg* Anybus module has been found, but no option has been installed.

Consequences

No communication on *arg* Anybus module is possible. There may be consequential errors from configuring when no such option has been installed.

Probable causes

An attempt may have been made to add the *arg* Anybus module functionality, without installing the option correctly.

Recommended actions

If the *arg* Anybus module option is required: configure a new system with this option, and install the system.

71402, Duplicate address on the *arg* network.

Description

The *arg* network address is duplicated on the network.

Conflicting address *arg*.

Consequences

No communication on the *arg* network is possible.

Recommended actions

- 1) Change the address on the conflicting adapter (or physically disconnect the adapter) or change the address for the *arg* network.

- 2) Restart the controller.

71403, The interval time is invalid

Description

For the DeviceNet device *arg* the connection *arg* interval time is invalid.

Probable causes

The interval time has a lower value than the production inhibit time.

Recommended actions

Change the connection *arg* interval time to be higher than the production inhibit time for the DeviceNet device *arg* in the I/O configuration.

Continues on next page

71404, Invalid input/output size

Description

The I/O device *arg* has an invalid value (zero) for the input or output size.

Recommended actions

Change the input/output size to a value greater than zero.

71405, Duplicate device mapping

Description

The I/O signal *arg* has overlapping bit(s) in the device map with the I/O signal *arg*.

Consequences

This I/O signal has been rejected, and no functions depending on it will work.

Recommended actions

Correct the device mapping for the overlapping I/O signals in the I/O configuration.

71406, Communication established on DeviceNet network

Description

The DeviceNet network has established communication.

71407, Route interface not found

Description

The route interface *arg* for network *arg* is not found in the system.

Consequences

The route is not available. Messages to I/O devices connected to the network *arg* will not be forwarded.

Probable causes

The network *arg* not defined.

Recommended actions

Change the network identifier.

71408, Route port number out of range

Description

The given port number *arg* of route *arg* is outside its range.

Consequences

The route is not available. Messages to I/O devices connected to the network *arg* will not be forwarded.

Probable causes

The number *arg* is outside its range.

Recommended actions

Change port number.

71409, Not able to add a port to *arg*

Description

Not able to define port *arg* of route *arg* due to lack of resources.

Consequences

The route is not available. Messages to I/O devices connected to port *arg* are not forwarded.

Probable causes

The network *arg* doesn't support this many ports.

Recommended actions

When possible reduce the number of ports or report the problem to ABB.

71410, CIP route option not installed

Description

The CIP route option is not enabled since it was not selected at system creation.

Consequences

Any CIP route definitions will be omitted.

Probable causes

The CIP route option is not installed in the system.

Recommended actions

Create and install a system with the CIP route option.

71411, Out of route resources

Description

Not able to add anymore routes due to no more route resources in the system.

Consequences

Route *arg* will not be added to the system.

Probable causes

Too many routes have been defined. The system only allows *arg* routes.

Recommended actions

Reduce the number of routes.

71412, The DeviceNet network has regained the bus power

Description

The DeviceNet network has regained the 24 V bus power.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71414, Concurrent changes of signal value

Description

Concurrent changes of I/O signal *arg* value have been detected.

Consequences

A signal value change of I/O signal *arg* is aborted due to another value change of the same I/O signal.

Probable causes

The concurrent value change is due to an undesired signal change sequence in a program. Multiple changes of I/O signal *arg* might appear when a I/O signal is pulsed, e.g.

```
SetDO arg, 0;  
PulseDO /High /PLength = 0.01, arg;
```

```
WaitTime 0.01;
```

```
SetDO arg, 1;
```

The I/O signal *arg* will be 1 at the end, but at rare occasions there will not be any visible pulse. This type of sequence should be avoided.

Recommended actions

Verify that concurrent value changes are desired of I/O signal *arg*, otherwise modify the signal change sequence.

Probable causes

PROFINET I/O device *arg* is defined as a PROFINET internal device while another PROFINET internal device has already been configured.

Recommended actions

Remove I/O device *arg* from the configuration.

71446, PROFINET configuration mismatch

Description

Configuration mismatch between the Anybus adapter and the connecting PROFINET controller in slot *arg*.

Consequences

The Anybus adapter will indicate a diagnostic error and no communication will be established between the Anybus adapter and the connecting PROFINET controller.

Probable causes

Mismatch of the data type/size in slot *arg* for the PROFINET controller configuration. The expected data type/size is *arg* *arg* bytes.

Recommended actions

Correct the data type/size in slot *arg* in the external configuration tool or change the data size in the I/O configuration.

NOTE:

In the PROFINET controller configuration input data shall be in slot 1 and output data in slot 2.

71449, Too many Anybus adapters configured

Description

Too many Anybus adapters configured. It is only allowed to have one Anybus adapter configured.

Consequences

The Anybus adapter *arg* has been rejected, and no functions depending on it will work.

Recommended actions

- 1) Remove an Anybus adapter in the configuration.
- 2) Restart the controller.

71450, EtherNet/IP Scanner/Adapter option not installed

Description

An EtherNet/IP network is configured, but the EtherNet/IP Scanner/Adapter option has not been installed.

71443, Too many PROFINET internal devices

Description

There are too many PROFINET internal devices defined in the controller.

Consequences

PROFINET I/O device *arg* will not be configured. No communication with this I/O device will be possible.

Continues on next page

Consequences

No communication on the EtherNet/IP is possible. There may be consequential errors from configuring EtherNet/IP when no such option has been installed.

Probable causes

An attempt may have been made to add the EtherNet/IP functionality, without installing the option correctly.

Recommended actions

- 1) If the EtherNet/IP option is required: configure a new system with this option, and install the system.
- 2) If the EtherNet/IP option is not required: configure a new system without this option, and install the system.

71452, Too many EtherNet/IP networks are configured

Description

Too many EtherNet/IP Industrial Networks are configured. There is only possibly to have one network for the EtherNet/IP Scanner/Adapter option.

Recommended actions

- 1) Remove one of the EtherNet/IP Industrial Networks from the I/O configuration.
- 2) Restart the controller.

71453, Wrong identity for EtherNet/IP adapter

Description

The identity for the adapter *arg* in the I/O configuration is not correct.

The correct identity is:

Vendor ID *arg*.

Device Type *arg*.

Product Code *arg*.

Consequences

No contact will be established with this adapter.

Recommended actions

Correct the I/O configuration for the adapter with the identity information above.

71454, The *arg* address is missing

Description

No IP address is specified for the *arg* network.

Consequences

No communication on the *arg* network is possible.

Recommended actions

- 1) Specify a valid IP address in the network configuration.
- 2) Restart the controller.

71455, EtherNet/IP connection type unknown

Description

The I/O configuration is invalid.

The unit type *arg* has an invalid/unknown connection type *arg*.

The connection type must be one of the following:

- MULTICAST

- POINT2POINT

Consequences

This unit type has been rejected.

Recommended actions

- 1) Correct the connection type of the unit type.
- 2) Restart the controller.

71457, The EtherNet/IP gateway address is invalid

Description

It is not possible to have the gateway address same as the IP address.

Or the gateway address cannot be same as the default destination 0.0.0.0.

Consequences

The default controller gateway address *arg* will be used and not the specified gateway address *arg*.

Recommended actions

- 1) If no physical gateway is used, do not specify any gateway address in the configuration.
- 2) Restart the controller.

71458, Could not change the default gateway address

Description

If no destination address is specified in the Ethernet/IP configuration, the default controller gateway address will be changed. The destination address was not given and the specified gateway address *arg* was not valid and could not be used.

Consequences

No communication on the EtherNet/IP network is possible.

Recommended actions

- 1) Correct the gateway in the EtherNet/IP network configuration.
- 2) Restart the controller.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71459, Illegal address for EtherNet/IP

Description

The address *arg* for the EtherNet/IP network is illegal.

Consequences

No communication on the EtherNet/IP network is possible.

Recommended actions

- 1) Correct the address in the EtherNet/IP network configuration.
- 2) Restart the controller.

71460, Not able to connect to EtherNet/IP adapter

Description

The configured adapter *arg* with address *arg* does not physically exist on the EtherNet/IP network.

Consequences

It is not possible to access the adapter itself or I/O signals on the adapter since it is currently not communicating with the controller.

Probable causes

The adapter does not exist physically.

The adapter address is wrong.

The adapter is malfunctioning.

Recommended actions

- 1) Check that the adapter physically exists on the EtherNet/IP network and that the address is correct.
- 2) If the address has been changed, restart the controller.

71461, Duplicated address on the EtherNet/IP network

Description

The adapter *arg* and the EtherNet/IP scanner have been configured with the same address in the controller.

Consequences

It is not possible to access the adapter or I/O signals on it, since it is currently not communicating with the controller.

Recommended actions

- 1) Change the address for the adapter *arg* or the address for the EtherNet/IP controller in the I/O configuration. If changing the I/O device address and it have this address physically it must also be changed in the adapter.
- 2) Restart the controller.

71462, Illegal subnet mask for EtherNet/IP

Description

The subnet mask *arg* for the EtherNet/IP network is illegal.

Consequences

No communication on the EtherNet/IP network is possible.

Recommended actions

- 1) Correct the subnet mask in the EtherNet/IP network configuration.
- 2) Restart the controller.

71463, Illegal address for EtherNet/IP network

Description

The EtherNet/IP address *arg* is reserved.

Consequences

No communication on the EtherNet/IP network is possible.

Probable causes

The specified address is on a subnet reserved by another Ethernet port. Two Ethernet ports on the controller cannot be on the same subnet.

Example:

EtherNet/IP port: 192.168.125.x

Service port: 192.168.125.x

Note:

The subnets within the range 192.168.125.xxx - 192.168.130.xxx are predefined and cannot be used.

Recommended actions

- 1) Change the address to another subnet.
- 2) Restart the controller.

71464, Could not add a new gateway for EtherNet/IP

Description

Could not add the gateway address *arg* with the destination address *arg* for EtherNet/IP.

Consequences

No communication on the EtherNet/IP network is possible.

Probable causes

- 1) The gateway address or the destination address are invalid.
- 2) No destination address have been specified.

Recommended actions

- 1) Correct the gateway address or the destination address in the EtherNet/IP network configuration.
- 2) Restart the controller.

Continues on next page

71469, Max number of internal I/O signals exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of internal I/O signals in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of I/O signals specified in the additional option configuration) so that the maximum limit is not exceeded.

71473, DeviceNet network scan result

Description

Address__Vendor_ID__Product_code__Device_name__
arg

71476, DeviceNet firmware file not found

Description

The DeviceNet firmware file *arg* was not found or is not readable.

The board firmware may be out of date.

Recommended actions

Reinstall the system.

71477, Invalid connection size for EtherNet/IP adapter

Description

The adapter *arg* is configured with invalid input and/or output size.

Consequences

No communication with the adapter is possible.

Recommended actions

Correct the input size to *arg* and the output size to *arg* for the adapter in the I/O configuration.

71478, Invalid input or output assembly for EtherNet/IP adapter

Description

The adapter *arg* has invalid input and/or output assembly.

Consequences

No communication with the adapter is possible.

Recommended actions

Correct the input/output assembly for the adapter in the I/O configuration.

71479, Invalid configuration assembly for EtherNet/IP I/O device

Description

The adapter *arg* has invalid configuration assembly.

Consequences

No communication with the adapter is possible.

Recommended actions

Correct the configuration assembly for the adapter in the I/O configuration.

71480, Adapter occupied by another scanner

Description

It is not possible to connect to the adapter *arg* because it already has an active connection.

Consequences

No communication with the adapter *arg* is possible as long as the adapter is occupied by another scanner.

Recommended actions

Release the connection from the other scanner to the adapter *arg* or change the address.

71481, PROFINET configuration file error

Description

The PROFINET configuration file *arg* could not be found or opened.

Consequences

The configuration file is needed to be able to use the I/O devices defined on the *arg* network.

Recommended actions

- 1) Make sure the file exists.
- 2) Make sure that the configuration file is placed in the HOME directory of your current system if filename without path is used.

71482, PROFINET network configuration changed

Description

I/O configuration for the network *arg* has been changed by an external configuration tool or a connecting controller.

The following values have been changed:

IP Address: *arg*.

Subnet mask: *arg*.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

Gateway address: arg.

Consequences

The changed parameter values are not valid until a restart of the controller is performed.

Recommended actions

Restart the controller.

71483, PROFINET identification request received

Description

A PROFINET identification request has been received from an external configuration tool.

The MAC address on the arg network is arg.

71485, Illegal subnet mask

Description

The subnet mask arg for the arg network is illegal. The allowed subnet mask range is 255.255.255.xxx.

Consequences

The subnet mask on the arg network was not changed.

Recommended actions

1) Correct the subnet mask for the arg network.

71486, Illegal address for arg network

Description

The IP address arg for the arg network is illegal.

Consequences

The arg network cannot be used.

Recommended actions

Correct the address for the arg network.

71487, Illegal IP address for arg network

Description

The arg network address arg is reserved.

Consequences

No communication on the arg network is possible.

Probable causes

The specified address is on a subnet reserved by another Ethernet port. Two Ethernet ports on the controller cannot be on the same subnet.

Example:

arg port: 192.168.125.xxx

Service port: 192.168.125.xxx

Note:

The subnets within the range 192.168.125.xxx - 192.168.130.xxx are predefined and cannot be used.

Recommended actions

Change the address to another subnet.

71488, Illegal gateway address for arg network

Description

The specified gateway address arg is not valid and cannot be used.

Consequences

The gateway address is not changed.

Probable causes

The specified gateway address might not be within the range of the arg network subnet mask arg.

Recommended actions

Correct the gateway address in the arg network configuration.

71489, PROFINET internal device configuration warning

Description

A PROFINET controller has established a connection with the PROFINET internal device on the arg network. The connecting PROFINET controller and the internal PROFINET device slot configuration differs.

The internal PROFINET device is currently configured with the following modules:

Slot 1: DI arg bytes.

Slot 2: DO arg bytes.

Consequences

Not all I/O signals will be possible to use.

Recommended actions

- 1) Reconfigure the connecting PROFINET controller to match the internal PROFINET device.
- 2) Reconfigure the internal PROFINET device in the Robot controller to match the connecting PROFINET controller.

71490, PROFINET I/O device configuration warning

Description

The I/O device arg on the arg network is configured in the PROFINET configuration file arg but not in the I/O configuration.

Recommended actions

Add the I/O device arg to the I/O configuration or remove the I/O device from the PROFINET configuration file.

Continues on next page

71491, PROFINET I/O device configuration missing

Description

The I/O device *arg* on the *arg* network is configured in the I/O configuration but not in the PROFINET configuration file *arg*.

Consequences

No communication with I/O device *arg* is possible.

Recommended actions

Add the I/O device *arg* to the PROFINET configuration file or remove the I/O device from the I/O configuration.

71492, PROFINET diagnostic data reported

Description

The I/O device *arg* has reported diagnostic data on slot *arg*.

71493, PROFINET I/O device auto configured

Description

A new I/O device has been found in the PROFINET configuration file. This I/O device has been auto configured in the controller with the following parameters:

Device name: *arg*.

Input bytes: *arg*.

Output bytes: *arg*.

Recommended actions

- 1) Edit or delete the configuration.
- 2) Restart the controller to activate the I/O device configuration.

71494, PROFINET option key missing

Description

The option key needed to run the *arg* network on the controller was not detected.

Consequences

No communication on *arg* network is possible.

Probable causes

An attempt may have been made to add the PROFINET functionality, without installing the option correctly.

Recommended actions

- 1) Configure a new system with the PROFINET option, and install that system.
- 2) If PROFINET is not required, configure a new system without this option, and install that system.

71495, PROFINET controller option key missing

Description

The option key needed to run the *arg* network as a PROFINET controller on the controller was not detected. The I/O device *arg* is not defined as an internal PROFINET device.

Consequences

No communication with the I/O device *arg* is possible.

Probable causes

The installed option key for the *arg* network only supports one internal PROFINET device.

Recommended actions

Configure a new system with the PROFINET controller/device option or remove the I/O device *arg* from the I/O configuration.

71498, PROFINET network configuration changed

Description

I/O configuration for the network *arg* have been changed by an external configuration tool or a connecting controller.

The following values have been changed:

Station name: *arg*.

Consequences

The changed parameter values is not valid until a restart of the controller is performed.

Recommended actions

Restart the controller.

71499, I/O signals in cross connection has overlapping device map

Description

The I/O configuration of cross connection *arg* is invalid.

The resultant I/O signal *arg* has an overlapping device map with the inverted actor I/O signal *arg*.

Using I/O signals with overlapping device map in a cross connection can cause infinity signal setting loops.

Consequences

The cross connection has been rejected, and no functions depending on it will work.

Recommended actions

Correct the device map or define one of the I/O signals as simulated.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71500, EtherNet/IP connection failure

Description

Not able to connect to the adapter *arg*.

arg

Consequences

No communication with the adapter is possible.

71501, PROFINET configuration file error

Description

The PROFINET configuration file *arg* was not valid. Internal error code *arg*.

Consequences

No communication on *arg* network is possible.

Probable causes

The PROFINET configuration file may be corrupt or have been created with an incompatible file format.

Recommended actions

Generate a new PROFINET configuration file.

71502, PROFINET configuration mismatch

Description

The I/O device *arg* reported a different slot configuration compared with the configuration for this I/O device in the PROFINET configuration file *arg*.

First slot mismatch reported on slot *arg*

arg slot mismatches found.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The module type used in slot *arg* may be of wrong type or of a different version compared to the actual hardware on the I/O device.

Recommended actions

- 1) Update the PROFINET configuration file *arg*
- 2) Check the I/O device hardware.

71503, PROFINET station name error

Description

The network system parameter Station Name on the *arg* network contains one or more illegal characters. The character at position *arg* is not allowed.

Consequences

The *arg* network is not possible to use.

Continues on next page

Recommended actions

Change the Station Name system parameter to an allowed string.

71504, File size exceeds max file size

Description

Unable to copy file data to the controller. The file *arg* is too large.

File size: *arg*.

Max file size: *arg*.

Probable causes

The file size is larger than the allowed file size.

Recommended actions

Check the FTP client configuration and increase the system parameter MaxFileSize to be able to transfer the file to the controller.

71505, Device command syntax error

Description

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

Device command name *arg*.

The syntax error: Missing comma.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71506, Device command syntax error

Description

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

Device command name *arg*.

The syntax error: Bad path size specified.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71507, Device command syntax error

Description

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

Device command name *arg*.

The syntax error: Incorrect path size.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71508, Device command syntax error

Description

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

Device command name *arg*.

The syntax error: Bad data type.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71509, Device command syntax error

Description

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

Device command name *arg*.

The syntax error: Missing space.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71510, Device command syntax error

Description

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

Device command name *arg*.

The syntax error: Incorrect byte size.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71511, Device command syntax error

Description

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

Device command name *arg*.

The syntax error: Incorrect data size.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71512, Invalid service identifier in device command

Description

Could not send device command to I/O device *arg* because of invalid service identifier *arg*.

Valid service identifiers are:

arg.

Recommended actions

Correct the service identifier.

71513, Device command response timeout

Description

A timeout occurred when sending device command *arg* to the I/O device *arg*.

Consequences

The device command was not sent.

Recommended actions

- 1) Check the device command syntax.
- 2) Make sure that the network cable is connected to the controller.
- 3) Make sure the I/O device has is correctly powered.
- 4) Make sure the cabling to the I/O device is correctly connected.

71514, Device command connection error

Description

Could not send device command *arg* to the I/O device *arg* because no active connection was present.

Consequences

The device command was not sent.

Recommended actions

- 1) Check the device command syntax.
- 2) Make sure that the network cable is connected to the controller.
- 3) Make sure the I/O device has is correctly powered.
- 4) Make sure the cabling to the I/O device is correctly connected.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71515, Device command send error

Description

Could not send device command *arg* to the I/O device *arg*.

Consequences

The device command was not sent.

Recommended actions

- 1) Check the device command syntax.
- 2) Make sure that the network cable is connected to the controller.
- 3) Make sure the I/O device has is correctly powered.
- 4) Make sure the cabling to the I/O device is correctly connected.

71516, An EtherNet/IP adapter does not support Quick Connect

Description

The adapter *arg* does not support Quick Connect.

Recommended actions

- 1) Set the parameter Quick Connect to "Not used" for the adapter in the I/O configuration.
- 2) Restart the controller.

71517, An attribute is changed for an EtherNet/IP adapter

Description

The attribute *arg* is changed to "*arg*" for the adapter *arg*.

71519, Too many PROFINET Networks are configured

Description

Too many PROFINET Controller/Device Industrial Networks are configured. It is only possible to have one network for PROFINET Controller/Device.

Recommended actions

- 1) Remove all but one of the PROFINET Controller/Device Industrial Networks from the configuration.
- 2) Restart the controller.

71520, Input data invalid

Description

The I/O device *arg* indicates input data invalid from slot *arg*.

Consequences

The input data is discarded.

Continues on next page

Probable causes

Internal error in the I/O device.

71521, Output data not processed

Description

The I/O device *arg* indicates output data to slot *arg* cannot be processed.

Consequences

The output data is discarded by the I/O device.

Probable causes

Internal error in the I/O device.

71522, Ethernet port occupied by another client

Description

The specified Ethernet port for EtherNet/IP network is occupied by another client.

Consequences

No communication on the EtherNet/IP network is possible.

Probable causes

A MultiMove system is installed and occupies the specified Ethernet port.

Recommended actions

Select another Ethernet port by changing the connector ID for the EtherNet/IP network.

71524, PROFINET I/O device unknown alarm

Description

The I/O device *arg* has reported an unknown alarm in slot *arg*. Use I/O device specific documentation for explanation on the alarm code.

Alarm code: *arg*.

71525, PROFINET I/O device diagnostics

Description

The I/O device *arg* has reported diagnostic data in slot *arg*. Use I/O device specific documentation for more explanation on the diagnostic data.

arg.

71526, PROFINET I/O device unknown alarm

Description

The I/O device *arg* has reported an unknown alarm in slot *arg*. Use I/O device specific documentation for explanation on the alarm code.

Alarm code: *arg*.

71527, EtherNet/IP adapter state conflict

Description

The current state of the adapter *arg* prevents communication from being established or the execution of a specific service. This is an adapter specific behavior documented by the vendor.

Consequences

No communication with the adapter *arg* is possible as long as the adapter is in this state.

Recommended actions

- 1) Verify the current state of the adapter *arg*.
- 2) If the state is error, check the I/O configuration or hardware setup of the adapter and consult the vendor documentation. If the state is running, the I/O device was earlier temporarily busy during communication attempt but has now recovered, no further actions are necessary.

Probable causes

The subnet mask is missing.

Recommended actions

Add a subnet mask.

71531, Faulty destination address

Description

The given destination address *arg*, on *arg* network, is not allowed. Doesn't follow the IP name standard or it's on the same network as the scanner and the adapter.

Consequences

No destination is available.

Probable causes

- 1) The address given is not following IP address standard.
- 2) The address is equal to network address or gateway address.
- 3) The address is on the same network as network and gateway.
- 4) The address is equal to broadcast or network address.

Recommended actions

Provide a valid destination address.

71528, EtherNet/IP general failure

Description

Not able to connect to the adapter *arg*.
arg.

Consequences

No communication with the adapter is possible.

71532, The gateway address is missing

Description

The destination address *arg* on *arg* is defined, but no gateway address is defined.

Consequences

The destination address will not be used since the gateway address is missing.

Recommended actions

Specify a gateway address to be used in conjunction with the destination address.

Or

Remove destination address definition.

71529, The destination address is missing

Description

The gateway address *arg* on network *arg* is defined, but no destination is defined.

Consequences

The gateway will not be used since the destination is missing.

Recommended actions

Specify a destination address to be used in conjunction with gateway address.

Or

Remove gateway address definition.

71533, Invalid configuration size for EtherNet/IP adapter

Description

The adapter *arg* has an invalid configuration size. Maximum configuration size supported is *arg* bytes.

Consequences

No communication with the adapter is possible.

Recommended actions

Correct the configuration size for the adapter in the I/O configuration.

71530, The subnet mask is missing

Description

The subnet mask, on *arg* network, is missing. The *arg* network is on connector *arg*.

Consequences

The *arg* network will not operate. No communication on *arg* network is possible.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

71534, Invalid output size for EtherNet/IP adapter

Description

The adapter *arg* has an invalid output size. Maximum output size supported is *arg* bytes.

Consequences

No communication with the adapter is possible.

Recommended actions

Correct the output size for the adapter in the I/O configuration.

71535, Invalid input size for EtherNet/IP adapter

Description

The adapter *arg* has an invalid input size. Maximum input size supported is *arg* bytes.

Consequences

No communication with the adapter is possible.

Recommended actions

Correct the input size for the adapter in the I/O configuration.

71536, Device command syntax error

Description

Could not send device command to adapter *arg* because there is a syntax error in the command value string.

Device command name *arg*.

The syntax error: Can't decode *arg*.

Consequences

The device command was not sent.

Recommended actions

Correct the device command value string.

71537, Invalid configuration data for EtherNet/IP adapter

Description

The adapter *arg* has an invalid configuration data. Can't decode *arg* at position *arg* in the configuration data.

Consequences

No communication with the adapter is possible.

Recommended actions

Correct the configuration data for the adapter in the I/O configuration.

71538, The EtherNet/IP network address must exist on PC

Description

The given address *arg*, configured on the EtherNet/IP network, is not found on any network interface on PC.

Consequences

No communication on the EtherNet/IP network is possible.

Probable causes

The *arg* address is not configured on any PC network interface.

Recommended actions

Set the *arg* address on the network interface connected to the EtherNet/IP network on PC.

71539, Invalid Signal Safe Level

Description

The I/O configuration is invalid.

I/O signal *arg* has an invalid/unknown Signal Safe Level: *arg*.

This I/O signal has been rejected.

Recommended actions

Correct the Signal Safe Level for the I/O signal.

71541, Network auto configuration, scan, successful

Description

The network auto configuration, operation: scan, on network *arg* was successful.

Recommended actions

View the information in the Event log.

71542, Network auto configuration, scan, not successful

Description

The network auto configuration, operation: scan, on network *arg* was not successful.

Recommended actions

View the errors in the Event log.

71543, Network auto configuration, scan EDS file, successful but with warnings

Description

The network auto configuration, operation: scan EDS file(s), on network *arg* and file *arg* was successful but with warnings.

Continues on next page

Consequences

The Template Device *arg* might not be complete.

Probable causes

Internal info:

arg

arg

Recommended actions

Verify the Template Device *arg*. Invalid parameters has to be manually corrected.

71544, Network auto configuration, scan EDS file, not successful

Description

The network auto configuration, operation: scan EDS file(s), on network *arg* and file *arg* was not successful.

Consequences

No Template Device could be created from the file *arg*.

Probable causes

Internal info:

arg

arg

arg

Recommended actions

Create the device manually.

71545, Network auto configuration, device, successful

Description

The network auto configuration, operation: add I/O device(s), on network *arg* was successful.

View the information in the Event log.

Recommended actions

Restart the controller to activate the new I/O device(s).

71546, Network auto configuration, device, not successful

Description

The network auto configuration, operation: add I/O device(s), on network *arg* was not successful.

Recommended actions

View the errors in the Event log.

71547, Network auto configuration, device and signals, successful

Description

The network auto configuration, operation: add I/O device(s) and I/O signals, on network *arg* was successful.

View the information in the Event log.

Recommended actions

Restart the controller to activate the new I/O device(s) and I/O signals.

71548, Network auto configuration, device and signals, not successful

Description

The network auto configuration, operation: add I/O device(s) and I/O signals, on network *arg* was not successful.

Recommended actions

View the errors in the Event log.

71549, Overlapping I/O signals with different values on ActionAtSysRestart

Description

The I/O signal *arg* has overlapping bit(s) in the device map with the I/O signal *arg*.

The I/O signal *arg* is using Signal Safe Level *arg* and the I/O signal *arg* is using Signal Safe Level *arg*.

I/O signals with overlapping device mapping must have the same value on the Signal Safe Level parameter

ActionAtSysRestart.

Consequences

The I/O signal *arg* has been rejected, and no functions depending on it will work.

Recommended actions

Correct the Signal Safe Level definitions for the overlapping I/O signals in the I/O configuration.

71550, Overlapping I/O signals with differing default values

Description

The I/O signal *arg* has overlapping bit(s) in the device map with the I/O signal *arg*. The I/O signal *arg* is using the default value *arg* and the I/O signal *arg* is using the default value *arg*.

I/O signals with overlapping device mapping must have default values with equal values on overlapping bit(s).

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

Consequences

This I/O signal *arg* has been rejected, and no functions depending on it will work.

Recommended actions

Correct the default values for the overlapping I/O signals in the I/O configuration.

71551, Network auto configuration not supported

Description

Network auto configuration is not supported on network *arg*.

71552, Max number of device trust levels exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of device trust levels in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of device trust levels) so that the maximum limit is not exceeded.

71553, Max number of device transfer instances exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of device-transfer instances in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of device-transfer instances or transfer information in I/O signals) so that the maximum limit is not exceeded.

71554, Max number of signal safe levels exceeded

Description

The I/O configuration is invalid.

The maximum number, *arg*, of signal safe levels in the I/O system has been exceeded.

Recommended actions

Modify the configuration of the I/O system (by reducing the number of signal safe levels) so that the maximum limit is not exceeded.

71555, Invalid configuration of TransferInputOffset and TransferOutputOffset

Description

The signal *arg* has both TransferInputOffset and TransferOutputOffset set.

Consequences

The configuration has been rejected.

Recommended actions

Remove either TransferInputOffset or TransferOutputOffset

71556, Signal cannot be transferred

Description

The signal *arg* has the signal type *arg*.

Only signals with the signal type DI or GI can be transferred with TransferOutputOffset and only DO/GO can be transferred with TransferInputOffset.

Consequences

The configuration has been rejected.

Recommended actions

Change the signal type or transfer another signal.

71557, Signal transfer was defined but no internal device was found

Description

The signal *arg* is being transferred but no internal device was found.

Recommended actions

Make sure the device is defined/configured before restarting the controller.

71558, Transfer signals overlap

Description

The signal *arg* and the signal *arg* both have transfer signal definitions and overlap.

Consequences

The configuration has been rejected.

Recommended actions

Change the configuration so that the signals don't overlap.

71559, Transfer signal and crossconnection overlaps

Description

The signal *arg* and the crossconnection *arg* overlaps.

Continues on next page

Consequences

The configuration has been rejected.

Recommended actions

Make sure that no crossconnection and transfer signal overlap.

71560, Transfer signal and SYSOUT_SIG overlaps**Description**

The transfer signal *arg* and the SYSOUT_SIG *arg* overlaps.

Consequences

The configuration has been rejected.

Recommended actions

Make sure that no SYSOUT_SIG and transfer signal overlap.

71561, Signal transfer has bitswapped devicemap**Description**

The transfer signal *arg* has a bitswapped device map, which is not allowed.

Consequences

The configuration has been rejected.

Recommended actions

Correct the device map.

71562, Signal transfer has a splitted devicemap**Description**

The transfer signal *arg* has a splitted device map, which is not allowed.

Consequences

The configuration has been rejected.

Recommended actions

Correct the device map.

71563, Signal on internal device with signal transfer definition**Description**

The signal *arg* is on an internal device and cannot have a transfer definition on it.

Consequences

The configuration has been rejected.

Recommended actions

Correct the configuration.

71564, Signal on internal device with signal transfer definition**Description**

The signal *arg* is being transferred to/from a network that is not PROFINET.

Consequences

The configuration has been rejected.

Recommended actions

Correct the configuration.

71565, Signal on internal device overlaps with transfer signal**Description**

The signal *arg* and the signal *arg* on an internal device overlap.

Consequences

The configuration has been rejected.

Recommended actions

Correct the configuration.

71566, Signal has both transfer signal attributes**Description**

The signal *arg* has both the TransferFromDevice and TransferToDevice attribute.

Consequences

The configuration has been rejected.

Recommended actions

Correct the configuration.

71567, Signal transfer without offset**Description**

The signal *arg* is being transferred to/from a device but is missing the offset attribute.

Consequences

The configuration has been rejected.

Recommended actions

Correct the configuration.

71568, Signal transfer to/from undefined device**Description**

The signal *arg* is being transferred to/from an undefined device *arg*.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

Consequences

The configuration has been rejected.

Recommended actions

Correct the configuration.

71569, Signal has offset but no transfer attribute

Description

The signal *arg* has a transfer offset set but no TransferFromDevice/TransferToDevice attribute.

Consequences

The configuration has been rejected.

Recommended actions

Correct the configuration.

71570, Signal has transfer defined with wrong offset

Description

The signal *arg* has a transfer defined but uses the wrong offset.

Consequences

The configuration has been rejected.

Recommended actions

Correct the configuration.

71571, Transfer signal I/O queue overload

Description

The I/O queue handling transfer signal changes has been overloaded.

Consequences

The system will go to status SYS STOP.

Probable causes

This is caused by too frequent signal changes or too large bursts of input bit changes, generated by inputs on I/O devices.

Recommended actions

- 1) Check the transfer definitions on I/O signals. How to check the configuration is detailed in the Trouble Shooting Manual.
- 2) Check the frequency of inputs from any external equipment connected to the system. Make sure it is not abnormal, and change if required.
- 3) If an extremely heavy I/O load is normal and required, investigate whether programming delays in the RAPID application may solve the problem.

71572, I/O device has entered error state

Description

System has indicated that the I/O device *arg* with address *arg* on the network *arg* is faulty.

Consequences

It is not possible to access the I/O device or I/O signals on it, since it is malfunctioning.

Probable causes

There are a number of potential causes for a device to start malfunctioning. Consult the corresponding application manual for possible causes.

Recommended actions

- 1) Consult the application manual for possible causes.
- 2) Check the hardware for potential errors.
- 3) Replace the device hardware, if applicable.

71573, PROFINET configuration mismatch

Description

The I/O device *arg* reported a different slot configuration than configured in the system. Module in slot *arg* is of wrong type.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The module type used in slot *arg* may be of wrong type or of a different version compared to the actual hardware on the I/O device.

Recommended actions

- 1) Update the PROFINET configuration file to match the hardware.
- 2) Check the I/O device.

71574, PROFINET configuration mismatch

Description

The I/O device *arg* reported a different slot configuration than configured in the system. Module in slot *arg* is correct but one or several submodules indicate errors.

Consequences

Some I/O signals might not be possible to use.

Probable causes

One or several submodules in slot *arg* may be of wrong type or of a different version compared to the actual hardware on the I/O device.

Continues on next page

Recommended actions

- 1) Update the PROFINET configuration file to match the hardware.
- 2) Check the I/O device.

71575, PROFINET configuration mismatch**Description**

The I/O device *arg* reported a different slot configuration than configured in the system. There is no module present in slot *arg* however one is configured in the configuration.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The module in slot *arg* is missing on the I/O device.

Recommended actions

- 1) Update the PROFINET configuration file to match the hardware.
- 2) Check the I/O device.

71576, Submodule could not be taken over**Description**

The submodule in subslot *arg* in slot *arg* on device *arg* could not be taken over.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* cannot be accessed by the robot.

Recommended actions

- 1) Make sure that the device configuration does not conflict with an external controller configuration. E.g. This could be the case in a shared device setup.
- 2) Check if device supports this feature.

71577, Submodule has qualified information available**Description**

The submodule in subslot *arg* in slot *arg* on device *arg* has qualified information available.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* has generated qualified information.

Recommended actions

- 1) Check the device diagnostic data for additional diagnostic information.
- 2) Consult the device vendor for additional information.

71578, Submodule requires maintenance**Description**

The submodule in subslot *arg* in slot *arg* on device *arg* has maintenance required information available.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* requires maintenance.

Recommended actions

- 1) Check the device diagnostic data for additional diagnostic information.
- 2) Consult the device vendor for additional information.

71579, Submodule demands maintenance**Description**

The submodule in subslot *arg* in slot *arg* on device *arg* has maintenance demanded information available.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* demands maintenance.

Recommended actions

- 1) Check the device diagnostic data for additional diagnostic information.
- 2) Consult the device vendor for additional information.

71580, Submodule has diagnostic information available**Description**

The submodule in subslot *arg* in slot *arg* on device *arg* has diagnostic information available.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* has generated diagnostic data.

Continues on next page

5 Trouble shooting by event log

5.8 7 xxxx

Continued

Recommended actions

- 1) Check the device diagnostic data for additional diagnostic information.
- 2) Consult the device vendor for additional information.

71581, Submodule is blocked by device

Description

The submodule in subslot *arg* in slot *arg* on device *arg* has a pending AR.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* is not accessible for controller.

Recommended actions

- 1) Power cycle the device to reestablish the connection.
- 2) Consult the device vendor for additional information.

71582, Submodule is locked by superordinated means

Description

The submodule in subslot *arg* in slot *arg* on device *arg* is locked by superordinated means.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* cannot be accessed by the robot.

Recommended actions

- 1) Make sure that the device configuration does not conflict with a external controller configuration. E.g. This could be the case in a shared device setup.

71583, Submodule is locked by another IO controller

Description

The submodule in subslot *arg* in slot *arg* on device *arg* is locked by another IO controller.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* cannot be accessed by the robot.

Recommended actions

- 1) Make sure that the device configuration does not conflict with a external controller configuration. E.g. This could be the case in a shared device setup.

71584, Submodule is locked by another IO supervisor

Description

The submodule in subslot *arg* in slot *arg* on device *arg* is locked by another IO supervisor.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* cannot be accessed by the robot.

Recommended actions

- 1) Update the PROFINET configuration file to match the hardware.
- 2) Check the I/O device.

71585, Submodule is of wrong type

Description

The submodule in subslot *arg* in slot *arg* on device *arg* is of wrong type.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* is of wrong type.

Recommended actions

- 1) Update the PROFINET configuration file to match the hardware.
- 2) Check the I/O device.

71586, Submodule is missing

Description

The submodule in subslot *arg* in slot *arg* on device *arg* is missing.

Consequences

Some I/O signals might not be possible to use.

Probable causes

The submodule in subslot *arg* in slot *arg* on device *arg* is missing.

Continues on next page

Recommended actions

- 1) Update the PROFINET configuration file to match the hardware.
- 2) Check the I/O device.

Device command name *arg*.

The syntax error: Duplicated segment.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71587, Device command syntax error**Description**

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

Device command name *arg*.

The syntax error: Unsupported segment.

Consequences

The device command was not sent.

Recommended actions

Correct the device command path string.

71589, Fiber optics error**Description**

Slot *arg* on device *arg* is signaling problems with the fiber optics, power budget.

Consequences

The device may not work properly due to transmission problems.

Recommended actions

Maintenance is needed of the device and or the fiber optics.

Check the fiber optic transmission chain. Replace the device and or the fiber optic cables if the error remains.

71588, Device command syntax error**Description**

Could not send device command to I/O device *arg* because there is a syntax error in the command path string.

5 Trouble shooting by event log

5.9 9 xxxx

5.9 9 xxxx

90200, Limit Switch opened by SC

Description

The limit switch on the robot has been opened by the Safety Controller (SC).

Consequences

The system goes to the Guard stop state.

Probable causes

The Safety Controller has opened the limit switch because of a safety violation.

Recommended actions

- 1) Check for reason found in other event messages.
- 2) Check the cable between the contactor board and the Safety Controller.
- 3) Do a Confirm Stop by pressing the Motors ON push button or by activating the appropriated system input.

2) Then switch the system back to state Motors ON by pressing the Motors ON button on the control module.

90203, Enabling Device open

Description

Only one of the two enabling device chains was opened.

Consequences

The system goes to status SYS HALT.

Probable causes

The FlexPendant enabling device may be faulty or incorrectly connected. The FlexPendant and its enabling device is described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check the FlexPendant cable and its connection.
- 2) If required, replace the faulty FlexPendant or its cable.

90201, Limit Switch open

Description

The limit switch on the robot has opened.

Consequences

The system goes to the Motors OFF status.

Probable causes

The robot has been run outside the working range defined by the limit switches fitted to the robot.

Recommended actions

- 1) Press an eventual existing external "Override Limit" button and manually jog the robot back into the working area.
- 2) Resume operation.

90204, Operation Key imbalance

Description

The system has detected an imbalance in the two parallel MANUAL / AUTO operation key circuits.

Probable causes

The contact pair in any of the cables connected to the operation key circuit is not working correctly.

Recommended actions

- 1) Isolate the cable connection causing the conflict.
- 2) Connect the cable in a correct way.

90205, Auto Stop open

Description

The Automatic Mode Safeguarded Stop circuit has been broken.

Consequences

The system goes to the Auto Stop status.

Probable causes

One or more of the switch connected in series with the Automatic Mode Safeguarded Stop circuit have been opened, which may be caused by a large number of faults. This is only possible while in the Auto operational mode. The Automatic Mode Safeguarded Stop circuit is described in the Trouble Shooting Manual.

Recommended actions

- 1) Locate the switch, reset it and restart the controller.

90202, Emergency Stop open

Description

The emergency stop circuit has previously been broken, and while broken, an attempt was made to operate the robot.

Consequences

The system remains in the Emergency Stop status.

Probable causes

An attempt has been made to maneuver a control, e.g. the enabling device.

Recommended actions

- 1) To resume operation, first reset the emergency stop button triggering the stop.

Continues on next page

2) Check cables and connections.

90206, General Stop open

Description

The General Mode Safeguarded Stop circuit has been broken.

Consequences

The system goes to the General Stop status.

Probable causes

One or more of the switch connected in series with the General Mode Safeguarded Stop circuit have been opened, which may be caused by a large number of faults. This is possible in any operational mode. The General Mode Safeguarded Stop circuit is described in the Trouble Shooting Manual.

Recommended actions

- 1) Locate the switch, reset it and restart the controller.
- 2) Check cables and connections.

90208, Chain switches open

Description

A safety chain, other than Auto Stop and General Stop, has been broken.

Consequences

The system goes to the Guard Stop status.

Probable causes

One or more of the switch connected in series with the run chain top circuit have been opened, which may be caused by a large number of faults. The run chain top is described in the Trouble Shooting Manual and Circuit Diagram.

Recommended actions

- 1) Check other error messages for primary fault reason.
- 2) Locate the switch, reset it and restart the controller.
- 3) Check cables and connections.

90209, External Contactor open

Description

An external contactor has been opened.

Consequences

The system goes from the Motors OFF status to SYS HALT when attempting to start.

Probable causes

The run chain of external equipment has been broken, which may be caused by the external contactor auxiliary contacts or, if used, any PLC, controlling it. The external contactor supplies power to a piece of external equipment, equivalently to how the

RUN contactor supplies a robot. This fault may occur when attempting to go to the Motors ON mode only. The run chain is described in the Trouble Shooting Manual and Circuit Diagram.

Recommended actions

- 1) Locate the switch, reset it and restart the controller.
- 2) Check cables and connections.
- 3) Check the external contactor auxiliary contacts.
- 4) If used, check any PLC equipment controlling the external contactor.

90211, Two channel fault, Enable Chain

Description

A switch in only one of the two enable chains was briefly affected, opening the chain and then reclosing it, without the other chain being affected.

Consequences

The system goes to status SYS HALT.

Probable causes

There may be a loose signal connection on either the axis computer or the safety system. The enable chain is described in the Trouble Shooting Manual and Circuit Diagram.

Recommended actions

- 1) Check cables and connections.
- 2) Make sure all signal connectors on the axis computer board and the safety system are securely connected.
- 3) If there is no loose connection, replace the faulty board.

90212, Two channel fault, Run Chain

Description

Only one of the two run chains was closed.

Consequences

The system goes to status SYS HALT.

Probable causes

Any of the switches connected to the run chain may be faulty or not correctly connected, causing only one channel to close. The run chain is described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check cables and connections.
- 2) Check other event messages occurring at the same time to determine which switch caused the fault.
- 3) Make sure all switches are working correctly.
- 4) To assist in returning the chains to a defined status, first pressing, then resetting the Emergency Stop.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

5) If there is no loose connection, replace the faulty switch.

90213, Two channel fault

Description

A brief status change in any of the run or enable chains has been detected.

Consequences

The system goes to status SYS HALT.

Probable causes

This may be caused by a number of faults. The enable and run chains are described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check cables and connections.
- 2) Check other event messages occurring at the same time to determine the cause of the fault.
- 3) To assist in returning the chains to a defined status, first pressing, then resetting the Emergency Stop may work.

90214, Limit Switch open, DRV1

Description

The limit switch on the robot has opened.

Consequences

The system goes to the Motors OFF status.

Probable causes

The robot has been run outside the working range defined by the limit switches fitted to the robot.

Recommended actions

- 1) Press an eventual existing external "Override Limit" button and manually jog the robot back into the working area.
- 2) Resume operation.

90215, Superior Stop open

Description

The Superior Mode Safeguarded Stop circuit has been opened.

Consequences

The system goes to the Superior Stop status.

Probable causes

One or more of the switch connected in series with the Superior Mode Safeguarded Stop circuit have been opened, which may be causes by a large number of faults. This is possible in any operational mode. The Superior Mode Safeguarded Stop circuit is described in the Trouble Shooting Manual.

Recommended actions

- 1) Locate the switch, reset it and restart the controller.

90216, Enabling device active in Auto mode

Description

The system has detected that the enabling device has been pressed for more than 3 seconds in Automatic operating mode.

Consequences

The system goes to status Guard Stop.

Recommended actions

- 1) Release the enabling device.
- 2) Switch to Manual mode.

90217, Limit Switch open, DRV2

Description

The limit switch on the robot has opened.

Consequences

The system goes to the Motors OFF status.

Probable causes

The robot has been run outside the working range defined by the limit switches fitted to the robot.

Recommended actions

- 1) Press an eventual existing external "Override Limit" button and manually jog the robot back into the working area.
- 2) Resume operation.

90218, Limit Switch open, DRV3

Description

The limit switch on the robot has opened.

Consequences

The system goes to the Motors OFF status.

Probable causes

The robot has been run outside the working range defined by the limit switches fitted to the robot.

Recommended actions

- 1) Press an eventual existing external "Override Limit" button and manually jog the robot back into the working area.
- 2) Resume operation.

90219, Limit Switch open, DRV4

Description

The limit switch on the robot has opened.

Continues on next page

Consequences

The system goes to the Motors OFF status.

Probable causes

The robot has been run outside the working range defined by the limit switches fitted to the robot.

Recommended actions

- 1) Press an eventual existing external "Override Limit" button and manually jog the robot back into the working area.
- 2) Resume operation.

90220, Superior stop conflict

Description

Only one of the two Superior Mode Safeguarded Stop chains was opened.

Consequences

The system goes to status SYS HALT.

Probable causes

Any of the switches connected to the Superior Stop chain may be faulty or not correctly connected, causing only one channel to close. The Superior Stop chain is described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check cables and connections.
- 2) Check other event messages occurring at the same time to determine which switch caused the fault.
- 3) Make sure all switches are working correctly.
- 4) If there is no loose connection, replace the faulty switch.

90221, Run chain conflict

Description

Status conflict for run chain.

Recommended actions

Please check the run chain cables.

90222, Limit switch conflict

Description

Only one of the two limit switch chains was opened.

Consequences

The system goes to status SYS HALT.

Probable causes

Any of the switches connected to the limit switch chain may be faulty or not correctly connected, causing only one channel to close. The limit switch chain is described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check cables and connections.
- 2) Check other event messages occurring at the same time to determine which switch caused the fault.
- 3) Make sure all switches are working correctly.
- 4) If there is no loose connection, replace the faulty switch.

90223, Emergency Stop conflict

Description

Only one of the two Emergency Stop chains was opened.

Consequences

The system goes to status SYS HALT.

Probable causes

Any of the switches connected to the Emergency Stop chain may be faulty or not correctly connected, causing only one channel to close. The Emergency Stop chain is described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check cables and connections.
- 2) Check other event messages occurring at the same time to determine which switch caused the fault.
- 3) Make sure all switches are working correctly.
- 4) If there is no loose connection, replace the faulty switch.

90224, Enabling Device conflict

Description

Only one of the two enabling device chains was opened.

Consequences

The system goes to status SYS HALT.

Probable causes

The FlexPendant enabling device may be faulty or incorrectly connected. The FlexPendant and its enabling device is described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check the FlexPendant cable and its connection.
- 2) If required, replace the faulty FlexPendant or its cable.

90225, Auto Stop conflict

Description

Only one of the two Automatic Mode Safeguarded Stop chains was opened.

Consequences

The system goes to status SYS HALT.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Probable causes

Any of the switches connected to the Auto Stop chain may be faulty or not correctly connected, causing only one channel to close. The Auto Stop chain is described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check cables and connections.
- 2) Check other event messages occurring at the same time to determine which switch caused the fault.
- 3) Make sure all switches are working correctly.
- 4) If there is no loose connection, replace the faulty switch.

90226, General Stop conflict

Description

Only one of the two General Mode Safeguarded Stop chains was opened.

Consequences

The system goes to status SYS HALT.

Probable causes

Any of the switches connected to the General Stop chain may be faulty or not correctly connected, causing only one channel to close. The General Stop chain is described in the Trouble Shooting Manual, IRC5.

Recommended actions

- 1) Check cables and connections.
- 2) Check other event messages occurring at the same time to determine which switch caused the fault.
- 3) Make sure all switches are working correctly.
- 4) If there is no loose connection, replace the faulty switch.

90227, Motor Contactor conflict, DRV1

Description

Only one of the two motor contactors for drive system 1 has acknowledged the activation order.

Consequences

The system goes to status SYS HALT.

Probable causes

A failure of the motor contactor auxiliary contacts or the supply to these.

Recommended actions

- 1) Check cables and connections.
- 2) Check the function of the auxiliary contacts.

90231, Delayed Emergency Stop due to circuit imbalance

Description

The system has detected an imbalance in the two parallel Emergency Stop circuits.

Consequences

The system goes to status Emergency Stop after approximately 1 sec.

Probable causes

The contact pair in any of the Emergency Stop buttons is not working correctly.

Recommended actions

- 1) Isolate the Emergency Stop button causing the conflict.
- 2) Check the contact pair.
- 3) Make sure all connections are tight.
- 4) Replace the button if required.

90232, Delayed Auto Stop due to circuit imbalance

Description

The system has detected an imbalance in the two parallel Auto Stop circuits.

Consequences

The system goes to status Guard Stop after approximately 1 sec.

Probable causes

The contact pair in any of the safety devices connected to the Auto Stop circuit is not working correctly.

Recommended actions

- 1) Isolate the safety device causing the conflict.
- 2) Make sure the device used is a two-channel device.
- 3) Check the contact pair.
- 4) Make sure all connections are tight.
- 5) Replace the device if required.

90233, Delayed General Stop due to circuit imbalance

Description

The system has detected an imbalance in the two parallel General Stop circuits.

Consequences

The system goes to status Guard Stop after approximately 1 sec.

Continues on next page

Probable causes

The contact pair in any of the safety devices connected to the General Stop circuit is not working correctly.

Recommended actions

- 1) Isolate the safety device causing the conflict.
- 2) Make sure the device used is a two-channel device.
- 3) Check the contact pair.
- 4) Make sure all connections are tight.
- 5) Replace the device if required.

90234, Immediate Emergency Stop

Description

The Emergency Stop circuits have been broken.

Consequences

The system goes directly to status Emergency Stop.

Probable causes

One or more of the red emergency stop buttons have been activated.

Recommended actions

- 1) Isolate the Emergency Stop button that was opened.
- 2) Reset the button.

90235, Immediate Auto Stop

Description

The Auto Stop circuits have been broken.

Consequences

The system goes directly to status Guard Stop.

Probable causes

One or more of the safety device switches in the Auto Stop circuit have been opened.

Recommended actions

- 1) Isolate the safety device that was opened.
- 2) Reset the device switch.

90236, Immediate General Stop

Description

The General Stop circuits have been broken.

Consequences

The system goes directly to status Guard Stop.

Probable causes

One or more of the safety device switches in the General Stop circuit have been opened.

Recommended actions

- 1) Isolate the safety device that was opened.
- 2) Reset the device switch.

90237, Immediate Superior Stop

Description

The Superior Stop circuits have been broken.

Consequences

The system goes directly to status Guard Stop.

Probable causes

One or more of the safety device switches in the Superior Stop circuit have been opened.

Recommended actions

- 1) Isolate the safety device that was opened.
- 2) Reset the device switch.

90238, Delayed Superior Stop due to circuit imbalance

Description

The system has detected an imbalance in the two parallel Superior Stop circuits.

Consequences

The system goes to status Guard Stop after approximately 1 sec.

Probable causes

The contact pair in any of the safety devices connected to the Superior Stop circuit is not working correctly.

Recommended actions

- 1) Isolate the safety device causing the conflict.
- 2) Make sure the device used is a two-channel device.
- 3) Check the contact pair.
- 4) Make sure all connections are tight.
- 5) Replace the device if required.

90240, Conflict between ENABLE signals

Description

A switch in only one of the two enable chains was affected, without the other chain being affected.

Consequences

The system goes to status SYS HALT.

Probable causes

There may be a loose signal connection on the safety system. The enable chain is described in the Trouble Shooting Manual and Circuit Diagram.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Recommended actions

- 1) Check cables and connections.
- 2) Make sure all signal connectors on the safety system are securely connected.
- 3) If there is no loose connection, replace the faulty board.

90241, Operating mode conflict

Description

There is a conflict between the operating mode selected on the operating mode selector on the controller cabinet front and the actual operating mode as detected by the axis computer.

Consequences

The system goes to status SYS HALT.

Probable causes

There may be a hardware fault in the operating mode selector or its cabling to the safety system.

Recommended actions

Check the operating mode selector and its cabling to the safety system.

90245, Run Control status conflict, DRV2

Description

Status conflict between run control and motor contactors for drive system 2.

Consequences

The system goes to status SYS HALT.

Probable causes

A failure of the motor contactors or the supply to these.

Recommended actions

- 1) Check cables and connections.
- 2) Restart the controller.

90246, Run Control status conflict, DRV3

Description

Status conflict between run control and motor contactors for drive system 3.

Consequences

The system goes to status SYS HALT.

Probable causes

A failure of the motor contactors or the supply to these.

Recommended actions

- 1) Check cables and connections.
- 2) Restart the controller.

90247, Run Control status conflict, DRV4

Description

Status conflict between run control and motor contactors for drive system 4.

Consequences

The system goes to status SYS HALT.

Probable causes

A failure of the motor contactors or the supply to these.

Recommended actions

- 1) Check cables and connections.
- 2) Restart the controller.

90248, Motor Contactor conflict, DRV2

Description

Only one of the two motor contactors for drive system 2 has acknowledged the activation order.

Consequences

The system goes to status SYS HALT.

Probable causes

A failure of the motor contactor auxiliary contacts or the supply to these.

Recommended actions

- 1) Check cables and connections.
- 2) Check the function of the auxiliary contacts.

90249, Motor Contactor conflict, DRV3

Description

Only one of the two motor contactors for drive system 3 has acknowledged the activation order.

Consequences

The system goes to status SYS HALT.

Probable causes

A failure of the motor contactor auxiliary contacts or the supply to these.

Recommended actions

- 1) Check cables and connections.
- 2) Check the function of the auxiliary contacts.

90250, Motor Contactor conflict, DRV4

Description

Only one of the two motor contactors for drive system 4 has acknowledged the activation order.

Continues on next page

Consequences

The system goes to status SYS HALT.

Probable causes

A failure of the motor contactor auxiliary contacts or the supply to these.

Recommended actions

- 1) Check cables and connections.
- 2) Check the function of the auxiliary contacts.

90252, Motor temperature high, DRV1

Description

Over temperature in manipulator motor. Make sure to let the motor cool down before ordering Motors On again.

Recommended actions

- 1) Wait until the overheated motor has cooled down before ordering Motors On again.
- 2) If optional air filter is used, check if it is clogged and has to be exchanged.

90253, External device temperature high, DRV1

Description

Over temperature in external device. Make sure to let the external device cool down before ordering Motors On again.

Recommended actions

Wait until the overheated motor has cooled down before ordering Motors On again.

90254, Motor temperature high, DRV2

Description

Over temperature in manipulator motor. Make sure to let the motor cool down before ordering Motors On again.

Recommended actions

- 1) Wait until the overheated motor has cooled down before ordering Motors On again.
- 2) If optional air filter is used, check if it is clogged and has to be exchanged.

90255, External device temperature high, DRV2

Description

Over temperature in external device. Make sure to let the external device cool down before ordering Motors On again.

Recommended actions

Wait until the overheated motor has cooled down before ordering Motors On again.

90256, Motor temperature high, DRV3

Description

Over temperature in manipulator motor. Make sure to let the motor cool down before ordering Motors On again.

Recommended actions

- 1) Wait until the overheated motor has cooled down before ordering Motors On again.
- 2) If optional air filter is used, check if it is clogged and has to be exchanged.

90257, External device temperature high, DRV3

Description

Over temperature in external device. Make sure to let the external device cool down before ordering Motors On again.

Recommended actions

Wait until the overheated motor has cooled down before ordering Motors On again.

90258, Motor temperature high, DRV4

Description

Over temperature in manipulator motor. Make sure to let the motor cool down before ordering Motors On again.

Recommended actions

- 1) Wait until the overheated motor has cooled down before ordering Motors On again.
- 2) If optional air filter is used, check if it is clogged and has to be exchanged.

90259, External device temperature high, DRV4

Description

Over temperature in external device. Make sure to let the external device cool down before ordering Motors On again.

Recommended actions

Wait until the overheated motor has cooled down before ordering Motors On again.

90260, Run Control status conflict, DRV1

Description

Status conflict between run control and motor contactors for drive system 1.

Consequences

The system goes to status SYS HALT.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Probable causes

A failure of the motor contactors or the supply to these.

Recommended actions

- 1) Check cables and connections.
- 2) Restart the controller.

90262, SC arg Not found

Description

The system has an option for *arg* Safety Controller (SC) on drive module *arg*, but no Safety Controller was found.

Recommended actions

- Check Safety Controller cabling.
- Check Safety Controller health.

Restart the robot controller, after performing recommended actions.

90263, SC arg Communication Failure

Description

Communication error with Safety Controller (SC) *arg*.

Recommended actions

- Check Safety Controller cabling.
- Check Safety Controller health.

Restart the robot controller, after performing recommended actions.

90264, SC arg Option Not Present

Description

Found *arg* Safety Controller (SC) on drive module *arg*. This system does not have the option for a Safety Controller on that drive module.

Recommended actions

- Check drive module software options.
- Install a system with Safety Controller option.

90265, SC Soft Stop Error

Description

Safety Controller (SC) Soft Stop has not opened the motor contactors within the calculated time.

Recommended actions

Check Lim-switch connection if SafeMove is present.

90266, SC arg PIN Code Request

Description

Safety Controller (SC) *arg* has a new safety configuration and needs a new PIN code to be activated.

Recommended actions

- 1) Log in as a user with Safety Configuration grants.
- 2) Enter new PIN-Code for the Safety Controller in the Control Panel.
- 3) If input of PIN-code does not help, upload calibration offset from the manipulator and download it to the safety controller. Repeat step 2.

90267, SC arg Initialization Failed

Description

Safety Controller (SC) *arg* failed to initialize properly, or failed to respond during start up.

Recommended actions

- 1) Check previous error logs for possible causes.
- 2) Restart the robot controller.

90268, SC arg Wrong Type

Description

Found *arg* Safety Controller (SC) on drive module *arg*, expected *arg*.

Recommended actions

- Check drive module software options.
- Install a system with correct Safety Controller option.
- Install a Safety Controller of the correct type.

90269, SC arg Motor Calibration Data Error

Description

No calibration data has been downloaded to Safety Controller (SC) on drive module *arg*, or erroneous data.

Recommended actions

Download motor calibration data to Safety Controller (SC).

90303, Acknowledge timeout

Description

The acknowledge signal, coming from a PLC, was not activated within the expected time during a remote change of operating mode to Automatic- or Manual full speed mode.

Consequences

Operating mode cannot be changed to Automatic- or Manual full speed mode. Manual operating mode remains.

Continues on next page

Probable causes

- 1) Cable connection fault.
- 2) Acknowledge signal was not activated by the PLC.
- 3) Incorrect I/O configuration.

Recommended actions

- 1) Make sure that the acknowledge signal becomes activated when expected.
- 2) Check I/O configuration.

90304, Change of Operating Mode is not allowed**Description**

Remote change of operating mode from a PLC is not allowed.

Consequences

Operating mode cannot be changed from the PLC.

Probable causes

- 1) Remote control activation signal not activated.
- 2) Incorrect I/O configuration.

Recommended actions

- 1) Make sure that the remote control activation signal is activated.
- 2) Check I/O configuration.

90305, Missing option for Remote Operating Mode**Description**

The option that is required for remote change of operating mode from a PLC is not selected.

Consequences

Operating mode cannot be changed from the PLC.

Probable causes

Option "Auto acknowledge input" is not selected.

Recommended actions

- 1) Update Robot system with the "Auto acknowledge input" option selected.
- 2) Restart the robot controller.

90306, Not possible to activate I/O signals in Safety system**Description**

It was not possible to activate I/O signals in the safety system during startup.

Consequences

The safety system cannot use I/O signals to detect state changes and critical states. This will end up in a system failure condition.

Probable causes

Drive system option is not present.

Recommended actions

- 1) Check if there is a drive system option present.
- 2) Create a new system including the correct drive system option and do a restart.

90307, Motor cooling fan malfunction, axis 1**Description**

The axis 1 motor cooling fan on the robot connected to drive module arg does not work correctly.

Consequences

The full meaning of this status is described in the Trouble Shooting Manual, IRC5.

Probable causes

- The fan power cabling may be damaged or not connected correctly to motor or contactor unit.
- The fan or the drive module power supply may be faulty.

Recommended actions

- 1) Make sure the fan cable is correctly connected.
- 2) Make sure the fan is free to rotate and that the air flow is not obstructed.
- 3) Make sure the drive module power supply output and input voltages are within specified limits as detailed in the Trouble shooting manual. Replace any faulty unit.

90308, Motor cooling fan malfunction, axis 2**Description**

The axis 2 motor cooling fan on the robot connected to drive module arg does not work correctly.

Consequences

The full meaning of this status is described in the Trouble Shooting Manual, IRC5.

Probable causes

- The fan power cabling may be damaged or not connected correctly to motor or contactor unit.
- The fan or the drive module power supply may be faulty.

Recommended actions

- 1) Make sure the fan cable is correctly connected.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

- 2) Make sure the fan is free to rotate and that the air flow is not obstructed.
3) Make sure the drive module power supply output and input voltages are within specified limits as detailed in the Trouble shooting manual. Replace any faulty unit.

90309, Motor cooling fan malfunction, axis 3

Description

The axis 3 motor cooling fan on the robot connected to drive module *arg* does not work correctly.

Consequences

The full meaning of this status is described in the Trouble Shooting Manual, IRC5.

Probable causes

- The fan power cabling may be damaged or not connected correctly to motor or contactor unit.
- The fan or the drive module power supply may be faulty.

Recommended actions

- 1) Make sure the fan cable is correctly connected.
- 2) Make sure the fan is free to rotate and that the air flow is not obstructed.
- 3) Make sure the drive module power supply output and input voltages are within specified limits as detailed in the Trouble shooting manual. Replace any faulty unit.

90310, SC *arg* Communication Failed

Description

An error occurred while trying to communicate with Safety Controller (SC) *arg*.

Recommended actions

- Check Safety Controller cabling.
- Check Safety Controller health.

Restart the robot controller, after performing recommended actions.

90311, Enable 1 open

Description

The Enable 1 circuit monitoring the safety system has been opened.

Consequences

The system goes to status SYS HALT.

Probable causes

There may be an internal fault in the safety system or the internal supervision has detected a fault.

Recommended actions

- 1) Check all connections to the safety system.
- 2) If faulty, replace the faulty board.

90312, Enable 2 open

Description

The Enable 2 circuit monitoring the axis computer has been opened.

Consequences

The system goes to status SYS HALT.

Probable causes

There may be a connection problem between main computer and axis computer.

Recommended actions

- 1) Check all connections to the axis computer.
- 2) Check cables connected to the safety system.

90313, Enable 1 supervision fault

Description

The Enable 1 circuit has been broken. This circuit monitors the function of the safety system and the main computer.

Consequences

The system goes to status SYS HALT.

Probable causes

A fault, probably a software fault, has been detected by any of the units supervised by the Enable 1 circuit.

Recommended actions

- 1) Attempt restarting by pressing the Motors ON button. If restarting is IMPOSSIBLE it indicates a possible hardware fault. If restarting is POSSIBLE, it indicates a software fault. In such case, contact your local ABB representative.
- 2) Determine which unit is faulty by checking its indication LEDs. The LEDs are described in the Trouble Shooting Manual. Replace the faulty unit.

90314, Enable2 supervision fault

Description

The Enable 2 circuit to drive module 1 has been broken. This circuit monitors e.g. the function of the safety system and the axis computer.

Consequences

The system goes to status SYS HALT.

Continues on next page

Probable causes

A fault, probably a software fault, has been detected by any of the units supervised by the Enable 2 circuit.

Recommended actions

1) Attempt restarting by pressing the Motors ON button. If restarting is IMPOSSIBLE it indicates a hardware fault in safety system, axis computer. If restarting is POSSIBLE, it indicates a software fault. In such case, contact your local ABB representative.

2) Determine which unit is faulty by checking its indication LEDs. The LEDs are described in the Trouble Shooting Manual. Replace the faulty unit.

90315, Enable2 Supervision fault

Description

The Enable 2 circuit to drive module 2 has been broken. This circuit monitors e.g. the function of the safety system and the axis computer.

Consequences

The system goes to status SYS HALT.

Probable causes

A fault, probably a software fault, has been detected by any of the units supervised by the Enable 2 circuit.

Recommended actions

1) Attempt restarting by pressing the Motors ON button. If restarting is IMPOSSIBLE it indicates a hardware fault in safety board, axis computer. If restarting is POSSIBLE, it indicates a software fault. In such case, contact your local ABB representative.

2) Determine which unit is faulty by checking its indication LEDs. The LEDs are described in the Trouble Shooting Manual.

Replace the faulty unit.

90316, Enable2 Supervision fault

Description

The Enable 2 circuit to drive module 3 has been broken. This circuit monitors e.g. the function of the safety system and the axis computer.

Consequences

The system goes to status SYS HALT.

Probable causes

A fault, probably a software fault, has been detected by any of the units supervised by the Enable 2 circuit.

Recommended actions

1) Attempt restarting by pressing the Motors ON button. If restarting is IMPOSSIBLE it indicates a hardware fault in safety system, axis computer. If restarting is POSSIBLE, it indicates a software fault. In such case, contact your local ABB representative.

2) Determine which unit is faulty by checking its indication LEDs. The LEDs are described in the Trouble Shooting Manual. Replace the faulty unit.

90317, Enable2 Supervision fault

Description

The Enable 2 circuit to drive module 4 has been broken. This circuit monitors e.g. the function of the safety system and the axis computer.

Consequences

The system goes to status SYS HALT.

Probable causes

A fault, probably a software fault, has been detected by any of the units supervised by the Enable 2 circuit.

Recommended actions

1) Attempt restarting by pressing the Motors ON button. If restarting is IMPOSSIBLE it indicates a hardware fault in safety system, axis computer. If restarting is POSSIBLE, it indicates a software fault. In such case, contact your local ABB representative.

2) Determine which unit is faulty by checking its indication LEDs. The LEDs are described in the Trouble Shooting Manual. Replace the faulty unit.

90326, Missing required UAS grant

Description

The user *arg* does not have the required UAS grant (*arg*) for the requested operation.

Consequences

The operation is not performed.

Recommended actions

Log in as another user that has the required grant, or add the grant to the existing user.

90327, Operation only allowed in Manual mode

Description

The requested safety-related operation requires that the controller is in Manual mode.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Consequences

The operation is not performed.

Recommended actions

Change the controller to Manual mode.

90328, Operation only allowed in Motors OFF

Description

The requested safety-related operation requires that the controller is in Motors OFF.

Consequences

The operation is not performed.

Recommended actions

Change the controller state to Motors OFF.

90329, Safety configuration is Locked

Description

The requested safety-related operation could not be performed because the safety configuration is Locked.

Consequences

The operation is not performed.

Recommended actions

Unlock the current configuration (requires UAS grant LOCK_SAFETY_CONFIG).

90330, Safety Mode not allowed

Description

The requested Safety mode is not allowed in the current controller state.

It is not allowed to change Safety mode when in Automatic mode.

It is not allowed to set Safety mode to Service Mode when in Automatic or ManualFullSpeed modes.

Consequences

The operation is not performed.

Recommended actions

Change the controller state to one of the allowed modes first.

90450, SC arg CBC Speed exceeded

Description

Cyclic Brake Check (CBC) speed limit is exceeded in Safety Controller (SC) on mechanical unit *arg*. Either CBC test interval has expired or a previous brake check failed.

Recommended actions

Decrease speed and execute Brake check.

90451, SC *arg* Not synchronized

Description

Safety Controller (SC) *arg* is not synchronized with supervised mechanical units.

Recommended actions

Move all mechanical units supervised by Safety Controller *arg* to the synchronization positions defined in the safety configuration.

90452, SC *arg* Synchronized

Description

Safety Controller (SC) *arg* is now synchronized to supervised mechanical units. Safety supervision can be used.

90453, SC *arg*: Wrong Sync. Position

Description

The positions of the supervised mechanical units do not match the synchronization positions defined in the safety configuration for Safety Controller (SC) *arg* on axis *arg*.

Recommended actions

- Check that all supervised mechanical units are positioned at the configured synchronization position.
- Check that the synchronization switch is working properly.
- Check that motor calibration and revolution counters are updated and correct.
- Check that the synchronization position in the safety configuration is correct.
- Check for configuration error.
- Download motor calibration values.
- Check if axis 4 or 6 is configured as independent, if YES, check that the EPS configuration is configured likewise.

90454, SC *arg* Servo-Lag Limit exceeded

Description

Safety Controller (SC) *arg* detected a too big difference between the ordered and actual position, for mechanical unit *arg* on axis *arg*.

Recommended actions

- Check for collision.
- If using external axis, check Servo Lag settings in the safety configuration.

Continues on next page

- If using Soft Servo, Check that the Operational Safety Range (OSR) Tolerance in the safety configuration is not set too low.
- Verify that revolution counters are updated.
- Check for communication problems to the main computer, axis computer or the serial measurement board.
- Check if tool weight is correctly defined.

90455, SC arg Incorrect Position Value

Description

Incorrect position value from serial measurement board detected by Safety Controller (SC) *arg* on mechanical unit *arg*.

Recommended actions

- Check resolver and resolver connections.
- Replace serial measurement board.
- Replace resolver.

90456, SC arg Reference Data Timeout

Description

The robot controller has stopped sending reference data to Safety Controller (SC) *arg*.

Recommended actions

- 1) Check previous error logs for possible causes.
- 2) Restart the robot controller.

90457, SC arg Changed safety configuration

Description

The safety configuration for Safety Controller (SC) *arg* has changed contents or doesn't fit with the used hardware.

Probable causes

- New safety configuration has been downloaded, the normal case.
- The configuration doesn't fit with the used hardware. Typically when the event message with request for new pin code is repeated.
- Corrupt safety configuration. Typically when the event message with request for new pin code is repeated.

Recommended actions

- 1) Check for new event messages that indicates if a new safety configuration has been downloaded.
- 2) If no new safety configuration has been downloaded and this event message comes after a restart, download a new safety configuration to the Safety Controller.
- 3) Create and download a new safety configuration if this event message comes after every restart and there is a request for new pin code again.

90458, SC *arg* Internal Failure

Description

Internal Failure in Safety Controller (SC) *arg*.

Recommended actions

- Check Safety Controller cabling.
- Check Safety Controller health on LED.
- Replace Safety Controller if remaining error.

90459, SC *arg* Input/Output Failure

Description

I/O Error on Safety Controller (SC) *arg*.

Recommended actions

- Check Safety Controller cabling.
- Check Safety Controller health.

Restart robot controller, after performing recommended actions.

90460, SC *arg* safety configuration not found

Description

Failed to retrieve safety configuration for Safety Controller (SC) *arg*.

Recommended actions

- Restart robot controller.
- Download a safety configuration to the SC.
- Reinstall system.

90461, SC *arg* Robot Configuration not found

Description

Failed to retrieve robot configuration for Safety Controller (SC) *arg*.

Recommended actions

- Restart robot controller.
- Reinstall system.

90462, SC *arg* Calibration Offset not found

Description

Failed to retrieve motor calibration offsets for Safety Controller (SC) *arg*.

Recommended actions

Download new calibration offsets to the SC.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

90463, SC *arg* safety configuration downloaded

Description

Download of safety configuration was successful for Safety Controller (SC) *arg*.

3) Tool speed.

4) Additional axis speed.

Recommended actions

Reduce tool speed.

90464, SC *arg* OSR Limit exceeded

Description

Safety Controller (SC) *arg* detected a too big difference between the ordered and actual position inside Operational Safety Range (OSR), for mechanical unit *arg* on axis *arg*.

Recommended actions

- Check for collision.
- Check that Operational Safety Range (OSR) Tolerance in the safety configuration is not set too low.
- Synchronize the Safety Controller, if the revolution counters have been updated since last synchronization.

90468, SC *arg* STZ violation

Description

Safe Tool Zone (STZ) *arg* is violated on mechanical unit *arg*. Tool *arg* was active.

Cause *arg*.

Probable causes

- 1) Exceeded speed.
- 2) Wrong tool position.
- 3) Wrong tool orientation.
- 4) Wrong elbow position.
- 11) Wrong tool point 1 position.
- 12) Wrong tool point 2 position.
- 13) Wrong tool point 3 position.
- 14) Wrong tool point 4 position.
- 15) Wrong tool point 5 position.
- 16) Wrong tool point 6 position.
- 17) Wrong tool point 7 position.
- 18) Wrong tool point 8 position.

Recommended actions

- Reduce speed.
- Move robot tool to safe position.
- Adjust tool orientation.

90465, SC *arg* SAS Speed exceeded

Description

Safe Axis Speed (SAS) violation on mechanical unit *arg* axis *arg* on Safety Controller (SC).

Recommended actions

Decrease speed on axis *arg*.

90469, SC *arg* SAR violation

Description

Safe Axis Range (SAR) *arg* is violated on mechanical unit *arg* axis *arg*.

Recommended actions

Move mechanical unit to safe position.

90466, SC *arg* Input/Output Failure

Description

I/O Error on Safety Controller (SC) *arg* I/O *arg* Type *arg*.

Type 1: Input.

Type 2: Output.

Probable causes

- Wrong connection to I/O terminals on SC.
- Two channel I/O mismatch.

Recommended actions

- Check SC cabling.
- Check SC health.

Restart robot controller, after performing recommended actions.

90467, SC *arg* STS speed exceeded

Description

Safe reduced Tool Speed (STS) in Safety Controller (SC) on mechanical unit *arg* too high. Cause *arg*.

Description

Synchronization required for mechanical units supervised by Safety Controller (SC) *arg* in less than *arg* hour(s).

Recommended actions

Perform synchronization before the time limit expires.

Probable causes

- 1) Tool0 speed.
- 2) Elbow speed.

Continues on next page

90471, SC arg Synchronization Timeout

Description

Synchronization time limit expired for Safety Controller (SC) *arg*. Last synchronization was *arg* hours ago.

Recommended actions

Perform synchronization.

90472, SC arg New safety configuration

Description

Safety Controller (SC) *arg* has received a new safety configuration. A new PIN-code is needed to activate.

Recommended actions

- 1) Log in as a user with safety configuration grants.
- 2) Enter new PIN-Code for the Safety Controller in the Control Panel.

90473, SC arg Dual Computer mismatch

Description

Safety Controller (SC) *arg* have had conflicting values for a Safety Output for too long.

Consequences

The Safety Controller has entered a Safe State and issue an error after 10 minutes of internal mismatch, if recommended actions are not performed.

Probable causes

- The mechanical unit have been parked at a position on, or close to, a supervised or monitored function limit for too long time.
- Internal computation error in Safety Controller.

Recommended actions

Move all mechanical units' axes and tools well inside or outside monitored and supervised function limits.

90474, SC arg I/O Supply Failure

Description

I/O supply voltage level for Safety Controller (SC) *arg* is out of range.

Probable causes

Either the voltage is out of limits or the voltage is missing.

Recommended actions

- 1) Connect 24V supply with correct voltage level to I/O supply terminals.
- 2) Restart robot controller.

90475, SC arg Synchronization rejected

Description

Safety Controller (SC) *arg* is not correctly configured for synchronization.

Probable causes

- Safety configuration PIN is not set or is incorrect.
- Safety configuration is empty.
- Safety configuration is corrupt or missing.
- Safety Controller connected to the wrong SMB bus.
- I/O power supply missing.

Recommended actions

Verify and check possible causes.

90476, SC arg Disabled

Description

Safety Controller (SC) *arg* is disabled.

Consequences

All safety supervision has been disabled in the Safety Controller.

Risk for safety hazards.

Recommended actions

Download a safety configuration to the Safety Controller.

90477, SC arg SMB Communication Failure

Description

Safety Controller (SC) *arg* failed to communicate with serial measurement board (SMB).

Recommended actions

- 1) Make sure that the cabling from SMB to Safety Controller is connected to the right SMB connector and functional.
- 2) Restart the robot controller.

90478, SC arg Main Supply Failure

Description

The main power supply voltage for Safety Controller (SC) *arg* is out of range.

Probable causes

Either the voltage is out of limit or the voltage is missing.

Recommended actions

- 1) Check Safety Controller cabling.
- 2) Check voltage from power supply.
- 3) Restart robot controller.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

90479, SC *arg* Additional Axis missing

Description

An additional axis that is supervised by Safety Controller (SC) *arg* is no longer present in the system configuration.

Recommended actions

Reinstall the supervised additional axis, or download a safety configuration without supervision of the additional axis.

90480, SC *arg* SST violation

Description

Safe Stand Still (SST) *arg* in Safety Controller (SC) is violated on mechanical unit *arg* axis *arg*.

Recommended actions

- Verify RAPID program.
- Verify process equipment.
- Check that movement is not ongoing when SST is active.
- Check previous event messages.

90481, SC *arg* OVR active

Description

Override Operation (OVR) active on Safety Controller (SC) *arg*. SafeMove will stop the robot after approximately 20 minutes with OVR active.

Speed is limited to 250 mm/s or 18 degrees/s.

Recommended actions

Deactivate signal connected to OVR input.

90482, SC *arg* OVR time out

Description

Override Operation (OVR) has been active too long time on Safety Controller (SC) *arg*.

Recommended actions

- 1) Restart robot controller.
- 2) Toggle signal connected to OVR input.
- 3) Activate Confirm stop by pressing Motors On push button.
- 4) Jog robot back into working area.
- 5) Deactivate signal connected to OVR input.

90483, SC *arg* CBC soon required

Description

Cyclic Brake Check (CBC) required in less than *arg* hours.

Recommended actions

Perform a brake check before the time limit expires.

90484, SC *arg* CBC needs to be done

Description

Cyclic Brake Check (CBC) time limit expired in Safety Controller (SC) or last brake check failed.

Recommended actions

Perform a brake check.

90485, SC *arg* Too low brake torque

Description

Too low brake torque in Safety Controller (SC) on mechanical unit *arg* axis *arg*.

Probable causes

- Axis has not been tested.
- Worn out brake(s).

Recommended actions

- Check that the failing axis is activated.
- If failing axis is activated replace brake(s) as soon as possible.

90486, SC *arg* CBC interrupted or incorrect

Description

Safety Controller (SC) has detected that the last Cyclic Brake Check (CBC) on mechanical unit *arg* was interrupted or incorrect.

Recommended actions

- Check previous event messages.
- Perform a new brake check only if needed, typically if event message 20485 also has been displayed.

90487, SC *arg* Unsynchronized speed exceeded

Description

Exceeded axis speed when Safety Controller (SC) *arg* was unsynchronized.

Recommended actions

Jog mechanical unit to synch position with low axis speed.
Reduce speed to 250 mm/s or 18 degrees/s.

90488, SC *arg* Unsynchronized time limit expired

Description

Available time to move the robot when unsynchronized has expired for Safety Controller (SC) *arg*.

Recommended actions

- 1) Do a Confirm stop by pressing the Motors ON push button or activate system input.

Continues on next page

2) Synchronize SC arg.

90489, SC arg has been disabled

Description

Safety Controller (SC) arg has been disabled and no supervision functions are active.

Probable causes

Either a system reset has been performed or it's the first startup of SC.

Recommended actions

Download a configuration to SC arg.

a stop1 is to slow. Check for other safety controller event messages.

Recommended actions

- Change parameter value for SBR in Motion configuration.
- Trigger a new stop to test the Brake Ramp.
- If this happens frequently, check the Application manual for mechanical units' configuration.

90494, SC arg Tool change incorrect

Description

Incorrect tool change with Tool arg on mechanical unit arg.

Recommended actions

- Check if correct tool.
- Decrease speed if needed.
- Perform a new tool change.

90500, Safety Controller Internal Failure

Description

An internal Failure has occurred in the safety controller.

Consequences

The safety controller will go into safe state. No operation will be possible until restart.

Recommended actions

- Check other error messages arriving at the same time for cause of the error.
- Check the safety controller configuration and installation.

90491, SC arg Override active during startup

Description

Override digital input was active during startup on SC arg.

90492, SC arg SST violation in Brake test

Description

Movement detected during Brake test on Safety Controller (SC) arg. Mechanical unit arg. Axis arg.

Probable causes

- Interrupted braketest.
- Worn out Brakes.

Recommended actions

- Restart CBC.
- Replace Brake.

90501, Safety Controller Reference Data Error

Description

The robot controller has stopped sending reference data to the safety controller for drive module arg.

Consequences

The safety controller will stop all robot movements.

Recommended actions

Restart the program. If the problem persists, restart the system.

90493, SC arg SBR triggered

Description

Safe Brake Ramp (SBR) on Safety Controller (SC) was interrupted by a Class 0 stop due to slow deceleration on mechanical unit arg. This is normal and occurs in cases when

90502, Safety Controller SMB Communication Failure

Description

The safety controller for drive module arg failed to communicate with the serial measurement board (SMB).

Consequences

The safety controller will stop all robot movements.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Probable causes

- Errors in the configuration of external axes.
- Disturbances in the communication links between the SMB, the robot controller, and the safety controller.

Recommended actions

- Check the configuration of external axes.
- Check the cabling from the axis computer to the main computer for possible disturbances.

90503, Safety Controller Illegal Position Value

Description

An illegal position value from the serial measurement board was detected by the safety controller (for drive module *arg*). The cause was *arg*.

Consequences

The safety controller will stop all robot movements.

Probable causes

- 1) The square sum of the measured positions exceeded the configured max.
- 2) The square sum of the measured positions was below the configured minimum value.
- 3) Too high acceleration was detected in the resolver input.

Recommended actions

- Check the configured square sum limits in the safety configuration.
- Check the cabling to the serial measurement board and resolvers.

90504, Safety Controller not synchronized

Description

The safety controller for drive module *arg* is not synchronized with supervised mechanical units.

Probable causes

- The robot has been moved while the power was off.
- An error has occurred in the communication with the serial measurement board (SMB).
- There is a mismatch between the calibration position parameters in the robot controller and the safety configuration.

Recommended actions

- Perform a new synchronization of the safety controller.

90505, Safety Controller Synchronization rejected

Description

The synchronization of Safety Controller drive module *arg* failed.

Continues on next page

Consequences

The safety controller will remain in the unsynchronized state.

Probable causes

- One or more axes moved during synchronization.
- The synchronization was not performed within the timeout limit.

Recommended actions

Make sure that the speed during synchronization is within limits, and perform a new synchronization of the safety controller.

90506, Safety Controller Wrong Sync Position

Description

The axis *arg* position does not match its synchronization position, as defined in the safety configuration for the safety controller on drive module *arg*.

Consequences

Synchronization will not be performed, and the safety controller will go to the unsynchronized state.

Probable causes

- One or more axes are not in the correct synchronization position.
- The revolution counters or calibration values of the robot controller are not correct.

Recommended actions

- Check that the synchronization positions in the safety configuration are correct, and that all axes are in their synchronization position.
- Perform revolution counter update or calibration in the correct position, followed by a new synchronization of the safety controller.
- Check that the synchronization switch is working properly.

90507, Safety Controller Synchronized

Description

The safety controller for drive module *arg* is now synchronized to supervised mechanical units.

Consequences

Safety supervision can be used.

90508, Safety Controller Tool Change Incorrect

Description

Incorrect tool change, in the safety controller for drive module *arg*.

The cause was *arg*.

Consequences

The safety controller will stop all robot movements. Operation is not possible until a valid tool has been selected.

Probable causes

- 1) Invalid tool selection input.
- 2) Very high speed was detected during the tool change.

Recommended actions

Check that exactly one tool selection input is active.

90509, Safety Controller Brake Ramp supervision triggered

Description

Too slow deceleration was detected during a Category 1 stop, in the safety controller for drive module *arg*.

Consequences

The Category 1 stop is automatically changed to a Category 0 stop.

Recommended actions

Usually, no actions are necessary. If this happens frequently, check the Application manual for mechanical units' configuration. For external axes, change the parameter value for Brake ramp in the safety configuration.

90511, Safety Controller Servo-Lag Limit exceeded

Description

The safety controller for drive module *arg* has detected a too big difference between the ordered and actual position on axis *arg*.

Consequences

The safety controller will stop all robot movements.

Probable causes

- A collision has occurred.
- Incorrect load definition in the robot program.
- Incorrect configuration of external axes.
- A function has been activated that result in greater servo lag, such as soft servo or force control.

Recommended actions

- If there was a collision, check the robot and perform a new synchronization if required.
- Make sure that the robot load is defined correctly.
- Check the Servo Lag settings in the safety configuration for the external axis.

- Check that Contact Application Tolerance is activated correctly.

- Check that the safety controller is synchronized correctly.

90512, SC Contact Application Tolerance servo lag exceeded

Description

The safety controller for drive module *arg* detected a too big difference between the ordered and actual position for axis *arg*, while inside Safety Area *arg*.

Consequences

The safety controller will stop all robot movements.

Probable causes

The robot has moved too far from the path, due to external forces or programmed compliance (soft servo or force control).

Recommended actions

- Decrease the compliance, or limit the external forces on the axis.
- Increase the Contact Application Tolerance position tolerance in the safety configuration.

90513, Tool Position supervision violation

Description

Tool position supervision *arg* caused a violation of zone *arg* in drive module *arg*. Tool *arg* was active and geometry *arg* caused the violation.

Consequences

If configured with a stop action, the safety controller will stop all robot movements, and no operation will be allowed until the violation has ceased or manual mode has been selected.

Probable causes

The tool geometry entered a forbidden region.

Recommended actions

Switch to manual mode, and jog the robot out of the violation.

90514, Safety Controller Standstill violation

Description

Standstill supervision *arg* in the safety controller for drive module *arg* is violated for axis *arg*.

Consequences

If configured with a stop action, the safety controller will stop all robot movements.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Probable causes

An attempt to move the robot has been done while Standstill supervision was active.

Recommended actions

- Make sure that no supervised axis is moving while Standstill supervision is active.
- Increase the Tolerance parameter for the axis, in the configuration for Standstill supervision.

3) Wrist.

4) Axis *arg.*

Recommended actions

- Check that the correct tool is selected in the safety controller, matching the tool definition used for jogging or program execution.
- Check that the configured manual mode speed in the safety controller matches the value in the robot controller configuration.
- If a Cyclic Brake Check was not performed within the specified time interval, perform a new brake check.

90515, Safety Controller Tool Speed violation

Description

Tool Speed supervision *arg* was violated in the safety controller for drive module *arg*.

The cause was *arg*.

Consequences

If configured with a stop action, the safety controller will stop all robot movements.

Probable causes

- 1) TCP speed too high.
- 2) Elbow speed too high.
- 3) Tool speed at point 1 too high.
- 4) Tool speed at point 2 too high.
- 5) Tool speed at point 3 too high.
- 6) Tool speed at point 4 too high.
- 7) Tool speed at point 5 too high.
- 8) Tool speed at point 6 too high.
- 9) Tool speed at point 7 too high.
- 10) Tool speed at point 8 too high.
- 11) Robot wrist speed too high.
- 12) TCP speed too low.

Recommended actions

Modify the program so that all speeds are inside the configured limits.

90517, Safety Controller Unsynchronized speed exceeded

Description

The unsynchronized mode speed limit was exceeded in the safety controller for drive module *arg*.

Consequences

The safety controller will stop all robot movements.

Probable causes

One or more mechanical units exceeded the unsynchronized mode speed limit.

Recommended actions

Jog all axes slowly to the synchronization position, and perform a synchronization of the safety controller.

90518, Safety Controller Emergency Stop triggered

Description

Emergency Stop *arg* has been triggered in the safety controller.

Consequences

The safety controller will stop all robot movements.

Probable causes

An emergency stop request has been received by the safety controller.

Recommended actions

Deactivate the emergency stop and restart the program.

90516, Safety Controller Reduced Speed violation

Description

The reduced speed limit was exceeded in the safety controller for drive module *arg*.

Consequences

The safety controller will stop all robot movements.

Probable causes

One or more mechanical units exceeded the reduced speed limit. The type of speed violation was *arg*.

1) TCP.

2) Elbow.

90519, Safety Controller Input/Output Mismatch

Description

Different inputs/outputs reported by the two channels in the safety controller for drive module *arg*. The mismatch type was *arg*.

Type 1: Input.

Continues on next page

Type 2: Output.

Consequences

The safety controller will stop all robot movements. No full speed operation is possible until the mismatch has ceased.

Probable causes

- Error in the cabling to the safety controller.
- Dual channel mismatch in the safety supervision, due to limited numerical accuracy.

Recommended actions

- Check the safety controller cabling.
- Check if one or more axes, points, or volumes are close to a zone or range border.

90520, Safety Controller Result Mismatch

Description

Different supervision results reported for the two channels in the safety controller for drive module *arg*.

Consequences

The safety controller will stop all robot movements. No full speed operation is possible until the mismatch has ceased.

Probable causes

One or more axes, points, or volumes are close to a zone or range border.

Recommended actions

In manual mode, jog away from the zone or range border.

90521, Safety Controller Brake Test violation

Description

Movement detected during Brake test for drive module *arg*, axis *arg*.

Probable causes

The brake test failed or was interrupted.

Recommended actions

- Perform a new brake test. If the problem persists, replace the brake.

90522, Safety Controller External power supply error

Description

Incorrect feedback from the external power supply contactors was detected by the safety controller.

Consequences

The safety controller will deactivate the external power supply.

Probable causes

The contactors or the cable harness may be defect.

Recommended actions

Check the connections to the external power supply.

90523, Safety Controller Protective Stop triggered

Description

Protective Stop *arg* has been triggered in the safety controller.

Consequences

The safety controller will stop all robot movements.

Probable causes

A protective stop request has been received by the safety controller.

Recommended actions

Deactivate the protective stop and restart the program.

90524, Safety Controller configuration error

Description

The Safety Controller failed to load the safety configuration file *arg*.

Consequences

The safety controller will stop all robot movements.

Probable causes

An invalid safety configuration has been loaded.

Recommended actions

Create and load a new safety configuration using the configurator.

90525, Operation in current mode not allowed by Safety Controller

Description

The safety controller does not allow operation in the operating mode selected in drive module *arg*.

Consequences

The safety controller will stop all robot movements.

Probable causes

- Automatic operating mode was selected while commissioning mode was active.
- Automatic or Manual Full Speed operating mode was selected while the safety controller was unsynchronized.

Recommended actions

Switch to manual mode to resume operation.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

90526, Safety Controller Automatic Mode Warning

Description

The active safety controller configuration has not been locked.

90527, Safety Controller difference in revolution counters

Description

An error was detected in the position data for drive module *arg*.

Consequences

The safety controller will stop all robot movements.

Recommended actions

Perform a new synchronization of the safety controller.

90528, Safety Controller Tool Orientation violation

Description

Tool Orientation supervision *arg* was violated in the safety controller for drive module *arg*. Tool *arg* was active.

Consequences

If configured with a stop action, the safety controller will stop all robot movements.

Probable causes

The orientation of the tool was outside the configured bounds while Tool Orientation supervision was active.

Recommended actions

Switch to manual mode, and jog the robot so that the tool orientation does not violate the configured bounds.

90529, Safety Controller axis Position violation

Description

Axis position supervision *arg* in the safety controller for drive module *arg* was violated for axis *arg*.

Consequences

If configured with a stop action, the safety controller will stop all robot movements.

Probable causes

The position of one or more axes were outside the configured bounds while axis position supervision was active.

Recommended actions

Switch to manual mode, and jog the robot to a position inside configured bounds.

90530, Safety Controller Axis Speed violation

Description

Axis Speed supervision *arg* in the safety controller for drive module *arg* was violated for axis *arg*. The cause was *arg*.

Consequences

If configured with a stop action, the safety controller will stop all robot movements.

Probable causes

- 1) Axis speed too high.
- 2) Axis speed too low.

Recommended actions

Modify the program, ensuring that all axis speeds are inside the configured limits.

90531, Cyclic Brake Check needs to be done

Description

Cyclic Brake Check (CBC) time limit expired in Safety Controller (SC) *arg* or last brake check failed.

Recommended actions

Perform a brake check.

90532, Max allowed speed during Cyclic Brake Check exceeded

Description

The maximum speed limit, 250 mm/s, during Cyclic Brake Check was exceeded in Safety Controller (SC) *arg*.

Probable causes

- The maximum allowed speed limit exceeded.

Recommended actions

- Perform a new brake check and run with a speed lower than 250 mm/s.

90533, Cyclic Brake Check will be required soon

Description

Cyclic Brake Check (CBC) required in *arg* hours.

Recommended actions

Perform a brake check before the time limit expires.

90534, Cyclic Brake Check interrupted or incorrect

Description

Safety Controller (SC) *arg* has detected that the last Cyclic Brake Check (CBC) was interrupted or incorrect.

Continues on next page

Recommended actions

- Check previous event messages.
- Perform a new brake check only if needed.

90535, Tool Position supervision violation, arm

Description

Tool position supervision *arg* caused a violation of zone *arg* in drive module *arg*. The violation was caused by geometry *arg* on the robot arm.

Consequences

If configured with a stop action, the safety controller will stop all robot movements, and no operation will be allowed until the violation has ceased or manual mode has been selected.

Recommended actions

Switch to manual mode, and jog the robot out of the violation.

90536, External power supply activated while in error mode

Description

The external power supply was activated while the feedback from the external power supply contactors was incorrect.

Consequences

The external supply output will remain in its old state.

Recommended actions

Check the connections to the external power supply.

90537, Missing Sync-request

Description

The synchronization switch is pressed without a synchronization request being sent to the Safety Controller.

Consequences

No synchronization will be done.

Recommended actions

Send a synchronization request to the Safety Controller before pressing the sync-switch.

90538, Safety Enable input not set

Description

The SafetyEnable input to the Safety Controller is not set.

Consequences

The system goes to the Superior Stop status.

Probable causes

- Errors in the safe communication.

- Errors in the Safe IO configuration of the safety controller.

Recommended actions

- Check that the safe communication is working correctly.
- Check the Safe IO configuration of the safety controller.

90539, Drive module without safety supervision

Description

The safety configuration contains one or more drive modules with no mechanical units defined.

Consequences

No safety supervision will be done for the corresponding drive modules.

90540, Only manual mode allowed

Description

The safety controller only allows operation in Manual mode, because of an error in the safety configuration or lock information.

Consequences

The safety controller will stop all robot movements.

Probable causes

An error in the safety configuration or lock information has previously been reported. Until this has been corrected, operation is only allowed in Manual mode.

Recommended actions

- Switch to Manual mode to resume operation.
- Correct the error in the configuration or lock information.

90541, Superior Stop opened by the Safety Controller

Description

The Superior Mode Safeguarded Stop circuit has been opened by the safety controller.

Consequences

The system goes to the Superior Stop status.

Probable causes

- One or more safety supervision functions has detected an active violation.
- Error in the safety controller cabling.

Recommended actions

- Check the event log for active safety function violations, and take the recommended actions to remove the violations.
- Check the safety controller cabling.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

90600, Invalid SiosCfg tag

Description

The SiosCfg tag on line *arg* is invalid.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90601, Version attribute not found

Description

The SiosCfg version attribute is missing on line *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Add the version attribute to the safety configuration file.

90604, Tag/Attribute is empty or contains invalid character(s)

Description

Tag/attribute *arg*, found on line *arg*, is empty or contains invalid character(s).

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90605, Net name attribute is missing

Description

The net name attribute on line *arg* is missing.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90606, Invalid net name

Description

The net name *arg* is invalid. Valid names are *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90603, Unsupported XML tag in safety configuration file

Description

XML tag *arg*, found on line *arg*, is unknown.

Consequences

The system will stop all robot movements.

Continues on next page

90607, Net already exists

Description

The net *arg*, specified on line *arg* has already been specified.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

Recommended actions

Update the safety configuration.

90608, Could not create network instance

Description

Could not create network *arg* instance. It already exists.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90611, Device create failed

Description

Device *arg* failed. The device already exists.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90609, Device attribute is missing

Description

Device *arg* attribute *arg* is missing on line *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90612, Device attribute insize is invalid

Description

Device *arg* attribute insize is empty or not a number.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90610, Device already exists

Description

Device *arg* on line *arg* already exists.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90614, Could not attach device to net

Description

Attaching device *arg* to net *arg* failed because the device is already attached to net *arg*.

Consequences

The system will stop all robot movements.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90615, Could not attach device to net

Description

Attaching device arg to net arg failed.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90616, Could not find device

Description

Could not find device arg.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90617, Device attribute is missing

Description

Device arg attribute arg is missing on line arg.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90618, Device attribute is invalid

Description

Device arg attribute arg is invalid on line arg.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90619, Device attribute is invalid

Description

Device arg attribute arg is invalid.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90620, Could not create device module

Description

Could not create device arg module.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90621, Signal width invalid in device mapping

Description

Device arg signal arg width is invalid.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

Continues on next page

90622, Signal offset invalid in device mapping

Description

Device *arg* signal *arg* offset is invalid.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

Recommended actions

Update the safety configuration.

90626, Signal name is missing

Description

Signal name is missing on line *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90623, Signal direction invalid in device mapping

Description

Device *arg* signal *arg* direction is invalid.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90627, Signal attribute is missing

Description

Signal *arg* attribute *arg* is missing.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90624, Could not find signal

Description

Could not attach signal *arg*to device *arg*. Signal is missing.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90628, Signal type is unknown

Description

Signal *arg* type *arg* is unknown on line *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90625, Could not find device

Description

Could not attach signal *arg*to device *arg*. Device is missing.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

90629, Signal attribute invalid in this context

Description

Signal *arg* attribute *arg* is only valid when mapping to a device.
Line *arg*.

Consequences

The system will stop all robot movements.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90630, Signal default value empty or out of range

Description

Signal *arg* default value is empty or out of range to the signal type.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90631, Signal type is invalid

Description

Signal *arg* type is invalid.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90632, Could not set signal value

Description

Could not set signal *arg* value.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90633, Signal create failed

Description

Signal *arg* already exists.

Continues on next page

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90634, Signal configuration conflict

Description

Signal *arg* configuration on line *arg* conflicts with previous declaration.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90635, Signal input already assigned

Description

Signal *arg* is already assigned to receive input from device *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90636, Signal value has already been set

Description

Signal *arg* input mapping failed. Signal value has already been set by *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90637, Signal mapped outside of device I/O area

Description

Signal *arg* mapping to device *arg* failed. Device I/O size is *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90638, Signal overlaps other signal

Description

Signal *arg* output mapping to device *arg* failed. Bits already mapped.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90641, FuncIO attribute is missing

Description

FuncIO *arg* attribute *arg* is missing on line *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90639, Signal type does not match value type

Description

Signal *arg* type *arg* does not match value type *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90642, Error parsing the safety configuration file

Description

FuncIO *arg* on line *arg* is already mapped to signal *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90643, FuncIO signal not found

Description

Mapping of FuncIO *arg* to device *arg* on line *arg* failed because the FuncIOMapping mapping has not been specified.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90640, FuncIO name is missing

Description

The name of FuncIO on line *arg* is missing.

Consequences

The system will stop all robot movements.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

90644, FuncIOMapping already exists

Description

Mapping of FuncIO *arg* to signal *arg* failed because a mapping has already been specified.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90646, FuncIOMapping attribute missing

Description

FuncIOMapping *arg* attribute *arg* is missing on line *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90648, FuncIOMapping signal does not exist

Description

FuncIOMapping *arg* to signal *arg* on line *arg* failed because the signal does not exist.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90649, FuncIOMapping failed

Description

FuncIOMapping *arg* to signal *arg* on line *arg* failed because the mapping has already been assigned to signal *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90650, Unexpected bitwidth mismatch

Description

Unexpected bitwidth *arg* when *arg* device *arg* *arg* from signal *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90651, Unexpected data size during import

Description

The target buffer size when importing from device *arg* does not match device input area size.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90652, Unexpected data size during export

Description

The data size when exporting to device *arg* does not match device output area size.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

Continues on next page

90653, The version of the sc_cfg file is not supported**Description**

The version of the sc_cfg file is not supported.

Consequences

The system will stop all robot movements.

Probable causes

Restore from an unsupported safety configuration.

Recommended actions

Update the safety configuration.

90655, Invalid value of the encoding attribute**Description**

Device arg signal arg map encoding is invalid.

Consequences

The system will stop all robot movements.

Probable causes

RobotStudio version is too old to handle the expected version.

Recommended actions

Update RobotStudio.

Update the safety configuration.

90660, FuncIO information missing**Description**

Could not set signal value for FuncIO arg.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90661, FuncIO signal could not be set**Description**

Could not set signal value for FuncIO arg.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90662, FuncIO signal not found**Description**

Could not find signal for FuncIO arg.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90663, Unstable Operating Mode selector input**Description**

Unstable input signals from the Operating Mode selector.

Consequences

The system will stop all robot movements.

Recommended actions

Switch back to previous operating mode and try again. If the problem persists, restart the system.

90664, FuncIOMappings dependency failed**Description**

FuncIOMappings for FuncIO arg has dependency to FuncIO arg.

If the first FuncIO is needed then the second FuncIO must also be specified.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90665, New safety configuration accepted**Description**

The safety configuration was successfully updated.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

90666, Safety Controller configuration version not supported

Description

The safety controller configuration version is not supported by the software in the safety controller.

Consequences

The system will stop all robot movements.

Probable causes

- 1) The safety controller configuration version is too new.
- 2) The safety controller software is too old.

Recommended actions

- 1) Downgrade the safety controller configuration version.
- 2) Upgrade the safety controller software.

90667, MC option does not match SC configuration file

Description

The installed Robotware option(s) do(es) not match the contents of the safety controller configuration file.

Consequences

The system will stop all robot movements.

Probable causes

The MC option for the Operating Mode Selector type has been modified.

Recommended actions

Reset the safety controller to factory settings and create a new safety configuration.

90668, Emergency Stop Status input could not be tested

Description

Emergency Stop Status input could not be tested because emergency stop circuit is broken.

Consequences

The system remains in the Emergency Stop status.

Probable causes

- 1) An emergency stop button has been pressed.
- 2) The cable to the safety controller is not connected.

Recommended actions

- 1) Reset the emergency stop button triggering the stop.
- 2) Attach the cable to the safety controller.

90669, Drive Enable Feedback is open

Description

The Drive Enable Feedback input to the safety controller is open.

Consequences

The system will stop all robot movements in automatic mode.

Probable causes

- 1) The Drive Enable Feedback signal is open.
- 2) The cable to the safety controller is not connected.

Recommended actions

- 1) Make sure the Drive Enable Feedback signal is closed.
- 2) Attach the cable to the safety controller.

90681, CL version attribute is missing

Description

The version attribute is missing in the CL configuration.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90682, CL version is invalid

Description

The safety configuration contains an unsupported version *arg* for the CL configuration on line *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90683, Invalid safety configuration item

Description

The safety configuration contains an invalid configuration item "arg" on line *arg*.

Consequences

The system will stop all robot movements.

Continues on next page

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90684, Safety configuration item/Attribute is invalid**Description**

Configuration item/attribute *arg*, found on line *arg*, is empty or contains invalid character(s).

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90685, More than one configuration item found**Description**

Duplicate safety configuration item "arg" found on line *arg*.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90686, Safety configuration item missing**Description**

Configuration item "arg" is missing in the safety configuration.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90687, Safety configuration item attribute missing**Description**

Configuration item "arg" missing on line "arg".

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90688, Too many configuration items specified**Description**

The Safety CL configuration contains too many "arg" items on line "arg".

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90689, Too few configuration items specified**Description**

The Safety CL configuration contains too few "arg" items on line "arg".

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90690, CL operator or operation already exists**Description**

The Safety CL configuration contains a duplicate item *arg* on line *arg*.

Consequences

The system will stop all robot movements.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90691, Actuator/resultant name already used

Description

Actuator/resultant name *arg* on line *arg* has already been specified.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90692, The specified signal does not exist

Description

Signal "*arg*", specified on line *arg*, is not defined in the safety configuration.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90693, Unknown signal type

Description

The signal type "*arg*", specified on line *arg*, is unknown.

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90694, Signal types differ

Description

The operation signal type "*arg*" differs from the operator signal type "*arg*" on line "*arg*".

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90695, Operator name is unknown

Description

Unknown operator name "*arg*" is specified for operation "*arg*" on line "*arg*".

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90696, Actuator/Resultant numbers differ

Description

Operation "*arg*": The number of "*arg*" differs from its operator "*arg*" count on line "*arg*".

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90697, Operation actuator/resultant not found

Description

Operation actuator or resultant "*arg*" does not have a corresponding operator actuator/resultant on line "*arg*".

Consequences

The system will stop all robot movements.

Continues on next page

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90698, Operator type is unknown**Description**

Unknown operator type "arg" is specified for operator "arg" on line "arg".

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90699, Configured operator signal type is not supported**Description**

Specified actuator/resultant "arg" type of the operator "arg" is not supported. Line number "arg".

Consequences

The system will stop all robot movements.

Probable causes

The safety configuration has not been created using RobotStudio.

Recommended actions

Update the safety configuration.

90700, arg initialization error**Description**

The Safety Network Controller arg failed to initialize.

Consequences

The system will stop all robot movements.

Probable causes

Internal error.

Recommended actions

Check for other event messages. Restart the robot controller.

90701, arg stop failed**Description**

The Safety Network Controller arg was unable to stop.

Consequences

The system will stop all robot movements. Communication with the network is not possible.

Probable causes

Internal error.

Recommended actions

Check for other event messages. Restart the robot controller.

90702, arg start failed**Description**

The Safety Network Controller arg was unable to start.

Consequences

The system will stop all robot movements. Communication with the network is not possible.

Probable causes

Internal error.

Recommended actions

Check for other event messages. Restart the robot controller.

90703, arg read failed**Description**

The Safety Network Controller arg was unable to read data from the network.

Consequences

The system will stop all robot movements. Communication with the network is not possible.

Probable causes

Network partner is unavailable. Cabling error.

Recommended actions

Check cables. Check for other event messages. Restart the robot controller.

90704, arg write failed**Description**

The Safety Network Controller arg was unable to write data to the network.

Consequences

The system will stop all robot movements. Communication with the network is not possible.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

Probable causes

Network partner is unavailable. Cabling error.

Recommended actions

Check cables. Check for other event messages. Restart the robot controller.

90705, arg sync failed

Description

The Safety Network Controller *arg* was unable to sync between CPUs.

Consequences

The system will stop all robot movements.

Probable causes

Internal error.

Recommended actions

Check for other event messages. Restart the robot controller.

90707, arg initialization failed

Description

The Safety Network Controller *arg* was unable to initialize communication with the robot controller.

Consequences

The system will stop all robot movements.

Probable causes

Internal error.

Recommended actions

Check for other event messages. Restart the robot controller.

90780, Two-channel fault in Safety Controller

Description

Two-Channel fault for Safety Controller GPIO input *arg*: *arg* != *arg*.

Consequences

The system will stop all robot movements.

Probable causes

- 1) Cable fault.
- 2) Signaling error.

Recommended actions

Check cables to the Safety Controller. Restart the robot controller.

90781, Safe Local I/O GPIO input is unstable

Description

arg SNC: GPIO input *arg* is unstable.

This is a warning only.

Probable causes

- 1) Cable fault.
- 2) Signaling error.

Recommended actions

- 1) Check cables to the Safety Controller.
- 2) Verify that the indicated signal to the Safety Controller is stable.

90790, arg setup failed

Description

The *arg* was unable to setup properly.

Consequences

arg is not running.

Probable causes

No communication with the PROFIsafe host. Bad parameter values.

Recommended actions

Check parameters and connection to the PROFIsafe host. Try again.

90791, arg start failed

Description

The *arg* was unable to start.

Consequences

arg is not running.

Probable causes

No communication with the PROFIsafe host. Bad parameter values.

Recommended actions

Check parameters and connection to the PROFIsafe host. Try again.

90792, arg fail-safe activated

Description

The *arg* has activated fail-safe values.

Probable causes

Lost communication with the PROFIsafe host.

Recommended actions

Check connection to the PROFIsafe host.

Continues on next page

90793, arg Operator Acknowledge

Description

The *arg* is in Operator Acknowledge state.

The PROFIsafe host is waiting for operator acknowledgement.

Consequences

arg is sending fail-safe values.

Probable causes

Communication with the the PROFIsafe host has been established.

Recommended actions

Activate the Operator Acknowledge signal for about 1 second.

90794, arg parameter mismatch

Description

The *arg* F-Parameters do not match F-Parameters from the PROFIsafe host.

Probable causes

Incorrect parameters sent from the PROFIsafe host.

Recommended actions

Check the configuration in the PROFIsafe host and restart communication.

90795, arg watchdog timeout

Description

The *arg* watchdog has timed out.

Probable causes

Lost communication with the PROFIsafe host.

Recommended actions

- 1) Check that the Ethernet cable is properly inserted.
- 2) Check that the PROFIsafe host is connected and running.

90796, arg CRC error

Description

The *arg* is in CRC error state.

Probable causes

Communication fault from the PROFIsafe host.

Recommended actions

Check connection to the PROFIsafe host and try again.

90797, arg fault

Description

The *arg* is in device fault state.

Probable causes

Communication fault from the PROFIsafe host. Internal errors.

Recommended actions

Check connection to the PROFIsafe host and try again.

90800, Bad XML syntax in *arg* safety configuration file

Description

The system could not parse the contents of the safety configuration file.

Probable causes

The configurator has not been used for creating the configuration file. Internal error in the configurator.

Recommended actions

Make sure to use the configurator when creating the safety configuration file.

90801, CRC error in *arg* safety configuration file

Description

The CRC in the safety configuration file does not match the contents of the file.

Consequences

The safety configuration file is not loaded and the Safety Controller goes to Safe state.

Recommended actions

Update the safety configuration and restart the system.

90802, Lock Information Error

Description

The lock information in the safety configuration file *arg* does not match the lock information stored in the Safety Controller, cause *arg*.

Checksum safety configuration file: *arg*.

Checksum Safety Controller: *arg*.

Consequences

No full speed operation is possible.

Probable causes

- 1) The safety configuration file contains LockInfo, but has not been locked to the Safety Controller.
- 2) The Safety Controller is locked to another safety configuration-file.
- 3) The Safety Controller was locked to another robot controller (mismatch ControllerId).

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

4) The Safety Controller is locked to this safety configuration file, but the file does not contain LockInfo.

Recommended actions

- 1) Lock the file to the Safety Controller or remove LockInfo from the safety configuration file.
- 2) Unlock the safety configuration on the Safety Controller, or revert to the file corresponding to the checksum on the Safety Controller.
- 3) Unlock the safety configuration stored on the Safety Controller, or move the Safety Controller hardware back to the correct robot controller (if it has been moved).
- 4) Add LockInfo to the safety configuration file, or perform Unlock on it to remove lock information from the Safety Controller.

90804, Communication lost with Safety Controller

Description

The main computer has lost contact with the Safety Controller.

Consequences

The robot controller goes to SYS FAIL No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure the Safety Controller board is properly mounted.
- 2) Restart the system and check if the error remains.

90805, Start of Safety Controller failed

Description

The main computer could not start the Safety Controller. See the event log for more details.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure the Safety Controller board is properly mounted.
- 2) Restart the system and check if the error remains.

90806, Safety Configuration Locked

Description

The Safety configuration was successfully locked by user *arg*.

Continues on next page

Consequences

The robot can now be run in automatic mode without warnings. The safety configuration cannot be changed unless it is unlocked first.

90807, Safety Configuration Unlocked

Description

The safety configuration was successfully unlocked.

Consequences

The safety configuration can now be modified. Switching to automatic mode will generate a warning.

90808, Unsupported Robot Type

Description

The Safety Controller does not support the robot type.

Consequences

No operation will be possible.

Recommended actions

- 1) Remove the Safety Controller board and the Safety Controller option from the system.
- 2) Change to a robot type that is supported by the Safety Controller.

90809, Safety Controller set to default configuration

Description

The safety controller configuration failed validation checks.

Consequences

The safety controller is running with the default configuration.

Probable causes

User misconfiguration.

Recommended actions

- 1) Correct the safety controller configuration.

90810, Safety Controller hardware diagnostics failed

Description

The Safety Controller hardware diagnostics failed: *arg arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure the Safety Controller board is properly mounted.
- 2) Restart the system and check if the error remains.
- 3) If the error remains replace the Safety Controller board.

90811, CPU register self-test failed**Description**

The CPU hardware diagnostics has detected an error: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Restart the system and check if the error remains.
- 2) If the error remains replace the Safety Controller board.

90812, GPIO register self-test failed**Description**

The GPIO hardware diagnostics has detected an error on GPIO ID: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Restart the system and check if the error remains.
- 2) If the error remains replace the Safety Controller board.

90813, GPIO start-up circuit test failed**Description**

The GPIO start-up circuit test failed on GPIO ID: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure that all cables to the safety controller are properly attached.
- 2) Restart the system and check if the error remains.
- 3) If the error remains replace the Safety Controller board.

90814, GPIO cyclic circuit test failed**Description**

The GPIO cyclic circuit test failed on GPIO ID: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure that all cables to the safety controller are properly attached.
- 2) Restart the system and check if the error remains.
- 3) If the error remains replace the Safety Controller board.

90815, Mode Selector input test failed**Description**

The Mode Selector input test failed on GPIO ID: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure that all cables to the safety controller are properly attached.
- 2) Restart the system and check if the error remains.
- 3) If the error remains replace the Safety Controller board.

90816, Invalid Mode Selector input**Description**

The Mode Selector has an invalid number of set inputs: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure that all cables to the safety controller are properly attached.
- 2) Restart the system and check if the error remains.
- 3) If the error remains replace the Safety Controller board.

Continues on next page

5 Trouble shooting by event log

5.9 9 xxxx

Continued

90817, Invalid state of the Mode Selector

Description

The Mode Selector input is in an invalid state GPIO ID: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure that all cables to the safety controller are properly attached.
- 2) Restart the system and check if the error remains.
- 3) If the error remains replace the Safety Controller board.

90818, Temperature test failed

Description

The temperature is outside specification: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

The ambient temperature is either too high or too low.

Recommended actions

- 1) Ensure that the system is operating in an approved environment.
- 2) Restart the system and check if the error remains.
- 3) If the error remains replace the Safety Controller board.

90819, Voltage test failed

Description

The voltage is outside specification: *arg*.

Consequences

No operation will be possible until the fault has been corrected and the system have been restarted.

Probable causes

This may be caused by faulty hardware.

Recommended actions

- 1) Make sure that all cables to the safety controller are properly attached.
- 2) Restart the system and check if the error remains.
- 3) If the error remains replace the Safety Controller board.

90830, Safety Controller persistent storage data is corrupt

Description

Data stored in persistent memory by Safety Controller was detected as corrupt/inconsistent. Data area will therefore be erased.

Consequences

See Application Manual for Functional safety and SafeMove regarding persistent storage.

Probable causes

This can be caused by an uncontrolled shutdown or in rare cases faulty hardware.

Recommended actions

- 1) Restart the robot controller to see if the error remains.
- 2) If the error remains consider replacing the Safety Controller hardware.

90831, Safety Controller persistent data lost

Description

Data stored in persistent memory by Safety Controller was not stored during last shutdown.

Consequences

See Application Manual for Functional safety and SafeMove regarding persistent storage.

Probable causes

This was caused by an uncontrolled shutdown or in rare cases faulty hardware.

Recommended actions

- 1) Restart the robot controller to see if the error remains.
- 2) If the error remains consider replacing the Safety Controller hardware.

90835, Safety Controller performance warning

Description

The work load on the safety controller is near its limit.

Consequences

If the work load is increased, the safety controller will stop the robot.

Probable causes

The safety configuration is too demanding for the system.

Recommended actions

Create and load a less demanding configuration with fewer and simpler zones.

Continues on next page

90836, Safety Controller has entered safe state

Description

The safety controller has entered the safe state.

Consequences

The system goes to status SYS HALT.

Probable causes

The cause of this is described in previous event log entries.

Recommended actions

Check and handle previous event messages and restart the robot controller.

90851, Safety Configuration Error

Description

The safety configuration file *arg* does not match the installed system options. The safety configuration file contains *arg* instances of *arg* when *arg* instances is allowed.

Consequences

The Safety Controller will not load the safety configuration and enters safe state.

Probable causes

The safety configuration file contains elements that are not supported by the installed system options.

Recommended actions

Remove the instance *arg* in the safety configuration and download it to the controller, or install the required option, *arg*.

90852, Empty Safety Configuration

Description

The safety configuration is empty.

Consequences

No supervision of the robot will be performed.

Recommended actions

Use the configurator to add safety supervision.

90890, Start of Safety Controller failed

Description

The main computer could not start the safety controller. See the event log for more details.

Consequences

No operation will be possible until the fault has been corrected and the system has been restarted.

Probable causes

This may be caused by faulty hardware or incompatible safety controller software version.

Recommended actions

- 1) Reinstall system.
- 2) Make sure the safety controller board is properly mounted.
- 3) Restart the system and check if the error remains.

5 Trouble shooting by event log

5.10 11 xxxx

5.10 11 xxxx

110001, Process Supervision Phase PRE

Description

Task: *arg*

Supervision failed for process phase PRE.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110005, Process Supervision Phase END_MAIN

Description

Task: *arg*

Supervision failed for process phase END_MAIN.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110002, Process Supervision Phase PRE_START

Description

Task: *arg*

Supervision failed for process phase PRE_START.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110006, Process Supervision Phase POST1

Description

Task: *arg*

Supervision failed for process phase POST1.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110003, Process Supervision Phase START

Description

Task: *arg*

Supervision failed for process phase START.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110007, Process Supervision Phase END_POST1

Description

Task: *arg*

Supervision failed for process phase END_POST1.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110004, Process Supervision Phase MAIN

Description

Task: *arg*

Supervision failed for process phase MAIN.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

Continues on next page

110008, Process Supervision Phase POST2

Description

Task: *arg*

Supervision failed for process phase POST2.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

3. A process error occurred too close to the endpoint of the process: a process restart is not performed.

Recommended actions

Remove the logical instructions, that cause the delay,

or

check, that the last application movement instruction indicates, that it is the last one.

110009, Process Supervision Phase END_POST2

Description

Task: *arg*

Supervision failed for process phase END_POST2.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110014, Option 'Optical Tracking' or 'Weldguide' is missing

Description

Task: *arg*

The optional argument '\Track' may not be used without the option 'Optical Tracking' or 'Weldguide' or 'Sensor Interface'.

arg

Recommended actions

Remove the optional argument '\Track'

or

Order a RobotWare key that, depending on your equipment, contains the option 'Optical Tracking' or 'Weldguide' or 'Sensor Interface'.

110015, Option Path Offset is missing

Description

Task: *arg*

The switch '\Corr' may not be used without the option Path Offset.

arg

Recommended actions

Remove the switch '\Corr'

or

Order a RobotWare key, that contains the option 'Path Offset'.

110012, Movement start timeout

Description

Task: *arg*

Time (*arg* second(s)) between start of process and Robot movement is too long.

Recommended actions

Check your process equipment.

110013, Application process interrupted

Description

Task: *arg*

The application process was not terminated properly.

arg

Consequences

Eventual post-motion phases were not executed.

Probable causes

1. Logical RAPID instructions in a sequence of application movement instructions consuming too much execution time.
2. The last instruction in the sequence of application movement instructions, that does not indicate the sequence end.

Description

Task: *arg*

Program execution proceeded to the next RAPID instruction before the application process had finished.

Consequences

If a process error occurs, the application process will be stopped on the fly, but the robot movement will not be stopped.

Probable causes

The zone size and the fly_end distance of the flying end instruction do not fit together.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

Increase fly_end distance or decrease the zone size of the instruction with flying end.

arg arg

110017, Process data buffer full

Description

Task: *arg*

arg

The process data buffer is full. The latest process data set and robtarget has been replaced by the data set and robtarget of the active instruction.

Consequences

A set of process data and a robtarget are skipped. This could result in path shortcuts and inadequate process data.

Probable causes

The RAPID program contains too many short continuous process instructions in sequence.

Recommended actions

Either increase the length of the continuous process instructions or

reduce process speed.

110018, Too many concurrent flying welds

Description

Task: *arg*

There are too many short movements with application process in sequence, that have flying start and flying end and that are programmed with a high process speed.

Consequences

Because the robot controller resources are not sufficient, the controller entered an error state.

Probable causes

1. Too high process speed.
2. Too short process movements with flying start and end.

Recommended actions

You can:

1. Decrease the process speed.
2. Remove the flying start and/or end.
3. Increase the length of the process movements.

110019, Option 'Optical Tracking' is missing

Description

Task: *arg*.

Continues on next page

The optional argument 'FillTrBuff' may not be used without the option 'Optical Tracking' or 'Weldguide' or 'Sensor Interface'.
arg.

Recommended actions

Remove the optional argument 'Track'
or

order a RobotWare license that, depending on your equipment, contains the option 'Optical Tracking' or 'Weldguide' or 'Sensor Interface'.

110020, Supervision limit

Description

Task: *arg*

The maximum number of signals to be supervised (max. 32) has been exceeded in one of the supervision phases.

arg

Recommended actions

Remove signals from supervision for phase *arg* in order to meet the limit of 32.

110021, Unknown supervision list

Description

Task: *arg*

The Supervision list type *arg* is unknown.

arg

Consequences

Supervision is not set up or removed.

Recommended actions

Change the supervision list type.

110025, No active CAP process

Description

Task: *arg*

There is no active CAP process for this instruction.

arg

Recommended actions

Verify that *arg* is used according to documentation.

110026, Process start not allowed

Description

Task: *arg*

It is not possible to start the process on the current instruction
arg

Probable causes

You try to start the process on a CAP instruction, where the value for capdata.first_instr is not set to TRUE.

Recommended actions

Either set the value for capdata.first_instr to TRUE or

Move the PP to a CAP instruction with capdata.first_instr = TRUE

or

Move the PP to an instruction that is not a CAP instruction.

110027, Robot movement is blocked**Description**

Task: *arg*

It is not possible to start the robot movement.

arg

Probable causes

The RAPID instruction 'StopMove' has been executed prior to this movement instruction.

Recommended actions

You have to execute the RAPID instruction 'StartMove' or 'StartMoveRetry' to unblock the movement of the Robot.

110030, Invalid ICap Event**Description**

Task: *arg*

arg is invalid as event for the instruction ICAP.

arg

Recommended actions

Use one of the valid ICAP events described in the reference manual for CAP.

110032, No TRAP routine for CAP_STOP**Description**

Task: *arg*

CAP requires a RAPID TRAP routine to be defined for the event CAP_STOP.

This is necessary as to stop external equipment when RAPID execution stops.

arg

Recommended actions

Add a TRAP routine for CAP_STOP in your RAPID code.

110034, Skip without process finished**Description**

The robot has reached the end of the distance it was requested to move without active application process.

Recommended actions

Recovery:

You might want to handle errno *arg* in your error handler

110035, Process start position reached**Description**

Task: *arg*.

The look-ahead buffer for tracking is filled and the robot TCP has reached the programmed start position for the application process.

arg.

Consequences

This recoverable error occurs if you have used the optional argument '\FillTrBuff' in the first CAP instruction of a sequence.

Recommended actions

You might want to handle errno *arg* in your error handler.

110040, Process Supervision Phase END_PRE**Description**

Task: *arg*

Supervision failed for process phase END_PRE.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110041, Process Supervision Phase START_POST1**Description**

Task: *arg*

Supervision failed for process phase START_POST1.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

You might want to handle errno *arg* in your error handler

110042, Process Supervision Phase

START_POST2

Description

Task: *arg*

Supervision failed for process phase START_POST2.

arg

Recommended actions

Check the signal(s) that failed:

arg

arg

Recovery:

You might want to handle errno *arg* in your error handler

110100, Fatal process error

Description

Task: *arg*

A fatal process error has been reported. Check previous error messages for more information about the reason of the error.

Recommended actions

A restart of the system or move of program pointer is highly recommended.

110101, Invalid weave shape

Description

Task: *arg*

The weave shape used is invalid:

[No shape = 0, Zig-zag shape = 1, V-shape = 2, Triangular shape = 3]

Recommended actions

Correct the shape component.

110102, Invalid weave length

Description

Task: *arg*

The weave length used is invalid:

(0 - 1) [m]

Recommended actions

Correct the component length.

110103, Invalid weave cycle time

Description

Task: *arg*

Continues on next page

The weave cycle time used is invalid:

(0 - 100) [s]

Recommended actions

Correct the component *cycle_time*.

110104, Invalid weave width

Description

Task: *arg*

The weave width used is invalid:

(0 - 1) [m]

Recommended actions

Correct the component width.

110105, Invalid weave height

Description

Task: *arg*

The weave height used is invalid:

(0 - 1) [m]

Recommended actions

Correct the component height

110106, Invalid weave dwell left

Description

Task: *arg*

The weave dwell_left used is invalid:

(0 - 1) [m]

Recommended actions

Correct the component dwell_left

110107, Invalid weave dwell center

Description

Task: *arg*

The weave dwell_center used is invalid:

(0 - 1) [m]

Recommended actions

Correct the component dwell_center

110108, Invalid weave dwell right

Description

Task: *arg*

The weave dwell_right used is invalid:

(0 - 1) [m]

Recommended actions

Correct the component dwell_right

110109, Invalid weave bias**Description**

Task: *arg*

The weave bias used is invalid:

(-1 - 1) [m]

Recommended actions

Correct the component bias

110110, Invalid weave direction angle**Description**

Task: *arg*

The weave direction angle used is invalid:

(-PI/2 - PI/2) [rad]

Recommended actions

Correct the component dir

110111, Invalid weave tilt angle**Description**

Task: *arg*

The weave tilt angle used is invalid:

(-PI/2 - PI/2) [rad]

Recommended actions

Correct the component tilt

110112, Invalid weave rotation angle**Description**

Task: *arg*

The weave rotation angle used is invalid:

(-PI/2 - PI/2) [rad]

Recommended actions

Correct the component rot

110113, Invalid horizontal weave offset**Description**

Task: *arg*

The horizontal weave offset is invalid:

110114, Invalid vertical weave offset**Description**

Task: *arg*

The vertical weave offset is invalid:

110115, Invalid weave sync left**Description**

Task: *arg*

The weave sync left value is invalid:

(0 - 100) [%]

Recommended actions

Correct the component ptrn_sync_left in capweavedata.

110116, Invalid weave sync right**Description**

Task: *arg*

The weave sync right value is invalid:

(0 - 100) [%]

Recommended actions

Correct the component ptrn_sync_right in capweavedata.

110117, Weave bias not allowed**Description**

Task: *arg*

It is not allowed to use bias for shapes other than Zig-zag (=1).

Recommended actions

Correct the components 'bias' and/or 'shape' in capweavedata.

110118, Weave bias too big**Description**

Task: *arg*

It is not allowed to use a bias that is bigger than half the width.

Recommended actions

Correct the components 'bias' and/or 'width' in capweavedata.

110119, Weave dwell too big**Description**

Task: *arg*

It is not allowed to use a dwell that is bigger than the length.

The ramp slope (amplitude/length) is limited.

Recommended actions

Correct the components 'dwell_right/center/left' and/or 'length' in capweavedata.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

110120, Weave bias change too big

Description

Task: *arg*

The weave bias change is bigger than allowed.

Max *arg* [m]

Recommended actions

Adjust weave tuning increment for bias, and/or check that the change of the bias is less than the maximum.

110121, Weave width tuning error

Description

Task: *arg*

The weave width change is bigger than allowed.

Max *arg* [m]

Recommended actions

Adjust weave tuning increment for width, and/or check that the change of the width is less than the maximum.

110122, Weave height tuning error

Description

Task: *arg*

The weave height change is bigger than allowed.

Max *arg* [m]

Recommended actions

Adjust weave height tuning increment, and/or check that the change of the height is less than the maximum.

110130, Signal not defined

Description

Task: *arg*

The signal *arg* is not defined.

arg

Recommended actions

Define the signal *arg* in eio.cfg

110131, No Signal specified

Description

Task: *arg*

No signal specified!

arg

Recommended actions

Specify a DI signal

110132, An internal error occurred

Description

Task: *arg*

arg

Recommended actions

Check the 'Internal' Log.

110133, Wrong path level

Description

Task: *arg*

arg

This instruction is not allowed on this path level (*arg*).

Recommended actions

Use RestoPath, to change to path level 0.

110134, Change from fine to z0

Description

Task: *arg*

arg

A 'fine' point is not allowed in the middle of a Process sequence.

The zone data was changed from 'fine' to 'z0'.

Recommended actions

Correct your RAPID instruction's zone data.

110135, Capdata.first_instr changed to FALSE

Description

Task: *arg*

arg

A capdata.first_instr = TRUE is not allowed in the middle of a Process sequence.

The value is internally changed from 'TRUE' to 'FALSE'.

Recommended actions

Correct your RAPID instruction's capdata.first_instr value or review the Cap sequence.

110140, \ReportAtTool only allowed with Look Ahead Trackers

Description

Task: *arg*

arg

It is not allowed to use the optional argument \ReportAtTool with other sensors than Look Ahead Trackers (e.g. Laser Trackers).

Continues on next page

Consequences

The sensor variable interrupt was not set up.

Recommended actions

Remove the optional argument \ReportAtTool from the instruction IVarValue.

110141, \Aptr only allowed with At Point Trackers**Description**

Task: *arg*

arg

It is not allowed to use the optional argument \Aptr with other sensors than At Point Trackers (e.g. WeldGuide).

Consequences

The sensor variable interrupt was not set up.

Recommended actions

Remove the optional argument \Aptr from the instruction IVarValue.

110142, Sensor variable type not supported by IVarValue**Description**

Task: *arg*

arg

The sensor variable type *arg* is not supported by IVarValue.

Consequences

The sensor variable interrupt was not set up.

Recommended actions

Change the sensor variable type.

110143, Number of subscriptions exceeded**Description**

Task: *arg*

arg

The number of sensor variable subscriptions (IVarValue) is exceeded.

Max. number of admitted subscriptions: *arg*

Consequences

The subscription was not set up.

Recommended actions

Reduce the number of sensor variable subscriptions (IVarValue).

110160, Track error**Description**

Task: *arg*

Track error.

arg

Recommended actions

Check joint definition.

Recovery: *arg*

110161, Track start error**Description**

Task: *arg*

Track start error.

arg

Recommended actions

Check joint definition in captrackdata.

Recovery: *arg*

110162, Track max path corr error**Description**

Task: *arg*

Track max path corr error.

arg

Recommended actions

Check joint definition and max_corr in captrackdata.

Recovery: *arg*

110163, Track communication error**Description**

Task: *arg*

No communication between sensor and controller.

Recommended actions

Check the hardware

110164, Track correction lost**Description**

Task: *arg*

Track lost due to power fail.

arg

Recommended actions

Move PP to main, or step through the rest of the CAP sequence.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

110165, No Sensor Measurement

Description

Task: *arg*

No sensor measurement available.

arg

110166, Sensor Not ready yet

Description

Task: *arg*

The sensor is not ready.

arg

110167, General error from sensor

Description

Task: *arg*

General sensor error.

arg

110168, Sensor busy

Description

Task: *arg*

The sensor is busy.

arg

110169, Unknown command to sensor

Description

Task: *arg*

Some for the sensor unknown command was sent.

arg

110170, Illegal variable or block number in sensor

Description

Task: *arg*

The variable number or block number is unknown to the sensor.

arg

110171, External alarm from sensor

Description

Task: *arg*

An external sensor alarm occurred.

arg

110172, Camera alarm from sensor

Description

Task: *arg*

The sensor camera sent an alarm.

arg

110173, Temperature alarm from sensor

Description

Task: *arg*

The sensor temperature is out of admitted bounds.

arg

110174, Value to sensor out of range

Description

Task: *arg*

The value sent to the sensor is out of bounds.

arg

110175, Camera check failed

Description

Task: *arg*

It was not possible to perform a sensor camera check.

arg

110176, Sensor communication time out

Description

Task: *arg*

Timeout occurred in communication with the sensor.

arg

110177, Tracker calibration error

Description

Task: *arg*

Sensor: *arg*

It was not possible to perform a valid tracker calibration.

Consequences

The sensor *arg* is not calibrated, thus should not be used for tracking.

Probable causes

The average calibration precisions obtained in the x-, y-, z-directions of the sensor tool are: *arg*. The desired ones are: *arg*.

Continues on next page

Recommended actions

Verify that the calibration plate has not been moved. Check the sensor settings. Start LTC to run a manual calibration setup followed by a new calibration.

110178, Tracker verification error**Description**

Task: *arg*

Sensor: *arg*

It was not possible to perform a valid tracker calibration verification.

Consequences

The sensor *arg* does not meet the calibration precision and will therefore be unreliable for tracking.

Probable causes

The average verification precisions obtained in the x-, y-, z-directions of the sensor tool are: *arg*. The desired ones are: *arg*.

Recommended actions

Start LTC to run a manual verification with a different number of measurements. If problems persist, run a new manual calibration from LTC.

110179, Left lap joint definition not correct**Description**

Task: *arg*

Sensor: *arg*

The definition of the left joint (number *arg*) is not correct.

Consequences

It will not be possible to perform a sensor calibration.

Probable causes

The measure obtained in the y-direction of the sensor tool on the left lap-joint is : *arg* mm. The value should be positive.

Recommended actions

Check the left-lap joint definition (*arg*) in the sensor's (*arg*)PC interface. Possibly switch between the right and left lap-joint definitions.

110180, Sensor Calibration Data updated**Description**

The sensor calibration data for *arg* (*arg* and *arg*) are updated.

Task: *arg*

Recommended actions

If you use CAP without RW Arc, you have to rerun the RAPID instruction

CapLATRSetup *arg,arg,arg\SensorFreq:=xxx*;
to make CAP use the updated sensor calibration data.

110181, Track max incremental corr error**Description**

Task: *arg*.

Track max incremental corr error.

arg.

Recommended actions

Check \MaxIncCorr in CapLATRSetup.

Recovery: *arg*.

110182, Invalid sensordatatype in Data**Description**

Task: *arg*.

The value *arg* for sensordatatype at array index *arg* is not valid *arg*.

Recommended actions

Change sensordatatype value to a valid value 0, 1 or 2.

110183, Invalid scale in Data**Description**

Task: *arg*.

The value *arg* for scale at array index *arg* is not valid *arg*.

Recommended actions

Change scale value to a valid value 1, 10 or 100.

110184, Error reading Device configuration**Description**

Task: *arg*.

There was an error when trying to read the configuration for the Device *arg* *arg*.

Recommended actions

Check the Device parameter.

110185, Value larger than sensordatatype allows**Description**

Task: *arg*.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

The value *arg* for sensordatatype at array index *arg* is to big for the sensordatatype *arg* *arg*.

Recommended actions

Change the value in sensorVarData.

110186, Invalid sensordatatype in Data

Description

Task: *arg*.

The value *arg* for sensordatatype at array index *arg* is not valid for configured device *arg*.

Recommended actions

Change sensordatatype value to a valid value 0 or 1.

110203, Application error

Description

Task: *arg*

The maximum program number, 'DA_PROG_MAX' is above the num data type limit.

Current value: *arg*

Consequences

The maximum configured program number will not be set.

Probable causes

The specified program number *arg* is above the maximum integer value for the num data type, max value 8388608.

Recommended actions

Check the program.

110204, Application error

Description

Task: *arg*

Any return code other than DAOK is rejected from *arg*

Recommended actions

110205, Application error

Description

Task: *arg*

Forward sequence jumping is not allowed.

Recommended actions

Check the program sequence.

110206, Application error

Description

Task: *arg*

Missing I/O-signal *arg*.

Recommended actions

Check the I/O configuration.

110207, Application error

Description

Task: *arg*

Process number *arg* of application *arg* was already installed.

Recommended actions

110208, Application error

Description

Task: *arg*

Number *arg* is not a valid start number.

Recommended actions

110209, Application error

Description

Task: *arg*

The user hook *arg* is not a valid sequence entry.

Recommended actions

Check the program sequence.

110210, Application error

Description

Task: *arg*

The program number *arg* is above the num data type limit.

Consequences

The program number will not be set.

Probable causes

The specified program number *arg* is above the maximum integer value for the num data type, max value 8388608.

Recommended actions

Check the program.

110211, Application error

Description

Task: *arg*

The instruction *arg* reported a fatal error.

Continues on next page

Line: *arg*.

Recommended actions

Check the program.

110212, Application error**Description**

Task: *arg*

arg tried to use a non existent process descriptor.

A fatal error in damastr class.

arg

Probable causes

The XXShPowerOn has not been executed.

Recommended actions

Check if XXShPowerOn was done.

arg

110221, Application error**Description**

Task: *arg*

The user data variable has incorrect type.

arg

arg

110222, Application error**Description**

Task: *arg*

The internal process data type lacks daintdata as first element.

arg

arg

Recommended actions

Check the program.

110214, Application error**Description**

Task: *arg*

arg tried to use a non existent application descriptor.

arg

Probable causes

The XXShPowerOn has not been executed, or to few DA_PROC task are specified.

Recommended actions

Check if XXShPowerOn was done.

If using only DAP you should save a sys.cfg, and add a new DA_PROCX task in that file. Check what files are loaded for DA_PROC1 task and add them to your new task.

110223, Application error**Description**

Task: *arg*

The user data type definitions exceed the maximum data storage size.

arg

arg

Recommended actions

Check the program.

110216, Application error**Description**

Task: *arg*

Attempt to install a process number outside it's limits.

arg

arg

Recommended actions

Check the program, max number of processes are limited to 4.

110224, Application error**Description**

Task: *arg*

The user data type definitions does not correspond to what was defined.

arg

arg

110226, Application error**Description**

Task: *arg*

An error occurred while attempting to reload the Power Failure area.

An automatic restart of the processes will not be possible.

arg

arg

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

110229, Application error

Description

Task *arg*:

Error from *arg*. The data type definitions exceed the maximum data storage size.

arg

Recommended actions

Check the data size.

110230, Application error

Description

Task *arg*:

Not possible to execute instruction in motors off state for servo tool *arg*.

Recommended actions

Retry after setting motors on.

110231, Application process time warning

Description

Task *arg*:

arg. Max process time exceeded, waiting for process complete.

Time: *arg* s.

Recommended actions

Check the application code for any delays preventing the process to finish.

110300, Parameter error

Description

Task: *arg*

The max string length of the parameter *arg* is 5 characters.

Current used name is *arg*.

See specification in *arg*.

arg

Recommended actions

Check the length of the string data value.

110302, Parameter error

Description

Task: *arg*

The specified signal *arg* in the instruction *arg* has no reference.

arg

Probable causes

The signal reference is not valid, no AliasIO has been done or the signal is write protected in the EIO configuration..

Continues on next page

Recommended actions

Check the EIO configuration.

110303, Parameter error

Description

Task: *arg*

The optional signals *arg* and *arg* must be used together.

See specification in *arg*.

arg

Recommended actions

Check the program.

110304, Parameter error

Description

Task: *arg*

The parameter *arg* of the instruction *arg* is not an array.

arg

Recommended actions

Check the data definition.

110305, Parameter error

Description

Task: *arg*

The dimension of the data array *arg* is to big.

See specification in *arg*.

arg

Recommended actions

Check the data declaration.

110306, Parameter error

Description

Task: *arg*

The array *arg* of the instruction *arg* is not right defined.

arg

Recommended actions

Check the data against the specification.

110307, Parameter error

Description

Task: *arg*

The event time array element *arg.arg* is less than 0.

See specification in *arg*.

arg

Recommended actions

Check the time event data.

110308, Parameter error**Description**

Task: *arg*

The data selector *arg* in the instruction *arg* is not valid.

arg

Recommended actions

Check the selector against the specification.

110309, Parameter error**Description**

Task: *arg*

The selector *arg* in the instruction *arg* is not valid.

arg

Recommended actions

Check the selector against the specification.

110310, Parameter error**Description**

Task: *arg*

The selector *arg* in the instruction *arg* is not valid.

arg

Recommended actions

Check the selector against the specification.

110311, No Spot task**Description**

Task: *arg*

No motion task is configured for Spot.

arg

Probable causes

Check the configuration

110312, Wrong number of DAPROC tasks**Description**

Task: *arg*

Error from *arg*. *arg* DA_PROC task(s) are configured in the system. Number of daprocs must be in the interval 1 - *arg*.

arg

Recommended actions

Check the configuration.

110313, Not possible to activate/deactivate**Description**

Task: *arg*

Error in *arg*. This daproc is not possible to activate/deactivate.

arg

Recommended actions

Check index in the daproc descriptor.

110401, Gas supervision**Description**

Task: *arg*

arg

Gas supervision signal not set at start of welding.

Recommended actions

Check the gas equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110402, Water supervision**Description**

Task: *arg*

arg

Water supervision signal not set at start of welding.

Recommended actions

Check the water cooling equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110403, Arc supervision**Description**

Task: *arg*

arg

Arc ignition supervision signal not set at start of welding.

Recommended actions

Check the power source.

Recovery: You might want to handle errno *arg* in your error handler.

110404, Voltage supervision**Description**

Task: *arg*

arg

Voltage supervision signal not set at start of welding.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

Check the power source.

Recovery: You might want to handle errno *arg* in your error handler.

110405, Current supervision

Description

Task: *arg*

arg

Current supervision signal not set at start of welding.

Recommended actions

Check the power source.

Recovery: You might want to handle errno *arg* in your error handler.

110406, Wirefeed supervision

Description

Task: *arg*

arg

Wirefeed supervision signal not set at start of welding.

Recommended actions

Check the wirefeed unit.

Recovery: You might want to handle errno *arg* in your error handler.

110407, Wiresstick supervision

Description

Task: *arg*

arg

Wiresstick supervision signal set at start of welding.

Recommended actions

Check, if the wire got stuck at the object.

Recovery: You might want to handle errno *arg* in your error handler.

110408, Arc ignition failed

Description

Task: *arg*

arg

Arc ignition failed at start of welding.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110409, Schedule strobe undefined

Description

Task: *arg*

arg

Schedule strobe undefined.

Recommended actions

Define a weld schedule strobe input.

Recovery: You might want to handle errno *arg* in your error handler.

110410, Schedule transfer error

Description

Task: *arg*

arg

It was not possible to transfer the schedule.

Probable causes

The schedule port was busy with previous transfer.

Recommended actions

Recovery: You might want to handle errno *arg* in your error handler.

110411, Process stopped

Description

Task: *arg*

arg

Process was stopped by the digital input 'stop process'.

Recommended actions

Check the digital input 'stop process'.

Recovery: You might want to handle errno *arg* in your error handler.

110412, Arc fill ignition failed

Description

Task: *arg*

arg

Arc fill ignition failed.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110413, Torch supervision

Description

Task: *arg*

Continues on next page

arg

Torch supervision signal went low during welding.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno **arg** in your error handler.

110414, Weld supervision

Description

Task: **arg**

arg

Weld ignition supervision signal not set at start of welding.

Recommended actions

Check the power source.

Recovery: You might want to handle errno **arg** in your error handler.

110415, Weld Off Supervision timeout

Description

Task: **arg**

arg

The ArcEst signal was not reset at the end of the weld within the specified time. (**arg** seconds)

Recommended actions

Check the welding equipment and/or adjust the Weld Off timeout value,

found in Arc Equipment Properties.

110416, Weld Off Supervision timeout

Description

Task: **arg**

arg

The WeldOK signal was not reset at the end of the weld within the specified time.

(**arg** seconds)

Recommended actions

Check the welding equipment and/or adjust the Weld Off timeout value,

found in Arc Equipment Properties.

110421, Gas supervision

Description

Task: **arg**

arg

Gas supervision signal went low during welding.

Seam name: **arg**.

Time from weld start: **arg** min.

Recommended actions

Check the gas equipment.

Recovery: You might want to handle errno **arg** in your error handler.

110422, Water supervision

Description

Task: **arg**

arg

Water supervision signal went low during welding.

Seam name: **arg**.

Time from weld start: **arg**.

Recommended actions

Check the cooling water equipment.

Recovery: You might want to handle errno **arg** in your error handler.

110423, Arc supervision

Description

Task: **arg**

arg

Arc supervision signal went low during welding.

Seam name: **arg**.

Time from weld start: **arg**.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno **arg** in your error handler.

110424, Voltage supervision

Description

Task: **arg**

arg

Voltage supervision signal went low during welding.

Seam name: **arg**.

Time from weld start: **arg**.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno **arg** in your error handler.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

110425, Current supervision

Description

Task: *arg*

arg

Current supervision signal went low during welding.

Seam name: *arg*

Time from weld start: *arg*

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110426, Wirefeed supervision

Description

Task: *arg*

arg

Wirefeed supervision signal went low during welding.

Seam name: *arg*

Time from weld start: *arg*

Recommended actions

Check the wirefeed unit.

Recovery: You might want to handle errno *arg* in your error handler.

110427, Process stopped

Description

Task: *arg*

arg

Process was stopped during welding by the digital input 'stop process'.

Seam name: *arg*

Time from weld start: *arg*

Recommended actions

Recovery: You might want to handle errno *arg* in your error handler.

110428, Torch supervision

Description

Task: *arg*

arg

Torch supervision signal went low during welding.

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110429, Arc ignition failed

Description

Task: *arg*

arg

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110430, Arc fill ignition failed

Description

Task: *arg*

arg

Arc ignition failed during crater fill.

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110431, Weld supervision

Description

Task: *arg*

arg

Weld supervision signal went low during welding.

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Check the welding equipment.

Recovery: You might want to handle errno *arg* in your error handler.

110432, Arc ignition failed

Description

Task: *arg*

arg

Seam name: *arg*.

Continues on next page

Time from weld start: *arg*.

Recommended actions

Check the welding equipment. Signal WeldOK.

Recovery: You might want to handle errno *arg* in your error handler.

110433, Arc fill ignition failed**Description**

Task: *arg*

arg

Arc ignition failed with signal WeldOk during crater fill.

Seam name: *arg*.

Time from weld start: *arg*.

110435, User defined signal supervision**Description**

Task: *arg*

arg

User defined signal defined by USERIO1 went low during welding.

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Recovery: You might want to handle errno *arg* in your error handler.

110436, User defined signal supervision**Description**

Task: *arg*

arg

User defined signal defined by USERIO2 went low during welding.

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Recovery: You might want to handle errno *arg* in your error handler.

110437, User defined signal supervision**Description**

Task: *arg*

arg

User defined signal defined by USERIO3 went low during welding.

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Recovery: You might want to handle errno *arg* in your error handler.

110438, User defined signal supervision**Description**

Task: *arg*

arg

User defined signal defined by USERIO4 went low during welding.

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Recovery: You might want to handle errno *arg* in your error handler.

110439, User defined signal supervision**Description**

Task: *arg*

arg

User defined signal defined by USERIO5 went low during welding.

Seam name: *arg*.

Time from weld start: *arg*.

Recommended actions

Recovery: You might want to handle errno *arg* in your error handler.

110440, User defined signal supervision**Description**

Task: *arg*

User defined signal *arg* defined by USERIO1 went low during welding.

110441, User defined signal supervision**Description**

Task: *arg*

User defined signal *arg* defined by USERIO2 went low during welding.

110442, User defined signal supervision**Description**

Task: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

User defined signal *arg* defined by USERIO3 went low during welding.

Time from weld start: *arg*.

110443, User defined signal supervision

Description

Task: *arg*

User defined signal *arg* defined by USERIO4 went low during welding.

110449, Current supervision

Description

Task: *arg*

arg

Current supervision signal went low during welding.

Seam name: *arg*

Time from weld start: *arg*.

110444, User defined signal supervision

Description

Task: *arg*

User defined signal *arg* defined by USERIO5 went low during welding.

110450, Wirefeed supervision

Description

Task: *arg*

arg

Wirefeed supervision signal went low during welding.

Seam name: *arg*

Time from weld start: *arg*.

110445, Gas supervision

Description

Task: *arg*

arg

Gas supervision signal went low during welding.

Seam name: *arg*

Time from weld start: *arg*.

110451, Torch supervision

Description

Task: *arg*

arg

Torch supervision signal went low during welding.

Seam name: *arg*

Time from weld start: *arg*.

110446, Water supervision

Description

Task: *arg*

arg

Water supervision signal went low during welding.

Seam name: *arg*

Time from weld start: *arg*.

110460, Weld Error Recovery

Description

PROC Parameters was loaded by *arg*

Configuration of Weld Error Recovery is Complete.

110447, Arc supervision

Description

Task: *arg*

arg

Arc supervision signal went low during welding.

Seam name: *arg*

Time from weld start: *arg*.

110461, Weld Error Recovery

Description

PROC Parameters for Weld Error Recovery could not be loaded in task *arg*

110448, Voltage supervision

Description

Task: *arg*

arg

Voltage supervision signal went low during welding.

Seam name: *arg*

110462, Weld Error Recovery

Description

Robot *arg* moved from error location.

Robot will attempt to move back to the error location.

110463, Weld Error Recovery Failed

Description

Incorrect Weld Error Recovery Usage.

Continues on next page

A user-defined service routine must return the robot to within 50mm of breakpoint.

Recommended actions

Re-program your service routine.

110464, EquipmentClass Error**Description**

Task: *arg*

The Specified EquipmentClass *arg* could not be unloaded.

110465, EquipmentClass Error**Description**

Task: *arg*

The Specified EquipmentClass *arg* could not be found at path:
arg

110466, RW Arc Installation**Description**

Weld System *arg* (of *arg* installed) started in task *arg*

Active EquipmentClass *arg*

Status OK

110467, RW Arc Installation**Description**

Deactivation and Unload of EquipmentClass *arg* failed.

110468, RW Arc Installation**Description**

Weld System *arg* deactivated in task *arg*

Status OK

110469, RW Arc Installation**Description**

Load and Init of EquipmentClass *arg* failed.

110470, Configuration Parameter Error**Description**

Task: *arg*

PROC Configuration Parameter *arg**arg*
could not be found in cfg database.

Recommended actions

Check the installation of PROC domain parameters.

110471, Undefined Signal Error**Description**

arg

Failing signal during weld phase *arg* could not be determined.

110472, Configuration Parameter Error**Description**

Task: *arg*

PROC Configuration Parameter *arg**arg*
is a required parameter.

Recommended actions

Check the installation of PROC domain parameters.

110473, Weld Equipment Error**Description**

Task: *arg*

arg

Error: *arg*
(format: ErrorCode ErrorText)

Recommended actions

Check the Power Source.

110474, RW Arc EIO signal error**Description**

There is no communication with signal *arg* on unit *arg*.

Consequences

Welding will not be possible without communication with this EIO unit.

Recommended actions

Check the communication link with the EIO unit.

110475, Calibration variable missing**Description**

Task: *arg*

No Calibration variable is specified in Arc Sensor Properties.
Default calibration data is used. *arg*=*arg*

Consequences

Calibration data is needed for optimal sensor performance.

110476, Calibration variable error**Description**

Task: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

The specified Calibration variable *arg* in in Arc Sensor Properties could not be found in any loaded RAPID modules. Default calibration data is used. *arg=arg*

Consequences

Calibration data is needed for optimal sensor performance.

Recommended actions

Check variable name in Arc Sensor Properties and make sure that the Sensor Calibration program is loaded.

110477, Device name mismatch

Description

Task: *arg*

Device name *arg* in in Arc Sensor Properties and Communication settings does not match.

Consequences

The same device name must be specified in both Arc Sensor Properties and Communication settings for the sensor to work properly.

110478, Process stop due to WDM Stability error

Description

Task: *arg*

arg

Consequences

RW Arc has stopped the welding process due to a Weld Data Monitor stability infraction.

Recommended actions

See Weld Data Monitor elog for more information.

110479, Process stop due to WDM Signature error

Description

Task: *arg*

arg

Consequences

RW Arc has stopped the welding process due to a Weld Data Monitor signature infraction.

Recommended actions

See Weld Data Monitor elog for more information.

110480, Arc Welding Task Busy

Description

Task: *arg*

arg

Continues on next page

Serious File System problem encountered.

Recommended actions

The Controller must be restarted to solve the problem.

110481, System Retry limit

Description

Task: *arg*

arg

Max number of retries has been reached on system level.

System Misc, NoOfRetry=*arg*

Recommended actions

Increase parameter value to avoid reaching the limit.

110482, Sensor calibration data updated

Description

Sensor calibration data updated in task: *arg*

Active calibration data: *arg=arg*

110490, Weld Error Recovery IO Error

Description

Task: *arg*

arg

The breakout input was left on. The external device must reset the signal.

The Weld Error Recovery IO interface is disabled. Respond to FlexPendant.

110491, Weld Error Recovery IO Error

Description

Task: *arg*

arg

Invalid response *arg* supplied on signal agiWER_Response.

Valid range: (*arg*)

Request has been changed to Abort.

110492, Weld Error Recovery IO Error

Description

Task: *arg*

arg

Escape option is not available. Request has been changed to MoveOut.

110493, Weld Error Recovery IO Error

Description

Task: *arg*

arg

System is waiting for the diWERAck input to go low.

a) $1 < (la / v) * f < 200$ (internal track buffer size)

b) $la / v > 0.5$ s (internal delay)

Recommended actions

Check sensor mounting, sensor setup, travel speed and trackdata.

Recovery: You might want to handle errno *arg* in your error handler.

110494, Weld Error Recovery IO Error

Description

Task: *arg*

arg

Supplied value on giWER_Response (*arg*) is not within range:
(*arg*)

Request has been changed to: *arg*

110501, Track start error

Description

Task: *arg*

arg

Not any valid correction data from the sensor while executing the current ArcX instruction.

Recommended actions

Check sensor setup and trackdata. Recovery: You might want to handle errno *arg* in your error handler.

110495, Weld Error Recovery IO Interface

Description

Task: *arg*

The Weld Error Recovery IO Interface is successfully configured for *arg*

and is ready for use.

110502, Track correction error

Description

Task: *arg*

arg

The correction is too big.

Recommended actions

1. Check that the seam definitions in the program reflect the actual seams. 2. Increase 'max_corr' in 'trackdata'. Recovery: You might want to handle errno *arg* in your error handler.

110496, IO signal not found

Description

Task: *arg*

Configured IO signal does not exist in system.

Configured parameter: *arg*.

Signal name: *arg*.

Recommended actions

Check the installation of PROC domain parameters.

110500, Track error

Description

Task: *arg*

arg

The maximum distance ['blindcount'(trackdata)] without new corrections is exceeded. The robot controller has not been able to calculate valid corrections.

Consequences

The robot is stopped.

Probable causes

1. The sensor does not send valid measurements, i.e. cannot see the seam.
2. the relationship between sensor look-ahead (la), sensor frequency (f) and travel speed (v) is bad. It has to fulfill

110503, Illegal arcflydata specified

Description

Task: *arg*

arg

The value of parameter *arg* in arcflydata is *arg*

Consequences

Flying *arg* will not work correctly with this value.

Recommended actions

Increase the value of *arg* in arcflydata to a value greater than zero.

110504, Illegal flydata combination

Description

Task: *arg*

arg

Flying *arg* is not possible with finepoint.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Consequences

There will be no flying *arg*

Recommended actions

Change to zonepoint in ArcXarg instruction.

110505, Illegal zonepoint specified

Description

Task: *arg*

arg

A zonepoint is used in the weld *arg* instruction without any optional arcflydata in the instruction.

Consequences

The zonepoint will be converted to a finepoint.

Recommended actions

Add the optional argument arcflydata to the ArcXarg instruction if flying *arg* is wanted.

110506, Illegal arcflydata combination

Description

Task: *arg*

arg

The arcflydata parameter *arg* has a value which is greater than the value of parameter *arg*.

Consequences

The value of *arg* will be reduced to the value of *arg*.

Recommended actions

Reduce the value of parameter *arg* so that the value is lower than or equal to the value of parameter *arg*.

110507, RW Arc EIO signal error

Description

Task: *arg*

arg

The value of *arg* for signal *arg* is below its minimum logical value (*arg*)

Consequences

The value of signal *arg* will be set to the minimum value *arg*.

Recommended actions

Check the values of *arg* components in seamdata and welldata. Change the value or change the min logical parameter for signal *arg* to avoid this message.

110508, Wirestick supervision

Description

Task: *arg*

arg

Wirestick supervision signal set at end of welding.

Recommended actions

Check, if the wire got stuck at the object.

Recovery: You might want to handle errno *arg* in your errorhandler.

110509, Weld Repair notification

Description

Welding was interrupted in task *arg* at seam *arg*

An attempt to re-weld the interrupted seam will now be made.

Program ref. *arg*

Probable causes

Disturbances in the welding process

110510, Weld Repair notification

Description

The weld seam *arg* was successfully re-welded in task *arg*

Program ref. *arg*

110511, Weld Repair notification

Description

The weld seam *arg* in procedure *arg* in task *arg* was skipped.

The maximum number of weld errors (*arg*) on seam *arg* was reached.

Program ref. *arg*

110512, Weld Repair notification

Description

The weld seam *arg* in procedure *arg* in task *arg* was skipped.

The maximum number of retries (*arg*) on seam *arg* was reached.

Program ref. *arg*

110513, Error in Arc instruction synchronization

Description

Task: *arg*

arg

This robot is welding synchronized with a non-welding external axis or robot in task *arg*

Continues on next page

The weld end instructions are synchronized, so the corresponding ArcMoveXXX instruction must be used in the non-welding external axis or robot.

Recommended actions

Use ArcMoveXXX instruction in the non-welding external axis or robot.

110514, Illegal superv_distance specified**Description**

Task: *arg*

arg

The value of parameter superv_distance is *arg*

Consequences

Flying start will not work correctly with this value.

Recommended actions

Increase the value of superv_distance to a value greater than zero.

Probable causes

No equipments are defined in the 'Spot Equipments' configuration.

Recommended actions

Add one or more equipment instance(s) in the 'Spot Equipments' configuration.

110515, Illegal flyStart parameter combination**Description**

Task: *arg*

arg

FlyStart can not be used at the same time as *arg*.

Consequences

Flying start will not be enabled.

Recommended actions

Remove *arg* if flying start shall be used

110600, Spot Startup completed**Description**

Spot startup was completed without errors.

Task: *arg*

110601, Invalid configuration**Description**

Task: *arg*

The number of configured equipments in the system are less than one(1).

Number of equipments: *arg*.

Consequences

It will not be possible to run any spot instructions.

110602, Invalid configuration**Description**

Task: *arg*

The number of configured equipments are more than 10.

Number of equipments: *arg*.

Consequences

It will not be possible to run any spot instructions.

Probable causes

Too many equipments are defined in the 'Spot Equipments' configuration.

Recommended actions

Remove equipment instances in the 'Spot Equipments' configuration.

110603, Optional argument error**Description**

Task: *arg*

No optional argument has been selected.

At least one optional argument is required.

Consequences

The instruction will not work correctly.

Recommended actions

Select an optional argument for this instruction.

110604, User hook execution time**Description**

Task: *arg*

The execution time for this user hook is too high.

User hook: *arg*

Execution time greater than: *arg* s.

Recommended actions

Reduce time consuming code in the user routine.

110605, Pre-position value error**Description**

Task: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

The optional argument PrePos are less than zero(0).

Consequences

It will not be possible to run this instruction until the argument are changed.

Recommended actions

Change the value to a higher value than zero (0).

110606, Gun not activated

Description

Task: *arg*

The servo gun *arg* is not activated.

Consequences

It will not be possible to run any spot instructions until the servo gun is activated.

Probable causes

The servo gun has not been activated before trying to run this instruction.

Recommended actions

Activate the servo gun *arg*.

Use the instruction 'ActUnit' to activate the servo gun, or set the 'Activate at Start Up' motion parameter to yes.

110607, Gun position not initialized

Description

Task: *arg*

The gun position is not initialized for the servo gun *arg*.

A gun init calibration is needed to find the contact position of the gun.

Consequences

It will not be possible to run any spot instructions until a gun init calibration is done.

Probable causes

The servo gun has probably been fine calibrated and a gun init calibration has not been done.

Recommended actions

1. Run the service routine 'ManualServiceCalib' to find the contact position of the gun, use option 2 - Initialize the servo gun position.
2. If tuning a gun it is possible to turn off the gun synchronization check, set the motion parameter 'Sync check off' to Yes.

Location: Configuration/Motion/SG Process.

110608, Gun position not synchronized

Description

Task: *arg*

The gun position is not synchronized for the servo gun *arg*.

A gun synchronization calibration is needed to find the contact position of the gun.

Consequences

It will not be possible to run any spot instructions until a gun synchronization calibration is done.

Probable causes

The revolution counters for the servo gun has probably been updated and a gun synchronization calibration has not been done.

Recommended actions

1. Run the service routine 'ManualServiceCalib' to find the contact position of the gun, use option 1 - Synchronize the servo gun position.
2. If tuning a gun it is possible to turn off the gun synchronization check, set the motion parameter 'Sync check off' to Yes.

Location: Configuration/Motion/SG Process.

110609, Gundata array index out of bounds

Description

Task: *arg*

The configured data size of the gundata array is wrong.

Current size: *arg*

Probable causes

Wrong gundata data size has been defined, it does not match the number of configured gun equipments in the system.

Recommended actions

Check that the configured gundata array has the correct size.

110610, Gun name error

Description

Task: *arg*

The servo gun *arg* specified in gundata {*arg*}, does not exist in the motion parameters.

Consequences

It will not be possible to run any spot instruction until a valid servo gun name (mecunit) is specified in gundata.gun_name.

Continues on next page

Probable causes

The specified gun name does not match any mechanical unit in the system or no configuration parameters for a servo gun has been loaded.

Recommended actions

1. Load configuration parameters for the servo gun.
2. Run the service routine 'ManualGunSearch' to search the system for servo guns and to update the gun name parameter in gundata,

110611, Invalid data value

Description

Task: *arg*

Invalid value of data *arg*. Allowed values are *arg* to *arg*

Current value is *arg*

Consequences

It will not be possible to run this instruction until this data is changed.

Probable causes

An invalid value is used.

Recommended actions

Change the value of *arg*.

110612, Invalid robot number

Description

Task: *arg*

Invalid robot number, robot number *arg*.

Recommended actions

Check that *arg* was done.

110613, Invalid error text id

Description

Task: *arg*

Invalid error number Id

Invalid use of *arg*.

Current Error Id: *arg*

Probable causes

The error number id was larger than *arg*.

Recommended actions

Don't use *arg*. This routine is for the Spot application use only.

110614, Water flow supervision alarm

Description

Task: *arg*

The water flow sensors indicate an error.

Consequences

Water has been turned off.

Recommended actions

Check the water circuit, and the water and air unit.

110615, Gun control in motors off

Description

Task: *arg*

It is not possible to close or open the servo gun *arg* in motors off or emergency stop state.

Consequences

The gun has not opened or closed.

Probable causes

The system was set to motors off state during process for some reason.

Recommended actions

Go to motors on state again and restart the instruction.

110616, Weld position aborted

Description

Task: *arg*

The weld position was aborted, current rob target *arg*.

Current gun: *arg*

Consequences

This weld position was not welded.

The strength of the welded object may have been reduced.

Probable causes

The spot instruction was aborted for some reason, the PP was moved or the instruction was skipped.

Recommended actions

Check that it was OK to skip this position.

110617, Invalid gun type

Description

Task: *arg*

Invalid value of the gun type data in gundata {*arg*}.

Allowed values for the gun type are: 1 = servo gun or 2 = pneumatic gun.

Current value is *arg*.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Consequences

This instruction will not work properly.

Recommended actions

Change the value of the gun type parameter in gundata {arg}.

110618, Invalid gun pre-close time

Description

Task: arg

Invalid value of the pre closing time parameter in gundata {arg}.

Allowed interval: 0 to max arg s.

Current value: arg s.

Current gun: arg

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the pre closing time parameter in gundata {arg}.

110619, Invalid gun pre-equalizing time

Description

Task: arg

Invalid value of the pre equalizing time in gundata {arg}.

Allowed interval: 0 to max arg s.

Current value: arg s.

Current gun: arg

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of pre equalizing time in gundata {arg}.

110620, Invalid weld timeout

Description

Task: arg

Invalid value of the weld timeout parameter in gundata {arg}.

Allowed interval: arg to arg s.

Current value: arg s.

Current gun: arg

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the weld timeout parameter in gundata {arg}.

110621, Invalid tip force

Description

Task: arg

Invalid value of the tip force parameter in spotdata.

Allowed values are: arg to max arg.

Current value: arg.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the tip force parameter in spotdata or check that the correct external data is used via the gun force group input (GI).

110622, Invalid plate thickness

Description

Task: arg

Invalid value of the plate thickness parameter in spotdata.

Allowed values are: 0 to max arg mm.

Current value: arg mm.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the plate thickness parameter in spotdata or check that the correct external data is used via the plate thickness group input (GI).

110623, Invalid plate tolerance

Description

Task: arg

Invalid value of the plate tolerance parameter in spotdata.

Allowed values are: 0 to max arg mm.

Current value: arg mm.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Continues on next page

Recommended actions

Change the value of the plate tolerance parameter in spotdata or check that the correct external data is used via the plate tolerance group input (GI).

110624, Invalid program number**Description**

Task: *arg*

Invalid value of the weld timer program number parameter in spotdata.

Allowed values are: 0 to max *arg*.

Current value: *arg*.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Probable causes

The program number parameter in spotdata has an invalid value.

Recommended actions

Change the value of the program number parameter in spotdata or check that the correct value is used as targetid or spotid.

110625, Invalid simulation type**Description**

Task: *arg*

Invalid value of the simulation type parameter in simdata.

Allowed values are: 0 to *arg*.

Current value: *arg*.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the simulation type parameter in simdata

110626, Invalid tip force**Description**

Task: *arg*

Invalid value of the tip force parameter in forcedata.

Allowed values are: 0 to *arg*.

Current value: *arg*.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the tip force parameter in forcedata.

110627, Invalid plate thickness**Description**

Task: *arg*

Invalid value of the plate thickness parameter in forcedata.

Allowed values are: 0 to max *arg* mm.

Current value: *arg* mm.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the plate thickness parameter in forcedata.

110628, Invalid plate tolerance**Description**

Task: *arg*

Invalid value of the plate tolerance parameter in forcedata.

Allowed values are: 0 to *arg* mm.

Current value: *arg* mm.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the plate tolerance parameter in forcedata.

110629, Invalid force time**Description**

Task: *arg*

Invalid value of the force time parameter in forcedata.

Allowed values are: *arg* to *arg* s.

Current value: *arg* s.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the force time parameter in forcedata.

110630, Weld complete timeout**Description**

Task: *arg*

arg

Current robttarget: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Current gun: *arg*

Consequences

The weld was not completed.

Probable causes

The weld controller did not reply with weld complete within the configured time.

Recommended actions

1. Try to reweld the position.
2. Check the weld controller for any errors.
3. Increase the weld timeout parameter in gundata {*arg*}.

110631, External weld fault reported

Description

Task: *arg*

arg

Current robtarget: *arg*

Current gun: *arg*

Consequences

The weld was not completed.

Probable causes

The weld controller reported an error and stopped the weld sequence.

Recommended actions

1. Check the event log for additional weld timer error logs (if Bosch).
2. Check the weld controller for any errors.

110632, Tip wear ratio not allowed

Description

Task: *arg*

Tip wear ratio only allowed when using the ReCalcTcp method.

Consequences

It will not be possible to run this instruction.

Recommended actions

Check that the tip wear ratio parameter is set to 'Deactivated' before running this routine. Configuration - Process - Spot Gun Equipment

110633, No mechanical unit

Description

Task: *arg*

arg

The servo gun does not exist in the motion parameters, no servo gun parameters has been loaded.

Current gun name: *arg*.

Consequences

It will not be possible to run any spot instructions until a configuration for a servo gun is added.

Probable causes

No configuration for servo gun parameters has been loaded.

Recommended actions

Load configuration for servo gun.

110634, Configuration data limit error

Description

Task: *arg*

The data value is outside the limit.

Recommended actions

Change the value.

110635, Tip position error

Description

Task: *arg*

Tip position error.

arg

Current gun: *arg*

Probable causes

1. The geometry of the plates are wrong or the tips are damaged.
2. The value of the plate thickness parameter in *arg* is not the same as the actual thickness of the plates.

Recommended actions

1. Check that the thickness of the plates are correct and corresponds to the value in the plate thickness parameter in *arg*.
2. Check that the tips are OK.

110636, Process error

Description

Task: *arg*

arg

Current gun: *arg*

Consequences

The position was not welded.

Probable causes

An error occurred before the weld process was started in the connected equipment.

Continues on next page

Recommended actions

Check the connected equipment.

110637, Text index too high**Description**

Task: *arg*

Text index out of bounds in SwTextGet.

Current index number: *arg*

Probable causes

The index number is too high.

Recommended actions

Change the index number.

110638, Weld program valid timeout**Description**

Task: *arg*

The weld controller did not reply with 'valid weld program' signal within the configured time.

Current robtarget: *arg*

Current weld program: *arg*

Consequences

The weld will not start until the 'valid weld program' signal is set by the weld controller.

Recommended actions

1. Check that the weld program valid signal is set in the weld controller.
2. Check that the configured program valid timeout time is big enough.

110639, Configuration error**Description**

Task: *arg*

Process configuration data can not be found in cfg.

Cfg path: *arg*

Consequences

It will be possible to run the application, but internal default values will be used instead of the missing configuration data.

Probable causes

No process configuration data has been loaded.

Recommended actions

Load the missing configuration data and restart the system.

110640, Missing signal error**Description**

Task: *arg*

The signal *arg* is missing in the EIO configuration.

Consequences

It will not be possible to use some internal functionality.

Probable causes

The signal *arg* was removed from the EIO configuration.

Recommended actions

Add the missing signal *arg*.

110641, Invalid simulation time**Description**

Task: *arg*

Invalid value of the simulation type parameter in simdata.

Allowed values are: 0 to *arg* s.

Current value: *arg* s.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the simulation type parameter in simdata.

110642, Reduced speed not allowed**Description**

Task: *arg*

It is not possible to run with reduced speed when software equalizing is active.

Allowed value (in percent): *arg* %.

arg

arg

Consequences

The instruction will not work until this value is changed.

Probable causes

The speed was probably lowered by the operator.

Recommended actions

Set the speed to *arg* %.

110643, Gun conflict error**Description**

Task: *arg*

More than one robot try to use the same gun at the same time.

arg

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Consequences

All the robots in the system are stopped.

Probable causes

The same gun is used from more than one motion task.

Recommended actions

Change the gun number or wait for the other robot to finish.
You have to deactivate the used gun before another robot can use it.

110644, Reference measurement already done

Description

Task: *arg*

A reference measurement has already been done.

Instruction: *arg*

Probable causes

This instruction was run a second time with the reference switch selected.

Recommended actions

If a new reference has to be done because the reference position has been moved, the \RefChange switch should be used instead.

110645, Instruction error

Description

Task: *arg*

Software equalizing error.

The instructions SpotML and SpotMJ can not be used with the software equalizing functionality activated.

Consequences

It is not possible to run this instruction with software equalizing activated.

Recommended actions

Turn off the software equalizing configuration for the specific gun(s) and run the instruction without software equalizing.

Configuration - Process - Spot Gun Equipment

110646, Invalid release distance

Description

Task: *arg*

Invalid value of the release distance parameter in gundata {*arg*}.

Allowed interval: 0 to max *arg* mm.

Current value: *arg* mm.

Current gun: *arg*

Consequences

It will not be possible to run any spot instructions until this value is changed.

Recommended actions

Change the value of the release distance parameter in gundata {*arg*}.

110647, Invalid deflection distance

Description

Task: *arg*

The calculated deflection distance for this gun is invalid.

Allowed interval: -*arg* to max *arg* mm.

Current value: *arg* mm.

Current gun: *arg*

$\text{deflection} = \text{spotdata.tip_force} * \text{gundata}\{\text{arg}\}.deflection_dist / \text{gundata}\{\text{arg}\}.deflection_force$

Consequences

The instruction will not work until this value is changed.

Probable causes

A too big gun deflection value has been entered in gundata {*arg*}, or the deflection force in gundata is set too low.

Recommended actions

Check the deflection distance and the deflection force in gundata {*arg*}.

110648, Invalid deflection time

Description

Task: *arg*

The value of the deflection time parameter in gundata {*arg*} is invalid.

Allowed values are: > 0 to max *arg* s.

Current value: *arg* s.

Current gun: *arg*

Consequences

The instruction will not work until this value is changed.

Probable causes

A too high gun deflection time has been specified in gundata {*arg*}.

Recommended actions

Check the value of the deflection time parameter in gundata {*arg*}.

Continues on next page

110649, I/O signal error

Description

Task: *arg*

It is not possible to set the signal, the I/O unit is lost.

Consequences

The signal will not be set.

Probable causes

The power to the IO unit is lost or the cable is damaged.

Recommended actions

1. Check the power to IO units.
2. Check that the cabling is OK.

Current value: {*arg*} mm.

Recommended actions

1. Check that the correct tips are mounted on the gun.
2. Check that the maximum allowed supervision value is big enough.

110652, Touch up force error

Description

Task: *arg*

The calculated touch up force is to high!

Overload at least of axis *arg*.

Probable causes

The touch up contact force is probably too high.

Recommended actions

Lower the setup data for touch up contact force.

Configuration/Process/Spot SoftWare Equalizing/MeasureWearL Touchup force.

110650, Search error

Description

Task: *arg*

Touch up error, no surface, or sensor signal was found during the search sequence.

Current gun: *arg*

Consequences

The tool will not be updated.

Probable causes

Check for missing or wrong tips and the reference plate is located in the correct position.

Recommended actions

1. Check that the correct tips are mounted on the gun.
 2. Check that the reference plate is in the correct position, or check that sensor is working properly.
 3. Increase the 'MeasureWearL movein distance' parameter.
- Configuration/Process/Spot SoftWare Equalizing

110653, Unexpected tip size moveable tip

Description

Task: *arg*

New moveable tip with unexpected size, the size of the tips exceeds the configured tip change supervision value.

Difference between new and old (worn) tips: *arg* mm.

Tip change tolerance: *arg* to *arg* mm.

Current gun: *arg*

Probable causes

1. Tips with unexpected size was mounted on the gun.
2. The size exceeds the maximum allowed value defined in the tip change supervision configuration data.

Configuration/Process/Spot Gun Equipment/Tip change supervision value.

Recommended actions

1. Check that the correct tips are mounted on the gun.
2. Check that the maximum allowed supervision value is big enough.

110651, Unexpected tip size after change

Description

Task: *arg*

New tips with unexpected size, the size of the tips exceeds the configured tip change supervision value.

Difference between new and old (worn) tips: *arg* mm.

Tip change tolerance: *arg* to *arg* mm.

Current gun: *arg*

Probable causes

Tips with unexpected size was mounted on the gun or the size exceeds the maximum allowed value defined in the tip change tolerance configuration data.

Configuration/Process/Spot Gun Equipment/Tip change supervision value.

110654, Unexpected tip size fixed tip

Description

Task: *arg*

New fixed tip with unexpected size, the size of the tips exceeds the tip change supervision value.

Difference between actual tip and reference tip: *arg* mm.

Tip change tolerance: *arg* to *arg* mm.

Current gun: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Probable causes

1. Tips with unexpected size was mounted on the gun.
2. The size exceeds the maximum allowed value defined in the tip change supervision configuration data.

Configuration/Process/Spot Gun Equipment/Tip change supervision value.

Recommended actions

1. Check that the correct tips are mounted on the gun.
2. Check that the maximum allowed supervision value is big enough.

110655, Tip wear out of range moveable tip

Description

Task: *arg*

Tip wear out of range, the tip wear exceeds the configured tip wear supervision value.

Actual tip wear (moveable tip): *arg* mm.

Tip wear tolerance: *arg* to *arg* mm.

Current gun: *arg*

Probable causes

The current tip wear exceeds the maximum allowed value defined in the tip wear supervision configuration data.

Configuration/Process/Spot Gun Equipment/Tip wear supervision value.

Recommended actions

Check that the maximum allowed supervision value is big enough.

110656, Tip wear out of range fixed tip

Description

Task: *arg*

Tip wear out of range, the tip wear exceeds the configured tip wear supervision value.

Actual tip wear (fixed tip): *argmm*.

Tip wear tolerance: *arg* to *arg* mm.

Current gun: *arg*

Probable causes

The current tip wear exceeds the maximum allowed value defined in the tip wear supervision configuration data.

Configuration/Process/Spot Gun Equipment/Tip wear supervision value.

Recommended actions

Check that the maximum allowed supervision value is big enough.

110657, Independent mode error

Description

Task: *arg*

It is not possible to use independent gun mode in Spot instructions when software equalizing is activated.

Current gun: *arg*

Consequences

It will not be possible to run any spot instruction until the independent mode is deactivated.

Probable causes

The independent gun mode is activated.

Recommended actions

Reset the independent mode with the instruction 'IndGunMoveReset'.

110658, Singularity error

Description

Task: *arg*

The robot is close to singularity. The performance of the Software Equalizing will be poor.

Consequences

The performance of the Software Equalizing will be poor.

Probable causes

The robot is close to singularity.

Recommended actions

Reorient the robot or move the point.

110659, Robot outside working area

Description

Task: *arg*

The robot is outside it's working area.

Consequences

The position is not possible to reach.

Probable causes

The robot is outside it's working area or the robot is very close to it when the gun arm deflection compensation is working.

Recommended actions

Reorient the robot or move the point.

110660, User module version warning

Description

Task: *arg*

Continues on next page

The version number of the user module(s) are older than the current spot application version

Current version of the spot application, *arg*.

Currently loaded user module and version number, *arg*, *arg*.

Consequences

Some functionality might not work correctly since the template user modules has changed since previous RobotWare releases. There is a risk that improvements and/or corrections added since previous RobotWare releases are unavailable.

Probable causes

The user modules originates from a backup taken from an older system.

Recommended actions

1. Compare and upgrade the user modules to the latest version supplied in this RobotWare release.
2. Load the correct(ed) module(s) and Reset RAPID.

110661, Signal label error

Description

Task: *arg*

The 'SignalLabel' name *arg* is not defined in the I/O configuration.

Probable causes

The 'SignalLabel' name is not defined in the I/O configuration.

Recommended actions

1. Check that the 'SignalLabel' is defined in the I/O configuration.
2. Add the missing 'SignalLabel'.

110662, Missing user routine

Description

Task: *arg*

A Spot user routine is missing, routine *arg*.

Consequences

This software option may not work correctly without this routine.

Probable causes

The module with the routine is not loaded or the routine has been removed from the module.

Recommended actions

1. Check that the module with the routine is loaded.
2. Load or add the missing module or routine.

110663, User data missing

Description

Task: *arg*

A Spot user data is missing, data *arg*.

Consequences

This software option may not work correctly without this data.

Probable causes

The module with the data is not loaded or the data has been removed.

Recommended actions

1. Check that the module with the data is loaded.
2. Load or add the missing module or data.

110664, Software equalizing active error

Description

Task: *arg*

It is not possible to run synchronized Spot instructions when the software equalizing mode is activated.

It is only possible to run spot instructions with software equalizing activated in semi coordinated mode.

Consequences

It will not be possible to run any spot instructions with software equalizing activated until the synchronized mode is disabled.

Probable causes

Synchronized mode is selected in the spot instruction.

Recommended actions

Turn off software equalizing to be able to run in synchronized mode or change the spot instructions to semi coordinated movements instead.

110665, *arg*

Description

Task: *arg*

arg

arg

Recommended actions

arg

110666, Servo gun already closed

Description

Task: *arg*

Can not close a closed servo gun, the servo gun *arg* is not open!

Probable causes

The gun is already closed.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

Open the gun before trying to close it.

110667, Gun force calibration error

Description

Task: *arg*

Force calibration failed for servo gun *arg*.

Check the force calibration values and try again. Do not restart system until a valid force calibration is made.

Consequences

The force calibration data will not be saved to the motion parameters.

Recommended actions

Check the values and try to do a force calibration again.

110668, Plate thickness error ignored

Description

Task: *arg*

arg

The current plate thickness error was ignored.

Current gun: *arg*

argarg

Probable causes

The operator probably ignored the thickness error.

Recommended actions

Check that it was OK to ignore the thickness error.

110669, Gun index number out of range

Description

Task: *arg*

The gun number *arg* is not a valid gun number, the gun index is out of range.

Allowed values are: *arg* to max *arg*.

Consequences

It will not be possible run this instruction until this value is changed.

Probable causes

A gun index number that was out of range was programmed in the instruction.

Current configured size of current gundata is *arg*.

Recommended actions

1. Change the gun index number in the instruction.
2. Increase the number of equipments in the configuration, and the spot application data types if needed.

110670, User module changed

Description

Task: *arg*

The routine *arg* has a newer syntax, the user module has changed since previous RobotWare releases.

Current module: *arg*

Current version: *arg*

Consequences

This instruction might not work correctly, some data(s) may not be updated correctly.

There is a risk that improvements and/or corrections added since previous RobotWare releases are unavailable.

Probable causes

The user modules probably originates from an backup taken from an older system.

Recommended actions

Compare and upgrade the user modules to the latest version supplied in this RobotWare release.

110671, Module not saved

Description

Task: *arg*

Could not save the module *arg*.

Consequences

The module *arg* was not saved.

Data needed for the process was not saved and will be lost if Reset RAPID is done.

Probable causes

The module does not exist, or the disk is full or the file is write protected.

Recommended actions

1. Check that the module exists in the specified location on the disk.
2. Try to save the module manually from the FlexPendant.

110672, Weld program GO limit

Description

Task: *arg*

The weld program number is out of limits for the defined weld program group output (GO).

Current value: *arg*.

Consequences

It will not be possible to run any spot instructions until this value is changed.

Continues on next page

Probable causes

The weld program signal group size is smaller than the specified weld program.

Recommended actions

1. Increase the size of the weld program output group.
2. Decrease the weld program number.

110673, Tool load undefined**Description**

Task: *arg*

The current used tool seems to have undefined load data.

The load of the tool is less than min. configured value and/or the center of gravity is not defined correctly.

arg

arg

arg

Consequences

It will not be possible run this instruction until a correctly defined tool is used.

Probable causes

'LoadIdentify' for this tool has not been done.

Recommended actions

Check that the tool is correctly defined before running this routine. Run the 'LoadIdentify' routine.

110674, Gun type error**Description**

Task: *arg*

This routine can not be used with this type of gun.

Current gun type: *arg*.

Consequences

It will not be possible run this instruction with this gun type is used.

Probable causes

The gun type parameter in the gun equipment configuration is not set correctly.

Recommended actions

Check that the gun type parameter is set to the correct type before running this routine. Configuration - Process - Spot Gun Equipment

Possible gun types: Servo gun or Pneumatic gun

110675, Process task error**Description**

Task: *arg*

The number of guns exceeds the number of activated process tasks.

Current gun: *arg*.

Consequences

It will not be possible to weld with more guns than the number of activated process tasks.

Probable causes

Faulty configuration.

Recommended actions

Rebuild the system with the 'Multiple Gun Support' selected.

110676, Power on sequence failed**Description**

Task: *arg*

An error has occurred during startup of the system.

The power on sequence has not been done.

Consequences

The spot application will not work correctly.

Recommended actions

1. Check the event log for other errors occurring at the same time.

110677, Instruction aborted**Description**

Task: *arg*

The instruction was aborted.

Instruction: *arg*

Consequences

Some data may not have been correctly updated.

Probable causes

The instruction was aborted by the operator and/or the PP was moved.

Recommended actions

Check that it was OK to abort this instruction.

110678, Reference measurement not done**Description**

Task: *arg*

A reference measurement must be done before a tip wear or tip change measurement can be done.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Instruction: *arg*

Probable causes

This instruction was run for the first time without the reference switch selected.

Recommended actions

Run this instruction with the reference switch selected first, \Reference.

110679, Undefined signal

Description

Task: *arg*

This signal is not defined in the I/O configuration.

Signal: *arg*

Recommended actions

Check that the correct name is used in the setup routine or in the I/O configuration.

110680, Max gun force exceeded

Description

Task: *arg*

The externally ordered gun force is too high and will be ignored.

Ordered force: *arg N*.

Current force: *arg N*.

Maximum force: *arg N*.

Consequences

Execution is stopped.

Probable causes

The ordered gun force is too high and exceeds the maximum allowed force for this gun.

Recommended actions

Check the weld program in the timer or the setup data 'gun_force_factor' value.

110681, Gun force change error

Description

Task: *arg*

It is not possible to change servogun force.

The parameters in the force calibration table are not correct.

squeeze_pos_1 = *arg mm*.

squeeze_pos_2 = *arg mm*.

Consequences

Execution is stopped.

Probable causes

An old motion configuration file is being used, or a force calibration has not been done.

Recommended actions

Perform a new force calibration or load valid servogun parameters.

110682, Too low gun force

Description

Task: *arg*

The ordered gun force is lower than the minimum allowed value.

Ordered force: *arg N*.

Minimum force: *arg N*.

Maximum force: *arg N*.

Current robtarget: *arg*

Consequences

The weld quality in this position will be poor.

Recommended actions

Check that the correct force value is used in the instruction or ordered externally.

110683, SoftMove speed warning

Description

Task: *arg*

The selected speed is lower than recommended.

SoftMove equalizing functionality will not work optimal at too low speed.

Speed override (TP): *arg*

VelSet override: *arg*

Consequences

Low speed will in many cases increase the inner friction of the robot and that can decrease SoftMove equalizing performance.

Recommended actions

Increase the speed.

110684, Required signals missing

Description

Task: *arg*

Required signals are missing, or I/O device is not running.

The signals 'start weld', 'weld complete', 'stop weld' and 'process run' are required to run the application.

Consequences

It is not possible to run the application without one of these signals.

Continues on next page

Recommended actions

1. Check that the configured I/O device is running.
2. Add the missing signals to the weld equipment and/or equipment configuration, and restart the system.

110685, Sensor signal missing**Description**

Task: *arg*

No MeasureWearL sensor signal has been configured.

Consequences

It is not possible to run the instruction without the signal.

Recommended actions

Add the missing signal to the gun equipment configuration, and restart the system. Configuration - Process - Spot Gun Equipment

110686, Invalid deflection force**Description**

Task: *arg*

Invalid value of the deflection force parameter in gundata {*arg*}.

Allowed interval: 0 to max *arg* *arg*.

Current value: *arg* *arg*.

Current gun: *arg*

Consequences

It will not be possible to run any spot instructions until this value is changed.

Probable causes

1. Used deflection force is outside limits.
2. Deflection distance is used without a specified deflection force.

Recommended actions

Change the value of the deflection force parameter in gundata {*arg*}

110687, Event Preset Time not zero**Description**

Task *arg*.

Event Preset Time for *arg* is set to *arg*.

Consequences

Process cycle time will be affected.

Recommended actions

Unless Event Preset Time for *arg* was set to *arg* for a reason, consider setting it to 0.

110688, Invalid tw_ref_dist value**Description**

Sanity check for tw_ref_dist for Gun *arg* failed. Values should be between 0 and *arg* mm.

Consequences

Tip Wear management will not work as intended.

Recommended actions

The values are normally changed by SpotWare, and should not be changed by the user in most cases. A new tip wear reference measurement might be required.

110689, Force calibration not done**Description**

Task: *arg*.

The gun is not force calibrated and/or a template servogun configuration file is loaded. If using a template file an initial force table can be set by running the service routine 'ManualForceCalib' or 'ManualServiceCalib'.

Current gun: *arg*.

Consequences

Execution is stopped.

Recommended actions

Set an initial force table or perform a force calibration of the gun with the service routine 'ManualForceCalib'.

110700, No weld internal.**Description**

Task:*arg*

arg

Weld signal switched off at programming terminal.

Recommended actions

Check programming unit setting Operating mode for Weld on/off, int.(S)/Weld/No weld (T).

110701, No weld external.**Description**

Task:*arg*

arg

External weld signal was deactivated.

Recommended actions

Check signal at weld external input.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

110702, The weld sequence is inhibited, weld schedule stopped.

Description

Task:*arg*

arg

The started program was inhibited for the sequence/schedule

Recommended actions

Enable program at the programming terminal at Operation - Modify - Programming - Sequence Setup Inhibit Sequence (S)/Start- Inhibit (T) for all programs or Inhibit Sequence (P)/Start-Inhibit (P) for one program - check program selection, select proper program.

110703, No valid weld program, no schedule programmed.

Description

Task:*arg*

arg

wrong program selected - invalid spot selection - invalid parameters in started program

Recommended actions

Check program selection - check spot selection - check value range of the following parameters: power unit number, electrode/stepper number, program number.

110704, The battery backup is low.

Description

Task:*arg*

arg

The buffer battery voltage has dropped

Recommended actions

Replace the backup battery in the weldtimer.

110705, Memory has been deleted.

Description

Task:*arg*

arg

All data of this weld timer has been deleted: - new timer firmware was copied to system - battery is low or defective.

Recommended actions

Copy data (Operation - Services - Restore/Download) if the error occurs repeatedly, replace timer.

110706, There is a hardware fault.

Description

Task:*arg*

arg

Defective module. When booting, a module is detected which does not match the firmware: - a firmware was introduced into the weld timer which is not permitted for the existing hardware.

Recommended actions

Replace module or timer - replace module - load proper firmware to the timer.

110707, External temperature too high.

Description

Task:*arg*

arg

Message of an external temperature input: - cable between thermostatic switch and timer interrupted - insufficient cooling - excessive welding heat/%l / duty cycle

Recommended actions

check cable/connector - check cooling circuit - reduce welding heat.

110708, Stop circuit open, no +24V.

Description

Task:*arg*

arg

+24V supply at stop circuit input missing.

Recommended actions

Close stop contact - check +24V supply at the inputs of the stop circuit.

110709, Circuit breaker tripped, weld without command.

Description

Task:*arg*

arg

The timer module has activated the main switch relay: the related main switch/circuit breaker is tripped.

Recommended actions

-

110710, Current feedback open.

Description

Task:*arg*

Continues on next page

arg

Broken sensor cable - detached plug connections - incorrect connector assignment - defective sensor.

Recommended actions

Replace cable - check plug-in connections - check connector assignment - replace sensor.

110711, Current feedback short circuit.

Description

Task:*arg*

arg

Squeezed sensor cable - incorrect connector assignment - defective sensor.

Recommended actions

Replace cable - check connector assignment - replace sensor.

110712, No primary voltage on first half wave.

Description

Task:*arg*

arg

No primary voltage was measured in KUR mode.

Recommended actions

Check connectors and cables.

110713, No current, weld 1 to 3.

Description

Task:*arg*

arg

Electrodes not closed - no electrical contact at the point to be welded - contamination of sheets - use of sealant.

Recommended actions

Check closing mechanisms (robot, machine) - check position and pressure of electrodes - clean sheets - check conductivity.

110714, Current is too low, weld 1 to 3.

Description

Task:*arg*

arg

Current measured is below tolerance band: - tolerance band too narrow - programmed value too high, e.g., because of stepping - contamination of electrodes - contamination of sheets - bad electrode positioning - welding transformer too small.

Recommended actions

Check tolerance band - check programmed value, stepper values - repeat weld, clean electrodes - repeat weld, clean sheets - improve positioning - change over or replace welding transformer.

110715, Current is too high, weld 1 to 3.

Description

Task:*arg*

arg

Current measured exceeds tolerance band: - programmed value jump to lower current values - handling of different sheet thicknesses or sheet layers - variant electrode pressure conditions - variant resistances (impedance) in secondary circuit, e.g. shunt resistor - mains voltage fluctuations.

Recommended actions

Increase tolerance band, reduce programmed value jumps - use several programs with different parameters - check electrode force system - check secondary circuit - increase tolerance band, ensure constant conditions.

110716, Current is low in consecutive welds, weld 1 to 3.

Description

Task:*arg*

arg

Current measured is below the limited tolerance band after n repetitions: - programmed value jump to higher current values - handling of different sheet thicknesses or sheet layers - variant electrode pressure conditions - variant resistance conditions in secondary circuit - mains voltage fluctuations.

Recommended actions

Value jumps - use several programs with different parameters - check electrode force system - ensure constant conditions - increase tolerance band, ensure constant conditions.

110717, Weld time is too short, weld 1 to 3.

Description

Task:*arg*

arg

The permitted time tolerance is not reached - external termination of weld signal.

Recommended actions

Check setting at Operation - Modify - Programming - Welding parameters - Time monitoring - check signal.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

110718, Weld time is too long, weld 1 to 3.

Description

Task:*arg*

arg

The permitted time tolerance is exceeded.

Recommended actions

Check setting at Operation - Modify - Programming - Welding parameters - Time monitoring.

110719, Bosch IO signal error

Description

Task: *arg*

It is not possible to read the timer status signal, the Bosch timer I/O unit is lost.

Consequences

It will not possible to get the timer status.

Probable causes

The power to the Bosch IO unit is lost or the cable is damaged.

Recommended actions

1. Check the power to Bosch weld timer.
 2. Check that the cabling is OK.
-

110720, Data value outside limits.

Description

Task:*arg*

Program Ref. *arg*

The value of 'TimerNo' is outside limits, current value: *arg*.

Allowed values are: 1 to *arg*.

Consequences

The instruction will not work until a valid value is entered.

Probable causes

An invalid value was entered.

Recommended actions

Change the value.

Recovery: *arg*

110721, Empty

Description

Empty

110722, Unknown fault in weld timer.

Description

Task:*arg*

Continues on next page

arg

There is a unknown fault in the weld timer, code *arg*.

Recommended actions

Connect the BOS5000/6000 application and check the reason for the fault.

110723, Power unit not ready.

Description

Task:*arg*

arg

The power unit temperature is too high.

Recommended actions

1. Check cooling.
 2. Check duty cycle, load.
 3. Check cables, connectors.
-

110724, 27~V Synchronisation, power fault.

Description

Task:*arg*

arg

Welding network has been switched off, or is outside the range of 50 to 60 Hz +- 5%.

Recommended actions

1. Switch on and check weldin network.
 2. Reset error, check all line phases.
 3. Check synchronisation voltage.
 4. Check fuses in power unit or replace power unit.
-

110725, 24V off or too low.

Description

Task:*arg*

arg

The 24V supply for the internal logic is too low(approx. 19V).

Recommended actions

1. Check 24V supply.
 2. Check the connectors.
-

110726, Transformer temperature too high.

Description

Task:*arg*

arg

The temperature of the welding transformer is too high.

Recommended actions

1. Check cables and connectors.

2. Check cooling circuit of the welding transformer.
3. Reduce welding heat.

110727, Cooling temperature too high.**Description**Task:*arg**arg*

The heat sink is too hot(above 70°C) or the ambient temperature is too high(above 70°C).

Recommended actions

1. Check cooling.
2. Check duty cycle, load.
3. Check temperature inside the process cabinet or check process cabinet cooling.

110728, IO bus fault.**Description**Task:*arg**arg*

The serial IO module has signalled a bus fault to the timer module.

Recommended actions

Replace IO module or timer.

110729, Electrode life has expired, end of stepper.**Description**Task:*arg**arg*

The specified electrode has reached the Electrode life Expired, End of stepper condition.

Recommended actions

The electrode must be replaced.

110730, Tip dress request.**Description**Task:*arg**arg*

The specified electrode has reached the Tip dress request, Tip dress inq. condition.

Recommended actions

The electrode tip must be dressed.

110731, Power voltage too high.**Description**Task:*arg**arg*

An excessively high mains voltage was measured at the DC link level. The mains voltage was above limits. Mains overvoltage or mains transients.

Recommended actions

Check the line voltage supply.

110732, Power voltage too low.**Description**Task:*arg**arg*

The mains voltage is too low or nonexistent. The mains voltage was below limits.

Recommended actions

Check the line voltage supply.

110733, Termination of Weld/No Primary Current.**Description**Task:*arg**arg*

No current was measured for 40ms at the beginning of welding. The schedule is aborted

Recommended actions

1. Check closing mechanism. robot, machine.
2. Check position and pressure of electrodes.

110750, TCP Beam: Reorientation less than 24 degrees.**Description**Task:*arg*

Reorientation of *arg* to small for QuickCheck.

Recommended actions

110751, TCP Beam: Tool differ from nominal.**Description**Task:*arg*

arg has changed since DAY 1.

x: *arg*

y: *arg*

z: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

2. Check internal elog messages.

110752, TCP Beam: Update TCP

Description

Task:*arg*

Update *arg* with:

x: *arg*

y: *arg*

z: *arg*

Recommended actions

110760, Tool Change Error

Description

Task:*arg*

arg

arg

arg

Recommended actions

arg

110790, Timer not connected

Description

No communication with Bosch weld timer *arg*.

Consequences

It will not be possible to access the timer from the FlexPendant.

Probable causes

Faulty configuration or disconnected hardware.

Recommended actions

Check configuration and that the communication cable are connected.

110791, Faulty configuration

Description

Number of configured weld timers are *arg*.

The configuration file(s) for Bosch weld timer interface does not contain all expected data.

Consequences

It will not be possible to access the timer from the FlexPendant.

Probable causes

Wrong version or corrupt configuration file(s).

Recommended actions

1. Re-install correct Bosch weld timer interface configuration files.

110801, Dispense Error

Description

Task:*arg*

arg

Not possible to start without On argument.

arg

Recommended actions

Add On switch to first instruction.

110802, Dispense Error

Description

Task: *arg*

arg

Value for DPUSER data dp_fl1_corr is out of limits.

arg

110803, Dispense Error

Description

Task: *arg*

arg

Value for DPUSER data dp_fl2_corr is out of limits.

arg

110804, Dispense Error

Description

Task: *arg*

arg

Value for flow1_type in beaddata is out of limits.

arg

110805, Dispense Error

Description

Task: *arg*

arg

Value for flow2_type in beaddata is out of limits.

arg

110806, Dispense Error

Description

Task: *arg*

arg

Not possible to use two On instructions in sequence.

Continues on next page

arg

Recommended actions

Remove one instruction with On switch.

110807, Dispense Error**Description**

Task: *arg*

arg

Value for fl1_delay in equipdata is out of limits.

arg

110808, Dispense Error**Description**

Task: *arg*

arg

Value for fl2_delay in equipdata is out of limits.

arg

110809, Dispense Error**Description**

Task: *arg*

arg

Value for ref_speed in equipdata is out of limits.

arg

110810, Dispense Error**Description**

Task: *arg*

arg

Value for equip_no in beaddata is out of limits.

arg

110811, Dispense Error**Description**

Task: *arg*

arg

Unexpected Stop. Stopped while dispensing was active.

arg

arg

110812, Dispense Error**Description**

Task: *arg*

arg

Unknown error during dispensing.

arg

110813, Dispense Error**Description**

Task: *arg*

arg

Value for DPUSER data dp_nof_equip is out of limits.

arg

110814, Dispense Error**Description**

Task: *arg*

arg

Value for flow1 in beaddata is out of limits.

arg

110815, Dispense Error**Description**

Task: *arg*

arg

Value for flow2 in beaddata is out of limits.

arg

110816, Dispense Error**Description**

Task: *arg*

arg

Value for fl1_corr in equipdata is out of limits.

arg

110817, Dispense Error**Description**

Task: *arg*

arg

Value for fl2_corr in equipdata is out of limits.

arg

110818, Dispense Error**Description**

Task: *arg*

arg

Not possible to change equipment in the middle of a string.

arg

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

110819, Dispense Error

Description

Task: *arg*

arg

Value for acc_max or decel_max in equipdata is too low.

arg

110820, Dispense Error

Description

Task: *arg*

arg

The calculated flow value is out of limits.

arg

110821, Dispense Error

Description

Task: *arg*

arg

fl1_delay or fl2_delay in equipdata is out of limits.

arg

110822, Dispense Error

Description

Task: *arg*

arg

Value for z_offset in beaddata is out of limits.

arg

110823, Dispense Error

Description

Task: *arg*

arg

Size of triggdata array exceeds upper limit (10).

arg

111000, Itemsource exists

Description

Itemsource *arg* already exists.

Two itemsources may not have the same name.

Recommended actions

Check itemsource name at:

arg

Recovery: *arg*

111001, Not a valid itemsource name

Description

Name *arg* is not a valid itemsource name.

Recommended actions

Check itemsource name at:

arg

Recovery: *arg*

111002, Buffer size exceeded

Description

Fatal internal error for itemsource *arg*.

Recommended actions

Try system restart or system reset. Please report this error.

111003, Itemsource not defined

Description

The itemsource object has not been defined.

Recommended actions

Check itemsource at:

arg

Recovery: *arg*

111004, Itmsrc internal error

Description

Internal error for itemsource *arg*.

Error type: *arg*.

Recommended actions

Instruction: *arg*

Recovery: *arg*

111005, Flush itemsource first

Description

Itemsource *arg* must be flushed before it is used.

arg

arg

Recommended actions

Instruction: *arg*

Recovery: *arg*

111006, Ack item target first

Description

Item target must be acknowledged before executing the GetItmTgt(s) instruction again.

Continues on next page

Itemsource: *arg*.

arg

arg

Recommended actions

Instruction: *arg*

Recovery: *arg*

111007, Item target buffer full

Description

Item target buffer full for itemsource *arg*.

Recommended actions

Instruction: *arg*

Recovery: *arg*

111008, Too many item targets

Description

Too many item targets pushed to itemsource *arg*.

arg

arg

Recommended actions

Instruction: *arg*

Recovery: *arg*

111009, Conveyor eio init error

Description

Error in the initialisation of the I/O signals for itemsource *arg*, for conveyor *arg*.

Recommended actions

Instruction: *arg*

Recovery: *arg*

111010, Conveyor does not exist

Description

Error for itemsource *arg*.

The conveyor *arg*

does not exist.

Recommended actions

Instruction: *arg*

Recovery: *arg*

111011, No conveyor name given

Description

Error for itemsource *arg*.

No conveyor name specified.

Recommended actions

Instruction: *arg*

Recovery: *arg*

111012, Conveyor limits error

Description

Error for itemsource *arg*, conveyor *arg*.

The limits are incorrect specified.

Recommended actions

Instruction: *arg*

Recovery: *arg*

111013, Cnv data defined late

Description

Error for itemsource *arg*, conveyor *arg*. The ItmSrcCnvDat instruction must be called before the ItmSrcFlush instruction.
arg

Recommended actions

Instruction: *arg*

Recovery: *arg*

111014, Timeout

Description

Instruction reached timeout

Recommended actions

Instruction: *arg*

Recovery: *arg*

111015, Sortdata overridden

Description

Use of selection data will override the sortdata.

Recommended actions

Instruction: *arg*

Recovery: *arg*

111016, Orientation error

Description

The orientation in selection data is not correctly defined.

Itemsource: *arg*

Recommended actions

All used orientations must be normalized i.e. the sum of the quaternion elements squares must equal 1.

Instruction: *arg*

Recovery: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

111017, Uplink message failed

Description

The system failed to send a rapid uplink message

Consequences

Program execution may run as expected.

Statistics may not be updated.

Probable causes

Network interrupt.

CPU overload in controller system.

CPU overload in remote system.

Remote system may not run as expected.

Recommended actions

Check network connection.

Check state of remote system.

Check robot program for infinite loops.

111100, Work object buffer full

Description

Too many conveyor strobes stored in
buffer for itemsource arg

In queue index: arg

Out queue index: arg

111101, Item target buffer full

Description

Item target buffer full for itemsource arg.

Item tag: arg.

Scene number arg.

111102, Too many item targets

Description

Too many item targets pushed to itemsource arg.

Number of items: arg.

Scene number arg.

111103, Push without any strobe

Description

Push received without any corresponding strobe signal is
received for itemsource arg.

Push scene number arg

Latest received strobe arg

Recommended actions

Check hardware connections

111104, Push received too late

Description

Push of items was received too late in itemsource arg.

Corresponding wobj already overwritten.

Push scene number arg.

Latest received strobe arg.

Recommended actions

Check the position generation frequency.

111105, Conveyor limits error

Description

Error in itemsource arg

Conveyor arg

The limits are incorrect specified.

Recommended actions

Required: Enter < Exit

or: Enter < Start < Stop < Exit

Given: arg

111106, Trig distance warning

Description

Trig distance is too long for conveyor arg.

Trig distance is set to maximum.

Max: arg.

Given: arg.

111107, Trig distance warning

Description

Trig distance is too short for conveyor arg.

The limitation of the trig distance is depended on the value for
the Encoder parameter CountsPerMeter.

Consequences

Trig distance is set to minimum.

Min: arg

Given: arg

Probable causes

The value for the trig distance is set too low.

Recommended actions

1. Increase the trig distance value.

2. Increase the value for the Encoder parameter CountsPerMeter
to be able to set a trig distance value lower than actual minimum
value.

Continues on next page

111108, Failed to send data

Description

An error occurred when sending variable *arg* from the itemsource *arg* to remote system.

Status *arg*.

Recommended actions

Check the position generation frequency and the network connections.

111109, Failed to open signal

Description

An error occurred when opening Position Generator signal: *arg* for itemsource: *arg*.

Status *arg*.

Recommended actions

Check the Position Generator signal name.

111110, Failed to open signal

Description

An error occurred when opening Trig signal: *arg* for itemsource: *arg*.

Status *arg*.

Recommended actions

Check the Trig signal name.

111111, Failed to open signal

Description

An error occurred when opening Strobe signal: *arg* for itemsource: *arg*.

Status *arg*.

Recommended actions

Check the Strobe signal name.

111112, Failed to open signal

Description

An error occurred when opening Robot Execution signal: *arg* for itemsource: *arg*.

Status *arg*.

Recommended actions

Check the Robot Execution signal name.

111113, Failed to open signal

Description

An error occurred when opening Queue Idle signal: *arg* for itemsource: *arg*.

Status *arg*.

Recommended actions

Check the Queue Idle signal name.

111114, Failed to open signal

Description

An error occurred when opening Position Available signal: *arg* for itemsource: *arg*.

Status *arg*.

Recommended actions

Check the Position Available signal name.

111115, Failed to open signal

Description

An error occurred when opening Conveyor Control signal: *arg* for itemsource: *arg*.

Status *arg*

Recommended actions

Check the Conveyor Control signal name.

111116, Prepared for PickMaster option not installed.

Description

The Prepared for PickMaster option has not been correctly installed in the system.

Recommended actions

Reinstall the system using a proper key containing the Prepared for PickMaster option.

111117, Uplink message failed

Description

The system failed to send a process uplink message.

Consequences

Item targets may not be picked.

The system may not run as expected.

Probable causes

Network interrupt.

CPU overload in controller system.

CPU overload in remote system.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Remote system may not run as expected.

Recommended actions

Check network connection.

Check state of remote system.

Check robot program for infinite loops.

111118, Conveyor moving with negative speed

Description

Conveyor arg is moving with negative speed.

Measured speed: arg mm/s.

Consequences

Item detection may fail.

Probable causes

1. Conveyor is moving in reversed direction.

2. Encoder is not connected properly.

Recommended actions

1. Check the conveyor control.

2. Check the encoder connection.

111400, GAP IO Error

Description

Task: arg

Context: arg

111402, GAP Execution Error

Description

Task: arg

Context: arg

Failed to access routine, arg

111403, Failed to advance to station

Description

Task: arg, failed to advance to station arg

111404, GAP Error

Description

Task: arg ,

GAP Error posted from PartCrossCheckOK routine.

PartCrossCheckOK not ok.

111405, GAP Execution Error

Description

BeforePart or AfterPart Sync Timeout in arg.

111406, Event execution error

Description

Event procedure: arg in task arg does not exist

Recommended actions

Create the procedure arg or change the procedure in the ee_event data arg to an existing procedure.

111407, GAP Execution Error

Description

Error in GAPExecCycle: arg

111408, GAP Execution Error

Description

WaitSyncPart Timeout: arg in arg.

111409, GAP Execution Error

Description

Error in GapExecPart: arg.

111410, No part selected for station

Description

No part selected for station arg in task arg.

111411, GAP Execution Error

Description

Part station number is invalid: arg

Valid station: arg

Next station: arg

111412, Not matching tasklists in tasks

Description

Tasklist in partdata arg in task arg does not match tasklist in partdata arg in task arg.

Recommended actions

Check and change the tasklists so they match.

111413, Invalid task name

Description

Taskname arg in partdata is invalid

Continues on next page

111414, GAP Execution Error**Description**

The tasklist must include 'this' task: *arg*

111415, GAP Execution Error**Description**

Task: *arg*

Tasks could not be cross-checked. Station: *arg*

111416, GAP Execution Error**Description**

GapEE_Stopped failed in task: *arg*

111417, GAP Access IO Error**Description**

GAP Access IO Error in task: *arg*

111419, GAP cfg data error**Description**

Cfg data not found in InstancePath: *arg*

Attribute: *arg*

111420, GAP IO Error**Description**

GAP IO Error in shared module.

111421, GAP Task Error**Description**

Maximum of GAP tasks defined (*arg*).

111422, GAP event error**Description**

arg GAP_EE_EVT

Unknown event id: *arg*

111423, GAP proc error**Description**

GAP_EE_EVT Unknown proc *arg*

111424, Partdata not found for PLC code**Description**

No matching partdata found in task *arg* for PLC code *arg*

Recommended actions

Create partdata with matching plc code.

111425, Menudata not found for PLC code**Description**

No matching menudata found in task *arg* for PLC code *arg*

Recommended actions

Create menudata with matching plc code.

111426, Not valid task state for menudata**Description**

The state of task *arg* should be at safe or at service when running selected menudata.

111427, Not valid station for menudata**Description**

Current station (*arg*) in task *arg* does not match valid station *arg* in menudata

111428, Not valid user level for menudata**Description**

Not valid menudata. Current user level *arg* does not match minimum user level *arg* defined in menudata

111429, Part execution error**Description**

Part procedure: *arg* in task *arg* does not exist

Recommended actions

Create the procedure *arg* or change the procedure in the partdata to an existing procedure.

111430, Menu execution error**Description**

Menu procedure: *arg* in task *arg* does not exist

Recommended actions

Create the procedure *arg* or change the procedure in the menu to an existing procedure.

111431, Timeout during handshaking**Description**

Timeout during handshaking in task *arg*.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Probable causes

The configured signal run_part_signal_in or run_menu_signal_in wasn't set to 0 within configured timeout (*arg* seconds) after the configured signal run_ack_out was set to 1.

Recommended actions

Make sure to reset configured signal run_part_signal_in or run_menu_signal_in after configured signal run_ack_out is set to 1.

111432, Not valid plc code in task

Description

Not valid plc code in task *arg*.

Probable causes

The configured group signal plc_cmd_group_in has a not valid value *arg*.

Values in the range of 1-99 is reserved for error codes.

Recommended actions

Make sure requests are higher than 99.

111433, Next station configuration error

Description

PROC configuration for next_stn_arg_signal_in not configured.

Consequences

Order for station *arg* may not be executed.

Recommended actions

Configure next_stn_arg_signal_in to ensure that orders for station *arg* will be executed.

111434, At station configuration error

Description

PROC configuration for at_stn_arg_signal_in not configured.

Consequences

Order for station *arg* may not be executed.

Recommended actions

Configure at_stn_arg_signal_in to ensure that orders for station *arg* will be executed.

111501, BullsEye Text Error

Description

BullsEye could not access text.

Index given: *arg*

Text Table: *arg*

Consequences

BullsEye will be unable to generate proper message dialogs.

Recommended actions

Please report this error to your ABB support representative.

111502, BullsEye Obsolete Message

Description

BullsEye Obsolete Message

111503, BullsEye Error

Description

Range-of-motion test failed.

111504, BullsEye Error

Description

RangeCheck feature does not support coordinated work objects.

111505, BullsEye Error

Description

RangeCheck feature does not support uframe transforms.

111506, BullsEye Data Loaded

Description

Stored reference data was loaded successfully.

111507, BullsEye Error

Description

No reference data file was found.

Probable causes

No previous data was stored.

111508, BullsEye Error

Description

The reference data file is already loaded.

111509, BullsEye Error

Description

An error occurred while unloading the reference data module.

Recommended actions

Reset program by moving the program pointer to the main routine and restart program execution.

Continues on next page

111510, BullsEye Error

Description

An error occurred while reading data from the stored reference data module.

111511, BullsEye Data Saved

Description

The reference data has been saved successfully.

111512, BullsEye Error

Description

An error occurred while saving the reference data.

111513, BullsEye Tool Initialized

Description

The tool, *arg*, has been initialized in the BullsEye data collection.

Task: *arg*

111514, BullsEye Tool Added

Description

The tool, *arg*, has been added to the BullsEye data collection.

Task: *arg*

111515, BullsEye Tool Removed

Description

The tool, *arg*, has been removed from the BullsEye data collection.

Task: *arg*

Consequences

BullsEye will no longer be able to evaluate this tool.

Recommended actions

Execute the BESetupToolJ setup instruction to add and initialize the tool.

111516, BullsEye IO Error

Description

Invalid input name: *arg*

Tool: *arg*

Task: *arg*

Consequences

No connection to the digital input could be established.

Initialization has failed.

Recommended actions

Check that the specified input exists in the system.

111517, BullsEye Error

Description

The tool, *arg*, is not included in the BullsEye data collection.

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

Execute the BESetupToolJ setup instruction to add and initialize the tool.

111518, BullsEye IO Error

Description

BullsEye attempted to reconnect a previously connected IO signal.

Input Name: *arg*

Tool: *arg*

Task: *arg*

Recommended actions

If problem persists, run the BESetupToolJ instruction to reinitialize the tool.

111519, BullsEye RangeCheck Failed

Description

Joint Limit Check failed for a Twist of *arg* and a Tilt of *arg*

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

Try a different start position or relocate the BullsEye device. If no acceptable position can be found, try reducing the requested Tilt and Twist in the be_scan data. However, be aware that reducing these values may reduce the accuracy.

111520, BullsEye RangeCheck Failed

Description

Singularity Check failed for a Twist of *arg* and a Tilt of *arg*

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

Try a different start position or relocate the BullsEye device.

111521, BullsEye RangeCheck Failed

Description

No solution could be found within acceptable Joint Limits and Singularity checks.

A Twist of *arg* and a Tilt of *arg* was specified.

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

Try a different start position or relocate the BullsEye device. If no acceptable position can be found, try reducing the requested Tilt and Twist in the be_scan data. However, be aware that reducing these values may reduce the accuracy.

111522, BullsEye RangeCheck Failed

Description

No solution could be found within acceptable Joint Limits and Singularity checks with adequate face-plate clearance.

A Twist of *arg* and a Tilt of *arg* was specified.

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

Try a different start position or relocate the BullsEye device. If no acceptable position can be found, try reducing the requested Tilt and Twist in the be_scan data. However, be aware that reducing these values may reduce the accuracy.

111523, BullsEye BaseFrame Read Error

Description

BullsEye was unable to read the BaseFrame definition for the robot.

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

The Motion Configuration Database (MOC) may have excessive protections implemented. Please ensure that the baseframe definition is accessible.

111524, BullsEye TCP Extended

Description

The instruction, BETcpExtend, was used to shift the TCP of *arg*.

Task: *arg*

New Extension: *arg*

Change: *arg*

111525, BullsEye Setup Complete

Description

Setup complete for:

Tool: *arg*

Task: *arg*

New work object: *arg*

New TCP: *arg*

Max, Mean Deviation: *arg*

111526, BullsEye Setup Failed

Description

The setup for Tool, *arg*, failed.

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

1. Check error log for additional messages.
2. Check setup parameters, sensor device, and start positions before attempting the setup again.

111527, BullsEye Error

Description

The start position for Tool, *arg*, is not defined.

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

Execute the BESetupToolJ setup instruction to define the position.

111528, BullsEye Beam Moved

Description

Beam has moved or calibration changed.

Tool: *arg*

Task: *arg*

Continues on next page

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

Execute the BESetupToolJ setup instruction to define the beam position.

111529, BullsEye Updated TCP**Description**

The TCP for Tool, *arg*, has been updated by BEUpdateTool.

Task: *arg*

New TCP: *arg*

Change: *arg*

Elapsed Time: *arg*

111530, BullsEye Error**Description**

Beam location could not be determined.

Tool: *arg*

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

1. Check that the sensor device is working properly.
2. Execute the BESetupToolJ setup instruction to define the beam position.

111531, BullsEye Error**Description**

The start position was changed.

Tool: *arg*

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

Execute the BESetupToolJ setup instruction to redefine the new start position.

111532, BullsEye Error**Description**

The tool, *arg*, is not set up.

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

Execute the BESetupToolJ setup instruction to add and initialize the tool.

111533, BullsEye Error**Description**

A full TCP measurement failed.

Tool: *arg*

Task: *arg*

Consequences

BullsEye will not be able to evaluate this tool.

Recommended actions

If problem persists, execute the BESetupToolJ setup instruction to add and initialize the tool.

111534, BullsEye Day1 TCP Updated**Description**

The Day1 TCP has been updated due to a change in the beam location.

Tool: *arg*

Task: *arg*

Consequences

New TCP: *arg*

Change: *arg*

111535, BullsEye Day1 TCP Updated**Description**

The operator has permitted the Day1 TCP to be updated.

Tool: *arg*

Task: *arg*

Consequences

New TCP: *arg*

Change: *arg*

111536, BullsEye New TCP Rejected**Description**

The operator rejected the TCP measurement.

Tool: *arg*

Task: *arg*

Consequences

TCP will remain unchanged.

Original TCP: *arg*

Measured TCP: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

111537, BullsEye Updated TCP

Description

The TCP for Tool, *arg*, has been updated by BECheckTcp.

Task: *arg*

New TCP: *arg*

Change: *arg*

Elapsed Time: *arg*

111538, BullsEye Debug On

Description

Debug mode has been turned on.

Task: *arg*

111539, BullsEye Debug Off

Description

Debug mode has been turned off.

Task: *arg*

111540, BullsEye Error

Description

An error has occurred. The cause has not been identified.

Task: *arg*

Recommended actions

If problems persists, try:

1. Execute the BESetupToolJ setup instruction to reinitialize the tool.
2. Please contact your ABB support representative if problem cannot be corrected.

111541, BullsEye TCP OK

Description

The TCP for Tool, *arg*, has not been updated by BECheckTcp, because it is within tolerance.

Task: *arg*

Measured TCP: *arg*

Current TCP: *arg*

Elapsed Time: *arg*

111551, SmarTac Configuration Error

Description

Signal names supplied in PROC cannot be found in EIO.

Recommended actions

Please check the PROC config and EIO config.

111552, SmarTac Configuration Error

Description

An error occurred while attempting to establish connections to I/O.

Recommended actions

Please check the PROC config and EIO config.

111553, SmarTac Configuration Error

Description

SmarTac was unable to find:

arg

in PROC configuration.

Probable causes

A PROC configuration file was loaded with errors.

111554, SmarTac Configuration Error

Description

SmarTac tried to access an illegal type:

arg

in PROC configuration.

Probable causes

A PROC configuration file was loaded with errors.

111555, SmarTac Configuration Error

Description

SmarTac experienced an unknown error trying to access:

arg

in PROC configuration.

Probable causes

A PROC configuration file was loaded with errors.

111556, SmarTac Result

Description

Search Result: *arg*

Search Type: Search 1D

Search Name: *arg*

111557, SmarTac Search Override

Description

Optional limit exceeded on Search_1D!

Search Name: *arg*

The magnitude of the offset = *arg*

The preset limit = *arg*

Continues on next page

111558, SmarTac Search Override

Description

Default search result selected after failed search.

Manual override selected.

Search Type: Search 1D

Search Name: *arg*

Text Table: *arg*

Consequences

SmarTac will not be able to display messages correctly.

Recommended actions

Report to ABB.

111559, SmarTac Result

Description

Part detected.

Search Type: Part Search

111601, DB Table Creation Failed

Description

Failed to create WebWare table: *tblBullsEye*

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111560, SmarTac Search Override

Description

Default search result selected.

No part found during part search.

Manual override 'TRUE' selected.

Search Type: Part Search

111602, DB Table Created

Description

The table, *tblBullsEye*, was successfully added to the WebWare database.

111561, SmarTac Search Override

Description

Default search result selected.

No part found during part search.

Manual override 'FALSE' selected.

Search Type: Part Search

111603, Production Monitor Error

Description

Configuration Error.

Production Monitor was unable to find:

arg

in the PROC configuration.

Recommended actions

Check the PROC configuration file for errors.

111562, SmarTac Result

Description

Location Result: *arg*

Width Result: *arg*

Search Type: Groove

Search Name: *arg*

111604, Production Monitor Error

Description

Configuration Error.

Production Monitor tried to access an illegal type:

arg

in the PROC configuration.

Recommended actions

Check the PROC configuration file for errors.

111563, SmarTac Search Override

Description

Default search result was selected after a failed Groove Search.

Manual override selected.

Search Type: Groove

Search Name: *arg*

111605, Production Monitor Error

Description

Configuration Error.

Production Monitor experienced an unknown error trying to access:

arg

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

in the PROC configuration.

Recommended actions

Check the PROC configuration file for errors.

111606, Production Monitor Error

Description

Text Resource Error.

Production Monitor could not access text.

Index: *arg*

File: *arg*

Recommended actions

Report to ABB.

111607, Production Monitor DB

Description

Creating the tblCycRes table in the WebWare database...

111608, DB Table Creation Failed

Description

Failed to create WebWare table: tblCycRes

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111609, DB Table Created

Description

The table, tblCycRes, was successfully added to the WebWare database.

111610, Production Monitor DB

Description

Creating the tblSeamRes table in the WebWare database...

111611, DB Table Creation Failed

Description

Failed to create WebWare table: tblSeamRes

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111612, DB Table Created

Description

The table, tblSeamRes, was successfully added to the WebWare database.

111613, Production Monitor DB

Description

Creating the tblSeamEv table in the WebWare database...

111614, DB Table Creation Failed

Description

Failed to create WebWare table: tblSeamEv

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111615, DB Table Created

Description

The table, tblSeamEv, was successfully added to the WebWare database.

111616, DB Table Creation Failed

Description

Failed to create WebWare table: tblCycleEv

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111617, DB Table Created

Description

The table, tblCycleEv, was successfully added to the WebWare database.

111618, DB Table Creation Failed

Description

Failed to create WebWare table: tblGapEv

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

Continues on next page

111619, DB Table Created

Description

The table, *tblGapEv*, was successfully added to the WebWare database.

Task Name: *arg*

Probable causes

The data file may contain syntax errors.

Recommended actions

Please delete the reference data file to allow new data to be stored.

111620, Production Monitor Mismatch

Description

The part information for, *arg*, has changed in task, *arg*.

Consequences

The reference data stored for this part can no longer be linked to the part program.

111625, Monitor Data Saved

Description

Nominal data was saved successfully for, *arg*.

Task Name: *arg*

111621, Production Monitor Error

Description

The reference data module for part, *arg*, is already loaded.

An attempt will be made to unload the module and then reload.

Task Name: *arg*

An error occurred while saving reference data file for part, *arg*.

Task Name: *arg*

Consequences

Production Monitor will not be able to perform monitoring activities.

Recommended actions

Report to ABB.

111622, Production Monitor Error

Description

The reference data module for part, *arg*, is already loaded. An attempt to unload the module failed.

Task Name: *arg*

111627, Production Monitor Timer Reset

Description

The cycle timer has been reset to prevent a possible overflow.

Task Name: *arg*

111628, Production Monitor Timer Reset

Description

The arc timer has been reset to prevent a possible overflow.

Task Name: *arg*

111623, Production Monitor Error

Description

The reference data module for part, *arg*, could not be unloaded.

Task Name: *arg*

111629, DB Table Creation Failed

Description

Failed to create WebWare table: *tblSmtc1D*

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111624, Production Monitor Error

Description

The reference data for part, *arg*, could not be read from the stored data file.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

111630, DB Table Created

Description

The table, tblSmtc1D, was successfully added to the WebWare database.

111631, DB Table Creation Failed

Description

Failed to create WebWare table: tblSmtcPart

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111632, DB Table Created

Description

The table, tblSmtcPart, was successfully added to the WebWare database.

111633, DB Table Creation Failed

Description

Failed to create WebWare table: tblSmtcGroove

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111634, DB Table Created

Description

The table, tblSmtcGroove, was successfully added to the WebWare database.

111635, DB Table Creation Failed

Description

Failed to create WebWare table: tblTchClean

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111636, DB Table Created

Description

The table, tblTchClean, was successfully added to the WebWare database.

111637, DB Table Creation Failed

Description

Failed to create WebWare table: tblNavigSrchSp.

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111638, DB Table Created

Description

The table, tblNavigSrchSp, was successfully added to the WebWare database.

111639, DB Table Creation Failed

Description

Failed to create WebWare table: tblNavigMeas1D.

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Check the WebWare server.

111640, DB Table Created

Description

The table, tblNavigMeas1D, was successfully added to the WebWare database.

111641, DB Table Creation Failed

Description

WebWare database tables must be created in Automatic Mode.

Consequences

Production Monitor will be unable to log data to the database.

Recommended actions

Switch to Automatic Mode and try again.

Continues on next page

111701, Torch Services Error

Description

Torch services MechClean configuration error. IO *arg* NOT found.

111702, Torch Services Error

Description

Torch services MechClean configuration error. Check PROC cfg domain.

111703, Torch Services Error

Description

Torch services MechClean configuration error. Torch Services was unable to find: *arg/arg* in PROC configuration.

111704, Torch Services Error

Description

Torch services MechClean configuration error. Torch Services tried to access an illegal type: *arg/arg* in PROC configuration.

111705, Torch Services Error

Description

Torch services MechClean configuration error. Torch Services experienced an unknown error trying to access: *arg/arg* in PROC configuration.

111706, Torch Services Error

Description

Torch services Wirecut configuration error. Torch Services was unable to find: *arg/arg* in PROC configuration.

111707, Torch Services Error

Description

Torch services Wirecut configuration error. Torch Services tried to access an illegal type: *arg/arg* in PROC configuration.

111708, Torch Services Error

Description

Torch services Wirecut configuration error. Torch Services experienced an unknown error trying to access: *arg/arg* in PROC configuration.

111709, Torch Services Error

Description

Torch services Wirecut configuration error. IO *arg* NOT found.

111710, Torch Services Error

Description

Torch services MechClean configuration error. Check PROC cfg domain.

111711, Torch Services Error

Description

Torch services Spray configuration error. Check PROC cfg domain.

111712, Torch Services Error

Description

Torch services Spray configuration error. Torch Services was unable to find: *arg/arg* in PROC configuration.

111713, Torch Services Error

Description

Torch services Spray configuration error. Torch Services tried to access an illegal type: *arg/arg* in PROC configuration.

111714, Torch Services Error

Description

Torch services Spray configuration error. Torch Services experienced an unknown error trying to access: *arg/arg* in PROC configuration.

111715, Torch Services Warning

Description

Torch services Spray has unconfigured IO.

111716, Torch Services Warning

Description

Torch services Wirecut has unconfigured IO.

111717, Torch Services Warning

Description

Torch services MechClean has unconfigured IO.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

111718, Torch Services Error

Description

Torch services MechClean Spray Liquid empty

Recommended actions

Refill Spray or check sensor

111751, Navigator Configuration Error

Description

Navigator configuration error. IO *arg* NOT found.

111752, Navigator Configuration Error

Description

Navigator configuration error. Navigator was unable to find:
arg/arg in PROC configuration.

111753, Navigator Configuration Error

Description

Navigator configuration error. Navigator tried to access an illegal type: *arg/arg* in PROC configuration.

111754, Navigator Configuration Error

Description

Navigator configuration error. Navigator experienced an unknown error trying to access: *arg/arg* in PROC configuration.

111755, Navigator error

Description

Sphere with name *arg* could not be localized.

Probable causes

Nominal point doesn't have sufficient accuracy.
Search radius is too small.

111756, Navigator Configuration Warning

Description

Navigator has unconfigured IO.

111900, Item target buffer full

Description

Target buffer full for Work Area *arg*.
Target number: *arg*.
Scene number *arg*.

111901, Push without any strobe

Description

Push received without any corresponding strobe signal is received for Work Area *arg*.

Push scene number *arg*

Latest received strobe *arg*

Recommended actions

Check hardware connections

111902, Push received too late

Description

Push of items was received too late to Work Area *arg*.

Corresponding Work Object already overwritten.

Push scene number *arg*.

Latest received strobe *arg*.

Recommended actions

Check the position generation frequency.

111903, Conveyor limits error

Description

Error in Work Area *arg*

Conveyor *arg*

The limits are incorrect specified.

Recommended actions

Required: Enter < Exit

or: Enter < Start < Stop < Exit

Given: *arg*

111904, Trig distance warning

Description

Trig distance is too long for conveyor *arg*.

Trig distance is set to maximum.

Max: *arg*.

Given: *arg*.

111905, Trig distance warning

Description

Trig distance is too short for conveyor *arg*.

Trig distance is set to minimum.

Min: *arg*

Given: *arg*.

Continues on next page

111913, Prepared for PickMaster option not installed.**Description**

The Prepared for PickMaster option has not been correctly installed in the system.

Recommended actions

Reinstall the system using a proper key containing the Prepared for PickMaster option.

111914, Uplink message failed**Description**

The system failed to send an uplink message.

Status: *arg*

Recommended actions

Check network connection.

Check state of remote system.

111915, Failed to open Work Object**Description**

An error occurred when opening Work Object: *arg* for Work Area: *arg*.

Status *arg*.

Consequences

The program execution is immediately halted.

Probable causes

No Work Object *arg* exist in loaded RAPID modules.

Recommended actions

Check that the Work Object data name exists.

111916, Tool name is missing for target**Description**

There was no tool for target in Work Area: *arg*.

Status *arg*.

Recommended actions

Check the tool name for target.

111917, Action list name missing**Description**

There was no action list name for target in Work Area: *arg*.

Status *arg*.

Recommended actions

Check the tool name for target.

111918, Work Object name is missing for Work Area**Description**

There was no Work Object for Work Area: *arg*.

Status *arg*.

Recommended actions

Check the Work Object name for Work Area.

111920, Missing toodata for generated operation set**Description**

Toodata not found for generated operation set on work area *arg*.

Consequences

The project can not be run.

Probable causes

Toodata not properly configured for the robot in the PickMaster line configuration.

Recommended actions

Check used tooldatas in the PickMaster line configuration.

111921, Target reset after move of Program Pointer**Description**

The current target in work area "arg" with *arg* products are reset to its origin and will be executed again.

Consequences

The current target and operation *arg* from layer *arg* will be executed once again.

Probable causes

The PP was moved without any target was finished.

Since the program context cannot be secured, the whole operation will be executed from beginning.

Recommended actions

Make sure the tool is empty and cleared, since the whole cycle will be executed from beginning.

Restart in reduced speed to avoid unexpected behavior.

111922, Targets lost after move of Program Pointer**Description**

arg targets with *arg* products in work area "arg" are lost because the operation was interrupted.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Consequences

The current target and operation *arg* from layer *arg* will be lost.

Probable causes

The PP was moved after at least one target in the operation was finished.

Since the program context cannot be secured, next operation will be executed.

Recommended actions

Make sure the tool is empty and cleared, since the whole cycle will be executed from beginning. An unfinished operation may be finished manually.

Restart in reduced speed to avoid unexpected behavior.

111923, Targets lost after LOST acknowledge

Description

arg targets with *arg* products in Work Area "arg" are lost because the operation was interrupted.

Consequences

The current target and operation *arg* from layer *arg* will be lost.

Probable causes

The last target acknowledge was set to LOST after at least one target in the operation was finished.

Since the operation cannot be finished, next operation will be executed.

Recommended actions

Make sure the tool is empty and cleared, since the whole cycle will be executed from beginning. An unfinished operation may be finished manually.

Restart in reduced speed to avoid unexpected behavior.

111924, Operation handler not in use

Description

Task: *arg*

Function *arg* failed. The current targets in this operation are lost.

Program Ref. *arg*

Consequences

It is not possible to finish this operation. The execution will stop if no action is taken in an ERROR handler.

Probable causes

This might be caused by a pulse on the Robot Execution signal after the operation descriptor has been fetched. It is more likely to occur if the operation is a multidrop.

Recommended actions

1. Move PP to main and restart the execution.
2. Use an ERROR handler and run i.e. ExitCycle.

Recovery: *arg*

111925, Failed to open PM work area signal

Description

An error occurred when opening signal *arg* configured in PickMaster for work area: *arg*. (Internal status *arg*.)

Consequences

The current PickMaster project will not execute.

Probable causes

The work area signal is missing in the I/O configuration of the robot controller.

The I/O unit is not running.

Recommended actions

1. Check the signal name in the Work Area configuration of PickMaster.
2. Check the signal name in the I/O configuration of the robot controller.
3. Check if the I/O unit is running.

111926, Triggering too frequently

Description

A new pulse on signal *arg* is to be requested before the previous pulse has finished. The signal is still high. The configured pulse length is *arg* ms.

Consequences

The operation fails to complete its task.

Probable causes

The pulse length is too long or the pick and place operation is very short.

Recommended actions

Decrease the configured pulse length.

111927, PM group signal too short for work area

Description

PickMaster group signal *arg* configured for work area *arg* has too few bits. Required number of bits is *arg*.

Consequences

The current project can not execute.

Probable causes

The signal has to few bits defined in the I/O configuration of the controller.

Continues on next page

Recommended actions

Check the controller I/O configuration of the signal.

111928, Restart job failed**Description**

A job failed to restart on work area *arg*.

Consequences

The work area has entered a response error state.

Probable causes

Start layer count = *arg* and start product count = *arg* is more than the total number of layers for the job (= *arg*).

Recommended actions

Correct the start layer count and start product count. Restart the job.

111929, Restart job failed**Description**

A job failed to restart on work area *arg*.

Consequences

The work area has entered a response error state.

Probable causes

Start product count *arg* is more than the number of products for the top layer (= *arg*).

Recommended actions

Correct the start product count and restart the job.

111930, Restart job failed**Description**

A job failed to restart on work area *arg*.

Consequences

The work area has entered a response error state.

Probable causes

Start product count = *arg*, does not match a full operation for the incomplete top layer. Start layer count is specified as = *arg*.

Recommended actions

Correct the start product count or start layer count. Restart the job.

111931, An unfinished job was stopped**Description**

An unfinished job was stopped on work area *arg*. Number of full layers in stack = *arg*. Number of products in top layer = *arg*.

111950, No PickMaster Flow to Retrieve**Description**

Task: *arg*

Instruction *arg* failed.

Program Ref. *arg*

Probable causes

There is no flow ready when executing instruction.

No *arg* or a low value is used on *arg* in this instruction.

Recommended actions

Use an error handler and do a RETRY on instruction. If a *arg* is used, and
this error occur often, increase the *arg*.

Recovery: *arg*

111951, Value Error**Description**

Task: *arg*

Illegal value in argument *arg*.

Program Ref. *arg*

Consequences

The program execution is immediately halted.

Probable causes

Error in the RAPID program.

Recommended actions

Check the value.*arg* must be a positive integer.

111952, Execution Error**Description**

Task: *arg*

The task is not allowed to execute the instruction *arg*.

Program Ref. *arg*

Probable causes

The task is not configured to control mechanical units

Recommended actions

Change the configuration or remove the instruction.

111953, Can not retrieve operation**Description**

Task: *arg*

Instruction *arg* failed.

Program Ref. *arg*

Probable causes

There is no operation to retrieve when executing instruction.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

No arg or a low value is used on arg in this instruction.

Recommended actions

Use an error handler and do a RETRY on instruction. If a arg is used, an this error occur often, increase the arg.

Recovery: arg

111954, Can not retrieve targets

Description

Task: arg

Instruction arg failed.

Program Ref. arg

Probable causes

There is no target ready when executing instruction.

No arg or a low value is used on arg in this instruction.

Recommended actions

Use an error handler and do a RETRY on instruction. If a arg is used, an this error occur often, increase the arg.

Recovery: arg

111956, Wrong value on in parameter arg

Description

Task: arg

Parameter arg has value arg. The only values that can be used for arg are the predefined values for:

arg

Program Ref: arg

Consequences

The program execution is immediately halted.

Probable causes

Wrong value on in parameter arg.

Recommended actions

Change value on in parameter arg.

111957, No active project

Description

Task: arg

Instruction/function arg has detected that the project has been stopped.

The RAPID can not continue its execution without an active project.

Program Ref:arg

Consequences

The program execution is immediately halted.

Probable causes

- 1) Project has been stopped.
- 2) A power fail has occurred, and the RAPID program has been started without starting the project again.
- 3) A restart has been done, and the RAPID program has been started without starting the project again.

Recommended actions

Start a project.

In some cases PP must be moved to main.

111958, No active project

Description

Task: arg

Instruction arg failed.

Program Ref. arg

Consequences

The program execution is immediately halted.

Probable causes

There is no project running when executing instruction.

No arg or a low value is used on arg in this instruction.

Recommended actions

Use an error handler and do a RETRY on instruction.

Recovery: arg

111959, Not valid work object data

Description

Task: arg

Instruction arg failed.

No Work Area has reference to work object data named arg.

Program Ref. arg

Consequences

The program execution is immediately halted.

Recommended actions

Use an error handler and do a RETRY on instruction with another work object data as parameter.

Recovery: arg

111960, Invalid descriptor used

Description

Task: arg

Instruction arg failed.

The Work Area descriptor that is used refers to an object that does not exist.

Program Ref. arg

Continues on next page

Consequences

The program execution is immediately halted.

Probable causes

An instruction/function is executed without a valid descriptor.

The Work Area descriptor has not been fetched correctly, or it is a restart after power fail.

Recommended actions

Check manual about how to get valid descriptors for Work Areas.

111962, Invalid target handle

Description

Task: *arg*

Instruction *arg* failed.

The target handle that is used refer to an object that does not exist or is not initialized.

Program Ref. *arg*

Consequences

The program execution is immediately halted.

Probable causes

An instruction/function is executed without a valid descriptor.

The target handle has not been fetched correctly, or it is a restart after power fail.

Recommended actions

Restart the project or rewrite the RAPID program.

111963, Invalid action handle

Description

Task: *arg*

Instruction *arg* failed.

The action handle that is used refer to an object that does not exist or is not initialized.

Program Ref. *arg*

Consequences

The program execution is immediately halted.

Probable causes

An instruction/function is executed without a valid handle.

The action handle has not been fetched correctly, or it is a restart after power fail.

Recommended actions

Restart the project or rewrite the RAPID program.

111964, Error event triggered

Description

Task: *arg*

Instruction *arg* failed.

The Work Area *arg* is set in error state after an error event.

Program Ref. *arg*

Consequences

It is not possible to execute the program until the error is solved.

Probable causes

1. The error source signal has set the Work Area in error state.
2. Stop immediately has been used.

Recommended actions

Solve the cause of the error situation and use one of the restart options.

112000, Failed to open signal

Description

An error occurred when opening signal *arg* for *arg*.

The signal should be of type *arg*.

Status *arg*.

Consequences

The execution is stopped immediately.

Probable causes

Wrong signal type or signal name.

Recommended actions

Check the signal name and type.

112001, PickMaster Flow Error

Description

The flow with name *arg* is in an internal error state.

Consequences

The flow is stopped and will not be used until the project is stopped and restarted again.

Probable causes

An internal error has occurred.

Recommended actions

Save the system diagnostics under Control Panel - Diagnostics and send to Robotics Product Support.

112002, Failed to Retrieve PickMaster Format

Description

The flow *arg* failed to request a format with index *arg*.

The reply came from Work Area *arg*.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Consequences

The flow is stopped immediately.

Probable causes

The setup file is corrupted or incomplete.

Wrong response from IO signals.

Recommended actions

Verify the project setup using PickMaster PC application.

Look for internal errors.

112003, Uplink message failed

Description

The system failed to send an uplink message.

Status: *arg*

Recommended actions

Check network connection.

Check state of remote system.

112050, Project *arg* starting

Description

Project *arg* is starting.

112051, Project *arg* started

Description

Project *arg* is now started.

112052, Project *arg* stopped

Description

Project *arg* stopped

112053, Failed to start project *arg*

Description

Failed to start project *arg*.

Check event logs for more information why the project could not be started.

Check for internal errors too.

Consequences

The project is not started, it is set in stop state.

Probable causes

The XML file is corrupted, or some internal error occurred.

Recommended actions

Check XML file, and check event logs for more information why the project could not be started.

112054, Project *arg* already started

Description

Project *arg* is already started.

Stop the project, and start it again if the project has been changed.

Consequences

The execution will continue.

Probable causes

Multiple use of RAPID instruction PmStartProj with the same project name *arg*.

Recommended actions

Stop project if the setup has been changed, and start it again.

112055, A project is already started

Description

A project *arg* is already started. Another project can not be started until the already started project is stopped.

Consequences

The project *arg* is not started.

The program execution is immediately halted if the start order was from RAPID.

Probable causes

Multiple start orders using different project names.

Recommended actions

Check the projects that are started. Remove one of the starts.

112056, Data List Full

Description

Internal data list was full when trying to store the variable *arg*.

Consequences

Targets depending on this variable will not be executed.

Probable causes

The project is probably too large.

Recommended actions

Reconfigure the project.

112057, Project name is an empty string

Description

The name of the project to start is not valid.

Consequences

Project not started. The program execution is immediately halted

Continues on next page

Probable causes

The project name has not been initiated.

Recommended actions

Check the project name used when starting project.

112058, Stop of project ordered during start**Description**

A stop order has been received during startup of project *arg*.

Consequences

Project *arg* is not started.

Probable causes

Stop during start of project. The stop can be from another client or another RAPID task.

Recommended actions

Do not stop project until it has been started correctly.

112059, Ongoing start of project**Description**

A start of the project *arg* is executed right now.

Consequences

If the start order comes from RAPID, the RAPID execution is immediately stopped.

Probable causes

Start orders from multiple clients or RAPID tasks at the same time

Recommended actions

Start project only one time.

112060, Stop of project ordered during start**Description**

RAPID execution stopped during start of project.

The project *arg* is not started.

Consequences

RAPID execution is immediately stopped. Project *arg* is not started.

Probable causes

A project stop order from PickMaster, FlexPendant, I/O or RAPID when a start of a project is executed.

Recommended actions

Try to start project again.

112100, PickMaster project file is too old**Description**

The *arg* file is not supported by this RobotWare.

Consequences

The required project file is too old and the project is therefore stopped.

Probable causes

The PickMaster version used to configure this project is too old for this RobotWare.

Required version by RobotWare: *arg*

PickMaster version used to create file: *arg*

Recommended actions

Update the project using at least version *arg* of PickMaster.

112101, Required PickMaster file could not be opened**Description**

The file below could not be opened.

arg

Status: *arg*

Consequences

The project can not be loaded or can not continue execution.

Probable causes

The file is missing or has been tampered.

Recommended actions

Re-transfer the project from the PickMaster PC.

112102, Missing attribute in node**Description**

The node is missing attribute "arg".

Consequences

The requested information could not be found. The execution of the project is stopped.

Probable causes

The PickMaster project file has been tampered.

Recommended actions

Re-transfer the project from the PickMaster PC.

112150, Failed to request new target set**Description**

The target pump process "arg" failed to request new target set from project.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Consequences

Last triggered operation set can not be pushed into the Work Area queue.

Probable causes

The triggered operation set (*arg*) is not configured in the project. The triggered combination of product I/O value (*arg*) and format I/O value (*arg*) is not configured in the project.

Status: *arg*

Recommended actions

Review the project setup.

Check the product and format selection groups signal values.

112151, Incorrect target set

Description

The target set sent to the pump process "arg" is not the requested one.

Consequences

Last triggered operation set can not be pushed into the Work Area queue.

Probable causes

The triggered operation set is not correct (*arg*) or the triggered I/O values are not correct (*arg*)

Status: *arg*

Recommended actions

Review the project setup.

Check the selection group signal values.

112152, Response error for work area

Description

Response error occurred for slave work area *arg*.

Targets generated (product = *arg*, format = *arg*) does not match positions requested (product = *arg*, format = *arg*).

Consequences

The work area has entered a response error state.

The robot will not access the work area until the correct targets are generated.

Any flow using the work area may become blocked from execution.

Probable causes

The product selection I/O values for position request and target generation is not the same.

The format selection I/O values for position request and target generation is not the same.

Recommended actions

Verify sequence logic and I/O values of external equipment setting the product and/or format I/O signals (i.e. a PLC).

To recover from the response error:

- 1) Verify that the requested targets are available on the work area.
- 2) Trigger a new target generation with correct I/O selection values.

112200, Failed to Open Signal

Description

An error occurred when opening the Trigger Event Signal.

Signal name: *arg*

Consequences

It will not be possible to use any PickMaster error recovery functionalities that can be generated from IO signals.

Probable causes

The signal name is not configured in the IO configuration.

Recommended actions

Verify the Trigger Event Signal name using the PickMaster PC application.

112201, Failed to Open Signal

Description

An error occurred when opening the Error Source Signal.

Signal name: *arg*

Consequences

It will not be possible to set any PickMaster source in an error state.

Probable causes

The signal name is not configured in the IO configuration.

Recommended actions

Verify the Error Source name using the PickMaster PC application.

112202, Failed to Open Signal

Description

An error occurred when opening the Event Message Signal.

Signal name: *arg*

Consequences

It will not be possible to use the PickMaster message functionality.

Probable causes

The signal name is not configured in the IO configuration.

Continues on next page

Recommended actions

Verify the Event Message name using the PickMaster PC application.

112203, Wrong PickMaster Error Source Value**Description**

The value that was read, *arg*, after an event was triggered does not match one or several configured bits in the IO signal *arg*.

Consequences

The system goes to SYS STOP state.

Recommended actions

Verify the configuration using the PickMaster PC application.
Verify external equipment generating the signal value.

112204, Wrong PickMaster Message value**Description**

The value that was read, *arg*, after an event was triggered does not match any configured values in the IO signal *arg*.

Recommended actions

Verify the configuration using the PickMaster PC application.
Verify external equipment generating signal value.

112250, PickMaster project size limitation**Description**

Not enough memory for PickMaster project.

Consequences

Not possible to run the selected PickMaster project.

Probable causes

The selected project contains too much data to be handled by the robot controller.

Recommended actions

Reduce number of objects in the PickMaster project, e.g. reduce number of work areas, operation sets, flows, formats and products. Reduce object complexity in the PickMaster project, e.g. reduce number of layers in used pallet patterns.

112350, Target configuration outside reach**Description**

Task: *arg*

A valid robot configuration within reach was not found for target.

Program Ref: *arg*

Consequences

The robot is not able to move to the target position.

Probable causes

The target position is outside reach.

A robot configuration was not found within reach for the target.

Recommended actions

Move the target position within the reach of the robot.

Check if the target position is possible to reach without robot configuration control (ConfJ\Off, ConfL\Off). Use an error handler and do a RETRY on instruction. ERRNO for recovery = *arg*.

112351, Failed to calculate axis limit**Description**

Task: *arg*

Calculating the axis limit failed.

Program Ref: *arg*

Consequences

The axis angle can not be calculated due to the angel limitations.

Probable causes

Too narrow angel limits.

Recommended actions

Review the limits for the instructions.

Use an error handler and do a RETRY on instruction.

Recovery: *arg*

112352, Wrong limitation value**Description**

Task: *arg*

The coordinate limits are not valid.

Program Ref: *arg*

Consequences

The coordinate is not possible to calculate.

Probable causes

Wrong limit values.

Recommended actions

Review the limits for the instructions.

Use an error handler and do a RETRY on instruction.

Recovery: *arg*

112353, Wrong intermediate part value**Description**

Task: *arg*

The intermediate part value is not valid. The InterMidPart argument must be between 0 and 1.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Program Ref: *arg*

Consequences

The intermediate position is not possible to calculate.

Probable causes

Wrong InterMidPart value.

Recommended actions

Review the InterMidPart for the instruction.

Probable causes

Error in the RAPID code.

Error in the PickMaster configuration.

Recommended actions

Check if the event type number is defined among the built-in variables of type pm_eventtype.

Review the PickMaster configuration.

112354, Unknown event signal name

Description

Task: *arg*

The event signal name *arg* is unknown.

Program Ref: *arg*

Consequences

The event can not be defined.

Probable causes

Wrong signal name in the PickMaster project or line configuration.

Recommended actions

Review the signal name in the PickMaster project or line configuration.

112357, Unknown target action type

Description

Task: *arg*

The target action type *arg* is unknown.

Program Ref: *arg*

Consequences

The action can't be performed.

Probable causes

Error in the RAPID code.

Error in the PickMaster configuration.

Recommended actions

Check if the action type number is defined among the built-in variables of type pm_actiontype.

Review the PickMaster configuration.

112355, Too many events

Description

Task: *arg*

There are too many trig events defined for one move. Maximum 8 are allowed but in this case there are *arg* defined.

Program Ref: *arg*

Consequences

All events can't be set.

Probable causes

Error in the PickMaster configuration.

Recommended actions

Review the PickMaster configuration.

112358, Unknown move type

Description

Task: *arg*

The move type *arg* is unknown.

Program Ref: *arg*

Consequences

The move can't be performed.

Probable causes

Error in the RAPID code.

Error in the PickMaster configuration.

Recommended actions

Check if the move type number is defined among the built-in variables of type pm_movetype.

Review the PickMaster configuration.

112356, Unknown event type

Description

Task: *arg*

The event type *arg* is unknown.

Program Ref: *arg*

Consequences

The event can't be set.

112359, Stack search detected empty stack

Description

Stack search detected empty stack.

Task: *arg*

Instruction *arg* failed.

Program Ref: *arg*

Continues on next page

Consequences

Not possible to finish current operation unless an error handler is implemented.

Probable causes

- 1) Stack is empty or:
- 2) Tool center point for Search Tool data, Tool configuration, is not correctly defined.
- 3) The expected location of the stack is not correct.
- 4) The search stop signal was not triggered correctly.

Recommended actions

If the stack not is empty:

Check definition of tool center point for Search Tool data.
Check definition of work object, tune frame, work area frame and displacement frame.

Check that the search stop signal is triggered correctly.

If the stack is empty:

This error can be recovered using the error handlers of the Operate() and OperateSequence() routines.

Recovery: arg.

- 1) Set the Redo Search signal after adjusting the stack.
- 2) Use RETRY to rerun Operate.

112360, Stack search adjusted stack layers

Description

Stack search adjusted the number of available layers in stack.

Task: arg

Instruction: arg.

Program Ref. arg

Probable causes

Actual stack height was lower than configured in PickMaster.

Recommended actions

No actions are required.

The default error handlers of the Operate() and OperateSequence() routines will recover the error.

Recovery: arg

112361, Unknown search type

Description

Task: arg

Search type arg is unknown.

Program Ref: arg

Consequences

Stack search can not be completed.

Probable causes

Errors in rapid code.

112362, Unknown search stop type

Description

Task: arg

Search stop type arg is unknown.

Program Ref: arg

Consequences

Stack search can not be completed.

Probable causes

Errors in rapid code.

112363, Stack search stop height mismatch

Description

Task: arg

The configured stop height = arg mm, was reached during stack search movement without detecting the stack height. The bottom layer of the stack is expected at least one layer below the reached stop height.

Program Ref: arg

Consequences

The stack height could not be properly adjusted after stack search.

Probable causes

The configured stop height is set too high.

The configured displacement frame offset for the operation set is set too low.

Recommended actions

Check the configured stop height.

Check the configured displacement frame offset for the operation set.

112364, PickMaster Tool Event Timeout

Description

Task: arg

A timeout has occurred while waiting for signal arg to get its correct value(arg).

Program Ref: arg

Consequences

The robot movement is halted until the signal condition is met. A new wait period is requested and the timeout is set to arg s.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

112365, Not Valid Signal

Description

Task: *arg*

The signal *arg* is not correct used for current instruction.

Program Ref: *arg*

Consequences

The RAPID execution will stop immediately and it is not possible to recover from this error until the faulty signal is corrected.

Probable causes

1. The signal is unknown in the system. If the signal is defined in the RAPID program, it must be connected to the configured signal with instruction AliasIO.
2. Signal argument is outside allowed limits.
3. There is no contact with the IO unit. The unit may have been disabled (IODisable "UNIT1", 1;). No power to the unit.

Recommended actions

All signals (except AliasIO signals) must be defined in the system parameters and can not be defined in the RAPID program.

Used group digital signal can not set required value according to configuration in system parameters.

Program Ref: *arg*

Consequences

It is not possible to get any information about the flow.

Probable causes

1. The requested flow is not configured in the project.
2. The mapping between flow and signal is wrong or missing.

Recommended actions

Recovery: *arg*

112369, The Requested Flow Could Not Be Found

Description

Task: *arg*

The requested flow *arg* could not be found in the loaded project.

Program Ref: *arg*

Consequences

The RAPID program will immediately be halted.

Probable causes

The requested flow is not configured in the project.

Recommended actions

Check that the flow name is a member of the project.

112367, The Requested Project Could Not Be Found

Description

Task: *arg*

The requested project *arg* could not be found in the PickMaster project folder. The project can be identified both with its name and its selection value.

Program Ref: *arg*

Consequences

It is not possible to get any information about the project.

Probable causes

1. The requested project is not transferred from PickMaster PC.
2. The mapping between project and signal is wrong or missing.

Recommended actions

Recovery: *arg*

112370, Not a Valid Stop Option

Description

Task: *arg*

The supplied stop options value is *arg*. The supported value must be in the range *arg*.

Program Ref: *arg*

Consequences

It is not possible to stop the flow *arg*.

Recommended actions

Recovery: PM_ERR_INVALID_FLOW_STOP_OPTION

112371, No Running Project

Description

Task: *arg*

There is no running project and the flow *arg* can for that reason not be accessed.

Program Ref: *arg*

Probable causes

The project has been stopped or is not yet started.

Recommended actions

Recovery: *arg*

112368, The Requested Flow Could Not Be Found

Description

Task: *arg*

The requested flow *arg* could not be found in the loaded project. The flow can be identified both with its name and its selection value.

Probable causes

The project has been stopped or is not yet started.

Recommended actions

Recovery: *arg*

Continues on next page

112372, Missing PickMaster signals

Description

Task: *arg*

One or more of the IO signals that is used for managing projects and flows are missing.

Program Ref: *arg*

Consequences

It is not possible to start or stop flows from the IO interface.

Project status signal might also be incorrect.

Probable causes

The signals are not and/or wrong configured in the IO configuration. One reason can be that an old backup is used.

Recommended actions

This message can be ignored if the IO interface is not used.

Recommended actions

Reduce work space restrictions for RAPID instruction

PmCalIntermid, e.g. decrease MinZ. Recovery: *arg*.

112375, Intermediate axis position outside reach

Description

An intermediate axis position cannot be reached when moving from work area *arg* to work area *arg*. Part of intermediate movement = *arg* %.

Program reference: *arg*

Consequences

The robot cannot perform the movement.

Probable causes

Restrictions on axis angles of the intermediate position.

Recommended actions

Reduce restrictions on axes angles for RAPID instruction

PmCalIntermid, e.g. increase MaxAngle. Recovery: *arg*.

112373, The Requested Work Area Could Not Be Found

Description

Task: *arg*

The requested Work Area with selection number or variable name *arg* could not be found in the loaded project. The Work Area can be identified both with its descriptor and its selection value.

Program Ref: *arg*

Consequences

It is not possible to get any information about the Work Area.

Probable causes

1. The requested Work Area is a RAPID variable that is not initialized.
2. The mapping between Work Area and signal value is wrong or missing.

Recommended actions

Recover: *arg*

112376, Required WorkArea is not valid

Description

Task: *arg*

PmSetRecoverAction with selected recover action requires a valid WokArea descriptor.

Program Ref: *arg*

Probable causes

1. Recover action PM_RECOVER_REDOLAYER and PM_RECOVER_NEXT_PALLET requires the optional argument WorkArea to be set.
2. The WorkArea descriptor is not initialized.
3. The WorkArea is not a part of the flow *arg*.

Recommended actions

Recover: *arg*

112377, Faulty Recover Action

Description

Task: *arg*

arg is not one of the supported recover actions.

Program Ref: *arg*

Consequences

It will not be possible to start the Flow *arg* if it is set in error state.

Probable causes

The recover action is not one of
PM_RECOVER_CONTINUE_OPERATION,

112374, Intermediate position outside reach

Description

An intermediate position cannot be reached when moving from work area *arg* to work area *arg*. Part of intermediate movement = *arg* %.

Program reference: *arg*

Consequences

The robot cannot perform the movement.

Probable causes

Work space restrictions of the intermediate position.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

PM_RECOVER_REDO_LAYER, PM_RECOVER_NEXT_PALLET or PM_RECOVER_REDO_LAST_PICK.

Recommended actions

Recover: *arg*

112378, Flow is already starting up

Description

Task: *arg*

The flow *arg* is already starting up. Only one call to PmFlowStart is allowed at each time.

Program Ref: *arg*

Consequences

The RAPID program is immediately halted.

Recommended actions

Check the RAPID program for multiple use of PmFlowStart to same flow.

112379, Wrong flow state

Description

Task: *arg*

It is not possible to start flow *arg* in current state.

Program Ref: *arg*

Consequences

The RAPID program is immediately halted.

Probable causes

The flow is probably set in a sever error state that can not be recover from.

Recommended actions

Recover: *arg*

112380, Failed to recover from an error state

Description

Task: *arg*

The start of flow *arg* from an error state failed.

Program Ref: *arg*

Consequences

The RAPID program is immediately halted.

112381, Redo last pick is not allowed in current position

Description

Task: *arg*

The flow *arg* can not recover from the error situation with recover action PM_RECOVER_REDO_LAST_PICK.

Program Ref: *arg*

Consequences

The flow can not be started until a valid recover action has been set.

Probable causes

The flow can only recover from an error with PM_RECOVER_REDO_LAST_PICK if the first item is picked and no items are placed.

Recommended actions

Recover: *arg*

112382, Project info contains no valid data for current task

Description

Task: *arg*

Failed to read project info data.

Program Ref: *arg*

Consequences

It is not possible to get any information about project settings, i.e. the names on modules that should be loaded.

Probable causes

The project is already started when a start order from the IO interface is received.

Recommended actions

Stop project and start it again via the IO interface.

112383, No Running Project

Description

Task: *arg*

There is no running project and the work area with selection number or variable name *arg* can for that reason not be accessed.

Program Ref: *arg*

Probable causes

The project has been stopped or is not yet started.

Recommended actions

Recovery: *arg*

112384, Invalid default height

Description

Task: *arg*

Continues on next page

The I/O value of signal *arg* does not correspond to a valid default height.

Program Ref: *arg*

Consequences

It was not possible to set the default height.

Probable causes

The I/O value of *arg* does not correspond to a valid default height selection.

Recommended actions

Make sure that *arg* is set to a proper value before *arg* is pulsed.

112385, Too many events defined for target action

Description

Task: *arg*

Unexpected failure.

More than *arg* events are configured for a single target action of type *arg* at work area *arg*.

Program Ref: *arg*

Consequences

Execution is stopped.

Probable causes

Too many events has been attached to the same target action.

Recommended actions

Modify the project configuration, download and restart the project.

Contact ABB.

112386, Unknown I/O Trigg type

Description

Task: *arg*

I/O Trigg type *arg* is unknown.

Program Ref: *arg*

Consequences

Stack search can not be completed.

Probable causes

Errors in rapid code.

112393, Flow recover with redo last pick

Description

The Flow *arg* will redo last unfinished operation at next flow start.

Recommended actions

Verify that:

- The tool is empty
- Products from last operation are restored on *arg*
- The reason for the stop is solved.

112394, Flow recover with continue pick-place

Description

The Flow *arg* will restart from where it was stopped at next flow start. Verify that the fault causing the stop has been handled.

Recommended actions

Verify expected number of products:

Tool: *arg*

WorkArea name/Number of products/Layer number

arg

arg

arg

112395, Flow recover with restart layer

Description

The Flow *arg* will restart from beginning of layer *arg* on WorkArea *arg* at next flow start.

Recommended actions

Verify that:

- The reason for the stop is solved
- The tool is empty
- Following WorkAreas are empty:

arg

arg

112396, Flow recover with next pallet

Description

The Flow *arg* will restart from beginning of next pallet on WorkArea *arg* at next flow start.

Recommended actions

Verify that:

- The reason for the stop is solved
- The tool is empty
- Following WorkAreas are empty:

arg

arg

arg

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

112397, Flow recover with redo last pick

Description

The Flow *arg* will redo last unfinished operation at next flow start.

Recommended actions

Verify that:

- The tool is empty
- New products can be supplied on *arg*
- The reason for the stop is solved.

112398, *arg*

Description

arg

112399, PickMaster Flow Stopped Immediately

Description

The Flow *arg* is stopped immediately.

Consequences

The RAPID program is stopped if the flow is active in any palletizing operation.

Recommended actions

Restart of the flow has to be performed from one of the error restart options.

112400, Invalid tuning parameter

Description

Task:*arg*

Context: *arg*

arg is not a valid tuning parameter.

112401, Schedule number out of range

Description

Task:*arg*

Context: *arg*

arg is not a valid schedule number.

Valid schedules numbers are in the range: *arg* to *arg*.

112402, SID file is not compatible

Description

Task:*arg*

Context: *arg*

The SID file version is not compatible.

Consequences

The SID file has not been loaded into power source memory.

Probable causes

The SID file was saved from a different power source type or the SID file has become corrupted.

Recommended actions

If the file has been transferred with FTP program. Are you sure that the FTP program uses binary transfer mode for this SID file?

If possible, try to recreate the SID file from the origin.

112403, Default I/O unit not defined

Description

Task: *arg*

The default I/O unit is not defined in configuration.

InstancePath: /PROC/ARISTOMIG_INT_USER_PROP/*arg*

Attribute: use_default_io

112404, Configuration data not found

Description

Task:*arg*

InstancePath: *arg*

Attribute: *arg*

112405, SID file corrupt

Description

Task:*arg*

Context: *arg*

The SID file is not in the correct format or the file size is incorrect.

Consequences

All the data was not recovered from the file.

Recommended actions

Verify the schedules in the power source. All data might not be recovered.

112406, Invalid tuning parameter

Description

Task:*arg*

Context: *arg*

arg is not a valid tuning parameter in instance *arg*.

Continues on next page

112407, Schedule does not exist

Description

The schedule *arg* does not exist in the power source *arg*, in *arg*.

Consequences

The welding results will not be as expected.

Recommended actions

Make sure that the schedule has been created before using it in a weld instruction.

Internal unit: *arg*

Consequences

The current welding process is stopped and starting is prevented.

Recommended actions

Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.

112410, Program memory error (EPROM)

Description

The program memory is damaged in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Restart the machine. If the fault persists, send for a service technician.

112414, Intermediate DC voltage outside limits

Description

The voltage is too high or too low in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Consequences

The power unit is stopped and cannot be started.

Probable causes

Too high a voltage can be due to severe transients on the mains power supply or to a weak power supply (high inductance of the supply or a phase missing).

Recommended actions

Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.

112411, Microprocessor RAM error

Description

The microprocessor is unable to print/read to the internal memory in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Restart the machine. If the fault persists, send for a service technician.

112415, High temperature

Description

The thermal overload-cut has tripped in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Consequences

The current welding process is stopped and cannot be restarted until the cut-out has reset.

Recommended actions

Check that the cooling air inlets or outlets are not blocked or clogged with dirt. Check the duty cycle being used, to make sure that the equipment is not being overloaded.

112412, External RAM error

Description

The microprocessor is unable to print/read to the external memory in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Restart the machine. If the fault persists, send for a service technician.

112416, High primary current

Description

The power unit *arg* takes too much current from the DC voltage that supplies it.

Fault code: *arg*

Internal unit: *arg*

Consequences

The power unit is stopped and cannot be started.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.

112417, Low battery voltage or power supply

Description

Unit: *arg*

See description corresponding to the internal unit: *arg*

WDU: Low battery voltage +3 V

Battery voltage too low in unit *arg*. If the battery is not replaced, all stored data will be lost.

PS: +15 V power supply

The power supply is too high or too low in unit *arg*.

Fault code: *arg*

Recommended actions

Send for a service technician.

112418, -15 V power supply

Description

The power supply is too high or too low in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Send for a service technician.

112419, +24 V power supply

Description

The power supply is too high or too low in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Send for a service technician.

112420, Current-servo / wire speed-servo error

Description

I/O unit: *arg*

Error code: *arg*

Internal unit: *arg*

112421, Communication error (warning)

Description

The load on the system's CAN-bus is temporarily too high in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Consequences

The power unit/wire feed unit has lost contact with the welding data unit.

Recommended actions

Check that all the equipment is correctly connected. If the fault persists, send for a service technician.

112423, Communication error

Description

The system's CAN-bus has temporarily stopped working due to the load being too high.

Fault code: *arg*

Internal unit: *arg*

Consequences

The current welding process stops.

Recommended actions

Check that all the equipment is correctly connected. Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.

112424, Messages lost

Description

The microprocessor is unable to process incoming messages sufficiently quickly and information has been lost in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.

112426, Lost contact with MEK

Description

Unit: *arg*

Fault code: *arg*

Internal unit: *arg*

112427, Lost contact

Description

The welding data unit(WDU) has lost contact with the power unit(PS) in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Continues on next page

Consequences

The current welding process stops.

Recommended actions

Check the cables. If the fault persists, send for a service technician.

112428, Memory error in battery-supplied data memory RAM**Description**

The battery has lost voltage in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Turn off the mains power supply to reset the unit. The welding data unit is reset.

112429, Non-permitted set values stored in RAM**Description**

Non-permitted values have been discovered at start-up in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Delete all data contained in the welding data unit.

Turn off the mains power supply to reset the unit. The welding unit is reset.

112430, Incompatible set values stored in RAM**Description**

Non-permitted welding data combinations have been specified in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.

112431, Transmit buffer overflow**Description**

The welding data unit does not manage to transmit information to the other units sufficiently quickly in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Turn off the mains power supply to reset the unit.

112432, Receiver buffer overflow**Description**

The welding data unit does not manage to process information from the other units sufficiently quickly.

Fault code: *arg*

Internal unit: *arg*

Recommended actions

Turn off the mains power supply to reset the unit.

112434, Incompatible weld data format**Description**

I/O unit: *arg*

Error code: *arg*

Internal unit: *arg*

112435, Program error**Description**

Something has prevented the processor from performing its normal duties in the program in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Consequences

The program restarts automatically. The current welding process will be stopped.

Recommended actions

Review the handling of welding programs during welding. If the fault is repeated, send for a service technician.

112436, No wire**Description**

I/O unit: *arg*

Error code: *arg*

Internal unit: *arg*

112437, Lost program data**Description**

Program execution does not work in unit *arg*.

Fault code: *arg*

Internal unit: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

Turn off the mains power supply to reset the unit. If the fault persists, send for a service technician.

112438, No water flow

Description

I/O unit: *arg*

Error code: *arg*

Internal unit: *arg*

112439, Lost contact with TIG card

Description

I/O unit: *arg*

Error code: *arg*

Internal unit: *arg*

112441, No gas flow

Description

I/O unit: *arg*

Error code: *arg*

Internal unit: *arg*

112500, Weld Data Monitor

Description

The configuration is complete for *arg*

112501, WDM Configuration Error

Description

The configuration failed for *arg*

Consequences

Weld Data Monitor will be inoperable.

Recommended actions

Please review PROC settings to correct.

112502, WDM Alias IO Error

Description

The signals defined in the PROC are invalid.

Task: *arg*

Consequences

Weld Data Monitor will be inoperable.

Recommended actions

Please review PROC settings to correct.

112503, WDM Failed to Read WDM_SETTINGS

Description

The 'chart' setting in the WDM_SETTINGS section of the PROC could not be read.

Task: *arg*

Consequences

Weld Data Monitor not save charting files.

Recommended actions

Please review PROC settings to correct.

112504, WDM Failed to Read WDM_SETTINGS

Description

The IO signal setting in the WDM_SETTINGS section of the PROC could not be read.

Task: *arg*

Consequences

Weld Data Monitor will be inoperable.

Recommended actions

Please review PROC settings to correct.

112505, WDM Failed to Read WDM_STABILITY

Description

The WDM_STABILITY section of the PROC could not be found.

Default values have been applied.

Task: *arg*

112506, WDM Failed to Read WDM_STABILITY

Description

The WDM_STABILITY section of the PROC could not be read.

Task: *arg*

Consequences

Weld Data Monitor may be inoperable.

Recommended actions

Please review PROC settings to correct.

112507, WDM Failed to Read WDM_SIGNATURE

Description

The WDM_SIGNATURE or WDM_SIGNATURE_DATA section of the PROC could not be found.

Default values have been applied.

Task: *arg*

Continues on next page

112508, WDM Failed to Read WDM_SIGNATURE

Description

The WDM_SIGNATURE or WDM_SIGNATURE_DATA section of the PROC could not be read.

Task: *arg*

Consequences

Weld Data Monitor may be inoperable.

Recommended actions

Please review PROC settings to correct.

Recommended actions

Restarting the controller and starting from the main may resolve the problem for the next learning cycle.

112513, WDM Signature File Inaccessible

Description

The stored signature could not be written to.

Seam Name: *arg*

Task: *arg*

The file may have been left open by another application.

Consequences

Weld Data Monitor is unable to evaluate this weld seam.

Recommended actions

Restarting the controller and starting from the main may resolve the problem for the next learning cycle.

112509, WDM Failed to Read WDM_TOLERANCE

Description

The WDM_TOLERANCE section of the PROC could not be read.

Task: *arg*

Consequences

Weld Data Monitor may be inoperable.

Recommended actions

Please review PROC settings to correct.

112514, WDM Results File Inaccessible

Description

The measured results could not be read.

Seam Name: *arg*

Task: *arg*

The file may have been left open by another application.

Consequences

Weld Data Monitor is unable to evaluate this weld seam.

Recommended actions

Restarting the controller and starting from the main may resolve the problem for the next learning cycle.

112510, WDM Learning Results Stored

Description

A learning cycle has finished for *arg* in task *arg* *arg* of *arg* learning cycles completed.

Sample size: *arg*

112511, WDM Learning Complete

Description

Learning is complete for *arg* in task *arg* *arg* of *arg* learning cycles completed.

Sample size: *arg*

Consequences

Monitoring will be active the next time this seam is welded.

112512, WDM Signature File Inaccessible

Description

The stored signature could not be read.

Seam Name: *arg*

Task: *arg*

The file may have been left open by another application.

Consequences

Weld Data Monitor is unable to evaluate this weld seam.

112515, WDM Data Reading Timeout

Description

Data could not be read from the binary file within a reasonable time.

Seam Name: *arg*

Task: *arg*

Timeout: *arg* seconds

Consequences

Weld Data Monitor is unable to evaluate this weld seam.

Recommended actions

Delete the stored WDM files and relearn.

112516, WDM Data Checksum Error

Description

Data read from the binary file did not match the expected size.

Seam Name: *arg*

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Task: arg

Consequences

Weld Data Monitor is unable to evaluate this weld seam.

Recommended actions

Delete the stored WDM files and relearn.

112517, WDM Unknown Error

Description

An unexpected error occurred in WriteSigData.

Seam Name: arg

Task: arg

Consequences

Weld Data Monitor is unable to evaluate this weld seam.

Recommended actions

Please report to your ABB representative.

112518, WDM Unknown Error

Description

An unexpected error occurred in EvalSigData.

Seam Name: arg

Task: arg

Consequences

Weld Data Monitor is unable to evaluate this weld seam.

Recommended actions

Please report to your ABB representative.

112519, WDM Signature File Too Short

Description

The end of the signature file was reached before welding stopped.

Seam Name: arg

Task: arg

Current number of samples: arg

Consequences

Weld Data Monitor is unable to evaluate this weld seam.

112520, WDM File Access Error

Description

Could not open the binary data file described below.

File: arg

Task: arg

The file may have been left open by another application.

Consequences

Weld Data Monitor will be inoperable.

Recommended actions

Restarting the controller and starting from the main may resolve the problem for the next learning cycle. Deleting the file may also resolve the problem.

112521, WDM File Access Error

Description

Could not close a binary data file.

Task: arg

Consequences

Weld Data Monitor may be inoperable.

Recommended actions

Restarting the controller and starting from the main may resolve the problem for the next learning cycle. Deleting the file may also resolve the problem.

112522, WDM File Access Error

Description

Could not seal the binary data file described below.

File: arg

Task: arg

Consequences

Weld Data Monitor will be inoperable.

Recommended actions

Restarting the controller and starting from the main may resolve the problem for the next learning cycle. Deleting the file may also resolve the problem.

112523, WDM Sample Size Error

Description

The number of points stored in the last weld seam does not match the number stored in the existing signature file.

Seam Name: arg

Task: arg

Measured samples: arg

Signature samples: arg

Consequences

Weld Data Monitor will be unable to evaluate the data from this seam.

Continues on next page

112524, WDM Weld End Error

Description

An unspecified error occurred at the end of the seam.

Task: *arg*

Consequences

Weld Data Monitor may be inoperable.

Recommended actions

Please contact your ABB representative.

112525, WDM Weld Start Error

Description

An unspecified error occurred at the start of the seam.

Task: *arg*

Consequences

Weld Data Monitor may be inoperable.

Recommended actions

Please contact your ABB representative.

112526, WDM Learning Started

Description

No previously stored signature exists for *arg* in task *arg*.

Learning will begin now.

Learning cycles required: *arg*

112527, WDM Text Resource Error

Description

Text Resource Error.

Weld Data Monitor could not access text.

Index: *arg*

File: *arg*

Task: *arg*

Recommended actions

Please contact your ABB representative.

112528, WDM Minor Infraction

Description

A minor *arg* infraction has occurred in seam *arg*.

Measured value: *arg*

Maximum limit: *arg*

Minimum limit: *arg*

112529, WDM Major Infraction

Description

A major *arg* infraction has occurred in seam *arg*.

Measured value: *arg*

Maximum limit: *arg*

Minimum limit: *arg*

112530, WDM Error

Description

An unspecified error has occurred in the Weld Data Monitor for task *arg*

Recommended actions

Please contact your ABB representative.

112531, WDM Trigger Ready

Description

Weld Data Monitor is ready to sample data for task *arg*

112532, WDM Trigger Subscriptions Failed

Description

Weld Data Monitor trigger subscriptions failed for task *arg*

Consequences

Weld Data Monitor will be inoperable.

112533, WDM Trigger IO Setup Failed

Description

Weld Data Monitor trigger IO connections failed for task *arg*

Consequences

Weld Data Monitor will be inoperable.

112534, WDM Weave Frequency Error

Description

Weave frequency is too fast for *arg* in task *arg*.

Consequences

WDM will reduce sampling rate to a fraction of the weave frequency.

112535, WDM Weave Frequency Error

Description

Weave frequency is too fast for *arg* in task *arg*.

Consequences

No monitoring will occur.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

Please reduce weave frequency to enable Weld Data Monitoring.

112536, WDM Weave Change Error

Description

The weave parameters have changed since learning of seam *arg* in task *arg*.

Consequences

No monitoring will occur.

Recommended actions

Please remove the stored signature and relearn with new parameters. Or, reinstate old parameters.

112537, WDM Speed Change Error

Description

The weld travel speed has changed since learning of seam *arg* in task *arg*.

Consequences

No monitoring will occur.

Recommended actions

Please remove the stored signature and relearn with new parameters. Or, reinstate old parameters.

112538, WDM Seam Length Changed

Description

The weld seam length has changed since learning of seam *arg* in task *arg*.

Consequences

No monitoring will occur.

Recommended actions

If the targets defining the seam were intentionally modified, please remove the stored signature and relearn with the new targets.

112539, WDM Sample Frequency Error

Description

Sampling frequency is too fast for *arg* in task *arg*.

Consequences

WDM will reduce sampling rate to a fraction of the requested frequency.

112540, WDM Sample Frequency Error

Description

Sampling frequency is too fast for *arg* in task *arg*.

Consequences

No monitoring will occur.

Recommended actions

Please reduce sampling frequency to enable Weld Data Monitoring.

112541, WDM welddata Change Error

Description

The weld parameters have changed since learning of seam *arg* in task *arg*.

Consequences

No monitoring will occur.

Recommended actions

Please remove the stored signature and relearn with new parameters. Or, reinstate old parameters.

112542, WDM Synchronizing Samples

Description

The segment number of the stored data is lagging the actual sample. This is normal behavior associated with execution stops.

Seamname: *arg*

Task: *arg*

Consequences

Some samples may have been ignored during the transition between segments.

112543, WDM Synchronizing Samples

Description

The segment number of the actual sample is lagging the stored data. This is normal behavior associated with execution stops.

Seamname: *arg*

Task: *arg*

Consequences

Some samples may have been ignored during the transition between segments.

Continues on next page

112544, WDM Sample Distance Changed

Description

The weave parameters, or no-weave sample distance, have changed since learning was finished for seam *arg* in task *arg*.

Consequences

No monitoring will occur.

Recommended actions

Please remove the stored signature and relearn with new parameters. Or, reinstate old parameters.

112600, Init of communication interface failed

Description

Task *arg*

Communication interface could not be initialized.

Program Ref. *arg*

Recommended actions

Check communication settings and parameters and restart application.

Recovery: *arg*

112601, Incorrect data received.

Description

The data received from remote system is incorrect. It is either a data error of the remote system, or a wrong message was received.

Recommended actions

Check data and program logic.

112602, Communication interface error.

Description

There is an error detected in the communication with the external system.

Recommended actions

Check remote system and connection. Restart communication.

112603, Failed to access the config files

Description

The configuration and settings files for the communication interface is not found in the HOME/GSI folder.

Recommended actions

Check that the HOME/GSI folder exists and that the configuration and settings files can be found there. Restart communication.

112700, Integrated Vision not installed

Description

The option Integrated Vision is not installed on this system.

Consequences

No communication with the camera is possible.

Probable causes

An attempt may have been made to use the Integrated Vision functionality without installing the option correctly.

Recommended actions

- 1) If the Integrated Vision option is required: configure a new system with this option, and install the system.
- 2) If the Integrated Vision option is not required: remove the use of Integrated Vision functionality, i.e. RAPID or configuration data.

112701, Communication failure with camera

Description

The robot controller failed to communicate with camera *arg*.

Consequences

Camera commands and results may be lost.

Probable causes

The reasons for this error can be:

- 1) The camera is not connected to the controller.
 - 2) There is no power to the camera.
 - 3) The camera's IP address is not valid.
 - 4) The camera is not connected to the proper network interface.
- Normally only the service port is supported.

Recommended actions**Recommended Actions**

- 1) Check cabling between robot controller and camera.
- 2) Check that the LED power and link indicators on the camera are active.
- 3) Use RobotStudio to check that the IP address has been configured correctly.

112702, Camera job is not valid

Description

The camera *arg* is in running mode, but the loaded job is not a valid ABB job.

Consequences

All camera results will be lost.

Probable causes

An attempt may have been made to load a job that does not conform with the ABB definition of a job.

Continues on next page

5 Trouble shooting by event log

5.10 11 xxxx

Continued

Recommended actions

1. Set the camera in program mode.
2. Load a valid ABB job into the camera or use Robot Studio to create a new job.

114800, arg

Description

arg
arg
arg
arg

Recommended actions

114801, arg

Description

arg
arg
arg
arg

Recommended actions

114802, arg

Description

arg
arg
arg
arg

Recommended actions

114803, arg

Description

arg
arg
arg
arg

Recommended actions

114804, arg

Description

arg
arg
arg
arg

Recommended actions

114805, arg

Description

arg
arg
arg
arg

Recommended actions

114806, arg

Description

arg
arg
arg
arg

Recommended actions

114807, arg

Description

arg
arg
arg
arg

Recommended actions

114808, arg

Description

arg
arg
arg
arg

Recommended actions

114809, arg

Description

arg
arg
arg
arg

Continues on next page

Recommended actions

114810, arg

Description

arg
arg
arg
arg

Recommended actions

114811, arg

Description

arg
arg
arg
arg

Recommended actions

114812, arg

Description

arg

arg

arg

arg

Recommended actions

114813, arg

Description

arg
arg
arg
arg

Recommended actions

114814, arg

Description

arg
arg
arg
arg

Recommended actions

5 Trouble shooting by event log

5.11 12 xxxx

5.11 12 xxxx

120001, Out of memory in cfg

Description

There is not enough memory in the cfg database for this operation.

Consequences

The configuration file will not be installed.

Recommended actions

- 1) Try to use the option: delete existing parameters before loading when loading the configuration file. This will delete all previous configuration settings for the domain.
- 2) Increase the size of the configuration database.

120002, Instance cannot be saved

Description

Not allowed to overwrite instance in line *arg* of file *arg*.

Consequences

The instance may be write protected and the configuration in file will not be installed.

Probable causes

Recommended actions

You are not allowed to change the instance.

120003, Wrong cfg domain version

Description

The cfg domain version is wrong in file *arg*. This version of RobotWare is made for reading domain *arg* with version *arg*.

Consequences

The configuration in file might not be installed correctly.

Probable causes

Recommended actions

- 1) Migrate or edit the configuration file and update the version in the header of the file.

120004, Line too long

Description

Line *arg* in file *arg* contains *arg* characters, which is more than the allowed *arg*.

Consequences

The configuration in file will not be installed.

Probable causes

Recommended actions

- 1) Re-edit the configuration file and reduce the number of characters, e.g. by splitting the instance into several lines. End each line, except the last one, with a trailing backslash "\\" to achieve this.

120005, Attribute value out of allowed range

Description

Attribute '*arg*' on line *arg* in file *arg* is out of the allowed range. The allowed range is <*arg*> - <*arg*>.

Consequences

The configuration in file will not be installed.

Probable causes

Recommended actions

- 1) Re-edit the configuration file and change the value on the attribute to fit inside the allowed range.

120006, Instance name occupied

Description

Instance in line *arg* in file *arg* is already occupied.

Consequences

The configuration in file will not be installed.

Probable causes

Recommended actions

- 1) Re-edit the configuration file and change the instance name to add it to the file OR
- 2) Use the "Replace" mode to overwrite the instance previously using the name. This may be selected when loading the configuration file using RobotStudio, and the procedure is detailed in the RobotStudio Manual.

120007, Unknown input in cfg file

Description

The name or the value of attribute '*arg*' in line *arg* in file *arg* is not recognized.

Consequences

The configuration in file will not be installed.

Probable causes

The configuration file contains invalid input.

Continues on next page

Recommended actions

- 1) Re-edit the configuration file.

120008, Mandatory attribute is missing in cfg file**Description**

Missing mandatory attribute *arg* on line *arg* in file *arg*.

Consequences

The configuration in file will not be installed.

Probable causes

Missing/mistyped mandatory attribute.

Recommended actions

- 1) Re-edit the configuration file.

120009, Missing instance name in cfg file**Description**

Missing instance name on line *arg* in file *arg*.

Consequences

The configuration in file will not be installed.

Probable causes**Recommended actions**

- 1) Re-edit the configuration file.

120010, Configuration attribute value out of the allowed range**Description**

Configuration attribute *arg* on line *arg* in file *arg* is out of the allowed range. The max. allowed length is *arg* characters.

Consequences

The configuration in file will not be installed.

Probable causes**Recommended actions**

- 1) Re-edit the configuration file and change the value on the attribute to fit inside the allowed range.

120011, Illegal version string**Description**

The version string in configuration file *arg* has illegal format.

Consequences

The configuration in file will not be installed.

Probable causes

The configuration file is made for a different system version/revision.

The version string in the configuration file is mistyped/missing.

The configuration file is corrupted.

Recommended actions

- 1) Re-edit the configuration file and change the version string according to this layout:
"domain":CFG_1.0:"version":"revision":..

120012, Illegal domain name**Description**

The domain name *arg* in configuration file *arg* is illegal.

Consequences

The configuration in file will not be installed.

Probable causes

The domain name may be mistyped or the domain is not installed in the system.

Recommended actions

- 1) Re-edit the configuration file and change the domain name.

120013, Illegal type name**Description**

The type name 'arg' in configuration file *arg* cannot be found in domain *arg*.

Consequences

The configuration in file will not be installed correctly.

Probable causes

The type name may be mistyped or the type is not installed in the system.

Recommended actions

- 1) Re-edit the configuration file and reload the cfg file.

120014, Configuration file error**Description**

Errors occurred during loading of configuration data.

All configuration errors are placed in the cfg Event Log.

Consequences

The configuration in file will not be installed.

Recommended actions

- 1) Make sure that the syntax of the CFG file is correct.
- 2) Make sure that the options are installed that matches types in the CFG file.
- 3) Check for additional errors in the CFG event log.

Continues on next page

5 Trouble shooting by event log

5.11 12 xxxx

Continued

120015, Invalid arg

Description

The *arg* 'arg' is invalid.

Parameter 'arg' is invalid here.

File: *arg*. Line: *arg*.

Consequences

The configuration in file will not be installed correctly.

Probable causes

The parameter is not valid.

Recommended actions

1) Re-edit the configuration file and reload the cfg file.

120016, Invalid arg

Description

Parameter 'arg' has an invalid value: 'arg'

Valid values: *arg*

arg

Consequences

The configuration in file will not be installed correctly.

Probable causes

The value might be mistyped.

Recommended actions

1) Re-edit the configuration file and reload the cfg file.

120017, Invalid Rapid Identifier

Description

The value 'arg' of parameter 'arg' for configuration instance 'arg' is invalid.

Consequences

The configuration in file will not be installed.

Probable causes

The value might be mistyped.

Recommended actions

Correct the value of the parameter so that it complies with the following rules:

Rules of RAPID identifiers:

- 1) The length must not exceed 16 characters.
- 2) The first character must be a letter (a-z or A-Z).
- 3) Subsequent characters must be letters (a-z or A-Z), digits (0-9) or underscores (_).

5.12 13 xxxx**130002, Equipment error****Description**

Paint process stopped.

Recommended actions

Check the paint equipment.

130008, Trig plane error**Description**

In 'SetBrush n': One trig plane, *arg*, is defined outside the programmed path.

Recommended actions

Change eventdata or reprogram path.

131000, Argument error.**Description**

The argument is not an integer.

Recommended actions

Change the argument to an integer.

131006, Argument value error**Description**

Negative value for argument no. *arg*

Recommended actions

Change argument value to a positive number.

131007, Signal '*arg*' does not exist**Description**

Signal: *arg*

Task: *arg*

Context: *arg*

Recommended actions

Check signal definitions.

Define signal or find an existing signal.

131013, Non-existing signal**Description**

The following signal did not exist:

'*arg*'

Recommended actions

Check signal definitions.

Define signal or find an existing signal

131015, Too many trig events**Description**

The maximum number of trig events (10) between two PaintL instructions is exceeded.

Task: *arg*

Instruction: *arg*

Context: *arg*

Recommended actions

Reduce the number of trig events.

131016, Illegal value for signal *arg***Description**

An attempt was made to set an illegal value *arg* for signal *arg*.

Consequences

Signal will not be set.

Recommended actions

Check that signal is within defined limits.

131017, SetBrushFac: Illegal applicator number *arg***Description**

Device AargBrush not found.

Consequences

Brush factor is not set.

Recommended actions

Check IPS config that device exists for this applicator number.

131018, SetBrushFac: Illegal factor or channel number**Description**

Channel *arg* is invalid or factor *arg* outside limit. (Range: 1-200%)

Consequences

Brush factor is not set.

Recommended actions

Check channel number and factor.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

131019, Unexpected IPS return value

Description

Command *arg* sent from RAPID returned value *arg*

Consequences

IPS parameter not set

Recommended actions

Check IPS and RobotWare compatibility or contact ABB support

131020, Unknown IPS command sent from RAPID

Description

The IPS command *arg* is unknown

Consequences

IPS parameter not set

Recommended actions

Check IPS and RobotWare compatibility or contact ABB support

131030, Failed to set IPS parameter.

Description

Device: *arg*, Parameter: *arg*, Task: *arg*, Context: *arg*

Recommended actions

Check if device and parameter exists.

131031, Failed to get IPS parameter.

Description

Device: *arg*, Parameter: *arg*, Task: *arg*, Context: *arg*

Recommended actions

Check if device and parameter exists.

131050, Failed to get index file data.

Description

Unable to open file: *arg*, Task: *arg*, Context: *arg*

Recommended actions

Check if index file exists.

131051, Failed to get index file data.

Description

Cannot find row number: *arg*, File: *arg*, Task: *arg*, Context: *arg*

Recommended actions

Check if row number exists in index file.

131052, Failed to get index file data.

Description

Cannot find column number: *arg*, Row: *arg*, File: *arg*, Task: *arg*,

Context: *arg*

Recommended actions

Check if column number exists at row in index file.

131400, Invalid program mapping index.

Description

Line *arg* in file *arg* is invalid.

Consequences

The index will be ignored.

Recommended actions

Check line in file for errors.

131401, Program mapping missing comma.

Description

Line *arg* in file *arg* does not contain a comma.

Consequences

The index will be ignored.

Recommended actions

Check line in file for errors.

131500, Command toggle was sent before previous command was finished.

Description

Command toggle for command number *arg* was sent before command number *arg* was finished.

Consequences

The command is ignored.

Recommended actions

Check PLC timing.

131501, Command toggle was lowered before command was finished.

Description

Command toggle for command number *arg* was lowered before it was finished.

Consequences

Command result will not be available.

Recommended actions

Check PLC timing.

Continues on next page

131540, Command is not allowed in manual mode.**Description**

Command number *arg* was sent in manual mode from *arg*.

Consequences

The command is rejected.

Recommended actions

Switch to automatic mode.

131550, Command timed out.**Description**

Wait for command number *arg* timed out.

Consequences

The actual command result will be received.

Recommended actions

Check if command uses too much time to execute.

131551, Command buffer full.**Description**

Unable to append command number *arg* because the buffer is full.

Consequences

The command will be rejected.

Recommended actions

Make sure previous command has finished before sending a new one.

131600, Proceed of material change failed.**Description**

The system was unable to send proceed command to material change engine.

Consequences

Material change becomes unsynchronized.

Recommended actions

Check communication between main computer and IPS.

131601, Material change error.**Description**

arg

131602, Material change warning.**Description**

arg

131650, No contact with material change engine.**Description**

The system was unable to communicate with external material change engine on PIB.

Consequences

Material change information will not be updated.

Recommended actions

Check that material change has been installed correctly on PIB.
Check communication between main computer and PIB.

131700, Maximum negative lag of conveyor reached.**Description**

The conveyor is running too fast compared to configured nominal speed.

Recommended actions

Check nominal speed setting or reduce conveyor speed.

131850, Bell speed rotation sensor calibration started.**Description**

The system has started calibration of the rotation sensor.

131851, Bell speed rotation sensor calibration finished.**Description**

Calibration of rotation sensor finished without errors.

131852, Bell speed rotation sensor calibration failed.**Description**

Calibration of rotation sensor finished with errors.

Recommended actions

Check for other process related error messages.

132500, Unable to open symbol.**Description**

Output for symbol *arg* not found.

NOTE: No paint-related outputs available

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

due to this error.

Recommended actions

1. Output for symbol not defined.
2. Output for symbol has wrong name.
3. Internal problem (memory etc..)

Try a restart.

132601, PIB contact lost

Description

Controller has lost connection with the Process Interface Board (PIB).

Consequences

The system goes to status SYS_FAIL.

Probable causes

1. Broken ethernet cable between PIB and MC
2. High network load.

Recommended actions

Check main computer
PIB Ethernet cable.
Restart the controller

132602, Invalid signal path for signal arg

Description

The path *arg* is invalid for signal *arg*

Consequences

This signal will be disabled

Recommended actions

Check that the named device exist in IPS and there are no conflicts. For numeric unit mapping on digital signals, please note that IPS uses 1-indexing while EIO uses 0-indexing.

132603, Watchdog fault between PIB and MC

Description

Controller has discovered watchdog fault towards Process Interface Board (PIB)

Consequences

The system goes to status SYS_FAIL.

Probable causes

1. Broken cable
2. High network load.

Recommended actions

If problem persists:
Check main computer

Check ethernet cable between PIB and main computer.

Restart the controller

132604, Regained contact with PIB

Description

Controller has regained contact with the Process Interface Board (PIB) after watchdog fault.

132999, Process error context

Description

arg, arg, arg, arg, arg

Probable causes

This message is associated with an IPS error and is used to map the problem to TCP position for visualization purposes.

133000, IPS Cfg Error

Description

Cfg Error: *arg*

Error accessing IPS config file *arg*. This config file is stored on one of the installed IPS nodes.

Recommended actions

1. Check IPS config file for errors.
2. Check if config file is stored on the correct IPS node.

133001, IPS Cfg Error

Description

Cfg Error: *arg*.

Error in IPS config file *arg* in line *arg*. This IPS config file is located on one of the IPS nodes.

Recommended actions

1. Check in IPS config file for error in given line.

133002, IPS Cfg Error

Description

Syntax Error: *arg*.

Faulty argument: *arg*, in IPS config file *arg* in line *arg*. This IPS config file is located on one of the IPS nodes.

Recommended actions

1. Check in IPS config file for error in given line.

133003, IPS Cfg Error

Description

Assertion error: *arg*.

Continues on next page

Error in IPS config file *arg* in line *arg*. This IPS config file is located on one of the IPS nodes.

Recommended actions

1. Check in IPS config file for error in given line.

133004, IPS Cfg Token Error**Description**

Cfg Token Error: *arg*.

Error in token *arg*, in IPS config file *arg* in line *arg* and character position *arg*. This IPS config file is located on one of the IPS nodes.

Recommended actions

1. Check in IPS config file for error in given line.

133005, IPS License Error**Description**

License server is not found.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Check that the system has a license server.
2. Check status on license server.
3. Check communication towards license server.

133006, IPS License Error**Description**

ID chip is not found.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Check that ID chip is mounted on PIB.

133007, IPS License Error**Description**

Wrong serial number.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Check serial number in license file.
2. Check that correct ID chip is mounted.

133008, IPS License Error**Description**

License file is not found. File name must be 'option.lic'.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Check that license file exist on license server.

133009, IPS License Error**Description**

License code in license file is not correct.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Check that the license file on license server is identical to the original license file.

133010, IPS License Error**Description**

Syntax error in license file.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Make sure the original license file is used.
2. Order new license file.

133011, IPS License Error**Description**

Option does not exist in license file.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Check if option exist in license file.
2. Check if correct license file loaded.
3. Check in IPS config file for errors.
4. Order new license file.

133012, IPS License Error**Description**

Counting option has no free licenses.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Check number of uses vs. license file.
2. Check if correct license file loaded.
3. Check in IPS config file for errors.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

133013, IPS License Error

Description

Protocol error in communication towards license server.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Contact customer support.

133014, IPS License Error

Description

Communication fault. License server has been found, but communication is lost.

Could not obtain option: *arg*

Reference: *arg*

Recommended actions

1. Check communication towards license server.

133200, *arg*:Trig error

Description

IPS has discovered an impossible trig time error.

This situation may occur if trig-events are programmed too close each other in e.g. a cleaning sequence.

Recommended actions

1. Check if events for named device are programmed too close each other.
2. Check compensation delays for named device.

133201, *arg*:Locked

Description

The named device is locked by IPS.

Can't set a value to this device when locked, and there is no direct access to it.

Recommended actions

1. Check if system tries to run named device, when it is already locked (connected) to another device.

133202, *arg*:Disabled

Description

Impossible to set a command value to

Continues on next page

named device when it is disabled.

When a device is disabled, it is not possible to operate it.

Recommended actions

1. Enable named device and set a new command to it.
2. Check if IPS config is set up to disable the named device.

133203, *arg*:Disconnect.

Description

The resource(s) for named device is disconnected and named device is not operational. The connect signal for the device is set to 0.

Recommended actions

1. Set the connect signal for the named device to 1.
2. Check if the system sets the connect signal to 0 in some special cases.

133204, *arg*:Not ready

Description

Can't set value: Named device is not ready and is halted by some supervision functions or it have a general problem.

Recommended actions

1. Check if IPS is setup with any supervision functions for named device.
2. Check if named device have any problem, fix the problem and retry.

133205, *arg*:Sprv. alarm

Description

Can't set value: An alarm that is supervising named device is active.

One of the installed alarms prevents the named device from being operational.

Recommended actions

1. Check for supervision alarms that sets named device in a not ready state.
2. Fix the actual alarm state.

133206, Lock arg failed

Description

Locking of a resource for named device failed. The same resource may have been allocated by another device.

Recommended actions

1. Check in IPS config if several IPS devices are using the same resource.

133207, arg:Val hi

Description

Value for named sensor or device has exceeded maximum limit.
IPS has discovered an alarm state for named sensor or device.

Recommended actions

1. Check if value for named sensor or device is too high.
2. Check for IPS configured LIMIT-alarms and verify that limits are OK.

133208, arg:Val lo

Description

Value for named sensor or device has exceeded minimum limit.
IPS has discovered an alarm state for named sensor or device.

Recommended actions

1. Check if value for named sensor or device is too low.
2. Check for IPS configured LIMIT-alarms and verify that limits are OK.

133209, arg:Act.val hi

Description

Actual value for named device has exceeded maximum limit. IPS has discovered too high actual value compared to the setpoint value.

Recommended actions

1. Check for IPS configured DEVIATION-alarms and verify that parameter limits are OK.
2. Check if the sensor, used by named

device, is noisy.

133210, arg:Act.val lo

Description

Actual value for named device has exceeded minimum limit. IPS has discovered too low actual value compared to the setpoint value.

Recommended actions

1. Check for IPS configured DEVIATION-alarms and verify that parameter limits are OK.
2. Check if the sensor, used by named device, is noisy or sending values.

133211, arg:Comp. hi

Description

Regulator for named device has compensated too much compared to the calibrated curve and its compensations parameter limits.

Recommended actions

1. Check in IPS config if compensation limits for named device are too tight.
2. Check supply pressures, hoses, sensor and transducer used by named device.

133212, arg:Comp. lo

Description

Regulator for named device has compensated too much compared to the calibrated curve and its compensations parameter limits.

Recommended actions

1. Check in IPS config if compensation limits for named device are too tight.
2. Check supply pressures, hoses, sensor and transducer used by named device.

133213, arg:Potlife

Description

The potlife time for named device has expired and the fluid will start to cure! Paint equipment may be destroyed!
Start to flush system at once!

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

Recommended actions

1. Check if flushing of system is performed.
2. Check if potlife time is correct.

133214, arg:Setp. hi

Description

Setpoint value for named device is too high. The setpoint value is set to the maximum configured value for named device.

Recommended actions

1. Check if setpoint to named device is set too high.
2. Change the maximum value in the IPS config file if needed.

133215, arg:Setp. lo

Description

Setpoint value for named device is too low. The setpoint value is set to the minimum configured value for named device.

Recommended actions

1. Check if setpoint to named device is set too low.
2. Change the minimum value in the IPS config file if needed.

133216, arg:Seq. error

Description

IPS has discovered a trig sequence error. The Dynamic Delay Compensation function for named device measured an 'on'- transition while expecting an 'off'- transition. (Or opposite)

Recommended actions

1. Check if the sensor signal has the correct level.
2. Check if the sensor signal is noisy.

133217, arg:Unexp. trans.

Description

IPS has discovered an unexpected

Continues on next page

transition. The Dynamic Delay

Compensation function for named device measured a transition at a time when none was expected.

Recommended actions

1. Check relay and electrical connections for the sensor.
2. Check if the sensor signal is noisy.

133218, arg:Timeout On

Description

IPS has discovered a trig timeout for an 'on'- transition. The Dynamic Delay Compensation function has timed out for an 'on'- transition.

Recommended actions

1. Check sensor for named device.
2. Check wiring or relay for sensor.

133219, arg:Timeout Off

Description

IPS has discovered a trig timeout for an 'off'- transition. The Dynamic Delay Compensation function has timed out for an 'off'- transition.

Recommended actions

1. Check sensor for named device.
2. Check wiring or relay for sensor.

133220, arg:No signal

Description

IPS is reading a zero value from the sensor used by the named device. Wiring or supply to this sensor can be the reason.

Recommended actions

1. Check if used sensor is broken.
2. Check wiring of used sensor.
3. Check process supply for used sensor.

133221, arg:Max output

Description

The closed loop regulator for named

device has reached the maximum output.

Recommended actions

1. Check if the commanded value to the regulator is higher than possible for the application equipment.
2. Reduce setpoint to operate regulator within controllable range.

133222, arg:Min output**Description**

The closed loop regulator for named device has reached the minimum output.

Recommended actions

1. Check if the commanded value to the regulator is lower than possible for the application equipment.
2. Increase setpoint to operate regulator within controllable range.

133223, arg:Interlock**Description**

IPS has discovered an interlock conflict error. An attempt was made to operate more than one valve or device in an interlocked group.

Recommended actions

1. Set active valve or device to zero before activating a new one.

133224, Acknowledge needed**Description**

arg is currently halted by an alarm supervision and an acknowledge of named device is needed.

Recommended actions

1. Check the alarms that is halting the named device.
2. Recover the alarm situation.
3. Acknowledge the alarm for named device and retry.

133225, DMC error**Description**

Following Digital Motor Controller (DMC) error message was sent to IPS:

arg.

IPS has lost communication or discovered an error sent from the named DMC driver.

Recommended actions

1. Check cables to the DMC.
2. Check power supply to the DMC.
3. For more info, see the Unit Description, Paint manual.

133226, arg.**Description**

Setpoint error.

IPS has discovered an error to set a signal on the named device.

Recommended actions

1. Check if signal is available for named device.

133250, arg:Comm. err**Description**

IPS has discovered an internal CAN-communication error. Communication on CAN-bus between IPS nodes is lost. System will try to reconnect if possible.

Recommended actions

1. Check CAN-bus cables for IPS nodes.
2. Check IPS nodes for correct MacID.
3. Check CAN-bus termination resistors.

133251, arg:New curve**Description**

IPS has created a new dynamic or calibrated curve, number *arg*, for named device.

Recommended actions

133252, arg:Calc. curve**Description**

IPS has recalculated a dynamic or calibrated curve, number *arg*, for named

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

device. The range of curve is modified due to modified range of regulator.

Recommended actions

133253, arg:Resizing

Description

IPS has resized a dynamic or calibrated curve, number *arg*, for named device. Due to change in curvesize parameter, the existing curves are transformed to the new curvepoint size.

Recommended actions

133254, arg:DMC error

Description

IPS has lost communication or discovered an error sent from named DMC-driver.
DMC error code is: *arg*.

Recommended actions

1. Check DMC-driver status LEDs.
2. Check power supply on the DMC-driver.
3. Turn off and on the DMC-driver power.

133255, Apmb error

Description

IPS has discovered an Apmb-driver (Berger-Lahr driver) error.
Apmb-driver, number: *arg*, has issued an error.

Recommended actions

1. Check the fault LEDs codes on the Berger-Lahr Drive unit.
2. Check stepper motor.
3. Check wiring for Berger-Lahr driver.

133256, arg:Curve err

Description

IPS has discovered a number format on named dynamic/calibrated curve that is not correct.

Recommended actions

1. Check if an already saved curve on the IPS node has an incompatible number

format than expected.

2. Delete the saved curve on the IPS board.

133257, SDI error

Description

SDI board have issued following error:*arg*, with error code:*arg*.

Recommended actions

1. Check SDI board for errors.

133258, VCD error,MacID:*arg*

Description

IPS has discovered an error on a VCD board with following details:*arg*.

Recommended actions

1. Check VCD board for the error reason given.
2. Replace the VCD board.

133259, File Access Error

Description

IPS has discovered a File Access Error on following file: *arg*.

Recommended actions

1. Check if named file exists.
2. Check if file is currently in use.

133260, File Defaulted

Description

IPS has created a default file of type: '*arg*' with following file name: *arg*.

Recommended actions

133261, File Parse Error

Description

IPS failed to load the following file *arg* in line *arg*.
Detailed error text: *arg*.

Recommended actions

1. Check that named file has the correct format for its use.

Continues on next page

133262, New index entry in file**Description**

IPS has created in file: *arg*
a new index entry with value: *arg*

Recommended actions

133263, PPRU CAN Error**Description**

PPRU unit: *arg*,
register '*arg*' = *arg*

133264, PPRU Error**Description**

PPRU unit: *arg*,
message = '*arg*'

133265, SPI down: *arg***Description**

IPS on node *arg* has discovered an SPI-communication error.
arg
System will try to reconnect.

Recommended actions

1. Check serial cable to SPI board.
2. Check power cable to SPI board.
3. Check/replace SPI board.

133266, SPI up: *arg***Description**

SPI reconnected on node *arg*.

133267, Missing index entry in file**Description**

IPS has tried to use a none existing index entry in file *arg* with
value *arg*.

Recommended actions

If this index entry is valid, it must be manually added to named
index file.

133268, *arg*: Failed to load brush table.**Description**

IPS has tried to load brush table *arg* on the named device.

Recommended actions

1. Check other error messages for detailed explanation.

133269, *arg*: Failed to set brush.**Description**

IPS has tried to set brush number *arg* in brush table *arg* on the
named device.

Recommended actions

1. Check if brush table (or material) is selected.
2. Check if selected brush number exists in loaded brush table.
3. Check global brush table if brush number larger than 900.

133270, Failed to update IPS parameters**Description**

IPS failed to update IPS parameter values after reconnect of
IPS agent connections. The update was initiated after the IPS
agents have been lost for any reason, typically caused by a
purge fault.

The system must be restarted to ensure all parameters are set
with correct values.

Consequences

IPS parameters may not have been updated with correct values.

Probable causes

IPS device or parameter may not exist or command is given
with an invalid value.

Recommended actions

1. Check if all IPS nodes are up and running.
2. Check IPS parameter files.
3. Restart system.

133271, IPS parameters updated**Description**

IPS has updated parameter values after reconnect of IPS agent
connections, typically caused by a purge fault.

133280, Servo create error**Description**

SDI board has discovered an error while
loading configuration.

Recommended actions

1. Check SDI configuration.
2. Check/replace SDI board.
3. Contact customer support.

133281, Servo meas. system error**Description**

SDI board has discovered an error on the

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

serial line for the measurement system.

Recommended actions

1. Check cables and connectors.
2. Check measurement board.
3. Contact customer support.

133282, Servo drive system error

Description

SDI board has discovered an error on the serial line for the drive system.

Recommended actions

1. Check cables and connectors.
2. Check serial line, maybe a loop-link is required.
3. Check drive units.
4. Contact customer support.

133283, Servo calibration done

Description

SDI board has performed calibration.

Recommended actions

133284, Servo calibration error

Description

SDI board has discovered an error while doing calibration.

Recommended actions

1. Retry calibration.
2. Contact customer support.

133285, Servo calibration timeout

Description

SDI board has discovered that the calibration job has timed out.

Recommended actions

1. Retry calibration.
2. Contact customer support.

133286, Servo config. timeout

Description

SDI board has discovered an error while loading configuration.

Recommended actions

1. Check SDI configuration.
2. Check/replace SDI board.
3. Contact customer support.

133287, Servo coeff. set error

Description

SDI board has discovered a problem to assign a specified set of coefficients.

Recommended actions

1. Check FILTERASSIGN section in SDI configuration file for errors.
2. Check/replace SDI board.
3. Contact customer support.

133288, Servo illegal hardware

Description

SDI board has discovered an error while loading configuration.

Recommended actions

1. Check SDI hardware version.
2. Check/replace SDI board.
3. Contact customer support.

133300, Drive units power up

Description

After power up or reset of Drive units the 'POWER_UP'-error bit is set. This is to indicate that the Drive units needs to be initialized by downloaded parameters.

Recommended actions

1. This is info only, the software on the SDI board should automatically download parameters to the drives.

133301, SDI Servo WatchDog

Description

SDI board has discovered a watchdog reset from the Drive unit used by: arg.

Recommended actions

1. Restart robot controller.
2. Replace Drive unit.

Continues on next page

133302, SDI logic +/-15V error

Description

The SDI supply voltage for +/-15V is out of range, received from the Drive unit used by: *arg*.

Recommended actions

1. Check cabling on SDI board.
2. Check supply voltage of +/-15V from SDI board.
3. Replace Drive unit.

133303, SDI Comm. error

Description

SDI board has discovered too many consecutive communication errors reported by the Drive unit used by: *arg*.

Recommended actions

1. Check cabling.
2. Replace Drive unit.
3. Replace SDI board.

133304, Int. Drive unit error

Description

SDI board has discovered an internal error in the Drive unit used by: *arg*.

Recommended actions

1. Ignore if any other Drive unit errors are present.
2. Replace Drive unit.

133305, Drive glitch warning

Description

SDI board has discovered a glitch in the short circuit detector for the Drive unit used by: *arg*.

Recommended actions

1. Check for short circuit in cabling.
2. Check for short circuit in servo motor.
2. Replace Drive unit.

133306, Servo short circuit

Description

SDI board has discovered an short circuit in the Drive unit used by: *arg*.

Recommended actions

1. Check for short circuit in cabling.
2. Check for short circuit in servo motor.
3. Replace Drive unit.

133307, Servo temp. warning

Description

SDI board has discovered a high temperature warning in the Drive unit used by: *arg*.

ALLOW SYSTEM TO COOL DOWN!

Recommended actions

1. Check cooling fans and filters for the Drive unit.
2. Too high ambient temperature.
3. Check power consumption of the Drive.
4. Replace Drive unit.

133308, Servo Temp. alarm

Description

SDI board has discovered a high temperature alarm in the Drive unit used by: *arg*.

ALLOW SYSTEM TO COOL DOWN!

Recommended actions

1. Check cooling fans and filters for the Drive unit.
2. Too high ambient temperature.
3. Check power consumption of the Drive.
4. Replace Drive unit.

133309, Servo over temperature

Description

SDI board has discovered an over temperature error in the Drive unit used by: *arg*.

ALLOW SYSTEM TO COOL DOWN!

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

Recommended actions

1. Check cooling fans and filters for the Drive unit.
2. Too high ambient temperature.
3. Check power consumption of the Drive.
4. Replace Drive unit.

133310, Servo Drive overload

Description

SDI board has discovered high temperature in transistors on the Drive unit used by: *arg*.

This problem is caused by overload for the actual Drive.

Recommended actions

1. Too much torque for the Drive unit. Check system for overload in torque.
2. Check if robot or pump is jammed.
3. Replace Drive unit.

133311, Servo high voltage

Description

SDI board has discovered a DC-bus voltage higher than allowed.

This is detected in the Drive unit used by: *arg*.

Recommended actions

1. Check incoming mains.
2. Check/replace bleeder resistors and cabling.
3. Check/replace DC-link.
4. Replace Drive Unit.

133312, Servo over voltage

Description

SDI board has discovered a critical over voltage on DC-bus detected in the Drive unit used by: *arg*.

Recommended actions

1. Check incoming mains.
2. Check/replace bleeder resistors.
3. Check/replace DC-link.

133313, Servo DC low voltage

Description

SDI board has discovered a low voltage on DC-bus detected in the Drive unit used by: *arg*.

Recommended actions

1. Check incoming mains.
2. Check/replace bleeder resistors and cabling.
3. Check/replace DC-link.
4. Replace Drive Unit.

133314, Servo torque command err.

Description

SDI board has discovered a servo torque command error with too big difference in 3 consecutive torque references.

This error is received from the Drive unit used by: *arg*.

Recommended actions

1. Check resolver cabling and external noise in resolver cabling.
2. Check resolver ground connections.
3. Check SDI configuration if gain is too high.

133315, Servo resolver pos. err.

Description

SDI board has discovered a resolver position error with too big difference in 3 consecutive rotor positions.

This error is received from the Drive unit used by: *arg*.

Recommended actions

1. Check resolver cabling and external noise in resolver cabling.
2. Check resolver ground connections.

133316, Saturated current contr.

Description

SDI board has discovered that the Drive unit is unable to supply ordered current due to low DC-voltage or broken motor connections, received from the Drive unit used by: *arg*.

Continues on next page

Recommended actions

1. Check DC-bus voltage.
2. Check servomotor/cables.
3. Check SDI configuration.
4. Replace Drive Unit.

133317, Servo cable error**Description**

SDI board has discovered a servo cable error between Drive unit and servomotor. This error is received from the Drive unit used by: *arg*.

Recommended actions

1. Check servomotor/cables.
2. Replace Drive unit.
3. Replace SDI board.

133318, Servo under current error**Description**

SDI board has discovered a torque that is producing a current lower than ordered, received from the Drive unit used by: *arg*.

Recommended actions

1. Check SDI configuration.
2. Check DC-bus voltage.
3. Check servomotor/cables.

133319, Servo over current error**Description**

SDI board has discovered a torque that is producing a current higher than ordered, received from the Drive unit used by: *arg*.

Recommended actions

1. Check SDI configuration.
2. Check DC-bus voltage.
3. Check servomotor/cables.

133320, Drive unit regulator err.**Description**

SDI board has discovered an error in the Drive unit regulator (d-part) used by: *arg*.

Recommended actions

1. Check SDI configuration.
2. Check servomotor/cables.
3. Check resolver and resolver cabling.
4. Replace SDI board.

133321, Servo max. current error**Description**

SDI board has discovered a maximum current error, received from the Drive unit used by: *arg*.

Recommended actions

1. Check SDI configuration.
2. Check DC-bus voltage.
3. Check servomotor/cables.

133322, Servo unknown error code**Description**

SDI board has discovered an unknown extended servo error code. This is an internal error, received from Drive unit used by: *arg*

Recommended actions

1. Check/replace Drive unit.
2. Check/replace SDI board.
3. Contact customer support.

133323, Servo overrun error**Description**

SDI board has discovered a receiver overrun. This is an internal error, received from Drive unit used by: *arg*

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133324, Servo illegal node**Description**

SDI board has discovered a servo illegal node address error. This is an internal error, received from Drive unit used by: *arg*

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133325, Servo illegal key

Description

SDI board has discovered a servo illegal key value when connecting to an Drive unit. This is an internal error, received from the Drive unit used by: arg

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133326, Servo no parameter

Description

SDI board has discovered that no parameter is used. This is an internal error, received from the Drive unit used by: arg

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133327, Servo read only par.

Description

SDI board has discovered an attempt to write parameter values to read only parameters on a Drive unit. This is an internal error, received from the Drive unit used by: arg

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133328, Servo locked parameter

Description

SDI board has discovered an attempt to write parameter values to locked parameters on a Drive unit. This is an internal error, received from the Drive unit used by: arg

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133329, Servo diagnosis no par.

Description

SDI board has asked for a non existing parameter from the Drive unit used by: arg

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133330, Servo current meas. error

Description

SDI board has discovered a servo current measurement error, caused by an error in the current measurement bridge.

This is an internal error, received from the Drive unit used by: arg

Recommended actions

1. Check/replace Drive unit.
2. Check/replace SDI board.
3. Contact customer support.

133331, Servo syncslot occupied

Description

SDI board has discovered a syncslot occupy error received from the Drive unit used by: arg.

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.

Continues on next page

3. Check/replace SDI board.
4. Contact customer support.

Recommended actions

1. Check resolver cabling.
2. Contact customer support.

133332, Servo sync insert error**Description**

SDI board has discovered a sync insert error received from the Drive unit used by: *arg*.

Recommended actions

1. Check how motor and resolver are configured on the SDI board.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133333, Servo sync no load par.**Description**

SDI board has discovered a sync with no parameters, received from the Drive unit used by: *arg*.

Recommended actions

1. Check SDI configuration.
2. Check/replace Drive unit.
3. Check/replace SDI board.
4. Contact customer support.

133334, Servo position reg. error**Description**

SDI board has discovered a servo position regulator error, for: *arg*. This error is typical if the resolver feedback is noisy.

Recommended actions

1. Check resolver cabling.
2. Contact customer support.

133335, Servo speed reg. overflow**Description**

SDI board has discovered a servo speed regulator overflow error, for: *arg*. This error is typical if the resolver feedback is noisy.

133336, Servo speed filt overflow**Description**

SDI board has discovered a servo speed filter overflow error, for: *arg*.

Recommended actions

1. Change SDI board.
2. Contact customer support.

133337, Servo res. angle overflow**Description**

SDI board has discovered a resolver angle calculation overflow error, for: *arg*.

Recommended actions

1. Check resolver and resolver cabling.
2. Contact customer support.

133338, Servo resolver error**Description**

SDI board has discovered a failure in resolver angle square root calculation, for: *arg*. The squared result for x- and y-signal on resolver exceeded a limit.

Recommended actions

1. Check resolver and resolver cabling.
2. Replace serial measurement boards.

133339, Servo torque limit error**Description**

SDI board has discovered a servo torque limit error, for: *arg*.

Recommended actions

1. Check motorcables or servomotor.
2. Check torque limits in configuration.
3. Check if servomotor/gearbox is stuck.
4. Check if configuration is correct for used setup.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

133340, Drive unit comm. lost

Description

SDI board has lost communication with the Drive unit used by: *arg.*

Recommended actions

1. Check cable between SDI board and Drive unit.
2. Replace SDI board.
3. Replace Drive unit.

133341, Sms board comm. lost

Description

SDI board has lost contact with the serial measurement board, used by: *arg.*

Recommended actions

1. Check cable between SDI board and measurement board.
2. Replace SDI board.
3. Replace serial measurement board.

133342, Sms board comm. lost

Description

SDI board has lost contact with the serial measurement board, used by: *arg.*

Recommended actions

1. Check cable between SDI board and measurement board.
2. Replace SDI board.
3. Replace serial measurement board.

133343, Sms board comm. lost

Description

SDI board has lost contact with the serial measurement board, used by: *arg.*

Recommended actions

1. Check cable between SDI board and measurement board.
2. Replace SDI board.
3. Replace serial measurement board.

133344, Position step error

Description

SDI board has discovered an ordered position step length larger than the maximum specified step length, configured for: *arg.*

Recommended actions

1. Check the 'MaxStepSize' parameter in the configuration for named servo.
2. Check acc./speed for superior interpolator.
3. Check resolver and resolver cabling.

133345, Speed error

Description

SDI board has discovered a speed error for: *arg.*

Recommended actions

1. Check acc./speed for superior interpolator.
2. Check gain parameters for named servo.
3. Check resolver and resolver cabling.

133430, Servo DC-link overtemp.

Description

SDI board has discovered an over-temperature in DC-link: *arg.*

Recommended actions

1. Check cooling fans and filters for the DC-link.
2. Too high ambient temperature.
3. Check main supply for DC-link.
4. Replace DC-link unit.

133431, Servo bleeder overload

Description

SDI board has discovered a bleeder overload for DC-link: *arg.*

Recommended actions

1. Check bleeder connections.
2. Too much deceleration.
3. Check AC voltage to DC-link.
4. Replace DC-link unit.

Continues on next page

133433, Servo mains error

Description

SDI board has discovered an error on the main supply for the DC-link unit: *arg.*

Recommended actions

1. Check power supply to the DC-link.
2. Replace DC-link unit.

133434, Low DC voltage

Description

SDI board has discovered low DC voltage on the DC-link unit: *arg.*

Recommended actions

1. Check power supply to the DC-link.
2. Replace DC-link unit.

133435, DC-link +/-15V error

Description

The DC-link supply voltage for +/-15 volt is out of range, detected by the DC-link unit: *arg.*

Recommended actions

1. Check cabling.
2. Check +/-15V from power supply.
3. Replace DC-link unit.

133436, Open circuit in bleeder resistor circuit

Description

The bleeder resistor connected to the rectifier is an open circuit, detected by: *arg.*

Recommended actions

1. Make sure the bleeder resistor cable is correctly connected to the rectifier unit.
2. Make sure the cable and resistor is working correctly by measuring their resistance respectively. Disconnect before measuring.
3. Replace any faulty component.

133437, Short circuit in bleeder resistor circuit

Description

The bleeder resistor connected to the rectifier is a short circuit, detected by: *arg.*

Recommended actions

1. Make sure the bleeder resistor cable is correctly connected to the rectifier unit.
2. Perform a shutdown and then restart the system.
3. If the problem persists, isolate the faulty rectifier unit and replace it.

133501, Handler is not calibrated

Description

Could not enable the handler, because the handler was not calibrated.

Recommended actions

Calibrate the handler.

133502, Belt on the handler is not calibrated

Description

Could not enable the handler, because the belt on the handler is not calibrated.

Recommended actions

1. Be sure to calibrate the handler in two postions.
2. Update SDI-configuration to one point calibration.

133503, Belt calibration error

Description

The result of the belt-calibration was too inaccurate.

Recommended actions

1. Check SDI-configuration for position of calibration points.
2. Make sure that you calibrate in the the correct order and that the handler is positioned accurately.

133504, Move not allowed

Description

A new move command was given to the interpolator on the SDI board when it was already interpolating two paths.

Recommended actions

1. Check in program if several moves is performed, without waiting for the interpolator to be ready for next move.

133505, No servo response on SDI

Description

SDI board has discovered that a servo did not request for a new step from the

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

interpolator.

Recommended actions

1. Check in error log for the servo errors given.
2. Fix the actual servo problem and retry the system.

133507, Invalid interpolator step

Description

SDI board has discovered an invalid interpolator step in the system. The interpolator on the SDI board has tried to set an illegal step length, or too high speed is set in the move program.

Recommended actions

1. Check program for too high speed.
2. Check for configuration error (gear ratio, etc.).
3. Interpolator error.
4. Contact customer support.

133508, Servo read error

Description

SDI board has discovered a servo read error. The interpolator on the SDI board has failed to read from a servo.

Recommended actions

1. Check in error log for the servo errors given.
2. Replace SDI board.

133509, Handler not in position

Description

SDI board has discovered that the handler has not reached the correct position, after a specified time.

Recommended actions

1. Check for servo errors.
2. Check for interpolator errors.
3. Replace SDI board.

133512, Command toggle error.

Description

A command toggle was sent to the

SDI board while the acknowledge signal was high.

Recommended actions

1. Assure that the command toggle signal is low before toggling a new command.

133550, Joint speed error

Description

The speed of joint *arg* deviates too much relative to the ordered speed.

Recommended actions

1. Check the parameters.
2. Check for external forces.
3. Reduce programmed speed and acceleration.

133551, Move not allowed

Description

The handler is ordered to move to an illegal position: *arg= arg*

Recommended actions

1. Check position limits.
2. Check position data.
3. Check signal CPYLimOverride.

134001, Fatal queue error

Description

It was not possible to pop the job queue, due to an unexpected error.

134002, Queue overflow

Description

The last job in the queue was removed because the queue is full.

Consequences

The last job will not be executed.

Recommended actions

Wait for queue size to decrease before inserting more jobs.

134003, Invalid token

Description

Token *arg* is out of bounds.

Continues on next page

Recommended actions

Check client parameters.

134004, Invalid client**Description**

Client *arg* is out of bounds.

Recommended actions

Check client parameters.

134005, *arg* can only get master in Auto mode**Description**

It is only allowed to get master in Auto mode.

Recommended actions

Switch the controller to Auto mode and execute the command again.

134006, *arg* failed to get master**Description**

arg could not get master, because master is already taken by *arg*.

134007, *arg* failed to release master**Description**

arg could not release master, because *arg* has master.

134008, Too many subscribers**Description**

The routine *arg* could not be subscribed to the *arg* event due to too many subscribers.

134009, Subscriber file error**Description**

The system failed to create the file *arg*.

134010, Subscriber reference error**Description**

arg did not contain the procedure *arg*.

134011, Subscriber unknown error**Description**

Unknown error during init. of subscribers.

134017, Buffer full**Description**

Buffer1: *arg*

Buffer2: *arg*

134018, Log semaphore timeout**Description**

Log: *arg*

Message: *arg*

134019, Master required**Description**

arg must be master to execute the command (*arg*).

134020, File not found**Description**

arg could not be found.

Recommended actions

Make sure that the file exists.

134021, Syntax Error**Description**

The file "*arg*" contains syntax errors or reference errors.

Consequences

The file was not loaded.

Recommended actions

Check error and rapid logs for the cause and fix the file.

134022, Duplicate attempt to load program**Description**

Duplicate attempt to load program index: *arg*.

Recommended actions

Wait for the current directly loaded program to finish executing.

134023, Duplicate attempt to load program**Description**

Duplicate attempt to load module name: *arg*.

Recommended actions

Wait for the current directly loaded program to finish executing.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

134025, Material Change Suspended

Description

Material change was suspended because of an error or stop.

Recommended actions

Fix the problem, reset error and restart.

Consequences

Material change decision may not be reliable.

Recommended actions

Procedures subscribed to the decide event should be checked for delays.

134026, Material Change Cancelled

Description

Material change was cancelled.

134035, Invalid material index

Description

Material index *arg* is not mapped to any system.

Consequences

Material change cannot be performed.

Recommended actions

Correctly assign the material index in the index files.

134027, Illegal Material Change Event

Description

Start of material change was issued while material change was already running.

134036, Material Change Error

Description

Timeout while waiting for selector to be set.

Consequences

Material change may not complete successfully.

Recommended actions

Check if selector signal is set up correctly.

134028, Illegal Material Change Event

Description

Proceed of material change was issued unexpectedly.

134029, Material Change Resumed

Description

Material change has resumed, after being in suspended state.

134039, Toggle lowered before command was finished

Description

The command toggle was lowered before the command was finished.

Consequences

The external controls system will not receive command result.

Probable causes

External controls system not compliant to protocol

134030, Material Change Skipped

Description

Material supply is turned off.

Consequences

Material change will be skipped for this job.

134040, Previous command not finished

Description

A command (*arg*) was sent before the previous (*arg*) was done.

Probable causes

External controls system not compliant to protocol

134032, Protocol Error

Description

A material change command was sent to the robot before the previous was done.

134033, Enable Material Supply Error

Description

Could not enable the material supply.

134041, Missing Signal Definition

Description

The signal *arg* could not be found.

134034, Material Change Time Out

Description

Material change decision timed out. Could be due to a material change cancel.

Continues on next page

134042, Volume not recorded

Description

Total consumed volume for the job is outside accepted tolerance. Volume: *arg*

Consequences

Accuvol table will not be updated.

134050, Applicator Timeout

Description

A timeout occurred while waiting for the applicator to get ready.

Recommended actions

Check other process messages for additional information.

134051, External Start when no program

Description

An External Start command (*arg*) was received when no program was loaded

Probable causes

External controls system not compliant to protocol

134052, Overpush

Description

The system has pushed to much material

Consequences

The current paint job might be contaminated

Recommended actions

Disable paint push and then check push parameters

134053, Applicator configuration mismatch

Description

There is a mismatch between the number of applicator enable signals and the number of brush signals.

Consequences

Robotware paint will not work properly

Recommended actions

Check the process configuration

134054, Command failed in e-stop state

Description

Command *arg* not allowed when the controller is in e-stop state.

Recommended actions

Remove emergency stop conditions and reset emergency stop state.

134055, Configuration error

Description

Could not add *arg.xml* into the configuration settings. There are too many configuration files.

Consequences

The option "arg" will be set to zero.

Recommended actions

Merge the configuration into another file, or increase the buffer size.

134056, Configuration error

Description

Could not find the file: *arg.xml*

Consequences

The option "arg" will be set to zero.

Recommended actions

Make sure the file exists.

134057, Configuration error

Description

Could not parse the file: *arg.xml*

Consequences

The option "arg" will be set to zero.

Recommended actions

Fix the markup in the XML file.

134058, Configuration error

Description

Did not find the option in the file: *arg.xml*

Consequences

The option "arg" will be set to zero.

Recommended actions

Add the option into the XML file.

134059, XML-parser error

Description

First dimension passed to XML-parser was to big.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

Recommended actions

Contact customer service.

134060, XML-parser error

Description

Third dimension passed to XML-parser was not big enough.

Recommended actions

Contact customer service.

134061, XML-parser overflow

Description

There were too many options in the file: *arg*

Consequences

Only *arg* options were parsed.

Recommended actions

Remove some options or increase the buffer size.

134062, XML-parser error

Description

Could not open the file: *arg* for reading.

Recommended actions

Make sure the file exists, and is accessible.

134063, XML-parser error

Description

Did not find a specified set of symbols.

Recommended actions

Fix the markup in the XML file.

134064, CSV-parser error

Description

Row out of range in the file: *arg*

Consequences

The rows out of range in the file will be skipped.

Recommended actions

Remove the offending rows, or increase the buffer size.

134065, CSV-parser error

Description

Encountered a row number that was not a positive integer in the file: *arg*

Consequences

The row/line in the file will be skipped.

Recommended actions

Change the row number to a positive integer.

134066, CSV-parser error

Description

There were too many columns on a row in the file: *arg*

Consequences

The remaining columns on the row/line in the file will be skipped.

Recommended actions

Reduce the amount of columns, or increase the buffer size.

134067, CSV-parser error

Description

Could not open the file: *arg* for reading.

Recommended actions

Make sure the file exists, and is accessible.

134068, Configuration error

Description

A semaphore timeout occurred when parsing the file: *arg.xml*

Consequences

The option "arg" will be set to zero.

Recommended actions

P-Start the controller to force a re-read of all configuration files.

134100, CBS servo not enabled.

Description

CBS servo was not enabled when deciding to do material change.

Consequences

The material change or maintenance operation will be skipped.

Recommended actions

Enable the CBS servo.

134101, CBS restarted while performing operations.

Description

CBS was restarted in state: *arg*

Consequences

The CBS is in an unreliable state.

Continues on next page

Recommended actions

The integrity of the system must be restored manually by moving cartridges back to their home stations.

134102, Unrecoverable CBS error.**Description**

An unrecoverable error has occurred.

Consequences

The CBS is in an unreliable state.

Recommended actions

The integrity of the system must be restored manually by moving cartridges back to their home stations.

134103, No solution for material index.**Description**

No cartridge and IFS combination found for selected material index.

Consequences

The material change will be skipped.

Recommended actions

Reconfigure the system by adding the material index.

134104, No station for material index.**Description**

No IFS station can supply the selected material index.

134105, No cartridge for material index.**Description**

No cartridge is available for the selected station and material index.

134106, Not able to empty auxiliary station.**Description**

Not able to empty auxiliary station due to a unrecoverable CBS error.

Recommended actions

The integrity of the system must be restored manually by moving cartridges back to their home stations.

134107, Storage station is not an IFS.**Description**

The returned cartridge was not stored in an IFS.

Consequences

The post processing of the cartridge will be skipped.

134108, Possible CBS collision.**Description**

Robot execution has been stopped in order to avoid a collision with the CBS handler.arg

Recommended actions

Manually move CBS handler away from robot and resume execution.

134110, Safe Move to address failed.**Description**

Not allowed to move to address: arg, with gripper: arg

Recommended actions

Reconfigure gripper access.

134111, Safe Move to address failed.**Description**

CBS servo is not enabled.

Recommended actions

Enable the CBS servo.

134112, Safe Move to address failed.**Description**

Arm could not be moved up.

134113, Safe Move to address failed.**Description**

CBS servo could not be controlled.

134114, Move to address failed.**Description**

Invalid angle configured for address: arg

134115, Move to address failed.**Description**

Invalid distance configured for address: arg

134116, Move to address failed.**Description**

Timeout while waiting for servo controller to complete previous command.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

Recommended actions

Check that servo controller and communication interface is ok.

134117, Move to address failed.

Description

Timeout while waiting for acknowledge from servo controller.

Recommended actions

Check that servo controller and communication interface is ok.

134118, Servo on failed.

Description

Timeout while waiting for servo controller feedback.

Recommended actions

Check that servo controller and communication interface is ok.

134119, Servo off failed.

Description

Timeout while waiting for servo controller feedback.

Recommended actions

Check that servo controller and communication interface is ok.

134120, Calibrate servo failed.

Description

Timeout while waiting for servo controller to complete previous command.

Recommended actions

Check that servo controller and communication interface is ok.

134121, Calibrate servo failed.

Description

Timeout while waiting for acknowledge from servo controller.

Recommended actions

Check that servo controller and communication interface is ok.

134122, Set servo acceleration failed.

Description

Specified setting is out of range.

134123, Set servo acceleration failed.

Description

Timeout while waiting for servo controller to complete previous command.

Recommended actions

Check that servo controller and communication interface is ok.

134124, Set servo acceleration failed.

Description

Timeout while waiting for acknowledge from servo controller.

Recommended actions

Check that servo controller and communication interface is ok.

134125, Set servo speed failed.

Description

Specified setting is out of range.

134126, Move arm up failed.

Description

CBS servo is not enabled.

Recommended actions

Enable the CBS servo.

134127, Move arm up failed.

Description

Timeout while waiting for servo feedback.

Recommended actions

Check that servo is enabled and calibrated correctly.

134128, Move arm down failed.

Description

CBS servo is not enabled.

Recommended actions

Enable the CBS servo.

134129, Move arm down failed.

Description

Timeout while waiting for servo feedback.

Recommended actions

Check that servo is enabled and calibrated correctly.

134130, Move arm up failed.

Description

Timeout while waiting for sensor feedback.

Recommended actions

Check that arm sensors are working.

Continues on next page

134131, Move arm down failed.**Description**

Timeout while waiting for sensor feedback.

Recommended actions

Check that arm sensors are working.

134132, Gripper open failed.**Description**

Opening gripper attempted while arm was not down.

Recommended actions

Make sure handler arm is down.

134133, Gripper open failed.**Description**

Unknown gripper specified: *arg*

134134, Gripper open failed.**Description**

Timeout while waiting for sensor feedback.

Recommended actions

Check that gripper sensors are working.

134135, Gripper close failed.**Description**

Unknown gripper specified: *arg*

134136, Gripper close failed.**Description**

Timeout while waiting for sensor feedback.

Recommended actions

Check that gripper sensors are working.

134137, Unexpected cartridge presence.**Description**

An unknown cartridge is blocking gripper: *arg*

Recommended actions

Remove the offending cartridge and verify the integrity of the system.

134138, No cartridge present.**Description**

Expected a cartridge in gripper: *arg*

Recommended actions

Locate missing cartridge and verify the integrity of the system.

134139, Gripper sense failed.**Description**

Unknown gripper specified: *arg*

134140, Gripper access check failed.**Description**

Unknown gripper specified: *arg*

134145, Vacuum check error.**Description**

Timeout while waiting for sensor feedback.

134150, Unlock station failed.**Description**

Unable to unlock station at address: *arg*

Recommended actions

Verify that locking signal for station is ok.

134151, Lock station failed.**Description**

Unable to lock station at address: *arg*

Recommended actions

Verify that locking signal for station is ok.

134152, Set primary IFS selector failed.**Description**

Unable to set primary IFS selector to address: *arg*

Recommended actions

Verify that primary IFS selector signal is ok.

134153, Set primary CC selector failed.**Description**

Unable to set primary CC selector to address: *arg*

Recommended actions

Verify that primary CC selector signal is ok.

134154, Set secondary IFS selector failed.**Description**

Unable to set secondary IFS selector to address: *arg*

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

Recommended actions

Verify that secondary IFS selector signal is ok.

134155, Set secondary CC selector failed.

Description

Unable to set secondary CC selector to address: *arg*

Recommended actions

Verify that secondary CC selector signal is ok.

134160, Arm sensors bypassed.

Description

Arm sensors bypassed.

Consequences

Speed of CBS handler may be reduced.

134161, Right gripper sensor bypassed.

Description

Right gripper sensor bypassed.

Consequences

Some integrity failures will not be detected, and cannot avoid damage to the system.

134162, Left gripper sensor bypassed.

Description

Left gripper sensor bypassed.

Consequences

Some integrity failures will not be detected, and cannot avoid damage to the system.

134163, Right cartridge sensor bypassed.

Description

Right cartridge sensor bypassed.

Consequences

Some integrity failures will not be detected, and cannot avoid damage to the system.

134164, Left cartridge sensor bypassed.

Description

Left cartridge sensor bypassed.

Consequences

Some integrity failures will not be detected, and cannot avoid damage to the system.

134165, Release sensor bypassed.

Description

Release sensor bypassed.

134166, Vacuum sensor bypassed.

Description

Vacuum sensor bypassed.

Consequences

Failure to produce vacuum will not be detected, and may cause cartridges to drop from applicator.

134167, Servo position feedback bypassed.

Description

Servo position feedback bypassed.

Consequences

Speed optimization features will not be used.

134168, Servo command acknowledge bypassed.

Description

Servo command acknowledge bypassed.

Consequences

Servo may not behave correctly.

134170, CBS configuration error.

Description

Delivery address is not specified.

Consequences

System will not work correctly.

134171, CBS configuration error.

Description

Home address is not specified.

Consequences

System will not work correctly.

134172, CBS configuration error.

Description

Home gripper is not specified.

Consequences

System will not work correctly.

Continues on next page

134173, CBS configuration error.**Description**

Default cartridge volume is not specified.

Consequences

System will not work correctly.

134174, CBS configuration error.**Description**

No cartridges has been defined.

Consequences

System will not work correctly.

134175, CBS configuration error.**Description**

No materials has been defined.

Consequences

System will not work correctly.

134176, CBS configuration error.**Description**

No addresses has been defined.

Consequences

System will not work correctly.

134177, CBS configuration error.**Description**

No home station specified for cartridge: *arg*

Consequences

Cartridge will be skipped.

134178, CBS configuration error.**Description**

Too many IFS stations have been defined.

Consequences

Some IFS stations will be skipped.

134180, Could not set baseplate data.**Description**

Address: *arg* Content: *arg*

134181, Could not get baseplate data.**Description**

Content: *arg*

134182, Could not get baseplate data.**Description**

Type: *arg*

134183, Could not get baseplate data.**Description**

Access: *arg*

134184, Could not get baseplate data.**Description**

Angle: *arg*

134185, Could not get baseplate data.**Description**

Distance: *arg*

134186, Could not get cartridge access data.**Description**

Cartridge: *arg* Address: *arg*

134187, Could not set cartridge data.**Description**

Cartridge: *arg* Data: *arg*

134188, Could not get cartridge data.**Description**

Cartridge: *arg* Data: *arg*

134189, Could not set IFS data.**Description**

Index: *arg* Data: *arg*

134190, Could not get IFS data.**Description**

Index: *arg* Data: *arg*

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

134191, IFS index from address resolution failed.

Description

Address: *arg*

134192, IFS address from index resolution failed.

Description

Index: *arg*

134193, Could not get station valve or material data.

Description

Station: *arg* Material: *arg*

134194, Could not get home address for cartridge.

Description

Cartridge: *arg*

134195, No auxilliray station found.

Description

No auxiliary station found after trying different options.

Recommended actions

Cancel the handler and reconfigure the system.

134196, No storage station found.

Description

No storage station found after trying different options.

Recommended actions

Cancel the handler and reconfigure the system.

134200, Move cartridge failed.

Description

Move cartridge failed in state: *arg*

Recommended actions

Fix the problem causing the failure and resume the operation.

134201, Cancel move cartridge failed.

Description

Cancel move cartridge failed in state: *arg*

Recommended actions

Fix the problem causing the failure and resume the operation.

134202, Exchange cartridge step one failed.

Description

Exchange cartridge failed in state: *arg*

Recommended actions

Fix the problem causing the failure and resume the operation.

134203, Exchange cartridge step two failed.

Description

Exchange cartridge failed in state: *arg*

Recommended actions

Fix the problem causing the failure and resume the operation.

134204, Exchange cartridge step three failed.

Description

Exchange cartridge failed in state: *arg*

Recommended actions

Fix the problem causing the failure and resume the operation.

134210, Move cartridge error.

Description

There is already a cartridge at the 'To' address: *arg*

Consequences

Cannot continue with the operation.

134211, Move cartridge error.

Description

There is already a cartridge at the 'From' address: *arg*

Consequences

Cannot continue with the operation.

134212, Move cartridge error.

Description

An impossible to reach 'From' address was specified: *arg*

Consequences

Cannot continue the operation.

Recommended actions

Reconfigure baseplate access.

134213, Move cartridge error.

Description

An impossible to reach 'To' address was specified: *arg*

Continues on next page

Consequences

Cannot continue the operation.

Recommended actions

Reconfigure baseplate access.

134214, Move cartridge error.**Description**

The cartridge at 'From' address is not allowed at the 'To' address. Cartridge: *arg* Address: *arg*

Consequences

Cannot continue the operation.

Recommended actions

Reconfigure cartridge access.

134215, Exchange cartridge error.**Description**

There is no cartridge to get at delivery address.

Consequences

Cannot continue with the operation.

134216, Exchange cartridge error.**Description**

Cannot find suitable station to put returned cartridge in.

Consequences

Cannot continue with the operation.

134217, Exchange cartridge error.**Description**

There is no cartridge at the 'From' address: *arg*

Consequences

Cannot continue with the operation.

134218, Exchange cartridge error.**Description**

An impossible to reach 'From' address was specified: *arg*

Consequences

Cannot continue the operation.

Recommended actions

Reconfigure baseplate access.

134219, Unexpected cartridge in applicator.**Description**

An unexpected cartridge was found while probing applicator.

Recommended actions

Remove the offending cartridge and resume the operation.

134220, Unexpected cartridge presence.**Description**

An unexpected cartridge was found during start check.

Recommended actions

Remove the offending cartridge and verify the integrity of the system.

134221, No cartridge found while probing.**Description**

Expected to find a cartridge in the station to process.

Consequences

Process operations on cartridge have been prevented.

Recommended actions

Manually verify the integrity of the system.

134222, Cartridge must be delivered with right gripper.**Description**

In order to prevent collisions, the cartridge must be moved out to the delivery area with the right gripper.

Recommended actions

Make sure that all stations are accessible with both grippers.

134223, Calibrate servo failed.**Description**

Cannot calibrate while a servo is enabled.

Recommended actions

Disable the CBS servos.

134224, Update servo position failed.**Description**

Cannot update servo position while a servo is enabled.

Recommended actions

Disable the CBS servos and run a manual re-calibration.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

134225, Vertical axis position is invalid.

Description

The internal and external resolvers report different positions.

Recommended actions

Run a re-calibration.

134226, Angle axis position is invalid.

Description

The internal and external resolvers report different positions.

Recommended actions

Run a re-calibration.

134230, Integrity check error.

Description

An unexpected cartridge was found during integrity check at address: *arg*

Recommended actions

Manually verify the integrity of the system.

134231, Integrity check error.

Description

Did not find expected cartridge during integrity check at address: *arg*

Recommended actions

Manually verify the integrity of the system.

134240, Maintenance operation error.

Description

Unknown maintenance operation specified: *arg*

134241, Maintenance operation error.

Description

Unknown cartridge process operation specified: *arg*

134242, Maintenance operation error.

Description

Not possible to move a cartridge from or to a hole.

134243, Maintenance operation error.

Description

Unknown cartridge specified: *arg*

134244, Maintenance operation error.

Description

No IFS solution for the cartridge specified: *arg*

134245, Maintenance operation failure.

Description

Integrity check failed.

Recommended actions

Fix the problem causing the failure and resume the operation.

134246, Maintenance operation failure.

Description

Unable to move all cartridges home.

Recommended actions

Operation must be completed manually.

134250, Cartridge PotLife timeout.

Description

System detected potlife timeout in cartridge: *arg*

Consequences

The cartridge will be cleaned.

134251, Cartridge reached continuous use limit.

Description

System detected a maximum continuous use of cartridge: *arg*

Consequences

The cartridge will be cleaned.

134260, Halt exchange timeout.

Description

A timeout occurred while waiting for another task to resume the exchange process.

134270, DCL pressure release timeout.

Description

A timeout occurred while waiting pressure to drop in DCU.

Current pressure: *arg*

134300, VB Stemachine Suspended

Description

VB Stemachine was suspended because of an error.

Continues on next page

Recommended actions

Fix the problem, reset error and resume.

134301, VB Statemachine Resumed**Description**

VB Statemachine has resumed, after being in suspended state.

134305, VB statemachine aborted.**Description**

VB statemachine was aborted.

134310, DSF cartridge 1 sensor bypassed.**Description**

DSF cartridge 1 sensor bypassed.

Consequences

System will run slower, and integrity failures will not be detected.

134311, DSF cartridge 2 sensor bypassed.**Description**

DSF cartridge 2 sensor bypassed.

Consequences

System will run slower, and integrity failures will not be detected.

134312, Cartridge 1 home sensor bypassed.**Description**

Cartridge 1 home sensor bypassed.

Consequences

System will run slower, and integrity failures will not be detected.

134313, Cartridge 2 home sensor bypassed.**Description**

Cartridge 2 home sensor bypassed.

Consequences

System will run slower, and integrity failures will not be detected.

134314, Cartridge 1 DSD sensor bypassed.**Description**

Cartridge 1 DSD sensor bypassed.

Consequences

System will run slower, and integrity failures will not be detected.

134315, Cartridge 2 DSD sensor bypassed.**Description**

Cartridge 2 DSD sensor bypassed.

Consequences

System will run slower, and integrity failures will not be detected.

134316, Cartridge 1 DSF sensor bypassed.**Description**

Cartridge 1 DSF sensor bypassed.

Consequences

System will run slower, and integrity failures will not be detected.

134317, Cartridge 2 DSF sensor bypassed.**Description**

Cartridge 2 DSF sensor bypassed.

Consequences

System will run slower, and integrity failures will not be detected.

134320, Move DSF failed.**Description**

Unknown position specified: *arg*

134321, Move DSF failed.**Description**

Timeout while waiting for sensor feedback.

Recommended actions

Check that DSF sensors are working.

134325, Move Cartridge failed.**Description**

Unknown cartridge position specified: *arg*

134326, Move Cartridge failed.**Description**

Unknown cartridge specified: *arg*

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

134327, Move Cartridge failed.

Description

Timeout while waiting for sensor feedback. Cartridge: *arg*

Position: *arg*

Recommended actions

Check that cartridge sensors are working.

134329, Get cartridge position failed.

Description

Unknown cartridge specified: *arg*

134330, Restore cartridge positions failed.

Description

Failed to move cartridges to previously known positions.

Recommended actions

Move cartridges manually back to suitable locations.

134340, VB configuration error.

Description

Maximum cartridge volume not specified.

Consequences

System will not behave correctly. Cartridges may not be filled.

Recommended actions

Add the missing value into the VB configuration file.

134341, VB configuration error.

Description

Swap cartridge volume not specified.

Consequences

System will not behave optimally. Cartridges will run completely empty before swapping occurs.

Recommended actions

Add the missing value into the VB configuration file.

134342, VB configuration error.

Description

Enough cartridge volume not specified.

Consequences

System will not behave optimally. Filling will always occur, even if cartridges have enough volume.

Recommended actions

Add the missing value into the VB configuration file.

134343, VB configuration error.

Description

Split volume not specified.

Consequences

System will not behave optimally. Last cartridge may delay material change.

Recommended actions

Add the missing value into the VB configuration file.

134350, Move cartridge to home failed.

Description

Operation failed in state: *arg*

134351, Move cartridge to DSD failed.

Description

Operation failed in state: *arg*

134352, Move cartridge to DSF failed.

Description

Operation failed in state: *arg*

134353, Move DSF to cartridge failed.

Description

Operation failed in state: *arg*

134360, VB maintenance operation error.

Description

Unknown maintenance operation specified: *arg*

134400, Out of paint.

Description

Cartridge *arg* ran out of paint before cartridge *arg* was ready.

Consequences

The robot has been stopped to prevent additional fluid consumption.

Recommended actions

Start the robot once the new cartridge is ready. Reduce the fluid brush and speed and check other process messages.

134401, Applicator fill problem.

Description

Paint line and applicator was not filled properly. *arg* > *arg*.

Continues on next page

Recommended actions

Refill applicator or paint line and check other process messages.

134402, Cartridge fill problem.**Description**

Cartridge *arg* was not filled properly. *arg > arg*.

Recommended actions

Refill cartridge and check other process messages.

134405, Illegal VB state.**Description**

A statemachine entered an unknown state.

134406, DCL not ready.**Description**

The status of DCL system *arg* is not in ready state.

Recommended actions

Run the maintenance operation to refill DCL for this system.

134410, Unknown sensor specified.**Description**

Unknown sensor ID: *arg*.

Recommended actions

Check that paint command paramters are correct.

134411, Unknown cartridge specified.**Description**

Unknown cartridge ID: *arg*.

Recommended actions

Check that paint command paramters are correct.

134412, Unknown position specified.**Description**

Unknown position ID: *arg*.

Recommended actions

Check that paint command paramters are correct.

134420, Bypass cartridge error.**Description**

Not allowed to run system with two or more sensors disabled for cartridge *arg*.

Recommended actions

Enable more sensors.

134421, Bypass DSF error.**Description**

Not allowed to run system with both DSF sensors disabled.

Recommended actions

Enable one of the sensors.

134425, Unknown DSF position.**Description**

The DSF is not in a known position.

Recommended actions

Put it in a known position or verify its sensors.

134426, Unknown cartridge position.**Description**

Cartridge *arg* is not in a known position.

Recommended actions

Put it in a known position or verify its sensors.

134430, DSF move error.**Description**

Could not move DSF to cartridge *arg*.

134431, Cartridge move error.**Description**

Could not move cartridge *arg* to home position.

134432, Cartridge move error.**Description**

Could not move cartridge *arg* to DSF position.

134433, Cartridge move error.**Description**

Could not move cartridge *arg* to DSD position.

134501, Parking unit move error.**Description**

Unable to move parking unit to applicator *arg*. Timeout while waiting for semaphore.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

134502, Parking unit move error.

Description

Unable to move parking unit to applicator *arg*. Manipulator is still in material change position.

134503, Parking unit move error.

Description

Unable to move parking unit to applicator *arg*. Cleaning unit is not in lower position.

134504, Parking unit move error.

Description

Unable to move parking unit to applicator *arg*. CBS arm is not in upper position.

134505, Parking unit move error.

Description

Unable to move parking unit to applicator *arg*. Timeout while waiting for sensor feedback.

134511, Cleaning unit move error.

Description

Unable to move cleaning unit up. Timeout while waiting for semaphore.

134512, Cleaning unit move error.

Description

Unable to move cleaning unit up. Parking unit is not in a valid position.

134513, Cleaning unit move error.

Description

Unable to move cleaning unit up. Timeout while waiting for sensor feedback.

134514, Cleaning unit move error.

Description

Unable to move cleaning unit down. Timeout while waiting for semaphore.

134515, Cleaning unit move error.

Description

Unable to move cleaning unit down. Timeout while waiting for sensor feedback.

134521, Applicator chucking failed.

Description

Timeout while waiting for semaphore.

134522, Applicator chucking failed.

Description

No air supply to chuck valve.

134523, Applicator chucking failed.

Description

Manipulator is not in material change position.

134524, Applicator chucking failed.

Description

Timeout while waiting for sensor feedback.

134526, Applicator un-chucking failed.

Description

Timeout while waiting for semaphore.

134527, Applicator un-chucking failed.

Description

No air supply to chuck valve.

134528, Applicator un-chucking failed.

Description

Manipulator is not in material change position.

134531, Parking unit in unknown position.

Description

Check sensors or air supply.

134532, Cleaning unit in unknown position.

Description

Check sensors or air supply.

Continues on next page

134533, Applicator integrity error.**Description**

No applicator mounted, but *arg* is triggered.

Recommended actions

Check motor configuration.

134534, Applicator integrity corrected.**Description**

No applicator is mounted.

134612, RCC movement error.**Description**

Unable to enable motor.

Recommended actions

Check motor configuration.

134535, Applicator integrity corrected.**Description**

Applicator *arg* is mounted.

134613, RCC movement error.**Description**

Unable to disable motor.

Recommended actions

Check motor configuration.

134536, Applicator integrity error.**Description**

Expected a mounted applicator.

134620, RCC cleaning error.**Description**

Not able to run cleaning due to missing cartridge.

Recommended actions

Make sure a cartridge is standing in IFS at address: *arg*.

134601, RCC docking error.**Description**

Timeout while waiting for sensor: *arg*.

Recommended actions

Check dock and undock sensors.

134650, RCC calibration error.**Description**

Unable to reach calibration position.

Recommended actions

Check calibration sensor and motor configuration.

134602, RCC undocking error.**Description**

Timeout while waiting for sensor: *arg*.

Recommended actions

Check dock and undock sensors.

134651, RCC calibration error.**Description**

Internal error in calibration routine.

Recommended actions

Check process configuration.

134610, RCC movement error.**Description**

Unable to rotate color changer while it is docked.

Recommended actions

Undock color changer.

135001, Material change suspended.**Description**

Material change was suspended due to an internal or external error.

Recommended actions

Fix the problem and recover material change.

134611, RCC movement error.**Description**

Timeout while waiting for motor feedback.

Continues on next page

5 Trouble shooting by event log

5.12 13 xxxx

Continued

135002, Material change cancelled.

Description

Material change was ordered to cancel.

Recommended actions

Fix the problem in the file.

135003, Material change resumed.

Description

Material change was recovered after being in suspended state.

135010, Material change initialization error.

Description

Unable to subscribe to interface signals.

Recommended actions

Check that there is valid configuration loaded for the interface signals in IPS.

135031, Material change system index error.

Description

Material index *arg* is missing an action specifier.

Recommended actions

Fix the problem in the file: *arg*

135041, Material change cavity index error.

Description

Material index *arg* on cavity '*arg*' does not have a cleaning sequence.

Recommended actions

Fix the problem in the file: *arg*

135042, Material change cavity index error.

Description

Material index *arg* on cavity '*arg*' does not have a filling sequence.

Recommended actions

Fix the problem in the file: *arg*

135051, Material change sequence error.

Description

Unable to open sequence file: *arg*

Recommended actions

Check that the file exists.

135052, Material change sequence error.

Description

The file '*arg*' contains invalid data on line: *arg*

Recommended actions

Fix the problem in the file.

135053, Material change sequence error.

Description

Failed to execute python file '*arg*'. Got Python exception: *arg*

Recommended actions

Fix the problem in the file.

135013, Material change initialization error.

Description

The file '*arg*' contains an invalid system type: *arg*

Recommended actions

Fix the problem in the file.

135021, Material change index file error.

Description

Unable to open index file: *arg*

Recommended actions

Check that the file exists.

135022, Material change index file error.

Description

The file '*arg*' contains an invalid index: *arg*

Continues on next page

135054, Material change sequence error.**Description**

The file 'arg' contains an invalid signal name: *arg*

Recommended actions

Fix the problem in the file.

135055, Material change sequence error.**Description**

Failed to execute python call 'arg' from 'arg'. Got Python exception: *arg*

Recommended actions

Fix the problem in the python source file.

135061, Material change signal error.**Description**

Communication against IPS is down.

135062, Material change signal error.**Description**

Communication against IPS has been re-established.

135063, Material change signal error.**Description**

Failed to read signal number *arg* on device: *arg*

Recommended actions

Check IPS configuration or signals used in material change sequences.

135064, Material change signal error.**Description**

Failed to write signal number *arg* on device: *arg*

Recommended actions

Check IPS configuration or signals used in material change sequences.

135071, Material change alarm monitor error.**Description**

Invalid signal name in configuration file: *arg*

Recommended actions

Check IPS or alarm configuration.

135072, Material change alarm monitor error.**Description**

Failed to subscribe to signal number *arg* on device: *arg*

Recommended actions

Check IPS or alarm configuration.

135073, Material change alarm monitor error.**Description**

Failed to subscribe to device: *arg*

Recommended actions

Check IPS or alarm configuration.

135100, Material change user error.**Description**

arg

5 Trouble shooting by event log

5.13 15 xxxx

5.13 15 xxxx

150330, RAPID error in module

Description

Task:*arg*

Module (line/column): *arg*

There is an error with symbol: *arg*

5.14 17 xxxx

170001, Connected Services Agent started

Description

Agent for Connected Services has been started.

Consequences

No communication to the ABB Connected Services center shall be possible.

170002, Connected Services registered

Description

Robot controller has successfully registered at ABB Connected Services Center.

Probable causes

Validation of the server certificate was unsuccessful.

Recommended actions

1. Check if this controller date and time is accurate.
2. Contact ABB support for assistance.

170003, Connected to ABB Connected Services Center

Description

Robot controller is successfully connected to ABB Connected Services Center.

170032, Connected Services no server connection

Description

This controller is unable to reach ABB Connected Services center.

Consequences

Connected Services functionality is unavailable for this robot system.

Probable causes

Details : arg

Recommended actions

1. Check above details for possible causes.
2. Check HTTP connectivity between this robot system and the Internet.

170005, Connected Services Agent reset mode

Description

Connected Services Agent has been started in reset mode.

170033, Data Collector Script start failed

Description

An error has occurred when Connected Services Agent tried to initialize Data Collector Script.

Probable causes

Data Collector Script is incompatible with Connected Services Agent or it has a fault.

Recommended actions

Contact ABB support for assistance.

170006, Connected Services reset by user

Description

User has requested a reset of Connected Services state on the controller. The reset shall be applied after a restart. If this controller has previously been registered in the ABB Connected Services Center, the registration process will need to be repeated.

170034, Connected Services registration error

Description

Connected Services Agent has failed to register at ABB Connected Services Center.

Probable causes

Possible connectivity problem with the server.

170007, Data Collector Script loaded

Description

Data Collector version arg has been loaded.

170030, Connected Services authentication error

Description

Connection to the ABB Connected Services Center server has failed.

Continues on next page

5 Trouble shooting by event log

5.14 17 xxxx

Continued

Recommended actions

1. Try to repeat the registration process.
2. Contact ABB support for assistance.

170035, Connected Services start failed

Description

Connected Services Agent has failed to start.

Probable causes

Configuration error or internal error.

Recommended actions

Contact ABB support for assistance.

170036, Connected Services internal registration error

Description

Connected Services Agent has failed to register at ABB Connected Services Center.

Probable causes

Failed to create CSR request.

Recommended actions

Contact ABB support for assistance.

170037, Connected Services credentials renewal error

Description

Connected Services Agent has failed to automatically renew login credentials at ABB Connected Services Center.

Probable causes

Possible connectivity problem with the server.

Recommended actions

1. Verify connectivity.
2. Repeat manually the registration process.
3. Contact ABB support for assistance.

170038, Connected Services credentials renewed

Description

Connected Services Agent has automatically renewed login credentials at ABB Connected Services Center.

6 Circuit diagrams

6.1 Circuit diagrams

Overview

The circuit diagrams are not included in this manual, but delivered as separate documents on the documentation DVD. See the article numbers in the tables below.

Controllers

Product	Article numbers for circuit diagrams
<i>Circuit diagram - IRC5</i>	<i>3HAC024480-011</i>
<i>Circuit diagram - IRC5 Compact</i>	<i>3HAC049406-003</i>
<i>Circuit diagram - IRC5 Panel Mounted Controller</i>	<i>3HAC026871-020</i>
<i>Circuit diagram - Euromap</i>	<i>3HAC024120-004</i>
<i>Circuit diagram - Spot welding cabinet</i>	<i>3HAC057185-001</i>

Robots

Product	Article numbers for circuit diagrams
<i>Circuit diagram - IRB 120</i>	<i>3HAC031408-003</i>
<i>Circuit diagram - IRB 140 type C</i>	<i>3HAC6816-3</i>
<i>Circuit diagram - IRB 260</i>	<i>3HAC025611-001</i>
<i>Circuit diagram - IRB 360</i>	<i>3HAC028647-009</i>
<i>Circuit diagram - IRB 460</i>	<i>3HAC036446-005</i>
<i>Circuit diagram - IRB 660</i>	<i>3HAC025691-001</i>
<i>Circuit diagram - IRB 760</i>	<i>3HAC025691-001</i>
<i>Circuit diagram - IRB 1200</i>	<i>3HAC046307-003</i>
<i>Circuit diagram - IRB 1410</i>	<i>3HAC2800-3</i>
<i>Circuit diagram - IRB 1600/1660</i>	<i>3HAC021351-003</i>
<i>Circuit diagram - IRB 1520</i>	<i>3HAC039498-007</i>
<i>Circuit diagram - IRB 2400</i>	<i>3HAC6670-3</i>
<i>Circuit diagram - IRB 2600</i>	<i>3HAC029570-007</i>
<i>Circuit diagram - IRB 4400/4450S</i>	<i>3HAC9821-1</i>
<i>Circuit diagram - IRB 4600</i>	<i>3HAC029038-003</i>
<i>Circuit diagram - IRB 6400RF</i>	<i>3HAC8935-1</i>
<i>Circuit diagram - IRB 6600 type A</i>	<i>3HAC13347-1 3HAC025744-001</i>
<i>Circuit diagram - IRB 6600 type B</i>	<i>3HAC13347-1 3HAC025744-001</i>
<i>Circuit diagram - IRB 6620</i>	<i>3HAC025090-001</i>

Continues on next page

6 Circuit diagrams

6.1 Circuit diagrams

Continued

Product	Article numbers for circuit diagrams
Circuit diagram - IRB 6620 / IRB 6620LX	3HAC025090-001
Circuit diagram - IRB 6640	3HAC025744-001
Circuit diagram - IRB 6650S	3HAC13347-1 3HAC025744-001
Circuit diagram - IRB 6660	3HAC025744-001 3HAC029940-001
Circuit diagram - IRB 6700	3HAC043446-005
Circuit diagram - IRB 7600	3HAC13347-1 3HAC025744-001
Circuit diagram - IRB 14000	3HAC050778-003
Circuit diagram - IRB 910SC	3HAC056159-002

Track motions

Product	Article numbers for circuit diagrams
Circuit diagram - IRBT IRB 6600/7600 i	3HEA803013-001
Circuit diagram - IRBT IRB 4400/4400F i	3HEA803014-001
Circuit diagram - IRBT IRB 4600 i	3HAC033657-001
Circuit diagram - IRBT 4004/6004/7004 ii	3HAC043574-001

i Not valid for motor Type A.

ii Valid for motor Type A.

Positioners

Product	Article numbers for circuit diagrams
Circuit diagram - Service diagram IRBP C	3HAC035753-001
Circuit diagram - Service diagram IRBP L	3HAC035753-002
Circuit diagram - Service diagram IRBP K/R	3HAC035753-003
Circuit diagram - Service diagram IRBP A	3HAC035753-004
Circuit diagram - Service diagram IRBP B/D	3HAC035753-005
Circuit diagram - Service diagram IRBP IF C	3HAC035754-001
Circuit diagram - Service diagram IRBP IF L	3HAC035754-002
Circuit diagram - Service diagram IRBP IF K/R	3HAC035754-003
Circuit diagram - Service diagram IRBP IF A	3HAC035754-004
Circuit diagram - Service diagram IRBP IF B/D	3HAC035754-005
Circuit diagram - Service diagram Safety Options A/L/S	3HEA800730-001
Circuit diagram - Service diagram Safety Interface A/L/S	3HEA802301-001

Continues on next page

DressPack/SpotPack

Product	Article numbers for circuit diagrams
<i>Circuit diagram - DressPack 6650S/7600</i>	<i>3HAC022327-002</i>
<i>Circuit diagram - DressPack 8700</i>	<i>3HAC053524-002</i>
<i>Circuit diagram - DressPack 6650S/7600</i>	<i>3HAC026209-001</i>
<i>Circuit diagram - DressPack 6620</i>	<i>3HAC026136-001</i>
<i>Circuit diagram - DressPack IRB 6640, IRB 6650S, IRB 7600</i>	<i>3HAC026209-001</i>
<i>Circuit diagram - DressPack 6660</i>	<i>3HAC029940-001</i>
<i>Circuit diagram - DressPack 6700</i>	<i>3HAC044246-002</i>
<i>Circuit diagram - SpotPack SWC IRC5 M2004</i>	<i>3HAC026208-001</i>
<i>Circuit diagram - SpotPack SWC IRC5 Design 2014 PROFINET</i>	<i>3HAC044736-001</i>

Use the correct circuit diagram (IRB 6600, IRB 6650 and IRB 6650S)

The cable harness of the robot is available in two different designs. Either the cabling is divided between the upper and lower arm, or not. Accordingly there are also two different versions of the circuit diagram. Decide which circuit diagram is valid for the robot by checking the article number for the cable harness.

This page is intentionally left blank

Index

A

Additional Drive Unit, 75
Axis computer, LEDs, 77

B

Brake, release, 60
Brake contactor, K44, 60
Brake power supply, faulty, 59–60

C

change of state, 44
Circuit breaker, F6, 46
Circuit breaker F5, 48
Collapsing manipulator, 56
computer unit, 70
Computer unit, LEDs, 71
Contactor, K41, 46
Contactor interface board, 88
 DSQC 611, 88
Contactor interface board, LEDs, 88
customer I/O power supply, 90
 LED, 91
Customer Power Supply Module, 91
 DCOK indicator, 91

D

damaged bearings, 55, 57
Damaged cable, 50, 52
Damaged connector, 50
damaged parallel bar, 55
danger levels, 11

E

Earth fault protection, 48
Earth fault protection, tripped, 41
Erratic event messages, 52, 62
Error report, 38
ESD
 damage elimination, 26
 sensitive equipment, 26
 wrist strap connection point, 26

F

faulty brake, 59
faulty calibration, 55
faulty connections, 52
faulty TCP definition, 55
Filing an error report, 38
FlexPendant
 restarting, 67
FlexPendant, not responding, 50

H

holding brakes, 23
hot gearbox oil, 56–57

I

Incompatibility, hardware/software, 54
Interference, 62

L

labels
 robot, 13
leaking seals, 56

LED Board, LEDs, 66

LEDs, indication, 46

Live voltage, Drive Module, 24

M

Main Drive Unit, 75
 Additional Drive Unit, 75
Main transformer, 46
Manual, how to use, 31

N

noise, 55, 57

O

oil leaks, 56
overfilled gearbox, 56

P

Panel Board, LEDs, 73
panel board unit, 72
 DSQC 643, 72
path accuracy, 55
power distribution board
 LED, 84
 test equipment, 84
 troubleshooting flowchart, 87
Power supply, faulty, 50
product standards, 20
program loops, 44

R

reset, 67
restart
 FlexPendant, 67
robot
 labels, 13
 symbols, 13

S

safety
 ESD, 26
 signals, 11
 signals in manual, 11
 symbols, 11
 symbols on robot, 13
 wrist strap, 26
safety risk
 hot parts, 29
safety signals
 in manual, 11
safety standards, 20
signals
 safety, 11
standards, 20
 ANSI, 21
 CAN, 21
 EN, 20
 EN IEC, 20
 EN ISO, 20
strained cables, 52
symbols
 safety, 11
system power supply
 test equipment, 79
 troubleshooting, flowchart, 82
system power supply, LEDs, 79

Contact us

ABB AB, Robotics
Robotics and Motion
S-721 68 VÄSTERÅS, Sweden
Telephone +46 (0) 21 344 400

ABB AS, Robotics
Robotics and Motion
Nordlysvegen 7, N-4340 BRYNE, Norway
Box 265, N-4349 BRYNE, Norway
Telephone: +47 22 87 2000

ABB Engineering (Shanghai) Ltd.
Robotics and Motion
No. 4528 Kangxin Highway
PuDong District
SHANGHAI 201319, China
Telephone: +86 21 6105 6666

ABB Inc.
Robotics and Motion
1250 Brown Road
Auburn Hills, MI 48326
USA
Telephone: +1 248 391 9000

www.abb.com/robotics