



CCTV REPORT



Mapletree Cottage
Pebmarsh
Halstead
CO9 2NA
GHG

06/03/2026

[illegible]

[illegible]

[illegible]

[illegible]


[illegible]

Company Registration Number:
09475415
Vat Registration: 210226962

DRAINAGE CODES

B	Broken pipe at... (or from... to...) o'clock	JN	Junction at...o'clock, diameter...mm
BR	Branch Major	JX	Junction defective at.. o'clock, diameter.. mm
CC	Crack circumferential from... to... o'clock	LC	Lining of sewer changes/starts/finishes at this
CL	Crack longitudinal @... o'clock	LD	Line of sewer deviates down
CM	Cracks multiple from... to... o'clock	LL	Line of sewer deviates left
CN	Connection at... o'clock, diameter... mm	LN	Line defect at (or from.. to..) o'clock
CNI	Connection at... o'clock, diameter... mm, intrusion... mm	LR	Line of sewer deviates right
CU	Camera under water	LU	Line of sewer deviates up
CX	Connection defective at... o'clock	MB	Missing bricks at.. (or from.. to..) o'clock
CXI	Connection defective at... o'clock, diameter... mm, intrusion... mm	MC	Material of sewer changes at this point
D	Deformed sewer... %	MH	Manhole/node
DB	Displaced bricks at (or from.. to..) o'clock	MM	Mortar missing medium at.. (or from.. to..) o'clock
DC	Dimension of sewer changes at this point	MS	Mortar missing surface at.. (or from.. to..) o'clock
DE	Debris (non silt/grease)... % cross-sectional loss	MT	Mortar missing total at.. (or from.. to..) o'clock
DEG	Debris grease... % cross-sectional area loss	OB	Obstruction... % height/diameter loss
DES	Debris silt... % cross-sectional area loss	OJL	Open joint large
DI	Dropped invert, gap... mm	OJM	Open joint medium
EHJ	Encrustation heavy from.. to.. o'clock % cross-sectional area loss (at joint)	PC	Length of pipe forming sewer changes at this new length...mm
ELJ	Encrustation light from.. to.. o'clock%	RFJ	Roots fine (at joint)
EMJ	Encrustation medium from.. to.. o'clock %, cross-sectional area loss (at joint)	RMJ	Roots mass... % cross-sectional area loss (at joint)
ESH	Scale heavy... % cross-sectional area loss from... to... o'clock	RTJ	Roots tap (at joint)
ESL	Scale light from... to... o'clock	SA	Survey abandoned
ESM	Scale medium... % cross-sectional area loss from... to... o'clock	SC	Shape of sewer changes at this point
FC	Fracture circumferential from... to... o'clock	SSL	Surface damage, spalling large at (or from.. to.. o'clock
FL	Fracture longitudinal at... o'clock	SSM	Surface damage, spalling medium at (or from.. to.. o'clock
FM	Fractures multiple from... to... o'clock	SSS	Surface damage, spalling slight at (or from.. to.. o'clock
GO	General observation at this point	SWL	Surface damage, wear large at... (or from.. to.. o'clock
GP	General photograph number... taken at this point	SWM	Surface damage, wear medium at... (or from.. to.. o'clock
H	Hole in sewer at... o'clock	SWS	Surface damage, wear slight at.. (or from.. to.. o'clock
IDJ	Infiltration dripper at (or from... to...) o'clock (at joint)	V	Vermin (rats and mice)
IGJ	Infiltration gusher at (or from... to...) o'clock (at joint)	WL	Water level... % height/diameter
IRJ	Infiltration runner at (or from... to...) o'clock (at joint)	X	Sewer collapsed... % cross-sectional area loss
ISJ	Infiltration seep at (or from... to...) o'clock (at joint)	FH	End of survey
JDM	Joint displaced medium		
JDL	Joint displaced large		


DRAINAGE LAYOUT PLAN

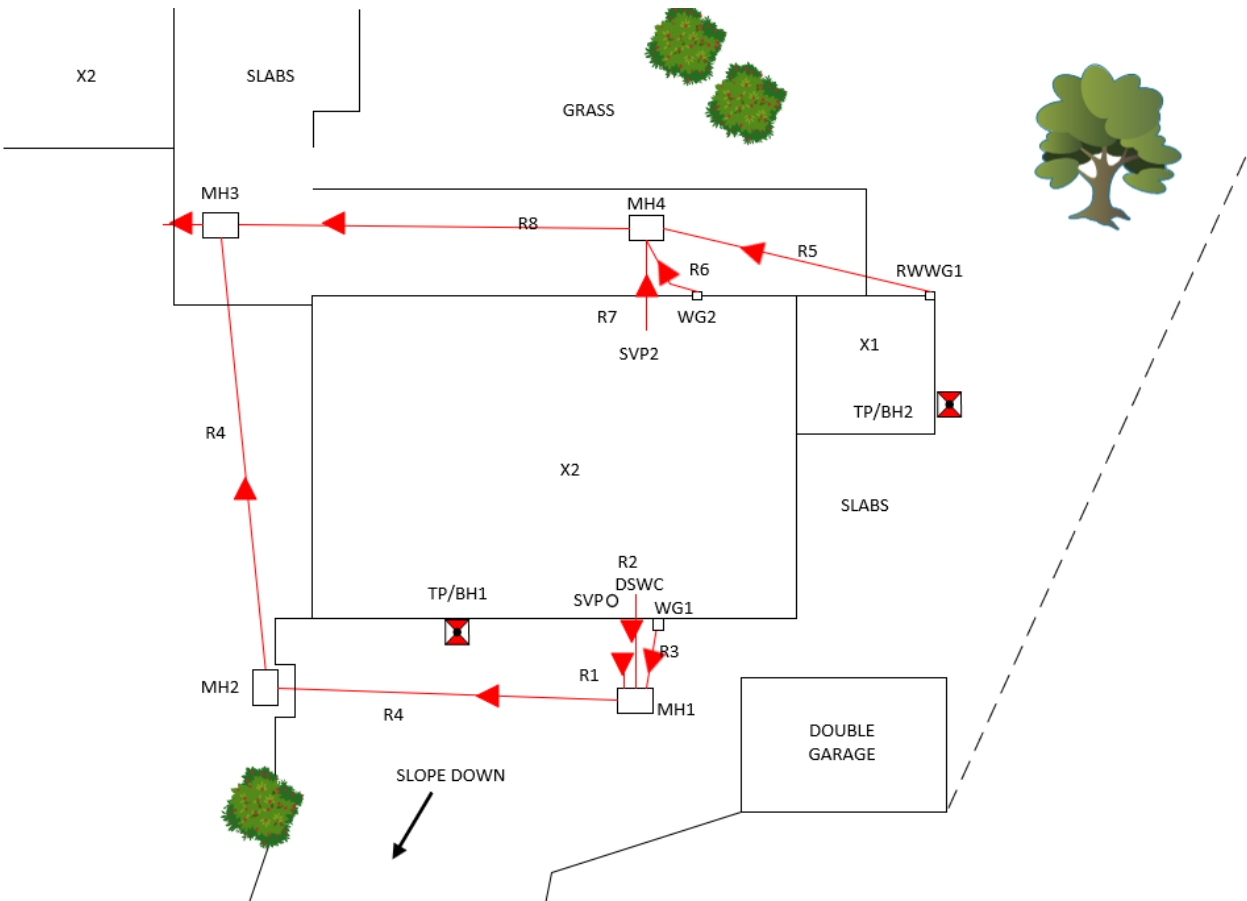

KEY

-  FOUL WATER
-  NOT SURVEYED FOUL
-  SURFACE WATER
-  NOT SURVEYED SURFACE
-  DIRECTION OF FLOW

Defect Grade Descriptions

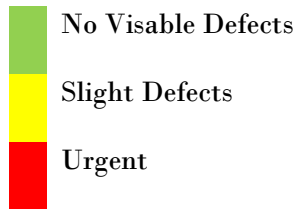

1: Occurrences without damage. For example, laterals, joints, etc.

THE RUN IS SERVICABLE WITH NO VISUAL DEFECTS

2: Slight constructional deficiencies: Eg. cracks, minor drainage obstructions such as calcite build ups, protruding laterals, minor damages to pipe walls, individual root penetrations, corroded pipe walls, slightly deformed pitch.

3: Urgent constructional damage. Eg: Large joint displacements, open joints, collapsed pipe, deeply rooted pipe, severely deformed pipework other drainage obstructions

Water Mains Test	Sheet:	1 of 1	Site:	Mapletree Cottage
	Job No:			
	Date:	06/03/26	Client:	GHG

Test	Start Time	Gauge Pressure (bar)		
		0 mins	5 mins	10 mins
1	13:20	2	2	2

If pressure drops before 5 minute test complete, advise time:

Test	Start Time	Gauge Pressure (bar)		
		0 mins	5 mins	10 mins

If pressure drops before 5 minute test complete, advise time:

Test	Start Time	Gauge Pressure (bar)		
		0 mins	5 mins	10 mins

If pressure drops before 5 minute test complete, advise time:

Listening Stick Water Mains Test

Period listening test carried out with all available water services within property switched off:

Any indication of leak detected by way of sound with stick placed on stop cock:

When taps are used, toilets flushed or any other water demand appliance used is there a noticeable flushing noise heard from the listening stick:

Photos Taken of Property

Front	
Side	
Rear	
Internal Floor Coverings and Location of Stopcock	

Reason for No External Photos:

Reason for No Internal Photos:

Information Notes

A site plan with external and internal stopcocks is required - also ground surfaces and assumed route of water main.

Water main stop cocks that appear to be seized or in an un-serviceable condition, are not to be forced to complete test, - a listening stick is to be used.

Remarks:

No stop cock couldf be located. Press tested carried out. PASS

Logged:		Checked:		Approved:	
---------	--	----------	--	-----------	--



RECOMMENDATION SHEET

Site: Mapletree Cottage, Pebmarsh, Halstead, C09 2NA.

Date of Survey: 06/03/2026

Dear client,


We attended the above property to carry out a survey to all accessible drains. We can now report the following.

Run 1	Heads upstream to SVP/1. The run is 100% blocked with root. The camera could not be pushed pasted the obstruction. We would advise the run is root cut to allow for a liner to be inverted upstream to the rest bend.	£2,167.58
Run 2	Heads upstream to DSWC/1. There are displacements noted within the run. We would advise the run is lined upstream to the rest bend.	£208.12
Run 3	Heads upstream to WG/1. There is a slight crack within the run. We would advise a patch is inverted.	£407.33
Run 4	Heads downstream to MH/2. The run then heads downstream off boundary and joins MH/3 which is then back on boundary. Roots have began to penetrate the run. We would advise the run is HPWJ and a liner inverted downstream to MH/2. Then x2 patches inverted from MH/3 upstream to cover defects noted at 8m and 14m (see coding sheet).	£1,543.08
Run 5	Heads upstream to RWWG/1. There is a displaced joint noted at 4.80m. We would advise a patch is inverted over the defect.	£407.33

Run 6	Heads upstream to WG/2. The gully is blocked and could not be cleared. The survey showed mass root at 0.80m. Due to the line up the gully will need to be removed to allow for the cutter to be deployed to remove the root ingress which will also clear the gully. On completion a super flexi liner to be inverted downstream to the gully. (Pump required to clear gully).	£2,089.23
Run 7	Heads upstream to SVP/2. The run appears serviceable with no visible defects.	£0
Run 8	Heads downstream off boundary. There is root ingress within the run. We would advise the run is HPWJ and a patch inverted upstream from MH/3 and downstream from MH/3.	£1,221.99
RWG/1	Located on front left off boundary. The gully is off boundary within the neighbour's flower bed. Both the homeowner and neighbour spoke to. The gully is cracked and blocked. Neighbour believed they found a pipe when laying a new drive way. We would advise the LWA are contacted.	£0
RWG/2	Located on rear left is 100% blocked. We would advise the gully and 1m of pipe work is excavated. Our camera could then be deployed and our findings reported.	£681.77
	Supply a two-man sewer rehabilitation team and all tooling.	£464.20
	Post works CCTV	£170.00
	Total + VAT	£9,360.63


DEFECTS & SITE IMAGES

Run 1

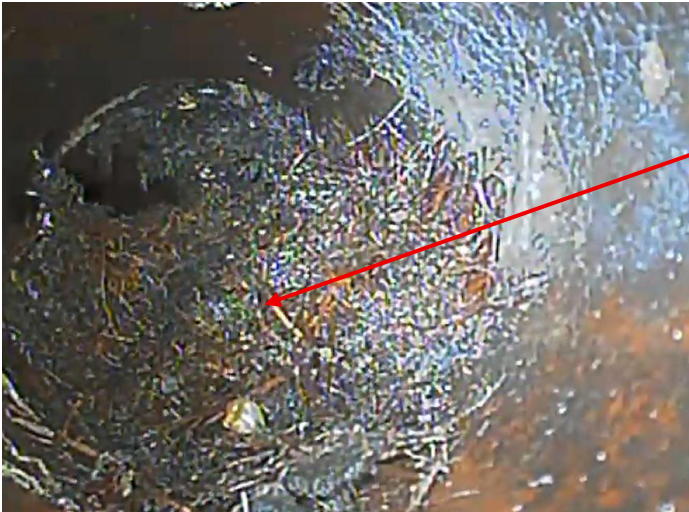

Root Mass

Run 2

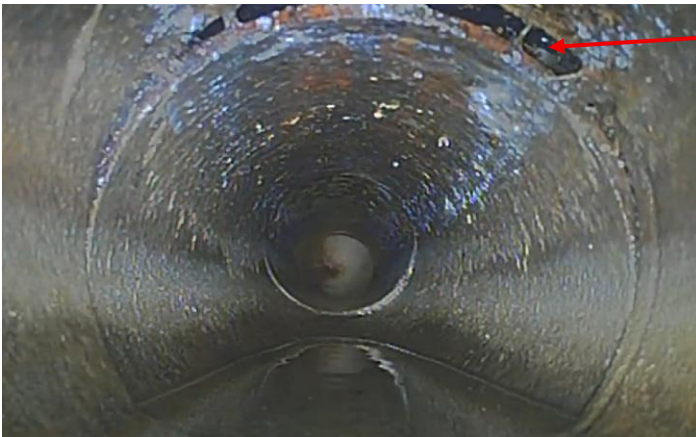

Root Mass



JDM

Run 3



Crack

Run 4



Root Mass



JDM




JDM




Root Mass

Run 5

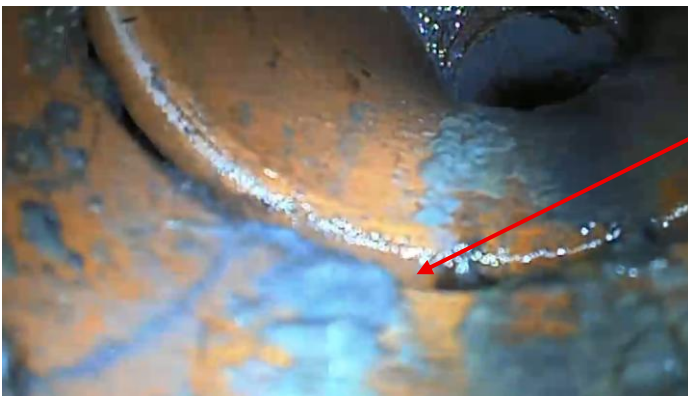

JDM

Run 6

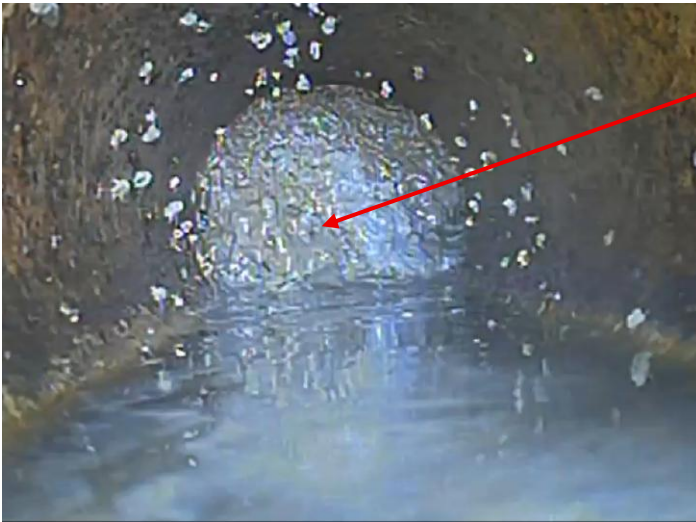

Root Mass

Run 7

No defects noted.


Run 8



Root



Root

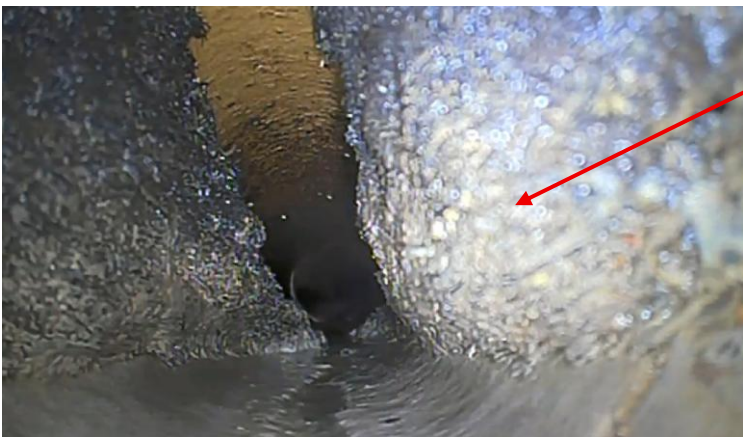

Root Mass

RWG/1



Cracked Gully



This document has been prepared by D.W Solutions with all reasonable skill, care and diligence within the terms of the contract with the client and within the limitations of the resources devoted to it by agreement with the Client. This document is confidential to the Client and D.W Solutions and accepts no responsibility whatsoever to third parties to whom this document, or any part thereof, is made known. Any such party relies upon the document at their own risk. This document shall not be used for engineering or contractual purposes unless signed above by the author and the approver for and on behalf of D.W Solutions and unless the document status is 'Final'.

Unless specifically assigned or transferred within the terms of the agreement, the consultant asserts and retains all Copyright, and other intellectual Property Rights in and over the Report and its contents.

Please note the above Quotation is based on the following: -

All prices quoted are exclusive of VAT.

Areas of work are easily accessible and clear of obstructions.

Payment Terms

Please be advised that when undertaking works for private/domestic client's full payment is required either before, or on the day of works.

For all new commercial clients/companies a 0% payment will be required before works commence.

Please note this quotation is valid for 30 days from the date of this letter.

D.W Solutions Ltd

We/I accept the quotation and terms as set out in Quotation agree your payment terms.

The invoice should be addressed as follows:-

Address (where
invoice to be sent): _____

Tele No: _____

Signed _____ **Print Name:** _____