

GPM Property Management

MOVE-OUT INSPECTION REPORT — PROPINSPECAI PROTOTYPE (LIVING ROOM)

Property	1554 Brest, Lincoln Park, MI
Job	121939
Date	2026-09-08
Inspector	Chuck Larson
Generated by	PropInspecAI (prototype) — automated extraction from inspection video, pending human review

Outside Vendor Work Required

(pulled to the top so a reviewer can hand this straight to scheduling — see full item detail in Living Room section below)

Vendor Trade	Work Required	Priority
Painting/Drywall	Repair wall mounting holes/patches and repaint; repair ceiling crack and repaint	Before next occupancy
Flooring	Clean/refinish stained hardwood; repair aluminum patch at wall vent, caulk base molding	Before next occupancy

Living Room

Overall Condition: Fair — Empty and generally serviceable, but requires wall, ceiling, flooring, window, and door work before next occupancy.

Room Dimensions: 14 ft × 11½ ft *(source: narrated by inspector, confirmed via tape measure visible in video)*

Item	Condition	Assigned To	Recommended Action	Trade Category	Priority	Tenant Damage
Walls	Damaged	Outside Vendor	Repair holes/patches, then paint	Painting/Drywall	Before next occupancy	☐
Ceiling	Damaged	Outside Vendor	Repair crack, paint ceiling	Painting/Drywall	Before next occupancy	☐
Front picture-window blind	Damaged/Missing	GPM Staff	Install new blind; remove old mounting hardware; repair affected area	Doors/Windows (hardware)	Before next occupancy	☐
Side-window mini-blind	Damaged	GPM Staff	Replace mini-blind; remove old hardware; repair mounting area	Doors/Windows (hardware)	Before next occupancy	☐
Windows / glass	Good	—	None	—	No action	—
Hardwood flooring	Damaged	Outside Vendor	Clean / refinish affected area (method to be confirmed on-site)	Flooring	Before next occupancy	☐
Flooring at wall vent	Damaged	Outside Vendor	Repair patch, caulk base molding	Flooring	Before next occupancy	☐
Electrical outlets / cover plates	Fair	GPM Staff	Secure outlets; clean devices and cover plates	Electrical (minor — no rewiring)	Routine turnover	☐
Closet door	Damaged	GPM Staff	Adjust strike / door alignment	Carpentry	Routine turnover	☐

Assigned To applies GPM's current vendor-assignment SOP ([rules/vendor-assignment-sop.md](#)): painting and flooring repair/replacement are always outside-vendor scope regardless of severity; minor electrical (no rewiring/breaker box) and hardware adjustments default to GPM staff. Tenant Damage is

left unchecked for reviewer sign-off — not pre-judged by the AI pass.

Turn summary: 3 items to Outside Vendor (walls/paint, ceiling/paint, flooring), 4 items to GPM Staff (blinds x2, outlets, closet door), 1 item no action needed.

GPM STAFF — MATERIALS & LABOR (REPLACEMENT/INSTALL ITEMS ONLY)


Pricing pending GPM's price book — cost lines below are placeholders for the reviewer to fill in.

Item	Work	Materials	Labor
Front picture-window blind	Install new blind	_____	_____
Side-window mini-blind	Replace mini-blind	_____	_____

Only GPM-staff items that are a replacement or install get a cost line — adjustments, cleaning, and securing (e.g. closet door latch, outlet cleaning) don't.

Photo Documentation

Stills below are frames pulled directly from the inspection video — no photos were taken separately, matching PropInspecAI's core idea of extracting everything from one video pass. Frame timing is approximate (sampled automatically), not the inspector's exact narration moment.

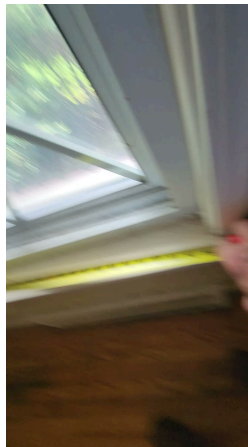


Room dimensions — tape measure reading




Ceiling — crack




Walls — condition

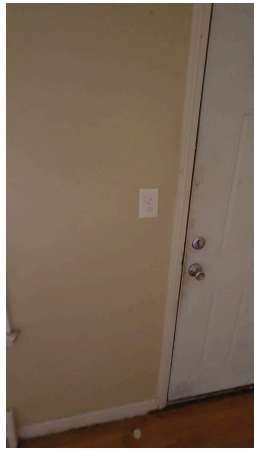

Window blind — damaged

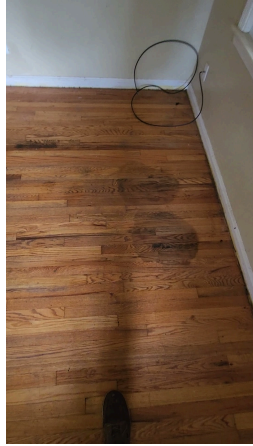


Hardwood flooring — staining

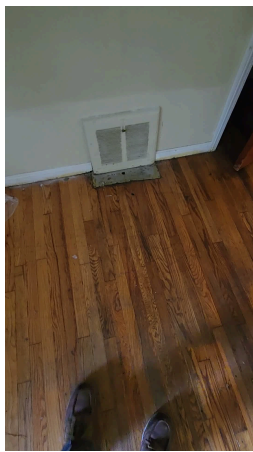

Electrical outlet



Front entry door

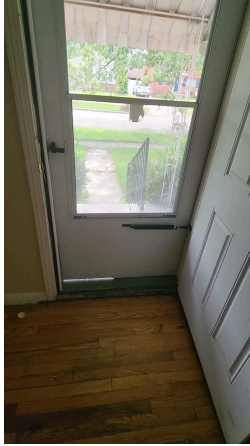

Storm door

INSPECTOR NARRATION — TIMESTAMPED REFERENCE

- **0:01–0:40** — Wall condition and mounting holes noted
- **0:20–0:43** — Ceiling crack identified
- **0:43–0:56** — Electrical outlet condition noted
- **1:05–1:14** — Front picture-window blind condition
- **Clip 2, 0:02–0:20** — Front picture-window opening measured: 75 inches
- **Clip 2, 0:20–0:29** — Side-window mini-blind / opening measured: 27 inches
- **Clip 2, 0:30–0:44** — Hardwood floor staining noted
- **Clip 2, 0:40–0:47** — Flooring repair needed at vent
- **Clip 2, 0:45–0:50** — Closet door latch issue noted

ABOUT THIS REPORT

This report was generated automatically from raw inspection video (no manual data entry) using a PropInspecAI prototype pass. It was cross-checked against the official Zinspector report for this same property and matched nearly item-for-item, including an exact room-dimension match (14' × 11.5"). This is a **prototype output for internal review** — not yet connected to GPM's quoting process, and pending a human review step before any report goes to an owner or tenant.