



INSPECTION REPORT
1135 Brook Path Trail
Denver NC 28037

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 5/21/2025
🕒 09:00:00 AM

Michael A Parr
3692

INVOICE

Above Parr Home Inspections

Inspected By: Alex Parr 3692

Inspection Date: 5/21/2025
Report ID: 052125AP1

Customer Info:	Inspection Property:
Jonathan Reynolds Customer's Real Estate Professional: Jake Reed NextHome at the Lake	1135 Brook Path Trail Denver NC 28037

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	595.00	1	595.00
WDI/Termite	75.00	1	75.00
Inspection Discount	-45.00	1	-45.00

Tax \$0.00
Total Price \$625.00

Payment Method: Credit Card
Payment Status: Paid
Note:

GENERAL INFO

Property Address

1135 Brook Path Trail
Denver NC 28037

Date of Inspection

5/21/2025

Report ID

052125AP1

Customer(s)

Jonathan Reynolds

Time of Inspection

09:00:00 AM

Real Estate Agent

Jake Reed
NextHome at the Lake

INSPECTION DETAILS

Approximate age of building:

Over 25 Years

In Attendance:

Customer and their agent

Radon Test:

No

Water Test:

No

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

Yes

Type of building:

Single Family (2 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

TABLE OF CONTENTS

Cover Page1

Invoice 2

Intro Page 3

Table of Contents 4

General Summary 5

1 Property Overview19

2 Roofing 21

3 Exterior 23

4 Structural Components 27

5 Plumbing System 30

6 Electrical System 33

7 Heating / Central Air Conditioning 38

8 Interiors 42

9 Insulation and Ventilation 44

10 Built-In Kitchen Appliances47

GENERAL SUMMARY

Above Parr Home Inspections

Customer

Jonathan Reynolds

Address

1135 Brook Path Trail
Denver NC 28037

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

1. PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

REPAIR OR REPLACE

1. Discoloration and some type of mold (Microbial) growth is present in the structure at several areas including but not limited to the crawl space and interior spaces. Evidence suggests that this condition is from a past or present elevated moisture conditions. We did not inspect, test or determine if this type of substance is or is not a health hazard. Further investigation is needed.

We recommend you contact a properly licensed expert for testing, investigation and or correction as deemed appropriate.



1.0 Item 1 (Picture)

1.1 INSPECTION LIMITATIONS

📋 REPAIR OR REPLACE

(1) The home inspection was limited, one or more areas were not accessible due to the following conditions:

1. Furniture, storage and or personal items in the garage and throughout the house. As a result the areas were not inspected. Hidden damage may be present. Further investigation and repairs are needed.

We recommend having all personal items removed and these areas inspected prior to closing.

(2)

1. The framing and foundation of the deck were not inspected as the deck was too low to the ground for inspector to enter below. Hidden damage may be present.

I recommend contacting a licensed contractor for further evaluation.



1.1 Item 1 (Picture)

2. ROOFING

2.0 ROOF COVERINGS

📋 REPAIR OR REPLACE

1. The roof shingle at the front of home has an exposed nail. This may allow water intrusion to occur. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



2.0 Item 1 (Picture)



2.0 Item 2 (Picture)

2.3 ROOF DRAINAGE SYSTEMS

REPAIR OR REPLACE

1. The gutter leaks at seam (s) at the front (right of main entry). Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 1 (Picture)



2.3 Item 2 (Picture)


3. EXTERIOR

3.2 WINDOWS


REPAIR OR REPLACE

1. The window drain is taped shut at the right side of the home. Deterioration may occur if not repaired. Repairs are needed.

I recommend a qualified contractor inspect and repair as needed.

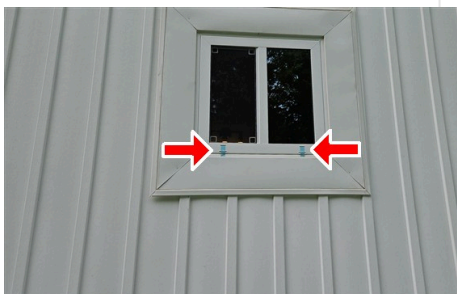

3.2 Item 1 (Picture)

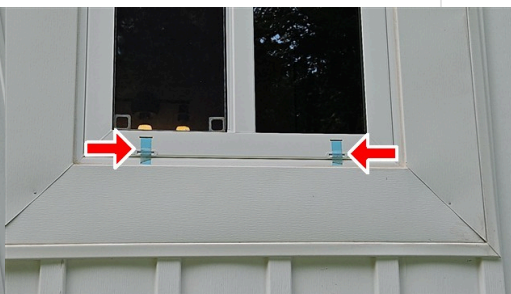

3.2 Item 2 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS


☐ REPAIR OR REPLACE

1. The floor joist hangers for the deck at the rear of home are fastened improperly. A more proper repair is needed to ensure stability or an injury might occur. Further investigation and repairs are needed. I recommend having the entire deck evaluated for structural stability.

A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

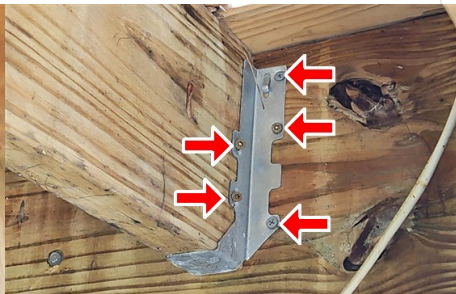

3.4 Item 2 (Picture)



3.4 Item 3 (Picture)



3.4 Item 4 (Picture)



3.4 Item 5 (Picture)



3.4 Item 6 (Picture)



3.4 Item 7 (Picture)



3.4 Item 8 (Picture)



3.4 Item 9 (Picture)

4. STRUCTURAL COMPONENTS


4.0 WALLS (STRUCTURAL)

☐ REPAIR OR REPLACE


1. The foundation wall in the crawlspace has cracks present. The wall(s) may need reinforcement. Further investigation and repairs are needed. A qualified licensed general contractor should inspect further and repair as needed.



4.0 Item 1 (Picture)

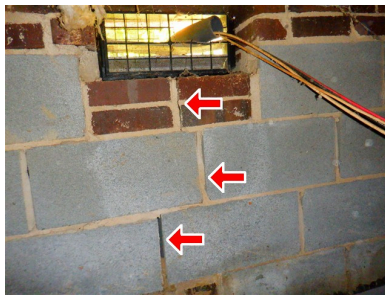

4.0 Item 2 (Picture)

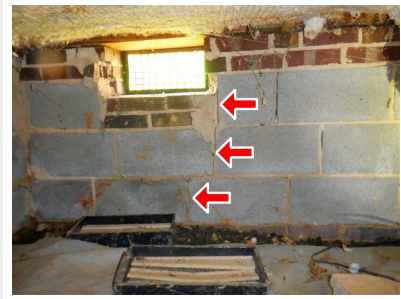

4.0 Item 3 (Picture)

4.1 COLUMNS OR PIERS

REPAIR OR REPLACE

1. Temporary wood support posts have been added in the crawlspace. All piers should be masonry. All piers should be examined for signs of settlement condition and their adequacy in accepting bearing loads. Those that are deficient should be repaired or replaced to prevent further foundation issues and movement. Not addressing these issues could result in further floor system movement and other foundation issues. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.



4.1 Item 1 (Picture)



4.1 Item 2 (Picture)



4.1 Item 3 (Picture)



4.1 Item 4 (Picture)



4.1 Item 5 (Picture)

4.5 WOOD DETERIORATION

REPAIR OR REPLACE

1. Wood debris is in contact with the crawlspace floor in numerous areas. This can attract wood destroying organisms. Removal is needed.

A qualified contractor should inspect and repair as needed.



4.5 Item 1 (Picture)



4.5 Item 2 (Picture)



4.5 Item 3 (Picture)

5. PLUMBING SYSTEM

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

☐ REPAIR OR REPLACE

1. The water heater is set over the recommended temperature. (Over 120) The risk is especially acute for infants, children, and the elderly. Water temperatures should never be set higher than 120 degrees.

This is a safety issue. Repairs are needed

A qualified contractor should inspect and repair as needed.



5.1 Item 1 (Picture)

6. ELECTRICAL SYSTEM


6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

☐ REPAIR OR REPLACE


(1)

1. Wires were observed to be cut down to fit circuit breakers in the sub panel. This often leads to wires that can overheat. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.


A qualified licensed electrical contractor should correct as needed.

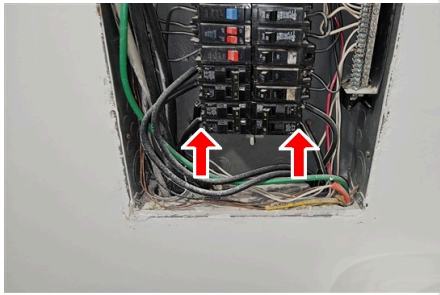

6.2 Item 1 (Picture)

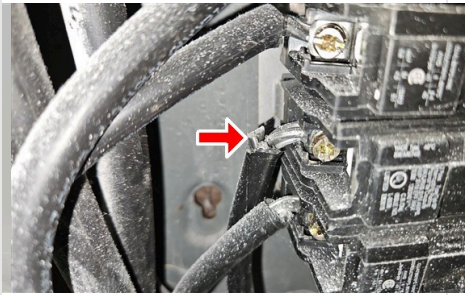

6.2 Item 2 (Picture)

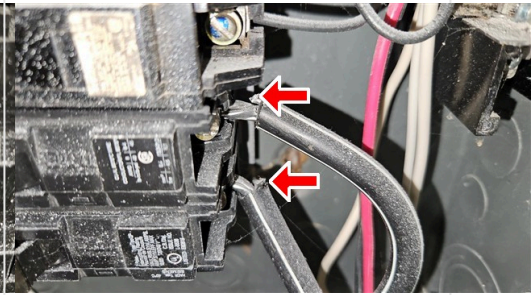


6.2 Item 3 (Picture)

(2)

1. The electrical panel cover sub panel has been secured with sheet metal screws. This is considered unsafe as sheet metal screws are not rated for electrical panel use. The use of sheet metal screws with panel cover has been known to short hot wires, as they can pierce the branch wiring protective coverings. (Safety Issue) Repairs are needed.

A qualified licensed electrical contractor should correct as needed.

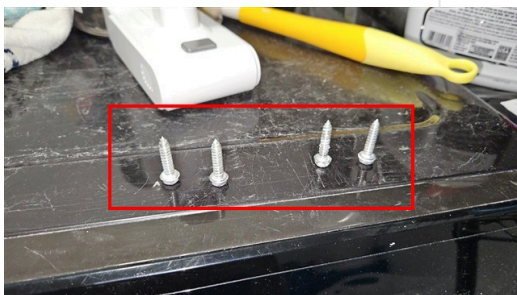

6.2 Item 4 (Picture)


(3)

1. The main panel has missing knockouts. (safety issue) Unused openings in panel equipment need to be closed. Covering these openings helps to prevent accidental shocks (think of kids), helps to prevent pests from entering. Repairs are needed.


A qualified licensed electrical contractor should correct as needed.



6.2 Item 5 (Picture)

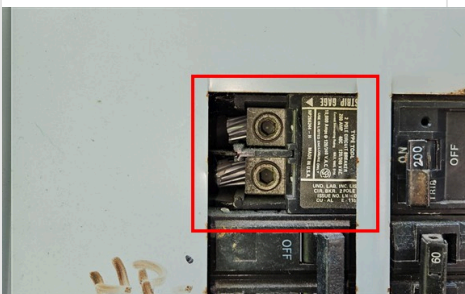

6.2 Item 6 (Picture)

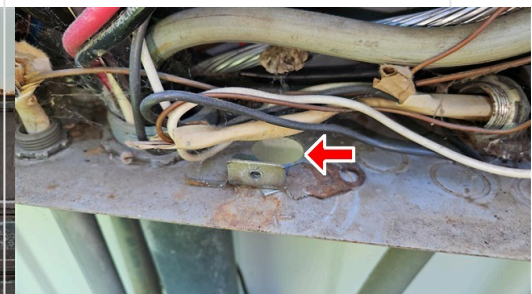

6.2 Item 7 (Picture)

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

 REPAIR OR REPLACE


(1)

1. The septic pump an extension cord as permanent wiring at the exterior. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 1 (Picture)

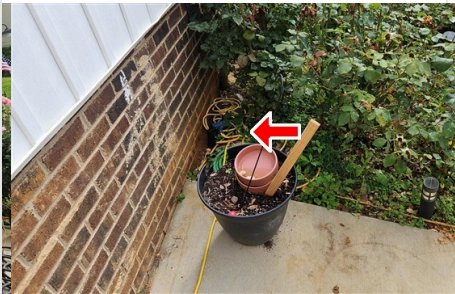

6.4 Item 2 (Picture)



6.4 Item 3 (Picture)




6.4 Item 4 (Picture)


(2)

1. The electrical conduit at the rear of the home is damaged. This may allow for water intrusion to occur. Further investigation and repairs are needed..

I recommend a qualified licensed electrical contractor correct.

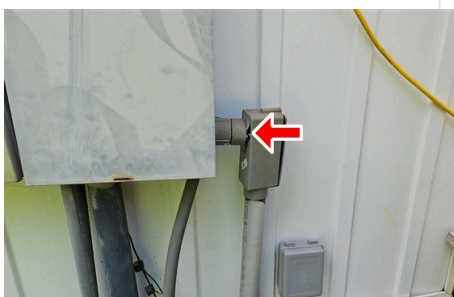

6.4 Item 5 (Picture)

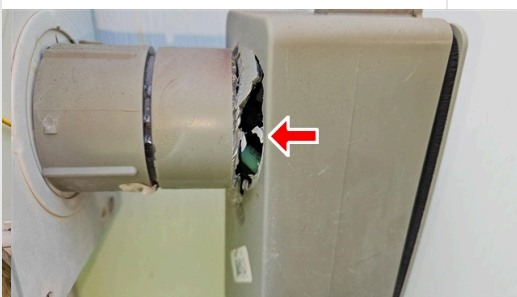

6.4 Item 6 (Picture)


(4)

1. Several open splices needs electrical splice placed inside access panel, or install inside a box with cover-plate in the crawlspace. Electrical wires laying on the ground. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 8 (Picture)

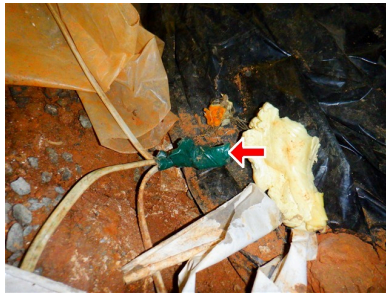

6.4 Item 9 (Picture)



6.4 Item 10 (Picture)



6.4 Item 11 (Picture)

6.7 SMOKE DETECTORS

☐ REPAIR OR REPLACE

1. The smoke detector are missing in the home. Without a working smoke detector in your home you have no first alert to a possible fire. Repairs are needed.

A qualified person should repair or replace as needed.

7. HEATING / CENTRAL AIR CONDITIONING

7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

☐ REPAIR OR REPLACE


(1)

1. The supply register in floor is weak (not intended for floor) throughout the home. This is a safety issue and should be repaired. A replacement is needed.

A qualified HVAC person should inspect further and repair or replace as needed.




7.3 Item 1 (Picture)

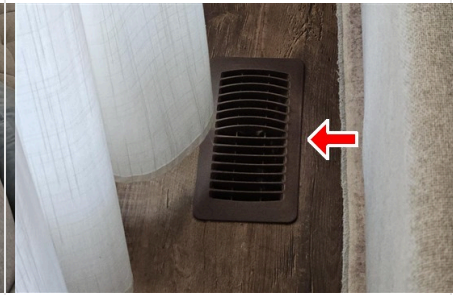

7.3 Item 2 (Picture)



7.3 Item 3 (Picture)

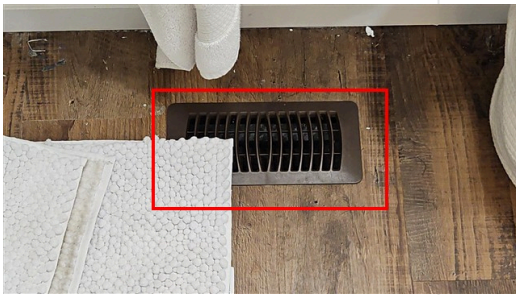

7.3 Item 4 (Picture)

(2)

1. The supply and return duct pipe are damaged and is in contact with ground and may deteriorate if not corrected in the crawlspace. Energy loss is occurring in crawlspace and immediate correction is needed. A minimum of four inches of clearance from the ground is needed to prevent deterioration to ductwork. Further investigation and repairs are needed.

I recommend having the homes entire ductwork system evaluated.

A qualified HVAC person should inspect further and repair or replace as needed.



7.3 Item 5 (Picture)



7.3 Item 6 (Picture)



7.3 Item 7 (Picture)



7.3 Item 8 (Picture)



7.3 Item 9 (Picture)

7.8 COOLING AND AIR HANDLER EQUIPMENT

☐ REPAIR OR REPLACE

(1)

1. The electrical conduit is not long enough and then at outside unit. This is a safety issue and should be repaired. Repairs are needed.

A licensed HVAC contractor should service or repair unit.



7.8 Item 1 (Picture)



7.8 Item 2 (Picture)

8. INTERIORS

8.6 WINDOWS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE

1. One window does not lock properly at the dining room. As a result you can not lock the window. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



8.6 Item 1 (Picture)



8.6 Item 2 (Picture)

9. INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

☐ REPAIR OR REPLACE

1. The vapor barrier (plastic) on the crawlspace ground is missing in areas. A vapor barrier provides added protection to the floor system from moisture or dampness that can enter from ground. Repairs are needed.

A qualified person should repair or replace as needed.



9.0 Item 1 (Picture)



9.0 Item 2 (Picture)




9.0 Item 3 (Picture)

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

☐ REPAIR OR REPLACE

1. The foundation vents are missing screens and or loose at the exterior. Rodents, reptiles or insects could enter into crawlspace. Repairs are needed.

A qualified person should repair or replace as needed.

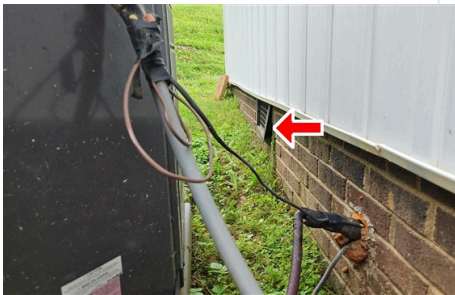

9.1 Item 1 (Picture)



9.1 Item 2 (Picture)



9.1 Item 3 (Picture)



9.1 Item 4 (Picture)



9.1 Item 5 (Picture)

9.3 INSULATION UNDER FLOOR SYSTEM

☐ REPAIR OR REPLACE

1. The insulation is missing is deteriorated in areas in the crawlspace. Heat loss can occur more on this home than one that is properly insulated. Repairs are needed.

A qualified contractor should inspect and repair as needed.



9.3 Item 1 (Picture)



9.3 Item 2 (Picture)

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

☐ REPAIR OR REPLACE

1. The dryer vent hood at the rear of home does not have the proper clearance from the grade/ground to function as intended. Dryer vent exhaust shall terminate not less than 12 inches above finish grade to prevent blockages. Current conditions should be considered a fire hazard until repaired. Repairs are needed.

A qualified person should repair or replace as needed.



9.5 Item 1 (Picture)



9.5 Item 2 (Picture)

10. BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER

☐ REPAIR OR REPLACE

(1)

1. The dishwasher door springs are damaged. The door springs need replacing if parts are available is damaged. I recommend repair as necessary.

I recommend contacting appliance repair company.




10.0 Item 1 (Picture)

10.1 RANGES/OVENS/COOKTOPS

☐ REPAIR OR REPLACE

1. The range/oven needs to be properly attached/anchored to the structure as to keep it from tipping over when the oven door is opened and/or oven racks are pulled out during use. This is a safety issue. Repairs are needed.

I recommend contacting appliance repair company.

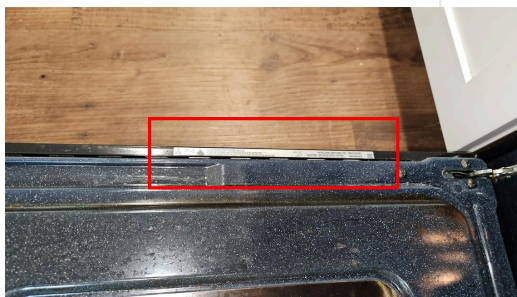

10.1 Item 1 (Picture)

10.3 FOOD WASTE DISPOSER

☐ REPAIR OR REPLACE

1. The food disposer has an obstruction inside. I recommend repair as needed.

I recommend contacting a plumber to make repairs.



10.3 Item 1 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The

causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

77

✓ ITEMS INSPECTED

Total number in report.

29

📋 SUMMARY COMMENTS

Total number in report.

93

📷 PHOTOS

Total number in report.

🏠 1. PROPERTY OVERVIEW

✂ STYLES & MATERIALS: PROPERTY OVERVIEW

Temperature:

Over 65 (F) = 18 (C)

Weather:

Clear

Rain in last 3 days:

Yes

👁 ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

📁 REPAIR OR REPLACE

1. Discoloration and some type of mold (Microbial) growth is present in the structure at several areas including but not limited to the crawl space and interior spaces. Evidence suggests that this condition is from a past or present elevated moisture conditions. We did not inspect, test or determine if this type of substance is or is not a health hazard. Further investigation is needed.

We recommend you contact a properly licensed expert for testing, investigation and or correction as deemed appropriate.



1.0 Item 1 (Picture)

1.1 INSPECTION LIMITATIONS

📁 REPAIR OR REPLACE

(1) The home inspection was limited, one or more areas were not accessible due to the following conditions:

1. Furniture, storage and or personal items in the garage and throughout the house. As a result the areas were not inspected. Hidden damage may be present. Further investigation and repairs are needed.

We recommend having all personal items removed and these areas inspected prior to closing.

(2)

1. The framing and foundation of the deck were not inspected as the deck was too low to the ground for inspector to enter below. Hidden damage may be present.

I recommend contacting a licensed contractor for further evaluation.



1.1 Item 1 (Picture)

1.2 RADON TESTING

☑ NOT INSPECTED

🏠 2. ROOFING

📋 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

🔧 STYLES & MATERIALS: ROOFING

Roof Covering: Architectural	Age: Unable to Determine	Viewed roof covering from: Ground Camera Optical Zoom
Sky Light(s): One	Chimney (exterior): N/A	Roof-Type: Gable

👁️ ITEMS: ROOFING

2.0 ROOF COVERINGS

📋 REPAIR OR REPLACE

1. The roof shingle at the front of home has an exposed nail. This may allow water intrusion to occur. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



2.0 Item 1 (Picture)



2.0 Item 2 (Picture)

2.1 FLASHINGS

✅ INSPECTED

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

✅ INSPECTED

2.3 ROOF DRAINAGE SYSTEMS

📋 REPAIR OR REPLACE

1. The gutter leaks at seam (s) at the front (right of main entry). Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 1 (Picture)



2.3 Item 2 (Picture)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

3. EXTERIOR



DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

STYLES & MATERIALS: EXTERIOR

Siding Style: Lap	Siding Material: Vinyl	Exterior Entry Doors: Steel Insulated glass
Appurtenance: Deck with steps Covered porch Sidewalk	Driveway: Concrete Asphalt	

ITEMS: EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM

INSPECTED

3.1 EAVES, SOFFITS AND FASCIAS


INSPECTED

3.2 WINDOWS


REPAIR OR REPLACE

1. The window drain is taped shut at the right side of the home. Deterioration may occur if not repaired. Repairs are needed.

I recommend a qualified contractor inspect and repair as needed.

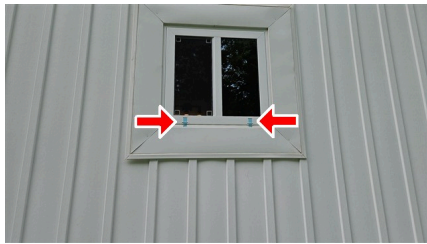

3.2 Item 1 (Picture)

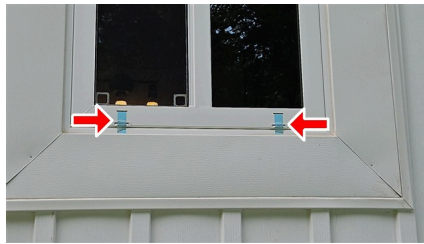

3.2 Item 2 (Picture)

3.3 DOORS (EXTERIOR)

✓ REPAIR OR REPLACE

(1)

1. The strike plates for the main entry door are missing. Repairs are needed.

I recommend a qualified contractor inspect and repair as needed.



3.3 Item 1 (Picture)

(2)

1. The access door to the crawlspace deteriorated at bottom frame. Further deterioration will occur. I recommend repair as needed.

I recommend a qualified contractor inspect and repair as needed.



3.3 Item 2 (Picture)



3.3 Item 3 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

📋 REPAIR OR REPLACE


1. The floor joist hangers for the deck at the rear of home are fastened improperly. A more proper repair is needed to ensure stability or an injury might occur. Further investigation and repairs are needed.

I recommend having the entire deck evaluated for structural stability.

A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

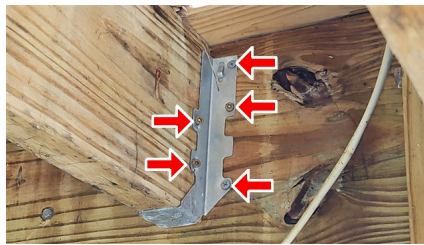

3.4 Item 2 (Picture)



3.4 Item 3 (Picture)



3.4 Item 4 (Picture)




3.4 Item 5 (Picture)



3.4 Item 6 (Picture)



3.4 Item 7 (Picture)

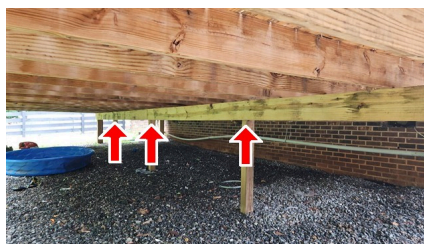

3.4 Item 8 (Picture)



3.4 Item 9 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

👍 REPAIR OR REPLACE

(1)

1. The asphalt drive at the front of home deteriorated in areas. Further deterioration can occur if not repaired. Repairs are needed.

A qualified person should repair or replace as needed.



3.5 Item 1 (Picture)



3.5 Item 2 (Picture)



3.5 Item 3 (Picture)

(2)

1. There is a negative slope at the exterior and can cause or contribute to water intrusion or deterioration. I recommend correcting landscape to drain water away from home.



3.5 Item 4 (Picture)



3.5 Item 5 (Picture)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 4. STRUCTURAL COMPONENTS

📋 DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

✂️ STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation:

Masonry block

Method used to observe

Crawlspace:

Crawled

Floor Structure:

8" or better

Wall Structure:

Wood

Columns or Piers:

Wood piers

Masonry block

Ceiling Structure:

Not visible

Roof Structure:

Not visible


👁️ ITEMS: STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)


📋 REPAIR OR REPLACE

1. The foundation wall in the crawlspace has cracks present. The wall(s) may need reinforcement. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.

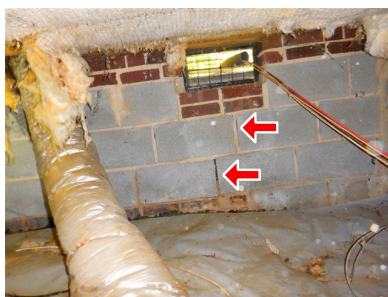

4.0 Item 1 (Picture)

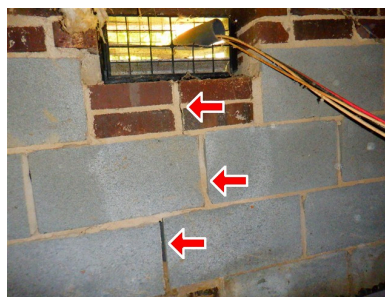

4.0 Item 2 (Picture)



4.0 Item 3 (Picture)

4.1 COLUMNS OR PIERS

☐ REPAIR OR REPLACE

1. Temporary wood support posts have been added in the crawl space. All piers should be masonry. All piers should be examined for signs of settlement condition and their adequacy in accepting bearing loads. Those that are deficient should be repaired or replaced to prevent further foundation issues and movement. Not addressing these issues could result in further floor system movement and other foundation issues. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.



4.1 Item 1 (Picture)




4.1 Item 2 (Picture)



4.1 Item 3 (Picture)



4.1 Item 4 (Picture)

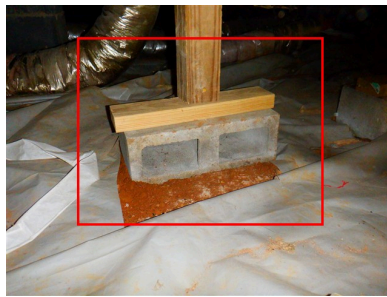

4.1 Item 5 (Picture)

4.2 FLOORS (STRUCTURAL)

☒ INSPECTED

4.3 CEILINGS (STRUCTURAL)

☒ NOT INSPECTED

4.4 ROOF STRUCTURE AND ATTIC

☒ NOT INSPECTED

4.5 WOOD DETERIORATION

☐ REPAIR OR REPLACE

1. Wood debris is in contact with the crawl space floor in numerous areas. This can attract wood destroying organisms. Removal is needed.

A qualified contractor should inspect and repair as needed.



4.5 Item 1 (Picture)



4.5 Item 2 (Picture)



4.5 Item 3 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☑ INSPECTED

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



Complimentary photo of the water heater

✂️ STYLES & MATERIALS: PLUMBING SYSTEM

Water Source: Well	Water Filters: None	Plumbing Water Supply (into home): Pex
Plumbing Water Distribution (inside home): PEX	Washer Drain Size: 2" Diameter	Plumbing Waste: PVC
Water Heater Power Source: Electric	Water Heater Capacity: Tankless	Manufacturer: RHEEM
Water Heater Location: Laundry Room		

👁️ ITEMS: PLUMBING SYSTEM

5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

 INSPECTED

The main shut off is the white lever located underneath in the crawlspace. This is for your information.



5.0 Item 1 (Picture)

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

 REPAIR OR REPLACE

1. The water heater is set over the recommended temperature. (Over 120) The risk is especially acute for infants, children, and the elderly. Water temperatures should never be set higher than 120 degrees. This is a safety issue. Repairs are needed

A qualified contractor should inspect and repair as needed.



5.1 Item 1 (Picture)

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

 INSPECTED

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

 REPAIR OR REPLACE

1. The toilet is loose at floor at the bath. Repairs may involve re-setting the toilet on a new wax seal. Repairs are needed.

I recommend a qualified licensed plumber repair or correct as needed.



5.3 Item 1 (Picture)

5.4 SINKS, FIXTURES, AND TOILETS

✓ INSPECTED

5.5 SHOWER/TUB & TILE WALLS

✓ INSPECTED

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

6. ELECTRICAL SYSTEM

DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service
Conductors:

Below ground
Aluminum

Panel capacity:

200 AMP

Panel Type:

Circuit breakers

Electric Panel Manufacturer:

GENERAL ELECTRIC

Branch wire 15 and 20 AMP:

Copper

Wiring Methods:

Romex

ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

INSPECTED

The main panel box is located at the outside.

6.1 SERVICE ENTRANCE CONDUCTORS

INSPECTED


6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

REPAIR OR REPLACE


(1)

1. Wires were observed to be cut down to fit circuit breakers in the sub panel. This often leads to wires that can overheat. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.


A qualified licensed electrical contractor should correct as needed.

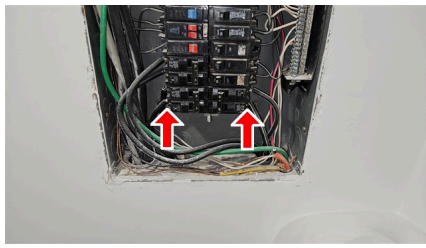

6.2 Item 1 (Picture)

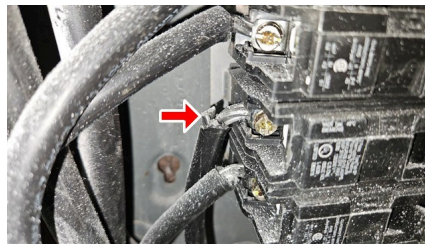

6.2 Item 2 (Picture)

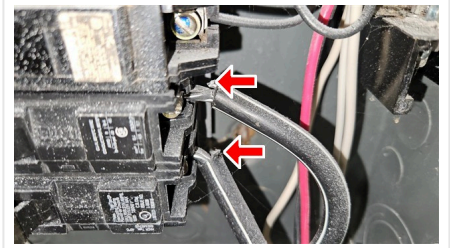


6.2 Item 3 (Picture)

(2)

1. The electrical panel cover sub panel has been secure with sheet metal screw. This is considered unsafe as sheet metal screws are not rated for electrical panel use. The use of sheet metal screws with panel cover have been known to short hot wires, as the can pearce the branch wiring protective coverings. (Safety Issue) Repairs are needed.

A qualified licensed electrical contractor should correct as needed.

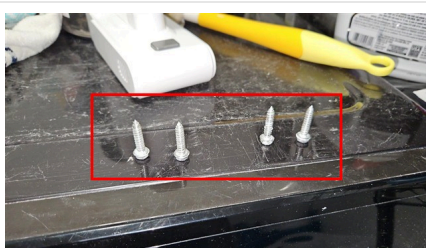


6.2 Item 4 (Picture)


(3)

1. The main panel has missing knockouts. (safety issue) Unused openings in panel equipment need to be closed. Covering these openings helps to prevent accidental shocks (think of kids), helps to prevent pests from entering. Repairs are needed.


A qualified licensed electrical contractor should correct as needed.

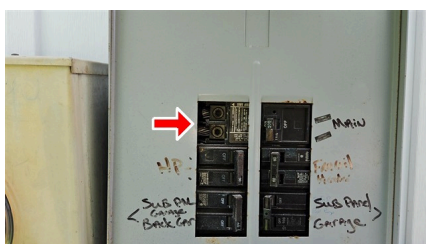

6.2 Item 5 (Picture)

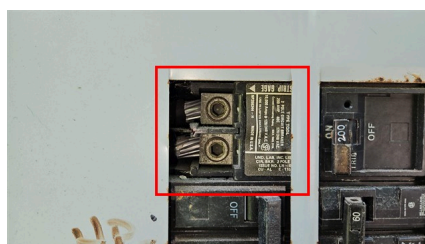

6.2 Item 6 (Picture)

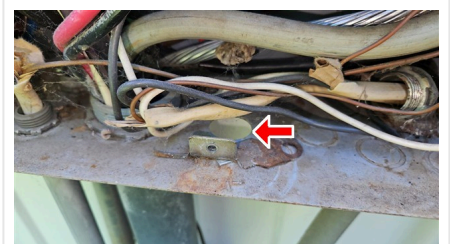


6.2 Item 7 (Picture)

(4)

1. The wire protection grommets are missing where the branch wiring enters the panel. Electrical issues are considered a hazard until repaired. Repairs are recommended.

A qualified licensed electrical contractor should correct as needed.

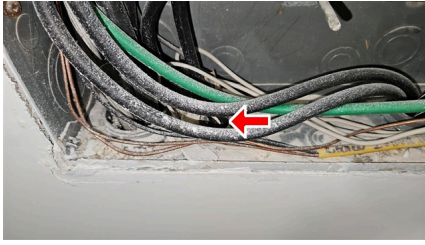

6.2 Item 8 (Picture)

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED


6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

📋 REPAIR OR REPLACE


(1)

1. The septic pump an extension cord as permanent wiring at the exterior. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.

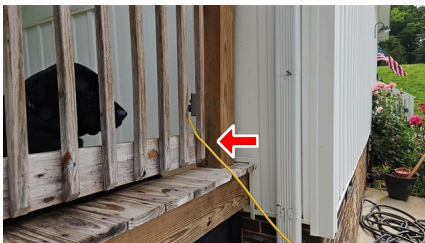

6.4 Item 1 (Picture)

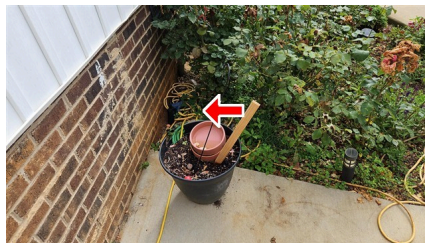

6.4 Item 2 (Picture)





6.4 Item 3 (Picture)

**6.4 Item 4 (Picture)**

(2)

1. The electrical conduit at the rear of the home is damaged. This may allow for water intrusion to occur. Further investigation and repairs are needed..

I recommend a qualified licensed electrical contractor correct.

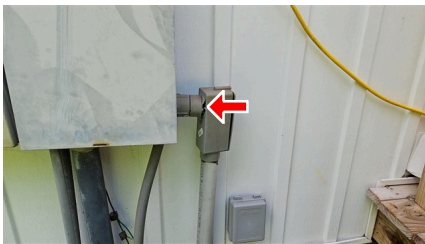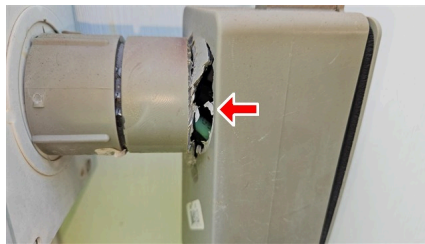**6.4 Item 5 (Picture)****6.4 Item 6 (Picture)**

(3)

1. The ceiling fan does work, but "wobbles" in the Guest bedroom. Some fans that wobble cannot be corrected without replacement. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.

**6.4 Item 7 (Picture)**


(4)

1. Several open splices needs electrical splice placed inside access panel, or install inside a box with cover-plate in the crawlspace. Electrical wires laying on the ground. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 8 (Picture)

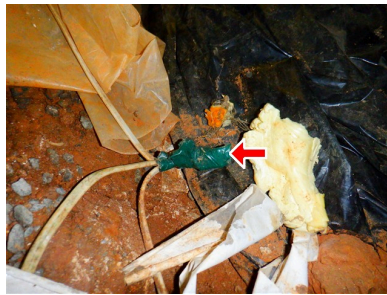

6.4 Item 9 (Picture)



6.4 Item 10 (Picture)



6.4 Item 11 (Picture)

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

✓ INSPECTED

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

✓ INSPECTED

6.7 SMOKE DETECTORS

📋 REPAIR OR REPLACE

1. The smoke detector are missing in the home. Without a working smoke detector in your home you have no first alert to a possible fire. Repairs are needed.


A qualified person should repair or replace as needed.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 7. HEATING / CENTRAL AIR CONDITIONING

📋 DESCRIPTION

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

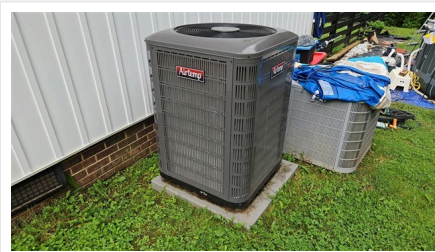

Complimentary photo of the heat pump



🔧 STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type: Heat Pump Forced Air (also provides cool air)	Number of Heat Systems (excluding wood): One	Energy Source: Electric
Operated: Summer-Did not operate due to weather conditons. (Could damage the system)	Heat System Brand: UNKNOWN	Ductwork: Insulated
Types of Fireplaces: None	Operable Fireplaces: None	Number of Woodstoves: None
Cooling Equipment Type: Heat Pump Forced Air (also provides warm air)	Cooling Equipment Energy Source: Electricity	Central Air Manufacturer: NORDYNE
Number of AC Only Units: One		

🔍 ITEMS: HEATING / CENTRAL AIR CONDITIONING

7.0 HEATING EQUIPMENT

✓ INSPECTED

7.1 NORMAL OPERATING CONTROLS

✓ INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

✓ INSPECTED


7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

📋 REPAIR OR REPLACE

(1)

1. The supply register in floor is weak (not intended for floor) throughout the home. This is a safety issue and should be repaired. A replacement is needed.

A qualified HVAC person should inspect further and repair or replace as needed.

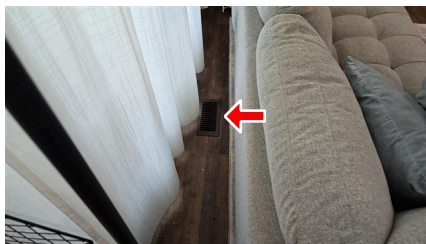


7.3 Item 1 (Picture)



7.3 Item 2 (Picture)



7.3 Item 3 (Picture)

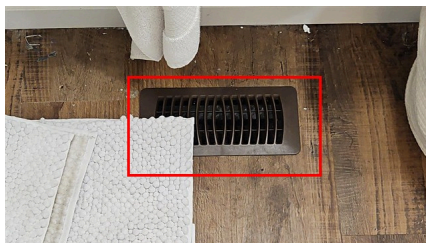

7.3 Item 4 (Picture)

(2)


1. The supply and return duct pipe are damaged and is in contact with ground and may deteriorate if not corrected in the crawlspace. Energy loss is occurring in crawlspace and immediate correction is needed. A minimum of four inches of clearance from the ground is needed to prevent deterioration to ductwork. Further investigation and repairs are needed.

I recommend having the homes entire ductwork system evaluated.


A qualified HVAC person should inspect further and repair or replace as needed.



7.3 Item 5 (Picture)

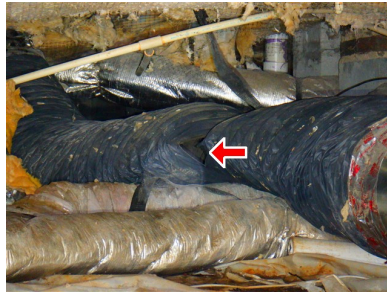

7.3 Item 6 (Picture)

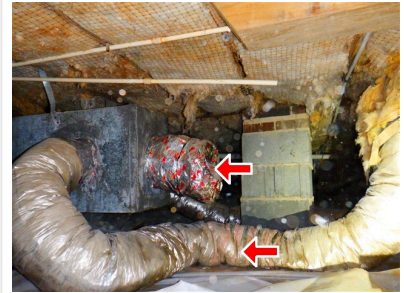

7.3 Item 7 (Picture)



7.3 Item 8 (Picture)



7.3 Item 9 (Picture)

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

☑ INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

☑ NOT PRESENT

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

☑ NOT PRESENT

7.7 GAS/LP FIRELOGS AND FIREPLACES

☑ NOT PRESENT

7.8 COOLING AND AIR HANDLER EQUIPMENT

☐ REPAIR OR REPLACE

(1)

1. The electrical conduit is not long enough and then at outside unit. This is a safety issue and should be repaired. Repairs are needed.

A licensed HVAC contractor should service or repair unit.




7.8 Item 1 (Picture)



7.8 Item 2 (Picture)

(2)

1. The foam sleeve on suction line is missing foam sleeve in area(s) at outside unit. Missing foam on suction line can cause energy loss and condensation. I recommend service or repair as needed.

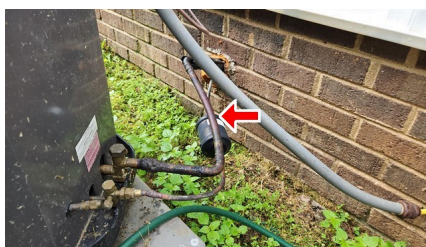

7.8 Item 3 (Picture)

7.9 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

☑ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

8. INTERIORS

DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

STYLES & MATERIALS: INTERIORS

Ceiling Materials:

Drywall

Wall Material:

Drywall

Floor Covering(s):

Area rug

Vinyl Plank

Interior Doors:

Hollow core

Raised panel

Window Types:

Thermal/Insulated

Single-hung

Tilt feature

ITEMS: INTERIORS

8.0 CEILINGS

 INSPECTED

8.1 WALLS

 INSPECTED

8.2 FLOORS

 INSPECTED

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

 INSPECTED

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

 INSPECTED

8.5 DOORS (REPRESENTATIVE NUMBER)

 REPAIR OR REPLACE

1. The door at private bath will not latch properly. Evidence suggest that the door needs strike and latch adjustment to shut properly. This is a small repair.

A qualified person should repair or replace as needed.




8.5 Item 1 (Picture)

8.6 WINDOWS (REPRESENTATIVE NUMBER)


REPAIR OR REPLACE

1. One window does not lock properly at the dining room. As a result you can not lock the window.
Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.

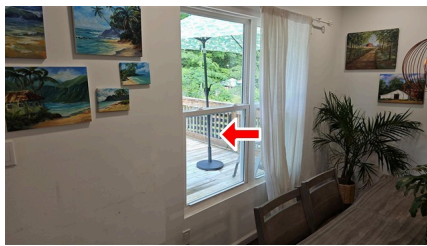

8.6 Item 1 (Picture)

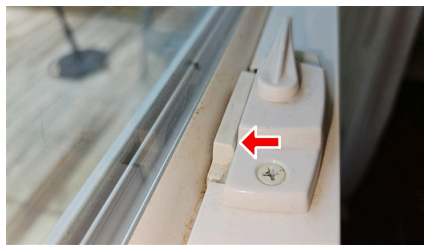

8.6 Item 2 (Picture)

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 9. INSULATION AND VENTILATION

📋 DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

✂️ STYLES & MATERIALS: INSULATION AND VENTILATION

Method used to observe attic:

Inaccessible

Attic Insulation:

Unknown

Ventilation:

Ridge vents

Soffit Vents

Exhaust Fans:

Fan with light

Dryer Power Source:

220 Electric

Dryer Vent:

Metal

Floor System Insulation:

Batts

Loose fill (netted)

👁️ ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

📋 REPAIR OR REPLACE

1. The vapor barrier (plastic) on the crawlspace ground is missing in areas. A vapor barrier provides added protection to the floor system from moisture or dampness that can enter from ground. Repairs are needed.

A qualified person should repair or replace as needed.



9.0 Item 1 (Picture)



9.0 Item 2 (Picture)




9.0 Item 3 (Picture)

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

☐ REPAIR OR REPLACE

1. The foundation vents are missing screens and or loose at the exterior. Rodents, reptiles or insects could enter into crawlspace. Repairs are needed.


A qualified person should repair or replace as needed.

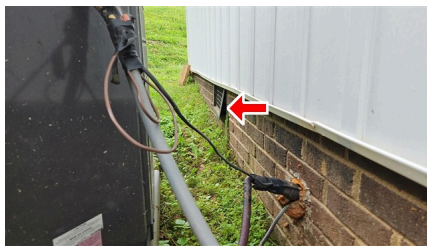

9.1 Item 1 (Picture)



9.1 Item 2 (Picture)

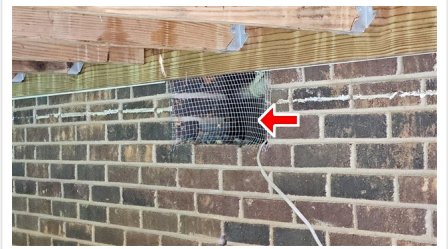

9.1 Item 3 (Picture)



9.1 Item 4 (Picture)



9.1 Item 5 (Picture)

9.2 INSULATION IN ATTIC

☒ NOT INSPECTED

9.3 INSULATION UNDER FLOOR SYSTEM

☐ REPAIR OR REPLACE

1. The insulation is missing is deteriorated in areas in the crawlspace. Heat loss can occur more on this home than one that is properly insulated. Repairs are needed.

A qualified contractor should inspect and repair as needed.



9.3 Item 1 (Picture)



9.3 Item 2 (Picture)

9.4 ATTIC ACCESS

☒ NOT PRESENT

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

📋 REPAIR OR REPLACE

1. The dryer vent hood at the rear of home does not have the proper clearance from the grade/ground to function as intended. Dryer vent exhaust shall terminate not less than 12 inches above finish grade to prevent blockages. Current conditions should be considered a fire hazard until repaired. Repairs are needed.

A qualified person should repair or replace as needed.



9.5 Item 1 (Picture)



9.5 Item 2 (Picture)

9.6 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

✅ NOT PRESENT

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

10. BUILT-IN KITCHEN APPLIANCES

DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Granite

Cabinetry:

Wood

ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER

REPAIR OR REPLACE

(1)

1. The dishwasher door springs are damaged. The door springs need replacing if parts are available is damaged. I recommend repair as necessary.

I recommend contacting appliance repair company.



10.0 Item 1 (Picture)

(2)

1. The dishwasher drain hose needs to be looped above the level of the kitchen sink drain or an approved air gap installed to prevent back flow of waste water into the water supply. (food safety issue) This can allow waste for the sink to contaminate the dishwasher. This is a small repair.

A qualified licensed plumber should repair or correct as needed.



10.0 Item 2 (Picture)

(3)

1. The dishwasher is loose and needs securing to underside of countertop (using a proper length screw). I recommend repair as necessary.

I recommend contacting appliance repair company.



10.0 Item 3 (Picture)

10.1 RANGES/OVENS/COOKTOPS

📋 REPAIR OR REPLACE

1. The range/oven needs to be properly attached/anchored to the structure as to keep it from tipping over when the oven door is opened and/or oven racks are pulled out during use. This is a safety issue. Repairs are needed.

I recommend contacting appliance repair company.



10.1 Item 1 (Picture)

10.2 RANGE HOOD (S)

✓ INSPECTED

10.3 FOOD WASTE DISPOSER

✗ REPAIR OR REPLACE

1. The food disposer has an obstruction inside. I recommend repair as needed.
I recommend contacting a plumber to make repairs.



10.3 Item 1 (Picture)

10.4 MICROWAVE COOKING EQUIPMENT

✓ INSPECTED

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.