



INSPECTION REPORT
151 Alder Springs Ln
 Mooresville NC 28117

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 4/30/2024
🕒 02:00:00 PM

Michael A Parr
3692

INVOICE

Above Parr Home Inspections

Inspected By: Alex Parr 3692

Inspection Date: 4/30/2024
Report ID: 043024AP2

Customer Info:	Inspection Property:
Jeff Schwing Customer's Real Estate Professional: Jake Reed NextHome at the Lake	151 Alder Springs Ln Mooresville NC 28117

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	625.00	1	625.00
WDI/Termite	75.00	1	75.00

Tax \$0.00
Total Price \$700.00

Payment Method: Credit Card
Payment Status: Paid
Note:

GENERAL INFO

Property Address

151 Alder Springs Ln
Mooresville NC 28117

Date of Inspection

4/30/2024

Report ID

043024AP2

Customer(s)

Jeff Schwing

Time of Inspection

02:00:00 PM

Real Estate Agent

Jake Reed
NextHome at the Lake

INSPECTION DETAILS

Approximate age of building:

Over 10 Years

In Attendance:

Customer and their agent

Radon Test:

No

Water Test:

No

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

Yes

Type of building:

Single Family (2 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

TABLE OF CONTENTS

Cover Page1

Invoice 2

Intro Page 3

Table of Contents 4

General Summary 5

1 Property Overview15

2 Roofing 17

3 Exterior18

4 Structural Components 23

5 Plumbing System 26

6 Electrical System30

7 Heating / Central Air Conditioning 34

8 Interiors37

9 Insulation and Ventilation 39

10 Built-In Kitchen Appliances 43

GENERAL SUMMARY

Above Parr Home Inspections

Customer

Jeff Schwing

Address

151 Alder Springs Ln
Mooresville NC 28117

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

1. PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE


REPAIR OR REPLACE

1. Discoloration and some type of mold (Microbial) growth is present in the structure at several areas including but not limited to the crawl space and interior spaces. Evidence suggests that this condition is from a past or present elevated moisture conditions. We did not inspect, test or determine if this type of substance is or is not a health hazard. Further investigation is needed.

We recommend you contact a properly licensed expert for testing, investigation and or correction as deemed appropriate.



1.0 Item 1 (Picture)

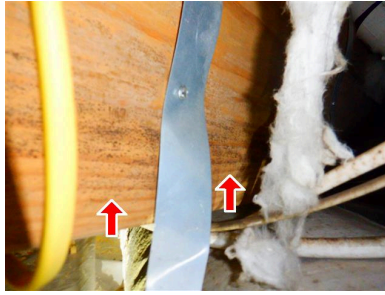

1.0 Item 2 (Picture)



1.0 Item 3 (Picture)



1.0 Item 4 (Picture)


1.1 INSPECTION LIMITATIONS

REPAIR OR REPLACE

The home inspection was limited, one or more areas were not accessible due to the following conditions:

1. Furniture, storage and or personal items in the garage and throughout the house. As a result the areas were not inspected. Hidden damage may be present. Further investigation and repairs are needed.

We recommend having all personal items removed and these areas inspected prior to closing.

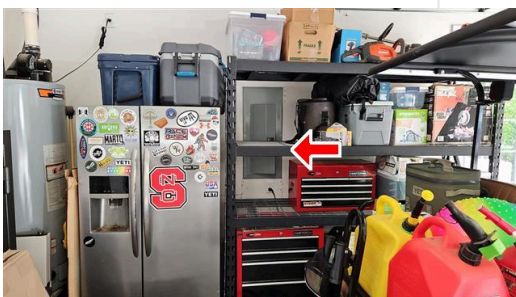

1.1 Item 1 (Picture)

3. EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM

REPAIR OR REPLACE

(1)

1. The wood siding at the exterior is deteriorated. Further deterioration can occur if not corrected. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



3.0 Item 1 (Picture)



3.0 Item 2 (Picture)



3.0 Item 3 (Picture)



3.0 Item 4 (Picture)

(2)

1. The wood siding at the exterior is damaged from what appears to be a woodpecker. Further deterioration can occur if not corrected. Further investigation and repairs are needed.


A qualified person should repair or replace as needed.




3.0 Item 5 (Picture)



3.0 Item 6 (Picture)

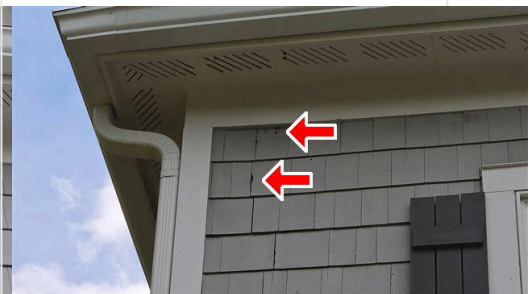


3.0 Item 7 (Picture)

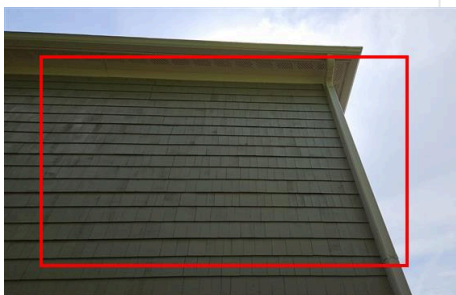


3.0 Item 8 (Picture)



3.0 Item 9 (Picture)

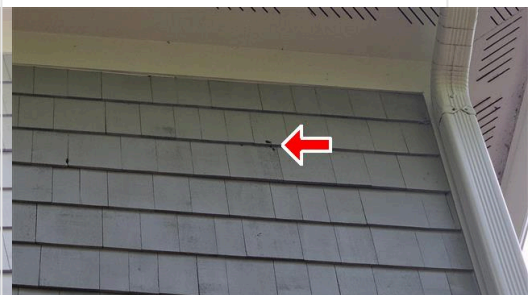


3.0 Item 10 (Picture)

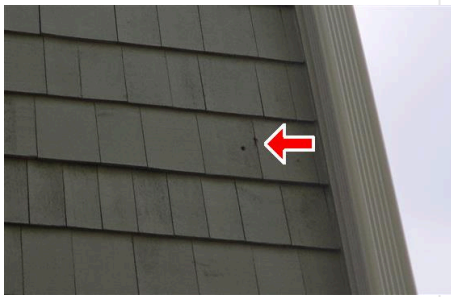


3.0 Item 11 (Picture)



3.0 Item 12 (Picture)

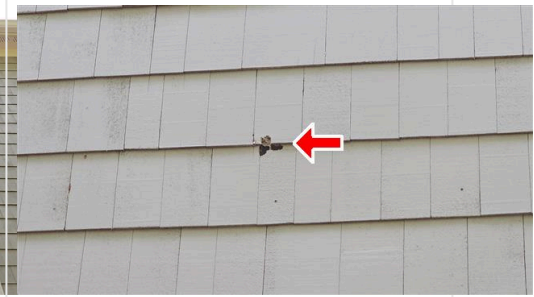

3.0 Item 13 (Picture)

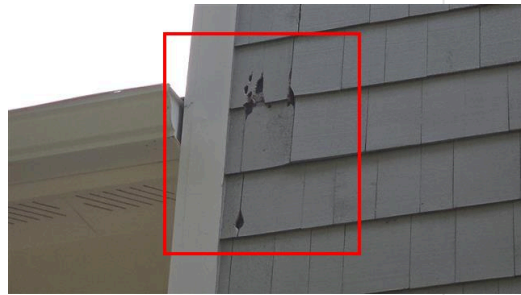


3.0 Item 14 (Picture)

3.3 DOORS (EXTERIOR)

REPAIR OR REPLACE

1. The entry door at rear of home deteriorated at bottom of jamb (s). Further deterioration may occur if not repaired. Repairs are needed.

A qualified person should repair or replace as needed.

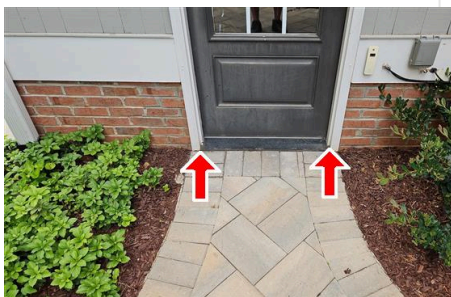

3.3 Item 1 (Picture)



3.3 Item 2 (Picture)




3.3 Item 3 (Picture)

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)


REPAIR OR REPLACE

1. The fire resistance sheathing that separates garage from heated space that separates garage from heated space is compromised. This is considered unsafe until corrected. Repairs are needed.

A qualified person should correct for safety.

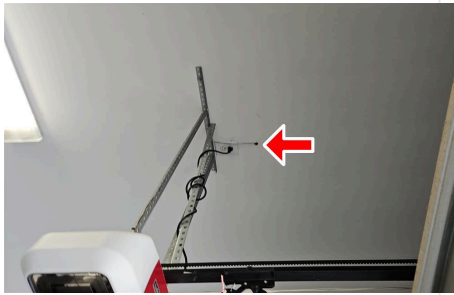


3.8 Item 1 (Picture)

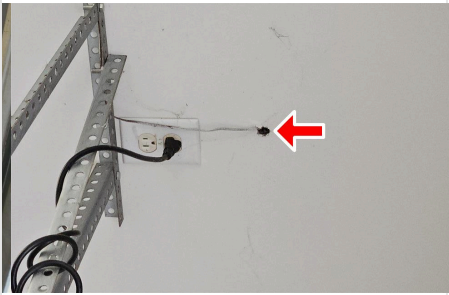

3.8 Item 2 (Picture)



3.8 Item 3 (Picture)

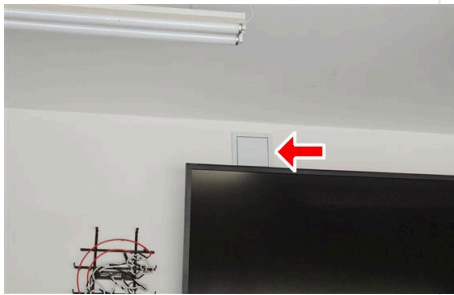

3.8 Item 4 (Picture)



3.8 Item 5 (Picture)

4. STRUCTURAL COMPONENTS

4.1 COLUMNS OR PIERS

REPAIR OR REPLACE

1. Several added CMU (concrete masonry unit) piers are installed incorrectly in the crawl space. As the piers have been installed with no concrete footing and with their cores horizontal with no mortar between the blocks. All masonry block piers should be installed on a concrete footing with the cores vertical and with joints mortared. All piers should be examined for signs of settlement condition and their adequacy in accepting bearing loads. Those that are deficient should be repaired or replaced to prevent foundation issues and movement. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.



4.1 Item 1 (Picture)



4.1 Item 2 (Picture)



4.1 Item 3 (Picture)

4.4 ROOF STRUCTURE AND ATTIC

REPAIR OR REPLACE

1. The collar ties is loose in the attic. Repairs are needed to maintain the stability of roof. Further investigation and repairs are needed.


I recommend a qualified contractor perform the work.



4.4 Item 1 (Picture)



4.4 Item 2 (Picture)

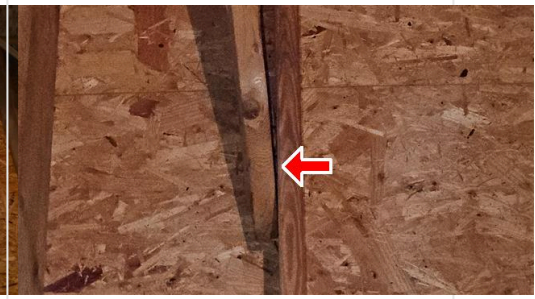

4.4 Item 3 (Picture)

4.5 WOOD DETERIORATION

REPAIR OR REPLACE

1. Wood debris is in contact with the crawl space floor in numerous areas. This can attract wood destroying organisms. Removal is needed.

A qualified contractor should inspect and repair as needed.



4.5 Item 1 (Picture)

5. PLUMBING SYSTEM

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

REPAIR OR REPLACE

1. The water heater is set over the recommended temperature. (Over 120) The risk is especially acute for infants, children, and the elderly. Water temperatures should never be set higher than 120 degrees.

This is a safety issue. Repairs are needed

A qualified contractor should inspect and repair as needed.



5.1 Item 1 (Picture)

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

REPAIR OR REPLACE


(1)

1. The sink controls are difficult to operate possibly hard water throughout the home. Therefore they do not function as intended. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.



5.2 Item 1 (Picture)

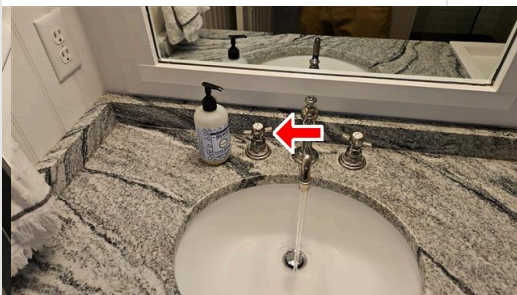


5.2 Item 2 (Picture)


(2)

1. The sink faucets is loose at the guest bath. This is allow undue stress to occur on supply lines allowing leaks to occur. Repairs are needed..


A qualified licensed plumber should repair or correct as needed.

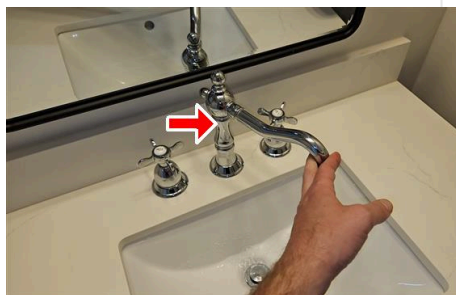

5.2 Item 3 (Picture)

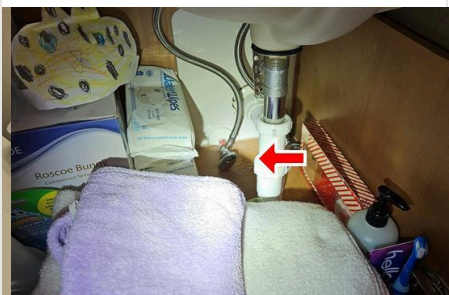

5.2 Item 4 (Picture)

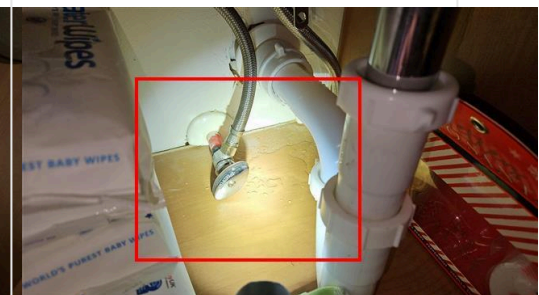


5.2 Item 5 (Picture)

5.6 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)

REPAIR OR REPLACE

1. The gas piping in the house includes corrugated stainless steel tubing (CSST). There is no electrical bonding connection between the gas piping system and the electrical system, other than the connection at the gas appliance that utilizes the grounding conductors for the appliance. The lack of a strong electrical bonding may increase the potential for lightning strikes to cause arcing of the CSST gas piping that may result in perforation of the piping, gas leaks, and fires. For safety, it is recommended that this installation be further investigated by a licensed electrical contractor.

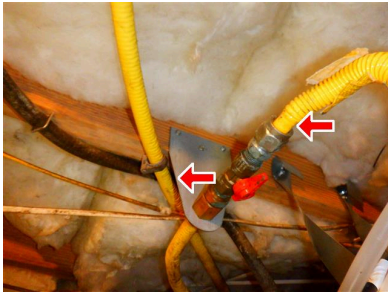

5.6 Item 1 (Picture)

6. ELECTRICAL SYSTEM

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

REPAIR OR REPLACE


(1)

1. One "three-prong" outlet is damaged (foreign object blocking prong holes) in the kitchen. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 1 (Picture)

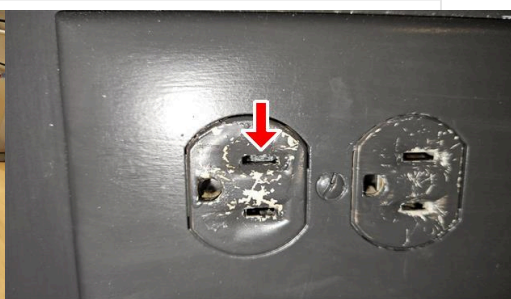


6.4 Item 2 (Picture)

6.7 SMOKE DETECTORS

REPAIR OR REPLACE

1. The smoke detector is missing battery at the bedroom. Without a working smoke detector in your home you have no first alert to a possible fire. Repairs are needed.

A qualified person should repair or replace as needed.

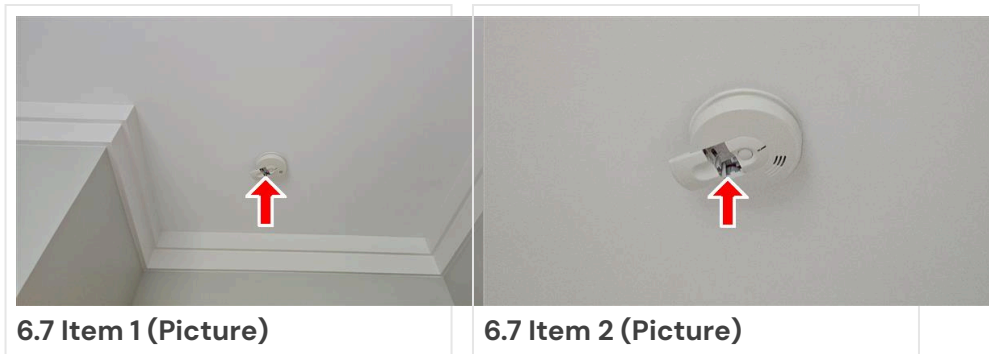

7. HEATING / CENTRAL AIR CONDITIONING


7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

REPAIR OR REPLACE

(1)

1. The supply plenum is in contact with ground and may deteriorate if not corrected in the crawlspace. A minimum of four inches of clearance from the ground is needed to prevent deterioration to ductwork. Further investigation and repairs are needed..

A qualified HVAC person should inspect further and repair or replace as needed.

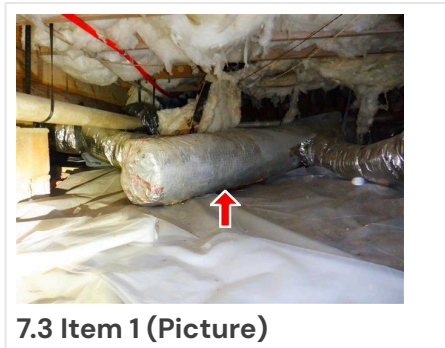

9. INSULATION AND VENTILATION

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

REPAIR OR REPLACE

(1)

1. Several foundation vent are damaged at the crawlspace entry. Opinions vary on whether or not your crawlspace should be ventilated. If you have some moisture entering in then ventilation is usually recommended. Not opening the vents when moisture is present could harm your floor system or contribute to mold. A dry crawlspace that is prepared for no ventilation (other steps required), would not use the vents. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



9.1 Item 1 (Picture)



9.1 Item 2 (Picture)



9.1 Item 3 (Picture)



9.1 Item 4 (Picture)

10. BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER

☐ REPAIR OR REPLACE

1. The dishwasher drain hose needs to be looped above the level of the kitchen sink drain or an approved air gap installed to prevent back flow of waste water into the water supply. (food safety issue) This can allow waste for the sink to contaminate the dishwasher. This is a small repair.

A qualified licensed plumber should repair or correct as needed.



10.0 Item 1 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground

items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

75

✓ ITEMS INSPECTED
Total number in report.

18

📋 SUMMARY COMMENTS
Total number in report.

77

📷 PHOTOS
Total number in report.

🏠 1. PROPERTY OVERVIEW

✂ STYLES & MATERIALS: PROPERTY OVERVIEW

Temperature:

Over 65 (F) = 18 (C)

Weather:

Clear

Rain in last 3 days:

No

👁 ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE


📋 REPAIR OR REPLACE

1. Discoloration and some type of mold (Microbial) growth is present in the structure at several areas including but not limited to the crawl space and interior spaces. Evidence suggests that this condition is from a past or present elevated moisture conditions. We did not inspect, test or determine if this type of substance is or is not a health hazard. Further investigation is needed.


We recommend you contact a properly licensed expert for testing, investigation and or correction as deemed appropriate.



1.0 Item 1 (Picture)

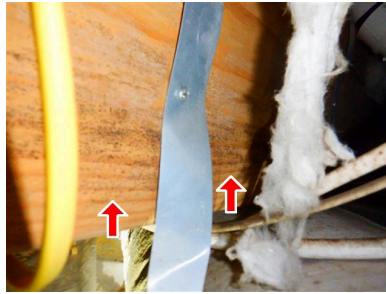

1.0 Item 2 (Picture)

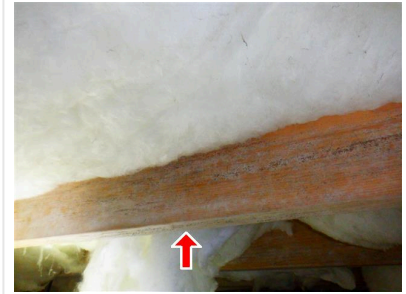

1.0 Item 3 (Picture)



1.0 Item 4 (Picture)

1.1 INSPECTION LIMITATIONS

REPAIR OR REPLACE

The home inspection was limited, one or more areas were not accessible due to the following conditions:

1. Furniture, storage and or personal items in the garage and throughout the house. As a result the areas were not inspected. Hidden damage may be present. Further investigation and repairs are needed.

We recommend having all personal items removed and these areas inspected prior to closing.



1.1 Item 1 (Picture)

1.2 RADON TESTING

NOT INSPECTED

 2. ROOFING

 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

 STYLES & MATERIALS: ROOFING

Roof Covering: Architectural	Age: 5-10 Yrs	Viewed roof covering from: Ground Camera Optical Zoom
Sky Light(s): None	Chimney (exterior): N/A	Roof-Type: Hip

 ITEMS: ROOFING

2.0 ROOF COVERINGS

 INSPECTED

2.1 FLASHINGS

 INSPECTED

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

 INSPECTED

2.3 ROOF DRAINAGE SYSTEMS

 INSPECTED

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 3. EXTERIOR



 DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

 STYLES & MATERIALS: EXTERIOR

Siding Style: Shiplap	Siding Material: Wood	Exterior Entry Doors: Wood Steel Insulated glass
Appurtenance: Covered porch Sidewalk Patio	Driveway: Concrete	

 ITEMS: EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM


 REPAIR OR REPLACE

(1)

1. The wood siding at the exterior is deteriorated. Further deterioration can occur if not corrected.

Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.

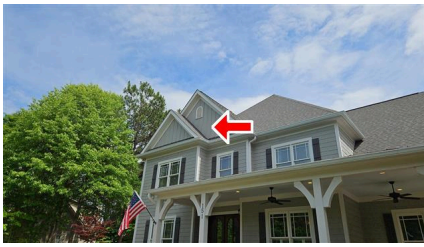

3.0 Item 1 (Picture)



3.0 Item 2 (Picture)



3.0 Item 3 (Picture)




3.0 Item 4 (Picture)

(2)

1. The wood siding at the exterior is damaged from what appears to be a woodpecker. Further deterioration can occur if not corrected. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.

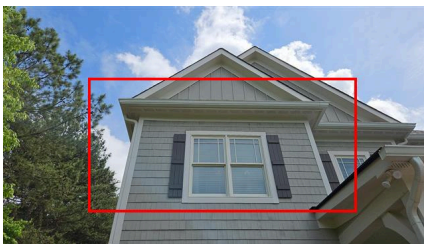


3.0 Item 5 (Picture)




3.0 Item 6 (Picture)



3.0 Item 7 (Picture)

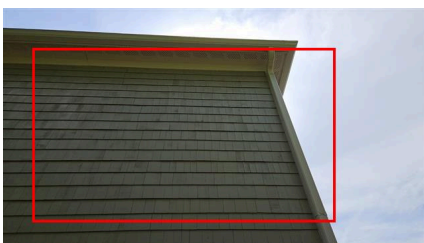


3.0 Item 8 (Picture)

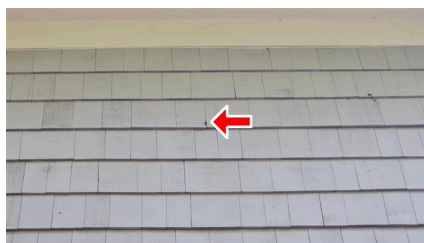

3.0 Item 9 (Picture)




3.0 Item 10 (Picture)

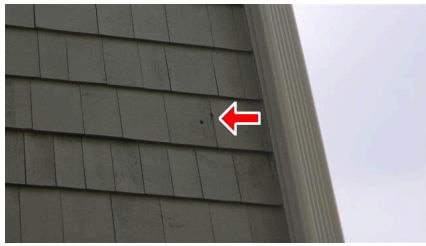

3.0 Item 11 (Picture)



3.0 Item 12 (Picture)

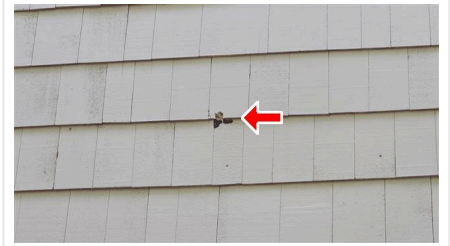

3.0 Item 13 (Picture)



3.0 Item 14 (Picture)

3.1 EAVES, SOFFITS AND FASCIAS

✓ INSPECTED

3.2 WINDOWS


✓ INSPECTED

3.3 DOORS (EXTERIOR)

📋 REPAIR OR REPLACE

1. The entry door at rear of home deteriorated at bottom of jamb (s). Further deterioration may occur if not repaired. Repairs are needed.

A qualified person should repair or replace as needed.

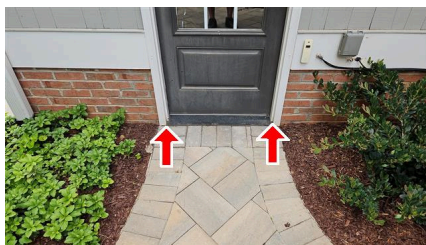

3.3 Item 1 (Picture)



3.3 Item 2 (Picture)



3.3 Item 3 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

✓ INSPECTED

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS

(WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

✓ INSPECTED

3.6 GARAGE DOOR (S)

✓ REPAIR OR REPLACE

1. The garage door at the right side (facing front) shows deterioration on bottom of side jambs.

Further deterioration may occur if not repaired. Repairs are needed.

A qualified person should repair or replace as needed.



3.6 Item 1 (Picture)



3.6 Item 2 (Picture)



3.6 Item 3 (Picture)



3.6 Item 4 (Picture)


3.7 GARAGE DOOR OPERATORS (REPORT WHETHER OR NOT DOORS WILL REVERSE WHEN MET WITH RESISTANCE)

✓ INSPECTED


3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

✗ REPAIR OR REPLACE

1. The fire resistance sheathing that separates garage from heated space that separates garage from heated space is compromised. This is considered unsafe until corrected. Repairs are needed. A qualified person should correct for safety.

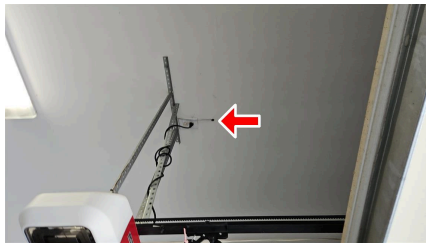

3.8 Item 1 (Picture)

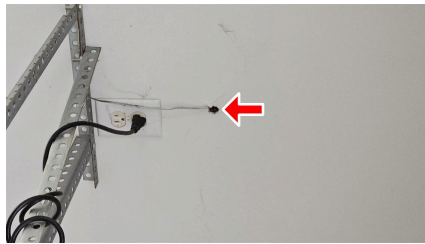

3.8 Item 2 (Picture)



3.8 Item 3 (Picture)



3.8 Item 4 (Picture)



3.8 Item 5 (Picture)

3.9 OCCUPANT DOOR (FROM GARAGE TO INSIDE OF HOME)

✓ INSPECTED

3.10 GARAGE FLOOR

✓ INSPECTED

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 4. STRUCTURAL COMPONENTS

 DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

 STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation: Masonry block	Method used to observe Crawlspace: Crawled	Floor Structure: 2 X 10
Wall Structure: Wood	Columns or Piers: Masonry block	Ceiling Structure: 6" or better
Roof Structure: 2 X 8 Rafters		

 ITEMS: STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

 INSPECTED

4.1 COLUMNS OR PIERS

 REPAIR OR REPLACE

1. Several added CMU (concrete masonry unit) piers are installed incorrectly in the crawl space. As the piers have been installed with no concrete footing and with their cores horizontal with no mortar between the blocks. All masonry block piers should be installed on a concrete footing with the cores vertical and with joints mortared. All piers should be examined for signs of settlement condition and their adequacy in accepting bearing loads. Those that are deficient should be repaired or replaced to prevent foundation issues and movement. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.



4.1 Item 1 (Picture)



4.1 Item 2 (Picture)



4.1 Item 3 (Picture)

4.2 FLOORS (STRUCTURAL)

✓ INSPECTED

4.3 CEILINGS (STRUCTURAL)

✓ INSPECTED

4.4 ROOF STRUCTURE AND ATTIC


✗ REPAIR OR REPLACE

1. The collar ties is loose in the attic. Repairs are needed to maintain the stability of roof. Further investigation and repairs are needed.


I recommend a qualified contractor perform the work.



4.4 Item 1 (Picture)

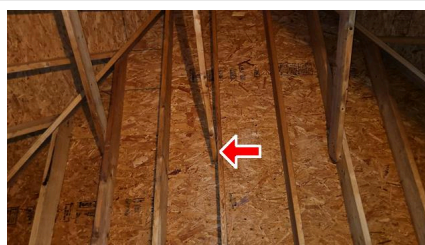

4.4 Item 2 (Picture)

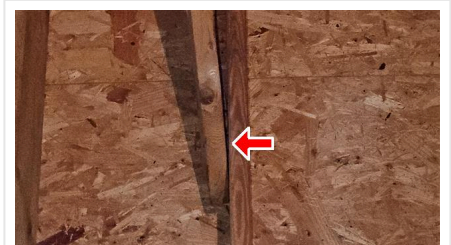

4.4 Item 3 (Picture)

4.5 WOOD DETERIORATION

✗ REPAIR OR REPLACE

1. Wood debris is in contact with the crawl space floor in numerous areas. This can attract wood destroying organisms. Removal is needed.

A qualified contractor should inspect and repair as needed.



4.5 Item 1 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☑ INSPECTED

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 5. PLUMBING SYSTEM

 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

 STYLES & MATERIALS: PLUMBING SYSTEM


Water Source: Well	Water Filters: None	Plumbing Water Supply (into home): Pex
Plumbing Water Distribution (inside home): PEX	Washer Drain Size: 2" Diameter	Plumbing Waste: PVC
Water Heater Power Source: Gas (quick recovery)	Water Heater Capacity: Unknown	Manufacturer: STATE
Water Heater Location: Garage		

 ITEMS: PLUMBING SYSTEM

5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

 INSPECTED

The main shut off is the red lever located underneath in the crawlspace. This is for your information.

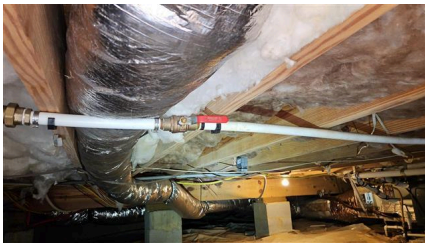

5.0 Item 1 (Picture)

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

REPAIR OR REPLACE

1. The water heater is set over the recommended temperature. (Over 120) The risk is especially acute for infants, children, and the elderly. Water temperatures should never be set higher than 120 degrees. This is a safety issue. Repairs are needed

A qualified contractor should inspect and repair as needed.



5.1 Item 1 (Picture)

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

REPAIR OR REPLACE


(1)

1. The sink controls are difficult to operate possibly hard water throughout the home. Therefore they do not function as intended. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.



5.2 Item 1 (Picture)

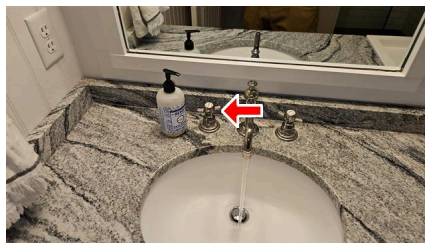


5.2 Item 2 (Picture)

(2)

1. The sink faucets is loose at the guest bath. This is allow undue stress to occur on supply lines allowing leaks to occur. Repairs are needed..

A qualified licensed plumber should repair or correct as needed.

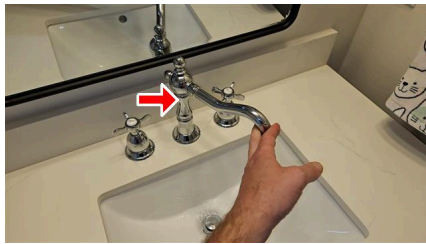

5.2 Item 3 (Picture)



5.2 Item 4 (Picture)



5.2 Item 5 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

✓ INSPECTED

5.4 SINKS, FIXTURES, AND TOILETS

✓ INSPECTED


5.5 SHOWER/TUB & TILE WALLS

✓ INSPECTED

5.6 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)

☐ REPAIR OR REPLACE

1. The gas piping in the house includes corrugated stainless steel tubing (CSST). There is no electrical bonding connection between the gas piping system and the electrical system, other than the connection at the gas appliance that utilizes the grounding conductors for the appliance. The lack of a strong electrical bonding may increase the potential for lightning strikes to cause arcing of the CSST gas piping that may result in perforation of the piping, gas leaks, and fires. For safety, it is recommended that this installation be further investigated by a licensed electrical contractor.

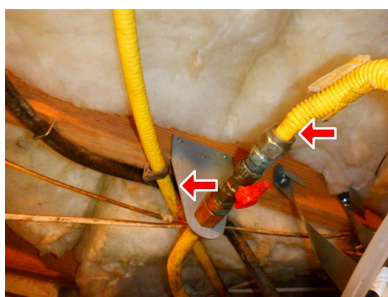

5.6 Item 1 (Picture)

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but

then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 6. ELECTRICAL SYSTEM

☰ DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.



Complimentary photo of the electric panel with the cover off

✂ STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service Conductors: Below ground Aluminum	Panel capacity: 200 AMP	Panel Type: Circuit breakers
Electric Panel Manufacturer: EATON	Branch wire 15 and 20 AMP: Copper	Wiring Methods: Romex

👁 ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

The main panel box is located at the outside.

6.1 SERVICE ENTRANCE CONDUCTORS

✓ INSPECTED

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

✗ REPAIR OR REPLACE


(1)

1. One "three-prong" outlet is damaged (foreign object blocking prong holes) in the kitchen. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 1 (Picture)

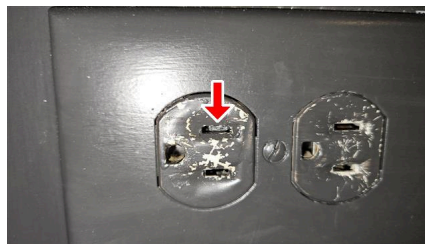


6.4 Item 2 (Picture)


(2)

1. The light fixture does not work (try bulb first) at the throughout the home. Further investigation and repairs are needed..

A qualified licensed electrical contractor should correct as needed.

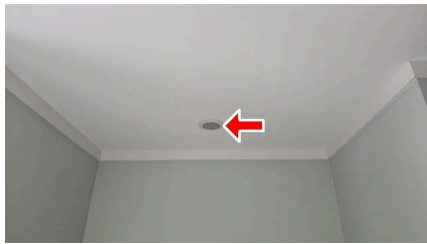

6.4 Item 3 (Picture)

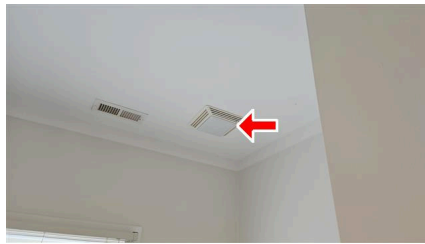

6.4 Item 4 (Picture)

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

✓ INSPECTED

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)


✓ INSPECTED

6.7 SMOKE DETECTORS

📋 REPAIR OR REPLACE

1. The smoke detector is missing battery at the bedroom. Without a working smoke detector in your home you have no first alert to a possible fire. Repairs are needed.

A qualified person should repair or replace as needed.

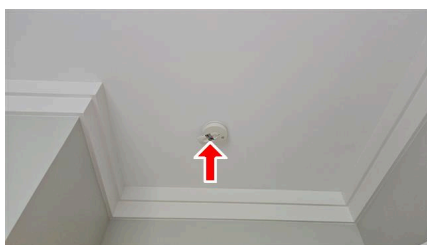

6.7 Item 1 (Picture)



6.7 Item 2 (Picture)

6.8 CARBON MONOXIDE DETECTORS

✓ INSPECTED

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection

report.

🏠 7. HEATING / CENTRAL AIR CONDITIONING

📋 DESCRIPTION

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



Complimentary photo of the AC units



Complimentary photo of the gas furnace with the cover off

✂️ STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type: Forced Air	Heating Age: 1-5 yrs	Number of Heat Systems (excluding wood): Two
Energy Source: Natural gas	Operated: Units Operated	Heat System Brand: TRANE
Ductwork: Insulated	Types of Fireplaces: Non-vented gas logs	Operable Fireplaces: One
Number of Woodstoves:	Cooling Equipment Type:	Air Conditioning Age:

None

Air conditioner unit

1-5 yrs

Cooling Equipment Energy**Central Air Manufacturer:****Number of AC Only Units:****Source:**

TRANE

Two

Electricity

ITEMS: HEATING / CENTRAL AIR CONDITIONING**7.0 HEATING EQUIPMENT**

✔ INSPECTED

7.1 NORMAL OPERATING CONTROLS

✔ INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

✔ INSPECTED


7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

📋 REPAIR OR REPLACE

(1)

1. The supply plenum is in contact with ground and may deteriorate if not corrected in the crawlspace. A minimum of four inches of clearance from the ground is needed to prevent deterioration to ductwork. Further investigation and repairs are needed..

A qualified HVAC person should inspect further and repair or replace as needed.

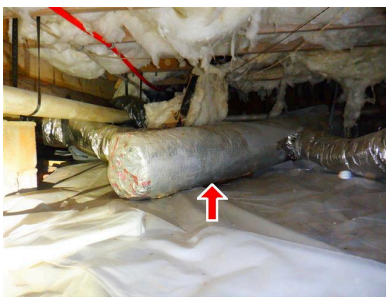**7.3 Item 1 (Picture)**

(2)

1. The supply plenum and duct pipe is damaged in the crawlspace. Energy loss is occurring in crawlspace and immediate correction is needed. Repairs are needed..

I recommend further inspection by a licensed HVAC contractor.



7.3 Item 2 (Picture)

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

☑ INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

☑ INSPECTED

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

☑ NOT PRESENT

7.7 GAS/LP FIRELOGS AND FIREPLACES

☑ INSPECTED

7.8 COOLING AND AIR HANDLER EQUIPMENT

☑ INSPECTED

7.9 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

☑ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 8. INTERIORS

 DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

 STYLES & MATERIALS: INTERIORS

Ceiling Materials: Drywall	Wall Material: Drywall	Floor Covering(s): Area rug Carpet Tile Wood
Interior Doors: Hollow core Solid Raised panel	Window Types: Thermal/Insulated Tilt feature Fixed	

 ITEMS: INTERIORS

8.0 CEILINGS

 INSPECTED

8.1 WALLS

 INSPECTED

8.2 FLOORS

 INSPECTED

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS


 INSPECTED

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

 INSPECTED, REPAIR OR REPLACE

1. Drawer faces and Cabinet door (s) rubs against cabinets. Further investigation and repairs are needed.

A qualified person should repair or replace as needed

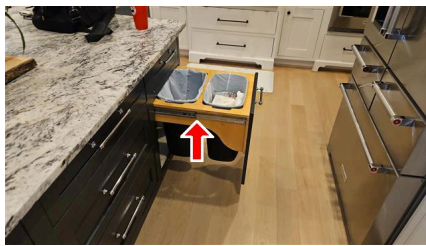

8.4 Item 1 (Picture)




8.4 Item 2 (Picture)

8.5 DOORS (REPRESENTATIVE NUMBER)

✓ REPAIR OR REPLACE

1. The door at guest Bedroom will not latch properly. Evidence suggest that the door needs strike and latch adjustment to shut properly. This is a small repair.

A qualified person should repair or replace as needed.

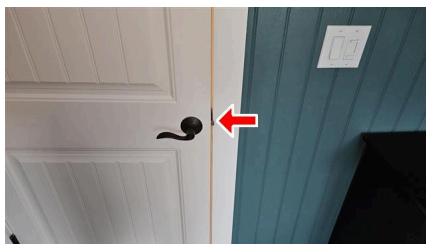

8.5 Item 1 (Picture)

8.6 WINDOWS (REPRESENTATIVE NUMBER)

✓ INSPECTED

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 9. INSULATION AND VENTILATION

 DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

 STYLES & MATERIALS: INSULATION AND VENTILATION

Attic info: Attic access	Method used to observe attic: From entry	Attic Insulation: Blown Fiberglass
Ventilation: Gable vents Ridge vents Soffit Vents	Exhaust Fans: Fan with light	Dryer Power Source: 220 Electric
Dryer Vent: Metal	Floor System Insulation: Faced Batts	

 ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

 INSPECTED

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

 REPAIR OR REPLACE

(1)

1. Several foundation vent are damaged at the crawlspace entry. Opinions vary on whether or not your crawlspace should be ventilated. If you have some moisture entering in then ventilation is usually recommended. Not opening the vents when moisture is present could harm your floor system or contribute to mold. A dry crawlspace that is prepared for no ventilation (other steps required), would not use the vents. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



9.1 Item 1 (Picture)



9.1 Item 2 (Picture)




9.1 Item 3 (Picture)




9.1 Item 4 (Picture)

(2)

1. The foundation vent(s) are below ground level at left side (facing front) which can allow water to enter crawlspace. A half-round window well should be installed. The dirt inside well should be replaced with approximately four inches of gravel. A couple of inches clearance between gravel and vent opening recommended.

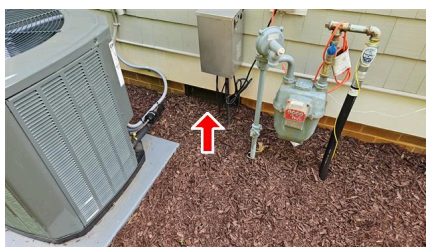

9.1 Item 5 (Picture)

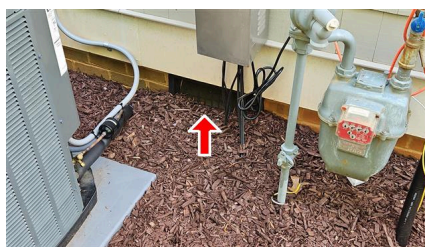


9.1 Item 6 (Picture)



9.1 Item 7 (Picture)



9.1 Item 8 (Picture)

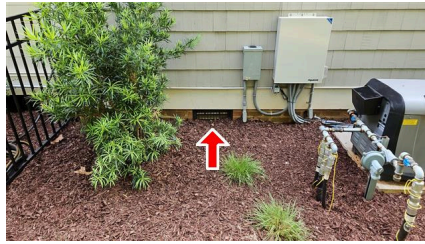

9.1 Item 9 (Picture)

9.2 INSULATION IN ATTIC

✓ REPAIR OR REPLACE

1. Fiberglass (loose-fill) insulation is is compressed in areas of the attic due to foot traffic or storage in attic. Heat loss can occur more on this home than one that is properly insulated. Repairs are recommended .

A qualified person should repair or replace as needed.



9.2 Item 1 (Picture)

9.3 INSULATION UNDER FLOOR SYSTEM

✓ REPAIR OR REPLACE

1. The insulation is loose/fallen in the crawlspace. Heat loss can occur more on this home than one that is properly insulated. Repairs are needed..


A qualified person should repair or replace as needed.



9.3 Item 1 (Picture)



9.3 Item 2 (Picture)

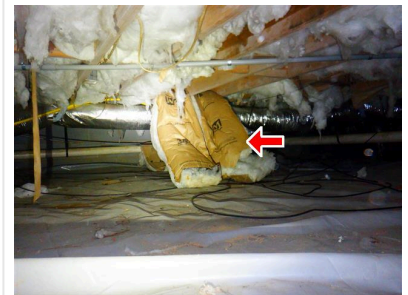

9.3 Item 3 (Picture)

**9.3 Item 4 (Picture)**

9.4 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

☑ INSPECTED

9.5 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

☑ NOT PRESENT

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 10. BUILT-IN KITCHEN APPLIANCES

📋 DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

🔧 STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Granite

Cabinetry:

Wood

👁️ ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER

📋 REPAIR OR REPLACE

1. The dishwasher drain hose needs to be looped above the level of the kitchen sink drain or an approved air gap installed to prevent back flow of waste water into the water supply. (food safety issue) This can allow waste for the sink to contaminate the dishwasher. This is a small repair.

A qualified licensed plumber should repair or correct as needed.



10.0 Item 1 (Picture)

10.1 RANGES/OVENS/COOKTOPS

✅ INSPECTED

10.2 RANGE HOOD (S)

✅ INSPECTED

10.3 FOOD WASTE DISPOSER

✅ INSPECTED

10.4 MICROWAVE COOKING EQUIPMENT

✓ INSPECTED

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.