



INSPECTION REPORT
246 Broadmoor Dr
Advance NC 27006

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 7/2/2025
🕒 09:00:00 AM

Michael A Parr
3692

INVOICE

Above Parr Home Inspections

Inspected By: Alex Parr 3692

Inspection Date: 7/2/2025
Report ID: 070225AP2

Customer Info:	Inspection Property:
Brett Goodman	246 Broadmoor Dr Advance NC 27006
Customer's Real Estate Professional: Will Sheppard Will Sheppard Realty	

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	680.00	1	680.00
WDI/Termite	75.00	1	75.00
Inspection Discount	-80.00	1	-80.00

Tax \$0.00

Total Price \$675.00

Payment Method: Credit Card

Payment Status: Paid

Note:

GENERAL INFO

Property Address

246 Broadmoor Dr
Advance NC 27006

Date of Inspection

7/2/2025

Report ID

070225AP2

Customer(s)

Brett Goodman

Time of Inspection

09:00:00 AM

Real Estate Agent

Will Sheppard
Will Sheppard Realty

INSPECTION DETAILS

Approximate age of building:

Over 25 Years

In Attendance:

Customer and their agent

Radon Test:

No

Water Test:

No

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

Yes

Type of building:

Single Family (2 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

■ ■ ■ TABLE OF CONTENTS

Cover Page1

Invoice 2

Intro Page 3

Table of Contents 4

General Summary 5

1 Property Overview 20

2 Roofing22

3 Exterior 25

4 Structural Components 35

5 Plumbing System 38

6 Electrical System 44

7 Heating / Central Air Conditioning 48

8 Interiors51

9 Insulation and Ventilation 55

10 Built-In Kitchen Appliances57

GENERAL SUMMARY

Above Parr Home Inspections

Customer

Brett Goodman

Address

246 Broadmoor Dr
Advance NC 27006

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

1. PROPERTY OVERVIEW

1.1 INSPECTION LIMITATIONS

REPAIR OR REPLACE

The home inspection was limited, one or more areas were not accessible due to the following conditions:

1. Furniture, storage and or personal items in the garage and throughout the house. As a result the areas were not inspected. Hidden damage may be present. Further investigation and repairs are needed.

We recommend having all personal items removed and these areas inspected prior to closing.

2. ROOFING

2.1 FLASHINGS

REPAIR OR REPLACE

1. The roof flashing has evidence of leaking above the master bedroom. Further damage may occur. Further investigation and repairs are needed.


A qualified person should repair or replace as needed.




2.1 Item 1 (Picture)



2.1 Item 2 (Picture)

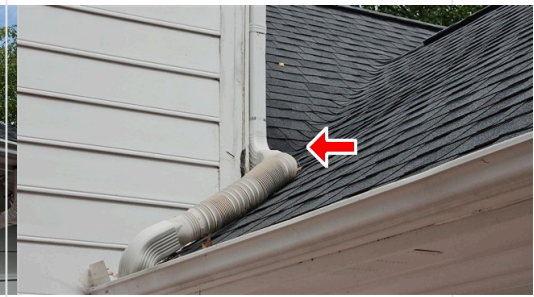

2.1 Item 3 (Picture)

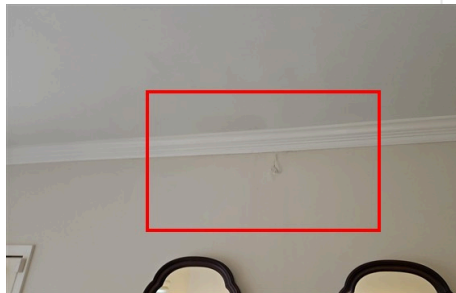

2.1 Item 4 (Picture)



2.1 Item 5 (Picture)



2.1 Item 6 (Picture)

2.3 ROOF DRAINAGE SYSTEMS

REPAIR OR REPLACE

(1)

1. The gutter do not appear to be draining properly. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



2.3 Item 1 (Picture)




2.3 Item 2 (Picture)



2.3 Item 3 (Picture)



2.3 Item 4 (Picture)

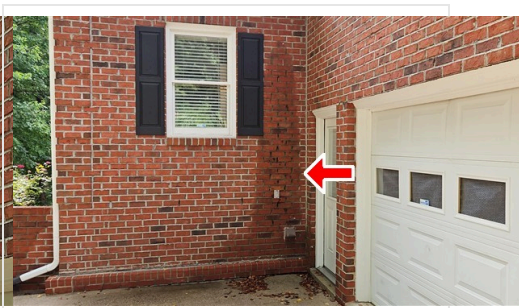

2.3 Item 5 (Picture)

3. EXTERIOR

3.2 WINDOWS

REPAIR OR REPLACE

(1)

1. The window frame deteriorated at most windows. Further deterioration may occur if not repaired.

Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.




3.2 Item 1 (Picture)



3.2 Item 2 (Picture)



3.2 Item 3 (Picture)

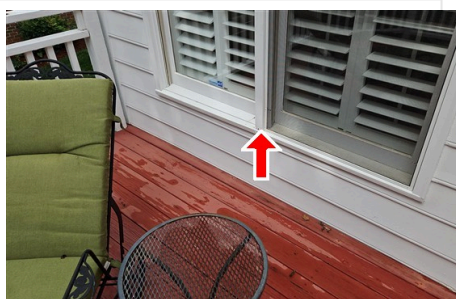

3.2 Item 4 (Picture)




3.2 Item 5 (Picture)



3.2 Item 6 (Picture)



3.2 Item 7 (Picture)

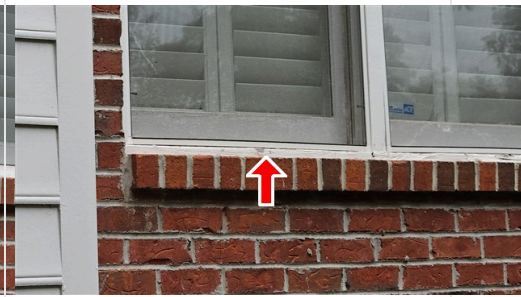

3.2 Item 8 (Picture)

3.3 DOORS (EXTERIOR)

☐ REPAIR OR REPLACE

(1) The main entry door deteriorated at bottom of jamb (s). This is allowing water damage to occur to the home. Further deterioration will occur if not repaired. A repair or replacement is needed.

A qualified contractor should inspect and repair as needed.



3.3 Item 1 (Picture)



3.3 Item 2 (Picture)



3.3 Item 3 (Picture)



3.3 Item 4 (Picture)



3.3 Item 5 (Picture)



3.3 Item 6 (Picture)



3.3 Item 7 (Picture)



3.3 Item 8 (Picture)



3.3 Item 9 (Picture)



3.3 Item 10 (Picture)



3.3 Item 11 (Picture)



3.3 Item 12 (Picture)



3.3 Item 13 (Picture)



3.3 Item 14 (Picture)

(2)

1. The exterior entry door has a dead bolt that is keyed. (Safety issue) All exterior doors should not be keyed type locks, as this can impede exiting the home should a fire occur. Repairs are needed.

A qualified person should repair or replace as needed.



3.3 Item 15 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

REPAIR OR REPLACE


(1)

1. The deck floor on the deck at the rear of home deteriorated. Further deterioration can occur if not repaired. A fall or injury can occur if not corrected. Repairs are needed.

A qualified contractor should repair or replace as needed.




3.4 Item 1 (Picture)

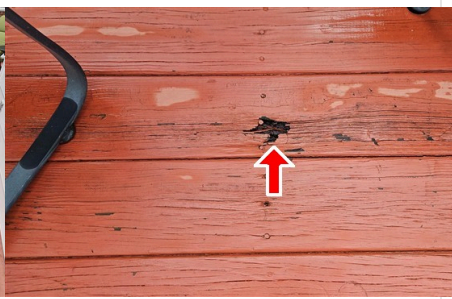


3.4 Item 2 (Picture)



3.4 Item 3 (Picture)

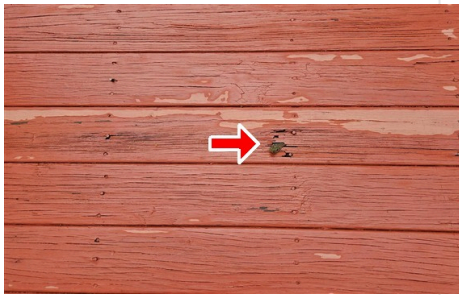

3.4 Item 4 (Picture)

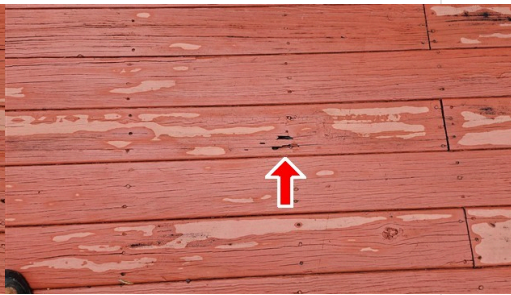

3.4 Item 5 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☐ REPAIR OR REPLACE

(1)

1. The concrete drive at the front of home has settled and is directing storm water into the home. This is causing damage and water intrusion to occur to the home. Further deterioration will occur. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



3.5 Item 1 (Picture)



3.5 Item 2 (Picture)



3.5 Item 3 (Picture)



3.5 Item 4 (Picture)



3.5 Item 5 (Picture)



3.5 Item 6 (Picture)



3.5 Item 7 (Picture)



3.5 Item 8 (Picture)



3.5 Item 9 (Picture)

(2)

1. The concrete drive at the front of home uneven, and can be a tripping hazard. Water can cause further deterioration if not repaired and sealed properly. A fall or injury can occur if not corrected. Repairs are needed.

A qualified contractor should inspect and repair as needed.



3.5 Item 10 (Picture)



3.5 Item 11 (Picture)



3.5 Item 12 (Picture)



3.5 Item 13 (Picture)

(3)

1. The sidewalk at the rear of home uneven, and can be a tripping hazard. A fall or injury can occur if not corrected. Repairs are needed.

A qualified contractor should inspect and repair as needed.



3.5 Item 14 (Picture)



3.5 Item 15 (Picture)



3.5 Item 16 (Picture)

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

REPAIR OR REPLACE

1. The fire resistance sheathing that separates garage from heated space is compromised. This is considered unsafe until corrected. Repairs are needed.

A qualified person should correct for safety.




3.8 Item 1 (Picture)



3.8 Item 2 (Picture)



3.8 Item 3 (Picture)

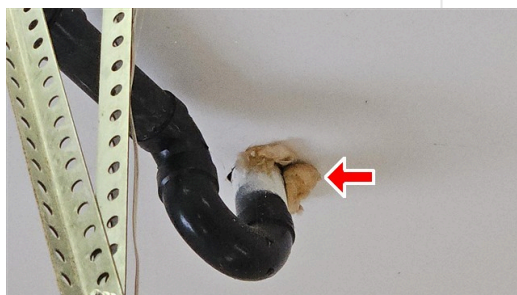

3.8 Item 4 (Picture)

4. STRUCTURAL COMPONENTS

4.4 ROOF STRUCTURE AND ATTIC


REPAIR OR REPLACE

1. The pull down stairs needs ladder trimmed at an angle to fit floor properly. Injury could result if not repaired. Repairs are needed.

A qualified contractor should inspect and repair as needed.



4.4 Item 1 (Picture)

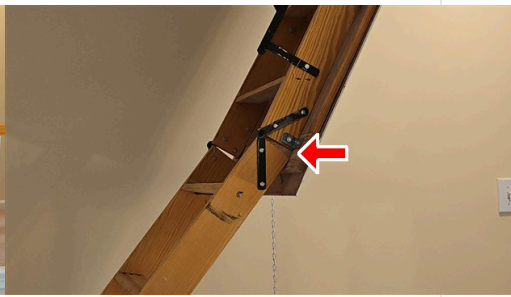

4.4 Item 2 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)


REPAIR OR REPLACE

1. Dark stains on the CMU (Concrete Masonry Unit) indicated that water is inside the block. Dark stains and white efflorescence (powder substance) on block wall indicates moisture is in contact with the masonry. This does not necessarily indicate that intrusion will occur. Efflorescence is found on many homes without water intrusion occurring inside the home. But, it should alert you to the possibility that future steps may be needed. Further investigation and repairs are needed.

I recommend contact a licensed water intrusion specialist regarding these conditions.



4.6 Item 1 (Picture)

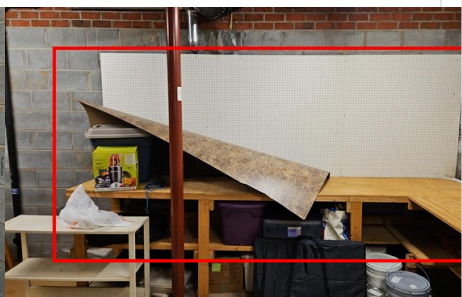

4.6 Item 2 (Picture)



4.6 Item 3 (Picture)



4.6 Item 4 (Picture)



4.6 Item 5 (Picture)



4.6 Item 6 (Picture)



4.6 Item 7 (Picture)

5. PLUMBING SYSTEM

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

☐ REPAIR OR REPLACE

(1)

1. The draft hood connection to flue vent connector: provide at least 12" vertical inches of the flue vent between the draft hood outlet and the first elbow. This is a safety issue and should be repaired. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 1 (Picture)

(2)

1. The T&P (Test and Pressure) valve on water heater needs a 3/4 threaded pipe to extend within 6 inches of floor for safety. (PVC is not approved for hot water use). I recommend repair by a qualified person.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 2 (Picture)


5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☐ REPAIR OR REPLACE

(1)

1. The sink faucets leaks at the upstairs bath. Repairs are needed to prevent water damage from occurring to the home. Repairs are needed.

A qualified licensed plumber should repair or correct as needed.

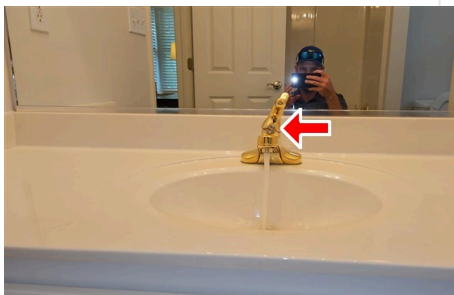

5.2 Item 1 (Picture)



5.2 Item 2 (Picture)



5.2 Item 3 (Picture)


(2)

1. The jacuzzi shows signs of improper cleaning and maintenance, as a result black residue is present (likely bacteria) when the tub was operated. (Health Safety Issue) Repairs are needed.

I recommend contacting a licensed plumber.



5.2 Item 4 (Picture)

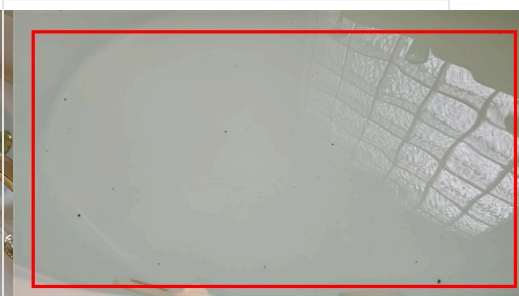

5.2 Item 5 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE

(1)

1. The toilet will not stop running at the guest bath. The flapper will likely need replacing. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 1 (Picture)

(2)

1. The plumbing waste line leaks under the W/D room. Repairs are needed to prevent water damage from occurring to the home. Repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 2 (Picture)



5.3 Item 3 (Picture)


(3)

1. The plumbing waste line leaks under the master bath. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 4 (Picture)

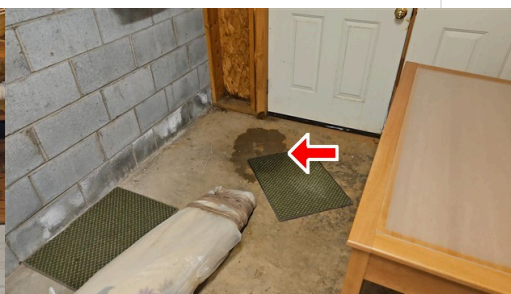

5.3 Item 5 (Picture)


6. ELECTRICAL SYSTEM

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

REPAIR OR REPLACE

1. Two wires were observed to be connected to one or more circuit breakers in the main panel. While often done, this is not permitted unless the device is so labeled. Double tapping often leads to overloaded circuits and loose connections that can overheat. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.

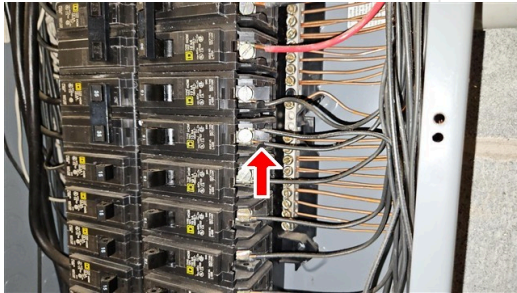

6.2 Item 1 (Picture)

6.7 SMOKE DETECTORS

REPAIR OR REPLACE

1. The smoke detectors in the home have expired. Without a working smoke detector in your home you have no first alert to a possible fire. Repairs are needed.

I recommend repair or replace as needed using a qualified person.



6.7 Item 1 (Picture)

6.8 CARBON MONOXIDE DETECTORS

REPAIR OR REPLACE

1. There is no carbon monoxide detector found in home. It is recommended that one be installed according to the manufacturer's instructions.

A qualified person should repair or replace as needed.

7. HEATING / CENTRAL AIR CONDITIONING

7.7 GAS/LP FIRELOGS AND FIREPLACES

📋 REPAIR OR REPLACE

1. The vented fire logs in the living room is not operable (burner would not ignite). Repairs should be made so unit works properly. Further investigation and repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.



7.7 Item 1 (Picture)


8. INTERIORS

8.2 FLOORS

📋 REPAIR OR REPLACE

1. The wood covering warped or buckled in the basement. Further deterioration can occur. This can be a tripping hazard. Further investigation and repairs are needed.


A qualified contractor should inspect and repair as needed.

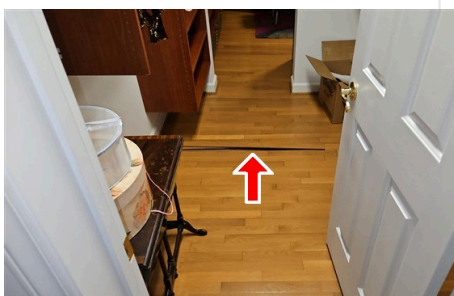


8.2 Item 1 (Picture)



8.2 Item 2 (Picture)

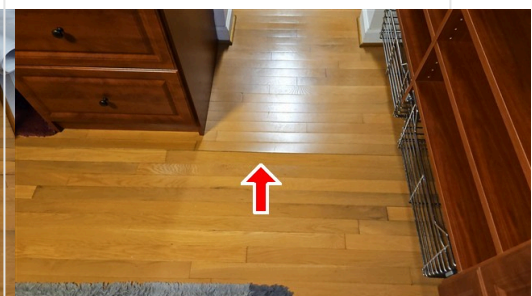

8.2 Item 3 (Picture)

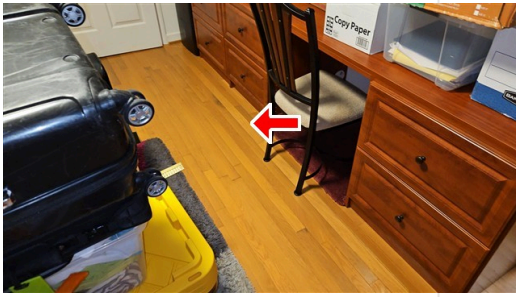

8.2 Item 4 (Picture)


8.5 DOORS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE


(1)

1. The privacy door is damaged at the guest bedroom. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

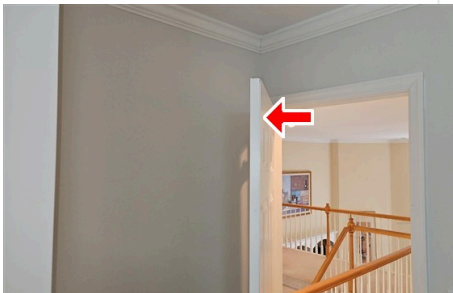

8.5 Item 1 (Picture)

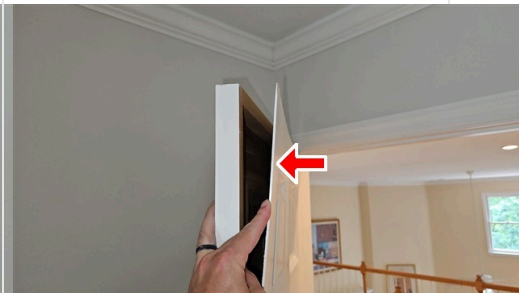

8.5 Item 2 (Picture)

9. INSULATION AND VENTILATION

9.2 INSULATION IN ATTIC

☐ REPAIR OR REPLACE

1. Fiberglass (loose-fill) insulation is compressed in areas of the attic due to foot traffic or storage in attic. Heat loss can occur more on this home than one that is properly insulated. Repairs are recommended .

A qualified person should repair or replace as needed.



9.2 Item 1 (Picture)



9.2 Item 2 (Picture)



9.2 Item 3 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

89

✓ ITEMS INSPECTED
Total number in report.

27

✓ SUMMARY COMMENTS
Total number in report.

132

✓ PHOTOS
Total number in report.

🏠 1. PROPERTY OVERVIEW

 STYLES & MATERIALS: PROPERTY OVERVIEW**Temperature:**

Over 65 (F) = 18 (C)

Weather:

Light Rain

Rain in last 3 days:

Yes

 ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

 INSPECTED

1.1 INSPECTION LIMITATIONS

 REPAIR OR REPLACE

The home inspection was limited, one or more areas were not accessible due to the following conditions:

1. Furniture, storage and or personal items in the garage and throughout the house. As a result the areas were not inspected. Hidden damage may be present. Further investigation and repairs are needed.

We recommend having all personal items removed and these areas inspected prior to closing.

1.2 RADON TESTING

 NOT INSPECTED

🏠 2. ROOFING

📋 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

🔧 STYLES & MATERIALS: ROOFING

Roof Covering: Architectural	Age: 10-15 Yrs	Viewed roof covering from: Ground Camera Optical Zoom
Sky Light(s): None	Chimney (exterior): N/A	Roof-Type: Gable Hip

👁️ ITEMS: ROOFING

2.0 ROOF COVERINGS

✅ INSPECTED

2.1 FLASHINGS

📋 REPAIR OR REPLACE

1. The roof flashing has evidence of leaking above the master bedroom. Further damage may occur. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



2.1 Item 1 (Picture)



2.1 Item 2 (Picture)




2.1 Item 3 (Picture)



2.1 Item 4 (Picture)



2.1 Item 5 (Picture)

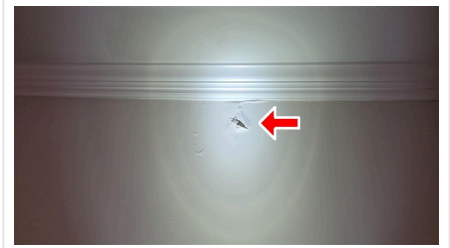

2.1 Item 6 (Picture)

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

✓ INSPECTED

2.3 ROOF DRAINAGE SYSTEMS

📋 REPAIR OR REPLACE

(1)

1. The gutter do not appear to be draining properly. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



2.3 Item 1 (Picture)




2.3 Item 2 (Picture)



2.3 Item 3 (Picture)



2.3 Item 4 (Picture)

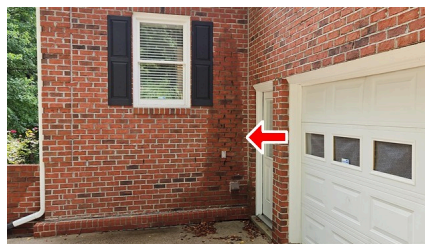

2.3 Item 5 (Picture)

(2)

1. The downspout needs reconnecting to existing drain line. Erosion can continue or become worse if not corrected possibly leading to water intrusion. Repairs are needed.

A qualified contractor should inspect and repair as needed.



2.3 Item 6 (Picture)



2.3 Item 7 (Picture)



2.3 Item 8 (Picture)



2.3 Item 9 (Picture)

(3)

1. The gutter leaks at seam (s) at the virtually all areas where gutters are installed. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 10 (Picture)



2.3 Item 11 (Picture)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 3. EXTERIOR



 DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

 STYLES & MATERIALS: EXTERIOR

Siding Style: Lap Brick	Siding Material: Cement-Fiber Brick veneer	Exterior Entry Doors: Wood Steel Insulated glass
Appurtenance: Deck with steps Sidewalk Patio	Driveway: Concrete	

 ITEMS: EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM


 REPAIR OR REPLACE

1. I observed small cracks in the brick veneer at the front of home. These are typical in nature due to age and normal masonry shrinkage. Although the cracks in the brick veneer are typical, these areas should be re sealed to prevent any water penetration or damage. Further evaluation by a qualified masonry contractor is recommended for this entire condition.

I recommend repair or replace using a qualified contractor.



3.0 Item 1 (Picture)

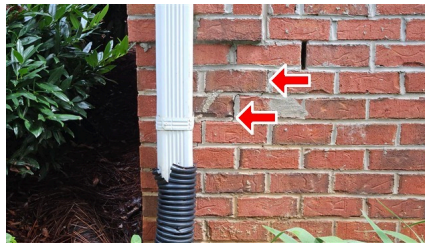

3.0 Item 2 (Picture)

3.1 EAVES, SOFFITS AND FASCIAS

✓ REPAIR OR REPLACE

1. The soffit panels at eave on the rear of home deteriorated. Further deterioration may occur if not repaired. Repairs are needed.

A qualified person should repair or replace as needed.



3.1 Item 1 (Picture)



3.1 Item 2 (Picture)

3.2 WINDOWS

☐ REPAIR OR REPLACE

(1)

1. The window frame deteriorated at most windows. Further deterioration may occur if not repaired.
Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



3.2 Item 1 (Picture)



3.2 Item 2 (Picture)



3.2 Item 3 (Picture)



3.2 Item 4 (Picture)



3.2 Item 5 (Picture)



3.2 Item 6 (Picture)



3.2 Item 7 (Picture)



3.2 Item 8 (Picture)


(2)

1. The steel lintels around the exterior of the home are beginning to rust or have rust present. A lintel is a horizontal architectural member or steel beam support placed over a wall opening to carry the weight of the masonry placed over it. In most situation, the lintel above you windows and doors will be steel angle iron or I beam. Either due to age or improper rust proofing or weep chord and flashing placement during installation, lintels will begin to rust. Rusting lintels can expand to become mush thicker then their original size. The expansive forces of rusting steel can shift entire multi-story elevations. If your lintels are currently rusting, a telltale sign of expansion is diagonal "step" pattern cracks, which can be found on either end of the window or door opening. Repairs are needed to prevent further damage to the structure. Further deterioration may occur if not repaired.


I recommend a qualified contractor inspect and repair as needed.



3.2 Item 9 (Picture)

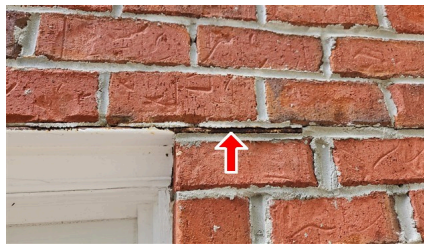

3.2 Item 10 (Picture)

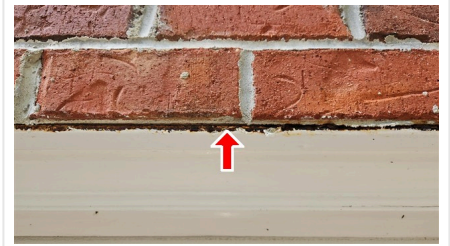

3.2 Item 11 (Picture)



3.2 Item 12 (Picture)

3.3 DOORS (EXTERIOR)

☐ REPAIR OR REPLACE

- (1) The main entry door deteriorated at bottom of jamb (s). This is allowing water damage to occur to the home. Further deterioration will occur if not repaired. A repair or replacement is needed.

A qualified contractor should inspect and repair as needed.



3.3 Item 1 (Picture)



3.3 Item 2 (Picture)



3.3 Item 3 (Picture)



3.3 Item 4 (Picture)



3.3 Item 5 (Picture)



3.3 Item 6 (Picture)



3.3 Item 7 (Picture)



3.3 Item 8 (Picture)



3.3 Item 9 (Picture)



3.3 Item 10 (Picture)



3.3 Item 11 (Picture)



3.3 Item 12 (Picture)



3.3 Item 13 (Picture)



3.3 Item 14 (Picture)

(2)

1. The exterior entry door has a dead bolt that is keyed. (Safety issue) All exterior doors should not be keyed type locks, as this can impede exiting the home should a fire occur. Repairs are needed.

A qualified person should repair or replace as needed.



3.3 Item 15 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE


(1)

1. The deck floor on the deck at the rear of home deteriorated. Further deterioration can occur if not repaired. A fall or injury can occur if not corrected. Repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

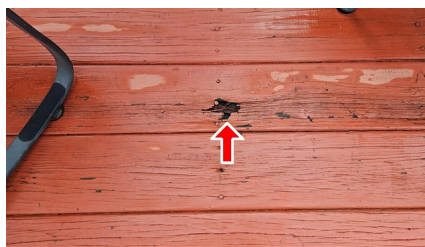

3.4 Item 2 (Picture)



3.4 Item 3 (Picture)



3.4 Item 4 (Picture)



3.4 Item 5 (Picture)


(2)

1. The brick stairs on the front entry at the exterior needs mortar where loose or missing. Further deterioration can occur if not repaired. Repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 6 (Picture)

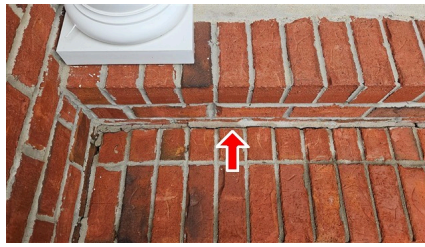

3.4 Item 7 (Picture)



3.4 Item 8 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☐ REPAIR OR REPLACE

(1)

1. The concrete drive at the front of home has settled and is directing storm water into the home. This is causing damage and water intrusion to occur to the home. Further deterioration will occur.
Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



3.5 Item 1 (Picture)



3.5 Item 2 (Picture)



3.5 Item 3 (Picture)



3.5 Item 4 (Picture)



3.5 Item 5 (Picture)



3.5 Item 6 (Picture)



3.5 Item 7 (Picture)



3.5 Item 8 (Picture)



3.5 Item 9 (Picture)

(2)

1. The concrete drive at the front of home uneven, and can be a tripping hazard. Water can cause further deterioration if not repaired and sealed properly. A fall or injury can occur if not corrected. Repairs are needed.

A qualified contractor should inspect and repair as needed.



3.5 Item 10 (Picture)



3.5 Item 11 (Picture)



3.5 Item 12 (Picture)



3.5 Item 13 (Picture)

(3)

1. The sidewalk at the rear of home uneven, and can be a tripping hazard. A fall or injury can occur if not corrected. Repairs are needed.

A qualified contractor should inspect and repair as needed.



3.5 Item 14 (Picture)



3.5 Item 15 (Picture)



3.5 Item 16 (Picture)

- (4) The tree limbs that are in contact with roof or hanging near roof should be trimmed.



3.5 Item 17 (Picture)



3.5 Item 18 (Picture)

3.6 GARAGE DOOR (S)

☑ INSPECTED

3.7 GARAGE DOOR OPERATORS (REPORT WHETHER OR NOT DOORS WILL REVERSE WHEN MET WITH RESISTANCE)

☑ INSPECTED

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)


📋 REPAIR OR REPLACE

1. The fire resistance sheathing that separates garage from heated space is compromised. This is considered unsafe until corrected. Repairs are needed.


A qualified person should correct for safety.




3.8 Item 1 (Picture)

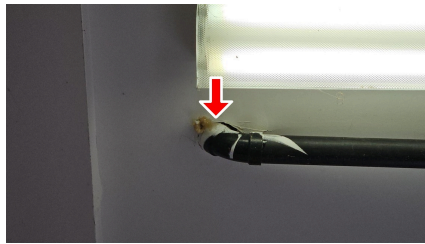

3.8 Item 2 (Picture)

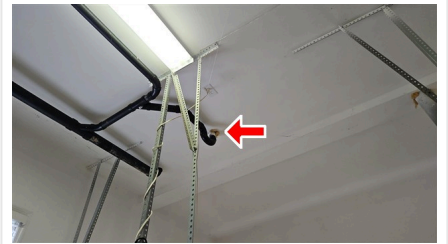

3.8 Item 3 (Picture)

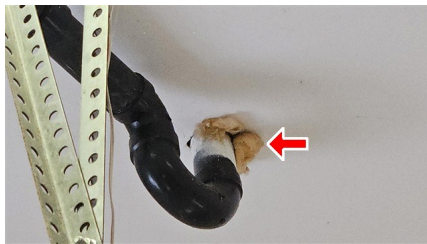

3.8 Item 4 (Picture)

3.9 OCCUPANT DOOR (FROM GARAGE TO INSIDE OF HOME)

✓ INSPECTED

3.10 GARAGE FLOOR

✓ INSPECTED

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

4. STRUCTURAL COMPONENTS

DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation:

Poured concrete

Method used to observe

Crawlspace:

No crawlspace

Floor Structure:

Slab

Wall Structure:

Wood

Masonry

Columns or Piers:

Steel lally columns

Supporting walls

Ceiling Structure:

4" or better

Roof Structure:

2 X 6 Rafters

ITEMS: STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

 INSPECTED

4.1 COLUMNS OR PIERS

 INSPECTED

4.2 FLOORS (STRUCTURAL)

 INSPECTED

4.3 CEILINGS (STRUCTURAL)

 INSPECTED

4.4 ROOF STRUCTURE AND ATTIC


 REPAIR OR REPLACE

1. The pull down stairs needs ladder trimmed at an angle to fit floor properly. Injury could result if not repaired. Repairs are needed.

A qualified contractor should inspect and repair as needed.



4.4 Item 1 (Picture)

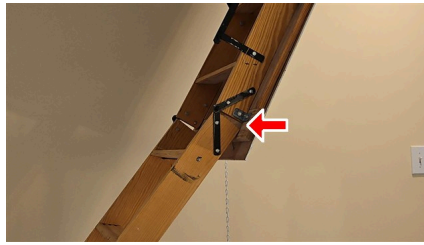

4.4 Item 2 (Picture)

4.5 WOOD DETERIORATION

✓ INSPECTED

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

📋 REPAIR OR REPLACE

1. Dark stains on the CMU (Concrete Masonry Unit) Indicated that water is inside the block. Dark stains and white efflorescence (powder substance) on block wall indicates moisture is in contact with the masonry. This does not necessarily indicate that intrusion will occur. Efflorescence is found on many homes without water intrusion occurring inside the home. But, it should alert you to the possibility that future steps may be needed. Further investigation and repairs are needed.

I recommend contact a licensed water intrusion specialist regarding these conditions.



4.6 Item 1 (Picture)



4.6 Item 2 (Picture)



4.6 Item 3 (Picture)



4.6 Item 4 (Picture)



4.6 Item 5 (Picture)



4.6 Item 6 (Picture)



4.6 Item 7 (Picture)

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



Complimentary photo of the water heater

✂️ STYLES & MATERIALS: PLUMBING SYSTEM

Water Source:

Public

Water Filters:

None

Plumbing Water Supply (into home):

Copper

Plumbing Water Distribution (inside home):

Copper

Washer Drain Size:

2" Diameter

Plumbing Waste:

ABS

Water Heater Power Source:

Gas (quick recovery)

Water Heater Capacity:

75 Gallon

Manufacturer:

RHEEM

Water Heater Location:


Basement

👁️ ITEMS: PLUMBING SYSTEM

5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

✓ INSPECTED

The main shut off is the white lever located in the basement. This is for your information.

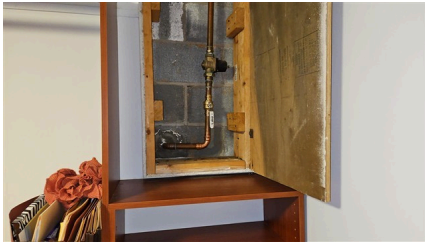

5.0 Item 1 (Picture)

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

📋 REPAIR OR REPLACE

(1)

1. The draft hood connection to flue vent connector: provide at least 12" vertical inches of the flue vent between the draft hood outlet and the first elbow. This is a safety issue and should be repaired. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 1 (Picture)

(2)

1. The T&P (Test and Pressure) valve on water heater needs a 3/4 threaded pipe to extend within 6 inches of floor for safety. (PVC is not approved for hot water use). I recommend repair by a qualified person.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 2 (Picture)


5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☐ REPAIR OR REPLACE


(1)

1. The sink faucets leaks at the upstairs bath. Repairs are needed to prevent water damage from occurring to the home. Repairs are needed.


A qualified licensed plumber should repair or correct as needed.

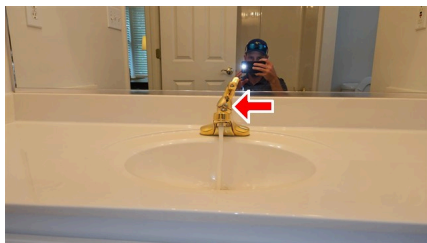

5.2 Item 1 (Picture)

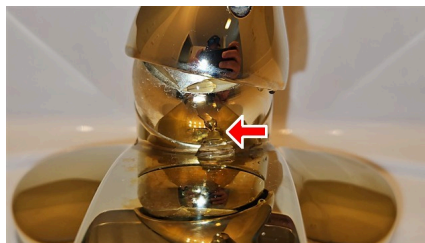

5.2 Item 2 (Picture)

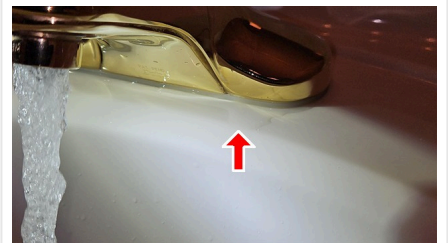

5.2 Item 3 (Picture)

(2)

1. The jacuzzi shows signs of improper cleaning and maintenance, as a result black residue is present (likely bacteria) when the tub was operated. (Health Safety Issue) Repairs are needed.

I recommend contacting a licensed plumber.



5.2 Item 4 (Picture)



5.2 Item 5 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE

(1)

1. The toilet will not stop running at the guest bath. The flapper will likely need replacing. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 1 (Picture)

(2)

1. The plumbing waste line leaks under the W/D room. Repairs are needed to prevent water damage from occurring to the home. Repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 2 (Picture)



5.3 Item 3 (Picture)


(3)

1. The plumbing waste line leaks under the master bath. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 4 (Picture)

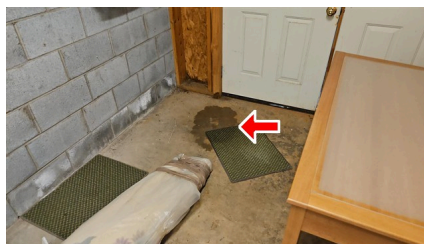

5.3 Item 5 (Picture)

(4)

1. The toilet lid seat is damage at floor at the bath. This is for your information.

I recommend a qualified licensed plumber repair or correct as needed.



5.3 Item 6 (Picture)



5.3 Item 7 (Picture)

5.4 SHOWER/TUB & TILE WALLS

✓ INSPECTED

5.5 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS,

LEAKS)

 INSPECTED

5.6 SUMP PUMP INSPECTED

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 6. ELECTRICAL SYSTEM

☰ DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.



Complimentary photo of the electric panel with the cover off

✂ STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service Conductors: Below ground Aluminum	Panel capacity: 200 AMP	Panel Type: Circuit breakers
Electric Panel Manufacturer: SQUARE D	Branch wire 15 and 20 AMP: Copper	Wiring Methods: Romex

🔍 ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

The main panel box is located at the basement.

6.1 SERVICE ENTRANCE CONDUCTORS


✓ INSPECTED

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

✗ REPAIR OR REPLACE

1. Two wires were observed to be connected to one or more circuit breakers in the main panel. While often done, this is not permitted unless the device is so labeled. Double tapping often leads to overloaded circuits and loose connections that can overheat. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.

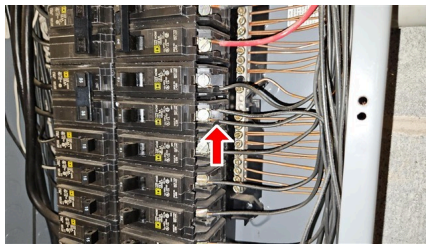

6.2 Item 1 (Picture)

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

✓ REPAIR OR REPLACE

(1)

1. The light fixture does not work (try bulb first) at the kitchen. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 1 (Picture)


(2)

1. The light fixture does not work (try bulb first) at the exterior. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed..

A qualified licensed electrical contractor should correct as needed.



6.4 Item 2 (Picture)

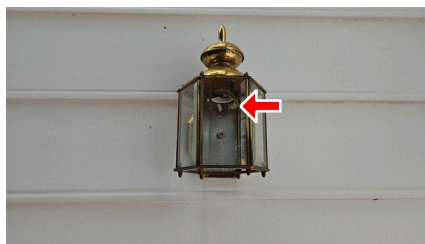

6.4 Item 3 (Picture)

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

☑ INSPECTED

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

☑ INSPECTED

6.7 SMOKE DETECTORS

📋 REPAIR OR REPLACE

1. The smoke detectors in the home have expired. Without a working smoke detector in your home you have no first alert to a possible fire. Repairs are needed.

I recommend repair or replace as needed using a qualified person.



6.7 Item 1 (Picture)

6.8 CARBON MONOXIDE DETECTORS

REPAIR OR REPLACE

1. There is no carbon monoxide detector found in home. It is recommended that one be installed according to the manufacturer's instructions.

A qualified person should repair or replace as needed.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.


🏠 7. HEATING / CENTRAL AIR CONDITIONING

📋 DESCRIPTION


The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



Complimentary photo of the AC units

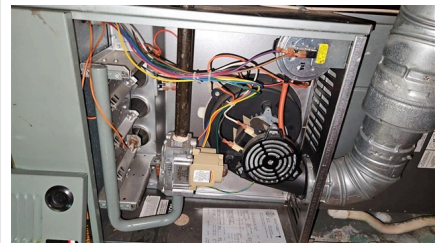

Complimentary photo of the gas furnace with the cover off

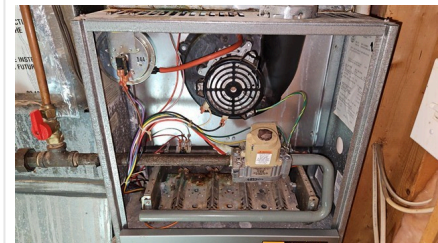

Complimentary photo of the gas furnace with the cover off

🔧 STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type:
Forced Air

Energy Source:
Natural gas

Ductwork:

Heating Age:
Original

Operated:
Summer-Did not operate due to weather conditons. (Could damage the system)

Types of Fireplaces:

Number of Heat Systems
(excluding wood):
Two

Heat System Brand:
RUUD

Operable Fireplaces:

Insulated

Vented gas logs

Two

Non-vented gas logs

Number of Woodstoves:

None

Cooling Equipment Type:

Air conditioner unit

Air Conditioning Age:

Original

Cooling Equipment Energy**Source:**

Electricity

Central Air Manufacturer:

RUDD

Number of AC Only Units:

Two

 ITEMS: HEATING / CENTRAL AIR CONDITIONING

7.0 HEATING EQUIPMENT

 INSPECTED

7.1 NORMAL OPERATING CONTROLS

 INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

 INSPECTED

7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

 INSPECTED

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

 INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

 INSPECTED

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

 NOT PRESENT

7.7 GAS/LP FIRELOGS AND FIREPLACES

 REPAIR OR REPLACE

1. The vented fire logs in the living room is not operable (burner would not ignite). Repairs should be made so unit works properly. Further investigation and repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.



7.7 Item 1 (Picture)

7.8 COOLING AND AIR HANDLER EQUIPMENT


✓ REPAIR OR REPLACE

1. The foam sleeve on suction line is missing foam sleeve in area(s) at outside unit. Missing foam on suction line can cause energy loss and condensation. I recommend service or repair as needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.



7.8 Item 1 (Picture)

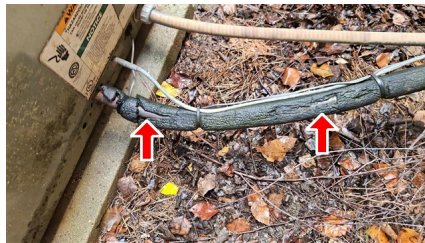

7.8 Item 2 (Picture)



7.8 Item 3 (Picture)

7.9 NORMAL OPERATING CONTROLS

✓ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

✓ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 8. INTERIORS

 DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

 STYLES & MATERIALS: INTERIORS

Ceiling Materials: Drywall	Wall Material: Drywall Wallpaper	Floor Covering(s): Area rug Carpet Hardwood T&G Linoleum Tile
Interior Doors: Hollow core Raised panel	Window Types: Thermal/Insulated Double-hung Tilt feature	

 ITEMS: INTERIORS

8.0 CEILINGS

 INSPECTED

8.1 WALLS


 INSPECTED

8.2 FLOORS


 REPAIR OR REPLACE

1. The wood covering warped or buckled in the basement. Further deterioration can occur. This can be a tripping hazard. Further investigation and repairs are needed.


A qualified contractor should inspect and repair as needed.

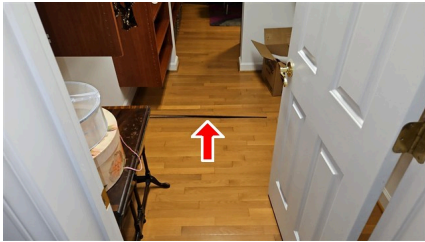


8.2 Item 1 (Picture)

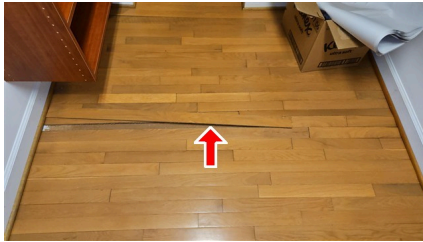

8.2 Item 2 (Picture)

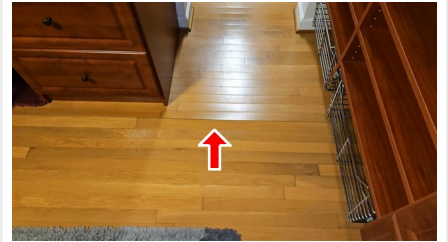

8.2 Item 3 (Picture)

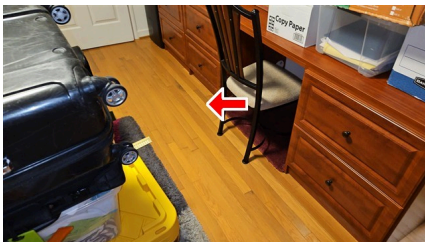

8.2 Item 4 (Picture)

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

✓ INSPECTED

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

✓ INSPECTED


8.5 DOORS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE


(1)

1. The privacy door is damaged at the guest bedroom. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

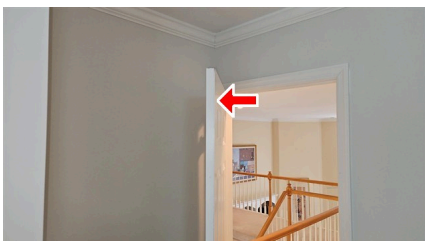

8.5 Item 1 (Picture)

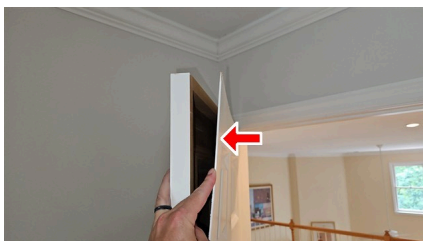


8.5 Item 2 (Picture)

(2)

1. The door at guest bedroom will not latch properly. Evidence suggest that the door needs strike and latch adjustment to shut properly. This is a small repair.

A qualified person should repair or replace as needed.

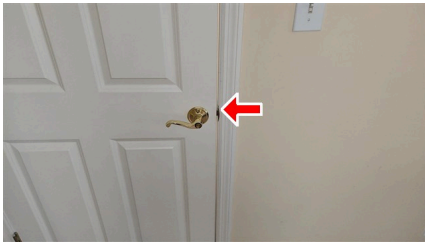


8.5 Item 3 (Picture)

(3)

1. The privacy door rubs at jamb when closing at the downstairs Guest bath. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

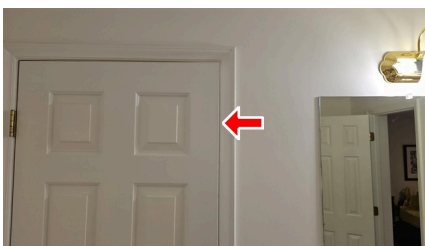


8.5 Item 4 (Picture)

(4)

1. The Privacy door rubs at jamb when closing at the downstairs. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

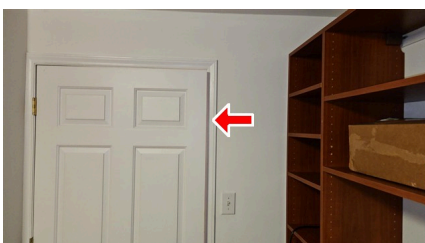


8.5 Item 5 (Picture)

(5)

1. The privacy door rubs at jamb when closing at the guest bedroom. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

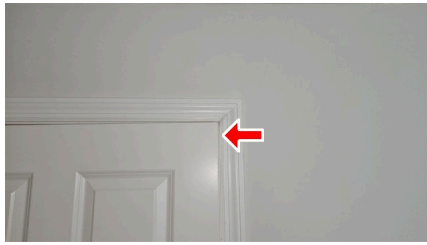

8.5 Item 6 (Picture)

8.6 WINDOWS (REPRESENTATIVE NUMBER)

✓ INSPECTED

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 9. INSULATION AND VENTILATION

 DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

 STYLES & MATERIALS: INSULATION AND VENTILATION

Attic info: Pull Down stairs	Method used to observe attic: From entry	Attic Insulation: Blown Fiberglass
Ventilation: Ridge vents Soffit Vents	Exhaust Fans: Fan only	Dryer Power Source: 220 Electric
Dryer Vent: Metal	Floor System Insulation: NONE	

 ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

 NOT PRESENT

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

 INSPECTED

9.2 INSULATION IN ATTIC

 REPAIR OR REPLACE

1. Fiberglass (loose-fill) insulation is is compressed in areas of the attic due to foot traffic or storage in attic. Heat loss can occur more on this home than one that is properly insulated. Repairs are recommended .

A qualified person should repair or replace as needed.



9.2 Item 1 (Picture)



9.2 Item 2 (Picture)



9.2 Item 3 (Picture)

9.3 INSULATION UNDER FLOOR SYSTEM

☑ NOT PRESENT

9.4 ATTIC ACCESS

☑ INSPECTED

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

☑ INSPECTED

9.6 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

☑ NOT PRESENT

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

10. BUILT-IN KITCHEN APPLIANCES

DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Corian

Cabinetry:

Wood

ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER

REPAIR OR REPLACE

1. The dishwasher drain hose needs to be looped above the level of the kitchen sink drain or an approved air gap installed to prevent back flow of waste water into the water supply. (food safety issue) This can allow waste for the sink to contaminate the dishwasher. This is a small repair.

A qualified licensed plumber should repair or correct as needed.



10.0 Item 1 (Picture)

10.1 RANGES/OVENS/COOKTOPS

INSPECTED

10.2 RANGE HOOD (S)

INSPECTED

10.3 FOOD WASTE DISPOSER

INSPECTED

10.4 MICROWAVE COOKING EQUIPMENT

✓ INSPECTED

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.