



INSPECTION REPORT
3617 Venetian Way
York SC 29745

INSPECTED BY
Matthew Adams
(704)519-6322
Matt@hicarolina.com
NC #4195 SC#1389770

A handwritten signature in black ink, appearing to read "Matthew Adams".

INSPECTION DATE
📅 10/7/2025
Home Inspection
Carolina



TABLE OF CONTENTS

Cover Page 1

Table of Contents 2

Intro Page 3

1 Deck(s)/Patio(s)/Porches 6

2 Exterior/Trim/Foundation 9

3 Grounds/Pavings 14

4 Garage-Carport 15

5 Roof Systems 17

6 Attic Interior System 21

7 Plumbing System 22

8 Laundry Area 26

9 Electrical System 27

10 HVAC System(s) Information 30

11 Cooling System(s) 33

12 Heating System 35

13 Interior Components 37

14 Bathrooms 41

15 Kitchen-Appliances 44

16 Crawlspace 47

Back Page 51

Summary 52

Complete Home Inspection Report

Exclusively for: Valorie Redwine

Including: Limitations, Recommendations, Material Types, and Additional Photos

THIS REPORT WAS INTENDED TO BE VIEWED IN COLOR.

Date:
10/7/2025

Property:
3617 Venetian Way
York SC 29745

Buyers Agent:
Will Sheppard



Inspector:
Matthew Adams
(704)519-6322
Matt@hicarolina.com
NC #4195 SC#1389770



People present at the time of inspection:

Buyer(s), Buyers Agent

Building Type:

Single Family.

Utilities Status:

All utilities on

Outside Temperature (F):

70-80 Degrees

Payment Type:

Credit Card Online

House Occupancy/Limitations:

The home was occupied at the time of inspection. When a home is occupied with furniture, clothing, and other stored items, it can obstruct the view and access to walls, receptacle outlets, under sinks, etc.

INSPECTION INFORMATION

The summary section is NOT the entire report.

Your complete report contains important information that may be of great concern to you. You are highly advised to review the entire report promptly. If you have any questions about the negotiability of any item in the report under the real estate purchase contract, please reach out to your real estate agent or an attorney for assistance.

Important - A qualified licensed contractor specializing in the fields mentioned in the report must be consulted to assess all findings or defects. Additional repairs may be necessary. Concealed defects could exist beyond initial inspection. It is highly recommended to have a thorough evaluation of the damage and necessary repairs before the home sale closes and during due diligence, or the contingency period. This report serves solely as a visual inspection. Its purpose is to offer guidance for your assessment of the home's overall condition. It does not determine the property's value or offer advice on its purchase.

THIS REPORT WAS INTENDED TO BE VIEWED IN COLOR.

v9.24.2

INSPECTION REPORT INFORMATION

Your summary section is NOT the entire report.

The complete report may include additional information of great concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney.

IMPORTANT - Due to the findings or defects stated within the report. A qualified licensed contractor who specializes in the respective fields of our findings or defects listed should be consulted to evaluate any and all findings or defects further. To determine the full extent of any damage(s) and or determine if additional repairs are required, which may be deemed necessary by the qualified licensed contractor. There may be other defects concealed and or otherwise unseen at the time of the initial inspection.

Further evaluation is recommended before the close of escrow on the home, due diligence, and or contingency period, whichever comes first, to thoroughly understand the extent of the damage(s) and the full extent of the repairs needed, required, or deemed necessary by the qualified licensed contractor.

Please understand that this is a visual inspection only. The report provided is intended only as a general guide to help you make your own evaluation of the overall condition of the home. This inspection is not intended to reflect the value of the premises nor make any representation as to the advisability of purchase.

Home Inspection Definitions

Home Inspection: A home inspection is a limited, non-invasive visual examination of the condition of a home. To visually inspect essential components of a residential dwelling designed to identify MATERIAL DEFECTS.

Direction: Our State requirements require us to direct our clients to consult with qualified licensed contractors for further evaluation of all defects identified within our report. It is essential that you thoroughly understand the extent of any problem before the close of escrow on the home.

Ancillary Services: Ancillary services, such as Mold Sampling, Radon Tests, etc., are not part of this home inspection and do not fall under state Standard of Practice guidelines. For your convenience, other services may be listed within this report; however, they are to be viewed as independent services and individually. For more information on additional ancillary services we provide, please get in touch with our office or visit our website at <https://www.homeinspectioncarolina.com/services/>

Material Defects: A material defect is a specific issue with a system or component of a residential property that may have a significant, adverse impact on the property's value or pose an unreasonable risk to people.

The following report reflects the visual conditions of the property at the time of the inspection only. The summary and main report are a list of items found to be defective, needing repair, or further evaluation. Please understand there may be hidden or concealed damage that could not be viewed, seen, or present at the time of inspection. For your protection, we strongly recommend consulting with a qualified licensed contractor to evaluate further all defects noted within this report. Hidden or concealed defects are not inspected and are not included in this report. No warranty is either expressed or implied in the home inspection report. This report is not an insurance policy nor a warranty service.

The point of reference for this report is from the street looking at the front of the house. (The front, right crawl space would be the front, right corner of the home, not the front right corner from the crawl space access door unless otherwise stated).

This inspection has been completed according to the standards of practice and code of ethics within the states of North or South Carolina. Please for a copy of the NC SOP, please [Click Here](#). For SC, [Click Here](#).

1. DECK(S)/PATIO(S)/PORCHES

DESCRIPTION

DECK INFORMATION

Decks and porches are often built close to the ground, where no viewing or access is possible. Any areas too low to enter or not accessible are excluded from the inspection. There is no inspection and/or evaluation or moving of landscape components such as but not limited to trees, shrubs, fountains, ponds, statuary, pottery, fire pits, patio fans, heat lamps, and decorative or low-voltage lighting.

TYPES & DESCRIPTIONS: DECK(S)/PATIO(S)/PORCHES

Deck Materials:

Wood Columns

Wood Framing

Wood Decking

Patio Type:


Concrete

ITEMS: DECK(S)/PATIO(S)/PORCHES

1.0 DECK/PATIO/PORCH VISUAL FINDINGS

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) The handrails at the steps of the rear porch were noted to be too wide at the time of inspection this should be repaired and or corrected for safety and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

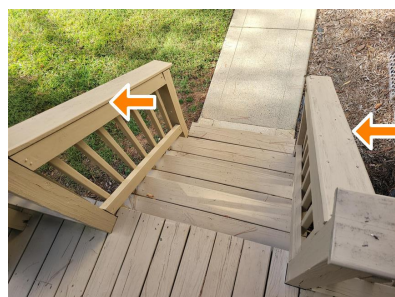



(2) The deck boards at the rear porch where noted to be fastened with nails at the time of inspection this should be corrected for safety and to ensure proper installation and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.





(3) **The railings were noted to be depending on the spindles as no posts were found or noted to be installed.** Post are needed at the base of the stairs/steps and approximately every six feet on center to properly support and secure the railing around the decking and stairs. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(4) Wood rot and or damage was noted to the deck boards at the rear porch at the time of inspection this should be corrected to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

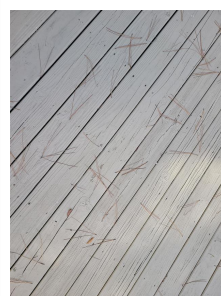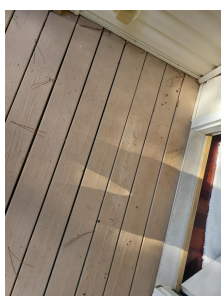

(5) **The stairs at front porch were found to be above 30", typically consisting of 3 or more steps.** Stairs, patios, and decks above 30" require a handrail to be installed to ensure safety. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

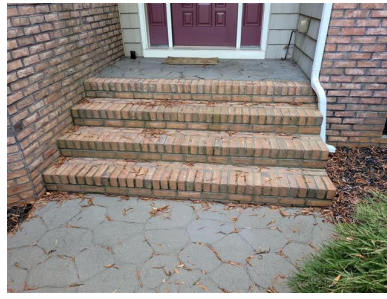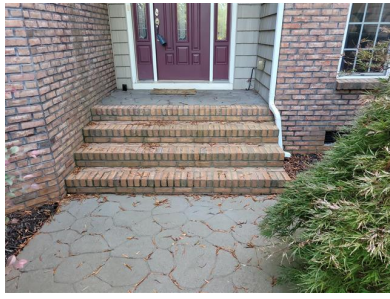

2. EXTERIOR/TRIM/FOUNDATION

DESCRIPTION

EXTERIOR INFORMATION

In accordance with our standards of practice, we identify foundation types and look for any evidence of structural deficiencies. However, minor cracks or deteriorated surfaces are common in many foundations and most do not represent a structural problem. If major cracks are present along with bowing, we routinely recommend further evaluation be made by a qualified licensed engineer that specializes in residential dwellings. The inspection will certainly alert you to any suspicious cracks if they are clearly visible. We are not specialists, and in the absence of any major defects, we may not recommend that you consult with a foundation contractor, an engineer that specializes in residential dwellings, or a geologist, but this should not deter you from seeking the opinion of any such expert. It is also routinely recommended that inquiry is made with the seller about knowledge of any prior foundation or structural repairs.

All items that are freshly painted including, but not limited to, trim, exterior siding, fascia, and soffit cannot be fully or completely viewed to determine if wood rot exists. Have the seller disclose any recent repairs or painting to determine if any damage has been hidden or concealed before the close of escrow on the home.

TYPES & DESCRIPTIONS: EXTERIOR/TRIM/FOUNDATION

Siding Types:

Vinyl Siding

Brick Veneer

Stories/Foundation:

2 Stories on a Crawlspace


Foundation

ITEMS: EXTERIOR/TRIM/FOUNDATION

2.0 EXTERIOR VISUAL FINDINGS

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) Trim was noted to be missing and or not installed correctly under the threshold of both rear doors at the time of inspection this should be repaired and or corrected to ensure proper installation and to prevent water intrusion and to prevent any further damage hidden and will concealed damage may exist. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

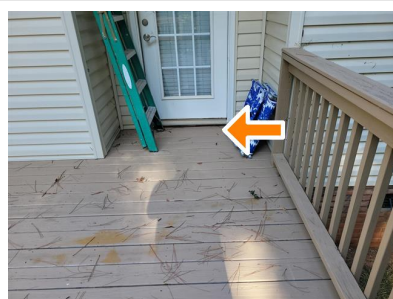



(2) The weather strip at the rear door Was noted to be torn and or damaged at the time of inspection this should be repaired and or replaced to ensure proper function and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




(3) Rust and or damage was noted to the rear door door trim and or threshold at the time of inspection this should be repaired and or corrected to ensure proper installation and function and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(4) No weep holes were detected in the brick siding surrounding the house. Weep holes, which are drilled openings or slots, are typically situated around the foundation and positioned above or below windows in brick veneer structures. These openings serve the purpose of facilitating the drainage of accumulated moisture within or behind building elements, as well as providing an outlet for water that could potentially gather in window sills and veneers. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




(5) Sealant is important for safeguarding against water damage and potential rodent intrusion at entry points where phone, cable, or electrical lines enter the home. This protective measure helps maintain the integrity of the home's infrastructure and prevents costly repairs in the long run. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

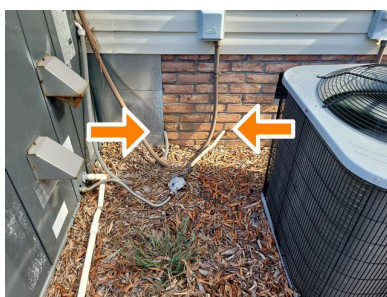

(6) Holes were noted to the siding at the rear right corner of the home at the time of inspection this should be repaired and or corrected to prevent water and or pest intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(7) Holes were noted to the siding at the left side of the home at the time of inspection this should be repaired and or corrected to prevent moisture and or pest intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

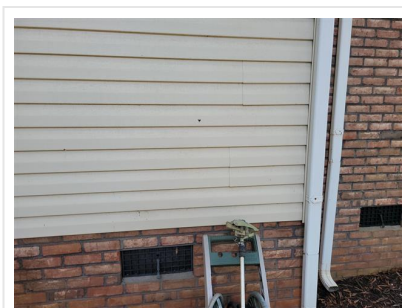

2.1 TRIM VISUAL FINDINGS

☐ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

Wood rot and or damage was noted to the trim at the front door area of the home at the time of inspection this should be repaired and or corrected to ensure proper installation and to prevent any further damage. Hidden and or concealed damage may exist. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



2.2 FOUNDATION VISUAL FINDINGS

☐ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) A crack was noted to the brick foundation at the back left portion of the home at the time of inspection this should be repaired and or corrected to prevent any further damage hidden and concealed damage may exist. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(2) A crack was noted to the brick Foundation at the left side of the home at the time of inspection this should be repaired and or corrected to prevent any further damage hidden and will concealed damage may exist. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



3. GROUNDS/PAVINGS

DESCRIPTION

GROUND INFORMATION


This inspection is not intended to address or include any geological conditions or site stability information. There are no comments or reporting on coatings or cosmetic deficiencies and the wear and tear associated with the passage of time, which would be apparent to the average person. However, cracks in hard surfaces can imply the presence of expansive soils that can result in continuous movement, but this can only be confirmed by a geological evaluation of the soil. Any reference to grade is limited to only areas around the exterior of the exposed portions around the foundation or exterior walls. The inspection and/or evaluation are not made on any mechanical or remotely controlled components such as driveway gates.

ITEMS: GROUNDS/PAVINGS

3.0 GROUND AREA VISUAL FINDINGS:

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

There are cracks noted at the sidewalk that need to be sealed and/or repaired properly to prevent water penetration and/or continual cracking. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

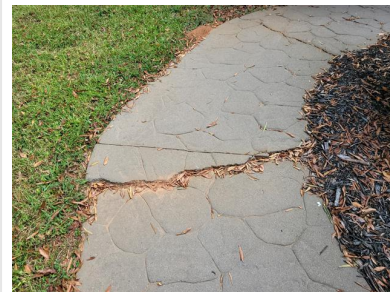

4. GARAGE-CARPORT

DESCRIPTION

GARAGE INFORMATION

Determining the heat resistance rating of firewalls is beyond the scope of this inspection. Flammable materials should not be stored within closed garage areas. It is not uncommon for moisture to penetrate garages, particularly with slabs-on-grade construction, and this may be apparent in the form of efflorescence or salt crystal formations on the concrete. This inspection does not include the inspection of detached garages, however, if a detached garage was inspected without additional costs it was inspected as a courtesy and should not be considered a part of the home inspection as it is not attached to the main structural inspection of the home.

TYPES & DESCRIPTIONS: GARAGE-CARPORT

Reverse Tension Tested:

Yes -The reverse tension was evaluated by testing the response to downward force.

Garage Sensors (photoelectric safety devices):


Tested and present at the time of inspection

ITEMS: GARAGE-CARPORT


4.0 GARAGE VISUAL FINDINGS

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED





(1) The door knob at the garage entry door with nutted to be damaged at the time of inspection this should be repaired and or replaced for safety and to ensure proper installation and function and to prevent any further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

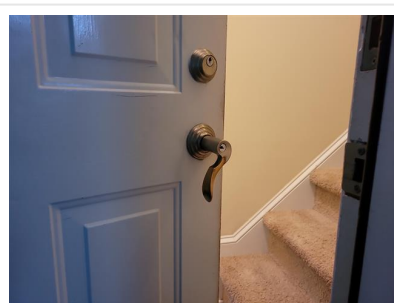

(2) The handrail was noted to be too wide at the railing at the steps in the garage at the time of inspection this should be repaired and or corrected for safety to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

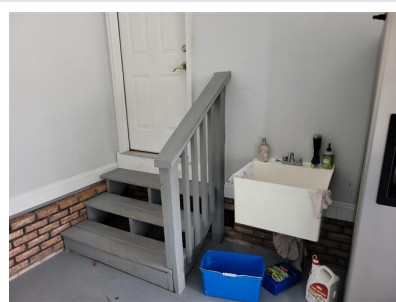

(3) Multiple crawl space vents were noted in the garage at the time of inspection this should be sealed and or corrected to prevent carbon monoxide exchange and to ensure proper construction and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

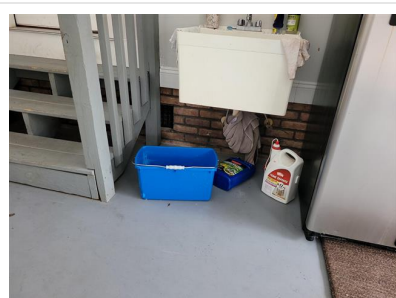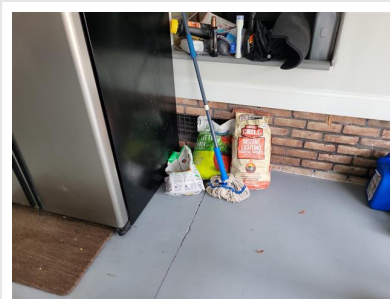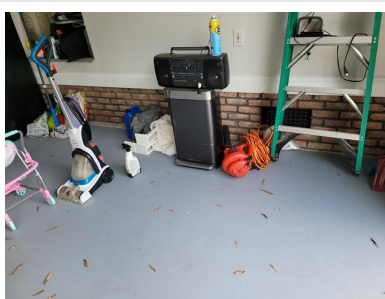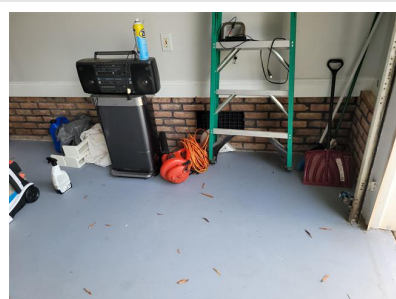

4.1 RECOMMENDATIONS/INFORMATION

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

5. ROOF SYSTEMS

DESCRIPTION

ROOF INFORMATION

Although not required, we generally attempt to evaluate various roof types by walking on their surfaces. If we are unable or unwilling to do this for any reason, we will indicate the method used to evaluate them. Every roof will wear differently relative to its age, the number of layers, quality of material, the method of application, exposure to weather conditions, and the regularity of its maintenance. The inspection provided is visual only and the opinion of the general quality and condition of the roofing material can be subjective. Any and all additional concerns should be addressed by a qualified licensed roofing contractor.

Every roof is inspected conscientiously; the remaining life expectancy, or guarantee that it will not leak, cannot and will not be provided by the inspector. It is recommended that you ask the sellers to disclose any information pertaining to repairs, leaks, and/or any additional information. Attached accessories including, but not limited to, solar systems, antennae, and lightning arrestors are not inspected. It is at the discretion of the inspector to climb and/or walk on the roof as it is not a requirement to do so.

TYPES & DESCRIPTIONS: ROOF SYSTEMS

Roof Covering Materials:

Asphalt Shingles
Metal

Roof Access:

Drone

ITEMS: ROOF SYSTEMS


5.0 ROOF VISUAL FINDING(S)

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) **The debris on the roof needs to be corrected to prevent the collection of debris, weathering, or damage at the rear of the home.** Corrections are needed to prolong life of the roof shingle and/or prevent leaks. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




(2) **The siding is touching the roof shingles along the roof line where the siding and roof meet.** The siding needs to be trimmed back properly to prevent water damage to the siding and/or water from penetrating into the home. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

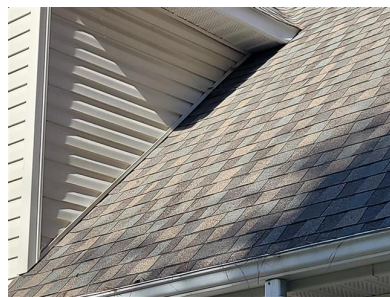

5.1 GUTTER VISUAL FINDING(S)

☐ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) **A splash block is needed to properly direct water away from the foundation of the home at the front and rear corner of the home.** Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

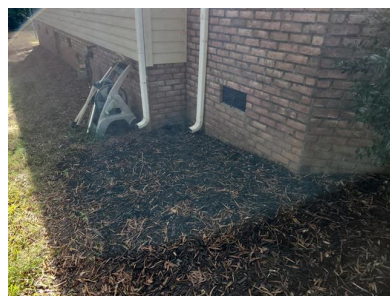

(2) The downspout was noted to be missing at the rear left corner of the home at the time of inspection this it could be corrected to ensure proper installation and to ensure proper water disbursements and to prevent any further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




5.2 FLASHING VISUAL FINDING(S)

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED



5.3 FASCIA/SOFFITS/EAVE VISUAL FINDING(S)

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED


(1) A hole was noted in the soffit at the back of the house at the time of inspection this should be corrected to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

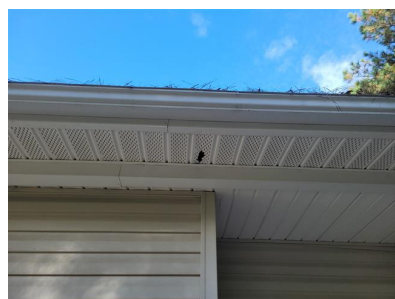

(2) A gap was noted in the soffit at the front of the home in multiple locations at the time of inspection this should be corrected to ensure proper installation and to prevent water and or pest intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

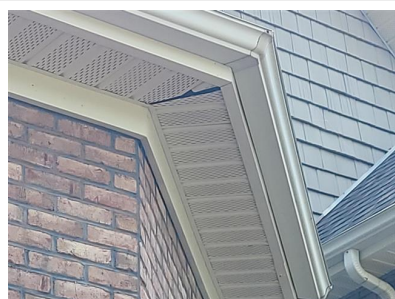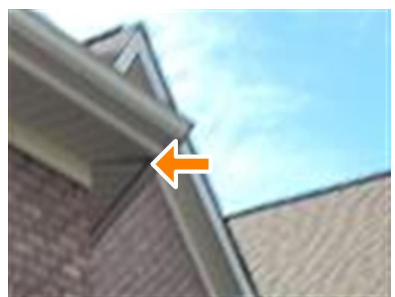

(3) The soffit was noted to be loose and or damaged at the front of the home at the time of inspection this should be corrected to ensure proper installation and to prevent water intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

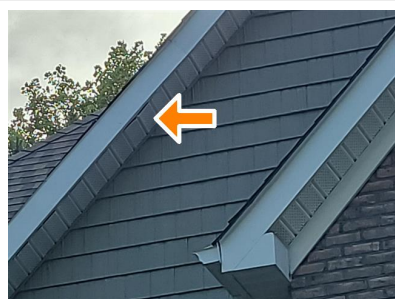

5.4 RECOMMENDATIONS/INFORMATION

The roof was installed with architectural shingles in a weaving method at the valleys. Some manufactures may approve this method. However, during the inspection, it is unable to determine the manufacture or the manufactures installation requirements. Because of this, you may want to consult with a roofing contractor to ensure proper installation.



6. ATTIC INTERIOR SYSTEM

DESCRIPTION

ATTIC INFORMATION

In accordance with our standards, attics that have less than thirty-six inches of headroom are not inspected, area restricted by ducts are not inspected, or in which the insulation obscures the joists and thereby makes mobility hazardous are not inspected, in which case the attic is inspected to the best of the inspectors ability from the access point. In regard to evaluating the type of insulation in the attic and on the attic floor, we do not sample or test the material for specific identification. Also, insulation is not disturbed or moved which may well obscure water pipes, electrical conduits, junction boxes, exhaust fans, and/or other components.

Due to pitch and/or height of the outer edges and corners cannot be viewed within the attic areas, These areas could not be fully viewed or inspected at the time of inspection and no claims could be made to the conditions and/or structure of these areas. The insulation in the attic obstructs viewing of the ceiling below while covering the framing and any electrical components throughout the attic area. Due to the insulation NOT being moved as this would disrupt the insulation from its original state, the conditions of the framing, ceiling below, electrical components, and any other areas or items that are covered or blocked by the insulation could not be viewed and no claims could be made as to the structure or conditions of the covered areas.

TYPES & DESCRIPTIONS: ATTIC INTERIOR SYSTEM

Framing and Component

Types:
A rafter system is installed in the attic cavity to support the roof decking

Unfinished Area Insulation

Type(s):
Blown Fiberglass
Fiberglass Batts or Rolled Batts

Attic Location(s):

Main Attic above the majority or entire home.

ITEMS: ATTIC INTERIOR SYSTEM

6.0 ATTIC VISUAL FINDINGS

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

Walk boards were noted to be missing at the attic access in the upstairs portion of the home at the time of inspection this should be corrected for safety and to prevent further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



 7. PLUMBING SYSTEM

 DESCRIPTION

PLUMBING INFORMATION

Water quality or hazardous materials testing is available however is not included with this inspection unless added as an additional service. Underground piping related to water supply, waste, sprinkler, as well as drainage systems is excluded from this inspection. The presence of mineral build-up that may gradually restrict their inner diameter and reduce water volume cannot be inspected.

The water main shut off valve, and shut off valves under sinks and behind toilets is not tested. By turning the valves it may cause them to leak causing damage to the property. Because of this, shut off valves are not turned, tested, or operated.

The inspection does not assure that the plumbing systems of the home will meet the demands of a family when in use.

 TYPES & DESCRIPTIONS: PLUMBING SYSTEM

Visible Plumbing Materials: PEX PVC Plastic Steel Braided Unable to determine DuraPex	Plumbing Vent Pipe Material Type(s): PVC	Water Heater Power Source: Electric
Water Heater Capacity: 48 Gallons	Water Temperature: 115 Degrees	Water Heater Location: Garage
Main Water Shut Off Location: Well		

 ITEMS: PLUMBING SYSTEM

7.0 PLUMBING CONDITIONS/VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) The visible plumbing lines in this home are plastic PEX with brass metal fittings. **Evidence of fitting deterioration was noted during the inspection in a few/several locations.** The deterioration could be the result of a known problem referred to as "dezincification". Dezincification occurs when brass fittings that are considered a high-zinc copper alloy are exposed to water and the zinc is leached from the fitting or component leaving the fitting in a weakened state. This process also leads to a buildup inside the fitting, restricting water flow and ultimately leaving the plumbing system prone to breakage and leaking. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(2) A leak was noted at least faucet at the sink in the garage at the time of inspection, This should be repaired and or replaced to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(3) There is CSST (corrugated stainless steel tubing) noted within the crawl space that was found to have the stainless steel areas exposed near the fittings. The exposed stainless steel needs to be sealed or covered with the proper and/or approved tape to prevent corrosion and/or rusting. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.





(4) The filter was noted to be unsupported and laying on the ground in the crawlspace at the time of inspection should be corrected to ensure proper installation and function and damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



7.1 WATER HEATER CONDITIONS/VISUAL FINDINGS

☐ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

The water heater appears to be above ten years of age. The lifespan of a typical water heater is noted to be 10-15 years for an electric water heater and 15-18 years for a gas water heater. The lifespan can depend on several things: the condition of the water; if the water heater is maintained properly; the location of the water heater (crawl space, interior closet, garage, etc.); and several other factors. Due to additional factors, it is impossible to determine the lifespan of the water heater(s) currently installed and/or the additional years left for the water heater. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

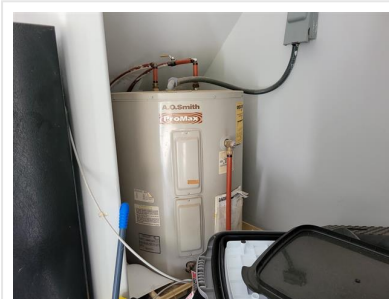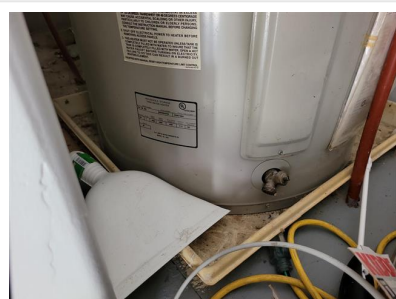

7.2 WATER TEMPERATURE INFORMATION

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED


The water temperature was found to range between 110 and 119 degrees. To ensure optimal performance, adjust the temperature to 120 degrees. [Click here](#) to discover how to set your water heater to a safe and efficient temperature level.

7.3 PLUMBING RECOMMENDATIONS/INFORMATION

☐ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) Dura-Pex/NIBCO PEX tubing is prone to oxidization, which is when oxygen negatively affects the quality of a material, like metal or plastic. This can happen if the material isn't treated properly or has a flawed design. Oxidization of PEX tubing can lead to the development of cracks and ruptures, resulting in water leaks. These leaks can also cause damage to NIBCO's fittings and clamps. No leaks were observed during the inspection. It is

advisable to continue monitoring for leaks. If leaks were found, consult with a licensed plumbing contractor to thoroughly evaluate and repair any issues that may arise.

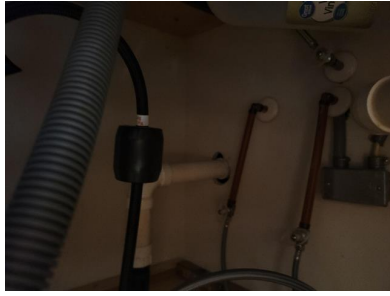

(2) Dura-Pex/NIBCO PEX tubing is prone to oxidization, which is when oxygen negatively affects the quality of a material, like metal or plastic. This can happen if the material isn't treated properly or has a flawed design. Oxidization of PEX tubing can lead to the development of cracks and ruptures, resulting in water leaks. These leaks can also cause damage to NIBCO's fittings and clamps. No leaks were observed during the inspection. It is advisable to continue monitoring for leaks. If leaks were found, consult with a licensed plumbing contractor to thoroughly evaluate and repair any issues that may arise.



8. LAUNDRY AREA

DESCRIPTION

LAUNDRY INFORMATION

Washer and dryers are not tested at the time of inspection as this is beyond the scope of a home inspection. The 220v electric dryer hookup, if so equipped is not tested during a normal home inspection. If washer and dryers are installed in the laundry room viewing of the wall and/or inspect the washer and dryer hookups cannot be completed due to the washer and dryer blocking the wall and hookups. No claims can be made regarding the condition of the wall and hookups.


ITEMS: LAUNDRY AREA

8.0 LAUNDRY AREA VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

8.1 LAUNDRY AREA LIMITATIONS

Unable to view the walls, flooring, and piping at the time of inspection due to the washing machine and/or dryer being installed obstructing viewing of these areas. No claims can be made to the condition of these areas at the time of inspection.

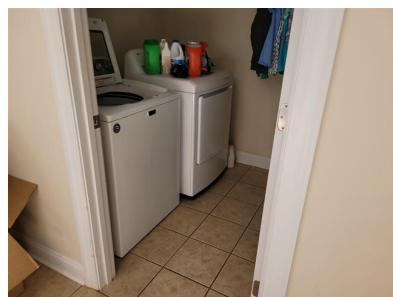

🏠 9. ELECTRICAL SYSTEM

📋 DESCRIPTION

ELECTRICAL INFORMATION

Load-calculations are not performed to determine if the supply meets the demand. Any electrical repairs or upgrades should be made by a licensed electrical contractor. Aluminum wiring requires periodic inspection and maintenance by a licensed electrical contractor. Smoke Alarms should be installed within 15 feet of all bedroom doors and tested regularly.

✂️ TYPES & DESCRIPTIONS: ELECTRICAL SYSTEM

Panel Location(s): The exterior of the home	Panel Cover: Removed and interior inspected	Main Power Panel Size: 200 amp service
Service Entry Conductor Type: Aluminum	Service Voltage: The incoming electrical service to the structure is 120/240 volts, with circuit breakers.	Branching Circuit Wiring Type: Branching Copper Wiring with Aluminum on (220) appliances.
Service Type: Underground		

👁️ ITEMS: ELECTRICAL SYSTEM

9.0 ELECTRICAL VISUAL FINDINGS

📋 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) A electrical outlet was noted to be installed behind the stove in the kitchen at the time of inspection this should be corrected for safety and to ensure proper installation and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.





(2) The inside breaker cover was noted to be damaged at the Exterior electric panel at the time of inspection this should be corrected for safety and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.






(3) The ceiling fan in the living room was there to be noisy at the time of inspection this should be repaired and or corrected to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(4) **Missing or damaged cover plates noted within the home.** Repair and/or replace as needed. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(5) Electric panel inspected.

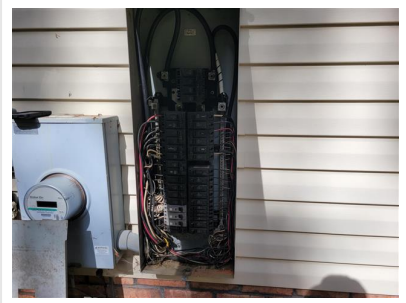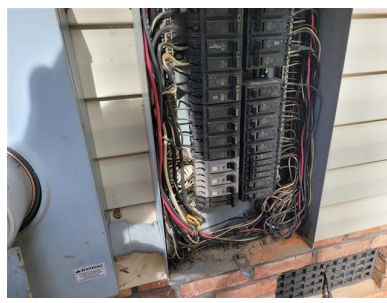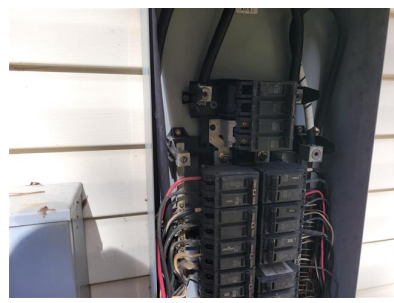

🏠 10. HVAC SYSTEM(S) INFORMATION

📋 DESCRIPTION

HVAC System(s) Information and Limitations

The interior AC coil(s) are not inspected as they could not be viewed at the time of inspection due to being taped sealed/closed. The fan units operated when testing (if temperature permits), but the interior was not visually observed. No claims could be made to the condition of the interior of the unit as this would require a complete invasive inspection of the unit, which is beyond the scope of a home inspection.

During this inspection, it is impossible to determine the condition of the interior of the flue/vents. The interior of the flue/vents may be deteriorated, but during a visual inspection, the interior walls were not inspected as this would require disassembly.

The interior heat unit portion of the heating system(s) is difficult to view or access without disassembly, and cannot be adequately checked during a visual inspection as disassembly is required. It is recommended that the unit is serviced yearly to ensure the unit operates and functions efficiently.

The home inspector does not determine the age of the HVAC unit. If the unit(s) are older than 10 years or if the age or the age is unknown, it is highly recommended that the unit(s) have a complete invasive inspection of the entire unit by a licensed HVAC contractor. Ask the seller for disclosure on any previously required services and/or repairs that have been previously made to the unit and routine servicing. If the home is vacant or in foreclosure, a complete invasive inspection of the entire unit by a licensed HVAC contractor is strongly recommended before the closing of escrow on the home.

✂ TYPES & DESCRIPTIONS: HVAC SYSTEM(S) INFORMATION

Air Conditioning Type(s): Central Split System(s) Packaged System(s)	Power Source: Electric 220 Volt	Heating Type(s): Heat Pump Unit(s) Gas Pack Unit- A gas pack combines the convenient cooling of an air conditioner with energy-efficient gas heat of a furnace, all in one space saving unit. Typically these units are installed at the exterior of the home.
Fuel/Power Source(s): Natural Gas Electric	Ducts/Air Supply Types: Fiberglass Duct Board: Flexible round duct work	Access Panel(s) Removed during visual inspection?: No

👁 ITEMS: HVAC SYSTEM(S) INFORMATION


10.0 AIR TEMP DROP DIFFERENTIAL

- ✔ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED
- (1) **primary unit differential** - The primary unit is producing an adequate air temperature drop. The temperature differentials when tested should be between 14 and 24 degrees. The differentials at the time of inspection were at 13 degrees.
- Primary Unit** :

3617 Venetian Way

Main Return Air Temperature- 70 degrees.

Main Supply Air Temperature- 57 degrees.

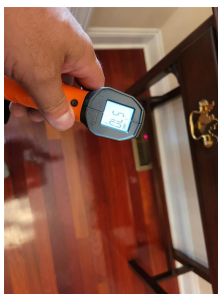

(2) **second floor unit differential** - The second floor unit is producing an adequate air temperature drop. The temperature differentials when tested should be between 14 and 24 degrees. The differentials at the time of inspection were at 13 degrees.

Second Floor Unit:

Main Return Air Temperature- 67 degrees.

Main Supply Air Temperature- 54 degrees.



10.1 HEATPUMP TEMPERATURE DIFFERENCE

☑ COMPONENT/ITEM WAS NOT INSPECTED DUE TO LIMITATION

10.2 GAS HEAT

☑ COMPONENT/ITEM WAS NOT INSPECTED DUE TO LIMITATION

Please note the home has a gas appliance due to the home having a gas appliance that is recommended having a gas leak detector installed before moving into the home or shortly thereafter. Gaslight detectors can detect potential gas leaks, ensuring safety for you and your family.

During this inspection, it is impossible to determine the condition of the interior of the ductwork or vent systems. The interior of the ductwork or vent systems may be deteriorated, but during a visual inspection, the interior walls were not inspected as this would require disassembly. Please also Note: During the home inspection the home is not inspected for mold, mildew, or other organic growth. We are not mold inspectors and are not certified in identifying types of mold within the home.

Some types of organic growth are common and/or natural to see within the home, however, dirty ductwork and high moisture levels around the duct work this may indicate, but does not guarantee, an organic growth problem. Many factors are needed to have excessive growth within or under a home and/or within duct systems. If mold, mildew, or other organic growth is a concern have a licensed or certified fungus specialist further evaluate to determine if the type of fungus within the ductwork is dangerous and determine if removal is needed.

11. COOLING SYSTEM(S)

DESCRIPTION

HVAC INFORMATION

Even modern heating systems can produce carbon monoxide, which in a poorly ventilated room can result in sickness and even death. Therefore, it is essential that any recommendations made for service or further evaluation be scheduled before the close of escrow, as a licensed specialist may reveal additional defects or recommend further upgrades that could affect your evaluation of the property, as our service does not include any form or warranty or guarantee.



On January 1, 2010, the Environmental Protection Agency (EPA) implemented a ban on the production and import of R22, except for continuing servicing needs of existing equipment. On January 1, 2020, R22 becomes illegal to purchase. As a result, repairing older R22 systems will become very expensive when the repair requires adding refrigerant to the system. If repair is needed, you may want to consider a replacement if the current AC unit was built before 2010. For more information please [click here](#).

ITEMS: COOLING SYSTEM(S)



11.0 AIR CONDITIONER VISUAL FINDINGS

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) The air conditioner at the right side of the home was noted to be sitting directly on the ground at the time of inspection this should be corrected to ensure proper installation and to prevent any further damage. Consult a qualified licensed contractor to assess the areas of concern and perform any additional repairs deemed necessary during their evaluation.

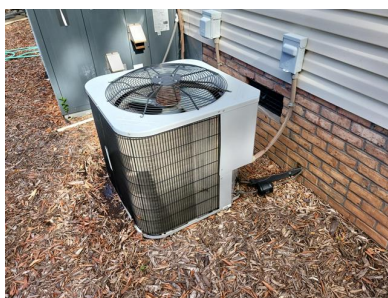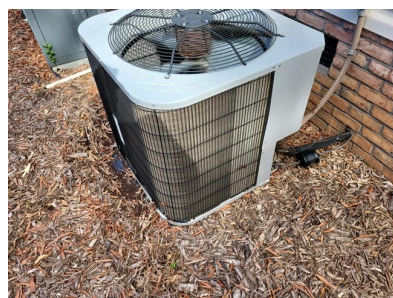

(2) The insulation is damaged, deteriorated, or torn and must be replaced at the Freon line to prevent potential harm or damage at the second floor unit. Insulation helps maintain the coolant's temperature, preventing it from heating up due to external conditions, which could lead to it converting to liquid and potentially damaging the unit. Consult a qualified licensed contractor to assess the areas of concern and perform any additional repairs deemed necessary during their evaluation.

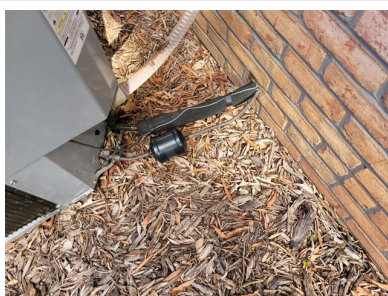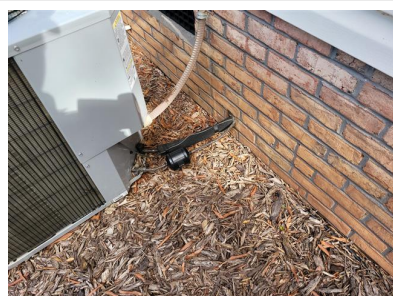

(3) The primary unit and second floor unit is failing to achieve a sufficient air temperature drop, which could suggest a range of issues, including but not limited to low Freon levels, a dirty air filter, or clogged coils. When tested, the temperature differentials should ideally fall between 14 and 24 degrees; however, the current differentials measured only 13 degrees.

11.1 DUCT VISUAL FINDINGS

📁 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

Water damage was noted to the ducts in the crawlspace in multiple locations at the time of inspection this should be repaired or corrected to ensure proper function and to prevent the damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



12. HEATING SYSTEM

DESCRIPTION

HVAC INFORMATION

Even modern heating systems can produce carbon monoxide, which in a poorly ventilated room can result in sickness and even death. Therefore, it is essential that any recommendations made for service or further evaluation be scheduled before the close of escrow, as a licensed specialist may reveal additional defects or recommend further upgrades that could affect your evaluation of the property, as our service does not include any form or warranty or guarantee.


On January 1, 2010, the Environmental Protection Agency (EPA) implemented a ban on the production and import of R22, except for continuing servicing needs of existing equipment. On January 1, 2020, R22 becomes illegal to purchase. As a result, repairing older R22 systems will become very expensive when the repair requires adding refrigerant to the system. If repair is needed, you may want to consider a replacement if the current AC unit was built before 2010. For more information please [click here](#).

ITEMS: HEATING SYSTEM


12.0 HEATING COMPONENT VISUAL FINDINGS

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) The **drip leg was missing** and is needed at the gas line where it enters the heating unit. This is needed to create a collection point for moisture and foreign particles (i.e copper sulfide) that may be in the gas line **at the primary unit**. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

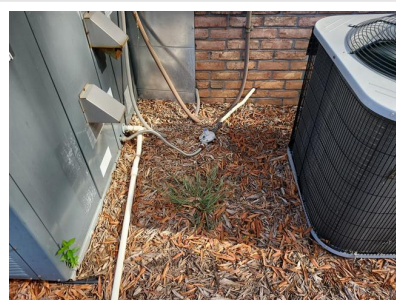

(2) The package unit at the right side of the home was noted to be improperly sealed to the foundation at the time of inspection this should be repaired and or corrected to ensure proper installation and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

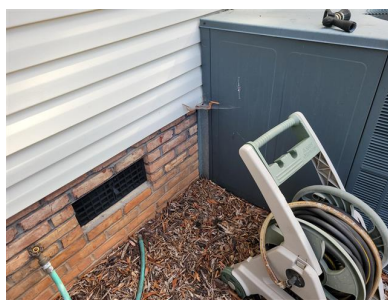

(3) The gas line was noted to be laying on the ground at the package unit at the time of inspection this is an improper installation and Corrections should be made to ensure proper installation and to prevent further

damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

(4) A shroud was noted to be missing where the package unit fastens to the home at the right side of the house at the time of inspection this should be corrected to ensure proper installation and to prevent water and or pest intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(5) The package unit was noted To be sitting directly on the ground at the right side of the home at the time of inspection this should be repaired and or corrected to ensure proper installation and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(6) The **secondary or emergency condensate line is capped** and needs correction in the event that the main drain line were to become clogged. The secondary line is designed to allow water to drain down into the overflow pan below turning off the unit or draining the water from the pan to the exterior of the home notifying the homeowner that a problem exists. Without a secondary line installed and/or being blocked from allowing the water to drain into the pan, the water that is trapped in the evaporator coil would eventually leak into the burner chamber potentially creating additional problems at the second floor unit. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



 13. INTERIOR COMPONENTS

 DESCRIPTION

INTERIOR INFORMATION

The inspection of living space includes the visually accessible areas of walls, floors, cabinets and closets, and the testing of a representative number of windows and doors, switches and outlets. We do not evaluate window treatments, move furnishings or possessions, lift carpets or rugs, empty closets or cabinets, nor comment on cosmetic deficiencies. We may not comment on cracks that appear around windows and doors, along lines of framing members or along seams of drywall and plasterboard, as these may be caused by minor movement, such as wood shrinkage, common settling, and seismic activity, and will often reappear if they are not correctly repaired. Such cracks can become the subject of disputes, and are therefore best evaluated by a specialist.

It is recommended that smoke/carbon monoxide detector(s) be replaced after moving in the home and every five years; homes that do not have carbon monoxide detectors already installed should have one installed on every floor for safety.

All items that are freshly painted including, but not limited to walls and ceilings cannot be fully or completely viewed to determine if water damage exists. Have the seller disclose any recent repairs or painting to determine if any damage has been hidden or concealed before the close of escrow on the home.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

 TYPES & DESCRIPTIONS: INTERIOR COMPONENTS


Smoke Detectors: Wired & Tested, Responded - Designed to respond all at once.	Carbon Monoxide Detector(s): Wired & Tested, Responded - Designed to respond all at once.	Combination Smoke/Carbon Monoxide Detector(s): Wired
Fireplace Location(s): Living Room	Fireplace Type(s): Prefabricated Insert with Vented Natural Gas Logs.	Wall Structure Type(s): Not Accessible
Ceiling Structure Type(s): Not Accessible	Flooring Structure Type(s): Not Accessible	

 ITEMS: INTERIOR COMPONENTS


13.0 INTERIOR COMPONENT CONDITIONS/VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) Railing returns where noted to be missing at the handrails at the interior stairs at the time of inspection this should be corrected for safety and to ensure proper installation and to prevent further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

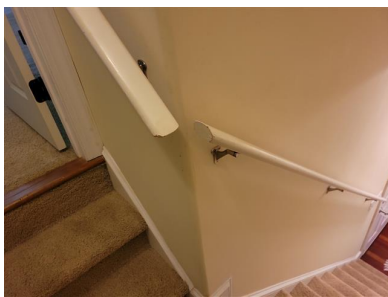

(2) **There are door stops missing/damaged behind doors in areas throughout the home;** replacement needed to prevent possible damage to the walls behind the doors. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

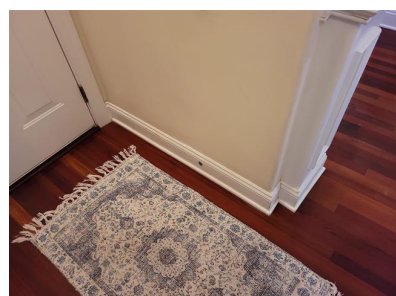

13.1 FIREPLACE/FIREBOX/GAS LOG CONDITIONS/VISUAL FINDINGS

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

13.2 WINDOW VISUAL FINDINGS

☐ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) **The inner seal/gasket is bubbling and/or expanding inside the following window(s).** This is an indication that either the seal is broken or going to break in the near future. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(2) **The window glass was broken and/or cracked at the time of inspection located in the master bedroom.** Proper corrections and/or repairs are needed for safety, prevention of heating and air loss, and/or water penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(3) **The following window(s) and/or sashes were found to have a bad or broken thermal seal.** When a bad or broken thermal seal is found, it is possible there may be more that cannot be found at the time of inspection. Because of this it is recommended that all windows be evaluated to prevent heating and air loss. dining room




13.3 INTERIOR COMPONENT RECOMMENDATIONS

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

Smoke detector(s) were located, and the test button on the Smoke detector(s) or combination with carbon monoxide detector(s) was pressed and responded. Please understand that the smoke or carbon monoxide simulation cannot be performed or tested during the inspection. To ensure safety, all smoke detector(s) and carbon monoxide detectors should be replaced after closing on the house and replaced as often per the manufacturer's recommendations.

13.4 FIREPLACE ADDITIONAL LIMITATIONS

The pilot light was not lit at the time of inspection. Note: Pilot lights must be lit at the time of inspection to ensure safety. When pilots are off and/or the fireplace has not been used for sometime, it may take a long time to light the unit. The units may not light at all due to the lines needing to be bled. Because of the time constraints of a home inspection, pilot lights cannot be lit. Please Note: Unable to determine if the unit functions and/or functions properly at the time of inspection due to the pilot not being lit.

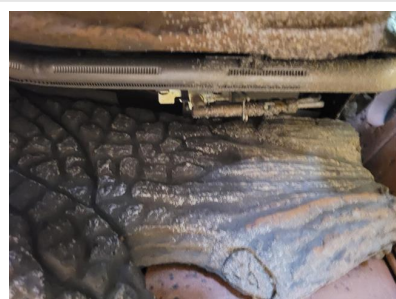

When one window is found to have a broken thermal seal, others may be in need of repair or replacement that are not listed below or within the report. Because of this, It is recommended that all windows be cleaned and further evaluated by the qualified licensed contractor or certified professional to determine if any additional windows are in need of replacement before the close of escrow. Any additional windows that are found to have a broken or bad thermal seal should also be repaired and/or replaced at that time by the qualified licensed contractor or certified professional that was recommended to further evaluate. The window at this point has lost its argon gas thus reduces the original R-Value of the window. All windows are located as if looking from the inside out toward the road or yard. -Overcast days, dirty windows, and/or rain can obstruct the view of the window or make it difficult to identify a bad thermal seal. The thermal window seal is the gasket that prevents fogging and moisture from entering in between the interior of the window panes.

14. BATHROOMS

DESCRIPTION

BATHROOM INFORMATION

Tub and bathroom sink overflows are not tested at the time of inspection. Inspectors are unable to determine if the overflow is connected properly in the wall at the time of inspection. If the overflow line is not connected properly testing them can cause damage to the property. Also, the shutoff valves under sinks are not tested. By turning the valves it may cause them to leak causing damage to the property. Because of this shutoff valves are not turned, tested, or operated.

TYPES & DESCRIPTIONS: BATHROOMS

Ventilation Types:


Electric power exhaust vent is installed in all bathrooms

ITEMS: BATHROOMS


14.0 PRIMARY BATHROOM VISUAL FINDINGS

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) The tile at the bathtub area of the master bathroom was there to be cracked and or damaged at the time of inspection this should be repaired and or replaced to ensure proper installation and to prevent water intrusion and to prevent any further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

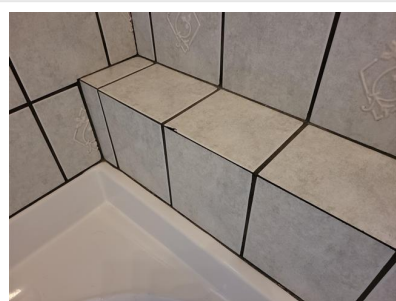

(2) A chip and or damage was noted at the bottom of the bathtub in the master bathroom at the time of inspection this should be sealed and or corrected to prevent water leakage and or any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

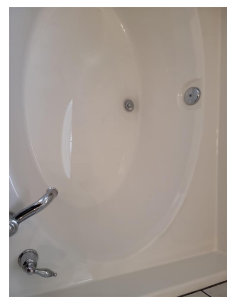

(3) The wall was noted be damaged at the shower area of the master bathroom at the time of inspection this should be repaired and or corrected for Aesthetics and to prevent any further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(4) The drain and stopper were noted to be damaged at the vanity in the master bathroom at the time of inspection this should be corrected to ensure proper installation and to prevent water leakage and any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



14.1 HALL BATHROOM VISUAL FINDINGS

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

14.2 UPSTAIRS BATHROOM VISUAL FINDINGS

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

Caulk is needed around the tub faucet where it meets the shower wall to prevent water penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



14.3 BATHROOM RECOMMENDATIONS/INFORMATION

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

 15. KITCHEN-APPLIANCES

 DESCRIPTION

KITCHEN INFORMATION

The kitchen appliances are tested for basic functionality and cannot be evaluated for their performance nor for the variety of their settings or cycles. Appliances older than ten years may exhibit decreased efficiency. Even if general comments are made, these items are not inspected: free-standing appliances, refrigerators, freezers, ice makers, trash-compactors, built-in toasters, coffee-makers, can-openers, blenders, non-built in or non-secured microwave(s), instant hot water dispensers, water-purifiers, barbecues, grills, or rotisseries, timers, clocks, thermostats, the self-cleaning and cooking capability of ovens, and concealed or countertop lighting, which is convenient but often installed after the initial construction and not wired to national electrical standards. These items are considered outside the scope of the inspection. Appliances are not moved during the inspection as they may cause damage. Portable dishwashers are not inspected, as they require a connection to facilitate testing.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

 TYPES & DESCRIPTIONS: KITCHEN-APPLIANCES

Kitchen Sink: Tested	Dishwasher: Dishwasher - Operated	Range: Electric Operated
Oven: Electric Wall Oven	Garbage Disposal: Operated	

 ITEMS: KITCHEN-APPLIANCES

15.0 KITCHEN COMPONENTS VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

15.1 KITCHEN APPLIANCE VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

The range lacks an anti-tip device, which is a bracket securing the rear foot of the stove to the wall/floor behind it. This safety feature prevents the stove from tipping forward if a child, who is learning to walk, pulls up on the oven handle. It effectively avoids any risk of hot items spilling from the stove onto the child. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



15.2 KITCHEN INFORMATION

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) The sink was tested for leaks at the time of the inspection.



(2) The dishwasher underwent testing and ran through a full normal cycle during the inspection. Other cycles were not tested due to time constraints.



(3) During the inspection, the range underwent testing by operating the burners, broiler (if available), bake element, and convection (if available). However, the self-cleaning function and other specialized modes are not tested.



(4) During the inspection, the oven underwent testing by operating the broiler (if available), bake element, and convection (if available). However, the self-cleaning function and other specialized modes are not tested.



(5) The garbage disposal was tested by using the switch near the sink and running water through it. The inspection did not determine the disposal's efficiency.



🏠 16. CRAWLSPACE

📋 DESCRIPTION

CRAWL SPACE INFORMATION

While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. During the course of the inspection, the inspector does not enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely affect the health of the inspector or other persons. The under the floor insulation, between the floor joists, restricts viewing of the subfloor area and a percentage of the floor joists that are not removed during the inspection. If high moisture levels were noted to be above 20% during the inspection, this may indicate but does not guarantee an organic growth problem. Many factors are needed to have excessive growth within or under a home and/or within duct systems. If mold, mildew, or other organic growth is a concern please contact us to perform a mold test or mold inspection to help determine if removal or remediation is needed.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

Please review the entire report and/or refer to the signed agreement/contract for any items that are outside the scope of the inspection performed.

✂ TYPES & DESCRIPTIONS: CRAWLSPACE

Access Location:

Left side of the home

Method Used to Inspect:

Crawled with a flashlight, moisture meter, and a probing tool.

Floor Type:

Soil

Foundation and Structure

Types:

Common with wood joists. Wall types are brick and concrete masonry units.

👁 ITEMS: CRAWLSPACE

16.0 CRAWLSPACE VISUAL FINDINGS

📋 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

Due to the following (but not limited to), a licensed general contractor should be consulted to further evaluate entire framing, girders, and band sills and determine the full extent of the damage and/or if additional repairs are required or deemed necessary, as there may be additional defects that were concealed and/or otherwise unseen at the time of the original inspection.

A. Wood rot and or damage was noted in multiple locations in the crawlspace at the time of inspection this should be corrected to prevent any damage hidden and concealed damage may exist The entirety of the crawlspace of this home.

B.Organic and microbial growth was noted on the floor joist, girder, subfloor and sill in multiple locations throughout the crawlspace and the inspection this should be repaired and corrected and THE damage may

exist throughout the entirety of the crawlspace in this home

C. Exposed ductwork in unheated space is not insulated where it meets the sub flooring. The efficiency of the heating and air conditioning systems is greatly reduced due to the heat loss or gain. The metal duct work that is exposed sweats when the cold air and humid air in the crawl space meet. This creates condensation on the subfloor, causing possible wood rot and fungal growth. Staining and fungal growth was noted on the bottom of the subfloor around the ducts where they meet the subfloor throughout the crawl space.



D. Fungal/Organic growth was identified in the crawl space area. Depending on the types mold it may be common to see some types of growth. It is important to address this issue for the health and safety of your home. We recommend having a mold sampling to assess the type of molds and the home's air quality. If you have concerns about the fungus/organic growth found, contact us for testing. Additional services, such as testing for mold, are not included in the standard home inspection. To schedule mold sampling with one of our certified mold specialists, contact us at 704-542-6575 or email us at info@hicarolina.com.

E. The floor joists were found to have fungus or organic growth along them throughout the crawl space.

F. There is fungal growth noted along the framing within the crawl space area. The fungal growth was noted to have a root type structure indicating a wood destroying fungus. A wood-destroying fungus can deteriorate the wood causing structural instability. Further evaluation is needed to determine if the structural components of the framing have been compromised as there may be hidden and of concealed damage that was otherwise unseen at the time of the inspection. Please note the integrity of the structure may change as the environment changes within the crawl space area do to corrections with high moisture levels.

G. There is not a vapor barrier installed in the crawl space exposing the soil within and throughout the crawl space. Exposed soils in a crawlspace should be covered with a retardant material to prevent moisture or standing water from possibly causing deterioration to the wood framing above. A vapor barrier is recommended to reduce or keep moisture levels down within the crawl space area.



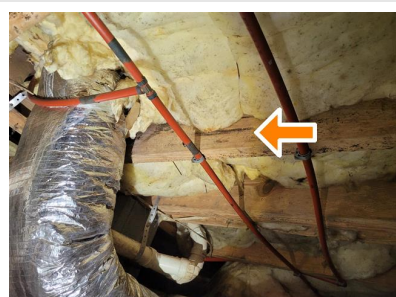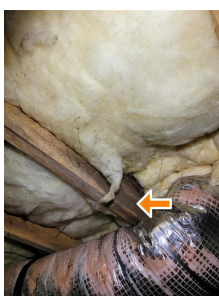

16.1 RECOMMENDATIONS/INFORMATION

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

Organic growth is common within all homes and buildings. The home inspection does not include or determine the presence or toxicity of mold and/or other organic growth(s) within the home. If there is evidence of mold and/or other organic growth(s) within the home it is strongly recommended that it be tested to determine its toxicity for you to determine if remediation is required or needed. If you are sensitive to mold and/or other organic growth(s) than it is

3617 Venetian Way

strongly recommended that the home is tested within the allotted time frame to make an educated discussion before purchasing the home. If tests are not completed before taking ownership of the home and mold is later discovered the corrections and/or remediation is solely the responsibility left to you "the buyer".

Valorie Redwine,

Thank you for trusting HIC to perform your inspection at 3617 Venetian Way
York SC 29745

. If you have any questions regarding this report, please do not hesitate to contact us and set up a time to review your report. Our inspectors are always willing to help answer any questions to ensure you completely understand the information provided in your report. Contact your inspector directly or our office at [704-542-6575](tel:704-542-6575) with any questions.

Sincerely,

Matthew Adams

(704)519-6322

Matt@hicarolina.com

NC #4195 SC#1389770



Office - [704-542-6575](tel:704-542-6575)

info@hicarolina.com

www.homeinspectioncarolina.com



Home Inspection Summary

Exclusively for Valorie Redwine

Please see main body of the report for any additional pictures and information

THIS REPORT IS INTENDED TO BE VIEWED IN COLOR.

Inspection Address

3617 Venetian Way
York SC 29745



Inspector Contact

Matthew Adams
(704)519-6322
Matt@hicarolina.com
NC #4195 SC#1389770

Thank you for choosing Home Inspection Carolina (HIC). At your request, a visual inspection of the above-referenced property was conducted on 10/7/2025. An earnest effort was made on your behalf to discover all visible defects; however, in the event of an oversight, maximum liability must be limited to the total inspection fee paid. It is strongly recommended that you promptly read the complete and entire report. The summary and main report are not limited to additional negotiable items identified outside this inspection. For more information on negotiable items identified outside this inspection, please contact your Real Estate Agent or attorney.

This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney. For South Carolina, contact your South Carolina real estate agent or an attorney.

Home Inspection Definitions

Home Inspection: A home inspection is a limited, non-invasive visual examination of the condition of a home. To visually inspect essential components of a residential dwelling designed to identify MATERIAL DEFECTS.

Direction: Our State requirements require us to direct our clients to consult with qualified licensed contractors for further evaluation of all defects identified within our report. It is essential that you thoroughly understand the extent of any problem before the close of escrow on the home.

Ancillary Services: Ancillary services, such as Mold Sampling, Radon Tests, etc., are not part of this home inspection and do not fall under state Standard of Practice guidelines. For your convenience, other services may be listed within this report; however, they are to be viewed as independent services and individually. For more information on additional ancillary services we provide, please get in touch with our office or visit our website at <https://www.homeinspectioncarolina.com/services/>

Material Defects: A material defect is a specific issue with a system or component of a residential property that may have a significant, adverse impact on the property's value or pose an unreasonable risk to people.

The following report reflects the visual conditions of the property at the time of the inspection only. The summary and main report are a list of items found to be defective, needing repair, or further evaluation. Please understand there may be hidden or concealed damage that could not be viewed, seen, or present at the time of inspection. For your protection, we strongly recommend consulting with a qualified licensed contractor to evaluate further all defects noted within this report. Hidden or concealed defects are not inspected and are not included in this report. **No warranty is either expressed or implied in the home inspection report. This report is not an insurance policy nor a warranty service.**

*The point of reference for this report is from the street looking at the front of the house. (The front, right crawl space would be the front, right corner of the home, not the front right corner from the crawl space access door unless otherwise stated).

1. DECK(S)/PATIO(S)/PORCHES

General Summary

DECK/PATIO/PORCH VISUAL FINDINGS

1. (1) The handrails at the steps of the rear porch were noted to be too wide at the time of inspection this should be repaired and or corrected for safety and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




2. (2) The deck boards at the rear porch were noted to be fastened with nails at the time of inspection this should be corrected for safety and to ensure proper installation and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.





3. (3) **The railings were noted to be depending on the spindles as no posts were found or noted to be installed.** Post are needed at the base of the stairs/steps and approximately every six feet on center to properly support and secure the railing around the decking and stairs. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



4. (4) Wood rot and or damage was noted to the deck boards at the rear porch at the time of inspection this should be corrected to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

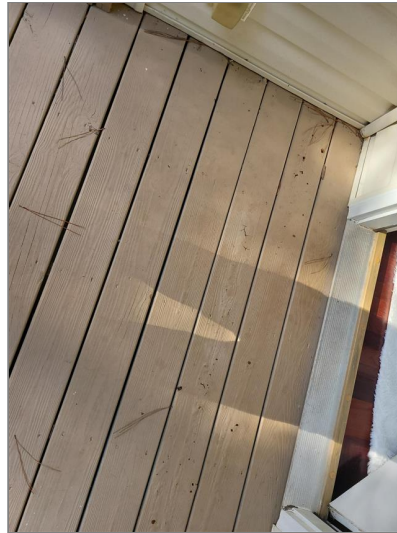

5. (5) **The stairs at front porch were found to be above 30", typically consisting of 3 or more steps.** Stairs, patios, and decks above 30" require a handrail to be installed to ensure safety. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

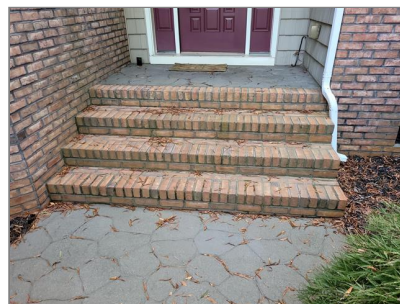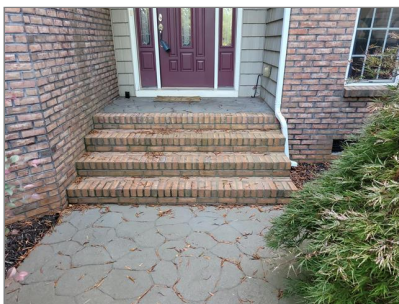


2. EXTERIOR/TRIM/FOUNDATION

General Summary

EXTERIOR VISUAL FINDINGS

6. (1) Trim was noted to be missing and or not installed correctly under the threshold of both rear doors at the time of inspection this should be repaired and or corrected to ensure proper installation and to prevent water intrusion and to prevent any further damage hidden and will concealed damage may exist. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

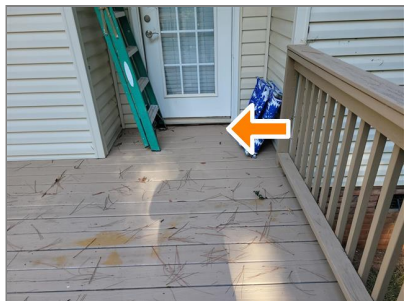

7. (2) The weather strip at the rear door Was noted to be torn and or damaged at the time of inspection this should be repaired and or replaced to ensure proper function and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




8. (3) Rust and or damage was noted to the rear door door trim and or threshold at the time of inspection this should be repaired and or corrected to ensure proper installation and function and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



9. (4) No weep holes were detected in the brick siding surrounding the house. Weep holes, which are drilled openings or slots, are typically situated around the foundation and positioned above or below windows in brick veneer structures. These openings serve the purpose of facilitating the drainage of accumulated moisture within or behind building elements, as well as providing an outlet for water that could potentially gather in window sills and veneers. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



10. (5) Sealant is important for safeguarding against water damage and potential rodent intrusion at entry points where phone, cable, or electrical lines enter the home. This protective measure helps maintain the integrity of the home's infrastructure and prevents costly repairs in the long run. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

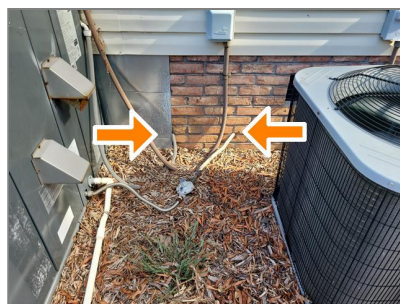

11. (6) Holes were noted to the siding at the rear right corner of the home at the time of inspection this should be repaired and or corrected to prevent water and or pest intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



12. (7) Holes were noted to the siding at the left side of the home at the time of inspection this should be repaired and or corrected to prevent moisture and or pest intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



TRIM VISUAL FINDINGS

13. Wood rot and or damage was noted to the trim at the front door area of the home at the time of inspection this should be repaired and or corrected to ensure proper installation and to prevent any further damage. Hidden and or concealed damage may exist. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



FOUNDATION VISUAL FINDINGS

14. (1) A crack was noted to the brick foundation at the back left portion of the home at the time of inspection this should be repaired and or corrected to prevent any further damage hidden Edward concealed damage may exist. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



15. (2) A crack was noted to the brick Foundation at the left side of the home at the time of inspection this should be repaired and or corrected to prevent any further damage hidden and will concealed damage may exist. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



3. GROUNDS/PAVINGS

General Summary

GROUND AREA VISUAL FINDINGS:

16. **There are cracks noted at the sidewalk that need to be sealed and/or repaired properly to prevent water penetration and/or continual cracking.** Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



4. GARAGE-CARPORT


General Summary

GARAGE VISUAL FINDINGS



17. (1) The door knob at the garage entry door with nutted to be damaged at the time of inspection this should be repaired and or replaced for safety and to ensure proper installation and function and to prevent any further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



18. (2) The handrail was noted to be too wide at the railing at the steps in the garage at the time of inspection this should be repaired and or corrected for safety to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

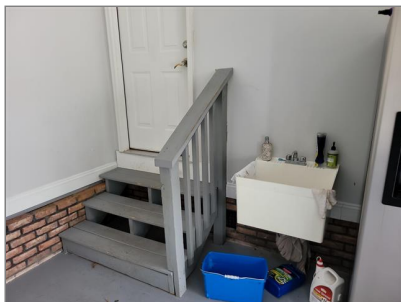

19. (3) Multiple crawl space vents were noted in the garage at the time of inspection this should be sealed and or corrected to prevent carbon monoxide exchange and to ensure proper construction and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

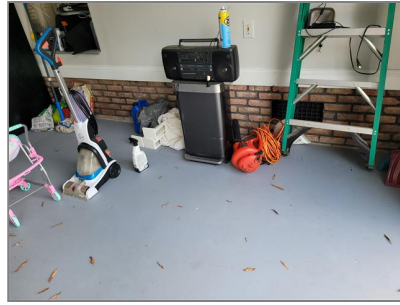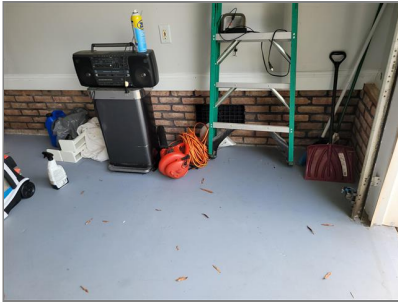

5. ROOF SYSTEMS

General Summary

ROOF VISUAL FINDING(S)

20. (1) **The debris on the roof needs to be corrected to prevent the collection of debris, weathering, or damage at the rear of the home.** Corrections are needed to prolong life or the roof shingle and/or prevent leaks. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



21. (2) **The siding is touching the roof shingles along the roof line where the siding and roof meet.** The siding needs to be trimmed back properly to prevent water damage to the siding and/or water from penetrating into the home. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



GUTTER VISUAL FINDING(S)

22. (1) **A splash block is needed to properly direct water away from the foundation of the home at the front and rear corner of the home.** Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



23. (2) The downspout was noted to be missing at the rear left corner of the home at the time of inspection this it could be corrected to ensure proper installation and to ensure proper water disbursements and to prevent any further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



FASCIA/SOFFITS/EAVE VISUAL FINDING(S)


24. (1) **A hole was noted in the soffit at the back of the house at the time of inspection this should be corrected to prevent any further damage.** Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



25. (2) A gap was noted in the soffit at the front of the home in multiple locations at the time of inspection this should be corrected to ensure proper installation and to prevent water and or pest intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



26. (3) The soffit was noted to be loose and or damaged at the front of the home at the time of inspection this should be corrected to ensure proper installation and to prevent water intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

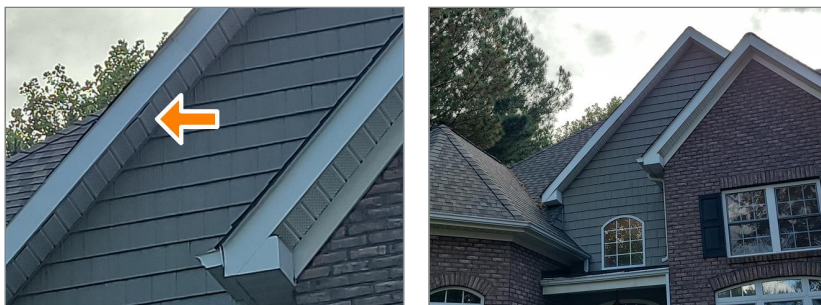


6. ATTIC INTERIOR SYSTEM

General Summary

ATTIC VISUAL FINDINGS

27. Walk boards were noted to be missing at the attic access in the upstairs portion of the home at the time of inspection this should be corrected for safety and to prevent further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

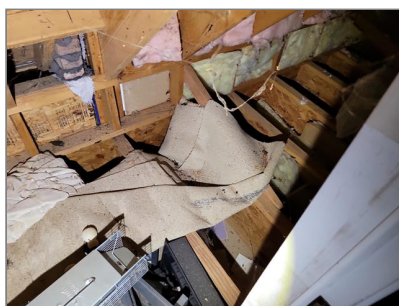

7. PLUMBING SYSTEM

General Summary

PLUMBING CONDITIONS/VISUAL FINDINGS

28. (1) The visible plumbing lines in this home are plastic PEX with brass metal fittings. **Evidence of fitting deterioration was noted during the inspection in a few/several locations.** The deterioration could be the result of a known problem referred to as "dezincification". Dezincification occurs when brass fittings that are considered a high-zinc copper alloy are exposed to water and the zinc is leached from the fitting or component leaving the fitting in a weakened state. This process also leads to a buildup inside the fitting, restricting water flow and ultimately leaving the plumbing system prone to breakage and leaking. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



29. (2) A leak was noted at least faucet at the sink in the garage at the time of inspection, This should be repaired and or replaced to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



30. (3) There is CSST (corrugated stainless steel tubing) noted within the crawl space that was found to have the stainless steel areas exposed near the fittings. The exposed stainless steel needs to be sealed or covered with the proper and/or approved tape to prevent corrosion and/or rusting. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



31. (4) The filter was noted to be unsupported and laying on the ground in the crawlspace at the time of inspection should be corrected to ensure proper installation and function and damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



WATER HEATER CONDITIONS/VISUAL FINDINGS

32. **The water heater appears to be above ten years of age. The lifespan of a typical water heater is noted to be 10-15 years for an electric water heater and 15-18 years for a gas water heater.** The lifespan can depend on several things: the condition of the water; if the water heater is maintained properly; the location of the water heater (crawl space, interior closet, garage, etc.); and several other factors. Due to additional factors, it is impossible to determine the lifespan of the water heater(s) currently installed and/or the additional years left for the water heater. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




PLUMBING RECOMMENDATIONS/INFORMATION

33. (1) Dura-Pex/NIBCO PEX tubing is prone to oxidization, which is when oxygen negatively affects the quality of a material, like metal or plastic. This can happen if the material isn't treated properly or has a flawed design. Oxidization of PEX tubing can lead to the development of cracks and ruptures, resulting in water leaks. These leaks can also cause damage to NIBCO's fittings and clamps. No leaks were observed during the inspection. It is advisable to continue monitoring for leaks. If leaks were found, consult with a licensed plumbing contractor to thoroughly evaluate and repair any issues that may arise.



34. (2) Dura-Pex/NIBCO PEX tubing is prone to oxidization, which is when oxygen negatively affects the quality of a material, like metal or plastic. This can happen if the material isn't treated properly or has a flawed design. Oxidization of PEX tubing can lead to the development of cracks and ruptures, resulting in water leaks. These leaks can also cause damage to NIBCO's fittings and clamps. No leaks were observed during the inspection. It is advisable to continue monitoring for leaks. If leaks were found, consult with a licensed plumbing contractor to thoroughly evaluate and repair any issues that may arise.

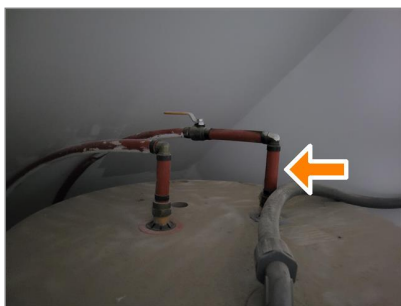

9. ELECTRICAL SYSTEM

General Summary

ELECTRICAL VISUAL FINDINGS


35. (1) A electrical outlet was noted to be installed behind the stove in the kitchen at the time of inspection this should be corrected for safety and to ensure proper installation and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



36. (2) The inside breaker cover was noted to be damaged at the Exterior electric panel at the time of inspection this should be corrected for safety and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



37. (3) The ceiling fan in the living room was there to be noisy at the time of inspection this should be repaired and or corrected to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

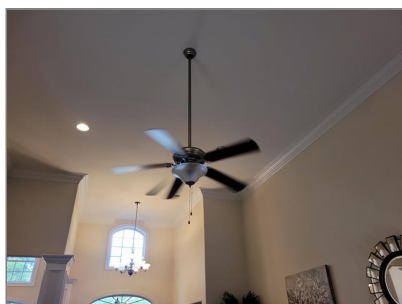

38. (4) **Missing or damaged cover plates noted within the home.** Repair and/or replace as needed. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.





11. COOLING SYSTEM(S)


General Summary

AIR CONDITIONER VISUAL FINDINGS

39. (1) The air conditioner at the right side of the home was noted to be sitting directly on the ground at the time of inspection this should be corrected to ensure proper installation and to prevent any further damage. Consult a qualified licensed contractor to assess the areas of concern and perform any additional repairs deemed necessary during their evaluation.

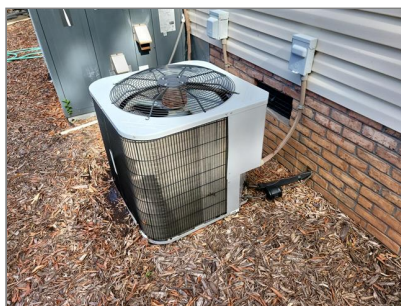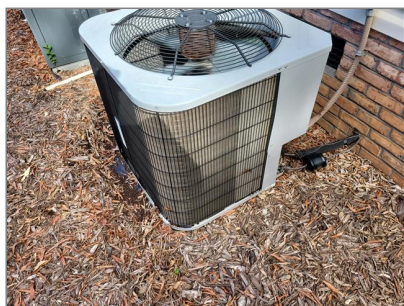


40. (2) The insulation is damaged, deteriorated, or torn and must be replaced at the Freon line to prevent potential harm or damage at the second floor unit. Insulation helps maintain the coolant's temperature, preventing it from heating up due to external conditions, which could lead to it converting to liquid and potentially damaging the unit. Consult a qualified licensed contractor to assess the areas of concern and perform any additional repairs deemed necessary during their evaluation.

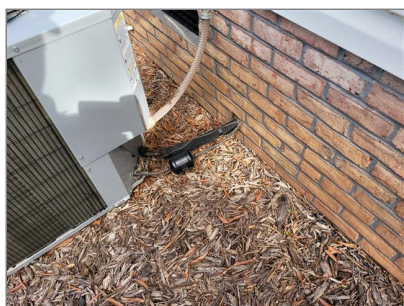

41. (3) The primary unit and second floor unit is failing to achieve a sufficient air temperature drop, which could suggest a range of issues, including but not limited to low Freon levels, a dirty air filter, or clogged coils. When tested, the temperature differentials should ideally fall between 14 and 24 degrees; however, the current differentials measured only 13 degrees.

DUCT VISUAL FINDINGS

42. Water damage was noted to the ducts in the crawlspace in multiple locations at the time of inspection this should be repaired or corrected to ensure proper function and to prevent the damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

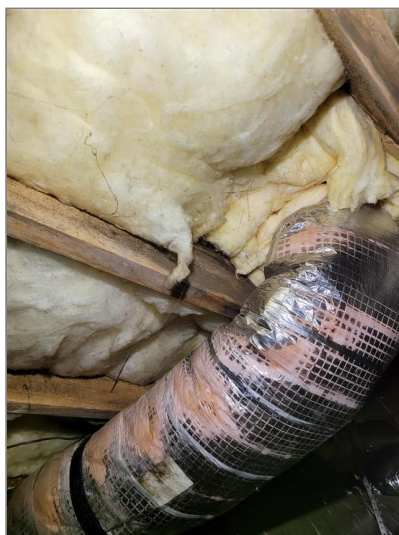


12. HEATING SYSTEM

General Summary

HEATING COMPONENT VISUAL FINDINGS

43. (1) The **drip leg was missing** and is needed at the gas line where it enters the heating unit. This is needed to create a collection point for moisture and foreign particles (i.e copper sulfide) that may be in the gas line **at the primary unit**. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

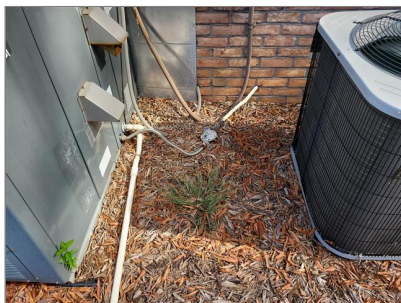


44. (2) The package unit at the right side of the home was noted to be improperly sealed to the foundation at the time of inspection this should be repaired and or corrected to ensure proper installation and to prevent any further


damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



45. (3) The gas line was noted to be laying on the ground at the package unit at the time of inspection this is an improper installation and Corrections should be made to ensure proper installation and to prevent further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.
46. (4) A shroud was noted to be missing where the package unit fastens to the home at the right side of the house at the time of inspection this should be corrected to ensure proper installation and to prevent water and or pest intrusion and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

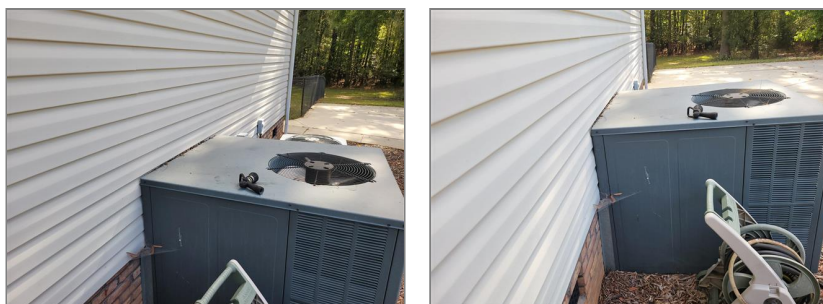

47. (5) The package unit was noted To be sitting directly on the ground at the right side of the home at the time of inspection this should be repaired and or corrected to ensure proper installation and to prevent any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

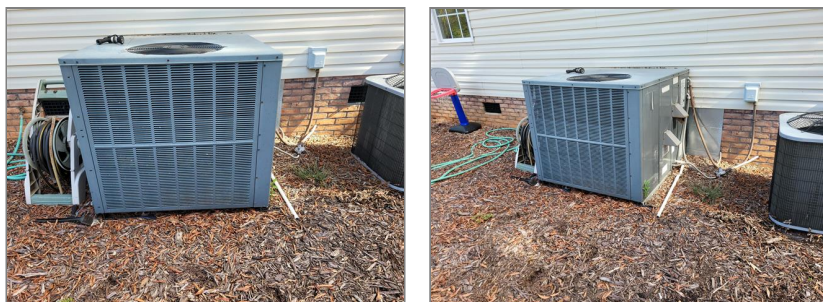

48. (6) The **secondary or emergency condensate line is capped** and needs correction in the event that the main drain line were to become clogged. The secondary line is designed to allow water to drain down into the overflow pan below turning off the unit or draining the water from the pan to the exterior of the home notifying the homeowner that a problem exists. Without a secondary line installed and/or being blocked from allowing the water to drain into the pan, the water that is trapped in the evaporator coil would eventually leak into the burner chamber

potentially creating additional problems **at the second floor unit**. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




13. INTERIOR COMPONENTS


General Summary

INTERIOR COMPONENT CONDITIONS/VISUAL FINDINGS

49. (1) Railing returns where noted to be missing at the handrails at the interior stairs at the time of inspection this should be corrected for safety and to ensure proper installation and to prevent further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

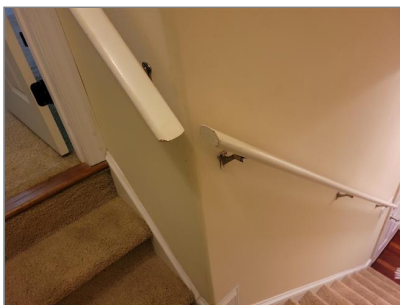

50. (2) **There are door stops missing/damaged behind doors in areas throughout the home**; replacement needed to prevent possible damage to the walls behind the doors. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

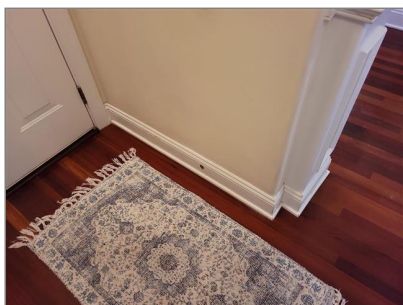

WINDOW VISUAL FINDINGS

51. (1) **The inner seal/gasket is bubbling and/or expanding inside the following window(s).** This is an indication that either the seal is broken or going to break in the near future. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



52. (2) **The window glass was broken and/or cracked at the time of inspection located in the master bedroom.** Proper corrections and/or repairs are needed for safety, prevention of heating and air loss, and/or water penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



53. (3) **The following window(s) and/or sashes were found to have a bad or broken thermal seal.** When a bad or broken thermal seal is found, it is possible there may be more that cannot be found at the time of inspection. Because of this it is recommended that all windows be evaluated to prevent heating and air loss. dining room




14. BATHROOMS

General Summary

PRIMARY BATHROOM VISUAL FINDINGS

54. (1) The tile at the bathtub area of the master bathroom was there to be cracked and or damaged at the time of inspection this should be repaired and or replaced to ensure proper installation and to prevent water intrusion and to prevent any further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

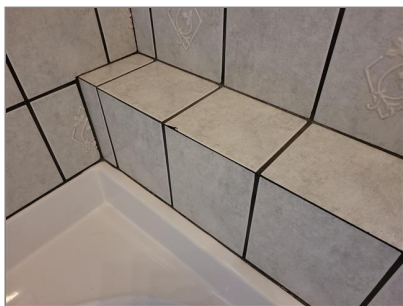

55. (2) A chip and or damage was noted at the bottom of the bathtub in the master bathroom at the time of inspection this should be sealed and or corrected to prevent water leakage and or any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



56. (3) The wall was noted be damaged at the shower area of the master bathroom at the time of inspection this should be repaired and or corrected for Aesthetics and to prevent any further damage Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



57. (4) The drain and stopper were noted to be damaged at the vanity in the master bathroom at the time of inspection this should be corrected to ensure proper installation and to prevent water leakage and any further damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



UPSTAIRS BATHROOM VISUAL FINDINGS

58. **Caulk is needed around the tub faucet** where it meets the shower wall to prevent water penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



15. KITCHEN-APPLIANCES

General Summary

KITCHEN APPLIANCE VISUAL FINDINGS

59. The range lacks an anti-tip device, which is a bracket securing the rear foot of the stove to the wall/floor behind it. This safety feature prevents the stove from tipping forward if a child, who is learning to walk, pulls up on the oven handle. It effectively avoids any risk of hot items spilling from the stove onto the child. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



16. CRAWLSPACE

General Summary

CRAWLSPACE VISUAL FINDINGS

60. Due to the following (but not limited to), a licensed general contractor should be consulted to further evaluate entire framing, girders, and band sills and determine the full extent of the damage and/or if additional repairs are required or deemed necessary, as there may be additional defects that were concealed and/or otherwise unseen at the time of the original inspection.

A. Wood rot and or damage was noted in multiple locations in the crawlspace at the time of inspection this should be corrected to prevent any damage hidden and concealed damage may exist The entirety of the crawlspace of this home.

B. Organic and microbial growth was noted on the floor joist, girder, subfloor and sill in multiple locations throughout the crawlspace and the inspection this should be repaired and corrected and THE damage may exist throughout the entirety of the crawlspace in this home

C. Exposed ductwork in unheated space is not insulated where it meets the sub flooring. The efficiency of the heating and air conditioning systems is greatly reduced due to the heat loss or gain. The metal duct work that is exposed sweats when the cold air and humid air in the crawl space meet. This creates condensation on the subfloor, causing possible wood rot and fungal growth. Staining and fungal growth was noted on the bottom of the subfloor around the ducts where they meet the subfloor throughout the crawl space.


D. Fungal/Organic growth was identified in the crawl space area. Depending on the types mold it may be common




to see some types of growth. It is important to address this issue for the health and safety of your home. We recommend having a mold sampling to assess the type of molds and the home's air quality. If you have concerns about the fungus/organic growth found, contact us for testing. Additional services, such as testing for mold, are not included in the standard home inspection. To schedule mold sampling with one of our certified mold specialists, contact us at 704-542-6575 or email us at info@hicarolina.com.

E. The floor joists were found to have fungus or organic growth along them throughout the crawl space.

F. There is fungal growth noted along the framing within the crawl space area. The fungal growth was noted to have a root type structure indicating a wood destroying fungus. A wood-destroying fungus can deteriorate the wood causing structural instability. Further evaluation is needed to determine if the structural components of the framing have been compromised as there may be hidden and of concealed damage that was otherwise unseen at the time of the inspection. Please note the integrity of the structure may change as the environment changes within the crawl space area do to corrections with high moisture levels.

G. There is not a vapor barrier installed in the crawl space exposing the soil within and throughout the crawl space. Exposed soils in a crawlspace should be covered with a retardant material to prevent moisture or standing water from possibly causing deterioration to the wood framing above. A vapor barrier is recommended to reduce or keep moisture levels down within the crawl space area.

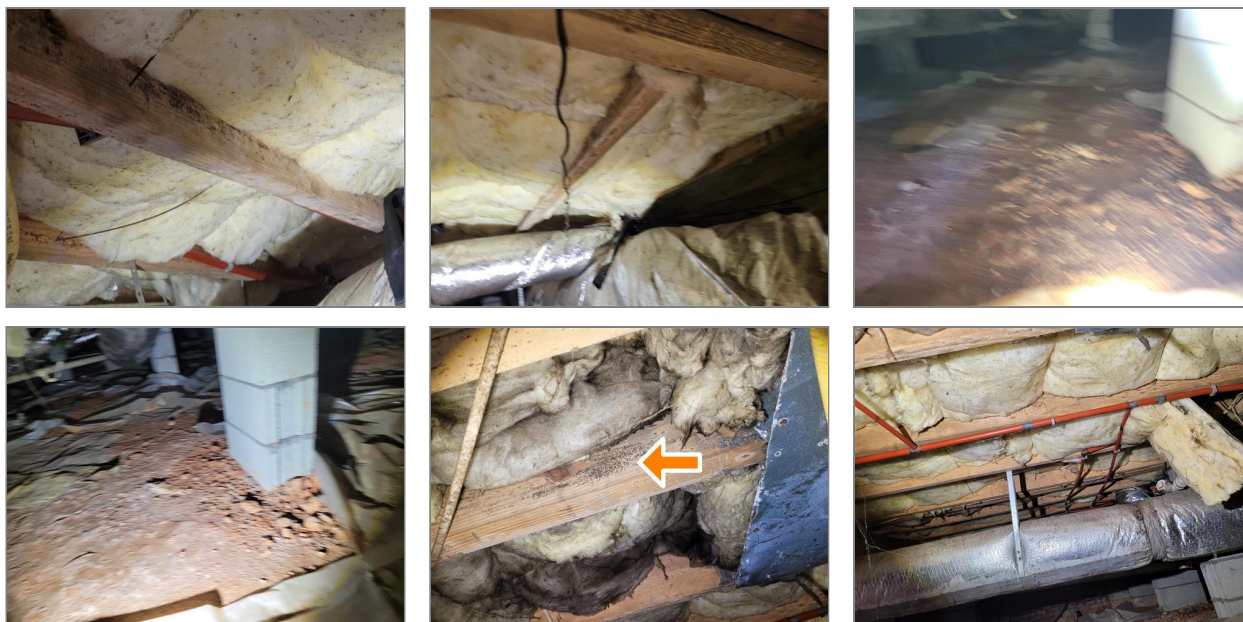

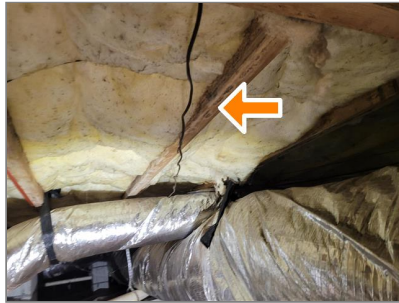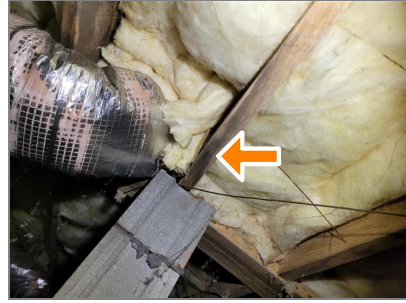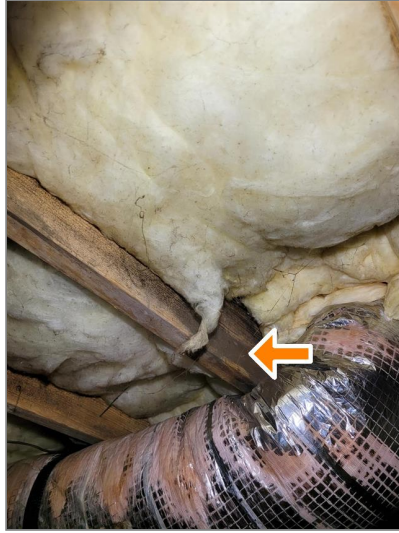

Valorie Redwine,

Thank you for trusting HIC to perform your inspection at 3617 Venetian Way
York SC 29745

If you have any questions regarding this report, please do not hesitate to contact us and set up a time to review your report. Our inspectors are always willing to help answer any questions to ensure you completely understand the information provided in your report. Contact your inspector directly or our office atÂ 704-542-6575Â with any questions.

Sincerely,



Matthew Adams
(704)519-6322
Matt@hicarolina.com
NC #4195 SC#1389770
Home Inspection Carolina
Office - 704-542-6575
Fax - 704.540.7313
info@hicarolina.com
www.homeinspectioncarolina.com



v09.10.24

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Matthew Adams