



INSPECTION REPORT
4286 Lake Shore Rd N
Denver NC 28037

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 1/31/2023
🕒 09:00:00 AM

INVOICE

Above Parr Home Inspections

Inspection Date: 1/31/2023

Inspected By: Alex Parr 3692

Report ID: 013123AP2

Customer Info:	Inspection Property:
Kevin Murphy	4286 Lake Shore Rd N Denver NC 28037
Customer's Real Estate Professional: Libby Allison	

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	550.00	1	550.00
WDI/Termite	75.00	1	75.00
Radon - Ancillary Service	150.00	1	150.00

Tax \$0.00

Total Price \$775.00

Payment Method: Credit Card

Payment Status: Paid

Note:

GENERAL INFO

Property Address

4286 Lake Shore Rd N
Denver NC 28037

Date of Inspection

1/31/2023

Report ID

013123AP2

Customer(s)

Kevin Murphy

Time of Inspection

09:00:00 AM

Real Estate Agent

Libby Allison

INSPECTION DETAILS

Approximate age of building:

Over 50 Years

In Attendance:

Customer and their agent

Radon Test:

Yes

Water Test:

No

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

Yes

Type of building:

Single Family (2 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

■ ■ ■ TABLE OF CONTENTS

Cover Page.....1

Invoice.....2

Intro Page.....3

Table of Contents4

General Summary5

1 Property Overview.....17

2 Roofing19

3 Exterior.....21

4 Structural Components28

5 Plumbing System33

6 Electrical System36

7 Heating / Central Air Conditioning.....39

8 Interiors41

9 Insulation and Ventilation43

10 Built-In Kitchen Appliances.....45

Attachments.....47

GENERAL SUMMARY

Above Parr Home Inspections

Customer

Kevin Murphy

Address

4286 Lake Shore Rd N
Denver NC 28037

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

2. ROOFING

2.0 ROOF COVERINGS

REPAIR OR REPLACE

(1)

1. The roof at the rear of the home has evidence of repairs. This may allow water intrusion to occur. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



2.0 Item 1 (Picture)



2.0 Item 2 (Picture)



2.0 Item 3 (Picture)

3. EXTERIOR

3.2 WINDOWS


REPAIR OR REPLACE

1. Several windows have failed/compromised thermal seals/fogged window panes. This is indicated by the visible moisture, discoloration, calcium deposits and or crystallization visible between the glass window panes. A certified window technician should recheck all the windows throughout the home. Due to weather conditions many times compromised/failed windows cannot be identified at the time of inspection. Further investigation and repairs are needed.

We recommend contacting a properly licensed window technician/contractor regarding these conditions and have repairs made deemed appropriate



3.2 Item 1 (Picture)

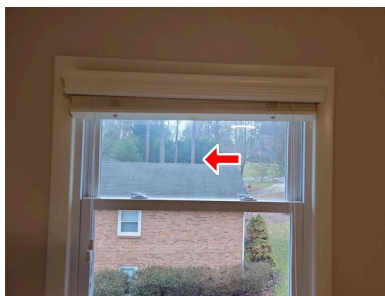

3.2 Item 2 (Picture)



3.2 Item 3 (Picture)



3.2 Item 4 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

REPAIR OR REPLACE

(1)

1. The deck floor system at the rear of home is not supported properly. A fall or injury can occur if not corrected. I recommend having the entire deck evaluated for structural stability. Further investigation and repairs are needed.


A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)



3.4 Item 2 (Picture)

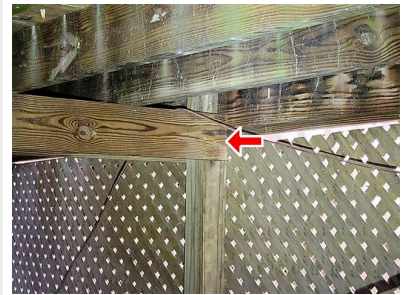

3.4 Item 3 (Picture)



3.4 Item 4 (Picture)



3.4 Item 5 (Picture)

(2)

1. The exterior girders for the wood deck are attached to the support posts by simple nail connections only. This is an uncommon construction method. Typically girders require through bolt connections, structural screws or direct bearing at end points to prevent framing movement and or failure. Deck failure could occur if not addressed. Further investigation and repairs are needed.

A qualified contractor should perform the work.



3.4 Item 6 (Picture)

(3)

1. The guardrails on deck at the rear of home are loose. A fall or injury could occur if not corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



3.4 Item 7 (Picture)



3.4 Item 8 (Picture)




3.4 Item 9 (Picture)


(4)

1. The deck at the rear of the home is showing signs of failing. I recommend having the entire deck evaluated for structural stability. Further investigation and repairs are needed.


A qualified contractor should repair or replace as needed.

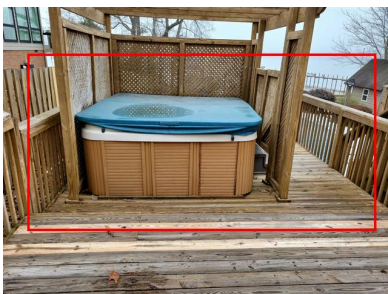

3.4 Item 10 (Picture)

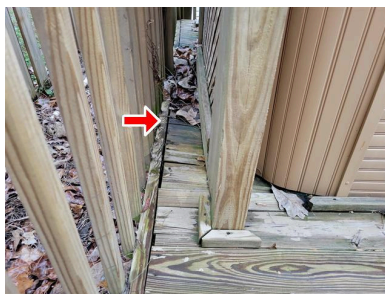


3.4 Item 11 (Picture)

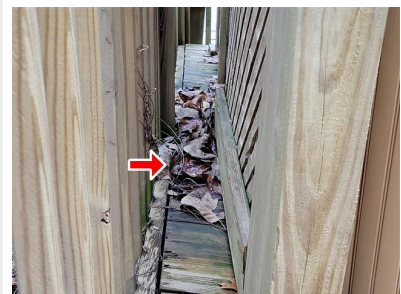

3.4 Item 12 (Picture)



3.4 Item 13 (Picture)

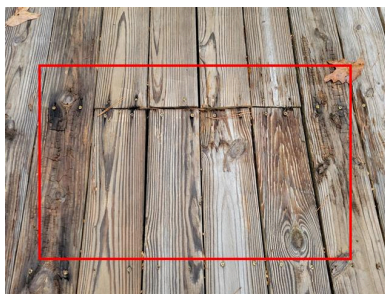

3.4 Item 14 (Picture)

(5)

1. The patio at the rear of home is deteriorated. This is allowing water intrusion to occur. Further deterioration can occur if not repaired. Further investigation and repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 15 (Picture)



3.4 Item 16 (Picture)



3.4 Item 17 (Picture)



3.4 Item 18 (Picture)



3.4 Item 19 (Picture)



3.4 Item 20 (Picture)



3.4 Item 21 (Picture)

(6)

1. The guardrails on patio at the rear of home is loose. A fall or injury could occur if not corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



3.4 Item 22 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☐ REPAIR OR REPLACE

(2)

1. The concrete drive at the front of home uneven, and can be a tripping hazard. Water can cause further deterioration if not repaired and sealed properly. A fall or injury can occur if not corrected. Repairs are needed.

A qualified person should repair or replace as needed.



3.5 Item 2 (Picture)



3.5 Item 3 (Picture)



3.5 Item 4 (Picture)



3.5 Item 5 (Picture)



3.5 Item 6 (Picture)

3.11 RETAINING WALLS

REPAIR OR REPLACE

1. The retaining wall at the rear of the home has evidence of movement. Further deterioration could occur. Further investigation and repairs are needed.

A qualified contractor should repair or replace as needed.



3.11 Item 1 (Picture)



3.11 Item 2 (Picture)



3.11 Item 3 (Picture)




3.11 Item 4 (Picture)

4. STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

REPAIR OR REPLACE

1. The brick at the right side (facing front) and the rear have cracks present with outward displacement/movement present. The wall(s) may need reinforcement. Further investigation and repairs are needed. A qualified licensed general contractor should inspect further and repair as needed.

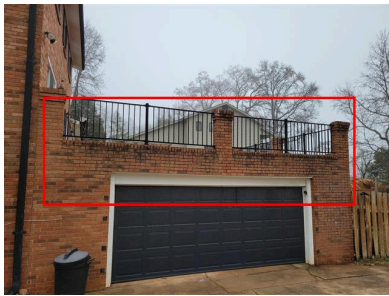


4.0 Item 1 (Picture)



4.0 Item 2 (Picture)



4.0 Item 3 (Picture)

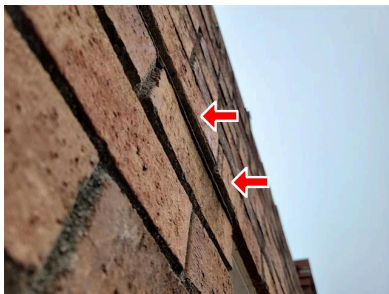


4.0 Item 4 (Picture)



4.0 Item 5 (Picture)



4.0 Item 6 (Picture)

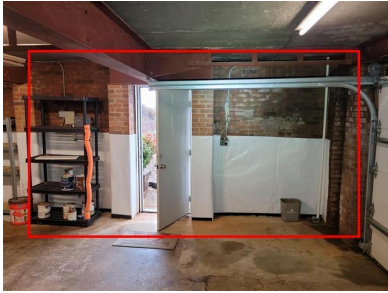

4.0 Item 7 (Picture)



4.0 Item 8 (Picture)




4.0 Item 9 (Picture)



4.0 Item 10 (Picture)



4.0 Item 11 (Picture)

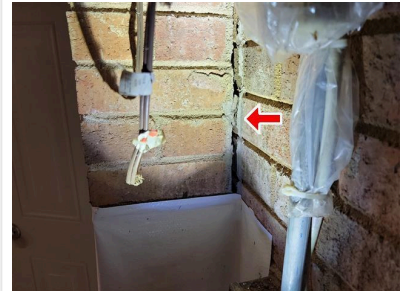


4.0 Item 12 (Picture)




4.0 Item 13 (Picture)



4.0 Item 14 (Picture)

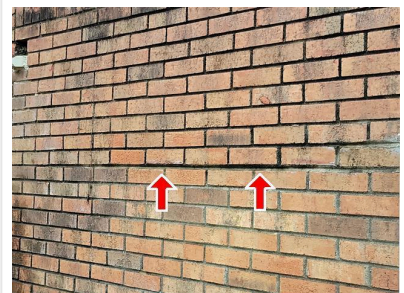

4.0 Item 15 (Picture)

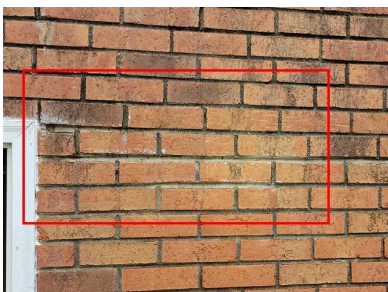

4.0 Item 16 (Picture)

4.2 FLOORS (STRUCTURAL)


REPAIR OR REPLACE

1. Steel truss is rusting under the concrete patio. I recommend having the steel truss evaluated for structural stability. Further investigation and repairs are needed.


A qualified licensed general contractor should inspect further and repair as needed.



4.2 Item 1 (Picture)

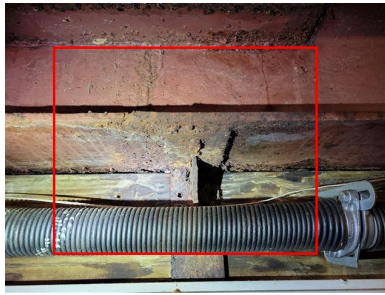

4.2 Item 2 (Picture)

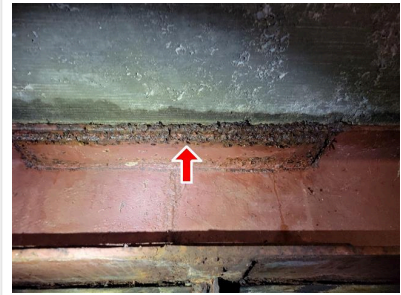

4.2 Item 3 (Picture)



4.2 Item 4 (Picture)

4.4 ROOF STRUCTURE AND ATTIC

REPAIR OR REPLACE

1. The truss system installed in the attic have been repaired due to damage during or before installation of the truss. All truss repairs should be repaired via an approved method specified by the manufacturer and or approved and stamped by licensed structural engineer. Note: No letter was present at repair. Further evaluation and repairs are needed. A qualified licensed structural engineer/design professional is recommended to evaluate the trusses for any repairs. This should include a site specific letter from the registered design professional/engineer stating what repairs (if any) are needed approval of performed repairs, signature, state license number, and state registered stamp of the engineer.



4.4 Item 1 (Picture)



4.4 Item 2 (Picture)



4.4 Item 3 (Picture)



4.4 Item 4 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

REPAIR OR REPLACE

1. Visible signs of water intrusion in the garage are present from water on wall. Water intrusion if not corrected can lead to other problems including mold and cause excessive moisture to floor system that can lead to deterioration and increased repair cost. Further investigation and repairs are needed.

I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist.



4.6 Item 1 (Picture)



4.6 Item 2 (Picture)

5. PLUMBING SYSTEM

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

REPAIR OR REPLACE


1. There is a plumbing leak under the guest bathroom 2nd floor. This is causing water damage to occur to the home. I am unable to determine how much damage has occurred to the home. Further investigation and repairs are needed.

I recommend having the light fixture in the kitchen evaluated due to the volume of water that traveled through it. Further investigation and repairs are needed.

I recommend a qualified licensed plumber repair or correct as needed.



5.3 Item 1 (Picture)

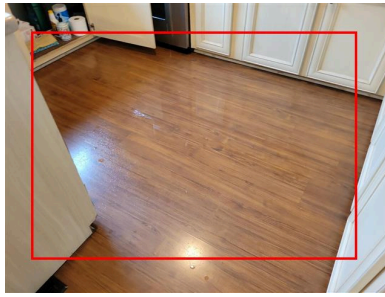

5.3 Item 2 (Picture)



5.3 Item 3 (Picture)

5.5 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)


REPAIR OR REPLACE

1. The gas line was installed improperly using soft copper through wall instead of hard piping at the fireplace. This is a safety issue and should be repaired. Further investigation and repairs are needed.

A qualified person should repair or replace as needed



5.5 Item 1 (Picture)

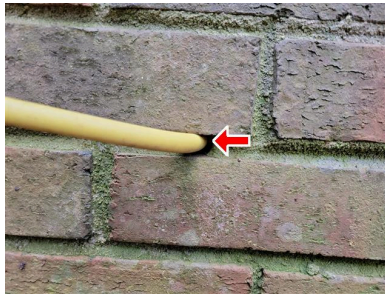

5.5 Item 2 (Picture)

6. ELECTRICAL SYSTEM

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

REPAIR OR REPLACE

(2)

1. The electrical panel cover sub panel has been secured with sheet metal screw. This is considered unsafe as sheet metal screws are not rated for electrical panel use. The use of sheet metal screws with panel cover have been known to short hot wires, as they can pierce the branch wiring protective coverings. (Safety Issue) Repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.2 Item 2 (Picture)

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

📋 REPAIR OR REPLACE

1. At least one GFCI (Ground Fault Circuit Interrupter) outlet at the exterior did not work or there is no power to outlet. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.6 Item 1 (Picture)



6.6 Item 2 (Picture)

10. BUILT-IN KITCHEN APPLIANCES

10.1 RANGES/OVENS/COOKTOPS

📋 REPAIR OR REPLACE

1. The range/oven needs to be properly attached/anchored to the structure as to keep it from tipping over when the oven door is opened and/or oven racks are pulled out during use. This is a safety issue. Repairs are needed.

I recommend contacting appliance repair company.



10.1 Item 1 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

82

✓ ITEMS INSPECTED

Total number in report.

19

📄 SUMMARY COMMENTS

Total number in report.

91

📷 PHOTOS

Total number in report.

🏠 1. PROPERTY OVERVIEW

 STYLES & MATERIALS: PROPERTY OVERVIEW

Temperature:
Below 65 (F) = 18 (C)

Weather:
Light Rain

Rain in last 3 days:
Yes

 ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

 INSPECTED

1.1 INSPECTION LIMITATIONS

 INSPECTED

1.2 RADON TESTING

 INSPECTED

🏠 2. ROOFING

📋 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

🔧 STYLES & MATERIALS: ROOFING

Roof Covering: Architectural	Age: 5-10 Yrs	Viewed roof covering from: Walked roof
Sky Light(s): Two	Chimney (exterior): Brick	Roof-Type: Gable

👁️ ITEMS: ROOFING

2.0 ROOF COVERINGS

📋 REPAIR OR REPLACE

- (1)
1. The roof at the rear of the home has evidence of repairs. This may allow water intrusion to occur. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



2.0 Item 1 (Picture)



2.0 Item 2 (Picture)



2.0 Item 3 (Picture)

(2)

1. The roof shingles is damaged at the front of home. Unable to determine if this area will leak. Repairs are needed.

A qualified person should repair or replace as needed.



2.0 Item 4 (Picture)



2.0 Item 5 (Picture)

2.1 FLASHINGS

✓ INSPECTED

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

✓ INSPECTED

2.3 ROOF DRAINAGE SYSTEMS

✓ INSPECTED

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

3. EXTERIOR



DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

STYLES & MATERIALS: EXTERIOR

Siding Style:

Lap
Brick

Siding Material:

Vinyl
Brick veneer

Exterior Entry Doors:

Steel
Insulated glass

Appurtenance:

Deck with steps
Covered porch
Sidewalk
Patio

Driveway:

Concrete

ITEMS: EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM

 INSPECTED

3.1 EAVES, SOFFITS AND FASCIAS

 INSPECTED

3.2 WINDOWS

 REPAIR OR REPLACE

- Several windows have failed/compromised thermal seals/fogged window panes. This is indicated by the visible moisture, discoloration, calcium deposits and or crystallization visible between the glass window panes. A certified window technician should recheck all the windows throughout the home. Due to weather conditions many times compromised/failed windows cannot be identified at the time of inspection. Further investigation and repairs are needed.

We recommend contacting a properly licensed window technician/contractor regarding these conditions and have repairs made deemed appropriate



3.2 Item 1 (Picture)



3.2 Item 2 (Picture)



3.2 Item 3 (Picture)



3.2 Item 4 (Picture)

3.3 DOORS (EXTERIOR)

☑ INSPECTED

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE

(1)

1. The deck floor system at the rear of home is not supported properly. A fall or injury can occur if not corrected. I recommend having the entire deck evaluated for structural stability. Further investigation and repairs are needed.


A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)



3.4 Item 2 (Picture)

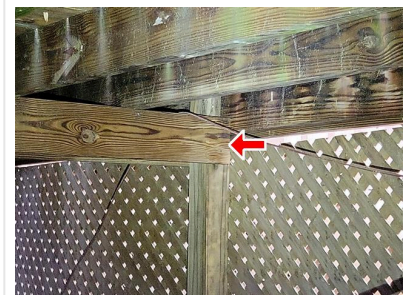

3.4 Item 3 (Picture)



3.4 Item 4 (Picture)



3.4 Item 5 (Picture)

(2)

1. The exterior girders for the wood deck are attached to the support posts by simple nail connections only. This is an uncommon construction method. Typically girders require through bolt connections, structural screws or direct bearing at end points to prevent framing movement and or failure. Deck failure could occur if not addressed. Further investigation and repairs are needed.

A qualified contractor should perform the work.



3.4 Item 6 (Picture)


(3)

1. The guardrails on deck at the rear of home are loose. A fall or injury could occur if not corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



3.4 Item 7 (Picture)

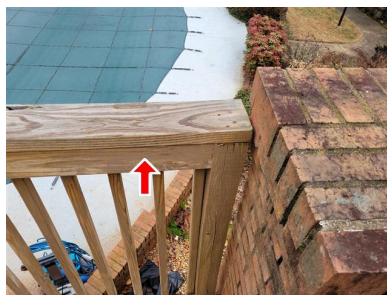

3.4 Item 8 (Picture)



3.4 Item 9 (Picture)

(4)

1. The deck at the rear of the home is showing signs of failing. I recommend having the entire deck evaluated for structural stability. Further investigation and repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 10 (Picture)




3.4 Item 11 (Picture)



3.4 Item 12 (Picture)



3.4 Item 13 (Picture)

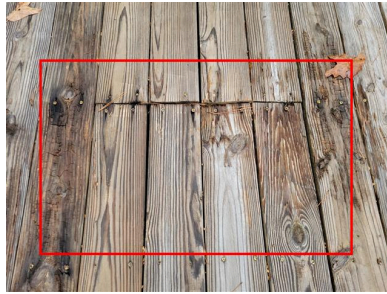

3.4 Item 14 (Picture)

(5)

1. The patio at the rear of home is deteriorated. This is allowing water intrusion to occur. Further deterioration can occur if not repaired. Further investigation and repairs are needed.

A qualified contractor should repair or replace as needed.




3.4 Item 15 (Picture)



3.4 Item 16 (Picture)



3.4 Item 17 (Picture)

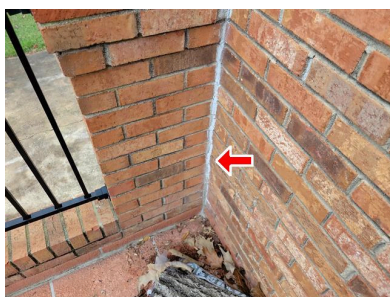

3.4 Item 18 (Picture)



3.4 Item 19 (Picture)



3.4 Item 20 (Picture)

**3.4 Item 21 (Picture)**

(6)

1. The guardrails on patio at the rear of home is loose. A fall or injury could occur if not corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.

**3.4 Item 22 (Picture)**

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☐ REPAIR OR REPLACE

(1)

1. There is a negative slope at the front of home and can cause or contribute to water intrusion or deterioration. Repairs are needed.

I recommend correcting landscape to drain water away from home.

**3.5 Item 1 (Picture)**

(2)

1. The concrete drive at the front of home uneven, and can be a tripping hazard. Water can cause further deterioration if not repaired and sealed properly. A fall or injury can occur if not corrected. Repairs are needed.

A qualified person should repair or replace as needed.



3.5 Item 2 (Picture)



3.5 Item 3 (Picture)



3.5 Item 4 (Picture)



3.5 Item 5 (Picture)



3.5 Item 6 (Picture)

3.6 GARAGE DOOR (S)

✓ INSPECTED

3.7 GARAGE DOOR OPERATORS (REPORT WHETHER OR NOT DOORS WILL REVERSE WHEN MET WITH RESISTANCE)

✓ INSPECTED

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

✓ INSPECTED

3.9 OCCUPANT DOOR (FROM GARAGE TO INSIDE OF HOME)

✓ INSPECTED

3.10 GARAGE FLOOR


✓ INSPECTED

3.11 RETAINING WALLS

✗ REPAIR OR REPLACE

1. The retaining wall at the rear of the home has evidence of movement. Further deterioration could occur. Further investigation and repairs are needed.


A qualified contractor should repair or replace as needed.

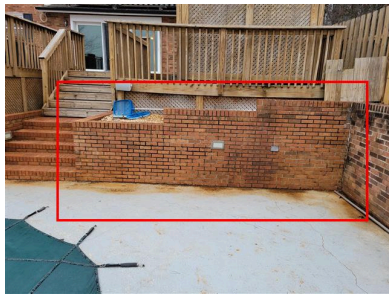

3.11 Item 1 (Picture)



3.11 Item 2 (Picture)

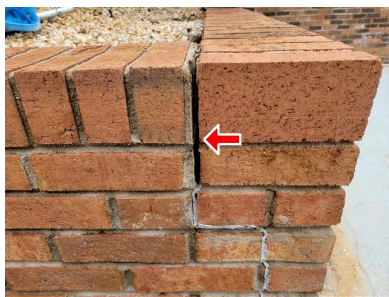

3.11 Item 3 (Picture)



3.11 Item 4 (Picture)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 4. STRUCTURAL COMPONENTS

📋 DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

🔧 STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation: Masonry block	Method used to observe Crawlspace: No crawlspace	Floor Structure: Slab
Wall Structure: Masonry	Columns or Piers: Steel lally columns	Ceiling Structure: 2X4
Roof Structure: Engineered wood trusses		

👁️ ITEMS: STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

📋 REPAIR OR REPLACE

1. The brick at the right side (facing front) and the rear have cracks present with outward displacement/ movement present. The wall(s) may need reinforcement. Further investigation and repairs are needed.


A qualified licensed general contractor should inspect further and repair as needed.




4.0 Item 1 (Picture)



4.0 Item 2 (Picture)

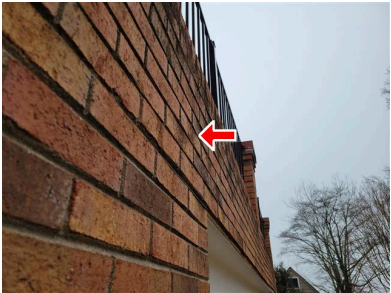

4.0 Item 3 (Picture)

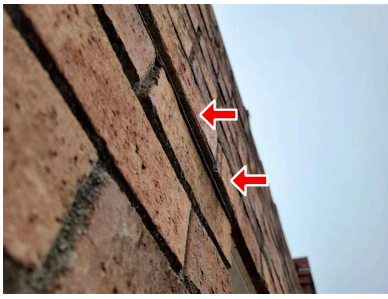

4.0 Item 4 (Picture)



4.0 Item 5 (Picture)



4.0 Item 6 (Picture)




4.0 Item 7 (Picture)



4.0 Item 8 (Picture)




4.0 Item 9 (Picture)

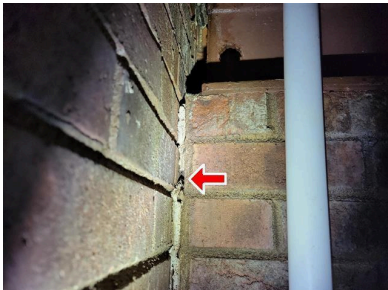

4.0 Item 10 (Picture)



4.0 Item 11 (Picture)

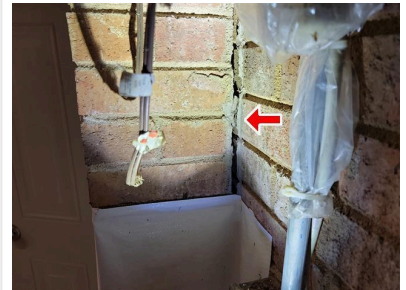


4.0 Item 12 (Picture)




4.0 Item 13 (Picture)



4.0 Item 14 (Picture)

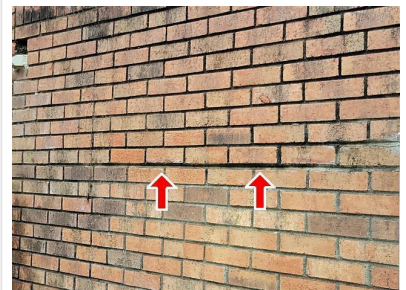

4.0 Item 15 (Picture)

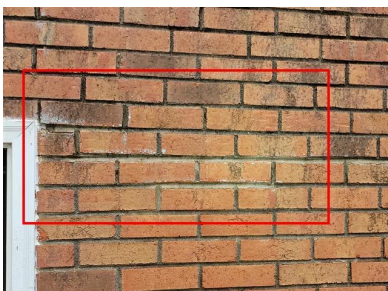

4.0 Item 16 (Picture)

4.1 COLUMNS OR PIERS

✓ INSPECTED

4.2 FLOORS (STRUCTURAL)


📋 REPAIR OR REPLACE

1. Steel truss is rusting under the concrete patio. I recommend having the steel truss evaluated for structural stability. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.



4.2 Item 1 (Picture)

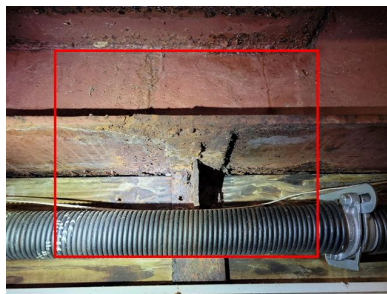

4.2 Item 2 (Picture)



4.2 Item 3 (Picture)



4.2 Item 4 (Picture)


4.3 CEILINGS (STRUCTURAL)

✓ INSPECTED


4.4 ROOF STRUCTURE AND ATTIC

📋 REPAIR OR REPLACE

1. The truss system installed in the attic have been repaired due to damage during or before installation of the truss. All truss repairs should be repaired via an approved method specified by the manufacture and or approved and stamped by licensed structural engineer. Note: No letter was present at repair. Further evaluation and repairs are needed. A qualified licensed structural engineer/design professional is recommended to evaluate the trusses for any repairs. This should include a site specific letter from the registered design professional/engineer stating what repairs (if any) are needed approval of performed repairs, signature, state license number, and state registered stamp of the engineer.

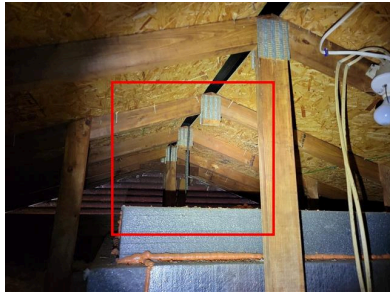

4.4 Item 1 (Picture)

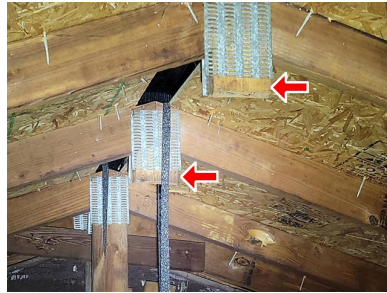

4.4 Item 2 (Picture)



4.4 Item 3 (Picture)



4.4 Item 4 (Picture)

4.5 WOOD DETERIORATION

☑ INSPECTED

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☐ REPAIR OR REPLACE

1. Visible signs of water intrusion in the garage are present from water on wall. Water intrusion if not corrected can lead to other problems including mold and cause excessive moisture to floor system that can lead to deterioration and increased repair cost. Further investigation and repairs are needed.

I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist.



4.6 Item 1 (Picture)



4.6 Item 2 (Picture)

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



Complimentary photo of the water heater

🔧 STYLES & MATERIALS: PLUMBING SYSTEM

Water Source: Public	Water Filters: None	Plumbing Water Supply (into home): Not visible
Plumbing Water Distribution (inside home): Copper	Washer Drain Size: 2" Diameter	Plumbing Waste: PVC Cast iron
Water Heater Power Source: Electric	Water Heater Capacity: 50 Gallon (2–3 people)	Manufacturer: A.O. SMITH
Water Heater Location: Basement		

👁️ ITEMS: PLUMBING SYSTEM

5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

☒ REPAIR OR REPLACE

I could not locate the main shut-off for water? Please ask the current owners for the location. Otherwise, you will need to use a water key at the street meter or have a plumber install one.

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

☒ INSPECTED

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☒ REPAIR OR REPLACE

(1)

1. The hose bib outside water faucet loose, and needs securing to wall at the front of home. This can allow undue stress to occur on supply lines allowing leaks to occur. Repairs are needed..

A qualified licensed plumber should repair or correct as needed.



5.2 Item 1 (Picture)




5.2 Item 2 (Picture)


(2)

1. The tub spout diverter is does not function properly at the guest bath. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.

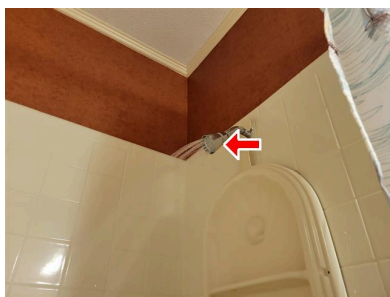

5.2 Item 3 (Picture)

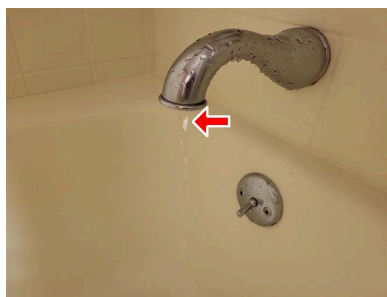

5.2 Item 4 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE

1. There is a plumbing leak under the guest bathroom 2nd floor. This is causing water damage to occur to the home. I am unable to determine how much damage has occurred to the home. Further investigation and repairs are needed.


I recommend having the light fixture in the kitchen evaluated due to the volume of water that traveled

through it. Further investigation and repairs are needed.


I recommend a qualified licensed plumber repair or correct as needed.



5.3 Item 1 (Picture)

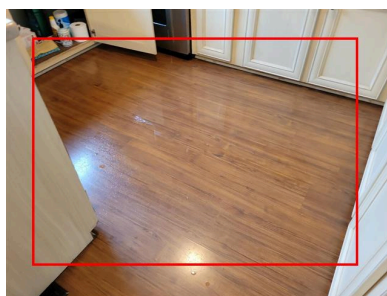

5.3 Item 2 (Picture)

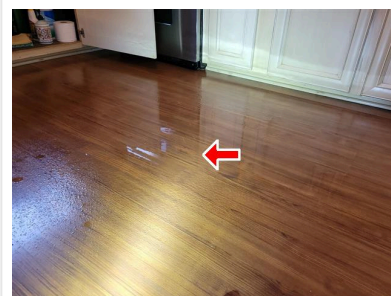

5.3 Item 3 (Picture)

5.4 SHOWER/TUB & TILE WALLS

✓ INSPECTED

5.5 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)


📁 REPAIR OR REPLACE

1. The gas line was installed improperly using soft copper through wall instead of hard piping at the fireplace. This is a safety issue and should be repaired. Further investigation and repairs are needed.

A qualified person should repair or replace as needed



5.5 Item 1 (Picture)

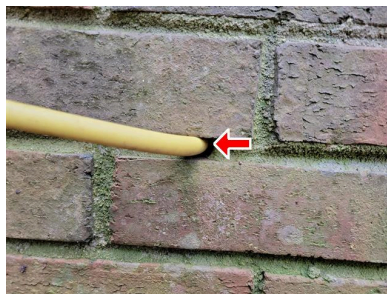


5.5 Item 2 (Picture)

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.


🏠 6. ELECTRICAL SYSTEM

☰ DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

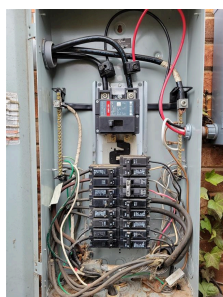

Complimentary photo of the electric panel with the cover off

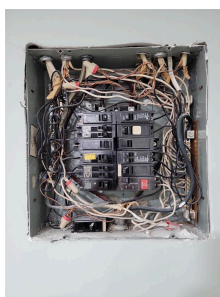

Complimentary photo of the sub panel with the cover off

✂ STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service Conductors:

Below ground
Copper

Panel capacity:

200 AMP

Panel Type:

Circuit breakers

Electric Panel Manufacturer:

CUTLER HAMMER

Branch wire 15 and 20 AMP:

Copper

Wiring Methods:

Romex

👁 ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

☑ INSPECTED

The main panel box is located at the outside.

6.1 SERVICE ENTRANCE CONDUCTORS

✓ INSPECTED


6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

📋 REPAIR OR REPLACE

(1)

1. The wire protection grommets are missing where the branch wiring enters the panel. Electrical issues are considered a hazard until repaired. Repairs are recommended.

A qualified licensed electrical contractor should correct as needed.

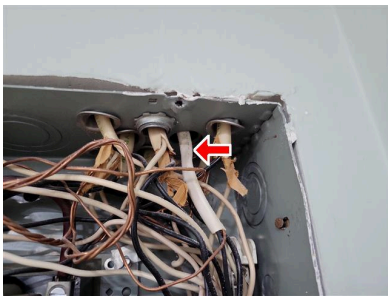

6.2 Item 1 (Picture)

(2)

1. The electrical panel cover sub panel has been secured with sheet metal screws. This is considered unsafe as sheet metal screws are not rated for electrical panel use. The use of sheet metal screws with panel cover has been known to short hot wires, as they can pierce the branch wiring protective coverings. (Safety Issue) Repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.2 Item 2 (Picture)

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE,

GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

✓ INSPECTED

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

✓ INSPECTED

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

📋 REPAIR OR REPLACE

1. At least one GFCI (Ground Fault Circuit Interrupter) outlet at the exterior did not work or there is no power to outlet. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.6 Item 1 (Picture)



6.6 Item 2 (Picture)

6.7 SMOKE DETECTORS

✓ INSPECTED

6.8 CARBON MONOXIDE DETECTORS

✓ INSPECTED

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.


🏠 7. HEATING / CENTRAL AIR CONDITIONING

📋 DESCRIPTION

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



Complimentary photo of the heat pump

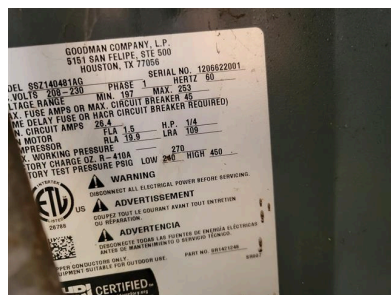

Complimentary photo of the heat pump

✂ STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type:

Heat Pump Forced Air (also provides cool air)

Energy Source:

Electric

Ductwork:

Insulated

Number of Woodstoves:

None

Cooling Equipment Energy Source:

Electricity

Heating Age:

10-15 yrs

Operated:

Unit Operated

Types of Fireplaces:

Non-vented gas logs

Cooling Equipment Type:

Heat Pump Forced Air (also provides warm air)

Central Air Manufacturer:

GOODMAN

Number of Heat Systems (excluding wood):

One

Heat System Brand:

GOODMAN

Operable Fireplaces:

One

Air Conditioning Age:

10-15 yrs

Number of AC Only Units:

One

👁 ITEMS: HEATING / CENTRAL AIR CONDITIONING

7.0 HEATING EQUIPMENT

✓ INSPECTED

7.1 NORMAL OPERATING CONTROLS

✓ INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

✓ INSPECTED

7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

✓ INSPECTED

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

✓ INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

✓ INSPECTED

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

✓ NOT PRESENT

7.7 GAS/LP FIRELOGS AND FIREPLACES

✓ INSPECTED

7.8 COOLING AND AIR HANDLER EQUIPMENT

✓ REPAIR OR REPLACE

The A/C was not tested for proper operation due to the outside air temperature is 65 degrees or less. We did not inspect this unit(s).

7.9 NORMAL OPERATING CONTROLS

✓ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

✓ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 8. INTERIORS

☰ DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

✂️ STYLES & MATERIALS: INTERIORS

Ceiling Materials: Drywall Ceiling Tile	Wall Material: Drywall	Floor Covering(s): Area rug Brick Laminated T&G Vinyl
Interior Doors: Hollow core Raised panel	Window Types: Thermal/Insulated Double-hung Tilt feature Fixed	

👁️ ITEMS: INTERIORS

8.0 CEILINGS

✔️ INSPECTED

8.1 WALLS

✔️ INSPECTED

8.2 FLOORS

✔️ INSPECTED

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

✔️ INSPECTED

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

✔️ INSPECTED


8.5 DOORS (REPRESENTATIVE NUMBER)

✔️ REPAIR OR REPLACE

(1)

1. The privacy door rubs at top when closing at the master bath. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

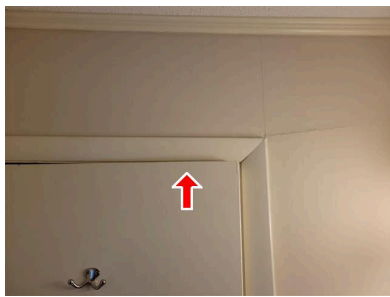

8.5 Item 1 (Picture)

(2)

1. The door at guest Bedroom will not latch properly. Evidence suggest that the door needs strike and latch adjustment to shut properly. This is a small repair.

A qualified person should repair or replace as needed.

8.6 WINDOWS (REPRESENTATIVE NUMBER)

☑ INSPECTED

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 9. INSULATION AND VENTILATION

☰ DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

✂ STYLES & MATERIALS: INSULATION AND VENTILATION

Attic info: Scuttle hole	Method used to observe attic: From entry	Attic Insulation: Blown Fiberglass
Ventilation: Gable vents Ridge vents Soffit Vents	Exhaust Fans: Fan with light	Dryer Power Source: 220 Electric
Dryer Vent: Flexible Metal	Floor System Insulation: NONE	

👁 ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

✔ NOT PRESENT

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

✔ NOT PRESENT

9.2 INSULATION IN ATTIC

✔ INSPECTED

9.3 INSULATION UNDER FLOOR SYSTEM

✔ NOT PRESENT

9.4 ATTIC ACCESS

✔ INSPECTED

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

☑ REPAIR OR REPLACE

1. The exhaust fan does not vent to outside at the guest and master bath. Vent pipes should terminate outside and not in the attic. Many homes have their vent pipe poised at the roof vent such as yours. It is up to you to determine whether or not this is a concern or needs further consideration from a general contractor. Repairs are needed.

A qualified person should repair or replace as needed.



9.5 Item 1 (Picture)

9.6 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

☑ INSPECTED

1. Whole house fan in the attic was insulated or blocked during inspection for winterization. Damage can occur if someone turns on switch. I did not inspect this unit.

A qualified person should repair or replace as needed.



9.6 Item 1 (Picture)

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 10. BUILT-IN KITCHEN APPLIANCES

📋 DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

✂️ STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Corian

Cabinetry:

Wood

👁️ ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER


✅ INSPECTED

10.1 RANGES/OVENS/COOKTOPS

📋 REPAIR OR REPLACE

1. The range/oven needs to be properly attached/anchored to the structure as to keep it from tipping over when the oven door is opened and/or oven racks are pulled out during use. This is a safety issue. Repairs are needed.

I recommend contacting appliance repair company.

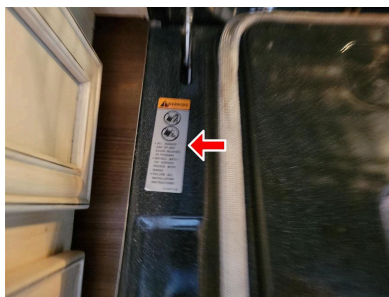

10.1 Item 1 (Picture)

10.2 RANGE HOOD (S)

✅ INSPECTED

10.3 TRASH COMPACTOR

✅ NOT PRESENT

10.4 FOOD WASTE DISPOSER

✓ INSPECTED

10.5 MICROWAVE COOKING EQUIPMENT

✓ REPAIR OR REPLACE

1. The microwave has improper clearance from the stove top. This can cause damage to the microwave. I recommend repair as needed.

I recommend contacting appliance repair company.



10.5 Item 1 (Picture)

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



Above Parr Home Inspections

Report Attachments

ATTENTION: This inspection report is incomplete without reading the information included herein at these links/ attachments. Note If you received a printed version of this page and did not receive a copy of the report through the internet please contact your inspector for a printed copy of the attachments.

[NC WDIIR](#)