



INSPECTION REPORT
9008 Brentfield Rd
Huntersville NC

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 7/22/2024
🕒 09:00:00 AM

Michael A Parr
3692

INVOICE

Above Parr Home Inspections

Inspected By: Alex Parr 3692

Inspection Date: 7/22/2024
Report ID: 072224AP3

Customer Info:	Inspection Property:
Deanna Whalen Customer's Real Estate Professional: Jake Reed NextHome at the Lake	9008 Brentfield Rd Huntersville NC

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	670.00	1	670.00
WDI/Termite	75.00	1	75.00

Tax \$0.00
Total Price \$745.00

Payment Method: Credit Card
Payment Status: Paid
Note:

GENERAL INFO

Property Address

9008 Brentfield Rd
Huntersville NC

Date of Inspection

7/22/2024

Report ID

072224AP3

Customer(s)

Deanna Whalen

Time of Inspection

09:00:00 AM

Real Estate Agent

Jake Reed
NextHome at the Lake

INSPECTION DETAILS

Approximate age of building:

Over 25 Years

In Attendance:

Vacant (inspector only)

Radon Test:

No

Water Test:

No

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

Yes

Type of building:

Single Family (2 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

TABLE OF CONTENTS

Cover Page1

Invoice 2

Intro Page 3

Table of Contents 4

General Summary 5

1 Property Overview 17

2 Roofing19

3 Exterior22

4 Structural Components 30

5 Plumbing System 33

6 Electrical System 38

7 Heating / Central Air Conditioning 42

8 Interiors 45

9 Insulation and Ventilation 48

10 Built-In Kitchen Appliances 52

Attachments 54

GENERAL SUMMARY

Above Parr Home Inspections

Customer

Deanna Whalen

Address

9008 Brentfield Rd
Huntersville NC

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.


1. PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

REPAIR OR REPLACE

1. Discoloration and some type of mold (Microbial) growth is present in the structure at several areas including but not limited to the crawl space and interior spaces. Evidence suggests that this condition is from a past or present elevated moisture conditions. We did not inspect, test or determine if this type of substance is or is not a health hazard. Further investigation is needed.

We recommend you contact a properly licensed expert for testing, investigation and or correction as deemed appropriate.

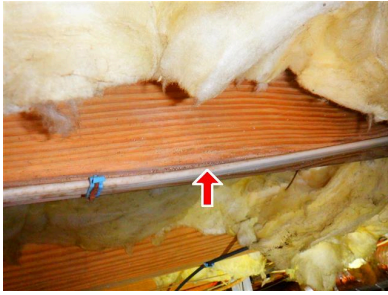

1.0 Item 1 (Picture)

2. ROOFING

2.0 ROOF COVERINGS

☐ REPAIR OR REPLACE

1. The roof shingles is damaged/deteriorated at the at rear of home. This damage should be repaired or replaced. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



2.0 Item 1 (Picture)




2.0 Item 2 (Picture)




2.0 Item 3 (Picture)



2.0 Item 4 (Picture)

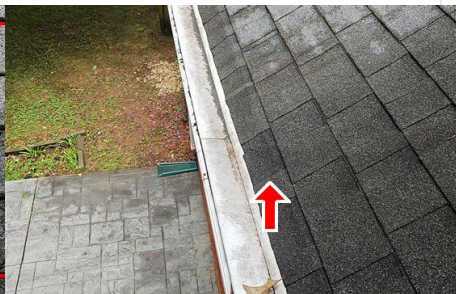

2.0 Item 5 (Picture)

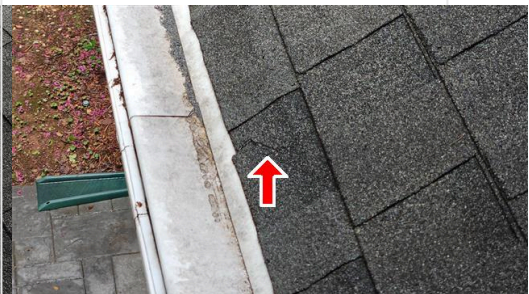

2.0 Item 6 (Picture)

3. EXTERIOR


3.0 WALL CLADDING FLASHING AND TRIM

☐ REPAIR OR REPLACE

(1)

1. The composite board siding at the at rear of home is deteriorated. Further deterioration can occur if

not corrected. Further investigation is damaged.
A qualified contractor should inspect and repair as needed.

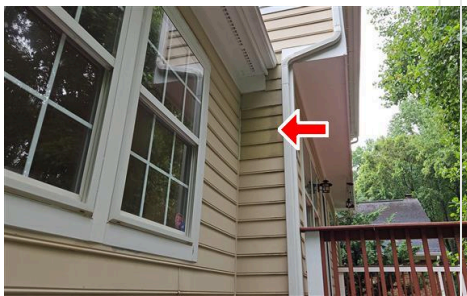

3.0 Item 1 (Picture)



3.0 Item 2 (Picture)



3.0 Item 3 (Picture)



3.0 Item 4 (Picture)

3.2 WINDOWS

REPAIR OR REPLACE

(1)

1. Several windows have failed/compromised thermal seals/fogged window panes. This is indicated by the visible moisture, discoloration, calcium deposits and or crystallization visible between the glass window panes. A certified window technician should recheck all the windows throughout the home. Due to weather conditions many times compromised/failed windows cannot be identified at the time of inspection. Further investigation and repairs are needed.

We recommend contacting a properly licensed window technician/contractor regarding these conditions and have repairs made deemed appropriate



3.2 Item 1 (Picture)



3.2 Item 2 (Picture)



3.2 Item 3 (Picture)



3.2 Item 4 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE

(1)

1. The deck floor at the rear of home is deteriorated. Further deterioration can occur if not repaired. Further investigation and repairs are needed.


A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)



3.4 Item 2 (Picture)

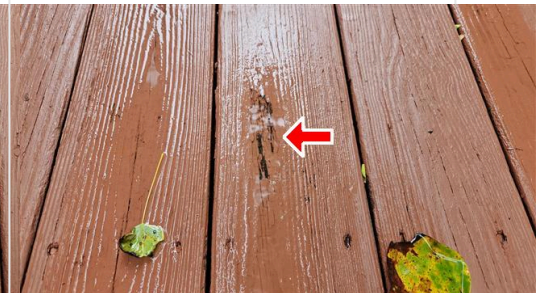

3.4 Item 3 (Picture)



3.4 Item 4 (Picture)



3.4 Item 5 (Picture)



3.4 Item 6 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☐ REPAIR OR REPLACE

(1)

1. The concrete drive at the right side (facing front) uneven, and can be a tripping hazard. A fall or injury can occur if not corrected. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



3.5 Item 1 (Picture)



3.5 Item 2 (Picture)



3.5 Item 3 (Picture)



3.5 Item 4 (Picture)

3.6 GARAGE DOOR (S)

☐ REPAIR OR REPLACE

(1)

1. The spring for garage door (s) at the right side (facing front) is disconnected and or damaged. This is considered unsafe and needs correcting. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.




3.6 Item 1 (Picture)

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

☐ REPAIR OR REPLACE

1. The fire resistance sheathing that separates garage from heated space is compromised. This is considered unsafe until corrected. Repairs are needed.

A qualified person should correct for safety.

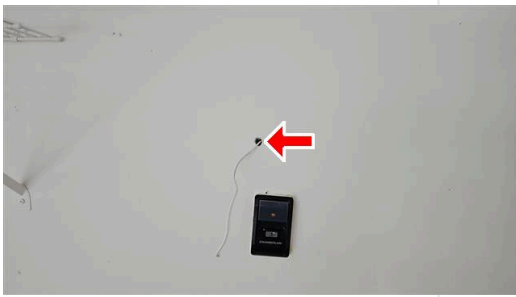

3.8 Item 1 (Picture)

4. STRUCTURAL COMPONENTS

4.4 ROOF STRUCTURE AND ATTIC

REPAIR OR REPLACE

1. The 2x4 roof support is damaged. Repairs may be needed to maintain the stability of roof. Further investigation and repairs are needed.

A qualified contractor should repair as needed.



4.4 Item 1 (Picture)



4.4 Item 2 (Picture)



4.4 Item 3 (Picture)

4.5 WOOD DETERIORATION

REPAIR OR REPLACE

1. Wood debris is in contact with the crawl space floor in numerous areas. This can attract wood destroying organisms. Removal is needed.

A qualified contractor should inspect and repair as needed.



4.5 Item 1 (Picture)

5. PLUMBING SYSTEM

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

REPAIR OR REPLACE

1. The gas water heater water heater stand does not appear to be stable. This is a safety issue and should be repaired. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 1 (Picture)



5.1 Item 2 (Picture)


5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

REPAIR OR REPLACE

(1)

1. The control lever valve stop is damage and is loose at the guest bath. Therefore it does not function as intended. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

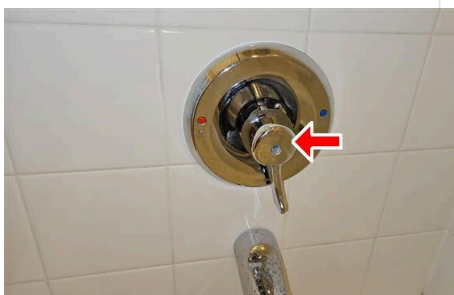

5.2 Item 1 (Picture)



5.2 Item 2 (Picture)

(2)

1. The toilet handle it is installed upside down at the guest bath. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.2 Item 3 (Picture)

(3)

1. The faucet difficult to operate at the kitchen sink. Therefore it does not function as intended. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.2 Item 4 (Picture)


5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE

(1)

1. The plumbing waste line leaks (under sink) under the master bath. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.

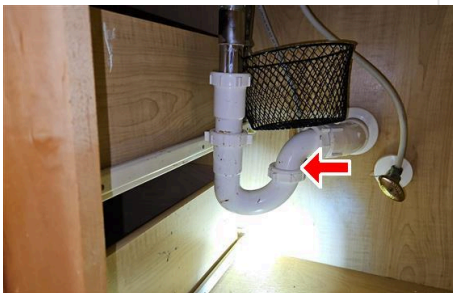

5.3 Item 1 (Picture)



5.3 Item 2 (Picture)

(2)

1. The toilet will not stop running at the guest bath. The flapper will likely need replacing. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 3 (Picture)

6. ELECTRICAL SYSTEM

6.1 SERVICE ENTRANCE CONDUCTORS

REPAIR OR REPLACE

1. The electrical service conduit is disconnected at the left side of the home. This could allow for water intrusion or an interruption in service. Further investigation and repairs are needed.

I recommend a licensed electrical contractor inspect further and correct as needed.



6.1 Item 1 (Picture)



6.1 Item 2 (Picture)

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

REPAIR OR REPLACE

(1)

1. One or more open splice needs placing inside a box with a cover-plate in the attic space. This is a safety issue. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 1 (Picture)



6.4 Item 2 (Picture)

(2)

1. The ceiling fan "wobbles" in the master bedroom. Some fans that wobble cannot be corrected without replacement. This is a safety issue. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 3 (Picture)

(3)

1. The wall switch is missing "cover-plate" at the guest bedroom closet. This is a safety issue that needs to be corrected. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 4 (Picture)

7. HEATING / CENTRAL AIR CONDITIONING

7.7 GAS/LP FIRELOGS AND FIREPLACES

☐ REPAIR OR REPLACE

(1)

1. The black soot build-up indicates that Gas Fire logs do not appear to be arranged or positioned

according to manufacturer's specs. If logs are not positioned correctly, carbon monoxide can be produced. Further investigation and repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.



7.7 Item 1 (Picture)



7.7 Item 2 (Picture)



7.7 Item 3 (Picture)

(2)

1. The non-vented fire logs (natural gas) in the Living room shut off valve was in the off position. As a result I did not operate the gas logs due to safety reason. The inspector assumes that if a gas appliance shut off valve is in the off position it is for a reason. Further investigation is recommended..

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.



7.7 Item 4 (Picture)

8. INTERIORS

8.5 DOORS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE


(1)

1. The bifold door is out of track add the bonus room. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.



8.5 Item 1 (Picture)

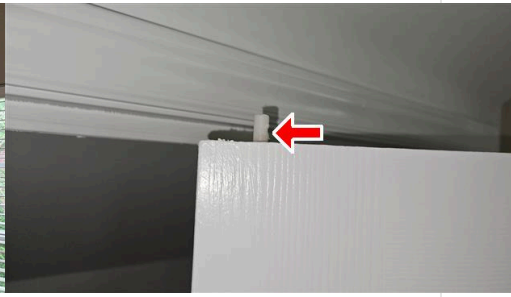

8.5 Item 2 (Picture)

9. INSULATION AND VENTILATION


9.4 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

☐ REPAIR OR REPLACE

(1)

1. No ventilation (window or exhaust fan) for the guest bath. Normally an exhaust fan or window is needed for proper ventilation. Adverse moisture conditions could occur if not corrected. I did not inspect to determine what steps are needed to comply. Repairs are needed.

A qualified contractor should inspect and repair as needed.

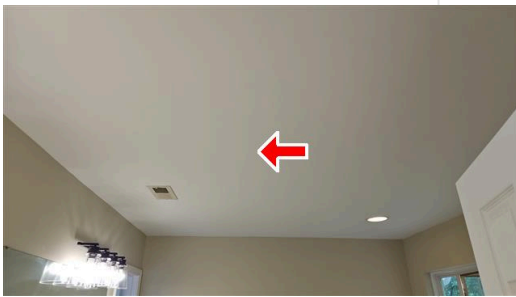

9.4 Item 1 (Picture)

10. BUILT-IN KITCHEN APPLIANCES

10.2 RANGE HOOD (S)

☐ REPAIR OR REPLACE

1. The range hood controls did not function properly. Further investigation and repairs are needed. I recommend contacting appliance repair company.



10.2 Item 1 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

88

✓ ITEMS INSPECTED
Total number in report.

25

📄 SUMMARY COMMENTS
Total number in report.

96

📷 PHOTOS
Total number in report.

🏠 1. PROPERTY OVERVIEW

✂ STYLES & MATERIALS: PROPERTY OVERVIEW

Temperature:

Over 65 (F) = 18 (C)

Weather:

Light Rain

Rain in last 3 days:

Yes


👁 ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

📋 REPAIR OR REPLACE

1. Discoloration and some type of mold (Microbial) growth is present in the structure at several areas including but not limited to the crawl space and interior spaces. Evidence suggests that this condition is from a past or present elevated moisture conditions. We did not inspect, test or determine if this type of substance is or is not a health hazard. Further investigation is needed.

We recommend you contact a properly licensed expert for testing, investigation and or correction as deemed appropriate.

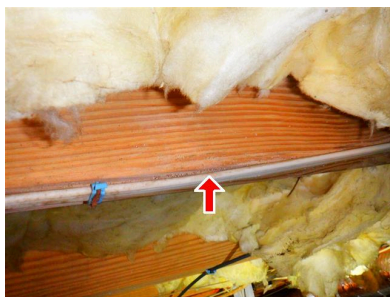

1.0 Item 1 (Picture)

1.1 INSPECTION LIMITATIONS

☑ INSPECTED

1.2 RADON TESTING

☑ NOT INSPECTED

🏠 2. ROOFING

📋 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

🔧 STYLES & MATERIALS: ROOFING

Roof Covering: Architectural	Age: 15–20 Yrs	Viewed roof covering from: Ground Camera Optical Zoom
Sky Light(s): None	Chimney (exterior): Brick	Roof–Type: Gable Hip

👁️ ITEMS: ROOFING

2.0 ROOF COVERINGS

📋 REPAIR OR REPLACE

1. The roof shingles is damaged/deteriorated at the at rear of home. This damage should be repaired or replaced. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



2.0 Item 1 (Picture)




2.0 Item 2 (Picture)




2.0 Item 3 (Picture)



2.0 Item 4 (Picture)

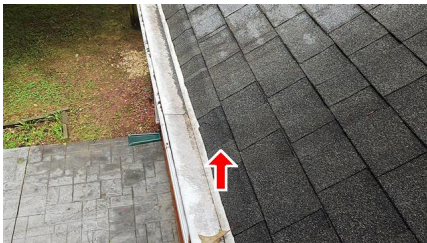

2.0 Item 5 (Picture)

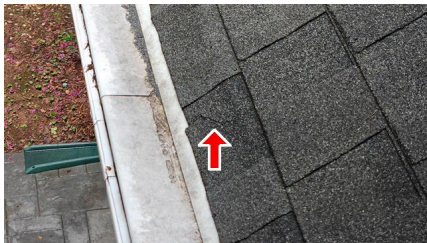

2.0 Item 6 (Picture)

2.1 FLASHINGS

✓ INSPECTED

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

✓ INSPECTED

2.3 ROOF DRAINAGE SYSTEMS

✓ REPAIR OR REPLACE

(1)

1. The gutter leaks at seam (s) at the virtually all areas where gutters are installed. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 1 (Picture)



2.3 Item 2 (Picture)



2.3 Item 3 (Picture)



2.3 Item 4 (Picture)

(2)

1. The downspout missing part (S) at the left corner (facing rear). This can lead to water intrusion.

Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 5 (Picture)



2.3 Item 6 (Picture)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 3. EXTERIOR



 DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

 STYLES & MATERIALS: EXTERIOR

Siding Style: Lap Brick	Siding Material: Composite board Brick veneer	Exterior Entry Doors: Wood Steel Insulated glass
Appurtenance: Deck with steps Sidewalk Patio	Driveway: Concrete	

 ITEMS: EXTERIOR


3.0 WALL CLADDING FLASHING AND TRIM

 REPAIR OR REPLACE

(1)

1. The composite board siding at the rear of home is deteriorated. Further deterioration can occur if not corrected. Further investigation is damaged.


A qualified contractor should inspect and repair as needed.

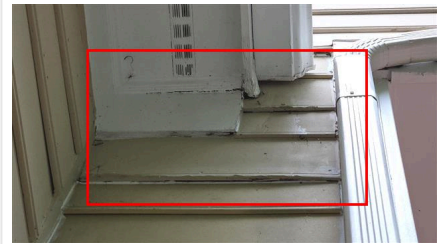**3.0 Item 1 (Picture)****3.0 Item 2 (Picture)****3.0 Item 3 (Picture)****3.0 Item 4 (Picture)**

(2)

1. I observed small cracks in the brick veneer at the exterior. These are typical in nature due to age and normal masonry shrinkage. Although the cracks in the brick veneer are typical, these areas should be re sealed to prevent any water penetration or damage. Further evaluation by a qualified masonry contractor is recommended for this entire condition.

I recommend repair or replace using a qualified contractor.

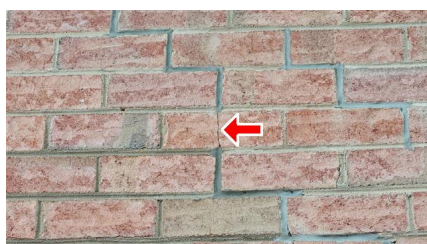**3.0 Item 5 (Picture)****3.0 Item 6 (Picture)****3.0 Item 7 (Picture)**

3.1 EAVES, SOFFITS AND FASCIAS

✓ INSPECTED

3.2 WINDOWS

☐ REPAIR OR REPLACE

(1)

1. Several windows have failed/compromised thermal seals/fogged window panes. This is indicated by the visible moisture, discoloration, calcium deposits and or crystallization visible between the glass window panes. A certified window technician should recheck all the windows throughout the home. Due to weather conditions many times compromised/failed windows cannot be identified at the time of inspection. Further investigation and repairs are needed.

We recommend contacting a properly licensed window technician/contractor regarding these conditions and have repairs made deemed appropriate



3.2 Item 1 (Picture)



3.2 Item 2 (Picture)



3.2 Item 3 (Picture)



3.2 Item 4 (Picture)

(2)

1. The steel lintels around the exterior of the home are beginning to rust or have rust present. A lintel is a horizontal architectural member or steel beam support placed over a wall opening to carry the weight of the masonry placed over it. In most situation, the lintel above you windows and doors will be steel angle iron or I beam. Either due to age or improper rust proofing or weep chord and flashing placement during installation, lintels will begin to rust. Rusting lintels can expand to become mush thicker then their original size. The expansive forces of rusting steel can shift entire multi-story elevations. If your lintels are currently rusting, a telltale sign of expansion is diagonal "step" pattern cracks, which can be found on either end of the window or door opening. Repairs are needed to prevent further damage to the structure. Further deterioration may occur if not repaired.

I recommend a qualified contractor inspect and repair as needed.



3.2 Item 5 (Picture)



3.2 Item 6 (Picture)

3.3 DOORS (EXTERIOR)

✓ INSPECTED

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE


(1)

1. The deck floor at the at rear of home is deteriorated. Further deterioration can occur if not repaired. Further investigation and repairs are needed.


A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

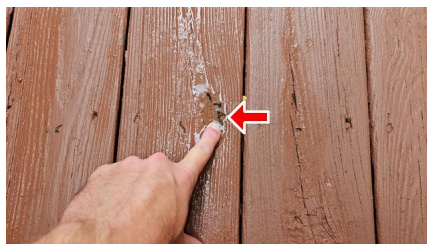

3.4 Item 2 (Picture)

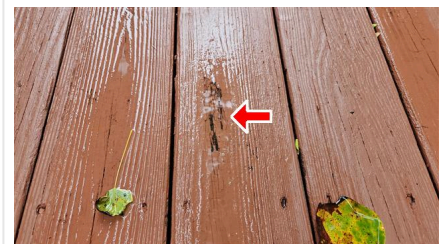


3.4 Item 3 (Picture)



3.4 Item 4 (Picture)



3.4 Item 5 (Picture)

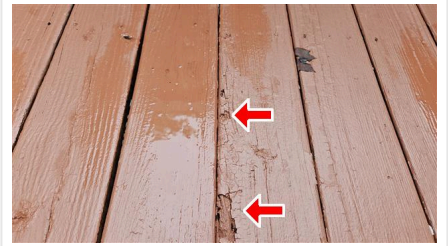

3.4 Item 6 (Picture)

(2)

1. The brick steps at the front entry is deteriorated. Further deterioration can occur. Further investigation and repairs are needed..

A qualified contractor should repair or replace as needed.



3.4 Item 7 (Picture)



3.4 Item 8 (Picture)



3.4 Item 9 (Picture)



3.4 Item 10 (Picture)

(3)

1. The balusters on deck, rear of home are attached improperly. Attached balusters are top and bottom (1) #8 wood screw or (2) 8d post frame threaded nails. A repair is needed to ensure stability or an injury might occur. Repairs are needed.

A qualified person should repair or replace as needed.



3.4 Item 11 (Picture)



3.4 Item 12 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☐ REPAIR OR REPLACE

(1)

1. The concrete drive at the right side (facing front) uneven, and can be a tripping hazard. A fall or injury can occur if not corrected. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



3.5 Item 1 (Picture)



3.5 Item 2 (Picture)



3.5 Item 3 (Picture)



3.5 Item 4 (Picture)

(2)

1. The concrete drive at the front of home deteriorated in areas. Water can cause further deterioration if not repaired and sealed properly. Repairs are needed.

A qualified person should repair or replace as needed.



3.5 Item 5 (Picture)



3.5 Item 6 (Picture)



3.5 Item 7 (Picture)

3.6 GARAGE DOOR (S)

☐ REPAIR OR REPLACE

(1)

1. The spring for garage door (s) at the right side (facing front) is disconnected and or damaged. This is considered unsafe and needs correcting. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.




3.6 Item 1 (Picture)

(2)

1. The two-door garage at the right side (facing front) shows deterioration on bottom of side jams. Further deterioration may occur if not repaired.

A qualified person should repair or replace as needed.

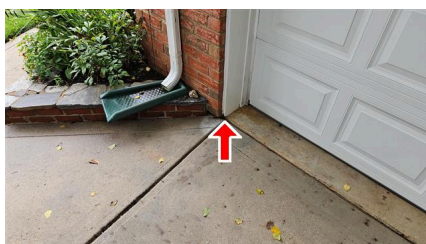

3.6 Item 2 (Picture)



3.6 Item 3 (Picture)

3.7 GARAGE DOOR OPERATORS (REPORT WHETHER OR NOT DOORS WILL REVERSE WHEN MET WITH RESISTANCE)


✓ INSPECTED

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

📋 REPAIR OR REPLACE

1. The fire resistance sheathing that separates garage from heated space is compromised. This is considered unsafe until corrected. Repairs are needed.

A qualified person should correct for safety.

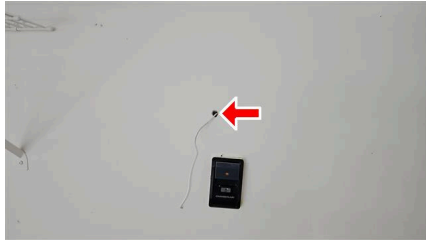

3.8 Item 1 (Picture)

3.9 OCCUPANT DOOR (FROM GARAGE TO INSIDE OF HOME)

✓ INSPECTED

3.10 GARAGE FLOOR

✓ INSPECTED

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

4. STRUCTURAL COMPONENTS

DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation:

Masonry block

Method used to observe
Crawlspace:

Crawled

Floor Structure:

8" or better

Wall Structure:

Wood

Columns or Piers:

Masonry block

Ceiling Structure:

2X4

6" or better

Roof Structure:

Engineered wood trusses

2 X 10 Rafters

ITEMS: STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

 INSPECTED

4.1 COLUMNS OR PIERS

 INSPECTED

4.2 FLOORS (STRUCTURAL)

 INSPECTED

4.3 CEILINGS (STRUCTURAL)

 INSPECTED

4.4 ROOF STRUCTURE AND ATTIC

 REPAIR OR REPLACE

1. The 2x4 roof support is damaged. Repairs may be needed to maintain the stability of roof. Further

investigation and repairs are needed.
A qualified contractor should repair as needed.



4.4 Item 1 (Picture)



4.4 Item 2 (Picture)



4.4 Item 3 (Picture)

4.5 WOOD DETERIORATION

☐ REPAIR OR REPLACE

1. Wood debris is in contact with the crawl space floor in numerous areas. This can attract wood destroying organisms. Removal is needed.

A qualified contractor should inspect and repair as needed.



4.5 Item 1 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☒ REPAIR OR REPLACE

1. Dark stains on the CMU (Concrete Masonry Unit) Indicated that water is inside the block. Dark stains and white efflorescence (powder substance) on block wall indicates moisture is in contact with the masonry. This does not necessarily indicate that intrusion will occur. Efflorescence is found on many homes without water intrusion occurring inside the home. But, it should alert you to the possibility that future steps may be needed. Further investigation and repairs are needed.

I recommend contact a licensed water intrusion specialist regarding these conditions.



4.6 Item 1 (Picture)



4.6 Item 2 (Picture)



4.6 Item 3 (Picture)



4.6 Item 4 (Picture)



4.6 Item 5 (Picture)

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

🔧 STYLES & MATERIALS: PLUMBING SYSTEM


Water Source: Public	Water Filters: None	Plumbing Water Supply (into home): Pex
Plumbing Water Distribution (inside home): PEX	Washer Drain Size: 2" Diameter	Plumbing Waste: PVC
Water Heater Power Source: Gas (quick recovery)	Water Heater Capacity: 50 Gallon (2-3 people)	Water Heater Location: Garage

👁️ ITEMS: PLUMBING SYSTEM


5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

✔️ INSPECTED

The main shut off is the white lever located coat closet. This is for your information.

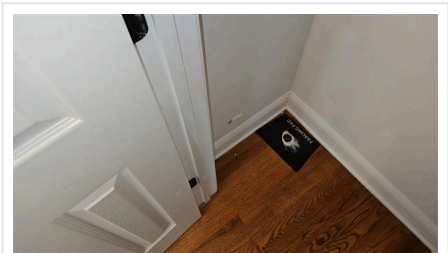

5.0 Item 1 (Picture)

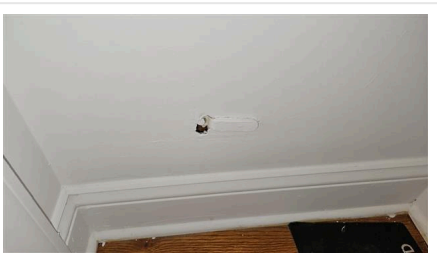

5.0 Item 2 (Picture)

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS


REPAIR OR REPLACE

1. The gas water heater water heater stand does not appear to be stable. This is a safety issue and should be repaired. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 1 (Picture)

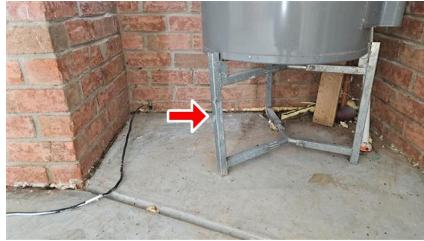

5.1 Item 2 (Picture)


5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

REPAIR OR REPLACE

(1)

1. The control lever valve stop is damage and is loose at the guest bath. Therefore it does not function as intended. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

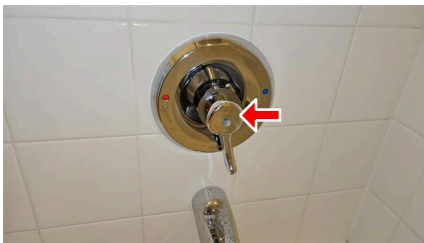

5.2 Item 1 (Picture)



5.2 Item 2 (Picture)

(2)

1. The toilet handle it is installed upside down at the guest bath. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.




5.2 Item 3 (Picture)

(3)

1. The faucet difficult to operate at the kitchen sink. Therefore it does not function as intended. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

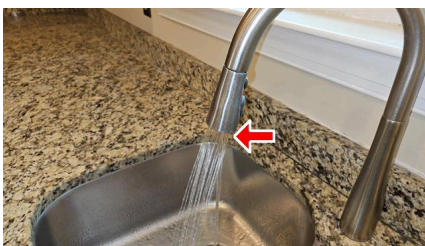

5.2 Item 4 (Picture)


5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

📋 REPAIR OR REPLACE

(1)

1. The plumbing waste line leaks (under sink) under the master bath. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.

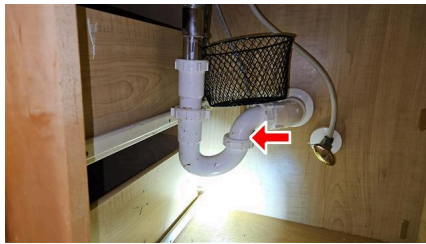

5.3 Item 1 (Picture)



5.3 Item 2 (Picture)

(2)

1. The toilet will not stop running at the guest bath. The flapper will likely need replacing. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 3 (Picture)

5.4 SINKS, FIXTURES, AND TOILETS

✓ INSPECTED

5.5 SHOWER/TUB & TILE WALLS

✓ INSPECTED

5.6 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)

✓ INSPECTED

5.7 SUMP PUMP

✓ INSPECTED


The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting

for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.


🏠 6. ELECTRICAL SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

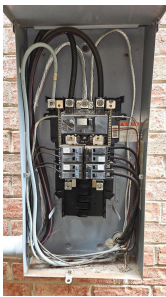

Complimentary photo of the electric panel with the cover off

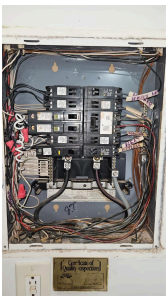

Complimentary photo of the sub panel with the cover off

⚙️ STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service Conductors: Below ground Aluminum	Panel capacity: 200 AMP	Panel Type: Circuit breakers
Electric Panel Manufacturer: SQUARE D	Branch wire 15 and 20 AMP: Copper	Wiring Methods: Romex

🔍 ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

The main panel box is located at the outside.

6.1 SERVICE ENTRANCE CONDUCTORS

📋 REPAIR OR REPLACE

1. The electrical service conduit is disconnected at the left side of the home. This could allow for water intrusion or an interruption in service. Further investigation and repairs are needed.

I recommend a licensed electrical contractor inspect further and correct as needed.



6.1 Item 1 (Picture)



6.1 Item 2 (Picture)

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

📋 REPAIR OR REPLACE

(1)

1. One or more open splice needs placing inside a box with a cover-plate in the attic space. This is a safety issue. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 1 (Picture)



6.4 Item 2 (Picture)

(2)

1. The ceiling fan "wobbles" in the master bedroom. Some fans that wobble cannot be corrected without replacement. This is a safety issue. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.




6.4 Item 3 (Picture)

(3)

1. The wall switch is missing "cover-plate" at the guest bedroom closet. This is a safety issue that needs to be corrected. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.

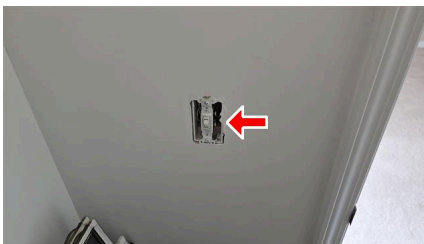

6.4 Item 4 (Picture)

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

✓ INSPECTED

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

☑ INSPECTED

6.7 SMOKE DETECTORS

☑ INSPECTED

6.8 CARBON MONOXIDE DETECTORS

☑ INSPECTED

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 7. HEATING / CENTRAL AIR CONDITIONING

📋 DESCRIPTION

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



Complimentary photo of the AC units



✂ STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type:

Forced Air

Heating Age:

1-5 yrs

Number of Heat Systems

(excluding wood):

Two

Energy Source:

Natural gas

Operated:

Summer-Did not operate due to weather conditons. (Could damage the system)

Heat System Brand:

RUUD

TRANE

Ductwork:

Insulated

Types of Fireplaces:

Vented gas logs

Operable Fireplaces:

One

Number of Woodstoves:

None

Cooling Equipment Type:

Air conditioner unit

Air Conditioning Age:

1-5 yrs

Cooling Equipment Energy

Source:

Electricity

Central Air Manufacturer:

TRANE

Number of AC Only Units:

Two

👁 ITEMS: HEATING / CENTRAL AIR CONDITIONING

7.0 HEATING EQUIPMENT

✓ INSPECTED

7.1 NORMAL OPERATING CONTROLS

✓ INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

✓ INSPECTED

7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

✓ INSPECTED

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

✓ INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

✓ INSPECTED

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

✓ NOT PRESENT

7.7 GAS/LP FIRELOGS AND FIREPLACES

📋 REPAIR OR REPLACE

(1)

1. The black soot build-up indicates that Gas Fire logs do not appear to be arranged or positioned according to manufacturer's specs. If logs are not positioned correctly, carbon monoxide can be produced. Further investigation and repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.



7.7 Item 1 (Picture)



7.7 Item 2 (Picture)




7.7 Item 3 (Picture)

(2)

1. The non-vented fire logs (natural gas) in the Living room shut off valve was in the off position. As a result I did not operate the gas logs due to safety reason. The inspector assumes that if a gas

appliance shut off valve is in the off position it is for a reason. Further investigation is recommended.. .

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.

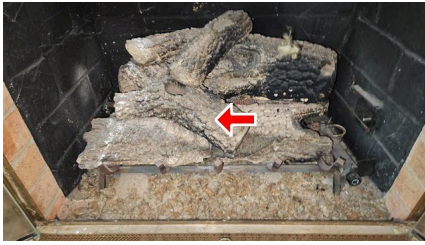

7.7 Item 4 (Picture)

7.8 COOLING AND AIR HANDLER EQUIPMENT

☑ INSPECTED

7.9 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

☑ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 8. INTERIORS

📋 DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

✂️ STYLES & MATERIALS: INTERIORS

Ceiling Materials: Drywall	Wall Material: Drywall	Floor Covering(s): Carpet Hardwood T&G Tile
Interior Doors: Hollow core Raised panel	Window Types: Thermal/Insulated Fixed	

👁️ ITEMS: INTERIORS

8.0 CEILINGS

✔️ INSPECTED

8.1 WALLS

✔️ INSPECTED

8.2 FLOORS


✔️ REPAIR OR REPLACE

1. The wood floor warped or buckled indicating moisture absorption at the downstairs. This is a cosmetic issue for your information.

A qualified person should repair or replace as needed.



8.2 Item 1 (Picture)

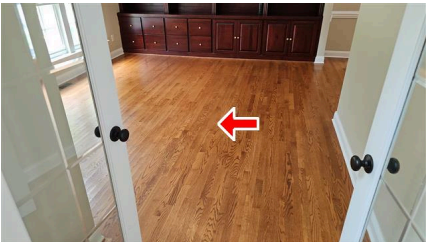

8.2 Item 2 (Picture)

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

✓ INSPECTED

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

✓ INSPECTED


8.5 DOORS (REPRESENTATIVE NUMBER)

📋 REPAIR OR REPLACE

(1)

1. The bifold door is out of track add the bonus room. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

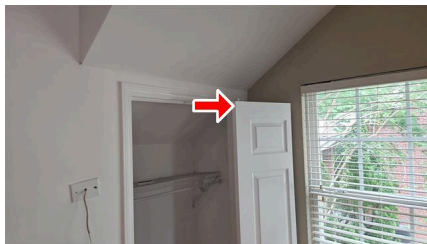

8.5 Item 1 (Picture)




8.5 Item 2 (Picture)

(2)

1. The door at guest Bedroom will not latch properly. Evidence suggest that the door needs strike and latch adjustment to shut properly. This is a small repair.

A qualified person should repair or replace as needed.

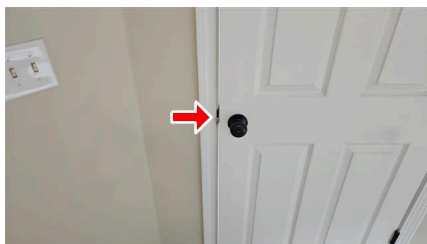

8.5 Item 3 (Picture)

8.6 WINDOWS (REPRESENTATIVE NUMBER)

✓ INSPECTED

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair

issues as it relates to the comments in this inspection report.

🏠 9. INSULATION AND VENTILATION

📋 DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

🔧 STYLES & MATERIALS: INSULATION AND VENTILATION

Attic info: Pull Down stairs	Method used to observe attic: From entry	Attic Insulation: Blown Batt Fiberglass
Ventilation: Ridge vents Soffit Vents	Exhaust Fans: Fan with light	Dryer Power Source: 220 Electric
Dryer Vent: Flexible Metal	Floor System Insulation: Faced Batts	

👁️ ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

✔️ INSPECTED

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

✔️ INSPECTED

9.2 INSULATION IN ATTIC

✔️ INSPECTED

9.3 INSULATION UNDER FLOOR SYSTEM

✔️ REPAIR OR REPLACE

1. The insulation is loose/fallen in the crawlspace. Heat loss can occur more on this home than one that is properly insulated. Repairs are needed.

A qualified person should repair or replace as needed.



9.3 Item 1 (Picture)


9.4 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

☐ REPAIR OR REPLACE

(1)

1. No ventilation (window or exhaust fan) for the guest bath. Normally an exhaust fan or window is needed for proper ventilation. Adverse moisture conditions could occur if not corrected. I did not inspect to determine what steps are needed to comply. Repairs are needed.

A qualified contractor should inspect and repair as needed.

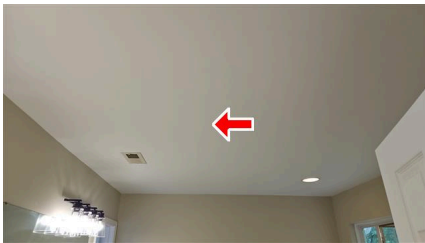

9.4 Item 1 (Picture)

(2)

1. The exhaust fan does not vent to outside at the guest bath and master bath. Vent pipes should terminate outside and not in the attic. Many homes have their vent pipe poised at the roof vent such as yours. It is up to you to determine whether or not this is a concern or needs further consideration from a general contractor. Repairs are needed.

A qualified person should repair or replace as needed.



9.4 Item 2 (Picture)



9.4 Item 3 (Picture)

(3)

1. The exhaust fan is missing light cover at the master bath. This is for informational purpose to you.

A qualified person should repair or replace as needed.



9.4 Item 4 (Picture)

9.5 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

☑ NOT PRESENT

(2)

1. Thermostatically controlled vent fan in the attic was not reachable. Therefore I did not inspect. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



9.5 Item 1 (Picture)

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

10. BUILT-IN KITCHEN APPLIANCES

DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Granite

Cabinetry:

Wood

ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER

 INSPECTED


10.1 RANGES/OVENS/COOKTOPS

 INSPECTED

10.2 RANGE HOOD (S)

 REPAIR OR REPLACE

1. The range hood controls did not function properly. Further investigation and repairs are needed. I recommend contacting appliance repair company.

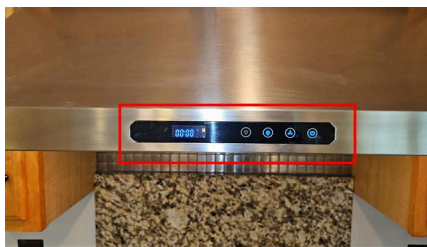

10.2 Item 1 (Picture)

10.3 FOOD WASTE DISPOSER

 INSPECTED

10.4 MICROWAVE COOKING EQUIPMENT

 NOT PRESENT

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



Above Parr Home Inspections

Report Attachments

ATTENTION: This inspection report is incomplete without reading the information included herein at these links/ attachments. Note If you received a printed version of this page and did not receive a copy of the report through the internet please contact your inspector for a printed copy of the attachments.

[NC WDIIR](#)