



Summary Only

Mark Powers

Property Address:
1022 Kenilworth Ct NW
Concord NC



Carolinas Home Inspections, LLC
Bill Boan NC HILB 2981
108 Bridgeport Dr
Mooresville, NC 28117

This is not the complete home inspection report. It is only the Summary Items.

SUMMARY



Carolinas Home Inspections, LLC
108 Bridgeport Dr
 Mooresville, NC 28117

Customer
Mark Powers

Address
1022 Kenilworth Ct NW
Concord NC

This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney.

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

2. EXTERIOR

2.1 DOORS (EXTERIOR)

INSPECTED, REPAIR OR REPLACE

At rear basement exterior door, daylight was visible at the weatherstripping on the side of the door. This can produce drafts. The weatherstripping needs to be "enlarged" at this side of the door to prevent drafts. Recommend repair.



2.1 Item 1 (Picture)



2.1 Item 2 (Picture)

2.2 WINDOWS (EXTERIOR)

☐ INSPECTED, REPAIR OR REPLACE

Many of exterior casement window bottom stiles are in need of repair or are near to rotting. Some have been repaired with wood hardener, many have not. I operated some of the windows from the inside, but there were some I did not operate due to fear that operating them may further damage the bottom stiles. Repair or replacement of windows is needed.



2.2 Item 1 (Picture)



2.2 Item 2 (Picture)



2.2 Item 3 (Picture)



2.2 Item 4 (Picture)



2.2 Item 5 (Picture)



2.2 Item 6 (Picture)



2.2 Item 7 (Picture)



2.2 Item 8 (Picture)



2.2 Item 9 (Picture)



2.2 Item 10 (Picture)

2.3 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ INSPECTED, REPAIR OR REPLACE

(1) At rear exterior door, due to the steps having four risers, I would recommend handrails be installed for occupant safety, if you desire . This will likely require approval of the HOA (may or may not be approved)



2.3 Item 1 (Picture)

(2) At the side deck structure, the deck structure was built using methods approved at the time of the build. It is likely that most all condo units have the same building method to each deck. I noted no rotten boards or structure issues which require "immediate" attention. However, there are some safety features which could be added to ensure long-term structural stability for occupant safety.

A) - where the stairs stringers attach to the deck structure at the top of the stairs, the stringers are pulling away where they are nailed to the side of the deck structure. These stair stringers should have joist hangers or mechanical steel plates added to ensure the stairs stringers do not pull away from the deck structure.


B) - the middle stair stringer is cracked near where it connects to the side of the deck. A joist hanger (mentioned above) will help to prevent this from further cracking)

C) - under the deck stairs, there is a singular post with a 4x4 placed laterally on top of it. This is to provide vertical and horizontal stability to each of the stair stringers to prevent the stairs from shaking while transversing them.. There are no side posts under the lateral 4x4 (i.e, there is no support on open side of stairs if the side stair stringer needs it)

D) - all deck joists should have joist hangers applied for safety

E) - at the deck ledger board which runs parallel to the exterior wall of unit, the ledger board was applied over the siding, and there is no indication that this ledger board was properly fastened to the exterior frame of the wall using bolts. Due to this, the area of the ledger board where the double joists are located (shown in picture 9) may not be fully supported. Even if joists hangers are applied at the double joists (at red circle in picture), the ledger board which "carries the weight" of the double joists does not appear to be bolted to the house (only nailed). Further evaluation should be done at this area


You will need to address this with the HOA, which may (or may not) agree with my safety suggestions. ..

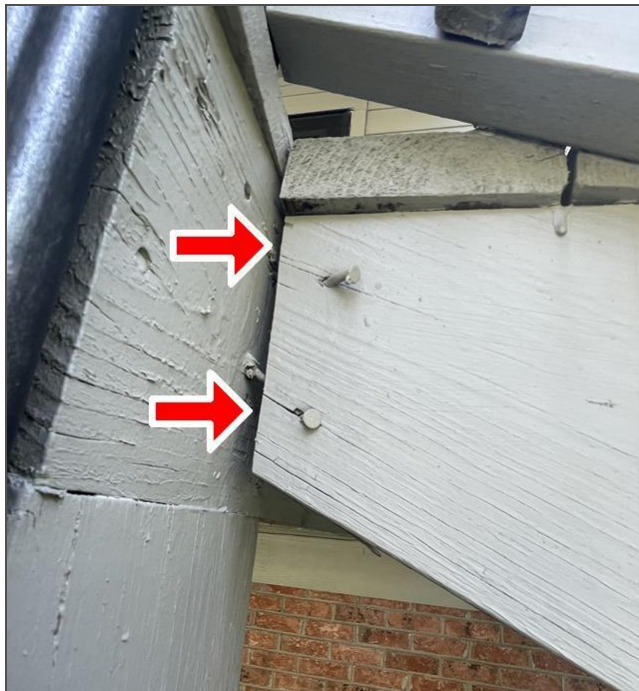

2.3 Item 2 (Picture) stair stinger connection to side of deck



2.3 Item 3 (Picture) middle stair stringer cracked

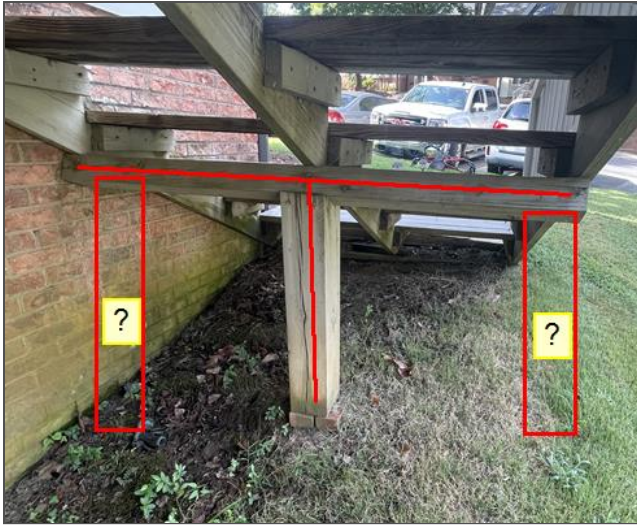


2.3 Item 4 (Picture)



2.3 Item 5 (Picture) end of lateral 4x4 not touching the stairs stringer (no support)




2.3 Item 6 (Picture) joist hangers would help to provide a higher level of structural safety

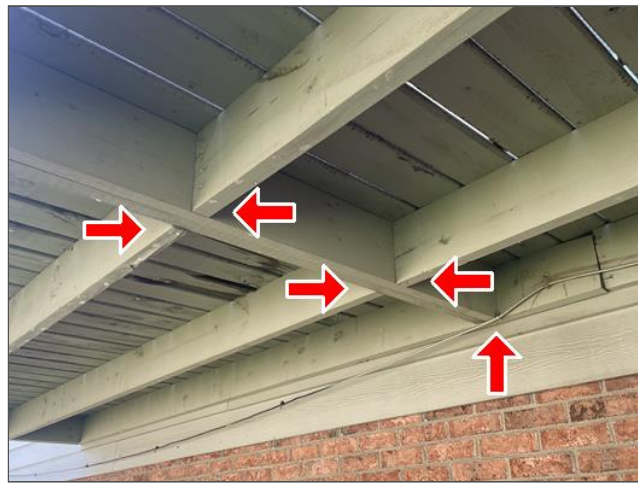

2.3 Item 7 (Picture) joist hangers would help to provide a higher level of structural safety



2.3 Item 8 (Picture) joist hangers would help to provide a higher level of structural safety

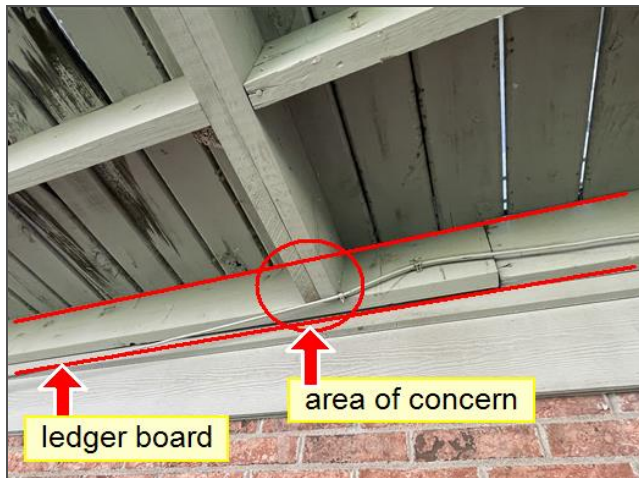


2.3 Item 9 (Picture)

5. PLUMBING SYSTEM

5.1 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☐ INSPECTED, REPAIR OR REPLACE

(1) At master bath sink, the sink bowl needs to have caulking applied in certain areas where the sink bowl intersects the underside of the countertop. There appears to be "void" (gap) in various areas.

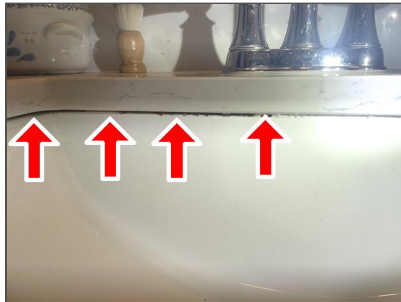

5.1 Item 1 (Picture)

(2) The basement vanity sink drain stop rod is not connected to the drain stop. Recommend repair.



5.1 Item 2 (Picture)

(3) At basement bath, there was a minor leak coming from the valve handle to the bathtub. It stopped shortly after it started. This appears to be intermittent. Repair or replace if desired.




5.1 Item 3 (Picture)

6. ELECTRICAL SYSTEM

6.1 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

☐ INSPECTED, REPAIR OR REPLACE

Inside the electrical panel, the knock-out hole at the top of the panel needs to be covered with knock-out plate, and at the bottom of the panel, the service entrance cables from the meter need to have a bushing installed (the bushing is meant to protect the electrical cable insulation from chaffing against the metal of the box). Recommend repair by electrician if/when they are on site for other issues noted in this section.

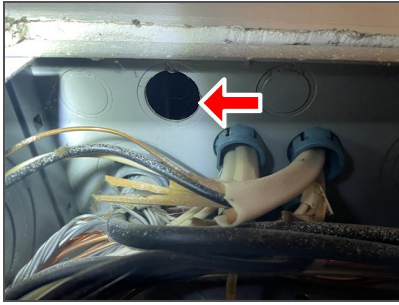

6.1 Item 1 (Picture) hole at top

6.1 Item 2 (Picture) bushing
needed at service entrance
cables at bottom of panel

6.3 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

☐ INSPECTED, REPAIR OR REPLACE

(1) Rear exterior light at the the rear basement door did not function. This may be due to a burnet bulb. If bulb replacement does not rectify the issue, the light circuit will need evaluation by an electrician.

(2) At basement room which has the exterior door, the ceiling fan/light has 2 different light switches which can operate the fixture. One is at the entrance to the room, the other is next to the rear exterior door. This is called a 3-way circuit, and both switches can typically operate the ceiling fixture independently. However, in this room, one of the light switches has to be in the "on" position for the other light switch to function. This sometimes occurs when occupants over the years have changed out the fixture but incorrectly wired something at the fixture or at a light switch. This also appears to be occurring at the main level den. You may desire to have an electrician evaluate and correct the problem. The fixtures function, but it can be a nuisance to have to walk across the room to the "functional" light switch, depending upon your entry point into the room

6.8 SMOKE DETECTORS / CO DETECTORS

☐ INSPECTED

It would be prudent to replace all batteries in the smoke detectors. While doing this, if any smoke detector is older than 10 years old, it should be replaced, as it as at the end of its useful lifespan. There is typically a date on the back of the smoke detector. Newer detectors provide better safety. A smoke detector should be in: the den; the kitchen area, the master bedroom, both basement bedrooms,

7. HEATING / CENTRAL AIR CONDITIONING

7.3 DISTRIBUTION SYSTEMS INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS, CONVECTORS, AUTOMATIC DAMPER SYSTEMS)

☐ INSPECTED, REPAIR OR REPLACE

(1) All air filters need replacement (1 on main floor and 1 at basement ceiling)



7.3 Item 1 (Picture) main floor



7.3 Item 2 (Picture) basement ceiling

(2) Battery needs to be replaced in the digital thermostat.



7.3 Item 3 (Picture)

8. INSULATION AND INTERIOR VENTILATION


8.3 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

☐ INSPECTED, REPAIR OR REPLACE

At basement bathroom, it is an interior bathroom (no window) and does not have an exhaust fan installed. This is unusual, as bathrooms which include a shower (but no window) typically have been required to have fans for decades. There could be several reasons for this. 1) This issue may go back to the original build, and it was just never installed. 2) There may be a fan pipe in the ceiling, but the light in the bathroom did not have a fan installed. If this is the case, the light can simply be switched out for a fan/light, BUT there was only 1 vent termination noted at the rear of home, and the adjacent unit appears to have 2 vents at the exterior. The vent termination at the exterior rear wall may have been covered up with newer siding, and the termination vent at the rear wall would need to be relocated to properly vent to the exterior. (Seller stated that there was no fan when they bought it)

Additionally regarding the laundry dryer vent - When looking behind the dryer, there was an excessive amount of lint. I then noted that the flexible vent pipe behind the dryer has a significant hole in it. This flexible dryer hose can

obviously be replaced, BUT my concern is this: Due to this hole in the dryer vent, I could not test the dryer vent to determine if the singular vent termination at the rear exterior wall is for the dryer or the bath fan. . Further verification will be needed to determine if the singular vent pipe at the rear is for the dryer or the bath vent (unit next door appears to have 2 vents instead of 1, assuming the adjacent unit has the same floor plan) The repair method for the basement bathroom vent and dryer vent will be determined upon further verification of both of these areas. Repair of the dryer vent and operation of the dryer may be the easiest way to determine what this singular vent is connected to (assuming the dryer vent is not clogged inside the wall or ceiling) NOTE: the laundry room and basement bath are aligned back to back, so it should be relatively easy to find out what steps need to be taken by opening up the bathroom ceiling. The laundry vent pipe should run above the bathroom ceiling as well.

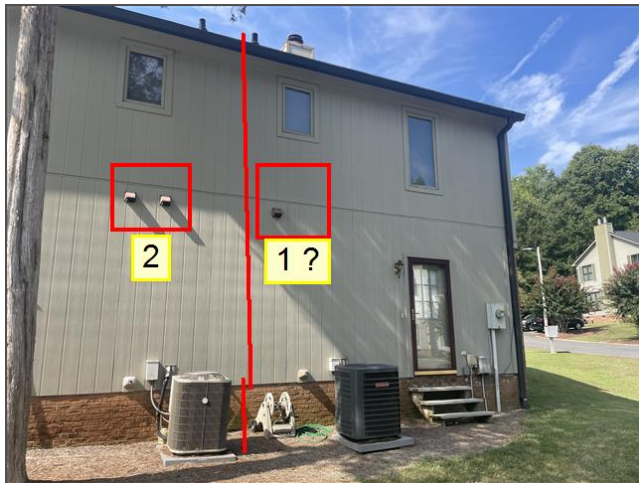

8.3 Item 1 (Picture)



8.3 Item 2 (Picture) light in basement bath - no fan noted



8.3 Item 3 (Picture) hole in vent flex pipe behind the dryer

9. BUILT-IN KITCHEN APPLIANCES/LAUNDRY AREA(S)

9.0 DISHWASHER


☐ INSPECTED

The dishwasher drain hose under the sink which attaches to the disposal needs to be elevated to a height just above the bottom of the sink and attached to the backside cabinet wall with a metal strap. This is called a "high loop" and it prevents water from the disposal from draining back into the dishwasher basin. This is a minor repair.

The dishwasher drain hose was not installed as to create a trap under sink.(known as a "high loop") The high loop prevents grey water and debris from disposal from running back to the dishwasher drain basin. Grey water which sits in the dishwasher basin can create mildew and foul smells inside the dishwasher. Repair recommended.



9.0 Item 1 (Picture)

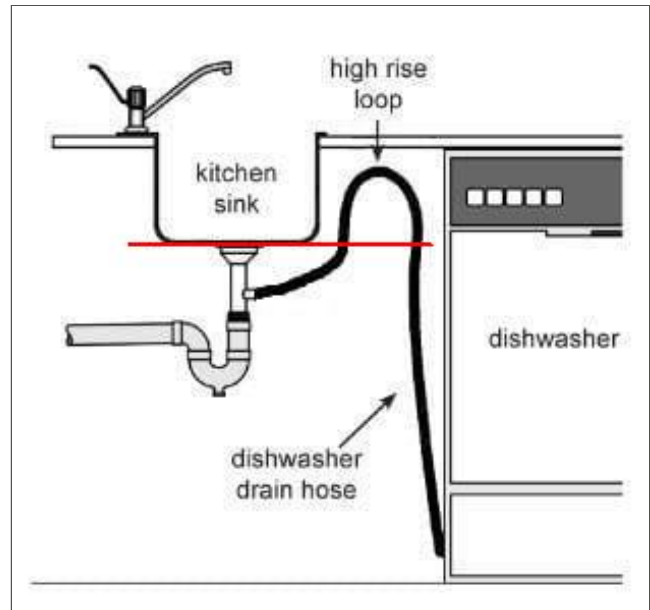

9.0 Item 2 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Bill Boan