



INSPECTION REPORT
107 S Gibbs Rd
 Mooresville NC 28117

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 6/23/2023
🕒 09:00:00 AM

Michael A Parr
3692

INVOICE

Above Parr Home Inspections

Inspected By: Alex Parr 3692

Inspection Date: 6/23/2023
Report ID: O62323AP1

Customer Info:	Inspection Property:
Davin O'Neill Customer's Real Estate Professional: Jake Reed NextHome at the Lake	107 S Gibbs Rd Mooresville NC 28117

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	550.00	1	550.00
WDI/Termite	75.00	1	75.00

Payment Method: Credit Card

Payment Status: Paid

Note:

Tax \$0.00
Total Price \$625.00

GENERAL INFO

Property Address

107 S Gibbs Rd
Mooresville NC 28117

Date of Inspection

6/23/2023

Report ID

O62323AP1

Customer(s)

Davin O'Neill

Time of Inspection

09:00:00 AM

Real Estate Agent

Jake Reed
NextHome at the Lake

INSPECTION DETAILS

Approximate age of building:

Over 25 Years

In Attendance:

Customer and their agent

Radon Test:

No

Water Test:

No

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

Yes

Type of building:

Single Family (2 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

TABLE OF CONTENTS

Cover Page.....

1

Invoice.....

2

Intro Page.....

3

Table of Contents

4

General Summary

5

1 Property Overview.....

16

2 Roofing

17

3 Exterior.....

19

4 Structural Components

25

5 Plumbing System

28

6 Electrical System

31

7 Heating / Central Air Conditioning.....

34

8 Interiors

37

9 Insulation and Ventilation

40

10 Built-In Kitchen Appliances.....

44

Attachments.....

46

GENERAL SUMMARY

Above Parr Home Inspections

Customer

Davin O'Neill

Address

107 S Gibbs Rd
Mooresville NC 28117

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling; or warrants further investigation by a specialist, or requires subsequent observation.** This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."


The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

1. PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

REPAIR OR REPLACE

1. Discoloration in some type of fungal growth (wood destroying fungus) is present in the structure at several areas including but not limited to the crawl space and or interior spaces. This type of substance commonly results in the building and finish type materials becoming weakened and or compromised. Evidence suggests that this condition is from a past or present elevated moisture conditions. The extent of the damage cannot be determined until the moisture issue is corrected. We did not inspect, test or determine if this type of substance is or is not a health hazard as this is above the scope of a home inspection. We recommend contacting a licensed expert for testing, investigation and or correction as deemed appropriate

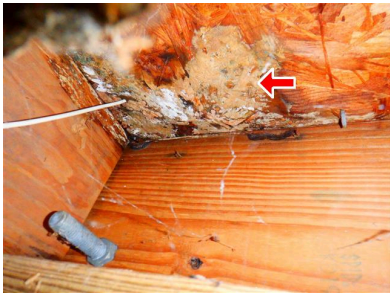

1.0 Item 1 (Picture)



1.0 Item 2 (Picture)


3. EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM


REPAIR OR REPLACE

1. The cement board at the exterior in areas is damaged. Deterioration can eventually occur if not corrected. Repairs are needed.


A qualified person should repair or replace as needed.

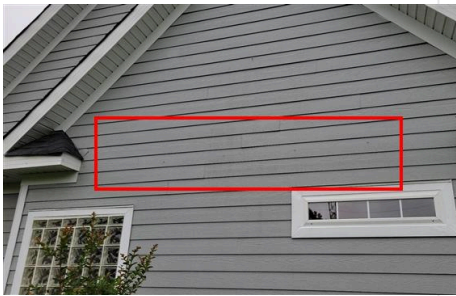


3.0 Item 1 (Picture)

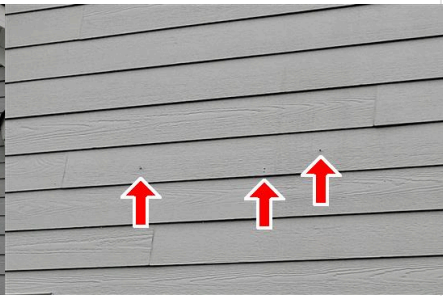

3.0 Item 2 (Picture)

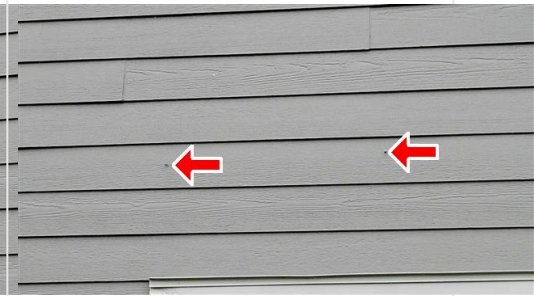

3.0 Item 3 (Picture)

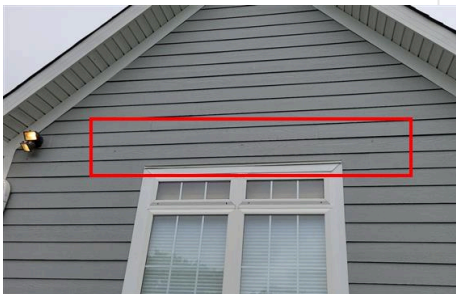

3.0 Item 4 (Picture)



3.0 Item 5 (Picture)



3.0 Item 6 (Picture)



3.0 Item 7 (Picture)



3.0 Item 8 (Picture)




3.0 Item 9 (Picture)

3.1 EAVES, SOFFITS AND FASCIAS

REPAIR OR REPLACE

1. The wood fascia at the front of home is damaged from what appears a pest. Further deterioration may occur if not repaired. Rodents, reptiles or insects could enter into attic. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.

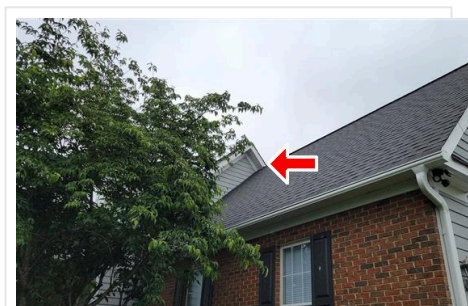

3.1 Item 1 (Picture)



3.1 Item 2 (Picture)



3.1 Item 3 (Picture)



3.1 Item 4 (Picture)

3.2 WINDOWS

REPAIR OR REPLACE


(1)

1. The wood trim deteriorated at some windows. Further deterioration may occur if not repaired. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



3.2 Item 1 (Picture)

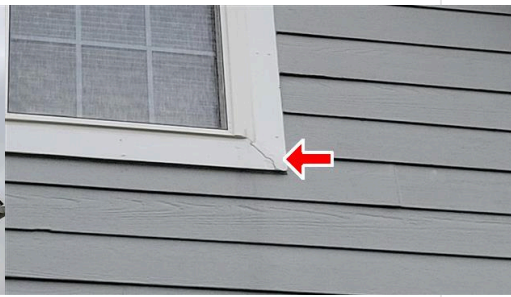

3.2 Item 2 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE

(1)

1. The guardrails on covered porch at the front of home are loose. An injury could occur if not corrected.

A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

4. STRUCTURAL COMPONENTS

4.5 WOOD DETERIORATION

☐ REPAIR OR REPLACE

1. Wood debris is in contact with the crawl space floor in numerous areas. This can attract wood destroying organisms. Removal is needed.

A qualified contractor should inspect and repair as needed.



4.5 Item 1 (Picture)



4.5 Item 2 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☐ REPAIR OR REPLACE

(1)

1. Visible signs of water intrusion in the crawlspace are present from standing water on ground. Water intrusion if not corrected can lead to other problems including mold and cause excessive moisture to floor system that can lead to deterioration and increased repair cost. Further investigation and repairs are needed.

I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist.



4.6 Item 1 (Picture)




4.6 Item 2 (Picture)



4.6 Item 3 (Picture)



4.6 Item 4 (Picture)

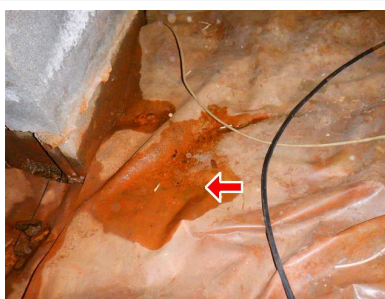


4.6 Item 5 (Picture)

(2)

1. Visible signs of water intrusion in the crawlspace (along rear of home) are present from water stains on floor. Water intrusion can cause deterioration and excessive moisture on building components if not corrected. Further investigation and repairs are needed.

I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist.

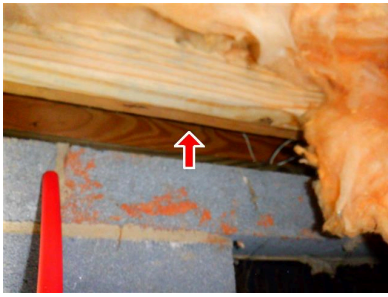

4.6 Item 6 (Picture)




4.6 Item 7 (Picture)



4.6 Item 8 (Picture)



4.6 Item 9 (Picture)

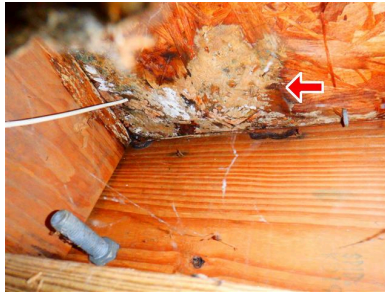

4.6 Item 10 (Picture)

5. PLUMBING SYSTEM

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☐ REPAIR OR REPLACE

(1)

1. The drain line for the water filtration system has been installed in properly. This can allow for cross contamination. This is a safety issue. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.



5.2 Item 1 (Picture)



5.2 Item 2 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE

1. The plumbing waste line left side of the home is exposed to the elements. This may allow the waistline to freeze. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.



5.3 Item 1 (Picture)



5.3 Item 2 (Picture)

6. ELECTRICAL SYSTEM


6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

☐ REPAIR OR REPLACE

(1)

1. At least two outlets are missing cover-plate bonus room. This is a safety issue that needs to be corrected. I recommend repair as needed.

A qualified licensed electrical contractor should correct as needed.

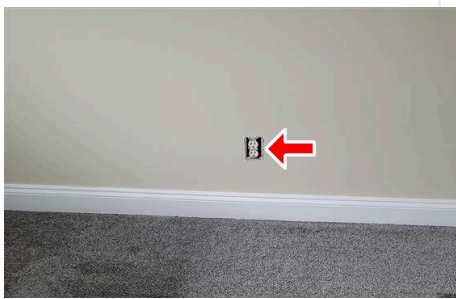

6.4 Item 1 (Picture)



6.4 Item 2 (Picture)



6.4 Item 3 (Picture)

6.8 CARBON MONOXIDE DETECTORS

☐ REPAIR OR REPLACE

1. There is no carbon monoxide detector found in home. It is recommended that one be installed according to the manufacturer's instructions.

A qualified person should repair or replace as needed.


7. HEATING / CENTRAL AIR CONDITIONING

7.7 GAS/LP FIRELOGS AND FIREPLACES

☐ REPAIR OR REPLACE

1. The non-vented fire logs in the Living room is not operable (burner would not ignite). Repairs should be made so unit works properly. Repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.

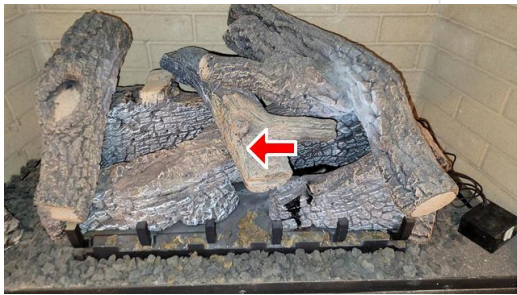

7.7 Item 1 (Picture)

8. INTERIORS

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

☐ REPAIR OR REPLACE

1. The hand/guard rail for the upstairs are lower than 36 inches from floor. A fall or injury could occur if not corrected A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



8.3 Item 1 (Picture)

8.6 WINDOWS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE

(1)

1. The windows at the throughout the home have damaged sash springs. This can allow the window to come down suddenly causing glass breakage and or injury. (Safety Issue) Repairs are needed.

A qualified person should repair or replace as needed.




8.6 Item 1 (Picture)



8.6 Item 2 (Picture)



8.6 Item 3 (Picture)

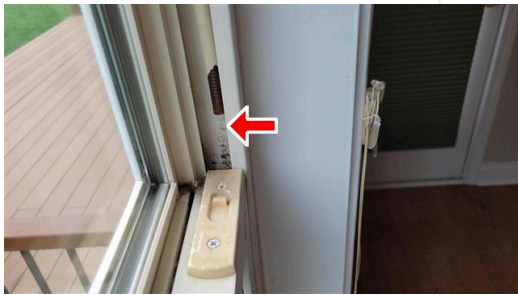

8.6 Item 4 (Picture)


(2)

1. Two windows are damaged at lock hardware at the master bedroom. As a result you can not lock the window. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



8.6 Item 5 (Picture)

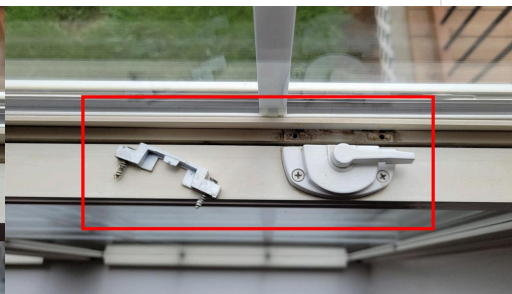

8.6 Item 6 (Picture)

9. INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

☐ REPAIR OR REPLACE

1. The vapor barrier (plastic) on the crawlspace ground is missing in areas. A vapor barrier provides added protection to the floor system from moisture or dampness that can enter from ground. Repairs are needed.

A qualified person should repair or replace as needed.



9.0 Item 1 (Picture)



9.0 Item 2 (Picture)



9.0 Item 3 (Picture)

9.3 INSULATION UNDER FLOOR SYSTEM


REPAIR OR REPLACE

1. The insulation is loose/fallen in the crawlspace. Heat loss can occur more on this home than one that is properly insulated. Repairs are needed..

A qualified person should repair or replace as needed.



9.3 Item 1 (Picture)

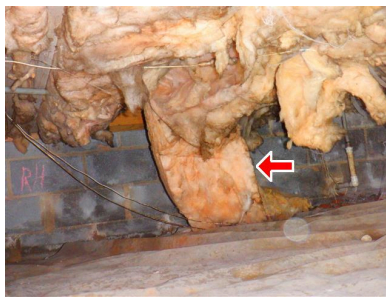

9.3 Item 2 (Picture)

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

REPAIR OR REPLACE

(1)

1. The dryer vent piping is improperly put together with duct tape. "Duct tape is not UL rated for this application." Repairs are needed.

A qualified person should repair or replace as needed.




9.5 Item 1 (Picture)

(2)

1. The dryer vent piping has large sags. This can cause an obstruction of lint that has a possibility to

create a fire hazard. Repairs are needed.

A qualified person should repair or replace as needed.

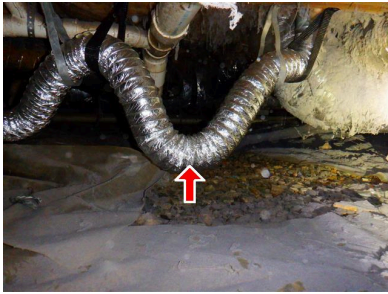

9.5 Item 2 (Picture)



9.5 Item 3 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

81

✓ ITEMS INSPECTED
Total number in report.

20

✓ SUMMARY COMMENTS
Total number in report.

81

📷 PHOTOS
Total number in report.

1. PROPERTY OVERVIEW

STYLES & MATERIALS: PROPERTY OVERVIEW

Temperature:

Over 65 (F) = 18 (C)

Weather:

Light Rain

Rain in last 3 days:


Yes

ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

REPAIR OR REPLACE

1. Discoloration in some type of fungal growth (wood destroying fungus) is present in the structure at several areas including but not limited to the crawl space and or interior spaces. This type of substance commonly results in the building and finish type materials becoming weakened and or compromised. Evidence suggests that this condition is from a past or present elevated moisture conditions. The extent of the damage cannot be determined until the moisture issue is corrected. We did not inspect, test or determine if this type of substance is or is not a health hazard as this is above the scope of a home inspection. We recommend contacting a licensed expert for testing, investigation and or correction as deemed appropriate

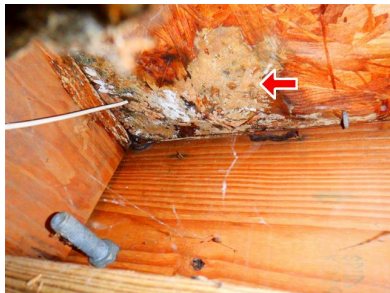**1.0 Item 1 (Picture)****1.0 Item 2 (Picture)**

1.1 INSPECTION LIMITATIONS

INSPECTED

1.2 RADON TESTING

NOT INSPECTED

🏠 2. ROOFING

📋 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

🔧 STYLES & MATERIALS: ROOFING

Roof Covering: Architectural	Age: 15–20 Yrs	Viewed roof covering from: Ground Camera Optical Zoom
Sky Light(s): None	Chimney (exterior): N/A	Roof-Type: Gable

👁️ ITEMS: ROOFING

2.0 ROOF COVERINGS

✔ INSPECTED

2.1 FLASHINGS

✔ INSPECTED

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

✔ INSPECTED

2.3 ROOF DRAINAGE SYSTEMS

✔ REPAIR OR REPLACE

1. The gutter leaks at seam (s) at the left side of home (facing front). Erosion can continue or become worse if not corrected possibly leading to water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 1 (Picture)



2.3 Item 2 (Picture)



2.3 Item 3 (Picture)



2.3 Item 4 (Picture)



2.3 Item 5 (Picture)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 3. EXTERIOR



📋 DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

✂️ STYLES & MATERIALS: EXTERIOR

Siding Style:

Lap
Brick

Siding Material:

Cement-Fiber
Brick veneer

Exterior Entry Doors:

Wood
Steel
Insulated glass

Appurtenance:

Deck with steps
Covered porch
Sidewalk

Driveway:

Concrete


👁️ ITEMS: EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM


📋 REPAIR OR REPLACE

1. The cement board at the exterior in areas is damaged. Deterioration can eventually occur if not corrected. Repairs are needed.

A qualified person should repair or replace as needed.

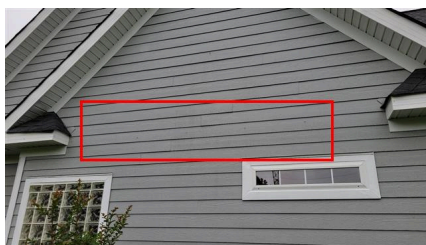

3.0 Item 1 (Picture)

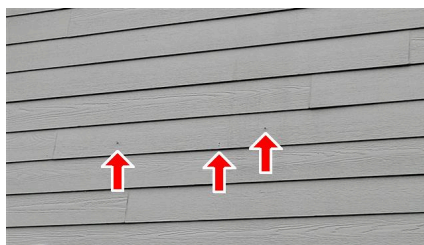


3.0 Item 2 (Picture)



3.0 Item 3 (Picture)



3.0 Item 4 (Picture)

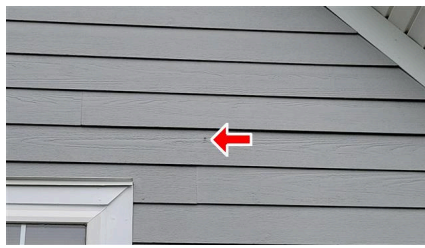

3.0 Item 5 (Picture)




3.0 Item 6 (Picture)



3.0 Item 7 (Picture)



3.0 Item 8 (Picture)

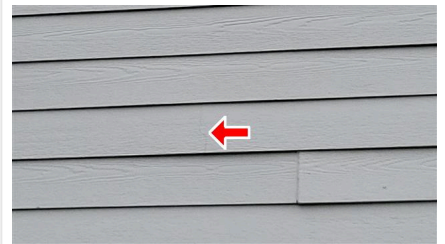

3.0 Item 9 (Picture)

3.1 EAVES, SOFFITS AND FASCIAS

REPAIR OR REPLACE

1. The wood fascia at the front of home is damaged from what appears a pest. Further deterioration may occur if not repaired. Rodents, reptiles or insects could enter into attic. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



3.1 Item 1 (Picture)



3.1 Item 2 (Picture)



3.1 Item 3 (Picture)



3.1 Item 4 (Picture)

3.2 WINDOWS

📋 REPAIR OR REPLACE


(1)

1. The wood trim deteriorated at some windows. Further deterioration may occur if not repaired. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



3.2 Item 1 (Picture)

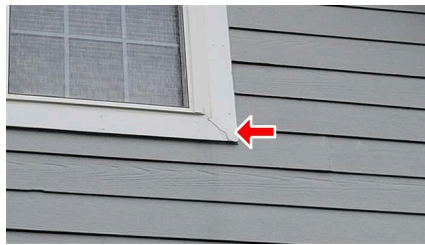

3.2 Item 2 (Picture)

(2)

1. The steel lintels around the exterior of the home are beginning to rust or have rust present. A lintel is a horizontal architectural member or steel beam support placed over a wall opening to carry the weight of the masonry placed over it. In most situation, the lintel above you windows and doors will be steel angle iron or I beam. Either due to age or improper rust proofing or weep chord and flashing placement during installation, lintels will begin to rust. Rusting lintels can expand to become much thicker than their original size. The expansive forces of rusting steel can shift entire multi-story elevations. If your lintels are currently rusting, a telltale sign of expansion is diagonal "step" pattern cracks, which can be found on either end of the window or door opening. Repairs are needed to prevent further damage to the structure. Further deterioration may occur if not repaired.

I recommend a qualified contractor inspect and repair as needed.



3.2 Item 3 (Picture)



3.2 Item 4 (Picture)

3.3 DOORS (EXTERIOR)

✅ REPAIR OR REPLACE

(1)

1. The main entry door rubs at jamb when closing. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.




3.3 Item 1 (Picture)

(2)

1. The entry door rear of home rubs floor when opened. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

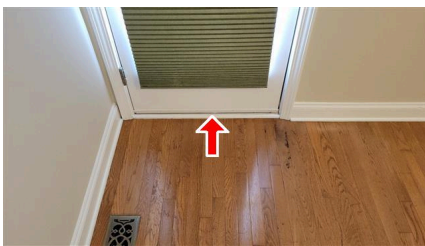

3.3 Item 2 (Picture)

(3)

1. The main entry door is missing strike plate. This is a maintenance issue and is for your information.

A qualified person should repair or replace as needed.



3.3 Item 3 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE

(1)

1. The guardrails on covered porch at the front of home are loose. An injury could occur if not

corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

(2)

1. The support post(s) on the deck at the rear of home is deteriorated. Further deterioration can occur if not repaired. Repairs are needed.

A qualified contractor should repair or replace as needed.




3.4 Item 2 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

✓ REPAIR OR REPLACE

1. The concrete driveway has cracks that should be sealed to prevent further damage, which is part of ongoing maintenance of a concrete driveway that will need to be performed on a regular basis. Repairs are recommended.

A qualified contractor should inspect and repair as needed.

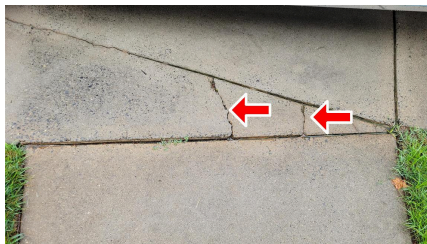

3.5 Item 1 (Picture)



3.5 Item 2 (Picture)



3.5 Item 3 (Picture)

3.6 GARAGE DOOR (S)

☑ NOT PRESENT

3.7 GARAGE DOOR OPERATORS (REPORT WHETHER OR NOT DOORS WILL REVERSE WHEN MET WITH RESISTANCE)

☑ NOT PRESENT

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

☑ NOT PRESENT

3.9 OCCUPANT DOOR (FROM GARAGE TO INSIDE OF HOME)

☑ NOT PRESENT

3.10 GARAGE FLOOR

☑ NOT PRESENT

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

4. STRUCTURAL COMPONENTS

DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation:

Masonry block

Method used to observe

Crawlspace:

Crawled

Floor Structure:

2 X 8

Wall Structure:

2 X 4 Wood

Columns or Piers:

Masonry block

Ceiling Structure:

2X4

Roof Structure:

Engineered wood trusses

ITEMS: STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

 INSPECTED

4.1 COLUMNS OR PIERS

 INSPECTED

4.2 FLOORS (STRUCTURAL)

 INSPECTED

4.3 CEILINGS (STRUCTURAL)

 INSPECTED

4.4 ROOF STRUCTURE AND ATTIC


 INSPECTED

4.5 WOOD DETERIORATION

 REPAIR OR REPLACE

1. Wood debris is in contact with the crawl space floor in numerous areas. This can attract wood destroying organisms. Removal is needed.

A qualified contractor should inspect and repair as needed.

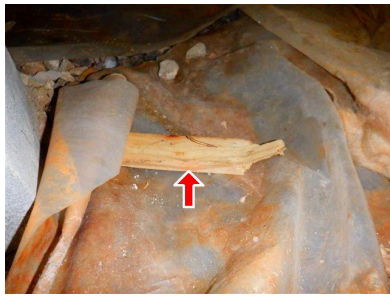

4.5 Item 1 (Picture)



4.5 Item 2 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☐ REPAIR OR REPLACE

(1)

1. Visible signs of water intrusion in the crawlspace are present from standing water on ground. Water intrusion if not corrected can lead to other problems including mold and cause excessive moisture to floor system that can lead to deterioration and increased repair cost. Further investigation and repairs are needed.

I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist.



4.6 Item 1 (Picture)




4.6 Item 2 (Picture)



4.6 Item 3 (Picture)



4.6 Item 4 (Picture)

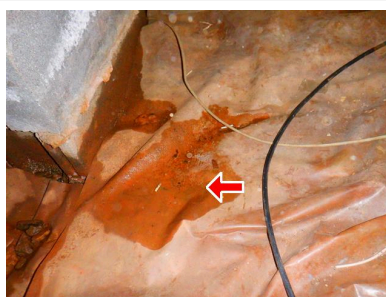

4.6 Item 5 (Picture)

(2)

1. Visible signs of water intrusion in the crawlspace (along rear of home) are present from water stains

on floor. Water intrusion can cause deterioration and excessive moisture on building components if not corrected. Further investigation and repairs are needed.

I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist.



4.6 Item 6 (Picture)




4.6 Item 7 (Picture)



4.6 Item 8 (Picture)



4.6 Item 9 (Picture)

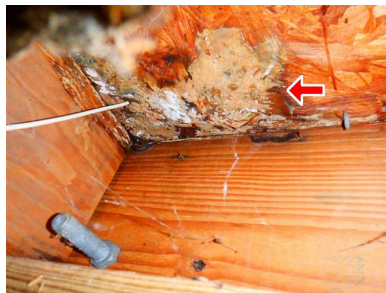

4.6 Item 10 (Picture)

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



Complimentary photo of the water heater

✂️ STYLES & MATERIALS: PLUMBING SYSTEM

Water Source: Well	Water Filters: Whole house conditioner	Plumbing Water Supply (into home): CPVC
Plumbing Water Distribution (inside home): PEX	Washer Drain Size: 2" Diameter	Plumbing Waste: PVC
Water Heater Power Source: Electric	Water Heater Capacity: Unknown	Manufacturer: RHEEM
Water Heater Location: Utility Room		

👁️ ITEMS: PLUMBING SYSTEM

5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

☒ REPAIR OR REPLACE

I could not locate the main shut-off for water? Please ask the current owners for the location. Otherwise, you will need to use a water key at the street meter or have a plumber install one.

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

☒ INSPECTED

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☐ REPAIR OR REPLACE

(1)

1. The drain line for the water filtration system has been installed in properly. This can allow for cross contamination. This is a safety issue. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.



5.2 Item 1 (Picture)




5.2 Item 2 (Picture)

(2)

1. The shower head leaks at the master bath. Repairs are needed.

A qualified licensed plumber should repair or correct as needed.

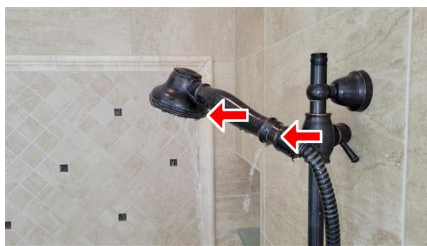

5.2 Item 3 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE

1. The plumbing waste line left side of the home is exposed to the elements. This may allow the waistline to freeze. Further investigation and repairs are needed..

A qualified licensed plumber should repair or correct as needed.



5.3 Item 1 (Picture)



5.3 Item 2 (Picture)

5.4 SINKS, FIXTURES, AND TOILETS

✓ INSPECTED

5.5 SHOWER/TUB & TILE WALLS

✓ INSPECTED

5.6 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)


✓ INSPECTED

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 6. ELECTRICAL SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

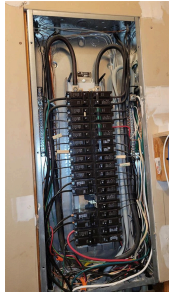

Complimentary photo of the electric panel with the cover off

✂️ STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service Conductors:

Below ground
Aluminum

Panel capacity:

200 AMP

Panel Type:

Circuit breakers

Electric Panel Manufacturer:

EATON

Branch wire 15 and 20 AMP:

Copper

Wiring Methods:

Romex

👁️ ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

✅ INSPECTED

The main panel box is located at the storage room.

6.1 SERVICE ENTRANCE CONDUCTORS

✓ INSPECTED

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED


6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

📋 REPAIR OR REPLACE

(1)

1. At least two outlets are missing cover-plate bonus room. This is a safety issue that needs to be corrected. I recommend repair as needed.


A qualified licensed electrical contractor should correct as needed.

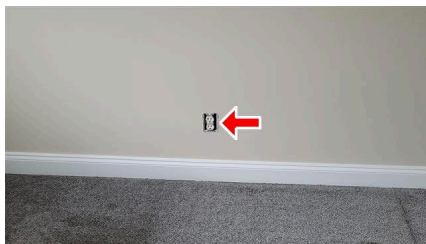

6.4 Item 1 (Picture)



6.4 Item 2 (Picture)

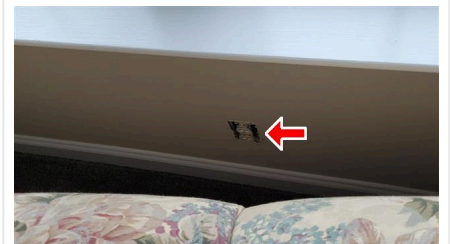

6.4 Item 3 (Picture)

(2)

1. The ceiling fan does work, but is noisy bonus room. This is for your information.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 4 (Picture)

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

✓ INSPECTED

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

✓ INSPECTED

6.7 SMOKE DETECTORS

✓ INSPECTED

6.8 CARBON MONOXIDE DETECTORS

📋 REPAIR OR REPLACE

1. There is no carbon monoxide detector found in home. It is recommended that one be installed according to the manufacturer's instructions.


A qualified person should repair or replace as needed.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

7. HEATING / CENTRAL AIR CONDITIONING

DESCRIPTION

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

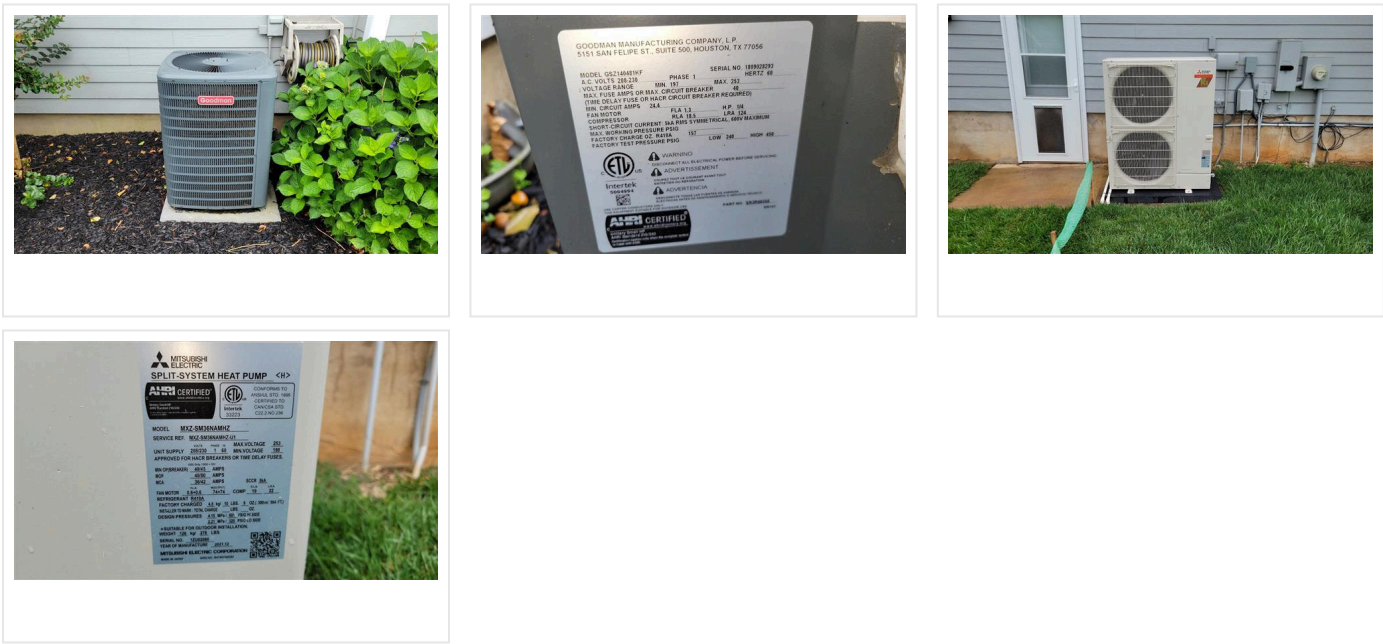

STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type: Heat Pump Forced Air (also provides cool air) Mini Split (Heat Pump)	Heating Age: 1-5 yrs 5-10 yrs	Number of Heat Systems (excluding wood): Two
Energy Source: Electric	Operated: Summer-Did not operate due to weather conditons. (Could damage the system)	Heat System Brand: GOODMAN
Ductwork: Insulated	Types of Fireplaces: Propane gas logs non-vented	Operable Fireplaces: One
Number of Woodstoves: None	Cooling Equipment Type: Heat Pump Forced Air (also	Air Conditioning Age: 1-5 yrs

provides warm air)

5-10 yrs

**Cooling Equipment Energy
Source:**
Electricity

Central Air Manufacturer:
GOODMAN
MITSUBISHI

Number of AC Only Units:
Two

ITEMS: HEATING / CENTRAL AIR CONDITIONING

7.0 HEATING EQUIPMENT

 INSPECTED

7.1 NORMAL OPERATING CONTROLS

 INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

 INSPECTED

7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

 INSPECTED

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

 INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

 NOT PRESENT

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)


 NOT PRESENT

7.7 GAS/LP FIRELOGS AND FIREPLACES

 REPAIR OR REPLACE

1. The non-vented fire logs in the Living room is not operable (burner would not ignite). Repairs should be made so unit works properly. Repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.

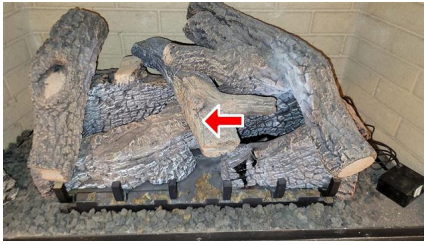

7.7 Item 1 (Picture)

7.8 COOLING AND AIR HANDLER EQUIPMENT

☑ INSPECTED

7.9 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

☑ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

8. INTERIORS

DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

STYLES & MATERIALS: INTERIORS

Ceiling Materials:

Drywall

Wall Material:

Drywall

Floor Covering(s):

Carpet

Hardwood T&G

Tile

Vinyl

Interior Doors:

Hollow core

Raised panel

Window Types:

Thermal/Insulated

Tilt feature

Fixed

ITEMS: INTERIORS

8.0 CEILINGS

 INSPECTED

8.1 WALLS

 INSPECTED

8.2 FLOORS

 INSPECTED

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

 REPAIR OR REPLACE

1. The hand/guard rail for the upstairs are lower than 36 inches from floor. A fall or injury could occur if not corrected A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



8.3 Item 1 (Picture)

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

✓ INSPECTED

8.5 DOORS (REPRESENTATIVE NUMBER)

✓ INSPECTED

8.6 WINDOWS (REPRESENTATIVE NUMBER)

📋 REPAIR OR REPLACE


(1)

1. The windows at the throughout the home have damaged sash springs. This can allow the window to come down suddenly causing glass breakage and or injury. (Safety Issue) Repairs are needed.


A qualified person should repair or replace as needed.




8.6 Item 1 (Picture)

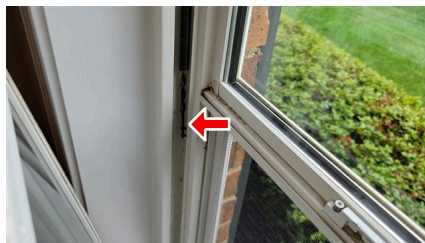

8.6 Item 2 (Picture)

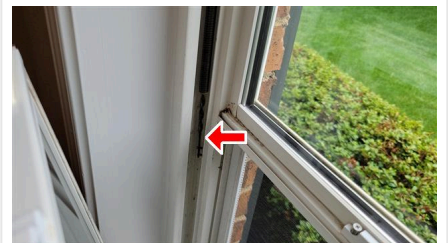

8.6 Item 3 (Picture)

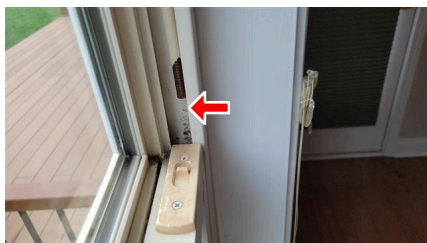


8.6 Item 4 (Picture)


(2)

1. Two windows are damaged at lock hardware at the master bedroom. As a result you can not lock the window. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.

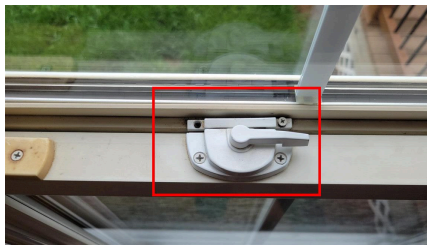

8.6 Item 5 (Picture)

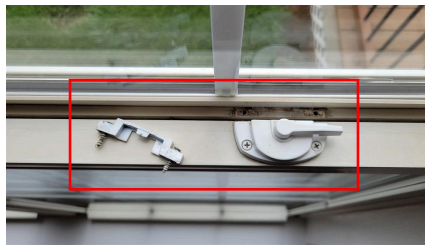

8.6 Item 6 (Picture)

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9. INSULATION AND VENTILATION

DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

STYLES & MATERIALS: INSULATION AND VENTILATION

Attic info:

Attic access
Scuttle hole

Method used to observe attic:

From entry

Attic Insulation:

Blown
Fiberglass

Ventilation:

Ridge vents
Soffit Vents

Exhaust Fans:

Fan with light

Dryer Power Source:

220 Electric

Dryer Vent:

Flexible Metal

Floor System Insulation:

Faced
Batts

ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

REPAIR OR REPLACE

1. The vapor barrier (plastic) on the crawlspace ground is missing in areas. A vapor barrier provides added protection to the floor system from moisture or dampness that can enter from ground. Repairs are needed.

A qualified person should repair or replace as needed.



9.0 Item 1 (Picture)



9.0 Item 2 (Picture)



9.0 Item 3 (Picture)

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

✓ REPAIR OR REPLACE

1. The foundation vent(s) are below ground level at left side (facing front) which can allow water to enter crawlspace. A half-round window well should be installed. The dirt inside well should be replaced with approximately four inches of gravel. A couple of inches clearance between gravel and vent opening recommended. Repairs are needed.



9.1 Item 1 (Picture)



9.1 Item 2 (Picture)

9.2 INSULATION IN ATTIC

✓ REPAIR OR REPLACE

1. Fiberglass (loose-fill) insulation is is compressed in areas of the attic due to foot traffic or storage in attic. Heat loss can occur more on this home than one that is properly insulated. Repairs are recommended .

A qualified person should repair or replace as needed.



9.2 Item 1 (Picture)



9.2 Item 2 (Picture)



9.2 Item 3 (Picture)

9.3 INSULATION UNDER FLOOR SYSTEM


✎ REPAIR OR REPLACE

1. The insulation is loose/fallen in the crawlspace. Heat loss can occur more on this home than one that is properly insulated. Repairs are needed..

A qualified person should repair or replace as needed.



9.3 Item 1 (Picture)

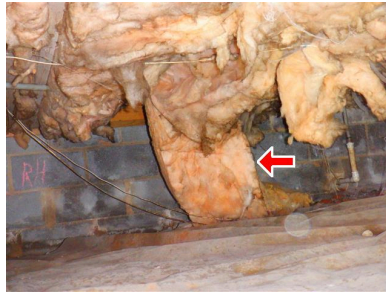

9.3 Item 2 (Picture)

9.4 ATTIC ACCESS

☑ INSPECTED

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

☐ REPAIR OR REPLACE

(1)

1. The dryer vent piping is improperly put together with duct tape. "Duct tape is not UL rated for this application." Repairs are needed.

A qualified person should repair or replace as needed.



9.5 Item 1 (Picture)

(2)

1. The dryer vent piping has large sags. This can cause an obstruction of lint that has a possibility to create a fire hazard. Repairs are needed.

A qualified person should repair or replace as needed.



9.5 Item 2 (Picture)



9.5 Item 3 (Picture)

9.6 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

✓ NOT PRESENT

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

10. BUILT-IN KITCHEN APPLIANCES

DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Granite

Cabinetry:

Wood

ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER

REPAIR OR REPLACE

1. The dishwasher drain hose needs to be looped above the level of the kitchen sink drain or an approved air gap installed to prevent back flow of waste water into the water supply. (food safety issue) This can allow waste for the sink to contaminate the dishwasher. This is a small repair.

A qualified licensed plumber should repair or correct as needed.



10.0 Item 1 (Picture)

10.1 RANGES/OVENS/COOKTOPS

INSPECTED

10.2 RANGE HOOD (S)

INSPECTED

10.3 TRASH COMPACTOR

NOT PRESENT

10.4 FOOD WASTE DISPOSER

✓ INSPECTED

10.5 MICROWAVE COOKING EQUIPMENT

✓ INSPECTED

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



Above Parr Home Inspections

Report Attachments

ATTENTION: This inspection report is incomplete without reading the information included herein at these links/ attachments. Note If you received a printed version of this page and did not receive a copy of the report through the internet please contact your inspector for a printed copy of the attachments.

[NC WDIIR](#)