



INSPECTION REPORT
119 Briar Ridge Cir
Winston-Salem NC 27104

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 9/5/2024
🕒 09:00:00 AM

Michael A Parr
3692

INVOICE

Above Parr Home Inspections

Inspected By: Alex Parr 3692

Inspection Date: 9/5/2024
Report ID: 090524AP1

Customer Info:	Inspection Property:
David and Susan Wee Customer's Real Estate Professional: Will Sheppard Will Sheppard Realty	119 Briar Ridge Cir Winston-Salem NC 27104

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	550.00	1	550.00
WDI/Termite	75.00	1	75.00

Tax \$0.00

Total Price \$625.00

Payment Method: Credit Card

Payment Status: Paid

Note:

GENERAL INFO

Property Address

119 Briar Ridge Cir
Winston-Salem NC 27104

Date of Inspection

9/5/2024

Report ID

090524AP1

Customer(s)

David and Susan Wee

Time of Inspection

09:00:00 AM

Real Estate Agent

Will Sheppard
Will Sheppard Realty

INSPECTION DETAILS

Approximate age of building:

Over 25 Years

In Attendance:

Customer representative

Radon Test:

No

Water Test:

No

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

Yes

Type of building:

Single Family (1 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

TABLE OF CONTENTS

Cover Page1

Invoice 2

Intro Page 3

Table of Contents 4

General Summary 5

1 Property Overview16

2 Roofing18

3 Exterior 20

4 Structural Components 24

5 Plumbing System 26

6 Electrical System31

7 Heating / Central Air Conditioning 36

8 Interiors 39

9 Insulation and Ventilation41

10 Built-In Kitchen Appliances 44

Attachments 46

GENERAL SUMMARY

Above Parr Home Inspections

Customer

David and Susan Wee

Address

119 Briar Ridge Cir
Winston-Salem NC 27104

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

1. PROPERTY OVERVIEW

1.1 INSPECTION LIMITATIONS

REPAIR OR REPLACE

1. The framing and foundation of the deck were not inspected as the deck was too low to the ground for inspector to enter below. Hidden damage may be present.

I recommend contacting a licensed contractor for further evaluation.



1.1 Item 1 (Picture)



1.1 Item 2 (Picture)

2. ROOFING

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

REPAIR OR REPLACE

1. The chimney crown appears to hold water and is deteriorate. This can cause deterioration of mortar, loose bricks, other structural problems and water intrusion to occur. Further investigation and repairs are needed.

I recommend a chimney sweep inspect and repairs what is deemed necessary.



2.2 Item 1 (Picture)



2.2 Item 2 (Picture)



2.2 Item 3 (Picture)



2.2 Item 4 (Picture)

3. EXTERIOR

3.2 WINDOWS

REPAIR OR REPLACE

(1)

1. The wood windows are deteriorated. Further deterioration may occur if not repaired. Further investigation and repairs are needed.

I recommend a qualified contractor inspect and repair as needed.



3.2 Item 1 (Picture)



3.2 Item 2 (Picture)



3.2 Item 3 (Picture)



3.2 Item 4 (Picture)



3.2 Item 5 (Picture)

(2)

1. Several windows have failed/compromised thermal seals/fogged window panes. This is indicated by the visible moisture, discoloration, calcium deposits and or crystallization visible between the glass window panes. A certified window technician should recheck all the windows throughout the home. Due to weather conditions many times compromised/failed windows cannot be identified at the time of inspection. Further investigation and repairs are needed.

We recommend contacting a properly licensed window technician/contractor regarding these conditions and have repairs made deemed appropriate



3.2 Item 6 (Picture)



3.2 Item 7 (Picture)



3.2 Item 8 (Picture)



3.2 Item 9 (Picture)



3.2 Item 10 (Picture)



3.2 Item 11 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE


1. The deck floor at the rear of home is loose and warped. A fall or injury can occur if not corrected.

Further investigation and repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

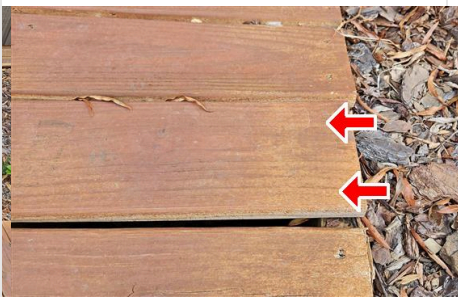

3.4 Item 2 (Picture)



3.4 Item 3 (Picture)



3.4 Item 4 (Picture)



3.4 Item 5 (Picture)



3.4 Item 6 (Picture)


4. STRUCTURAL COMPONENTS

4.4 ROOF STRUCTURE AND ATTIC

☐ REPAIR OR REPLACE

1. The pull down stairs has missing hardware and is considered dangerous. Injury could result if not repaired. Repairs are needed.

A qualified person should repair or replace as needed.

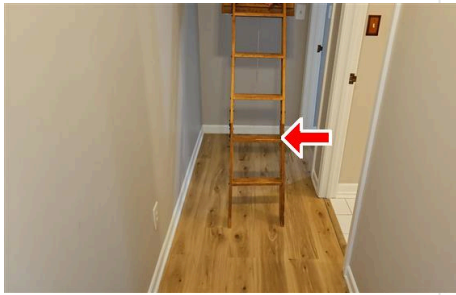

4.4 Item 1 (Picture)



4.4 Item 2 (Picture)



4.4 Item 3 (Picture)

5. PLUMBING SYSTEM

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

REPAIR OR REPLACE

1. The water heater is set over the recommended temperature. (Over 120) The risk is especially acute for infants, children, and the elderly. Water temperatures should never be set higher than 120 degrees.

This is a safety issue. Repairs are needed

A qualified contractor should inspect and repair as needed.



5.1 Item 1 (Picture)

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

REPAIR OR REPLACE


(1)

1. The toilet handle is damaged at the master bath. Therefore the toilet does not function as intended. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.2 Item 1 (Picture)

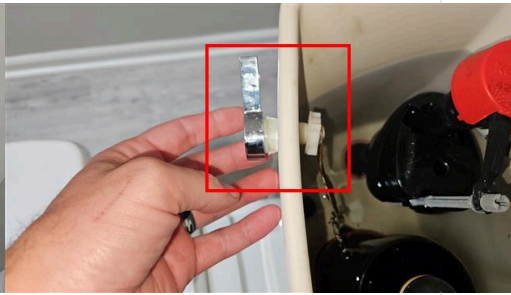

5.2 Item 2 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE


(1)

1. There is a plumbing leak in between the master bathroom shower and bathtub. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

I recommend a qualified licensed plumber repair or correct as needed.



5.3 Item 1 (Picture)

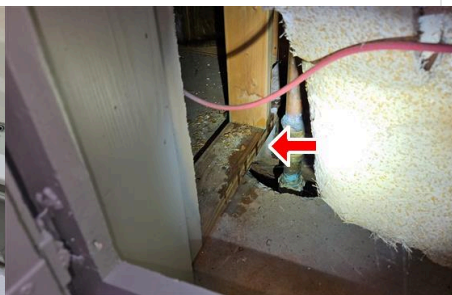

5.3 Item 2 (Picture)



5.3 Item 3 (Picture)



5.3 Item 4 (Picture)




5.3 Item 5 (Picture)

(2)

1. The plumbing waste line is damaged at the guest bath sink. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

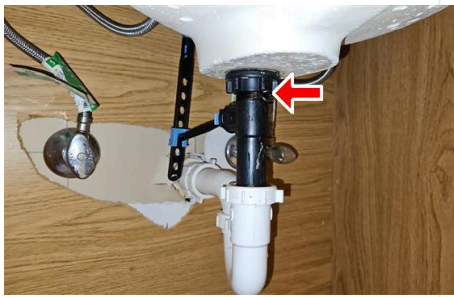

5.3 Item 6 (Picture)



5.3 Item 7 (Picture)

5.5 SHOWER/TUB & TILE WALLS


☐ REPAIR OR REPLACE

1. The master and guest bath fiberglass shower/tub has chips and damage present. Damaged fiberglass tub have been known to leak. This can cause water damage to occur to the home. Further investigation and repairs are needed.

I recommend contacting a licensed plumber.



5.5 Item 1 (Picture)

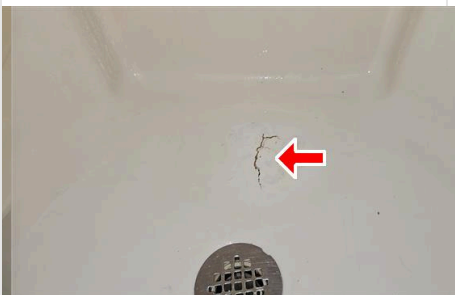


5.5 Item 2 (Picture)



5.5 Item 3 (Picture)



5.5 Item 4 (Picture)

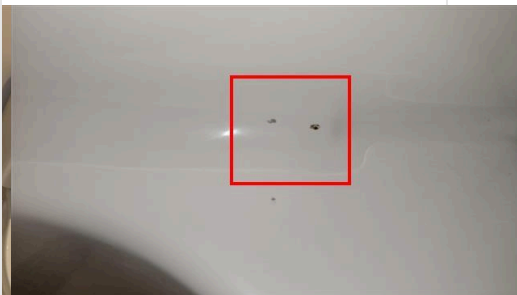

5.5 Item 5 (Picture)


6. ELECTRICAL SYSTEM

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS


☐ REPAIR OR REPLACE

1. Two wires were observed to be connected to one or more circuit breakers in the main panel. While often done, this is not permitted unless the device is so labeled. Double tapping often leads to overloaded circuits and loose connections that can overheat. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.

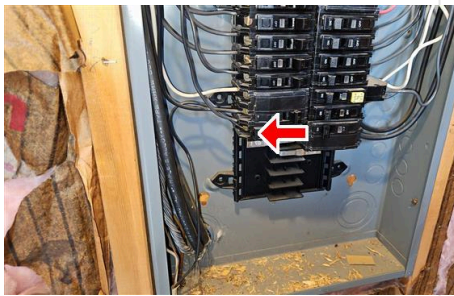

6.2 Item 1 (Picture)

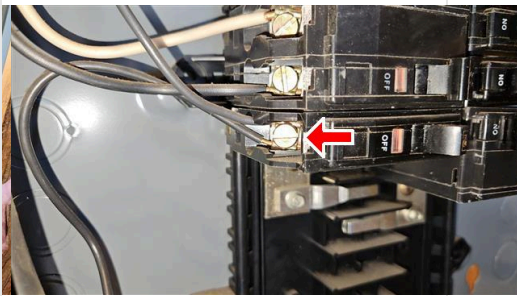

6.2 Item 2 (Picture)

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

☐ REPAIR OR REPLACE


(1)

1. The light fixture is wired incorrectly at the entry coat closet. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.


A qualified licensed electrical contractor should correct as needed.




6.4 Item 1 (Picture)

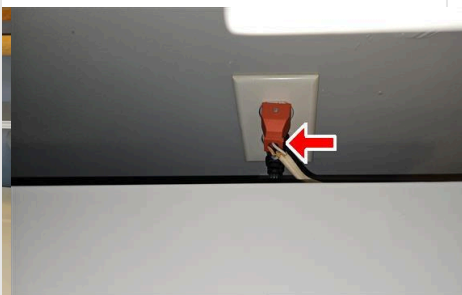


6.4 Item 2 (Picture)

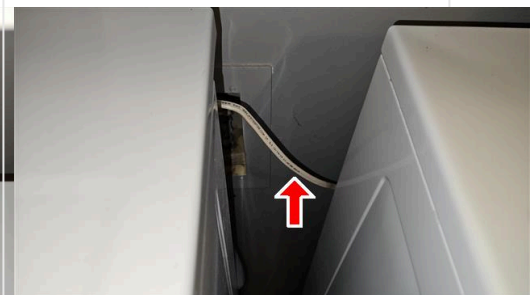


6.4 Item 3 (Picture)

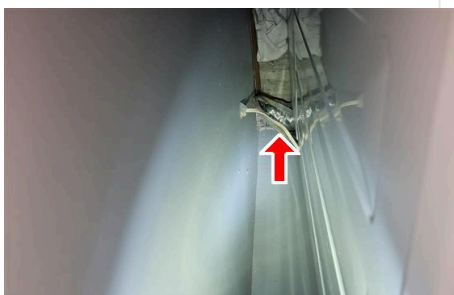

6.4 Item 4 (Picture)

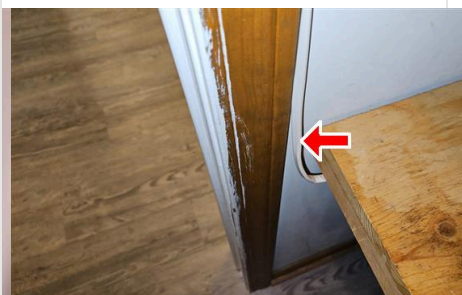

6.4 Item 5 (Picture)

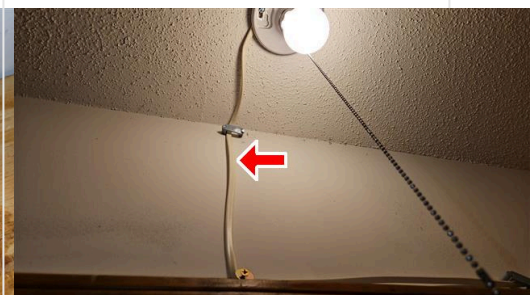

6.4 Item 6 (Picture)

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

☐ REPAIR OR REPLACE

(1)

1. The outlet at the kitchen are not GFIC protected. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.6 Item 1 (Picture)



6.6 Item 2 (Picture)

(2)

1. One GFCI (Ground Fault Circuit Interrupter) outlet at the exterior is loose in the wall. Electrical issues are considered a hazard until repaired. Repairs are needed..

A qualified licensed electrical contractor should correct as needed.



6.6 Item 3 (Picture)



6.6 Item 4 (Picture)

6.8 CARBON MONOXIDE DETECTORS

☐ REPAIR OR REPLACE

1. There is no carbon monoxide detector found in home. It is recommended that one be installed according to the manufacturer's instructions.

A qualified person should repair or replace as needed.

7. HEATING / CENTRAL AIR CONDITIONING

7.7 GAS/LP FIRELOGS AND FIREPLACES

☐ REPAIR OR REPLACE

(1)

1. The black soot build-up indicates that gas fire logs do not appear to be arranged or positioned according to manufacturer's specs. If logs are not positioned correctly, carbon monoxide can be produced. Repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.



7.7 Item 1 (Picture)




7.7 Item 2 (Picture)

(2)

1. The damper for vented fire logs at the Living room is missing a clamp or lock that forces lid to stay open (required for Vented Gas/LP logs). Without a clamp to force open the damper, it could shut and cause unsafe carbon dioxide to enter into living space. Repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.

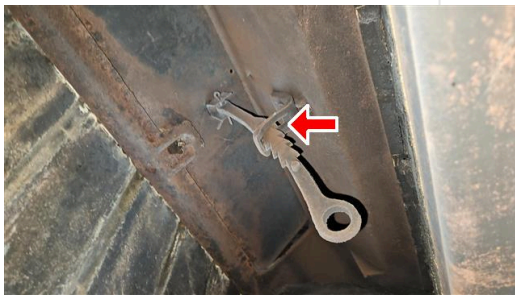

7.7 Item 3 (Picture)

8. INTERIORS

8.6 WINDOWS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE

1. Numerous casement windows are damaged or did not function as intended throughout the home. Further deterioration may occur if not repaired. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



8.6 Item 1 (Picture)



8.6 Item 2 (Picture)



8.6 Item 3 (Picture)


9. INSULATION AND VENTILATION

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

REPAIR OR REPLACE

1. The dryer vent hood at the front of home does not have the proper clearance from the grade/ground to function as intended. Dryer vent exhaust shall terminate not less than 12 inches above finish grade to prevent blockages. Current conditions should be considered a fire hazard until repaired. Repairs are needed.

A qualified person should repair or replace as needed.

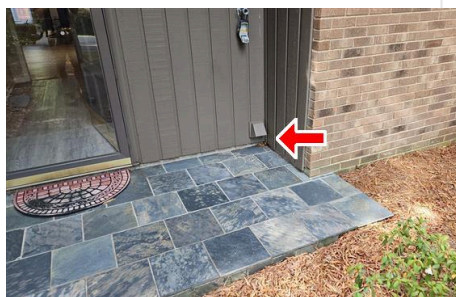

9.5 Item 1 (Picture)



9.5 Item 2 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous

substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

79

✓ ITEMS INSPECTED
Total number in report.

20

📋 SUMMARY COMMENTS
Total number in report.

90

📷 PHOTOS
Total number in report.

🏠 1. PROPERTY OVERVIEW

✂ STYLES & MATERIALS: PROPERTY OVERVIEW

Temperature:

Below 65 (F) = 18 (C)

Weather:

Cloudy

Rain in last 3 days:

No

👁 ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

✓ INSPECTED

1.1 INSPECTION LIMITATIONS

📋 REPAIR OR REPLACE

1. The framing and foundation of the deck were not inspected as the deck was too low to the ground for inspector to enter below. Hidden damage may be present.

I recommend contacting a licensed contractor for further evaluation.



1.1 Item 1 (Picture)



1.1 Item 2 (Picture)

1.2 RADON TESTING

☑ NOT INSPECTED

🏠 2. ROOFING

📋 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

🔧 STYLES & MATERIALS: ROOFING

Roof Covering: Architectural	Age: 10-15 Yrs	Viewed roof covering from: Walked roof
Sky Light(s): One	Chimney (exterior): Brick	Roof-Type: Gable

👁️ ITEMS: ROOFING

2.0 ROOF COVERINGS




✔️ INSPECTED

2.1 FLASHINGS

✔️ REPAIR OR REPLACE

1. The nails for the plumbing vent boots need to be sealed to prevent water damage from occurring. Repairs are needed.

A qualified person should repair or replace as needed.

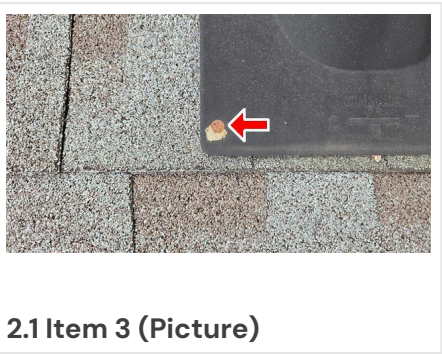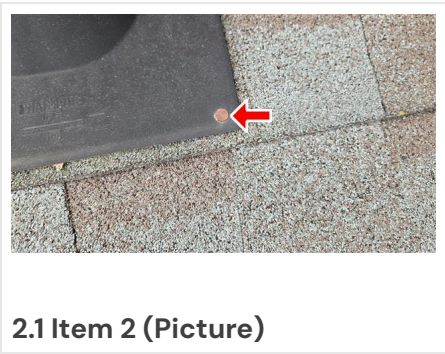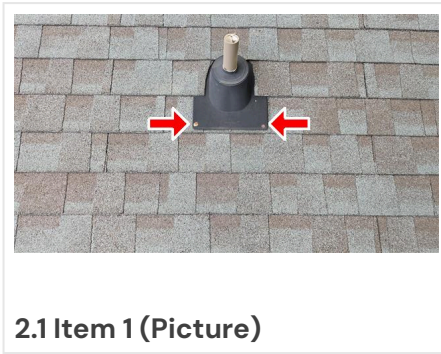

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

📋 REPAIR OR REPLACE

1. The chimney crown appears to hold water and is deteriorate. This can cause deterioration of mortar, loose bricks, other structural problems and water intrusion to occur. Further investigation and repairs are needed.

I recommend a chimney sweep inspect and repairs what is deemed necessary.



2.2 Item 1 (Picture)



2.2 Item 2 (Picture)



2.2 Item 3 (Picture)




2.2 Item 4 (Picture)

2.3 ROOF DRAINAGE SYSTEMS


✓ REPAIR OR REPLACE

1. The gutter needs cleaning of debris at the virtually all areas where gutters are installed. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Repairs are needed.


A qualified person should repair or replace as needed.

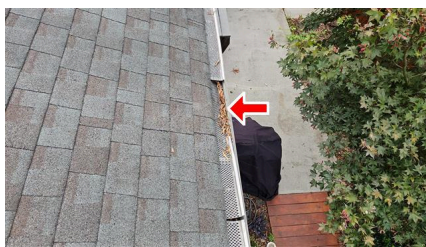

2.3 Item 1 (Picture)

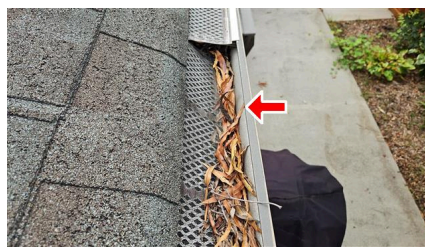

2.3 Item 2 (Picture)

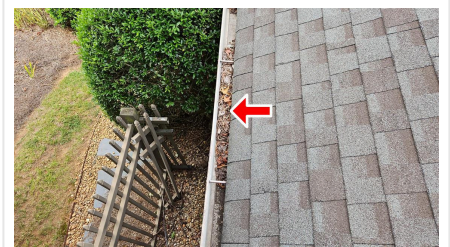

2.3 Item 3 (Picture)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 3. EXTERIOR



📋 DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

✂️ STYLES & MATERIALS: EXTERIOR

Siding Style:

Lap
Brick

Siding Material:

Wood
Brick veneer

Exterior Entry Doors:

Wood
Steel
Insulated glass

Appurtenance:

Deck

Driveway:

Asphalt

👁️ ITEMS: EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM

✅ REPAIR OR REPLACE


(1)

1. The wood siding at the exterior in areas deteriorated. Further deterioration can occur if not corrected. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



3.0 Item 1 (Picture)

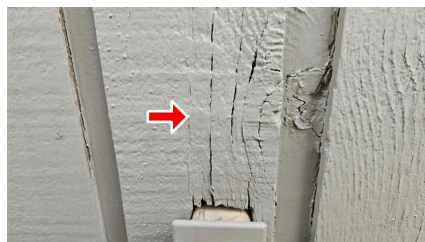

3.0 Item 2 (Picture)




3.0 Item 3 (Picture)

(2)

1. Siding in contact with ground at left side (facing front). Because the siding is in contact with ground it is possible for framing to be deteriorated. We did not inspect behind this siding. Recommend a ground clearance of six to eight inches where possible. Repairs are needed.

A qualified person should repair or replace as needed.

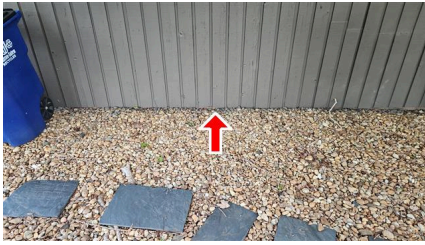

3.0 Item 4 (Picture)

3.1 EAVES, SOFFITS AND FASCIAS

✓ INSPECTED

3.2 WINDOWS

📋 REPAIR OR REPLACE

(1)

1. The wood windows are deteriorated. Further deterioration may occur if not repaired. Further investigation and repairs are needed.

I recommend a qualified contractor inspect and repair as needed.



3.2 Item 1 (Picture)



3.2 Item 2 (Picture)



3.2 Item 3 (Picture)



3.2 Item 4 (Picture)



3.2 Item 5 (Picture)

(2)

1. Several windows have failed/compromised thermal seals/fogged window panes. This is indicated by the visible moisture, discoloration, calcium deposits and or crystallization visible between the glass

window panes. A certified window technician should recheck all the windows throughout the home. Due to weather conditions many times compromised/failed windows cannot be identified at the time of inspection. Further investigation and repairs are needed.

We recommend contacting a properly licensed window technician/contractor regarding these conditions and have repairs made deemed appropriate



3.2 Item 6 (Picture)




3.2 Item 7 (Picture)



3.2 Item 8 (Picture)



3.2 Item 9 (Picture)

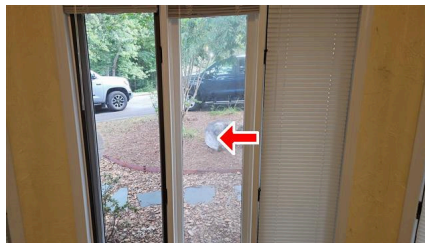

3.2 Item 10 (Picture)



3.2 Item 11 (Picture)

3.3 DOORS (EXTERIOR)


✓ INSPECTED

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE

1. The deck floor at the rear of home is loose and warped. A fall or injury can occur if not corrected. Further investigation and repairs are needed.

A qualified contractor should repair or replace as needed.

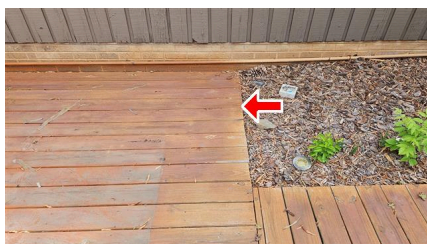


3.4 Item 1 (Picture)



3.4 Item 2 (Picture)



3.4 Item 3 (Picture)

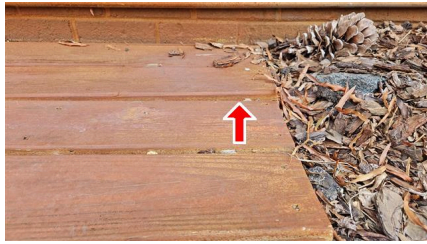

3.4 Item 4 (Picture)



3.4 Item 5 (Picture)



3.4 Item 6 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☑ INSPECTED

3.6 GARAGE DOOR (S)

☑ NOT PRESENT

3.7 GARAGE DOOR OPERATORS (REPORT WHETHER OR NOT DOORS WILL REVERSE WHEN MET WITH RESISTANCE)

☑ NOT PRESENT

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

☑ NOT PRESENT

3.9 OCCUPANT DOOR (FROM GARAGE TO INSIDE OF HOME)

☑ NOT PRESENT

3.10 GARAGE FLOOR

☑ NOT PRESENT

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

4. STRUCTURAL COMPONENTS

DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation:

Poured concrete

Method used to observe
Crawlspace:

No crawlspace

Floor Structure:

Slab

Wall Structure:

2 X 4 Wood

Columns or Piers:

Supporting walls

Ceiling Structure:

2X4

Roof Structure:

Engineered wood trusses

ITEMS: STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

 INSPECTED

4.1 COLUMNS OR PIERS

 INSPECTED

4.2 FLOORS (STRUCTURAL)

 INSPECTED

4.3 CEILINGS (STRUCTURAL)

 INSPECTED

4.4 ROOF STRUCTURE AND ATTIC

 REPAIR OR REPLACE

1. The pull down stairs has missing hardware and is considered dangerous. Injury could result if not repaired. Repairs are needed.

A qualified person should repair or replace as needed.



4.4 Item 1 (Picture)



4.4 Item 2 (Picture)



4.4 Item 3 (Picture)

4.5 WOOD DETERIORATION

☑ INSPECTED

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☑ INSPECTED

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



Complimentary photo of the water heater

✂️ STYLES & MATERIALS: PLUMBING SYSTEM

Water Source:

Public

Water Filters:

None

Plumbing Water Supply (into home):

Copper

Plumbing Water Distribution (inside home):

Copper
PEX

Washer Drain Size:

2" Diameter

Plumbing Waste:

PVC

Water Heater Power Source:

Gas (quick recovery)

Water Heater Capacity:

40 Gallon (1-2 people)

Manufacturer:

A.O. SMITH

Water Heater Location:


Utility Room

👁️ ITEMS: PLUMBING SYSTEM

5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

✓ INSPECTED

The main shut off is the black knob located at the utility room. This is for your information.

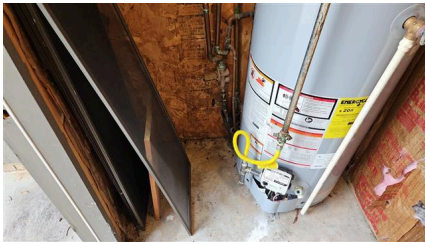

5.0 Item 1 (Picture)



5.0 Item 2 (Picture)

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

📋 REPAIR OR REPLACE

1. The water heater is set over the recommended temperature. (Over 120) The risk is especially acute for infants, children, and the elderly. Water temperatures should never be set higher than 120 degrees. This is a safety issue. Repairs are needed

A qualified contractor should inspect and repair as needed.



5.1 Item 1 (Picture)

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

📋 REPAIR OR REPLACE


(1)

1. The toilet handle is damaged at the master bath. Therefore the toilet does not function as intended. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.2 Item 1 (Picture)

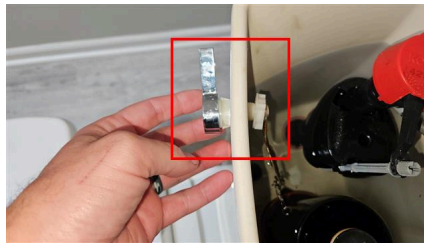


5.2 Item 2 (Picture)

(2)

1. The outside water faucet loose, and needs securing to wall at the rear of home. This can allow undue stress to occur on supply lines allowing leaks to occur. Repairs are needed.

A qualified licensed plumber should repair or correct as needed.

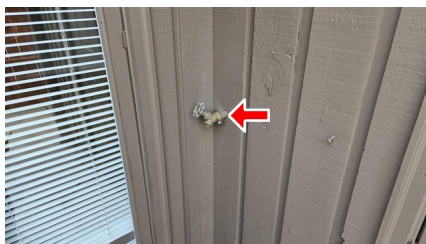

5.2 Item 3 (Picture)



5.2 Item 4 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE


(1)

1. There is a plumbing leak in between the master bathroom shower and bathtub. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

I recommend a qualified licensed plumber repair or correct as needed.



5.3 Item 1 (Picture)

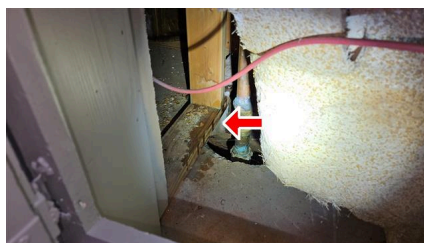

5.3 Item 2 (Picture)



5.3 Item 3 (Picture)



5.3 Item 4 (Picture)



5.3 Item 5 (Picture)

(2)

1. The plumbing waste line is damaged at the guest bath sink. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 6 (Picture)



5.3 Item 7 (Picture)

5.4 SINKS, FIXTURES, AND TOILETS

✓ INSPECTED

5.5 SHOWER/TUB & TILE WALLS


📋 REPAIR OR REPLACE

1. The master and guest bath fiberglass shower/tub has chips and damage present. Damaged fiberglass tub have been known to leak. This can cause water damage to occur to the home. Further investigation and repairs are needed.

I recommend contacting a licensed plumber.



5.5 Item 1 (Picture)

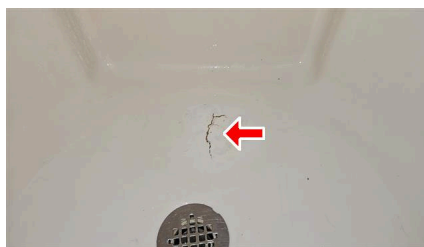


5.5 Item 2 (Picture)



5.5 Item 3 (Picture)



5.5 Item 4 (Picture)

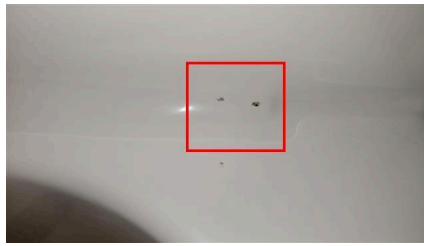

5.5 Item 5 (Picture)

5.6 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)

✓ INSPECTED


The oil line connection at oil filter is leaking at the oil barrel. This can contaminate the soil and should be corrected. I did not inspect soil. I recommend a qualified contractor inspect and repair as needed.

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 6. ELECTRICAL SYSTEM

☰ DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

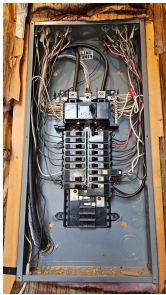

Complimentary photo of the electric panel with the cover off

✂ STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service	Panel capacity:	Panel Type:
Conductors:	150 AMP	Circuit breakers
Below ground		
Aluminum		
Electric Panel Manufacturer:	Branch wire 15 and 20 AMP:	Wiring Methods:
SQUARE D	Copper	Romex

👁 ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

The main panel box is located at the outside storage room.

6.1 SERVICE ENTRANCE CONDUCTORS

✓ INSPECTED

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS


📋 REPAIR OR REPLACE

1. Two wires were observed to be connected to one or more circuit breakers in the main panel. While often done, this is not permitted unless the device is so labeled. Double tapping often leads to overloaded circuits and loose connections that can overheat. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.2 Item 1 (Picture)

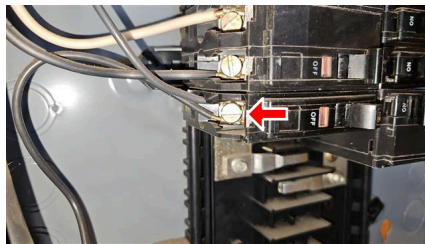

6.2 Item 2 (Picture)

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

📋 REPAIR OR REPLACE


(1)

1. The light fixture is wired incorrectly at the entry coat closet. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 1 (Picture)

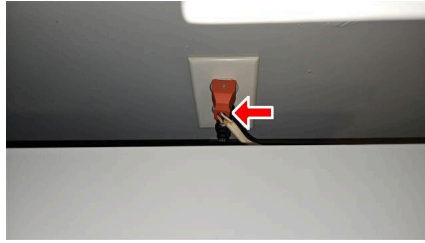

6.4 Item 2 (Picture)



6.4 Item 3 (Picture)



6.4 Item 4 (Picture)



6.4 Item 5 (Picture)



6.4 Item 6 (Picture)

(2)

1. The ceiling fan "wobbles" in the living room. Some fans that wobble cannot be corrected without replacement. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.




6.4 Item 7 (Picture)


(3)

1. One or more "three-prong" outlet is broken or damaged in the living room. Electrical issues are considered a hazard until repaired. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.

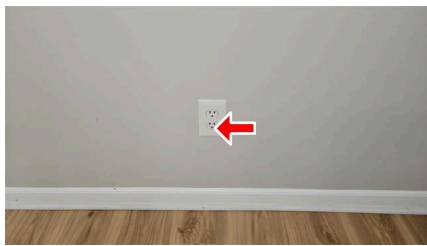

6.4 Item 8 (Picture)

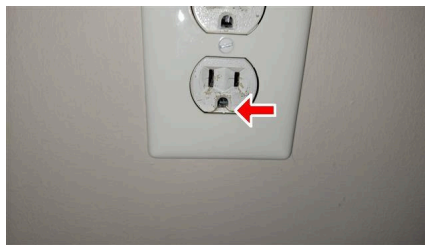

6.4 Item 9 (Picture)

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

✓ INSPECTED


6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

☐ REPAIR OR REPLACE

(1)

1. The outlet at the kitchen are not GFIC protected. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.

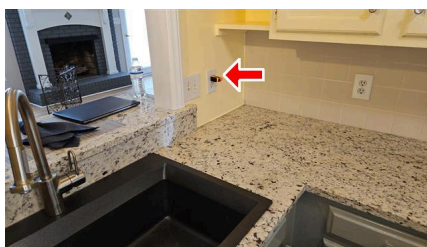

6.6 Item 1 (Picture)



6.6 Item 2 (Picture)

(2)

1. One GFCI (Ground Fault Circuit Interrupter) outlet at the exterior is loose in the wall. Electrical issues are considered a hazard until repaired. Repairs are needed..

A qualified licensed electrical contractor should correct as needed.



6.6 Item 3 (Picture)



6.6 Item 4 (Picture)

6.7 SMOKE DETECTORS

✓ INSPECTED

6.8 CARBON MONOXIDE DETECTORS

✗ REPAIR OR REPLACE

1. There is no carbon monoxide detector found in home. It is recommended that one be installed according to the manufacturer's instructions.

A qualified person should repair or replace as needed.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 7. HEATING / CENTRAL AIR CONDITIONING

📋 DESCRIPTION

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



Complimentary photo of the AC unit



Complimentary photo of the gas furnace with the cover off

✂ STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type:

Forced Air

Number of Heat Systems (excluding wood):

One

Energy Source:

Natural gas

Operated:

Unit Operated

Heat System Brand:

YORK

Ductwork:

Insulated

Types of Fireplaces:

Vented gas logs

Operable Fireplaces:

One

Number of Woodstoves:

None

Cooling Equipment Type:

Air conditioner unit

Air Conditioning Age:

1-5 yrs

Cooling Equipment Energy Source:

Electricity

Central Air Manufacturer:

RHEEM

Number of AC Only Units:

One

👁 ITEMS: HEATING / CENTRAL AIR CONDITIONING

7.0 HEATING EQUIPMENT

✓ INSPECTED

7.1 NORMAL OPERATING CONTROLS

✓ INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

✓ INSPECTED

7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

✓ INSPECTED

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

✓ INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

✓ INSPECTED

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

✓ NOT PRESENT

7.7 GAS/LP FIRELOGS AND FIREPLACES

📋 REPAIR OR REPLACE

(1)

1. The black soot build-up indicates that gas fire logs do not appear to be arranged or positioned according to manufacturer's specs. If logs are not positioned correctly, carbon monoxide can be produced. Repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.



7.7 Item 1 (Picture)




7.7 Item 2 (Picture)

(2)

1. The damper for vented fire logs at the Living room is missing a clamp or lock that forces lid to stay open (required for Vented Gas/LP logs). Without a clamp to force open the damper, it could shut and cause unsafe carbon dioxide to enter into living space. Repairs are needed.

A qualified licensed HVAC (Heat/Ventilation/Air conditioning Contractor) should inspect further and repair as needed.

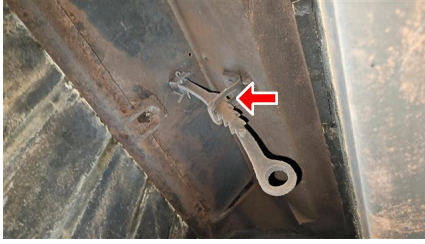

7.7 Item 3 (Picture)

7.8 COOLING AND AIR HANDLER EQUIPMENT

☑ INSPECTED

7.9 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

☑ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 8. INTERIORS

📋 DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

✂️ STYLES & MATERIALS: INTERIORS

Ceiling Materials:

Drywall

Interior Doors:

Hollow core

Raised panel

Wall Material:

Drywall

Window Types:

Thermal/Insulated

Casement

Fixed

Floor Covering(s):

Vinyl Plank


👁️ ITEMS: INTERIORS

8.0 CEILINGS


✅ REPAIR OR REPLACE

1. The drywall on the ceiling reveals a light stain which appears from a water leak. Stain appears old at the master bath. This damage is considered cosmetic. Further investigation may be needed.

A qualified person should repair or replace as needed.

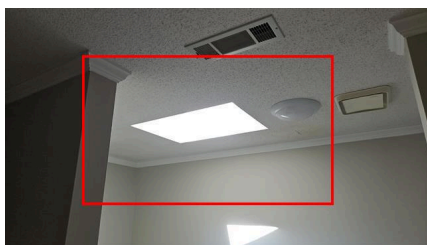

8.0 Item 1 (Picture)

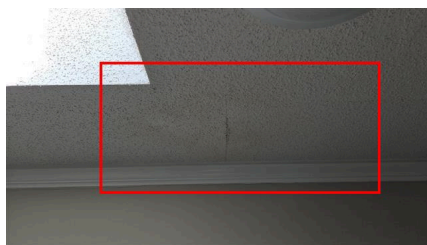

8.0 Item 2 (Picture)



8.0 Item 3 (Picture)

8.1 WALLS

✅ INSPECTED

8.2 FLOORS

✅ INSPECTED

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

✓ INSPECTED

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)


✓ INSPECTED

8.5 DOORS (REPRESENTATIVE NUMBER)

✓ REPAIR OR REPLACE

1. The privacy door rubs at jamb when closing at the guest bedroom. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

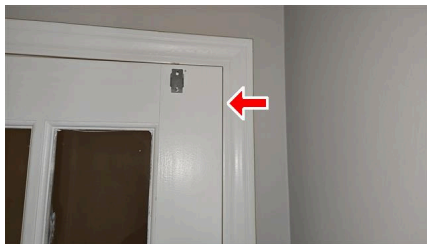

8.5 Item 1 (Picture)

8.6 WINDOWS (REPRESENTATIVE NUMBER)

✗ REPAIR OR REPLACE

1. Numerous casement windows are damaged or did not function as intended throughout the home. Further deterioration may occur if not repaired. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



8.6 Item 1 (Picture)



8.6 Item 2 (Picture)



8.6 Item 3 (Picture)

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 9. INSULATION AND VENTILATION

📋 DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

🔧 STYLES & MATERIALS: INSULATION AND VENTILATION

Attic info: Pull Down stairs	Method used to observe attic: From entry	Attic Insulation: Rock wool
Ventilation: Ridge vents Soffit Vents	Exhaust Fans: Fan only	Dryer Power Source: 220 Electric
Dryer Vent: Metal	Floor System Insulation: NONE	

👁️ ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

✔ NOT PRESENT

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

✔ INSPECTED

9.2 INSULATION IN ATTIC

✔ REPAIR OR REPLACE

1. Rock Wool (loose-fill) insulation is missing in areas in attic. Heat loss can occur more on this home than one that is properly insulated. Repairs are needed.

A qualified person should repair or replace as needed.



9.2 Item 1 (Picture)

9.3 INSULATION UNDER FLOOR SYSTEM

✓ INSPECTED

9.4 ATTIC ACCESS


✓ INSPECTED

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

✗ REPAIR OR REPLACE

1. The dryer vent hood at the front of home does not have the proper clearance from the grade/ground to function as intended. Dryer vent exhaust shall terminate not less than 12 inches above finish grade to prevent blockages. Current conditions should be considered a fire hazard until repaired. Repairs are needed.

A qualified person should repair or replace as needed.

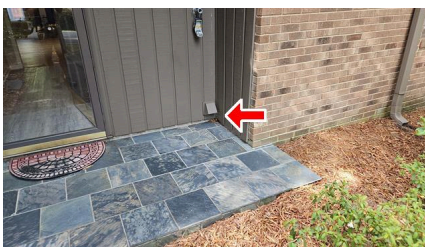

9.5 Item 1 (Picture)



9.5 Item 2 (Picture)

9.6 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

✓ NOT PRESENT

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that

the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 10. BUILT-IN KITCHEN APPLIANCES

📋 DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

🔧 STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Granite

Cabinetry:

Wood


👁️ ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER


✅ REPAIR OR REPLACE

1. The dishwasher door is rubbing the mounting screw. Their deterioration could occur. Repairs are needed.

I recommend contacting appliance repair company.

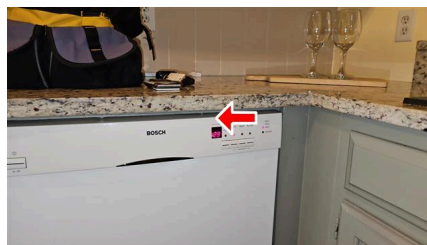

10.0 Item 1 (Picture)

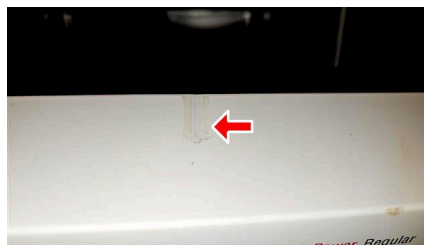

10.0 Item 2 (Picture)

10.1 RANGES/OVENS/COOKTOPS

✅ INSPECTED

10.2 RANGE HOOD (S)

✅ INSPECTED

10.3 FOOD WASTE DISPOSER

✅ INSPECTED

10.4 MICROWAVE COOKING EQUIPMENT

✓ INSPECTED

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



Above Parr Home Inspections

Report Attachments

ATTENTION: This inspection report is incomplete without reading the information included herein at these links/ attachments. Note If you received a printed version of this page and did not receive a copy of the report through the internet please contact your inspector for a printed copy of the attachments.

[NC WDIIR](#)