



INSPECTION REPORT
127 Streamside Ests Dr
Mooresville NC 28117

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 7/8/2024
🕒 09:00:00 AM

Michael A Parr
3692

INVOICE

Above Parr Home Inspections

Inspected By: Alex Parr 3692

Inspection Date: 7/8/2024
Report ID: 070824AP5

Customer Info:	Inspection Property:
Aubrey Sherrill	127 Streamside Ests Dr Mooresville NC 28117
Customer's Real Estate Professional: Will Sheppard Will Sheppard Realty	

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	755.00	1	755.00
Basic Well Water Testing	130.00	1	130.00
Inspection Discount	-55.00	1	-55.00

Tax \$0.00

Total Price \$830.00

Payment Method: Credit Card

Payment Status: Paid

Note:

GENERAL INFO

Property Address

127 Streamside Ests Dr
Mooresville NC 28117

Date of Inspection

7/8/2024

Report ID

070824AP5

Customer(s)

Aubrey Sherrill

Time of Inspection

09:00:00 AM

Real Estate Agent

Will Sheppard
Will Sheppard Realty

INSPECTION DETAILS

Approximate age of building:

Over 25 Years

In Attendance:

Customer representative

Radon Test:

No

Water Test:

Yes

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

No

Type of building:

Single Family (1 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

■ ■ ■ TABLE OF CONTENTS

Cover Page1

Invoice 2

Intro Page 3

Table of Contents 4

General Summary 5

1 Property Overview18

2 Roofing 20

3 Exterior22

4 Structural Components 26

5 Plumbing System 29

6 Electrical System 35

7 Heating / Central Air Conditioning 39

8 Interiors 43

9 Insulation and Ventilation47

10 Built-In Kitchen Appliances 49

GENERAL SUMMARY

Above Parr Home Inspections

Customer

Aubrey Sherrill

Address

127 Streamside Ests Dr
Mooresville NC 28117

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling;** or **warrants further investigation by a specialist,** or **requires subsequent observation.** This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

1. PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

REPAIR OR REPLACE

1. Discoloration and some type of mold (Microbial) growth is present in the structure at several areas including but not limited to the crawl space and interior spaces. Evidence suggests that this condition is from a past or present elevated moisture conditions. We did not inspect, test or determine if this type of substance is or is not a health hazard. Further investigation is needed.


We recommend you contact a properly licensed expert for testing, investigation and or correction as deemed appropriate.



1.0 Item 1 (Picture)



1.0 Item 2 (Picture)

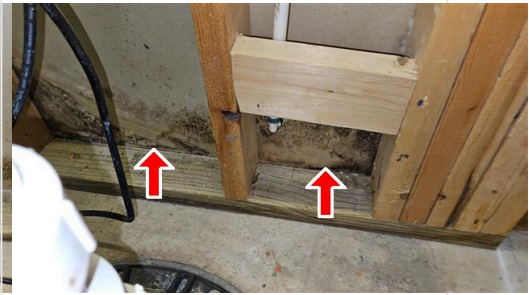

1.0 Item 3 (Picture)

2. ROOFING

2.3 ROOF DRAINAGE SYSTEMS

☐ REPAIR OR REPLACE

(1)

1. The gutter is holding water due to leaves or debris at the front (right of main entry). Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 1 (Picture)



2.3 Item 2 (Picture)

(2)

1. The downspout missing part (S) at the front left corner of home. Erosion can continue or become worse if not corrected possibly leading to water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 3 (Picture)



2.3 Item 4 (Picture)

3. EXTERIOR

3.3 DOORS (EXTERIOR)

REPAIR OR REPLACE

1. The front door will not latch properly. Evidence suggest that the door needs strike and latch adjustment to shut properly. Repairs are needed.

A qualified person should repair or replace as needed.



3.3 Item 1 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

REPAIR OR REPLACE

1. The guardrail on steps at the rear of home are lower than 36 inches from deck floor. A fall or injury could occur if not corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

REPAIR OR REPLACE

(1)

1. The sidewalk at the front of home uneven, and can be a tripping hazard. Water can cause further deterioration if not repaired and sealed properly. A fall or injury can occur if not corrected. Repairs are needed.

A qualified person should repair or replace as needed.



3.5 Item 1 (Picture)



3.5 Item 2 (Picture)

(2)

1. The sidewalk at the front of home is sloped back towards the home. Water can cause further deterioration if not repaired and sealed properly. Further deterioration can occur if not repaired.

A qualified person should repair or replace as needed.



3.5 Item 3 (Picture)

(3)

1. The sidewalk at the front of home is sloped back towards the home. Water can cause further deterioration if not repaired and sealed properly. Further deterioration can occur if not repaired.

A qualified person should repair or replace as needed.



3.5 Item 4 (Picture)


4. STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

☐ REPAIR OR REPLACE

1. The brick at the rear of home has cracks present with outward displacement/ movement present. The wall(s) may need reinforcement. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.

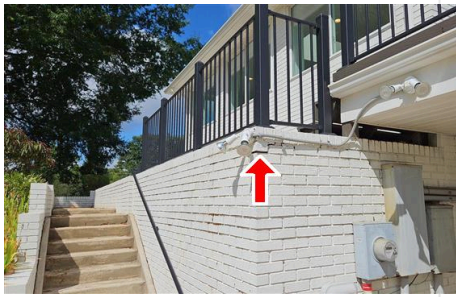

4.0 Item 1 (Picture)




4.0 Item 2 (Picture)

4.4 ROOF STRUCTURE AND ATTIC

☐ REPAIR OR REPLACE

1. The pull down stairs is damaged and dangerous (Missing spring). Injury could result if not repaired. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.

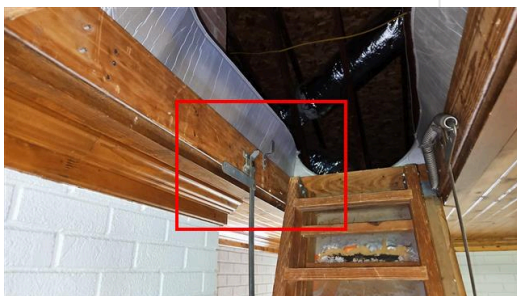

4.4 Item 1 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☐ REPAIR OR REPLACE

1. Dark stains on the CMU (Concrete Masonry Unit) Indicated that water is inside the block. Dark stains and white efflorescence (powder substance) on block wall indicates moisture is in contact with the masonry. This does not necessarily indicate that intrusion will occur. Efflorescence is found on many homes without water intrusion occurring inside the home. But, it should alert you to the possibility that future steps may be needed. Further investigation and repairs are needed.

I recommend contact a licensed water intrusion specialist regarding these conditions.



4.6 Item 1 (Picture)



4.6 Item 2 (Picture)

5. PLUMBING SYSTEM

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

REPAIR OR REPLACE

(1)

1. The water heater appears to be leaking at hot supply outlet and cold supply inlet. Leaks can cause damage to unit or home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 1 (Picture)



5.1 Item 2 (Picture)



5.1 Item 3 (Picture)

(2)

1. The existing piping for T&P valve on water heater fails to extend downward to within six inches of floor. This is a safety issue and should be repaired. A replacement is needed.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 4 (Picture)

(3)

1. The water heater is set over the recommended temperature. (Over 120) The risk is especially acute for

infants, children, and the elderly. Water temperatures should never be set higher than 120 degrees.

This is a safety issue. Repairs are needed

A qualified contractor should inspect and repair as needed.



5.1 Item 5 (Picture)


5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☐ REPAIR OR REPLACE

(1)

1. Non typical water lines above the water heater and the floor system has been damaged. I recommend having a plumber review the water lines to ensure they are the proper. I recommend having a contractor review the damage to the truss. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

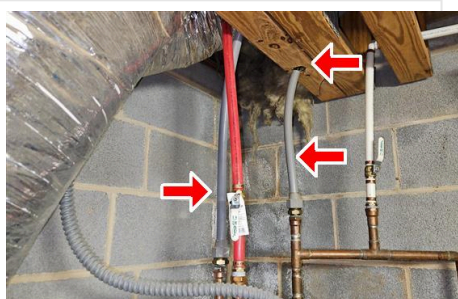


5.2 Item 1 (Picture)



5.2 Item 2 (Picture)

(2)

1. Polybutylene plastic plumbing supply lines (PB) are installed in the subject house. Polybutylene has been used in this area for many years, but has had a higher than normal failure rate, and is no longer being widely used. Copper and Brass fittings used in later years have apparently reduced the failure rate. This subject house has copper fittings. For further details contact the Consumer Plumbing Recovery center at 1-800-392-7591 or the web at <http://www.pbpipe.com>

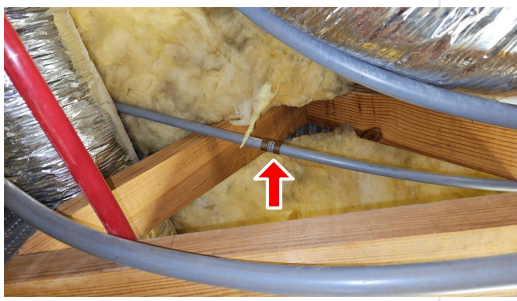

5.2 Item 3 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

REPAIR OR REPLACE


(1)

1. The shower drain is damaged at the guest bath. This is a safety issue. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 1 (Picture)

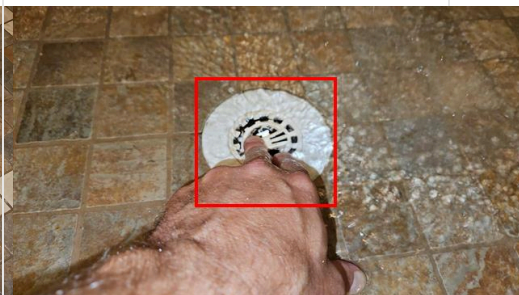

5.3 Item 2 (Picture)

(2)

1. The plumbing waste line leaks at the guest bath sink. Repairs are needed to prevent water damage from occurring to the home. Repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 3 (Picture)



5.3 Item 4 (Picture)


5.4 SHOWER/TUB & TILE WALLS

REPAIR OR REPLACE

1. The shower door does not shut properly at the guest bath. This is a safety issue. Further investigation

and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

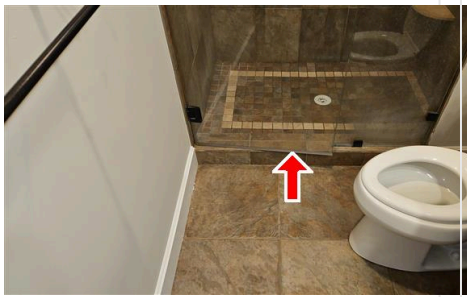

5.4 Item 1 (Picture)



5.4 Item 2 (Picture)

6. ELECTRICAL SYSTEM


6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

☐ REPAIR OR REPLACE

(1)

1. Some labels are present, but are illegible or confusing for the electrical panels. This is a safety issue. Repairs are recommended.

A qualified licensed electrical contractor should correct as needed.

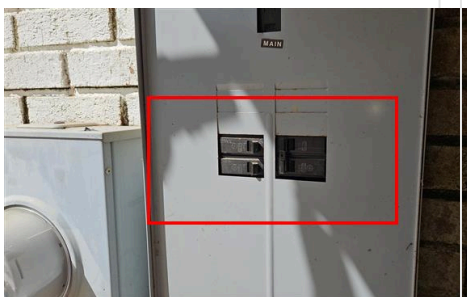

6.2 Item 1 (Picture)



6.2 Item 2 (Picture)


6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

☐ REPAIR OR REPLACE

(1)

1. The electrical conduit and junction box is loose above the ovens. This is a safety issue. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.

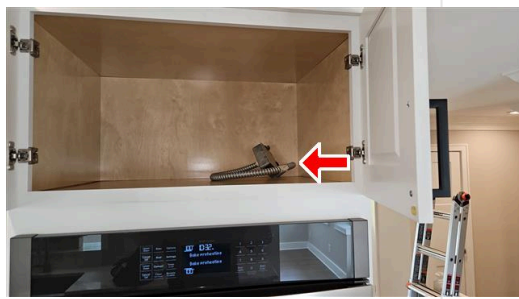

6.4 Item 1 (Picture)

(2)

1. The wall switch is missing "cover-plate" at the master bedroom closet. This is a safety issue that needs to be corrected. Repairs are needed..

A qualified licensed electrical contractor should correct as needed.



6.4 Item 2 (Picture)

7. HEATING / CENTRAL AIR CONDITIONING


7.8 COOLING AND AIR HANDLER EQUIPMENT

☐ REPAIR OR REPLACE


(1)

1. It appears they are trying to heat and cool the sunroom in the basement. The connection is improper and the unit may not be sized for this. Further investigation and repairs are needed.

I recommend further inspection by a licensed HVAC contractor.

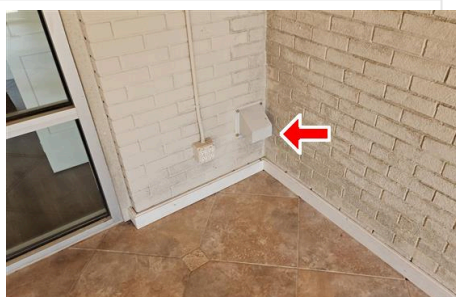

7.8 Item 1 (Picture)

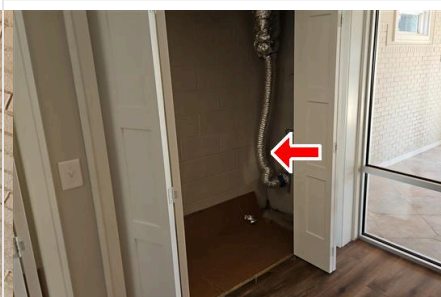

7.8 Item 2 (Picture)



7.8 Item 3 (Picture)



7.8 Item 4 (Picture)

(2)

1. The platform for condenser(s) is not level. This can cause damage to the unit or shorten its life span. Further investigation and repairs are needed.

I recommend further inspection by a licensed HVAC contractor.



7.8 Item 5 (Picture)

(3)

1. The ambient air test was performed by using thermometers on the air handler of Heat pump in cool mode to determine if the difference in temperatures of the supply and return air are between 14 degrees and 22 degrees which indicates that the unit is cooling as intended. (For the pool house) The supply air temperature on your system read 76 degrees, and the return air temperature was 75 degrees. This indicates that the unit is **not** cooling properly and a licensed Heat/Air contractor should inspect for cause or problem.



7.8 Item 6 (Picture)



7.8 Item 7 (Picture)

(4)

1. The heat pump is leaking at the unit in the attic. Evidence suggest the primary condensation line may be clogged. Leaks can cause damage to unit or home. Further investigation and repairs are needed.

A qualified HVAC person should inspect further and repair or replace as needed.



7.8 Item 8 (Picture)



7.8 Item 9 (Picture)



7.8 Item 10 (Picture)

8. INTERIORS


8.5 DOORS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE

(1)

1. The bifold door is damaged or not installed at the basement closet. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

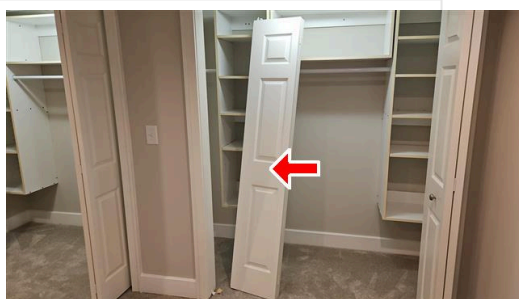

8.5 Item 1 (Picture)

8.6 WINDOWS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE

1. One window will not shut properly at the Sunroom. Further investigation and repairs are needed..

A qualified person should repair or replace as needed.



8.6 Item 1 (Picture)

9. INSULATION AND VENTILATION

9.4 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

REPAIR OR REPLACE

1. The dryer vent hood at the right side (facing front) does not have the proper clearance from the grade/ground to function as intended. Dryer vent exhaust shall terminate not less than 12 inches above finish grade to prevent blockages. Current conditions should be considered a fire hazard until repaired. Repairs are needed.

A qualified person should repair or replace as needed.



9.4 Item 1 (Picture)

9.4 Item 2 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous

substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

88

✓ ITEMS INSPECTED
Total number in report.

29

📋 SUMMARY COMMENTS
Total number in report.

76

📷 PHOTOS
Total number in report.

🏠 1. PROPERTY OVERVIEW

✂ STYLES & MATERIALS: PROPERTY OVERVIEW

Temperature:

Over 65 (F) = 18 (C)

Weather:

Clear

Rain in last 3 days:

Yes

👁 ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

📋 REPAIR OR REPLACE

1. Discoloration and some type of mold (Microbial) growth is present in the structure at several areas including but not limited to the crawl space and interior spaces. Evidence suggests that this condition is from a past or present elevated moisture conditions. We did not inspect, test or determine if this type of substance is or is not a health hazard. Further investigation is needed.

We recommend you contact a properly licensed expert for testing, investigation and or correction as deemed appropriate.



1.0 Item 1 (Picture)



1.0 Item 2 (Picture)



1.0 Item 3 (Picture)

1.1 INSPECTION LIMITATIONS

☑ INSPECTED

1.2 RADON TESTING

☑ NOT INSPECTED

 2. ROOFING

 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

 STYLES & MATERIALS: ROOFING

Roof Covering: Architectural	Age: 10-15 Yrs	Viewed roof covering from: Walked roof
Sky Light(s): One	Chimney (exterior): Brick	Roof-Type: Gable Hip

 ITEMS: ROOFING

2.0 ROOF COVERINGS

 INSPECTED

2.1 FLASHINGS

 INSPECTED

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

 INSPECTED


2.3 ROOF DRAINAGE SYSTEMS

 REPAIR OR REPLACE

(1)

1. The gutter is holding water due to leaves or debris at the front (right of main entry). Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.

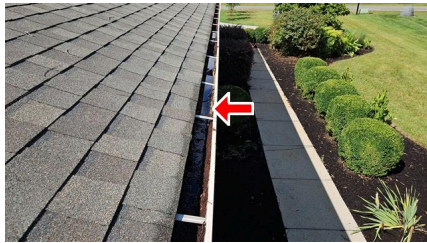

2.3 Item 1 (Picture)



2.3 Item 2 (Picture)

(2)

1. The downspout missing part (S) at the front left corner of home. Erosion can continue or become worse if not corrected possibly leading to water intrusion. Repairs are needed.

A qualified person should repair or replace as needed.



2.3 Item 3 (Picture)



2.3 Item 4 (Picture)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

3. EXTERIOR



DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

STYLES & MATERIALS: EXTERIOR

Siding Style:

Brick

Siding Material:

Brick veneer

Exterior Entry Doors:

Steel

Insulated glass

Appurtenance:

Deck with steps

Sidewalk

Patio

Driveway:

Concrete

ITEMS: EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM

 INSPECTED

3.1 EAVES, SOFFITS AND FASCIAS

 INSPECTED

3.2 WINDOWS

 INSPECTED

3.3 DOORS (EXTERIOR)

 REPAIR OR REPLACE

1. The front door will not latch properly. Evidence suggest that the door needs strike and latch adjustment to shut properly. Repairs are needed.

A qualified person should repair or replace as needed.



3.3 Item 1 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

REPAIR OR REPLACE

1. The guardrail on steps at the rear of home are lower than 36 inches from deck floor. A fall or injury could occur if not corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

REPAIR OR REPLACE

(1)

1. The sidewalk at the front of home uneven, and can be a tripping hazard. Water can cause further deterioration if not repaired and sealed properly. A fall or injury can occur if not corrected. Repairs are needed.

A qualified person should repair or replace as needed.



3.5 Item 1 (Picture)



3.5 Item 2 (Picture)

(2)

1. The sidewalk at the front of home is sloped back towards the home. Water can cause further deterioration if not repaired and sealed properly. Further deterioration can occur if not repaired.

A qualified person should repair or replace as needed.



3.5 Item 3 (Picture)

(3)

1. The sidewalk at the front of home is sloped back towards the home. Water can cause further deterioration if not repaired and sealed properly. Further deterioration can occur if not repaired.

A qualified person should repair or replace as needed.



3.5 Item 4 (Picture)

(4)

1. There is a negative slope at the front of home and can cause or contribute to water intrusion or

deterioration. I recommend correcting landscape to drain water away from home.
A qualified person should repair or replace as needed.



3.5 Item 5 (Picture)

3.6 GARAGE DOOR (S)

✓ INSPECTED

3.7 GARAGE DOOR OPERATORS (REPORT WHETHER OR NOT DOORS WILL REVERSE WHEN MET WITH RESISTANCE)

✓ INSPECTED

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

✓ INSPECTED

3.9 OCCUPANT DOOR (FROM GARAGE TO INSIDE OF HOME)

✓ INSPECTED

3.10 GARAGE FLOOR

✓ INSPECTED

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 4. STRUCTURAL COMPONENTS

📋 DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

✂️ STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation:

Masonry block

Method used to observe

Crawlspace:

Crawled

Floor Structure:

8" or better

Wall Structure:

Wood

Columns or Piers:

Masonry block

Ceiling Structure:

2X4

Roof Structure:

Engineered wood trusses

👁️ ITEMS: STRUCTURAL COMPONENTS


4.0 WALLS (STRUCTURAL)

📋 REPAIR OR REPLACE

1. The brick at the rear of home has cracks present with outward displacement/ movement present.

The wall(s) may need reinforcement. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.

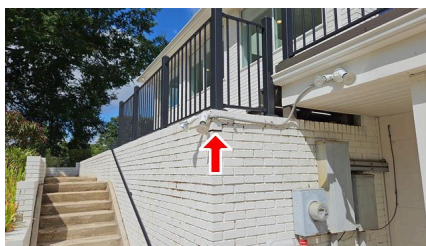

4.0 Item 1 (Picture)



4.0 Item 2 (Picture)

4.1 COLUMNS OR PIERS

✅ INSPECTED

4.2 FLOORS (STRUCTURAL)

✓ INSPECTED

4.3 CEILINGS (STRUCTURAL)

✓ INSPECTED

4.4 ROOF STRUCTURE AND ATTIC

📋 REPAIR OR REPLACE

1. The pull down stairs is damaged and dangerous (Missing spring). Injury could result if not repaired. Further investigation and repairs are needed.

A qualified person should repair or replace as needed.



4.4 Item 1 (Picture)

4.5 WOOD DETERIORATION

✓ INSPECTED

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

📋 REPAIR OR REPLACE

1. Dark stains on the CMU (Concrete Masonry Unit) Indicated that water is inside the block. Dark stains and white efflorescence (powder substance) on block wall indicates moisture is in contact with the masonry. This does not necessarily indicate that intrusion will occur. Efflorescence is found on many homes without water intrusion occurring inside the home. But, it should alert you to the possibility that future steps may be needed. Further investigation and repairs are needed.

I recommend contact a licensed water intrusion specialist regarding these conditions.



4.6 Item 1 (Picture)



4.6 Item 2 (Picture)

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



Complimentary photo of the water heater

✂️ STYLES & MATERIALS: PLUMBING SYSTEM

Water Source: Well	Water Filters: Sediment filter (We do not inspect filtration systems)	Plumbing Water Supply (into home): Copper
Plumbing Water Distribution (inside home): Copper PEX POLY	Washer Drain Size: 2" Diameter	Plumbing Waste: PVC
Water Heater Power Source: Electric	Water Heater Capacity: 80 Gallon (plenty)	Manufacturer: CRAFTMASTER
Water Heater Location: Basement		

ITEMS: PLUMBING SYSTEM

5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

✓ INSPECTED

The main shut off is the blue knob located in the basement. This is for your information.



5.0 Item 1 (Picture)

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

☐ REPAIR OR REPLACE

(1)

1. The water heater appears to be leaking at hot supply outlet and cold supply inlet. Leaks can cause damage to unit or home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 1 (Picture)



5.1 Item 2 (Picture)



5.1 Item 3 (Picture)

(2)

1. The existing piping for T&P valve on water heater fails to extend downward to within six inches of floor. This is a safety issue and should be repaired. A replacement is needed.

A qualified licensed plumber should repair or correct as needed.



5.1 Item 4 (Picture)

(3)

1. The water heater is set over the recommended temperature. (Over 120) The risk is especially acute for infants, children, and the elderly. Water temperatures should never be set higher than 120 degrees. This is a safety issue. Repairs are needed

A qualified contractor should inspect and repair as needed.



5.1 Item 5 (Picture)


5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☐ REPAIR OR REPLACE

(1)

1. Non typical water lines above the water heater and the floor system has been damaged. I recommend having a plumber review the water lines to ensure they are the proper. I recommend having a contractor review the damage to the truss. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

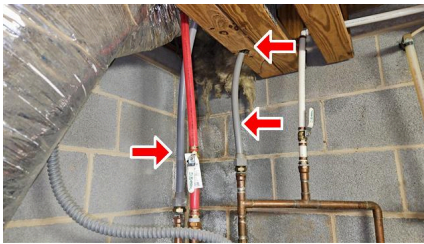


5.2 Item 1 (Picture)



5.2 Item 2 (Picture)

(2)

1. Polybutylene plastic plumbing supply lines (PB) are installed in the subject house. Polybutylene has been used in this area for many years, but has had a higher than normal failure rate, and is no longer being widely used. Copper and Brass fittings used in later years have apparently reduced the failure rate. This subject house has copper fittings. For further details contact the Consumer Plumbing Recovery center at 1-800-392-7591 or the web at <http://www.pbpipe.com>

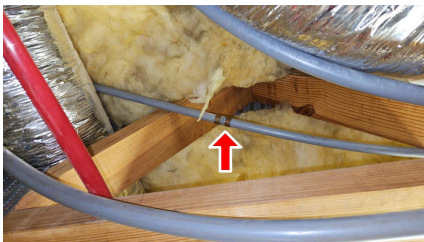

5.2 Item 3 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

☐ REPAIR OR REPLACE

(1)

1. The shower drain is damaged at the guest bath. This is a safety issue. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 1 (Picture)



5.3 Item 2 (Picture)


(2)

1. The plumbing waste line leaks at the guest bath sink. Repairs are needed to prevent water damage from occurring to the home. Repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 3 (Picture)

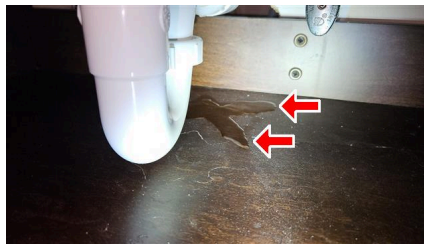


5.3 Item 4 (Picture)

5.4 SHOWER/TUB & TILE WALLS

☐ REPAIR OR REPLACE

1. The shower door does not shut properly at the guest bath. This is a safety issue. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

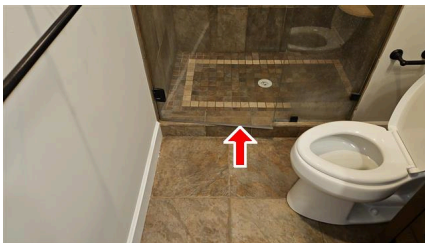

5.4 Item 1 (Picture)



5.4 Item 2 (Picture)

5.5 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)

☑ NOT PRESENT

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 6. ELECTRICAL SYSTEM

📋 DESCRIPTION


The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.



Coqmplimentary photo of the electric panel with the cover off



Complimentary photo of the sub panel with the cover off

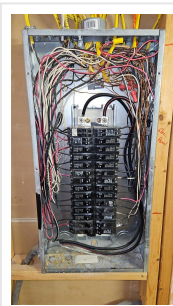

Complimentary photo of the sub panel with the cover off

⚙️ STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service Conductors: Below ground Aluminum	Panel capacity: 200 AMP	Panel Type: Circuit breakers
Electric Panel Manufacturer: GENERAL ELECTRIC	Branch wire 15 and 20 AMP: Copper	Wiring Methods: Romex

🔍 ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

The main panel box is located at the outside.

6.1 SERVICE ENTRANCE CONDUCTORS

✓ INSPECTED

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

✗ REPAIR OR REPLACE

(1)

1. Some labels are present, but are illegible or confusing for the electrical panels. This is a safety issue. Repairs are recommended.

A qualified licensed electrical contractor should correct as needed.



6.2 Item 1 (Picture)




6.2 Item 2 (Picture)


(2)

1. One or more circuit in main/sub panel is of a different brand than panel manufacturer. The manufacture requires that in order for the panel to be safe, only their brand is allowed to be used inside the panel. Even though these circuit breaker are all "UL approved," they are not approved to be used in panels of different manufactures unless so indicated on the panel label. Further investigation is needed.

A qualified licensed electrical contractor should correct as needed.

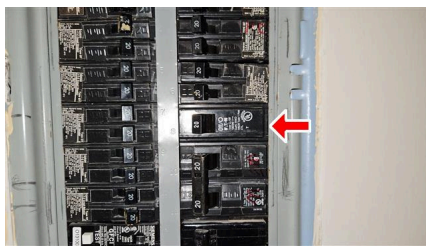

6.2 Item 3 (Picture)

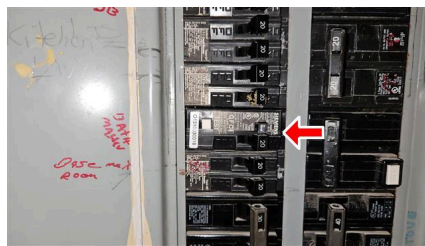

6.2 Item 4 (Picture)

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED


6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

🔧 REPAIR OR REPLACE

(1)

1. The electrical conduit and junction box is loose above the ovens. This is a safety issue. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.

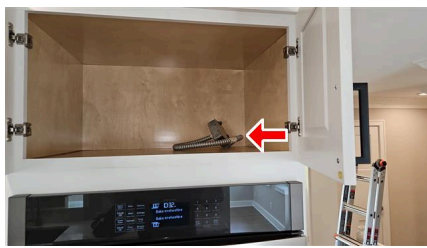

6.4 Item 1 (Picture)

(2)

1. The wall switch is missing "cover-plate" at the master bedroom closet. This is a safety issue that needs to be corrected. Repairs are needed..

A qualified licensed electrical contractor should correct as needed.




6.4 Item 2 (Picture)

(3)

1. The light fixture does not work (try bulb first) at the throughout the home. Further investigation and repairs are needed..

A qualified licensed electrical contractor should correct as needed.

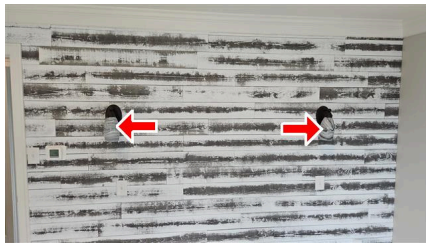

6.4 Item 3 (Picture)



6.4 Item 4 (Picture)

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

✓ INSPECTED

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

✓ INSPECTED

6.7 SMOKE DETECTORS

✓ INSPECTED

6.8 CARBON MONOXIDE DETECTORS

✓ INSPECTED

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



Complimentary photo of the heat pump



Heat Type:

Heat Pump Forced Air (also provides cool air)

Energy Source:

Electric

Ductwork:

Insulated

Number of Woodstoves:

Heating Age:

1-5 yrs

5-10 yrs

Operated:

Summer-Did not operate due to weather conditons. (Could damage the system)

Types of Fireplaces:

Solid Fuel

Cooling Equipment Type:

**Number of Heat Systems
(excluding wood):**

Three

Heat System Brand:

TRANE

Operable Fireplaces:

One

Air Conditioning Age:

None	Heat Pump Forced Air (also provides warm air)	1-5 yrs 5-10 yrs
Cooling Equipment Energy Source: Electricity	Central Air Manufacturer: TRANE	Number of AC Only Units: Three

👁 ITEMS: HEATING / CENTRAL AIR CONDITIONING

7.0 HEATING EQUIPMENT

✓ INSPECTED

7.1 NORMAL OPERATING CONTROLS

✓ INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

✓ INSPECTED

7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

✓ INSPECTED

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

✓ INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

✓ REPAIR OR REPLACE

1. The liner was mainly visible and appears good except for creosote dust that may conceal a hairline crack until cleaned and inspected by a licensed chimney sweep. For a detailed inspection of liner. Further investigation is needed.

I recommend a qualified chimney sweep inspect for safety.



7.5 Item 1 (Picture)

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

✓ INSPECTED

7.7 GAS/LP FIRELOGS AND FIREPLACES

✓ NOT PRESENT


7.8 COOLING AND AIR HANDLER EQUIPMENT

📋 REPAIR OR REPLACE


(1)

1. It appears they are trying to heat and cool the sunroom in the basement. The connection is improper and the unit may not be sized for this. Further investigation and repairs are needed.

I recommend further inspection by a licensed HVAC contractor.

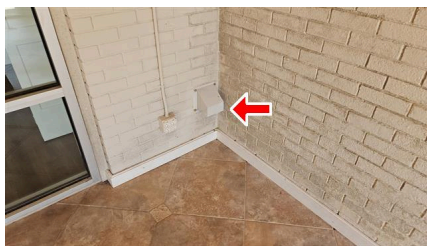

7.8 Item 1 (Picture)

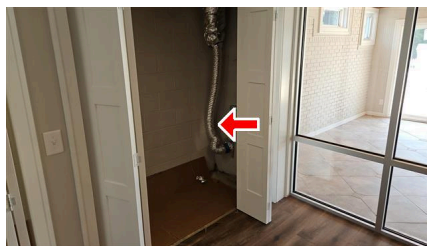

7.8 Item 2 (Picture)



7.8 Item 3 (Picture)



7.8 Item 4 (Picture)

(2)

1. The platform for condenser(s) is not level. This can cause damage to the unit or shorten its life span. Further investigation and repairs are needed.

I recommend further inspection by a licensed HVAC contractor.



7.8 Item 5 (Picture)

(3)

1. The ambient air test was performed by using thermometers on the air handler of Heat pump in cool mode to determine if the difference in temperatures of the supply and return air are between 14 degrees and 22 degrees which indicates that the unit is cooling as intended. (For the pool house) The supply air temperature on your system read 76 degrees, and the return air temperature was 75 degrees. This indicates that the unit is **not** cooling properly and a licensed Heat/Air contractor should inspect for cause or problem.



7.8 Item 6 (Picture)



7.8 Item 7 (Picture)

(4)

1. The heat pump is leaking at the unit in the attic. Evidence suggest the primary condensation line may be clogged. Leaks can cause damage to unit or home. Further investigation and repairs are needed.

A qualified HVAC person should inspect further and repair or replace as needed.



7.8 Item 8 (Picture)



7.8 Item 9 (Picture)



7.8 Item 10 (Picture)

7.9 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

☑ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 8. INTERIORS

 DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

 STYLES & MATERIALS: INTERIORS

Ceiling Materials: Drywall Suspended ceiling panels	Wall Material: Drywall	Floor Covering(s): Carpet Vinyl Plank
Interior Doors: Hollow core Raised panel	Window Types: Thermal/Insulated Tilt feature Casement Sliders Fixed	

 ITEMS: INTERIORS

8.0 CEILINGS

 INSPECTED

8.1 WALLS

 INSPECTED

8.2 FLOORS

 INSPECTED

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

 INSPECTED

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

 REPAIR OR REPLACE

1. The hinge hardware in master bath is loose. Therefore it does not function as intended. Repairs are needed.

I recommend repair or replace as necessary.



8.4 Item 1 (Picture)



8.4 Item 2 (Picture)


8.5 DOORS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE

(1)

1. The bifold door is damaged or not installed at the basement closet. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

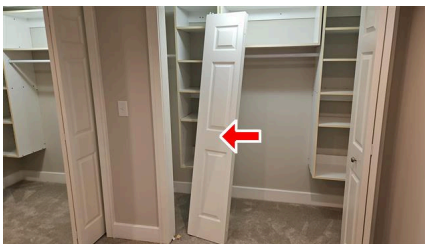


8.5 Item 1 (Picture)

(2)

1. The pocket door needs adjustment at the laundry room. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

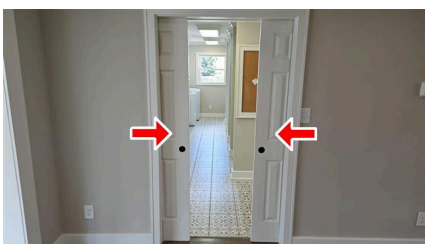


8.5 Item 2 (Picture)

(3)

1. The closet door rubs floor when opened. Door needs to be trimmed at bottom by a skilled

craftsman at the guest bedrooms. As a result the door will not close properly. Repairs are needed. A qualified person should repair or replace as needed.

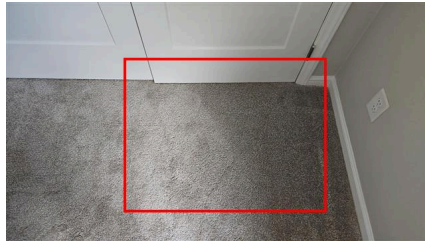**8.5 Item 3 (Picture)****8.5 Item 4 (Picture)**

(4)

1. The door at master Bedroom will not latch properly. Evidence suggest that the door needs strike and latch adjustment to shut properly. This is a small repair.




A qualified person should repair or replace as needed.

**8.5 Item 5 (Picture)**

(5)

1. The doors rubs at jamb when closing in the basement. As a result the door will not close properly. Repairs are needed.

A qualified person should repair or replace as needed.

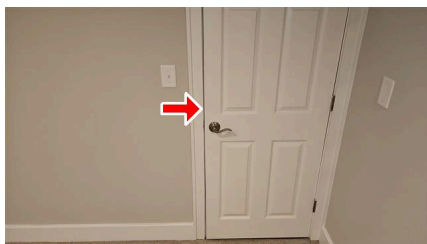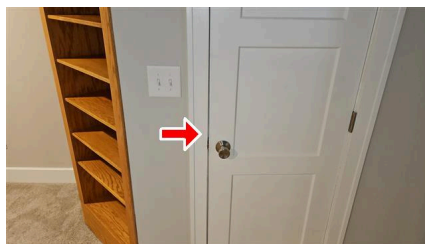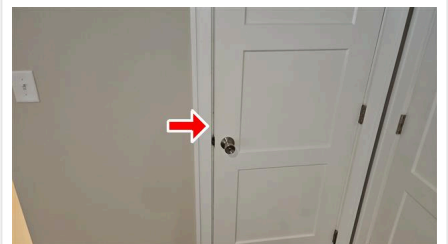**8.5 Item 6 (Picture)****8.5 Item 7 (Picture)****8.5 Item 8 (Picture)**

8.6 WINDOWS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE

1. One window will not shut properly at the Sunroom. Further investigation and repairs are needed..

A qualified person should repair or replace as needed.



8.6 Item 1 (Picture)

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 9. INSULATION AND VENTILATION

 DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

 STYLES & MATERIALS: INSULATION AND VENTILATION

Attic info: Pull Down stairs	Method used to observe attic: From entry	Attic Insulation: Blown Fiberglass
Ventilation: Gable vents Ridge vents	Exhaust Fans: Fan	Dryer Power Source: 220 Electric
Dryer Vent: Metal	Floor System Insulation: Faced Batts	

 ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

 INSPECTED

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

 INSPECTED

9.2 INSULATION IN ATTIC

 REPAIR OR REPLACE

1. Fiberglass (loose-fill) insulation is is compressed in areas of the attic due to foot traffic or storage in attic. Heat loss can occur more on this home than one that is properly insulated. Repairs are recommended .

A qualified person should repair or replace as needed.



9.2 Item 1 (Picture)

9.3 INSULATION UNDER FLOOR SYSTEM

✓ INSPECTED

9.4 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

✍ REPAIR OR REPLACE

1. The dryer vent hood at the right side (facing front) does not have the proper clearance from the grade/ground to function as intended. Dryer vent exhaust shall terminate not less than 12 inches above finish grade to prevent blockages. Current conditions should be considered a fire hazard until repaired. Repairs are needed.

A qualified person should repair or replace as needed.



9.4 Item 1 (Picture)



9.4 Item 2 (Picture)

9.5 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

✓ NOT PRESENT

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

10. BUILT-IN KITCHEN APPLIANCES

DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Granite

Cabinetry:

Wood


ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER

REPAIR OR REPLACE

1. The dishwasher drain hose needs to be looped above the level of the kitchen sink drain or an approved air gap installed to prevent back flow of waste water into the water supply. (food safety issue) This can allow waste for the sink to contaminate the dishwasher. This is a small repair.

A qualified licensed plumber should repair or correct as needed.

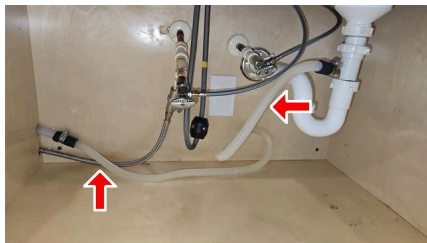

10.0 Item 1 (Picture)

10.1 RANGES/OVENS/COOKTOPS

INSPECTED

10.2 RANGE HOOD (S)

INSPECTED

10.3 TRASH COMPACTOR

NOT PRESENT

10.4 FOOD WASTE DISPOSER

☑ NOT PRESENT

10.5 MICROWAVE COOKING EQUIPMENT

☑ NOT PRESENT

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.