



INSPECTION REPORT
2339 Perry Rd.
Denver NC 28037

INSPECTED BY
Mike Sweeting
(704)651-8190
MikeS@hicarolina.com
NC #5106

INSPECTION DATE
📅 3/26/2025
Home Inspection
Carolina





TABLE OF CONTENTS

Cover Page	1
Table of Contents	2
Intro Page	3
1 Deck(s)/Patio(s)/Porches	6
2 Exterior/Trim/Foundation	9
3 Grounds/Pavings	12
4 Garage-Carport	13
5 Roof Systems	15
6 Attic Interior System	19
7 Plumbing System	22
8 Laundry Area	25
9 Electrical System	26
10 HVAC System(s) Information	29
11 Cooling System(s)	31
12 Heating System	33
13 Interior Components	34
14 Bathrooms	40
15 Kitchen-Appliances	43
16 Basement	45
Back Page	46
Summary	47

Complete Home Inspection Report

Exclusively for: Daniel Bare

Including: Limitations, Recommendations, Material Types, and Additional Photos

THIS REPORT WAS INTENDED TO BE VIEWED IN COLOR.

Date:
3/26/2025

Property:
2339 Perry Rd.
Denver NC 28037

Buyers Agent:
Jake Reed



Inspector:
Mike Sweeting
(704)651-8190
MikeS@hicarolina.com
NC #5106

People present at the time of inspection:

Buyer(s), Buyers Agent

Building Type:

Split Level

Utilities Status:

All utilities on

Outside Temperature (F):

40-50 Degrees

Payment Type:

Paid by Check at the time of inspection

House Occupancy/Limitations:

The home was unoccupied but still furnished or partially furnished at the time of inspection. When a home is occupied with furniture, clothing, and other stored items, it can obstruct the view and access to walls, receptacle outlets, under sinks, etc. The time in which the home has been vacant is unknown.

INSPECTION INFORMATION

The summary section is NOT the entire report.

Your complete report contains important information that may be of great concern to you. You are highly advised to review the entire report promptly. If you have any questions about the negotiability of any item in the report under the real estate purchase contract, please reach out to your real estate agent or an attorney for assistance.

Important - A qualified licensed contractor specializing in the fields mentioned in the report must be consulted to assess all findings or defects. Additional repairs may be necessary. Concealed defects could exist beyond initial inspection. It is highly recommended to have a thorough evaluation of the damage and necessary repairs before the home sale closes and during due diligence, or the contingency period. This report serves solely as a visual inspection. Its purpose is to offer guidance for your assessment of the home's overall condition. It does not determine the property's value or offer advice on its purchase.

THIS REPORT WAS INTENDED TO BE VIEWED IN COLOR.

INSPECTION REPORT INFORMATION

Your summary section is NOT the entire report.

The complete report may include additional information of great concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney.

IMPORTANT - Due to the findings or defects stated within the report. A qualified licensed contractor who specializes in the respective fields of our findings or defects listed should be consulted to evaluate any and all findings or defects further. To determine the full extent of any damage(s) and or determine if additional repairs are required, which may be deemed necessary by the qualified licensed contractor. There may be other defects concealed and or otherwise unseen at the time of the initial inspection.

Further evaluation is recommended before the close of escrow on the home, due diligence, and or contingency period, whichever comes first, to thoroughly understand the extent of the damage(s) and the full extent of the repairs needed, required, or deemed necessary by the qualified licensed contractor.

Please understand that this is a visual inspection only. The report provided is intended only as a general guide to help you make your own evaluation of the overall condition of the home. This inspection is not intended to reflect the value of the premises nor make any representation as to the advisability of purchase.

Home Inspection Definitions

Home Inspection: A home inspection is a limited, non-invasive visual examination of the condition of a home. To visually inspect essential components of a residential dwelling designed to identify MATERIAL DEFECTS.

Direction: Our State requirements require us to direct our clients to consult with qualified licensed contractors for further evaluation of all defects identified within our report. It is essential that you thoroughly understand the extent of any problem before the close of escrow on the home.

Ancillary Services: Ancillary services, such as Mold Sampling, Radon Tests, etc., are not part of this home inspection and do not fall under state Standard of Practice guidelines. For your convenience, other services may be listed within this report; however, they are to be viewed as independent services and individually. For more information on additional ancillary services we provide, please get in touch with our office or visit our website at <https://www.homeinspectioncarolina.com/services/>

Material Defects: A material defect is a specific issue with a system or component of a residential property that may have a significant, adverse impact on the property's value or pose an unreasonable risk to people.

The following report reflects the visual conditions of the property at the time of the inspection only. The summary and main report are a list of items found to be defective, needing repair, or further evaluation. Please understand there may be hidden or concealed damage that could not be viewed, seen, or present at the time of inspection. For your protection, we strongly recommend consulting with a qualified licensed contractor to evaluate further all defects noted within this report. Hidden or concealed defects are not inspected and are not included in this report. No warranty is either expressed or implied in the home inspection report. This report is not an insurance policy nor a warranty service.

The point of reference for this report is from the street looking at the front of the house. (The front, right crawl space would be the front, right corner of the home, not the front right corner from the crawl space access door unless otherwise stated).

This inspection has been completed according to the standards of practice and code of ethics within the states of North or South Carolina. Please for a copy of the NC SOP, please [Click Here](#). For SC, [Click Here](#).

1. DECK(S)/PATIO(S)/PORCHES

DESCRIPTION

DECK INFORMATION

Decks and porches are often built close to the ground, where no viewing or access is possible. Any areas too low to enter or not accessible are excluded from the inspection. There is no inspection and/or evaluation or moving of landscape components such as but not limited to trees, shrubs, fountains, ponds, statuary, pottery, fire pits, patio fans, heat lamps, and decorative or low-voltage lighting.

TYPES & DESCRIPTIONS: DECK(S)/PATIO(S)/PORCHES

Deck Materials:

Wood Columns
Wood Framing
Wood Decking

Patio Type:

Concrete

ITEMS: DECK(S)/PATIO(S)/PORCHES

1.0 DECK/PATIO/PORCH VISUAL FINDINGS

FURTHER EVALUATION IS NEEDED.

(1) The stair stringers are not secured by any ledger or joist hanger. A ledger or joist hanger gives the joist additional support, also preventing it from twisting or moving. A ledger or joist hanger needs to be installed to provide proper support and stability.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(2) There are loose railing(s) that need to be secured properly to prevent continual movement and/or a possible hazard at the rear deck.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(3) There are loose and cupping/bowing boards noted throughout the stair surface. The boards need to be secured properly and the cupping or bowing boards may need to be replaced to prevent a tripping hazard and/or continual movement or cupping.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




stairs

(4) There are nails protruding from the stairs resulting or can result in the boards to become loose as well as creating a possible trip hazard proper corrections and repairs are needed at the rear deck steps.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(5) There are cracked and/or warped spindles found on or around the deck railing. Proper corrections, repairs, and/or replacement are needed for the spindles to allow for proper protection. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

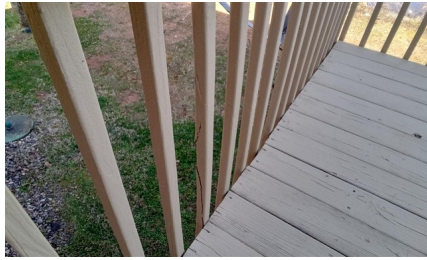

(6) The rear deck is not flashed or no signs of flashing were present at the time of inspection. Flashing is needed to prevent water penetration and wood rot between the deck and siding where it attaches. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



🏠 2. EXTERIOR/TRIM/FOUNDATION

📋 DESCRIPTION

EXTERIOR INFORMATION

In accordance with our standards of practice, we identify foundation types and look for any evidence of structural deficiencies. However, minor cracks or deteriorated surfaces are common in many foundations and most do not represent a structural problem. If major cracks are present along with bowing, we routinely recommend further evaluation be made by a qualified licensed engineer that specializes in residential dwellings. The inspection will certainly alert you to any suspicious cracks if they are clearly visible. We are not specialists, and in the absence of any major defects, we may not recommend that you consult with a foundation contractor, an engineer that specializes in residential dwellings, or a geologist, but this should not deter you from seeking the opinion of any such expert. It is also routinely recommended that inquiry is made with the seller about knowledge of any prior foundation or structural repairs.

All items that are freshly painted including, but not limited to, trim, exterior siding, fascia, and soffit cannot be fully or completely viewed to determine if wood rot exists. Have the seller disclose any recent repairs or painting to determine if any damage has been hidden or concealed before the close of escrow on the home.

✂️ TYPES & DESCRIPTIONS: EXTERIOR/TRIM/FOUNDATION

Siding Types:

Brick Veneer
Stone Veneer Siding

Stories/Foundation:

2 Stories on a Basement
Foundation

🔍 ITEMS: EXTERIOR/TRIM/FOUNDATION

2.0 EXTERIOR VISUAL FINDINGS

📋 FURTHER EVALUATION IS NEEDED.

(1) The exterior light fixtures lack proper sealing at the points where they meet the outer walls on the home, potentially leading to moisture intrusion. It is important to address this issue to prevent potential damage to the structure over time if left unaddressed.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front



front



rear

(2) The flap, which is meant to cover the exhaust vent on the left side of the home, is currently missing or damaged. This issue poses a risk of potential rodent and insect intrusion. To safeguard against such unwanted guests, it is important to address this by either repairing or replacing the flap.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



2.1 TRIM VISUAL FINDINGS

📋 FURTHER EVALUATION IS NEEDED.

(1) Spacing and/or gapping was noted at the sidewalk and stone veneer where it meets the brick veneer. Properly sealing these areas is needed to prevent water penetration where the trim meets the brick veneer at the trim around the home.


Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front




front

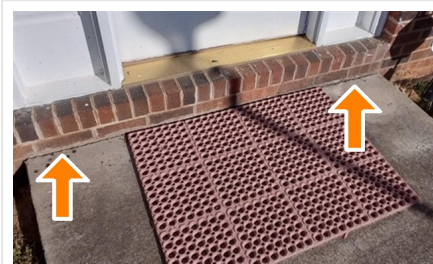


(2) Wood rot has been observed at the trim where it intersects the threshold of the exterior doors. A more thorough assessment is required to ascertain the extent of repair or replacement necessary.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

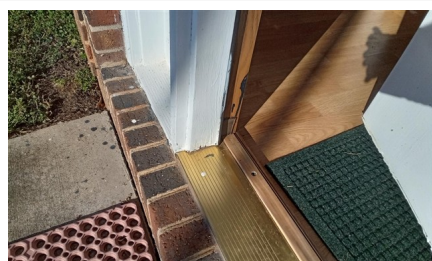

front door

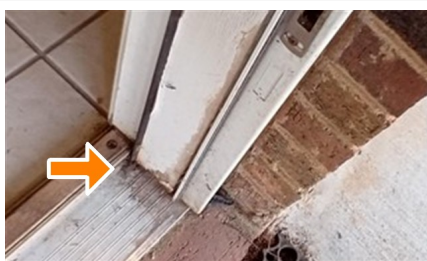

rear basement door

(3) Sealant deficiencies, such as missing or poorly sealed areas, were observed on the exterior siding and trim in various sections around the home, including window and door frames. Corrections are required to prevent potential water seepage or insect infestation.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front window/door



garage



garage



rear deck door

2.2 FOUNDATION VISUAL FINDINGS

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

3. GROUNDS/PAVINGS

DESCRIPTION

GROUND INFORMATION

This inspection is not intended to address or include any geological conditions or site stability information. There are no comments or reporting on coatings or cosmetic deficiencies and the wear and tear associated with the passage of time, which would be apparent to the average person. However, cracks in hard surfaces can imply the presence of expansive soils that can result in continuous movement, but this can only be confirmed by a geological evaluation of the soil. Any reference to grade is limited to only areas around the exterior of the exposed portions around the foundation or exterior walls. The inspection and/or evaluation are not made on any mechanical or remotely controlled components such as driveway gates.

ITEMS: GROUNDS/PAVINGS

3.0 GROUND AREA VISUAL FINDINGS:

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

3.1 EXTERIOR SURROUNDINGS RECOMMENDATIONS/INFORMATION

(1) There are cracks noted at the driveway and/or sidewalk(s) that need to be sealed and or repaired properly to prevent water penetration and or continual cracking. At a minimum, continue to monitor and make any additional repairs as needed.



(2) There are termite bait stations around the exterior foundation of the home. This home may be under a termite bond and may be transferable. Ask the seller if the home is bonded and the rates to transfer the bond to a new owner.



4. GARAGE-CARPORT

DESCRIPTION

GARAGE INFORMATION

Determining the heat resistance rating of firewalls is beyond the scope of this inspection. Flammable materials should not be stored within closed garage areas. It is not uncommon for moisture to penetrate garages, particularly with slabs-on-grade construction, and this may be apparent in the form of efflorescence or salt crystal formations on the concrete. This inspection does not include the inspection of detached garages, however, if a detached garage was inspected without additional costs it was inspected as a courtesy and should not be considered a part of the home inspection as it is not attached to the main structural inspection of the home.

TYPES & DESCRIPTIONS: GARAGE-CARPORT

Reverse Tension Tested:

No - Testing was not conducted due to a defect or at the inspector's discretion; please refer to the limitations for more details.

Garage Sensors (photoelectric safety devices):

Tested and present at the time of inspection


ITEMS: GARAGE-CARPORT

4.0 GARAGE VISUAL FINDINGS

FURTHER EVALUATION IS NEEDED.

There is a dent in the garage door that could prevent the door from opening/closing properly requiring proper corrections and/or repairs/replacement.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

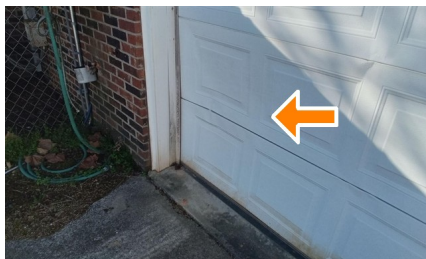

4.1 GARAGE LIMITATIONS

FURTHER EVALUATION IS NEEDED.

(1) The reverse tension on garage doors that have garage door opener(s) installed were not tested at the time of inspection. Testing the reverse tension on the garage door opener may result in damage to the door and/or unit if the settings are not properly set. Without being able to determine if the setting are correct before testing the garage door opener, the opener could not be tested. To ensure that the garage door reverse tension is set

properly, ask the seller for any disclosure to any repairs or adjustments that have been made to the unit, any paperwork provided from any service, builder, and/or installation company. The reversing tension needs to be properly set to prevent possible damage to property, the garage door, and/or the garage door opener.

(2) The garage walls, foundation and/or floor were not fully visible due to stored items along the walls and floor in the garage. Due to the stored items obstructing the viewing of the walls, floor and foundation within the garage, the inspector cannot determine if there is hidden or concealed damage or defects in the garage that may have been obstructed at the time of inspection. The conditions in the obstructed areas are unknown at the time of inspection. It is recommended that all of the stored items be removed from the garage so that a qualified professional can further evaluate the conditions within the garage before the closing or due diligence date as there may be hidden or concealed damage.



🏠 5. ROOF SYSTEMS

📋 DESCRIPTION

ROOF INFORMATION

Although not required, we generally attempt to evaluate various roof types by walking on their surfaces. If we are unable or unwilling to do this for any reason, we will indicate the method used to evaluate them. Every roof will wear differently relative to its age, the number of layers, quality of material, the method of application, exposure to weather conditions, and the regularity of its maintenance. The inspection provided is visual only and the opinion of the general quality and condition of the roofing material can be subjective. Any and all additional concerns should be addressed by a qualified licensed roofing contractor.

Every roof is inspected conscientiously; the remaining life expectancy, or guarantee that it will not leak, cannot and will not be provided by the inspector. It is recommended that you ask the sellers to disclose any information pertaining to repairs, leaks, and/or any additional information. Attached accessories including, but not limited to, solar systems, antennae, and lightning arrestors are not inspected. It is at the discretion of the inspector to climb and/or walk on the roof as it is not a requirement to do so.

✂ TYPES & DESCRIPTIONS: ROOF SYSTEMS

Roof Covering Materials:

Asphalt Shingles

Roof Access:

Due to the pitch, height, or the discretion of the inspector, the roof was viewed from the ground with binoculars. It is at the discretion of the inspector to climb and/or walk on the roof as it is not a requirement to do so.

👁 ITEMS: ROOF SYSTEMS


5.0 ROOF VISUAL FINDING(S)

📋 FURTHER EVALUATION IS NEEDED.

(1) Multiple nail pops or otherwise lifted shingles were noted in multiple locations throughout the roof surface.


This can result in damaged shingles and moisture penetration.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

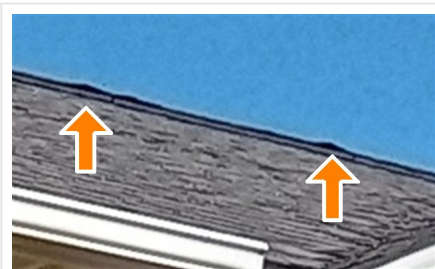

(2) The ridge vent along the top of the roof is loose and needs to be secured properly to prevent possible water penetration.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

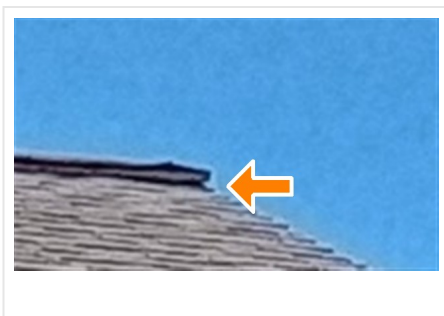

(3) There are lifting, cupping, or bowing shingles noted in the valleys that need repair or corrections to prevent possible wind damage and or water penetration.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front left




front left

5.1 GUTTER VISUAL FINDING(S)


📋 FURTHER EVALUATION IS NEEDED.

(1) The gutters drain into a corrugated piping drain and are missing the coupling that connects the gutter and corrugated piping together. This is needed to prevent debris from entering the corrugated piping and clogging it. Underground drainage from gutters or a drainage system is not inspected at the time of inspection.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

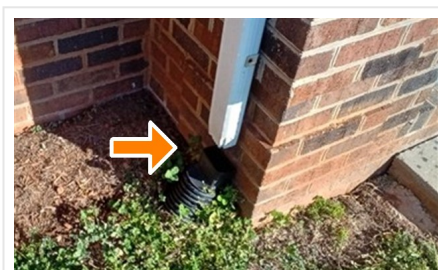


front

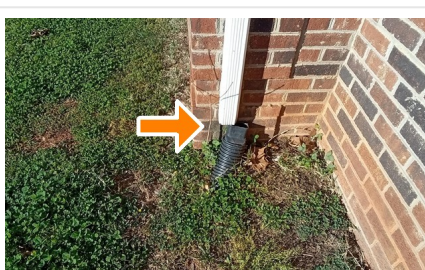

front

(2) A splash block is needed to properly direct water away from the foundation of the home under all gutter down spouts around the home.


Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

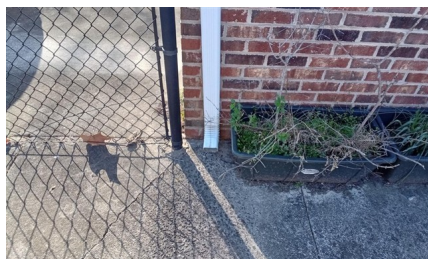

rear

(3) The gutters are bent, loose, and/or damaged around the home. They are in need of repairs and/or replacement to properly direct water away from the home and foundation.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

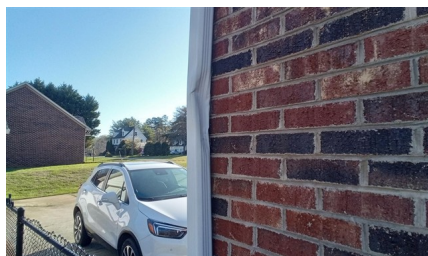

rear right

5.2 FLASHING VISUAL FINDING(S)

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

5.3 FASCIA/SOFFITS/EAVE VISUAL FINDING(S)

📋 FURTHER EVALUATION IS NEEDED.


(1) There are loose piece(s) of fascia that need to be re-installed and/or secured properly to prevent water penetration and/or possible damage at the front of the home.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(2) There is damaged and/or rotted soffit that needs repaired and/or replaced. The source of the water that caused or is causing the damage needs to be located and corrected to prevent continual rot at the right of the home.


Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

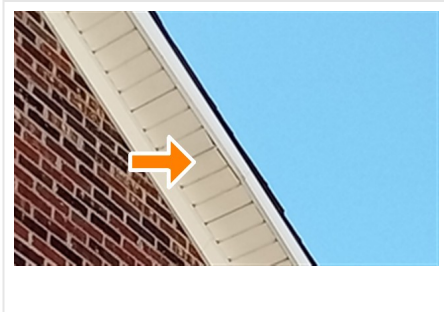

5.4 ROOF LIMITATIONS/RESTRICTIONS

FURTHER EVALUATION IS NEEDED.

Solar panels were found to be installed on the roof of the home. Solar panels are not inspected or tested during the home inspection, as this is outside the standards of practice. During the inspection, it is unable to determine the installation process or if they were installed to prevent water penetration at the time of inspection. Continue to monitor areas around the panels and the sheathing in the attic area for signs of possible water penetration. Ask the seller for documentation and disclosure for any transferable warranty information. Due to the height of the home, the gutters could not be viewed from the top. Underground drainage from gutters or a drainage system is not inspected at the time of inspection, as this is beyond the scope of a normal home inspection.

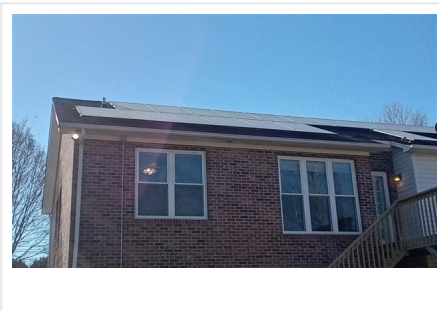

 6. ATTIC INTERIOR SYSTEM

 DESCRIPTION

ATTIC INFORMATION

In accordance with our standards, attics that have less than thirty-six inches of headroom are not inspected, area restricted by ducts are not inspected, or in which the insulation obscures the joists and thereby makes mobility hazardous are not inspected, in which case the attic is inspected to the best of the inspectors ability from the access point. In regard to evaluating the type of insulation in the attic and on the attic floor, we do not sample or test the material for specific identification. Also, insulation is not disturbed or moved which may well obscure water pipes, electrical conduits, junction boxes, exhaust fans, and/or other components.

Due to pitch and/or height of the outer edges and corners cannot be viewed within the attic areas, These areas could not be fully viewed or inspected at the time of inspection and no claims could be made to the conditions and/or structure of these areas. The insulation in the attic obstructs viewing of the ceiling below while covering the framing and any electrical components throughout the attic area. Due to the insulation NOT being moved as this would disrupt the insulation from its original state, the conditions of the framing, ceiling below, electrical components, and any other areas or items that are covered or blocked by the insulation could not be viewed and no claims could be made as to the structure or conditions of the covered areas.

 TYPES & DESCRIPTIONS: ATTIC INTERIOR SYSTEM

Framing and Component Types: A truss system is installed in the attic cavity that is used to support the roof decking and transmit the roof load to the exterior walls. OSB Roof Sheathing OSB Wall Sheathing	Unfinished Area Insulation Type(s): Blown Fiberglass Fiberglass Batts or Rolled Batts	Attic Location(s): Main Attic above the majority or entire home.
---	--	--

 ITEMS: ATTIC INTERIOR SYSTEM

6.0 ATTIC VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

(1) A ridge vent has been installed on the home with gable vents installed. When ridge vents are installed with gable vents air will pull in and directly up then out through the ridge vent but not through the attic area. **The presences of both systems are counterproductive and are preventing proper ventilation of the attic area.** This may result in poor and/or improper ventilation throughout the attic area, which can lead to high moisture/ wood rot.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(2) Moisture staining/damage was noted along the bottom of the roof sheathing/decking and/or on the attic framing in the left area of the attic. Unable to determine if an active leak exist at the time of inspection as the stain(s) were either dry relative to unaffected areas or were not safely accessible for testing with a moisture meter at the time of inspection. Water penetration in the building can result in damage and/or undesirable environmental conditions. Have a qualified licensed general contractor further evaluate and make any additional repairs as needed or deemed necessary.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



6.1 ATTIC LIMITATIONS

☐ FURTHER EVALUATION IS NEEDED.

The attic was observed from hatch areas only. Access is restricted by low headroom and/or no floored area. The structure condition could not be fully viewed and the conditions are unknown. Ask the seller for full disclosure as to any repairs or defects that may have occurred in the past and if corrections have been made to correct them.



 7. PLUMBING SYSTEM

 DESCRIPTION

PLUMBING INFORMATION

Water quality or hazardous materials testing is available however is not included with this inspection unless added as an additional service. Underground piping related to water supply, waste, sprinkler, as well as drainage systems is excluded from this inspection. The presence of mineral build-up that may gradually restrict their inner diameter and reduce water volume cannot be inspected.

The water main shut off valve, and shut off valves under sinks and behind toilets is not tested. By turning the valves it may cause them to leak causing damage to the property. Because of this, shut off valves are not turned, tested, or operated.

The inspection does not assure that the plumbing systems of the home will meet the demands of a family when in use.

 TYPES & DESCRIPTIONS: PLUMBING SYSTEM

Visible Plumbing Materials: PEX PVC Copper Piping Steel Braided	Plumbing Vent Pipe Material Type(s): PVC	Water Heater Power Source: Electric
Water Heater Capacity: 50 Gallons	Water Temperature: 108 Degrees 111 Degrees 113 Degrees 121 Degrees	Water Heater Location: Basement
Main Water Shut Off Location: The basement		

 ITEMS: PLUMBING SYSTEM

7.0 PLUMBING CONDITIONS/VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

(1) There are not any anti-backflow preventer valves installed at the front exterior hose faucet. Backflow preventer valves are required to prevent cross-contamination between water supply sources. Consult with a qualified licensed contractor to fully understand the extent of the repairs needed and determine if corrective actions are required.




front



rear

(2) There is no shut off valve at the gas line on the rear exterior. Shut off valve is needed in case there is a possible emergency and the gas line needs turned off. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

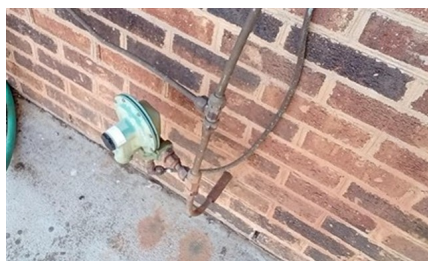


7.1 WATER HEATER CONDITIONS/VISUAL FINDINGS

☐ FURTHER EVALUATION IS NEEDED.

Water heater is located at an interior area and is not provided with an emergency overflow pan. These pans, with their drain lines, act to prevent damage to carpeting and furnishings, should the unit begin leaking. Oftentimes, installations more than a few years of age are not equipped with such pans. They are a good idea however, and should be installed at the time of water heater replacement, provided an exterior wall through which the drain line can flow by gravity is located conveniently nearby.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

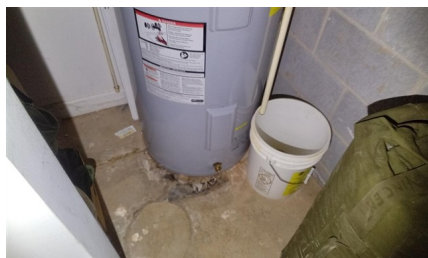

7.2 WATER TEMPERATURE INFORMATION

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

(1) The water temperature was found to range between 110 and 119 degrees. To ensure optimal performance, adjust the temperature to 120 degrees. [Click here](#) to discover how to set your water heater to a safe and efficient temperature level.



basement



kitchen



primary bathroom



hallway bathroom

(2) The water temperature was found to range between 110 and 119 degrees. To ensure optimal performance, adjust the temperature to 120 degrees. [Click here](#) to discover how to set your water heater to a safe and efficient temperature level.

7.3 PLUMBING RECOMMENDATIONS/INFORMATION

8. LAUNDRY AREA

DESCRIPTION

LAUNDRY INFORMATION

Washer and dryers are not tested at the time of inspection as this is beyond the scope of a home inspection. The 220v electric dryer hookup, if so equipped is not tested during a normal home inspection. If washer and dryers are installed in the laundry room viewing of the wall and/or inspect the washer and dryer hookups cannot be completed due to the washer and dryer blocking the wall and hookups. No claims can be made regarding the condition of the wall and hookups.

ITEMS: LAUNDRY AREA


8.0 LAUNDRY AREA VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

8.1 LAUNDRY AREA LIMITATIONS

 FURTHER EVALUATION IS NEEDED.

Unable to view the walls, flooring, and piping at the time of inspection due to the washing machine and/or dryer being installed obstructing viewing of these areas. No claims can be made to the condition of these areas at the time of inspection.

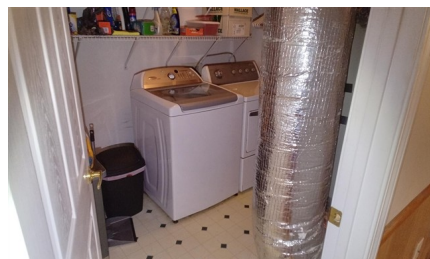

🏠 9. ELECTRICAL SYSTEM

📋 DESCRIPTION

ELECTRICAL INFORMATION

Load-calculations are not performed to determine if the supply meets the demand. Any electrical repairs or upgrades should be made by a licensed electrical contractor. Aluminum wiring requires periodic inspection and maintenance by a licensed electrical contractor. Smoke Alarms should be installed within 15 feet of all bedroom doors and tested regularly.

✂️ TYPES & DESCRIPTIONS: ELECTRICAL SYSTEM


Panel Location(s): Garage	Main Power Panel Size: 200 amp service	Service Entry Conductor Type: Aluminum
Service Voltage: The incoming electrical service to the structure is 120/240 volts, with circuit breakers.	Branching Circuit Wiring Type: Copper Single strand aluminum wire is present on 120 volt branch circuits in the house.	Service Type: Underground

👁️ ITEMS: ELECTRICAL SYSTEM

9.0 ELECTRICAL VISUAL FINDINGS

📋 FURTHER EVALUATION IS NEEDED.

(1) Outlets where found in and/or throughout the home to have broken and/or damaged outlets. The outlet(s) are cracked and need replacement to prevent a loose or improper connection. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

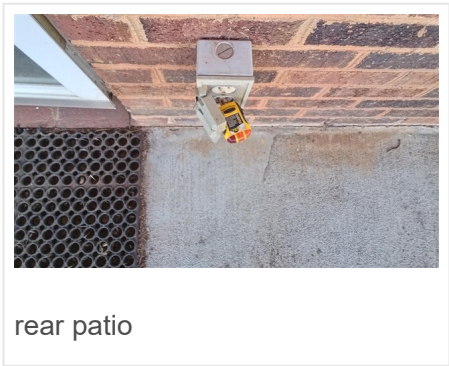

(2) Loose outlets were noted throughout the home. Loose outlets can result in loose electrical connections which can increase the potential for a safety hazard and/or equipment failure. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



primary bathroom

(3) There are missing screws at the electrical panel that need replacement to properly secure the electrical panel cover to the panel prevent access to the interior of the panel.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(4) There are pointed or tipped screws (wood screws) installed to secure the exterior cover of the electrical panel. Pointed or tipped screws may puncture the wiring installed in the panel and need to be replaced to flat/ blunt tipped screws.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(5) The electrical system of this home has single strand aluminum wiring present on the lighting and receptacle branch circuits. As a result of documented fire hazards, the use of single strand aluminum wiring for lighting and receptacle branch circuits was discontinued in 1974 until material improvement could be made. Due to the concealed nature of the electrical components, the general condition of the system could not be determined during the home inspection. A licensed electrical contractor should be consulted for a complete evaluation of the electrical system to determine if repair, modification, or replacement is needed to ensure safe and reliable

service. For more information on aluminum household wiring and recommended repair methods, refer to the C.P.S.C. booklet "Repairing Aluminum Wiring." The toll-free hotline number for obtaining this booklet is 1-800-638-2772, or you can visit: <https://www.cpsc.gov/s3fs-public/516.pdf>



(6) There are GFCI's installed down stream of a main GFCI located in the primary bathroom. If the GFCI downstream trips the lead GFCI must be reset before the GFCI downstream can be reset. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



9.1 ELECTRICAL LIMITATIONS

FURTHER EVALUATION IS NEEDED.

The Arc fault breakers were **not** tested at the time of inspection due to the home being occupied. When testing the arc fault the breaker trips causing loss of power. Due to the home being occupied they are not tested as there may be appliances such as computers and clocks plugged into the outlets that are protected by the arc fault breakers. To test the breakers simply press the yellow, white, green, and or blue button at the front of the breaker to ensure that the breaker trips and then reset.

There are stored items throughout the home that prevent access and testing at some outlets and switches. Because of this not all outlets and switches could be tested at the time of inspection. The conditions of the outlets that were not tested are unknown at the time of inspection, no claims could be made as to whether they function properly.

10. HVAC SYSTEM(S) INFORMATION

DESCRIPTION

HVAC System(s) Information and Limitations

The interior AC coil(s) are not inspected as they could not be viewed at the time of inspection due to being taped sealed/closed. The fan units operated when testing (if temperature permits), but the interior was not visually observed. No claims could be made to the condition of the interior of the unit as this would require a complete invasive inspection of the unit, which is beyond the scope of a home inspection.

During this inspection, it is impossible to determine the condition of the interior of the flue/vents. The interior of the flue/vents may be deteriorated, but during a visual inspection, the interior walls were not inspected as this would require disassembly.

The interior heat unit portion of the heating system(s) is difficult to view or access without disassembly, and cannot be adequately checked during a visual inspection as disassembly is required. It is recommended that the unit is serviced yearly to ensure the unit operates and functions efficiently.

The home inspector does not determine the age of the HVAC unit. If the unit(s) are older than 10 years or if the age or the age is unknown, it is highly recommended that the unit(s) have a complete invasive inspection of the entire unit by a licensed HVAC contractor. Ask the seller for disclosure on any previously required services and/or repairs that have been previously made to the unit and routine servicing. If the home is vacant or in foreclosure, a complete invasive inspection of the entire unit by a licensed HVAC contractor is strongly recommended before the closing of escrow on the home.

TYPES & DESCRIPTIONS: HVAC SYSTEM(S) INFORMATION

Air Conditioning Type(s): Central Split System(s)	Power Source: Electric 220 Volt	Heating Type(s): Heat Pump Unit(s)
Fuel/Power Source(s): Electric	Ducts/Air Supply Types: Fiberglass Duct Board: Flexible round duct work	Access Panel(s) Removed during visual inspection?: No

ITEMS: HVAC SYSTEM(S) INFORMATION

10.0 AIR TEMP DROP DIFFERENTIAL

THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

heating unit differential - The heating unit is producing an adequate air temperature drop. The temperature differentials when tested should be between 14 and 24 degrees. The differentials at the time of inspection were at sufficient drop in degrees.



upstairs



upstairs



basement



basement

During this inspection, it is impossible to determine the condition of the interior of the ductwork or vent systems. The interior of the ductwork or vent systems may be deteriorated, but during a visual inspection, the interior walls were not inspected as this would require disassembly. Please also Note: During the home inspection the home is not inspected for mold, mildew, or other organic growth. We are not mold inspectors and are not certified in identifying types of mold within the home.

Some types of organic growth are common and/or natural to see within the home, however, dirty ductwork and high moisture levels around the duct work this may indicate, but does not guarantee, an organic growth problem. Many factors are needed to have excessive growth within or under a home and/or within duct systems. If mold, mildew, or other organic growth is a concern have a licensed or certified fungus specialist further evaluate to determine if the type of fungus within the ductwork is dangerous and determine if removal is needed.

11. COOLING SYSTEM(S)

DESCRIPTION

HVAC INFORMATION

Even modern heating systems can produce carbon monoxide, which in a poorly ventilated room can result in sickness and even death. Therefore, it is essential that any recommendations made for service or further evaluation be scheduled before the close of escrow, as a licensed specialist may reveal additional defects or recommend further upgrades that could affect your evaluation of the property, as our service does not include any form or warranty or guarantee.

On January 1, 2010, the Environmental Protection Agency (EPA) implemented a ban on the production and import of R22, except for continuing servicing needs of existing equipment. On January 1, 2020, R22 becomes illegal to purchase. As a result, repairing older R22 systems will become very expensive when the repair requires adding refrigerant to the system. If repair is needed, you may want to consider a replacement if the current AC unit was built before 2010. For more information please [click here](#).

ITEMS: COOLING SYSTEM(S)

11.0 AIR CONDITIONER VISUAL FINDINGS

11.1 DUCT VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

There is dust and/or dirt noted inside the duct system viewed from the air filter location. This may be an indication that the ducts are in need of cleaning to ensure efficiency of the unit(s).

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



11.2 HVAC LIMITATIONS

 FURTHER EVALUATION IS NEEDED.

Unable to operate the exterior AC unit equipment or systems due to low exterior temperatures. Winter inspections only include a visual inspection of the air condition system(s). The AC units job is to cool the home when temperatures are below 60 degrees; the home is already cooled and the unit will not cool properly or give a false reading. If the exterior temperature is below 60 degrees Fahrenheit or when other circumstances are not conducive to safe operation, this may damage the equipment. With exterior temperatures below 60 degrees, the unit(s) cannot be inspected and no other part of that unit(s)/component(s) can be inspected for efficiency, operation, and/or functionality of the unit(s)/component(s). All unit(s)/component(s) require the proper source(s) to determine the efficiency, operation, and/or functionality of the unit(s)/component(s). The home inspector can

not determine if an AC system will function as intended during the winter inspection and the operation of the system could result in component damage. At the time of the inspection, the home inspector develops no conclusions concerning whether or not the system will function or adequately cool the home during the summer season.

12. HEATING SYSTEM

DESCRIPTION

HVAC INFORMATION

Even modern heating systems can produce carbon monoxide, which in a poorly ventilated room can result in sickness and even death. Therefore, it is essential that any recommendations made for service or further evaluation be scheduled before the close of escrow, as a licensed specialist may reveal additional defects or recommend further upgrades that could affect your evaluation of the property, as our service does not include any form or warranty or guarantee.

On January 1, 2010, the Environmental Protection Agency (EPA) implemented a ban on the production and import of R22, except for continuing servicing needs of existing equipment. On January 1, 2020, R22 becomes illegal to purchase. As a result, repairing older R22 systems will become very expensive when the repair requires adding refrigerant to the system. If repair is needed, you may want to consider a replacement if the current AC unit was built before 2010. For more information please [click here](#).

ITEMS: HEATING SYSTEM

12.0 HEATING COMPONENT VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

12.1 HEATING UNIT(S) LIMITATIONS

 FURTHER EVALUATION IS NEEDED.

The panel was not removed due to risk of damaging the freon line. No statement can be made about the inside conditions of the heat pump unit in the basement.



13. INTERIOR COMPONENTS

DESCRIPTION

INTERIOR INFORMATION

The inspection of living space includes the visually accessible areas of walls, floors, cabinets and closets, and the testing of a representative number of windows and doors, switches and outlets. We do not evaluate window treatments, move furnishings or possessions, lift carpets or rugs, empty closets or cabinets, nor comment on cosmetic deficiencies. We may not comment on cracks that appear around windows and doors, along lines of framing members or along seams of drywall and plasterboard, as these may be caused by minor movement, such as wood shrinkage, common settling, and seismic activity, and will often reappear if they are not correctly repaired. Such cracks can become the subject of disputes, and are therefore best evaluated by a specialist.

It is recommended that smoke/carbon monoxide detector(s) be replaced after moving in the home and every five years; homes that do not have carbon monoxide detectors already installed should have one installed on every floor for safety.

All items that are freshly painted including, but not limited to walls and ceilings cannot be fully or completely viewed to determine if water damage exists. Have the seller disclose any recent repairs or painting to determine if any damage has been hidden or concealed before the close of escrow on the home.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

TYPES & DESCRIPTIONS: INTERIOR COMPONENTS

Combination Smoke/Carbon Monoxide Detector(s): Battery Operated	Interior Column Type(s): Drywall Column(s) Please note: Unable to determine if the column is load bearing at the time of inspection.	Fireplace Location(s): Living Room
Fireplace Type(s): Prefabricated Insert with Vent Free Propane Gas Logs	Wall Structure Type(s): Not Accessible	Ceiling Structure Type(s): Not Accessible
Flooring Structure Type(s): Not Accessible		

ITEMS: INTERIOR COMPONENTS

13.0 INTERIOR COMPONENT CONDITIONS/VISUAL FINDINGS


FURTHER EVALUATION IS NEEDED.

(1) This home is equipped with multiple dead bolts that can only be opened from the interior with a key when locked. These types of dead bolts restrict easy access to the exterior of the home in the event of an emergency. It is recommended to replace the dead bolts with the type that can be easily opened from the interior of the home.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front door

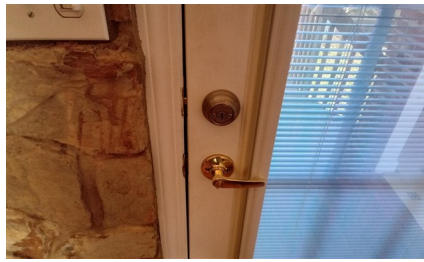


rear deck

(2) Moisture staining/damage was noted on the ceiling in the basement. Unable to determine if an active leak exists at the time of inspection as the stains were dry relative to unaffected areas at the time of inspection. Moisture penetration/leakage into or within a home can result in moisture damage to the structure and adverse environmental conditions. Unable to determine if there is hidden or concealed damage that was not visible at the time of inspection. Ask the seller the history of the stains and if repairs have been made to correct any leaks that may have caused the stain. If the sellers are unaware of the stain or no repairs have been made then it should be treated as an active issue and further evaluation is needed by a licensed general contractor. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




(3) The Drive-In Ball Catch w/ Strike Plate are missing at the top of the following doors: front bedroom door(s) Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

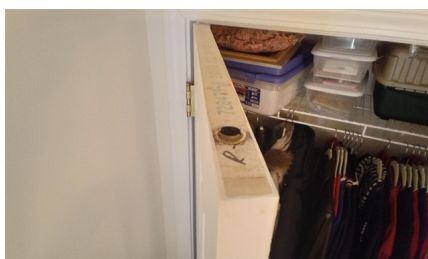

(4) The following door(s) listed below rubbed at the frame/flooring and need adjustment and/or repair for the door(s) to open and close properly without rubbing: bathroom door(s), primary bedroom
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



primary bathroom

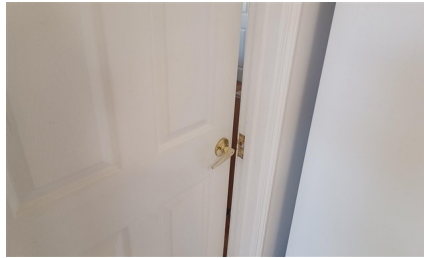

primary bedroom

(5) There were cracked floor tile(s) noted in the following location(s): basement steps. Corrections are needed in order to prevent possible further damage.
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(6) The front door did not latch closed at the time of inspection. Corrections are needed so the door can function as intended. Have a qualified licensed contractor further evaluate and make the necessary repairs.
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



13.1 FIREPLACE/FIREBOX/GAS LOG CONDITIONS/VISUAL FINDINGS

☑ COMPONENT/ITEM WAS NOT INSPECTED DUE TO LIMITATION

13.2 WINDOW VISUAL FINDINGS

☐ FURTHER EVALUATION IS NEEDED.

There is wood rot and/or water damage noted (but not limited to) the windows framing/casing around the windows at the following location(s) listed below. Repair and/or replacement is needed at the window or window framing to ensure that there is not any hidden or concealed damage that was otherwise unseen at the time of inspection.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



left rear bedroom

13.3 INTERIOR COMPONENT RECOMMENDATIONS

 FURTHER EVALUATION IS NEEDED.


Smoke detector(s) were located, and the test button on the Smoke detector(s) or combination with carbon monoxide detector(s) was pressed and responded. Please understand that the smoke or carbon monoxide simulation cannot be performed or tested during the inspection. To ensure safety, all smoke detector(s) and carbon monoxide detectors should be replaced after closing on the house and replaced as often per the manufacturer's recommendations.



13.4 WINDOWS ADDITIONAL LIMITATIONS

 FURTHER EVALUATION IS NEEDED.

Unable to test or fully view the following rooms windows due to stored items, window treatments blocking the windows preventing access or operation at the time of inspection: master bedroom, front window.

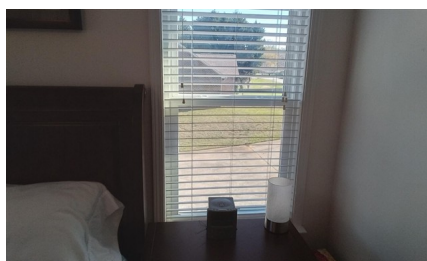

front

13.5 FIREPLACE ADDITIONAL LIMITATIONS

 FURTHER EVALUATION IS NEEDED.

The pilot light was not lit at the time of inspection. Note: Pilot lights must be lit at the time of inspection to ensure safety. When pilots are off and/or the fireplace has not been used for sometime, it may take a long time to light the unit. The units may not light at all due to the lines needing to be bled. Because of the time constraints of a home inspection, pilot lights cannot be lit. Please Note: Unable to determine if the unit functions and/or functions properly at the time of inspection due to the pilot not being lit.



13.6 INTERIOR LIMITATIONS

 FURTHER EVALUATION IS NEEDED.

Stored items and furniture prevent a full viewing of wall surfaces and floor surfaces. The inspection report applies to viewable surfaces only.

Stored items and/or rugs prevented a full viewing of the floored areas.

Stored items in closets prevented a full view of wall and floor conditions in those areas; the conditions in these areas are unknown and may expose damage after items are removed.

When one window is found to have a broken thermal seal, others may be in need of repair or replacement that are not listed below or within the report. Because of this, It is recommended that all windows be cleaned and further evaluated by the qualified licensed contractor or certified professional to determine if any additional windows are in need of replacement before the close of escrow. Any additional windows that are found to have a broken or bad thermal seal should also be repaired and/or replaced at that time by the qualified licensed contractor or certified professional that was recommended to further evaluate. The window at this point has lost its argon gas thus reduces the original R-Value of the window. All windows are located as if looking from the inside out toward the road or yard. -Overcast days, dirty windows, and/or rain can obstruct the view of the window or make it difficult to identify a bad thermal seal. The thermal window seal is the gasket that prevents fogging and moisture from entering in between the interior of the window panes.

14. BATHROOMS

DESCRIPTION

BATHROOM INFORMATION

Tub and bathroom sink overflows are not tested at the time of inspection. Inspectors are unable to determine if the overflow is connected properly in the wall at the time of inspection. If the overflow line is not connected properly testing them can cause damage to the property. Also, the shutoff valves under sinks are not tested. By turning the valves it may cause them to leak causing damage to the property. Because of this shutoff valves are not turned, tested, or operated.

TYPES & DESCRIPTIONS: BATHROOMS

Ventilation Types:

Electric power exhaust vent is installed in all bathrooms

ITEMS: BATHROOMS

14.0 PRIMARY BATHROOM VISUAL FINDINGS

FURTHER EVALUATION IS NEEDED.

(1) The shower door leaks at the seal on the bottom. Corrections are needed in order to prevent possible further leaking or damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




(2) There is a leak at the faucet or faucet handle that needs repairs or replacement to prevent possible further leaking.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(3) Caulk is needed to fill the gaps where the sink countertop and backsplash meet to prevent water penetration.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

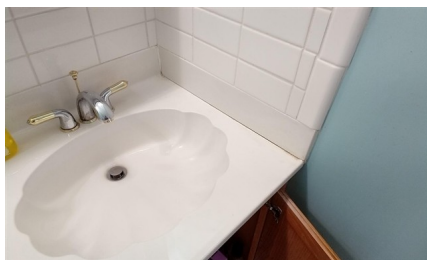

(4) The primary bathroom tub does not achieve functional drainage. This means that the tub will fill with water faster than it can drain water even when the stopper is not engaged.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




14.1 HALL BATHROOM VISUAL FINDINGS

📋 FURTHER EVALUATION IS NEEDED.

Caulk/grout is needed to seal the gaps where the upstairs hall bathroom tub and shower wall meet to prevent water penetration.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

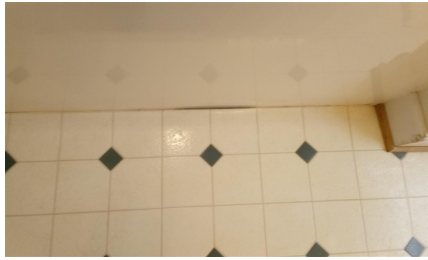

14.2 BASEMENT BATHROOM VISUAL FINDINGS

📋 FURTHER EVALUATION IS NEEDED.

The tank is loose where it attaches to the base of the toilet and needs to be properly secured to prevent leakage.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



 15. KITCHEN-APPLIANCES

 DESCRIPTION

KITCHEN INFORMATION

The kitchen appliances are tested for basic functionality and cannot be evaluated for their performance nor for the variety of their settings or cycles. Appliances older than ten years may exhibit decreased efficiency. Even if general comments are made, these items are not inspected: free-standing appliances, refrigerators, freezers, ice makers, trash-compactors, built-in toasters, coffee-makers, can-openers, blenders, non-built in or non-secured microwave(s), instant hot water dispensers, water-purifiers, barbecues, grills, or rotisseries, timers, clocks, thermostats, the self-cleaning and cooking capability of ovens, and concealed or countertop lighting, which is convenient but often installed after the initial construction and not wired to national electrical standards. These items are considered outside the scope of the inspection. Appliances are not moved during the inspection as they may cause damage. Portable dishwashers are not inspected, as they require a connection to facilitate testing.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

 TYPES & DESCRIPTIONS: KITCHEN-APPLIANCES

Kitchen Sink: Tested	Dishwasher: Dishwasher - Operated	Cooktop: Electric - Operated
Microwave: Operated	Oven: Electric Wall Oven	Garbage Disposal: Operated


 ITEMS: KITCHEN-APPLIANCES

15.0 KITCHEN COMPONENTS VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

Sealant/Caulk is needed to prevent water penetration and seal the gap(s) where the countertop meets the backsplash around the entire kitchen.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

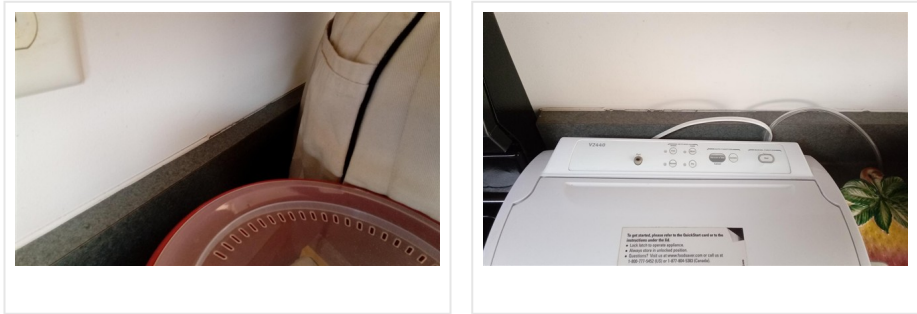

15.1 KITCHEN APPLIANCE VISUAL FINDINGS

✓ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

15.2 KITCHEN INFORMATION

- (1) The sink was tested for leaks at the time of the inspection.
 - (2) The dishwasher underwent testing and ran through a full normal cycle during the inspection. Other cycles were not tested due to time constraints.
 - (3) The cooktop was test by operating the burners during the inspection. However, the efficiency of the burners could not be determined at that time.
 - (4) The microwave was tested and responded during the inspection.
 - (5) During the inspection, the oven underwent testing by operating the broiler (if available), bake element, and convection (if available). However, the self-cleaning function and other specialized modes are not tested.
 - (6) The garbage disposal was tested by using the switch near the sink and running water through it. The inspection did not determine the disposal's efficiency.
-

 16. BASEMENT

 DESCRIPTION

BASEMENT INFORMATION

While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. During the course of the inspection, the inspector does not enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely affect the health of the inspector or other persons. The under the floor insulation, between the floor joists, restricts viewing of the subfloor area and a percentage of the floor joists that are not removed during the inspection. If high moisture levels were noted to be above 20% during the inspection, this may indicate but does not guarantee an organic growth problem. Many factors are needed to have excessive growth within or under a home and/or within duct systems. If mold, mildew, or other organic growth is a concern please contact us to perform a mold test or mold inspection to help determine if removal or remediation is needed.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

Please review the entire report and/or refer to the signed agreement/contract for any items that are outside the scope of the inspection performed.

 TYPES & DESCRIPTIONS: BASEMENT

Access:	Method Used to Inspect Basement:	Walls:
Beam Types:	Posts & Piers Type(s):	Floor Type:
Sump Pump Installed Location:		

 ITEMS: BASEMENT

16.0 BASEMENT VISUAL FINDINGS

16.1 RECOMMENDATIONS

While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. During the course of the inspection, the inspector does not enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely affect the health of the inspector or other persons.

The under the floor insulation, between the floor joists, restricts viewing of the subfloor area and a percentage of the floor joists that are not removed during the inspection.

Daniel Bare

Thank you for trusting HIC to perform your inspection at 2339 Perry Rd.
Denver NC 28037

If you have any questions regarding this report, please do not hesitate to contact us and set up a time to review your report. Our inspectors are always willing to help answer any questions to ensure you completely understand the information provided in your report. Contact your inspector directly or our office at [704-542-6575](tel:704-542-6575) with any questions.

Sincerely,
Mike Sweeting
(704)651-8190
MikeS@hicarolina.com
NC #5106



Office - [704-542-6575](tel:704-542-6575)
info@hicarolina.com
www.homeinspectioncarolina.com



Home Inspection Summary

Exclusively for Daniel Bare

Please see main body of the report for any additional pictures and information

THIS REPORT IS INTENDED TO BE VIEWED IN COLOR.

Inspection Address

2339 Perry Rd.
Denver NC 28037



Inspector Contact

Mike Sweeting
(704)651-8190
MikeS@hicarolina.com
NC #5106

Thank you for choosing Home Inspection Carolina (HIC). At your request, a visual inspection of the above-referenced property was conducted on 3/26/2025. An earnest effort was made on your behalf to discover all visible defects; however, in the event of an oversight, maximum liability must be limited to the total inspection fee paid. It is strongly recommended that you promptly read the complete and entire report. The summary and main report are not limited to additional negotiable items identified outside this inspection. For more information on negotiable items identified outside this inspection, please contact your Real Estate Agent or attorney.

This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney. For South Carolina, contact your South Carolina real estate agent or an attorney.

Home Inspection Definitions

Home Inspection: A home inspection is a limited, non-invasive visual examination of the condition of a home. To visually inspect essential components of a residential dwelling designed to identify MATERIAL DEFECTS.

Direction: Our State requirements require us to direct our clients to consult with qualified licensed contractors for further evaluation of all defects identified within our report. It is essential that you thoroughly understand the extent of any problem before the close of escrow on the home.

Ancillary Services: Ancillary services, such as Mold Sampling, Radon Tests, etc., are not part of this home inspection and do not fall under state Standard of Practice guidelines. For your convenience, other services may be listed within this report; however, they are to be viewed as independent services and individually. For more information on additional ancillary services we provide, please get in touch with our office or visit our website at <https://www.homeinspectioncarolina.com/services/>

Material Defects: A material defect is a specific issue with a system or component of a residential property that may have a significant, adverse impact on the property's value or pose an unreasonable risk to people.

The following report reflects the visual conditions of the property at the time of the inspection only. The summary and main report are a list of items found to be defective, needing repair, or further evaluation. Please understand there may be hidden or concealed damage that could not be viewed, seen, or present at the time of inspection. For your protection, we strongly recommend consulting with a qualified licensed contractor to evaluate further all defects noted within this report. Hidden or concealed defects are not inspected and are not included in this report. **No warranty is either expressed or implied in the home inspection report. This report is not an insurance policy nor a warranty service.**

*The point of reference for this report is from the street looking at the front of the house. (The front, right crawl space would be the front, right corner of the home, not the front right corner from the crawl space access door unless otherwise stated).

1. DECK(S)/PATIO(S)/PORCHES

General Summary

DECK/PATIO/PORCH VISUAL FINDINGS


1. (1) The stair stringers are not secured by any ledger or joist hanger. A ledger or joist hanger gives the joist additional support, also preventing it from twisting or moving. A ledger or joist hanger needs to be installed to provide proper support and stability.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



2. (2) There are loose railing(s) that need to be secured properly to prevent continual movement and/or a possible hazard at the rear deck.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

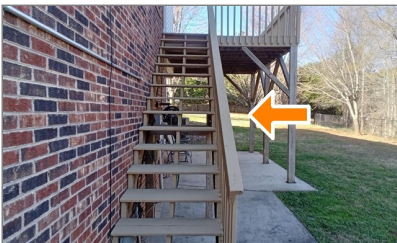

3. (3) There are loose and cupping/bowing boards noted throughout the stair surface. The boards need to be secured properly and the cupping or bowing boards may need to be replaced to prevent a tripping hazard and/or continual movement or cupping.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




stairs


4. (4) There are nails protruding from the stairs resulting or can result in the boards to become loose as well as creating a possible trip hazard proper corrections and repairs are needed at the rear deck steps.
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



5. (5) There are cracked and/or warped spindles found on or around the deck railing. Proper corrections, repairs, and/or replacement are needed for the spindles to allow for proper protection.
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

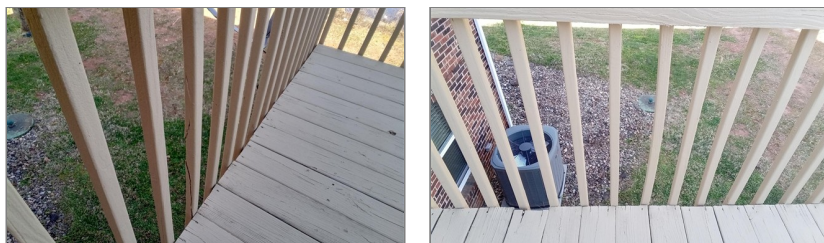

6. (6) The rear deck is not flashed or no signs of flashing were present at the time of inspection. Flashing is needed to prevent water penetration and wood rot between the deck and siding where it attaches.
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

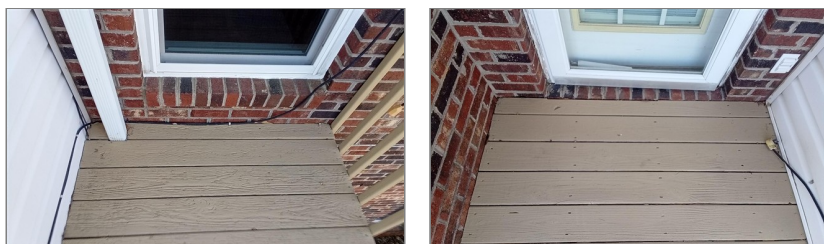

2. EXTERIOR/TRIM/FOUNDATION

General Summary

EXTERIOR VISUAL FINDINGS

7. (1) The exterior light fixtures lack proper sealing at the points where they meet the outer walls on the home, potentially leading to moisture intrusion. It is important to address this issue to prevent potential damage to the structure over time if left unaddressed. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front



front



rear

8. (2) The flap, which is meant to cover the exhaust vent on the left side of the home, is currently missing or damaged. This issue poses a risk of potential rodent and insect intrusion. To safeguard against such unwanted guests, it is important to address this by either repairing or replacing the flap. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



TRIM VISUAL FINDINGS


9. (1) Spacing and/or gapping was noted at the sidewalk and stone veneer where it meets the brick veneer. Properly sealing these areas is needed to prevent water penetration where the trim meets the brick veneer at the trim around the home. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front




front

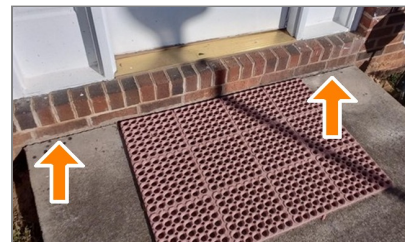

10. (2) Wood rot has been observed at the trim where it intersects the threshold of the exterior doors. A more thorough assessment is required to ascertain the extent of repair or replacement necessary.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

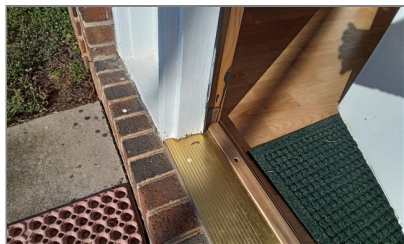

front door



rear basement door

11. (3) Sealant deficiencies, such as missing or poorly sealed areas, were observed on the exterior siding and trim in various sections around the home, including window and door frames. Corrections are required to prevent potential water seepage or insect infestation.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front window/door



garage



garage



rear deck door

4. GARAGE-CARPORT

General Summary

GARAGE VISUAL FINDINGS

12. There is a dent in the garage door that could prevent the door from opening/closing properly requiring proper corrections and/or repairs/replacement.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



GARAGE LIMITATIONS

13. (1) The reverse tension on garage doors that have garage door opener(s) installed were not tested at the time of inspection. Testing the reverse tension on the garage door opener may result in damage to the door and/or unit if the settings are not properly set. Without being able to determine if the settings are correct before testing the garage door opener, the opener could not be tested. To ensure that the garage door reverse tension is set properly, ask the seller for any disclosure to any repairs or adjustments that have been made to the unit, any paperwork provided from any service, builder, and/or installation company. The reversing tension needs to be properly set to prevent possible damage to property, the garage door, and/or the garage door opener.

5. ROOF SYSTEMS

General Summary

ROOF VISUAL FINDING(S)

14. (1) Multiple nail pops or otherwise lifted shingles were noted in multiple locations throughout the roof surface. This can result in damaged shingles and moisture penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



15. (2) The ridge vent along the top of the roof is loose and needs to be secured properly to prevent possible water penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



16. (3) There are lifting, cupping, or bowing shingles noted in the valleys that need repair or corrections to prevent possible wind damage and or water penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front left



front left

GUTTER VISUAL FINDING(S)

17. (1) The gutters drain into a corrugated piping drain and are missing the coupling that connects the gutter and corrugated piping together. This is needed to prevent debris from entering the corrugated piping and clogging it. Underground drainage from gutters or a drainage system is not inspected at the time of inspection. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



front



front


18. (2) A splash block is needed to properly direct water away from the foundation of the home under all gutter down spouts around the home. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



rear

19. (3) The gutters are bent, loose, and/or damaged around the home. They are in need of repairs and/or replacement to properly direct water away from the home and foundation.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

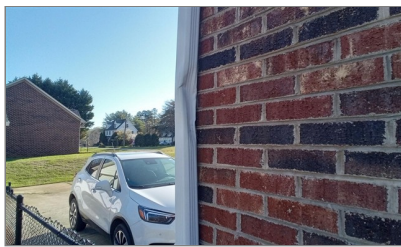

rear right

FASCIA/SOFFITS/EAVE VISUAL FINDING(S)

20. (1) There are loose piece(s) of fascia that need to be re-installed and/or secured properly to prevent water penetration and/or possible damage at the front of the home.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.





21. (2) There is damaged and/or rotted soffit that needs repaired and/or replaced. The source of the water that caused or is causing the damage needs to be located and corrected to prevent continual rot at the right of the home.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



ROOF LIMITATIONS/RESTRICTIONS

22. Solar panels were found to be installed on the roof of the home. Solar panels are not inspected or tested during the home inspection, as this is outside the standards of practice. During the inspection, it is unable to determine the installation process or if they were installed to prevent water penetration at the time of inspection. Continue to monitor areas around the panels and the sheathing in the attic area for signs of possible water penetration. Ask the seller for documentation and disclosure for any transferable warranty information. Due to the height of the home, the gutters could not be viewed from the top. Underground drainage from gutters or a drainage system is not inspected at the time of inspection, as this is beyond the scope of a normal home inspection.

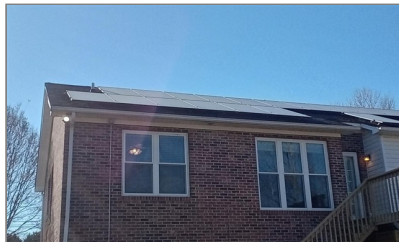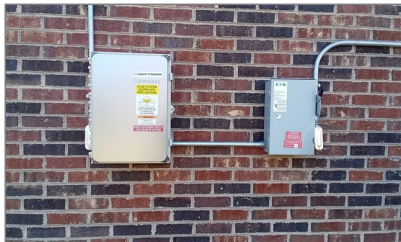

6. ATTIC INTERIOR SYSTEM

General Summary

ATTIC VISUAL FINDINGS

23. (1) A ridge vent has been installed on the home with gable vents installed. When ridge vents are installed with gable vents air will pull in and directly up then out through the ridge vent but not through the attic area. **The presences of both systems are counterproductive and are preventing proper ventilation of the attic area.** This may result in poor and/or improper ventilation throughout the attic area, which can lead to high moisture/wood rot.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



24. (2) Moisture staining/damage was noted along the bottom of the roof sheathing/decking and/or on the attic framing in the left area of the attic. Unable to determine if an active leak exist at the time of inspection as the stain(s) were either dry relative to unaffected areas or were not safely accessible for testing with a moisture meter at the time of inspection. Water penetration in the building can result in damage and/or undesirable environmental conditions. Have a qualified licensed general contractor further evaluate and make any additional repairs as needed or deemed necessary.
- Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



ATTIC LIMITATIONS

25. The attic was observed from hatch areas only. Access is restricted by low headroom and/or no floored area. The structure condition could not be fully viewed and the conditions are unknown. Ask the seller for full disclosure as to any repairs or defects that may have occurred in the past and if corrections have been made to correct them.



7. PLUMBING SYSTEM

General Summary

PLUMBING CONDITIONS/VISUAL FINDINGS

26. (1) There are not any anti-backflow preventer valves installed at the front exterior hose faucet. Backflow preventer valves are required to prevent cross-contamination between water supply sources. Consult with a qualified licensed contractor to fully understand the extent of the repairs needed and determine if corrective actions are required.




front




rear

27. (2) There is no shut off valve at the gas line on the rear exterior. Shut off valve is needed in case there is a possible emergency and the gas line needs turned off. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

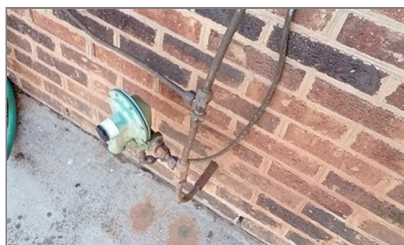

WATER HEATER CONDITIONS/VISUAL FINDINGS

28. Water heater is located at an interior area and is not provided with an emergency overflow pan. These pans, with their drain lines, act to prevent damage to carpeting and furnishings, should the unit begin leaking. Oftentimes, installations more than a few years of age are not equipped with such pans. They are a good idea however, and should be installed at the time of water heater replacement, provided an exterior wall through which the drain line can flow by gravity is located conveniently nearby. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

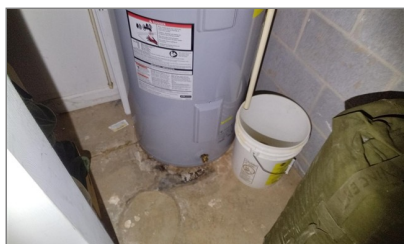

8. LAUNDRY AREA

General Summary

LAUNDRY AREA LIMITATIONS

29. Unable to view the walls, flooring, and piping at the time of inspection due to the washing machine and/or dryer being installed obstructing viewing of these areas. No claims can be made to the condition of these areas at the time of inspection.



9. ELECTRICAL SYSTEM

General Summary

ELECTRICAL VISUAL FINDINGS

30. (1) Outlets were found in and/or throughout the home to have broken and/or damaged outlets. The outlet(s) are cracked and need replacement to prevent a loose or improper connection. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



rear patio

31. (2) Loose outlets were noted throughout the home. Loose outlets can result in loose electrical connections which can increase the potential for a safety hazard and/or equipment failure. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



primary bathroom

32. (3) There are missing screws at the electrical panel that need replacement to properly secure the electrical panel cover to the panel prevent access to the interior of the panel. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



33. (4) There are pointed or tipped screws (wood screws) installed to secure the exterior cover of the electrical panel. Pointed or tipped screws may puncture the wiring installed in the panel and need to be replaced to flat/blunt tipped screws. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



34. (5) The electrical system of this home has single strand aluminum wiring present on the lighting and receptacle branch circuits. As a result of documented fire hazards, the use of single strand aluminum wiring for lighting and receptacle branch circuits was discontinued in 1974 until material improvement could be made. Due to the concealed nature of the electrical components, the general condition of the system could not be determined during the home inspection. A licensed electrical contractor should be consulted for a complete evaluation of the electrical system to determine if repair, modification, or replacement is needed to ensure safe and reliable service. For more information on aluminum household wiring and recommended repair methods, refer to the C.P.S.C. booklet "Repairing Aluminum Wiring." The toll-free hotline number for obtaining this booklet is 1-800-638-2772, or you can visit: <https://www.cpsc.gov/s3fs-public/516.pdf>



35. (6) There are GFCI's installed down stream of a main GFCI located in the primary bathroom. If the GFCI downstream trips the lead GFCI must be reset before the GFCI downstream can be reset. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



ELECTRICAL LIMITATIONS

36. The Arc fault breakers were **not** tested at the time of inspection due to the home being occupied. When testing the arc fault the breaker trips causing loss of power. Due to the home being occupied they are not tested as there may be appliances such as computers and clocks plugged into the outlets that are protected by the arc fault breakers. To test the breakers simply press the yellow, white, green, and or blue button at the front of the breaker to ensure that the breaker trips and then reset.

There are stored items throughout the home that prevent access and testing at some outlets and switches. Because of this not all outlets and switches could be tested at the time of inspection. The conditions of the outlets that were not tested are unknown at the time of inspection, no claims could be made as to whether they function properly.

11. COOLING SYSTEM(S)

General Summary

DUCT VISUAL FINDINGS

37. **There is dust and/or dirt noted inside the duct system** viewed from the air filter location. This may be an indication that the ducts are in need of cleaning to ensure efficiency of the unit(s).

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



HVAC LIMITATIONS

38. Unable to operate the exterior AC unit equipment or systems due to low exterior temperatures. Winter inspections only include a visual inspection of the air condition system(s). The AC units job is to cool the home when temperatures are below 60 degrees; the home is already cooled and the unit will not cool properly or give a false reading. If the exterior temperature is below 60 degrees Fahrenheit or when other circumstances are not conducive to safe operation, this may damage the equipment. With exterior temperatures below 60 degrees, the unit(s) cannot be inspected and no other part of that unit(s)/component(s) can be inspected for efficiency, operation, and/or functionality of the unit(s)/component(s). All unit(s)/component(s) require the proper source(s) to determine the efficiency, operation, and/or functionality of the unit(s)/component(s). The home inspector can not determine if an AC system will function as intended during the winter inspection and the operation of the system could result in component damage. At the time of the inspection, the home inspector develops no conclusions concerning whether or not the system will function or adequately cool the home during the summer season.

12. HEATING SYSTEM

General Summary

HEATING UNIT(S) LIMITATIONS

39. The panel was not removed due to risk of damaging the freon line. No statement can be made about the inside conditions of the heat pump unit in the basement.




13. INTERIOR COMPONENTS

General Summary


INTERIOR COMPONENT CONDITIONS/VISUAL FINDINGS

40. (1) This home is equipped with multiple dead bolts that can only be opened from the interior with a key when locked. These types of dead bolts restrict easy access to the exterior of the home in the event of an emergency. It is recommended to replace the dead bolts with the type that can be easily opened from the interior of the home.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

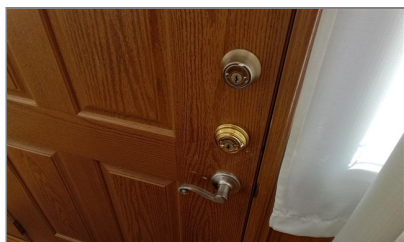


front door

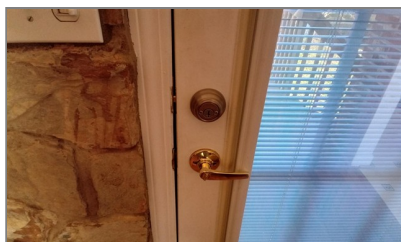


rear deck

41. (2) Moisture staining/damage was noted on the ceiling in the basement. Unable to determine if an active leak exists at the time of inspection as the stains were dry relative to unaffected areas at the time of inspection. Moisture penetration/leakage into or within a home can result in moisture damage to the structure and adverse environmental conditions. Unable to determine if there is hidden or concealed damage that was not visible at the time of inspection. Ask the seller the history of the stains and if repairs have been made to correct any leaks that may have caused the stain. If the sellers are unaware of the stain or no repairs have been made then it should be treated as an active issue and further evaluation is needed by a licensed general contractor.


Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

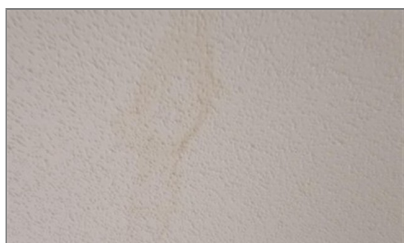


42. (3) The Drive-In Ball Catch w/ Strike Plate are missing at the top of the following doors: front bedroom door(s). Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

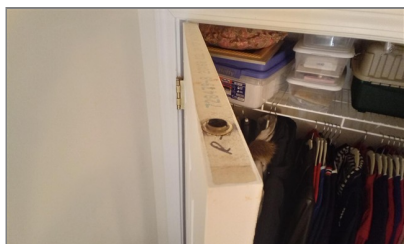

43. (4) The following door(s) listed below rubbed at the frame/flooring and need adjustment and/or repair for the door(s) to open and close properly without rubbing: bathroom door(s), primary bedroom
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

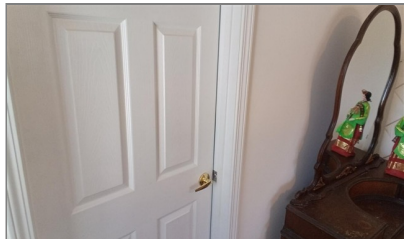


primary bathroom

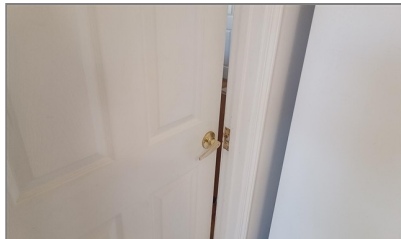

primary bedroom

44. (5) There were cracked floor tile(s) noted in the following location(s): basement steps. Corrections are needed in order to prevent possible further damage.
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

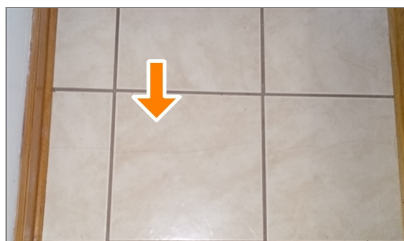

45. (6) The front door did not latch closed at the time of inspection. Corrections are needed so the door can function as intended. Have a qualified licensed contractor further evaluate and make the necessary repairs.
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



WINDOW VISUAL FINDINGS

46. There is wood rot and/or water damage noted (but not limited to) the windows framing/casing around the windows at the following location(s) listed below. Repair and/or replacement is needed at the window or window framing to ensure that there is not any hidden or concealed damage that was otherwise unseen at the time of inspection.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



left rear bedroom


INTERIOR COMPONENT RECOMMENDATIONS

47. Smoke detector(s) were located, and the test button on the Smoke detector(s) or combination with carbon monoxide detector(s) was pressed and responded. Please understand that the smoke or carbon monoxide simulation cannot be performed or tested during the inspection. To ensure safety, all smoke detector(s) and carbon monoxide detectors should be replaced after closing on the house and replaced as often per the manufacturer's recommendations.



WINDOWS ADDITIONAL LIMITATIONS

48. Unable to test or fully view the following rooms windows due to stored items, window treatments blocking the windows preventing access or operation at the time of inspection: master bedroom, front window.

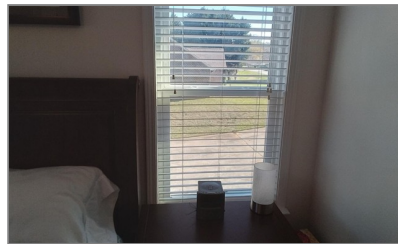

front

FIREPLACE ADDITIONAL LIMITATIONS

49. The pilot light was not lit at the time of inspection. Note: Pilot lights must be lit at the time of inspection to ensure safety. When pilots are off and/or the fireplace has not been used for sometime, it may take a long time to light the unit. The units may not light at all due to the lines needing to be bled. Because of the time constraints of a home inspection, pilot lights cannot be lit. Please Note: Unable to determine if the unit functions and/or functions properly at the time of inspection due to the pilot not being lit.



INTERIOR LIMITATIONS

50. Stored items and furniture prevent a full viewing of wall surfaces and floor surfaces. The inspection report applies to viewable surfaces only.

Stored items and/or rugs prevented a full viewing of the floored areas.

Stored items in closets prevented a full view of wall and floor conditions in those areas; the conditions in these areas are unknown and may expose damage after items are removed.

14. BATHROOMS

General Summary

PRIMARY BATHROOM VISUAL FINDINGS


51. (1) The shower door leaks at the seal on the bottom. Corrections are needed in order to prevent possible further leaking or damage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



52. (2) There is a leak at the faucet or faucet handle that needs repairs or replacement to prevent possible further leaking.
Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



53. (3) Caulk is needed to fill the gaps where the sink countertop and backsplash meet to prevent water penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

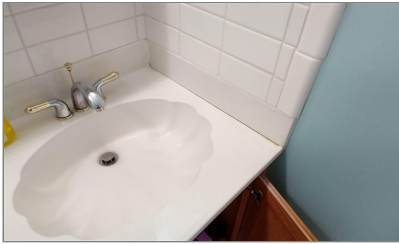


54. (4) The primary bathroom tub does not achieve functional drainage. This means that the tub will fill with water faster than it can drain water even when the stopper is not engaged. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



HALL BATHROOM VISUAL FINDINGS

55. Caulk/grout is needed to seal the gaps where the upstairs hall bathroom tub and shower wall meet to prevent water penetration. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

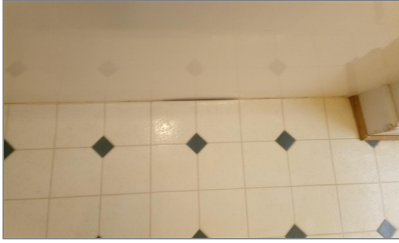

BASEMENT BATHROOM VISUAL FINDINGS

56. The tank is loose where it attaches to the base of the toilet and needs to be properly secured to prevent leakage. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



15. KITCHEN-APPLIANCES

General Summary

KITCHEN COMPONENTS VISUAL FINDINGS

57. Sealant/Caulk is needed to prevent water penetration and seal the gap(s) where the countertop meets the backsplash around the entire kitchen. Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



Daniel Bare,

Thank you for trusting HIC to perform your inspection at 2339 Perry Rd.
Denver NC 28037

If you have any questions regarding this report, please do not hesitate to contact us and set up a time to review your report. Our inspectors are always willing to help answer any questions to ensure you completely understand the information provided in your report. Contact your inspector directly or our office atÂ 704-542-6575Â with any questions.

Sincerely,



Mike Sweeting
(704)651-8190
MikeS@hicarolina.com
NC #5106
Home Inspection Carolina
Office - 704-542-6575
Fax - 704.540.7313
info@hicarolina.com
www.homeinspectioncarolina.com



v09.10.24

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Chip Sprague