



INSPECTION REPORT
8315 Bridgegate Dr
Huntersville NC 28078

INSPECTED BY
Alex Parr 3692
Above Parr Home
Inspections

INSPECTION DATE
📅 3/27/2025
🕒 09:00:00 AM

Michael A Parr
3692

INVOICE

Above Parr Home Inspections

Inspected By: Alex Parr 3692

Inspection Date: 3/27/2025
Report ID: 032725AP1

Customer Info:	Inspection Property:
Lorelei Ross Customer's Real Estate Professional: Jake Reed NextHome at the Lake	8315 Bridgegate Dr Huntersville NC 28078

Inspection Fee:

Service	Price	Amount	Sub-Total
Inspection Fee	775.00	1	775.00
WDI/Termite	75.00	1	75.00
Inspection Discount	-75.00	1	-75.00

Tax \$0.00

Total Price \$775.00

Payment Method: Credit Card

Payment Status: Paid

Note:

GENERAL INFO

Property Address

8315 Bridgegate Dr
Huntersville NC 28078

Date of Inspection

3/27/2025

Report ID

032725AP1

Customer(s)

Lorelei Ross

Time of Inspection

09:00:00 AM

Real Estate Agent

Jake Reed
NextHome at the Lake

INSPECTION DETAILS

Approximate age of building:

Over 10 Years

In Attendance:

Vacant (inspector only)

Radon Test:

No

Water Test:

No

Mold/Fungal Testing:

No

Wood Destroying Insect Report:

Yes

Type of building:

Single Family (2 story)

COMMENT KEY & DEFINITIONS

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

TABLE OF CONTENTS

Cover Page1

Invoice 2

Intro Page 3

Table of Contents 4

General Summary 5

1 Property Overview18

2 Roofing 21

3 Exterior 23

4 Structural Components 29

5 Plumbing System 33

6 Electrical System37

7 Heating / Central Air Conditioning41

8 Interiors 45

9 Insulation and Ventilation 48

10 Built-In Kitchen Appliances50

Attachments 52

GENERAL SUMMARY

Above Parr Home Inspections

Customer

Lorelei Ross

Address

8315 Bridgegate Dr
Huntersville NC 28078

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

"This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney."

The summary page must describe any system or component of the home that does not function as intended, allowing for normal wear and tear that does not prevent the system or component from functioning as intended. The summary page must also describe any system or component that appears not to function as intended, based upon documented tangible evidence, and that requires either subsequent examination or further investigation by a specialist. The summary page may describe any system or component that poses a safety concern.

1. PROPERTY OVERVIEW

1.1 INSPECTION LIMITATIONS

REPAIR OR REPLACE

(1) The home inspection was limited, one or more areas were not accessible due to the following conditions:

1. Several attic accesses were painted shut. As a result the areas were not inspected. Hidden damage may be present. Further investigation and repairs are needed.

We recommend having all personal items removed and these areas inspected prior to closing.



(2)

1. The framing and the foundation of the deck were not inspected as the underneath of the deck was blocked by trellis. No access panel could be located. Hidden damage may be present. Further evaluation is needed.

A qualified contractor should inspect and repair as needed.




2. ROOFING

2.0 ROOF COVERINGS

☐ REPAIR OR REPLACE

1. The roof shingles is damaged at the right side (facing front). This damage should be repaired or replaced. Due to the age and damage I recommend having the entire roof evaluated. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.

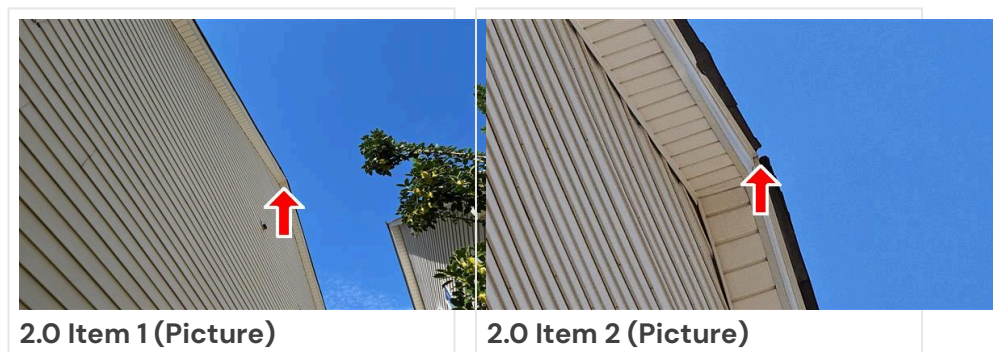

3. EXTERIOR


3.0 WALL CLADDING FLASHING AND TRIM

☐ REPAIR OR REPLACE

(1)

1. The vinyl siding at the right side (facing front) is loose. Deterioration can eventually occur if not corrected. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.

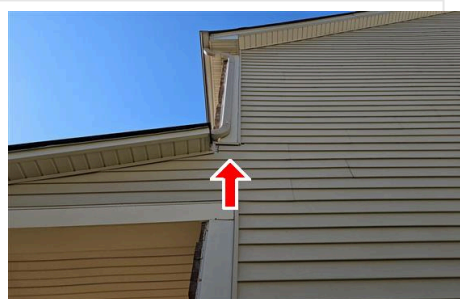

3.0 Item 1 (Picture)



3.0 Item 2 (Picture)



3.0 Item 3 (Picture)


3.3 DOORS (EXTERIOR)

☐ REPAIR OR REPLACE

(1)

1. Numerous exterior doors have evidence of past water intrusion and damaged. Using the moisture meter it did not indicate an actively at any of the locations. Further deterioration may occur. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.

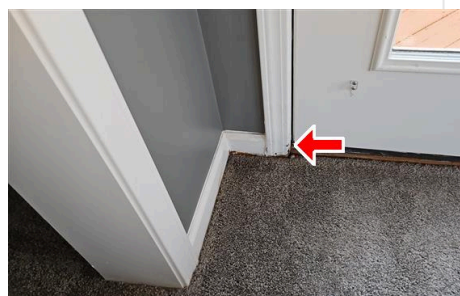

3.3 Item 1 (Picture)



3.3 Item 2 (Picture)



3.3 Item 3 (Picture)



3.3 Item 4 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE


(1)

1. The deck floor and steps at the rear of home are deteriorated. Further deterioration can occur if not repaired. Further investigation and repairs are needed.


A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

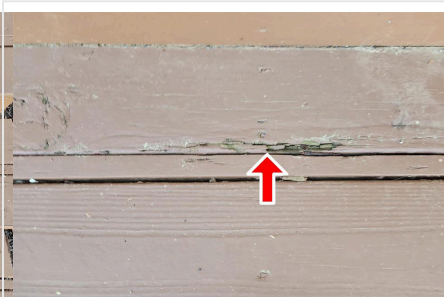


3.4 Item 2 (Picture)

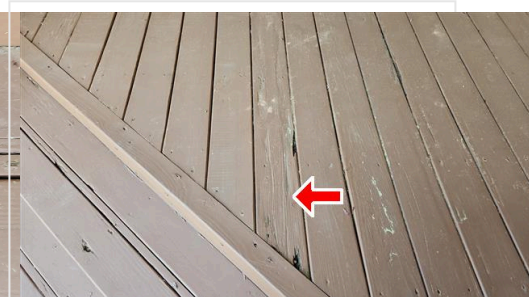

3.4 Item 3 (Picture)



3.4 Item 4 (Picture)

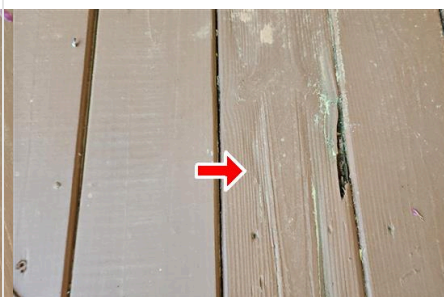

3.4 Item 5 (Picture)



3.4 Item 6 (Picture)



3.4 Item 7 (Picture)

(2)

1. The guardrails at covered porch at the front of home are missing. A fall or injury could occur if not corrected. Repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 8 (Picture)

(3)

1. The guardrails on steps at the rear of home are loose. A fall or injury could occur if not corrected. Repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 9 (Picture)


3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☐ REPAIR OR REPLACE

(1)

1. The concrete drive at the front of home shows signs of erosion and problem needs to be addressed. Further erosion or deterioration can occur if not corrected. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.

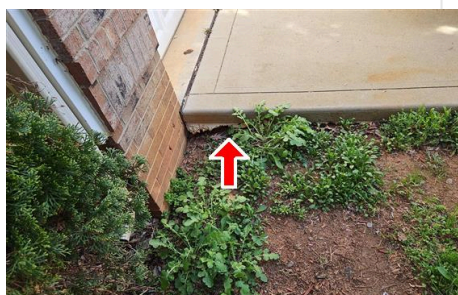

3.5 Item 1 (Picture)




3.5 Item 2 (Picture)

(2)

1. Evidence suggests the driveway at the front of the home is diverting stormwater towards the home.

Further deterioration can occur if not repaired. Further investigation and repairs are needed

A qualified contractor should inspect and repair as needed.

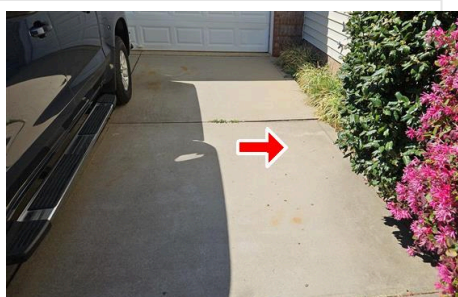

3.5 Item 3 (Picture)



3.5 Item 4 (Picture)

4. STRUCTURAL COMPONENTS

4.4 ROOF STRUCTURE AND ATTIC

REPAIR OR REPLACE

1. The truss system installed in the attic have been repaired due to damage during or before installation of the truss. All truss repairs should be repaired via an approved method specified by the manufacturer and or approved and stamped by licensed structural engineer. Note: No letter was present at repair. Further evaluation and repairs are needed. A qualified licensed structural engineer/design professional is recommended to evaluate the trusses for any repairs. This should include a site specific letter from the registered design professional/engineer stating what repairs (if any) are needed approval of performed repairs, signature, state license number, and state registered stamp of the engineer.



4.4 Item 1 (Picture)



4.4 Item 2 (Picture)



4.4 Item 3 (Picture)



4.4 Item 4 (Picture)



4.4 Item 5 (Picture)




4.4 Item 6 (Picture)

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

☐ REPAIR OR REPLACE

1. Visible signs of water intrusion in the basement (left side of home facing front) are present from water on wall. Water intrusion can lead to more costly repairs and increase damage if not corrected. Further investigation and repairs are needed.

I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist.

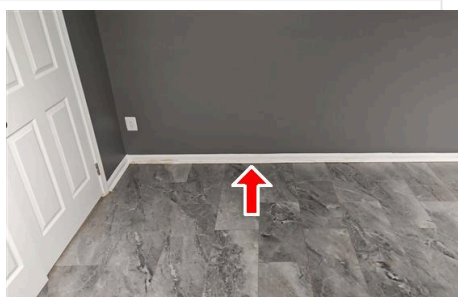

4.6 Item 1 (Picture)



4.6 Item 2 (Picture)



4.6 Item 3 (Picture)



4.6 Item 4 (Picture)

5. PLUMBING SYSTEM

5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

☐ REPAIR OR REPLACE

(1)

1. The kitchen sink is loose/not sealed properly. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.2 Item 1 (Picture)



5.2 Item 2 (Picture)



5.2 Item 3 (Picture)

(2)

1. The supply line has a corroded at connection in the basement. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.2 Item 4 (Picture)



5.2 Item 5 (Picture)

5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS


 REPAIR OR REPLACE

(1)

1. The tub drain drains slowly at the guest bath. Sometimes the drain can be partially clogged down line.

I am unable to determine the cause of the slow drain. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

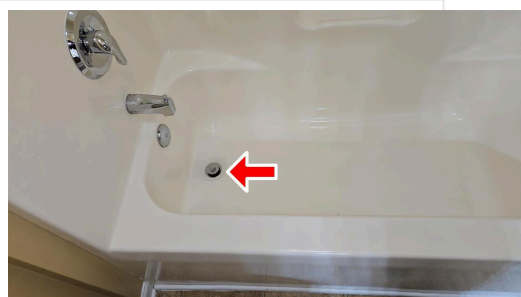

5.3 Item 1 (Picture)


(2)

1. The plumbing waste line leaks at the master bath sink. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 2 (Picture)

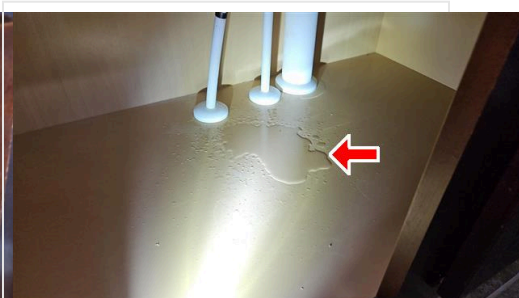

5.3 Item 3 (Picture)

6. ELECTRICAL SYSTEM

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

 REPAIR OR REPLACE

(1)

1. The light fixture does not work (try bulb first) at the bonus room. Electrical issues are considered a hazard until repaired. Repairs are needed.


A qualified licensed electrical contractor should correct as needed.

**6.4 Item 1 (Picture)**

(2)

1. The light fixture does not work at the guest bedroom closet. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.

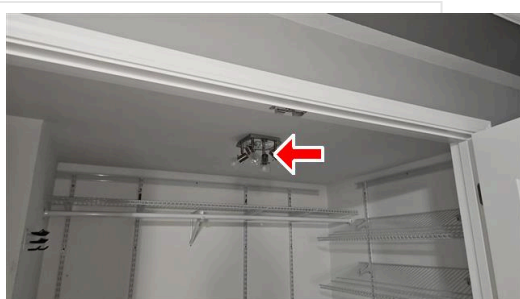**6.4 Item 2 (Picture)**

(3)

1. The ceiling fan does not work and in the guest bedroom. Electrical issues are considered a hazard until repaired. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.

**6.4 Item 3 (Picture)**

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)


☐ REPAIR OR REPLACE

1. GFCI (Ground Fault Circuit Interrupter) outlet at the exterior has a damaged cover. This may allow for water intrusion to occur. Repairs are needed.

A qualified licensed electrical contractor should correct as needed A qualified licensed electrical contractor should correct as needed.



6.6 Item 1 (Picture)

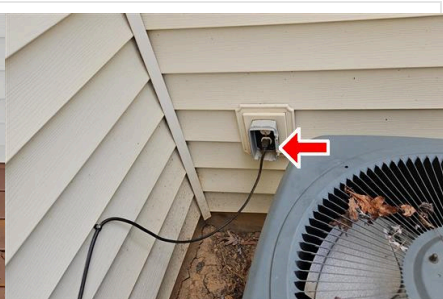

6.6 Item 2 (Picture)



6.6 Item 3 (Picture)

6.8 CARBON MONOXIDE DETECTORS

☐ REPAIR OR REPLACE

1. There is no carbon monoxide detector found in home. It is recommended that one be installed according to the manufacturer's instructions.

A qualified person should repair or replace as needed.

7. HEATING / CENTRAL AIR CONDITIONING


7.0 HEATING EQUIPMENT

☐ REPAIR OR REPLACE


(1)

1. The furnace combustion chamber has rusted with rust particles and flakes on the burners and at the bottom of the chambers. This is a typical sign of a possibly failed heating system/heat exchanger. Further investigation and repairs are needed.

I recommend contacting a licensed (HVAC) heating and air contractor for further evaluation.

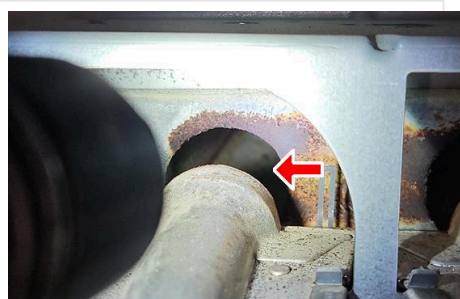

7.0 Item 1 (Picture)

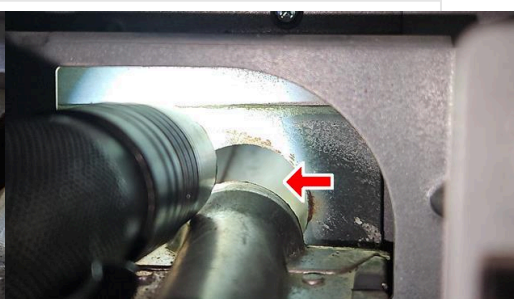


7.0 Item 2 (Picture)


(2)

1. The gas furnace has a gasket that is leaking. This can cause damage to the unit or shorten its life span. Further investigation and repairs are needed.


I recommend a qualified licensed contractor inspect further and repair as needed.

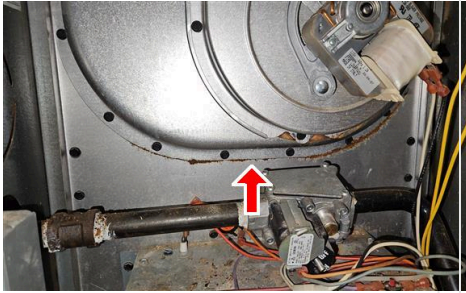

7.0 Item 3 (Picture)

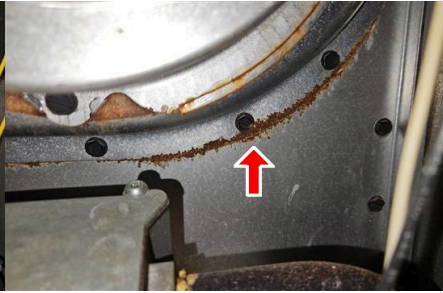

7.0 Item 4 (Picture)

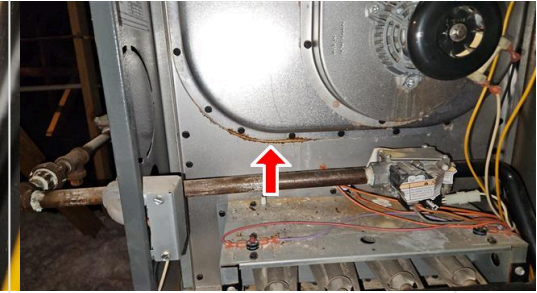

7.0 Item 5 (Picture)



7.0 Item 6 (Picture)


8. INTERIORS

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

☐ REPAIR OR REPLACE

1. The hand/guard rail for the upstairs is loose. A fall or injury could occur if not corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.

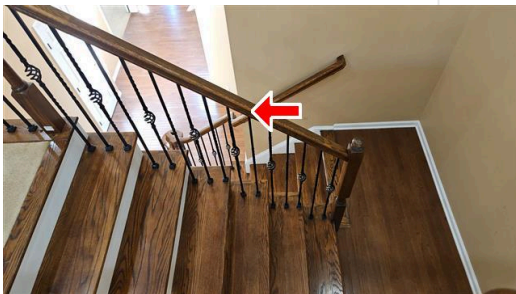


8.3 Item 1 (Picture)

8.6 WINDOWS (REPRESENTATIVE NUMBER)


☐ REPAIR OR REPLACE

1. The windows at the throughout the home have damaged sash springs. This can allow the window to come down suddenly causing glass breakage and or injury. (Safety Issue) Repairs are needed.

A qualified person should repair or replace as needed.

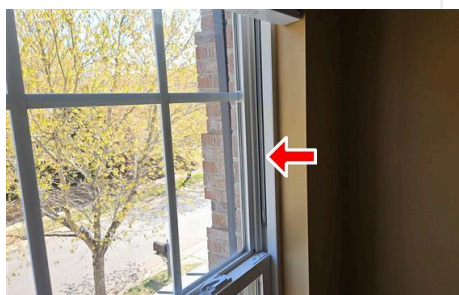

8.6 Item 1 (Picture)

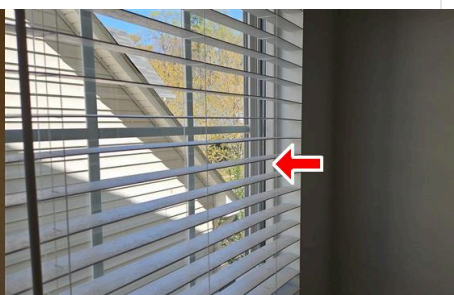


8.6 Item 2 (Picture)




8.6 Item 3 (Picture)



8.6 Item 4 (Picture)

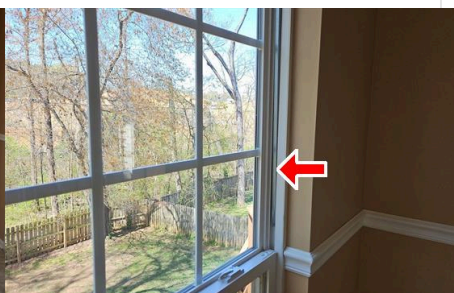

8.6 Item 5 (Picture)

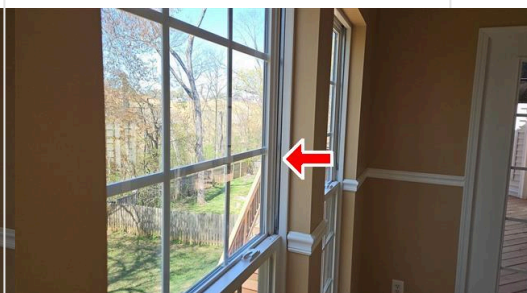

8.6 Item 6 (Picture)



8.6 Item 7 (Picture)



8.6 Item 8 (Picture)

10. BUILT-IN KITCHEN APPLIANCES

10.3 FOOD WASTE DISPOSER

☐ REPAIR OR REPLACE

1. The food disposer wiring is improper. Electrical issues are considered a hazard until repaired Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



10.3 Item 1 (Picture)



10.3 Item 2 (Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Alex Parr 3692

✓ RESULTS AT A GLANCE

84

✓ ITEMS INSPECTED
Total number in report.

26

📄 SUMMARY COMMENTS
Total number in report.

100

📷 PHOTOS
Total number in report.

🏠 1. PROPERTY OVERVIEW

✖ STYLES & MATERIALS: PROPERTY OVERVIEW

Temperature:

Below 65 (F) = 18 (C)

Weather:

Clear

Rain in last 3 days:

No

👁 ITEMS: PROPERTY OVERVIEW

1.0 SUBJECT PROPERTY PROSPECTIVE

✓ INSPECTED

1.1 INSPECTION LIMITATIONS

📋 REPAIR OR REPLACE


(1) The home inspection was limited, one or more areas were not accessible due to the following conditions:

1. Several attic accesses were painted shut. As a result the areas were not inspected. Hidden damage may be present. Further investigation and repairs are needed.


We recommend having all personal items removed and these areas inspected prior to closing.



1.1 Item 1 (Picture)

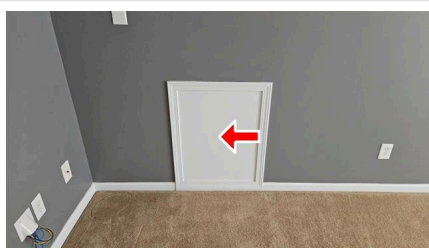

1.1 Item 2 (Picture)

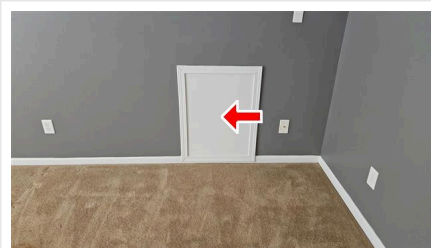

1.1 Item 3 (Picture)

(2)

1. The framing and the foundation of the deck were not inspected as the underneath of the deck was blocked by trellis. No access panel could be located. Hidden damage may be present. Further evaluation is needed.

A qualified contractor should inspect and repair as needed.



1.1 Item 4 (Picture)

1.2 RADON TESTING

☑ NOT INSPECTED

🏠 2. ROOFING

📋 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

🔧 STYLES & MATERIALS: ROOFING

Roof Covering: 3-Tab fiberglass Metal	Age: Original	Viewed roof covering from: Ground Camera Optical Zoom
Sky Light(s): None	Chimney (exterior): N/A	Roof-Type: Gable


👁️ ITEMS: ROOFING

2.0 ROOF COVERINGS


📋 REPAIR OR REPLACE

1. The roof shingles is damaged at the right side (facing front). This damage should be repaired or replaced. Due to the age and damage I recommend having the entire roof evaluated. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.

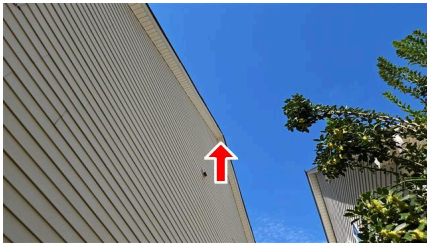

2.0 Item 1 (Picture)

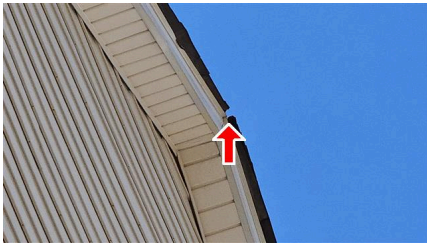


2.0 Item 2 (Picture)

2.1 FLASHINGS

👍 REPAIR OR REPLACE

1. The kick-out flashing is missing at the roof to wall intersection of the home. This is not best practice. Repairs are needed.

A qualified roofing contractor should inspect further and correct as needed.

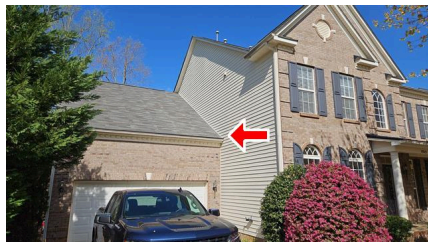

2.1 Item 1 (Picture)



2.1 Item 2 (Picture)

2.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

☑ INSPECTED

2.3 ROOF DRAINAGE SYSTEMS

☑ INSPECTED

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

3. EXTERIOR



DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

STYLES & MATERIALS: EXTERIOR

Siding Style:

Lap
Brick

Siding Material:

Vinyl
Brick veneer

Exterior Entry Doors:

Steel
Insulated glass

Appurtenance:

Deck with steps
Covered porch
Sidewalk

Driveway:

Concrete

ITEMS: EXTERIOR

3.0 WALL CLADDING FLASHING AND TRIM

REPAIR OR REPLACE

(1)

1. The vinyl siding at the right side (facing front) is loose. Deterioration can eventually occur if not corrected. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



3.0 Item 1 (Picture)



3.0 Item 2 (Picture)




3.0 Item 3 (Picture)

(2)

1. The vinyl siding at the rear of home is damaged. Further deterioration can occur if not corrected. Repairs are needed.

A qualified person should repair or replace as needed.

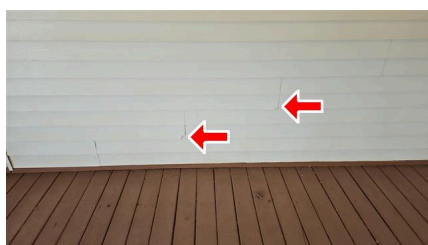

3.0 Item 4 (Picture)



3.0 Item 5 (Picture)



3.0 Item 6 (Picture)

3.1 EAVES, SOFFITS AND FASCIAS


✓ INSPECTED

3.2 WINDOWS


✓ REPAIR OR REPLACE

1. The steel lintels around the exterior of the home are beginning to rust or have rust present. A lintel is a horizontal architectural member or steel beam support placed over a wall opening to carry the weight of the masonry placed over it. In most situation, the lintel above you windows and doors will be steel angle iron or I beam. Either due to age or improper rust proofing or weep chord and flashing placement during installation, lintels will begin to rust. Rusting lintels can expand to become much thicker than their original size. The expansive forces of rusting steel can shift entire multi-story elevations. If your lintels are currently rusting, a telltale sign of expansion is diagonal "step" pattern cracks, which can be found on either end of the window or door opening. Repairs are needed to prevent further damage to the structure. Further deterioration may occur if not repaired.

I recommend a qualified contractor inspect and repair as needed.

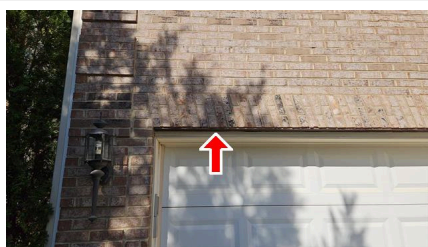

3.2 Item 1 (Picture)

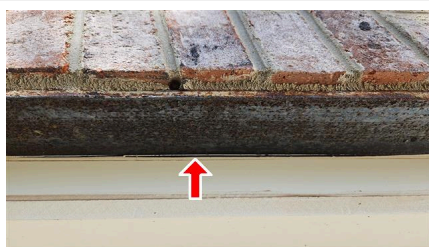

3.2 Item 2 (Picture)

3.3 DOORS (EXTERIOR)

☐ REPAIR OR REPLACE

(1)

1. Numerous exterior doors have evidence of past water intrusion and damaged. Using the moisture

meter it did not indicate an actively at any of the locations. Further deterioration may occur.
Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



3.3 Item 1 (Picture)



3.3 Item 2 (Picture)



3.3 Item 3 (Picture)



3.3 Item 4 (Picture)

(2)

1. The entry door at rear of home is deteriorated. Further deterioration may occur if not repaired.
Repairs are needed.

A qualified person should repair or replace as needed.



3.3 Item 5 (Picture)



3.3 Item 6 (Picture)

3.4 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ REPAIR OR REPLACE


(1)

1. The deck floor and steps at the rear of home are deteriorated. Further deterioration can occur if not repaired. Further investigation and repairs are needed.


A qualified contractor should repair or replace as needed.



3.4 Item 1 (Picture)

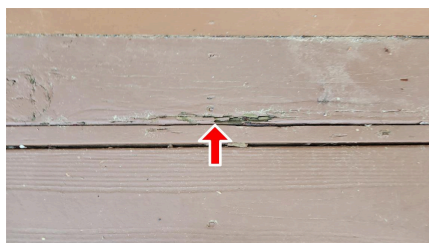

3.4 Item 2 (Picture)

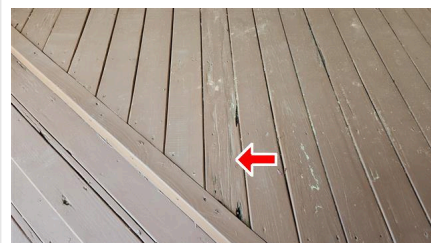

3.4 Item 3 (Picture)



3.4 Item 4 (Picture)



3.4 Item 5 (Picture)



3.4 Item 6 (Picture)



3.4 Item 7 (Picture)

(2)

1. The guardrails at covered porch at the front of home are missing. A fall or injury could occur if not corrected. Repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 8 (Picture)

(3)

1. The guardrails on steps at the rear of home are loose. A fall or injury could occur if not corrected. Repairs are needed.

A qualified contractor should repair or replace as needed.



3.4 Item 9 (Picture)

3.5 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☐ REPAIR OR REPLACE

(1)

1. The concrete drive at the front of home shows signs of erosion and problem needs to be addressed. Further erosion or deterioration can occur if not corrected. Further investigation and repairs are needed.

A qualified contractor should inspect and repair as needed.



3.5 Item 1 (Picture)



3.5 Item 2 (Picture)

(2)

1. Evidence suggests the driveway at the front of the home is diverting stormwater towards the home. Further deterioration can occur if not repaired. Further investigation and repairs are needed

A qualified contractor should inspect and repair as needed.



3.5 Item 3 (Picture)



3.5 Item 4 (Picture)

(3)

1. The concrete driveway has cracks that should be sealed to prevent further damage, which is part of ongoing maintenance of a concrete driveway that will need to be performed on a regular basis. Repairs are recommended.

A qualified contractor should inspect and repair as needed.



3.5 Item 5 (Picture)

3.6 GARAGE DOOR (S)

✓ INSPECTED

3.7 GARAGE DOOR OPERATORS (REPORT WHETHER OR NOT DOORS WILL REVERSE WHEN MET WITH RESISTANCE)

✓ INSPECTED

3.8 GARAGE WALLS (INCLUDING FIREWALL SEPARATION)

✓ INSPECTED

3.9 OCCUPANT DOOR (FROM GARAGE TO INSIDE OF HOME)

✓ INSPECTED

3.10 GARAGE FLOOR

✓ INSPECTED

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 4. STRUCTURAL COMPONENTS

📋 DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

🔧 STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation: Poured concrete	Method used to observe Crawlspace: No crawlspace	Floor Structure: Slab
Wall Structure: Wood	Columns or Piers: Supporting walls	Ceiling Structure: 2X4
Roof Structure: Engineered wood trusses		

👁️ ITEMS: STRUCTURAL COMPONENTS

4.0 WALLS (STRUCTURAL)

✅ REPAIR OR REPLACE

1. The concrete poured foundation wall at the exterior has cracks present. This crack does not appear significant to require repairs at this time. Further investigation and repairs are needed.

A qualified licensed general contractor should inspect further and repair as needed.




4.0 Item 1 (Picture)




4.0 Item 2 (Picture)



4.0 Item 3 (Picture)

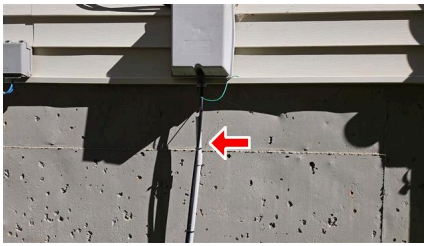

4.0 Item 4 (Picture)

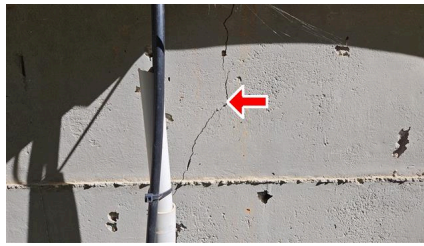

4.0 Item 5 (Picture)



4.0 Item 6 (Picture)



4.0 Item 7 (Picture)

4.1 COLUMNS OR PIERS

☑ INSPECTED

4.2 FLOORS (STRUCTURAL)

☑ INSPECTED

4.3 CEILINGS (STRUCTURAL)

☑ INSPECTED

4.4 ROOF STRUCTURE AND ATTIC

📋 REPAIR OR REPLACE

1. The truss system installed in the attic have been repaired due to damage during or before installation of the truss. All truss repairs should be repaired via an approved method specified b the manufacture and or approved and stamped by licensed structural engineer. Note: No letter was present at repair. Further evaluation and repairs are needed. A qualified licensed structural engineer/design professional is recommended to evaluate the trusses for any repairs. This should include a site specific letter from the registered design professional/engineer stating what repairs (if any) are needed approval of performed repairs, signature, state license number, and state registered stamp of the engineer.



4.4 Item 1 (Picture)




4.4 Item 2 (Picture)



4.4 Item 3 (Picture)



4.4 Item 4 (Picture)

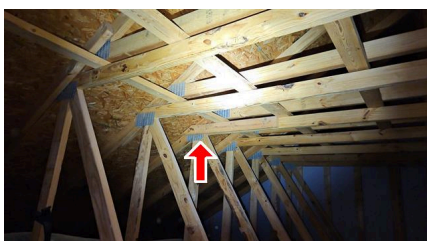

4.4 Item 5 (Picture)



4.4 Item 6 (Picture)

4.5 WOOD DETERIORATION


✓ INSPECTED

4.6 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

✗ REPAIR OR REPLACE

1. Visible signs of water intrusion in the basement (left side of home facing front) are present from water on wall. Water intrusion can lead to more costly repairs and increase damage if not corrected. Further investigation and repairs are needed.

I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist.

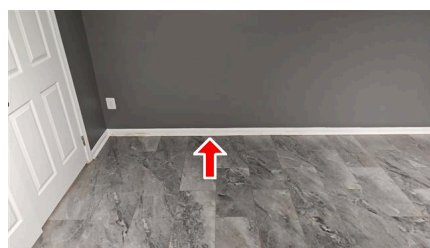

4.6 Item 1 (Picture)



4.6 Item 2 (Picture)



4.6 Item 3 (Picture)



4.6 Item 4 (Picture)

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



Complimentary photo of the water heater

✂️ STYLES & MATERIALS: PLUMBING SYSTEM

Water Source:

Public

Water Filters:

None

Plumbing Water Supply (into home):

Pex

Plumbing Water Distribution (inside home):

PEX

Washer Drain Size:

2" Diameter

Plumbing Waste:

PVC

Water Heater Power Source:

Gas (quick recovery)

Water Heater Capacity:

50 Gallon (2-3 people)

Manufacturer:

STATE

Water Heater Location:

Attic

👁️ ITEMS: PLUMBING SYSTEM

5.0 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

✓ INSPECTED

The main shut off is the red lever located in the basement. This is for your information.



5.0 Item 1 (Picture)

5.1 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

✓ INSPECTED


5.2 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

✗ REPAIR OR REPLACE

(1)

1. The kitchen sink is loose/not sealed properly. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

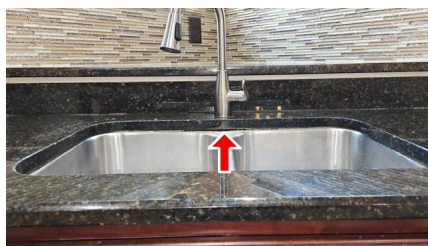

5.2 Item 1 (Picture)



5.2 Item 2 (Picture)



5.2 Item 3 (Picture)

(2)

1. The supply line has a corroded at connection in the basement. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.2 Item 4 (Picture)



5.2 Item 5 (Picture)


5.3 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

REPAIR OR REPLACE

(1)

1. The tub drain drains slowly at the guest bath. Sometimes the drain can be partially clogged down line. I am unable to determine the cause of the slow drain. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.

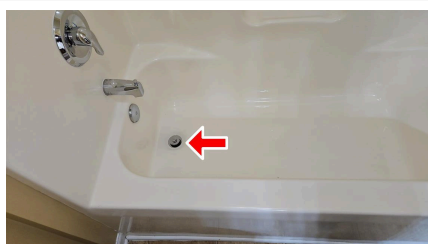

5.3 Item 1 (Picture)


(2)

1. The plumbing waste line leaks at the master bath sink. Repairs are needed to prevent water damage from occurring to the home. Further investigation and repairs are needed.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 2 (Picture)

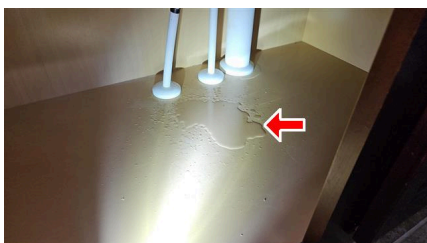

5.3 Item 3 (Picture)

(3)

1. The plumbing waste line drains slowly at the guest bath sink. A cause of a slow drain can range from a simple cleaning at stop valve or at the trap under sink. Sometimes the drain can be partially clogged down line. I am unable to determine the cause of the slow drain.

A qualified licensed plumber should repair or correct as needed.



5.3 Item 4 (Picture)

5.4 SHOWER/TUB & TILE WALLS

✓ INSPECTED

5.5 FUEL STORAGE AND DISTRIBUTION SYSTEMS (INTERIOR FUEL STORAGE, PIPING, VENTING, SUPPORTS, LEAKS)


✓ INSPECTED

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 6. ELECTRICAL SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

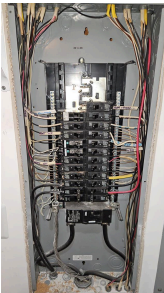

Complimentary photo of the electric panel with the cover off

⚙️ STYLES & MATERIALS: ELECTRICAL SYSTEM

Electrical Service Conductors: Below ground Aluminum	Panel capacity: (2) 200 AMP service panel	Panel Type: Circuit breakers
Electric Panel Manufacturer: SIEMENS	Branch wire 15 and 20 AMP: Copper	Wiring Methods: Romex

🔍 ITEMS: ELECTRICAL SYSTEM

6.0 LOCATION OF MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

The main panel box is located at the garage.

6.1 SERVICE ENTRANCE CONDUCTORS

✓ INSPECTED

6.2 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

✓ INSPECTED

6.3 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED

6.4 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

✗ REPAIR OR REPLACE

(1)

1. The light fixture does not work (try bulb first) at the bonus room. Electrical issues are considered a hazard until repaired. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 1 (Picture)

(2)

1. The light fixture does not work at the guest bedroom closet. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 2 (Picture)

(3)

1. The ceiling fan does not work and in the guest bedroom. Electrical issues are considered a hazard until repaired. Repairs are needed.

A qualified licensed electrical contractor should correct as needed.



6.4 Item 3 (Picture)

6.5 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

✓ INSPECTED

6.6 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)


✗ REPAIR OR REPLACE

1. GFCI (Ground Fault Circuit Interrupter) outlet at the exterior has a damaged cover. This may allow for water intrusion to occur. Repairs are needed.

A qualified licensed electrical contractor should correct as needed A qualified licensed electrical contractor should correct as needed.



6.6 Item 1 (Picture)

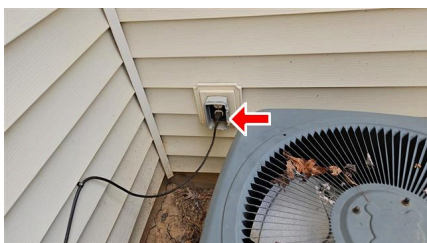

6.6 Item 2 (Picture)



6.6 Item 3 (Picture)

6.7 SMOKE DETECTORS

✓ INSPECTED

6.8 CARBON MONOXIDE DETECTORS

✎ REPAIR OR REPLACE

1. There is no carbon monoxide detector found in home. It is recommended that one be installed according to the manufacturer's instructions.

A qualified person should repair or replace as needed.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



🏠 7. HEATING / CENTRAL AIR CONDITIONING

📋 DESCRIPTION

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



Complimentary photo of the AC units

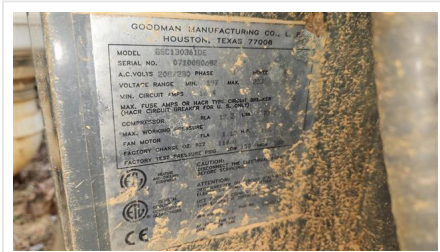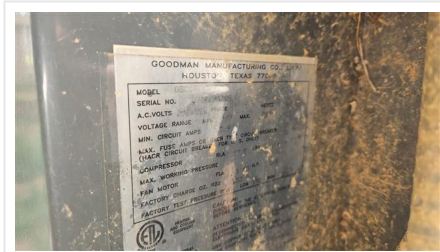

✂ STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type: Forced Air	Heating Age: Original	Number of Heat Systems (excluding wood): Three
Energy Source: Natural gas	Operated: Units Operated	Heat System Brand: GOODMAN
Ductwork: Insulated	Types of Fireplaces: Vented gas logs	Operable Fireplaces: One
Number of Woodstoves: None	Cooling Equipment Type: Air conditioner unit	Air Conditioning Age: Original
Cooling Equipment Energy	Central Air Manufacturer:	Number of AC Only Units:

Source:
Electricity

GOODMAN

Three

ITEMS: HEATING / CENTRAL AIR CONDITIONING


7.0 HEATING EQUIPMENT

REPAIR OR REPLACE


(1)

1. The furnace combustion chamber has rusted with rust particles and flakes on the burners and at the bottom of the chambers. This is a typical sign of a possibly failed heating system/heat exchanger. Further investigation and repairs are needed.

I recommend contacting a licensed (HVAC) heating and air contractor for further evaluation.

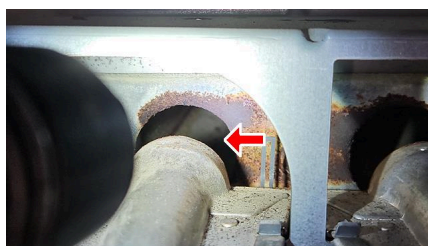

7.0 Item 1 (Picture)

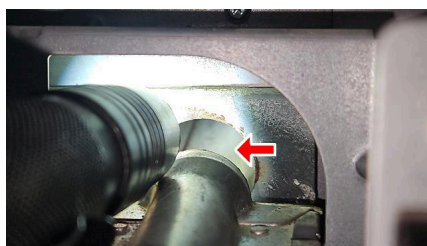


7.0 Item 2 (Picture)

(2)

1. The gas furnace has a gasket that is leaking. This can cause damage to the unit or shorten its life span. Further investigation and repairs are needed.


I recommend a qualified licensed contractor inspect further and repair as needed.

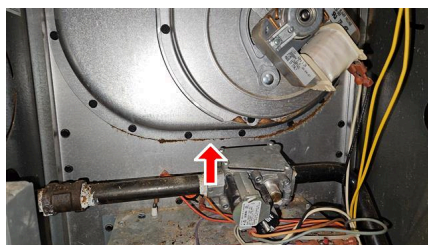

7.0 Item 3 (Picture)



7.0 Item 4 (Picture)

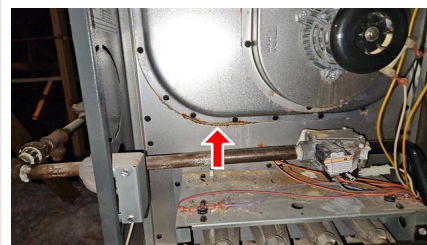

7.0 Item 5 (Picture)



7.0 Item 6 (Picture)

7.1 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

☑ INSPECTED

7.3 DISTRIBUTION SYSTEMS (INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS AND CONVECTORS)

☑ INSPECTED

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

☑ INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

☑ INSPECTED

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

☑ NOT PRESENT

7.7 GAS/LP FIRELOGS AND FIREPLACES

☑ INSPECTED


7.8 COOLING AND AIR HANDLER EQUIPMENT

☑ REPAIR OR REPLACE

(1)

1. The platform for condenser(s) has erosion occurring under it. This can cause damage to the unit or shorten its life span. Repairs are needed.

I recommend further inspection by a licensed HVAC contractor.

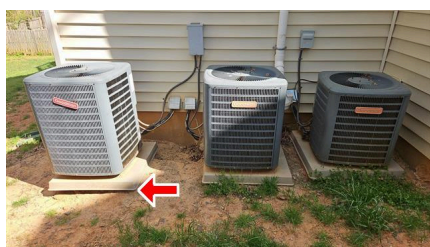

7.8 Item 1 (Picture)

(2)

1. The foam sleeve on suction line is missing foam sleeve in area(s) at outside unit. Missing foam on suction line can cause energy loss and condensation. I recommend service or repair as needed.

I recommend further inspection by a licensed HVAC contractor.

7.9 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.10 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

☑ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

 8. INTERIORS

 DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

 STYLES & MATERIALS: INTERIORS

Ceiling Materials: Drywall	Wall Material: Drywall	Floor Covering(s): Carpet Hardwood T&G Linoleum Tile
Interior Doors: Hollow core Raised panel	Window Types: Thermal/Insulated Single-hung Tilt feature Casement Fixed	

 ITEMS: INTERIORS

8.0 CEILINGS

 INSPECTED

8.1 WALLS

 INSPECTED

8.2 FLOORS


 INSPECTED

8.3 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

 REPAIR OR REPLACE

1. The hand/guard rail for the upstairs is loose. A fall or injury could occur if not corrected. A repair or replacement is needed.

A qualified contractor should repair or replace as needed.

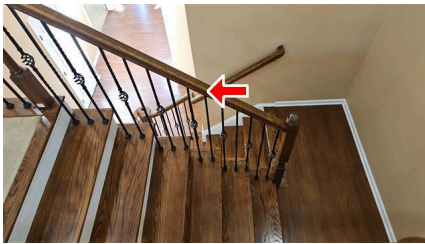

8.3 Item 1 (Picture)

8.4 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

✓ REPAIR OR REPLACE

1. Cabinet base is missing under sink. This is a cosmetic issue for your information. Recommend repair or replace as necessary.

A qualified person should repair or replace as needed



8.4 Item 1 (Picture)


8.5 DOORS (REPRESENTATIVE NUMBER)

✓ INSPECTED


8.6 WINDOWS (REPRESENTATIVE NUMBER)

☐ REPAIR OR REPLACE

1. The windows at the throughout the home have damaged sash springs. This can allow the window to come down suddenly causing glass breakage and or injury. (Safety Issue) Repairs are needed. A qualified person should repair or replace as needed.

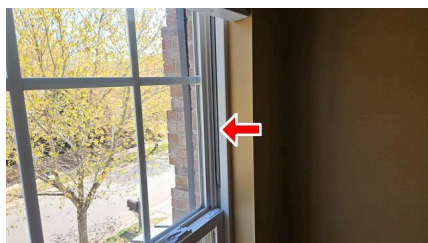

8.6 Item 1 (Picture)

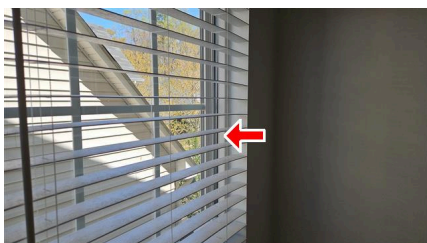


8.6 Item 2 (Picture)




8.6 Item 3 (Picture)



8.6 Item 4 (Picture)

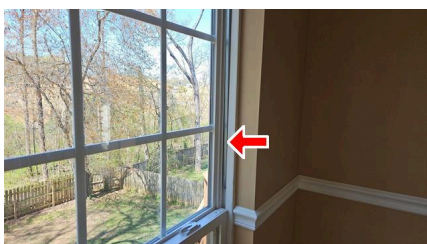


8.6 Item 5 (Picture)

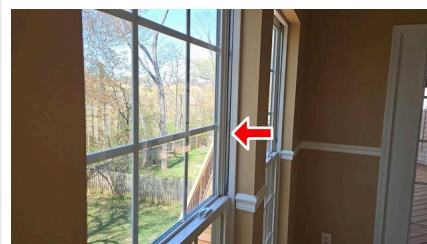

8.6 Item 6 (Picture)



8.6 Item 7 (Picture)

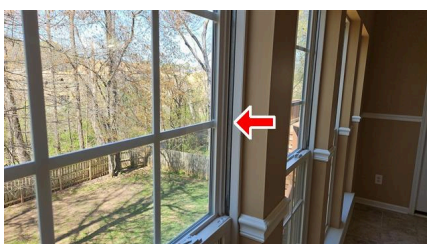

8.6 Item 8 (Picture)

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 9. INSULATION AND VENTILATION

📋 DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

🔧 STYLES & MATERIALS: INSULATION AND VENTILATION

Attic info: Attic access Pull Down stairs	Method used to observe attic: From entry Inaccessible	Attic Insulation: Blown Fiberglass
Ventilation: Ridge vents Soffit Vents	Exhaust Fans: Fan	Dryer Power Source: 220 Electric
Dryer Vent: Metal	Floor System Insulation: NONE	

👁️ ITEMS: INSULATION AND VENTILATION

9.0 VAPOR RETARDERS (IN CRAWLSPACE OR BASEMENT)

✔ NOT PRESENT

9.1 VENTILATION OF ATTIC AND FOUNDATION AREAS

✔ NOT PRESENT

9.2 INSULATION IN ATTIC

✔ REPAIR OR REPLACE

1. Fiberglass (loose-fill) insulation is is compressed in areas of the attic due to foot traffic or storage in attic. Heat loss can occur more on this home than one that is properly insulated. Repairs are recommended .

A qualified person should repair or replace as needed.



9.2 Item 1 (Picture)



9.2 Item 2 (Picture)

9.3 INSULATION UNDER FLOOR SYSTEM

✓ NOT PRESENT

9.4 ATTIC ACCESS

✓ INSPECTED

9.5 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

✓ INSPECTED

9.6 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

✓ NOT PRESENT

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 10. BUILT-IN KITCHEN APPLIANCES

📋 DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

🔧 STYLES & MATERIALS: BUILT-IN KITCHEN APPLIANCES

Countertop:

Granite

Cabinetry:

Wood


👁️ ITEMS: BUILT-IN KITCHEN APPLIANCES

10.0 DISHWASHER


✅ REPAIR OR REPLACE

1. The dishwasher is loose and needs securing to underside of countertop (using a proper length screw). I recommend repair as necessary.

A qualified licensed plumber should repair or correct as needed.

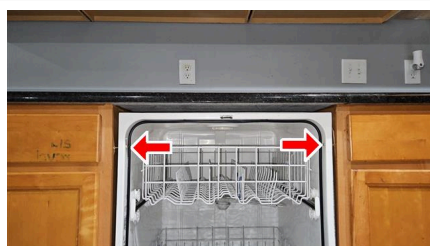

10.0 Item 1 (Picture)

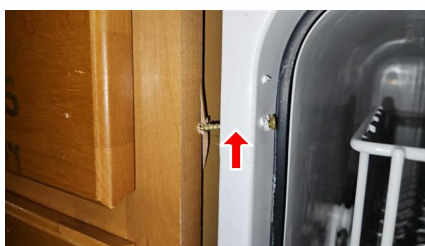

10.0 Item 2 (Picture)



10.0 Item 3 (Picture)



10.0 Item 4 (Picture)

10.1 RANGES/OVENS/COOKTOPS

✓ INSPECTED

10.2 RANGE HOOD (S)

✓ INSPECTED

10.3 FOOD WASTE DISPOSER

📋 REPAIR OR REPLACE

1. The food disposer wiring is improper. Electrical issues are considered a hazard until repaired. Further investigation and repairs are needed.

A qualified licensed electrical contractor should correct as needed.



10.3 Item 1 (Picture)



10.3 Item 2 (Picture)

10.4 MICROWAVE COOKING EQUIPMENT

✓ INSPECTED

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



Above Parr Home Inspections

Report Attachments

ATTENTION: This inspection report is incomplete without reading the information included herein at these links/ attachments. Note If you received a printed version of this page and did not receive a copy of the report through the internet please contact your inspector for a printed copy of the attachments.

[NC WDIIR](#)