



Inspection Report

Carolinas Home Inspections, LLC

Bill Boan NC HILB 2981

108 Bridgeport Dr

Mooresville, NC 28117



REPORT PREPARED FOR:

Mark Powers

INSPECTED PROPERTY ADDRESS:

1022 Kenilworth Ct NW

Concord NC

TABLE OF CONTENTS

Cover Page 1

Table of Contents 2

Intro Page..... 3

1 Roofing 5

2 Exterior 7

3 Interiors 13

4 Structural Components..... 15

5 Plumbing System 18

6 Electrical System..... 22

7 Heating / Central Air Conditioning 26

8 Insulation and Interior Ventilation 30

9 Built-In Kitchen Appliances/Laundry Area(s)..... 31

 GENERAL INFO**Property Address**1022 Kenilworth Ct NW
Concord NC**Date of Inspection**

7/30/2025

Report ID**Customer(s)**

Mark Powers

Time of Inspection

10:00 AM

Real Estate AgentJake Reed
Next Home World Class -
 Mooresville INSPECTION DETAILS**Standard of Practice:**

NC

In Attendance:

Seller only

Type of building:Single Family (1 story) with finished
basement**Style of Home:**

Ranch

Approximate age of building:

1984 (41 years old)

Temperature:

approx 95 F

Weather:

Clear, Hot and Humid

Ground/Soil surface condition:

Dry

Rain in last 3 days:

No

Radon Test:

No

Water Test:

No

 COMMENT KEY & DEFINITIONS**Comment Key or Definitions**

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Inspected (IN) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI) = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

*****INTRODUCTION - PLEASE READ FULLY*****

Homes More Than 40 Years Old

Homes more than 40 years old WILL have systems/areas/portions of structure that are not current in code requirements. This is not a new home and this home should NOT be expected to meet current code / building standards or methods. Code cycles continually change and will always become more restrictive since this home was originally built. This inspection is NOT a building code inspection (the city/county code officials enforce these) This inspection is NOT intended to determine if any permits for repairs/remodeling were applied for. This inspection makes every effort to point out safety issues, items which are not functioning as intended, and items which may need further evaluation/repair by a trade or specialist. The inspection is not meant to be technically exhaustive, but rather to give a general overview of the home, its VISIBLE and ACCESSIBLE systems and its VISIBLE and ACCESSIBLE components. Some areas/components may go unnoticed or uninspected due to vegetation, stored items, furniture, inaccessible areas, etc.

WE CANNOT PREDICT FUTURE CONDITIONS -- THE INSPECTION & REPORT IS REFLECTIVE OF THE CONDITION OF THE HOME & THE FUNCTIONALITY OF COMPONENTS THE DAY OF INSPECTION, AND THEREFORE IS NOT A WARRANTY OF COMPONENTS, THE STRUCTURE, OR THE HOME IN GENERAL. The home inspection does not look for possible manufacturer re-calls on components that could be in this home, nor does it comment on the "age" of appliances/components (as long as said appliances/components are functioning correctly). Example = kitchen appliances, water heater, hvac systems, roofing, etc. No home inspector is able to ascertain how long a particular appliance or component may function before it needs to be serviced, repaired, or replaced. Cosmetic items are not discussed unless the underlying cause of the cosmetic issue was/is/can be attributed to a particular system/component issue or failure. THE INSPECTION OF THE MAIN COMPONENTS IS THE PURPOSE OF THIS INSPECTION. Components such as exterior, roof, visible structure, plumbing, heating/AC, electrical, visible insulation, and kitchen appliances are main components.

It is common that homes of any age will have had repairs performed and some repairs may not be in a workmanlike manner. Some areas may appear less than standard, but may be functioning correctly at time of inspection. The inspection does not "grade" the repair. For example, it is sometimes common to see old plumbing materials mixed with new plumbing materials. Sometimes water signs in crawlspaces or basements could be years old from a problem that no longer exists. Or, it may still need further attention and repair. Determining this can be difficult in a lived in home. Sometimes homes have signs of damage to wood from wood eating insects. Having this is typical and fairly common. If the home inspection reveals signs of damage you should have a pest control company inspect further for activity and possible hidden damage. Always consider hiring the appropriate expert for any repairs or further inspection.

🏠 1. ROOFING

📋 DESCRIPTION

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.



Front >>>



Rear >>>





✂ STYLES & MATERIALS: ROOFING

Roof Covering:

Architectural
Asphalt/Fiberglass

Viewed roof covering from:

Ground
Zoom-Lens Camera
Binoculars

Sky Light(s):

None

Chimney (exterior):

Wood Frame
Metal Flue Pipe
Horizontal /Vertical Metal Vent
Termination

Roof Ventilation:

Gable vents
Ridge vents
Soffit Vents

👁 ITEMS: ROOFING

1.0 ROOF COVERINGS

☑ INSPECTED

1.1 VISIBLE FLASHINGS

☑ INSPECTED

1.2 SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS

☑ INSPECTED

1.3 VENTILATION OF ROOF/ATTIC AREAS

☑ INSPECTED

1.4 VENTILATION FANS AND THERMOSTATIC CONTROLS IN ATTIC

☑ NOT PRESENT

none noted

1.5 ROOF DRAINAGE SYSTEMS/GUTTERS/DOWNSPOUTS

☑ INSPECTED

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.


🏠 2. EXTERIOR

📋 DESCRIPTION

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.



Front >>>>

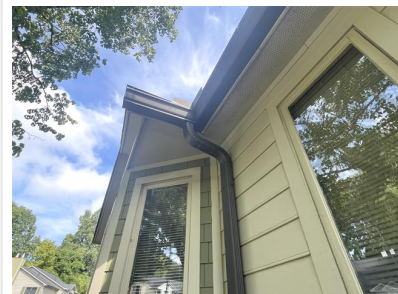







rear >>>>





front stairs and porch >>>

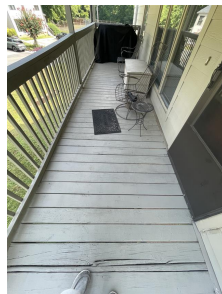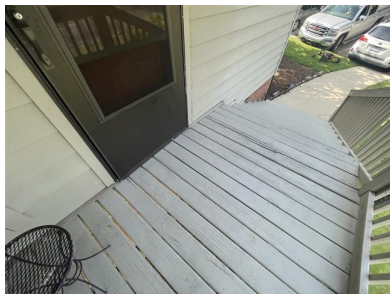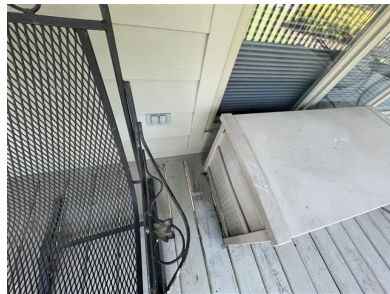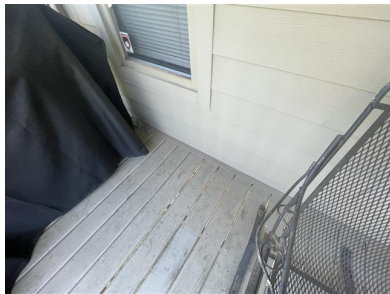

✕ STYLES & MATERIALS: EXTERIOR

Siding Style:

Lap Siding
Brick

Siding Material:

Composite board
Brick veneer

Trim Material:

Wood
Composite Board
Aluminum-Clad wood

Exterior Entry Doors:

Wood

Exterior Windows Trim:

Wood

Appurtenance:

Deck with steps
Covered porch

Driveway:

Parking lot

👁 ITEMS: EXTERIOR

2.0 WALL CLADDING FLASHING AND TRIM

☑ INSPECTED

2.1 DOORS (EXTERIOR)

📋 INSPECTED, REPAIR OR REPLACE

At rear basement exterior door, daylight was visible at the weatherstripping on the side of the door. This can produce drafts. The weatherstripping needs to be "enlarged" at this side of the door to prevent drafts. Recommend repair.



2.1 Item 1 (Picture)



2.1 Item 2 (Picture)

2.2 WINDOWS (EXTERIOR)

📋 INSPECTED, REPAIR OR REPLACE

Many of exterior casement window bottom stiles are in need of repair or are near to rotting. Some have been repaired with wood hardener, many have not. I operated some of the windows from the inside, but there were some I did not operate due to fear that operating them may further damage the bottom stiles. Repair or replacement of windows is needed.



2.2 Item 1 (Picture)



2.2 Item 2 (Picture)



2.2 Item 3 (Picture)



2.2 Item 4 (Picture)



2.2 Item 5 (Picture)



2.2 Item 6 (Picture)



2.2 Item 7 (Picture)



2.2 Item 8 (Picture)



2.2 Item 9 (Picture)



2.2 Item 10 (Picture)

2.3 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/COVER AND APPLICABLE RAILINGS

☐ INSPECTED, REPAIR OR REPLACE

(1) At rear exterior door, due to the steps having four risers, I would recommend handrails be installed for occupant safety, if you desire . This will likely require approval of the HOA (may or may not be approved)



2.3 Item 1 (Picture)

(2) At the side deck structure, the deck structure was built using methods approved at the time of the build. It is likely that most all condo units have the same building method to each deck. I noted no rotten boards or structure issues which require "immediate" attention. However, there are some safety features which could be added to ensure long-term structural stability for occupant safety.

A) - where the stairs stringers attach to the deck structure at the top of the stairs, the stringers are pulling away where they are nailed to the side of the deck structure. These stair stringers should have joist hangers or mechanical steel plates added to ensure the stairs stringers do not pull away from the deck structure.


B) - the middle stair stringer is cracked near where it connects to the side of the deck. A joist hanger (mentioned above) will help to prevent this from further cracking)

C) - under the deck stairs, there is a singular post with a 4x4 placed laterally on top of it. This is to provide vertical and horizontal stability to each of the stair stringers to prevent the stairs from shaking while transversing them.. There are no side posts under the lateral 4x4 (i.e, there is no support on open side of stairs if the side stair stringer needs it)

D) - all deck joists should have joist hangers applied for safety

E) - at the deck ledger board which runs parallel to the exterior wall of unit, the ledger board was applied over the siding, and there is no indication that this ledger board was properly fastened to the exterior frame of the wall using bolts. Due to this, the area of the ledger board where the double joists are located (shown in picture 9) may not be fully supported. Even if joists hangers are applied at the double joists (at red circle in picture), the ledger board which "carries the weight" of the double joists does not appear to be bolted to the house (only nailed). Further evaluation should be done at this area

You will need to address this with the HOA, which may (or may not) agree with my safety suggestions. ..

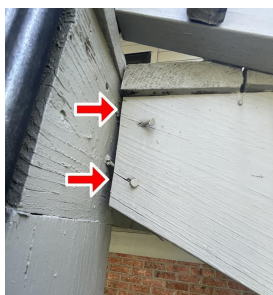

2.3 Item 2 (Picture)
stair stinger connection to side of deck



2.3 Item 3 (Picture)
middle stair stringer cracked




2.3 Item 4 (Picture)



2.3 Item 5 (Picture)
end of lateral 4x4 not touching the stringer (no support)




2.3 Item 6 (Picture)
joist hangers would help to provide a higher level of structural safety

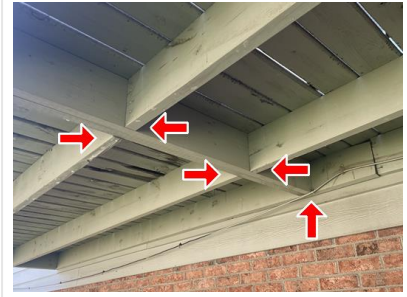

2.3 Item 7 (Picture)
joist hangers would help to provide a higher level of structural safety



2.3 Item 8 (Picture)
joist hangers would help to provide a higher level of structural safety

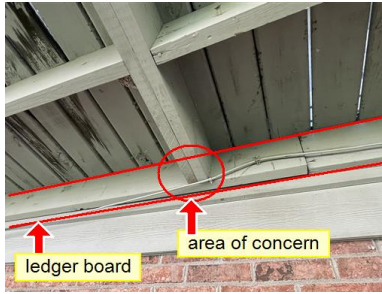

2.3 Item 9 (Picture)

2.4 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (WITH RESPECT TO THEIR EFFECT ON THE CONDITION OF THE BUILDING)

☑ INSPECTED

2.5 EAVES, SOFFITS AND FASCIAS

☑ INSPECTED

2.6 EXTERIOR PENETRATIONS

☑ INSPECTED

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 3. INTERIORS

DESCRIPTION

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

STYLES & MATERIALS: INTERIORS

Ceiling Materials:

Gypsum Board

Wall Material:

Gypsum Board

Floor Covering(s):

Carpet

Tile

Vinyl

Wood

Interior Doors:

Hollow core

Raised panel

Wood

Window Types:

AGED

Thermal/Insulated

Casement

Cabinetry:

Wood

ITEMS: INTERIORS

3.0 CEILINGS

☑ INSPECTED

3.1 WALLS

☑ INSPECTED, NOT INSPECTED

Limitation - finished walls were not fully visible due to owner stored items and furniture.

3.2 FLOORS

☑ INSPECTED, NOT INSPECTED

Limitation - finished floors (carpet, tiles, etc) were not fully visible due to owner stored items and furniture.

3.3 INTERIOR TRIM

☑ INSPECTED, NOT INSPECTED

Limitation - finished trim was not fully visible due to owner stored items and furniture.

3.4 STEPS, STAIRWAYS, BALCONIES AND RAILINGS

☑ INSPECTED

3.5 COUNTERS AND CABINETS (REPRESENTATIVE NUMBER)

☑ INSPECTED, NOT INSPECTED

Limitation - seller was home and cooking in kitchen. I could not inspect all cabinets or countertops

3.6 DOORS (REPRESENTATIVE NUMBER)

☑ INSPECTED

3.7 WINDOWS (REPRESENTATIVE NUMBER)


☑ INSPECTED

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 4. STRUCTURAL COMPONENTS

☰ DESCRIPTION

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

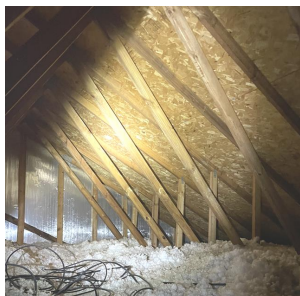


attic area/ roof structure - viewed from scuttle hole - did not walk attic








fireplace vent coming through ceiling.








fireplace vent going through roof

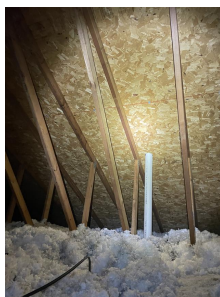

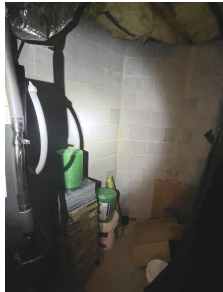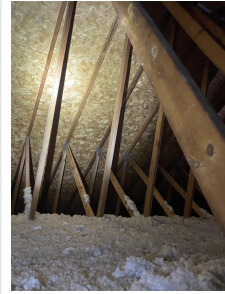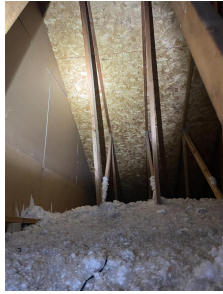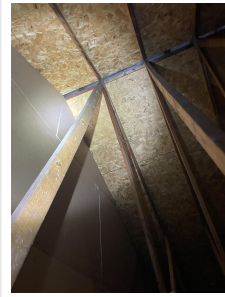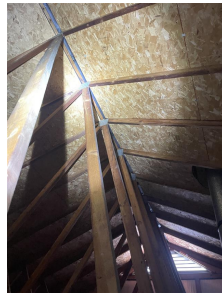

unfinished area of basement >>>

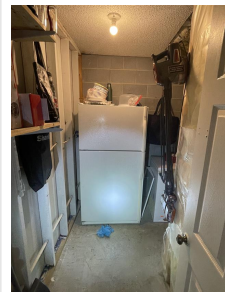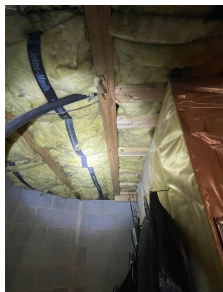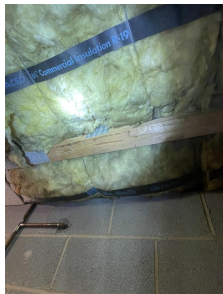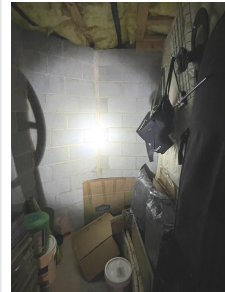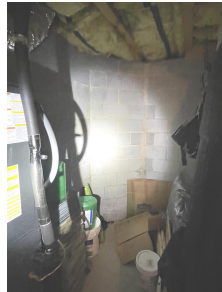

✂ STYLES & MATERIALS: STRUCTURAL COMPONENTS

Foundation:

Masonry block
Brick

Columns or Piers:

Wood posts/columns at deck
Supporting walls

Floor Structure:

Slab
Engineered floor trusses
Extra Info : Only visible in unfinished basement area

Wall Structure:

Wood
Masonry
Only visible in the unfinished basement

Ceiling Structure:

Wood Joists
4" or better
Not visible

Roof Structure:

Engineered wood trusses
OSB Sheathing
Extra Info : Party wall (fire-wall) between units is installed

Roof-Type:

Gable

Method used to observe attic:

From attic platform(s)
Extra Info : Did not walk the attic
- no platform

Attic info:

Scuttle hole
No Storage
Limited visibility/limited access
Extra Info : not platform, storage, or light in attic

ITEMS: STRUCTURAL COMPONENTS

4.0 FOUNDATIONS, BASEMENT AND CRAWLSPACE (REPORT SIGNS OF ABNORMAL OR HARMFUL WATER PENETRATION INTO THE BUILDING OR SIGNS OF ABNORMAL OR HARMFUL CONDENSATION ON BUILDING COMPONENTS.)

INSPECTED

In basement utility room there is a small hairline stair-step crack in the foundation block above the refrigerator (to the left of the vertical copper water pipe). This crack is approx 1/16" or less and does not appear to pose a structural concern at the moment. It should be monitored to ensure the crack does not get larger. If crack begins to exceed 1/4" or if water intrusion is noted at this crack in the future, the HOA should be contacted. This is FYI



4.0 Item 1 (Picture)

4.1 COLUMNS OR PIERS

INSPECTED

Wood posts at side deck

4.2 FLOORS (STRUCTURAL)

☑ INSPECTED

Only visible in portion of unfinished basement (floor trusses)

4.3 WALLS (STRUCTURAL)

☑ NOT INSPECTED

Wall structure was not visible due to sheetrocked wall coverings (except in unfinished basement). Noted no substantial cracking of a 1/4" or more which would have indicated a structural concern at time of inspection.

4.4 CEILINGS (STRUCTURAL)

☑ NOT INSPECTED

Main story ceiling structure was not visible due to sheetrocked ceilings and insulation in the attic. Noted no substantial cracking at basement ceiling or main floor ceiling of 1/4" or more which would have indicated a structural concern at time of inspection

4.5 ROOF STRUCTURE AND ATTIC


☑ INSPECTED

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 5. PLUMBING SYSTEM




📋 DESCRIPTION

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

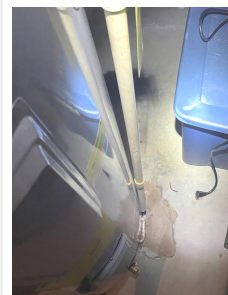




master bath >>>

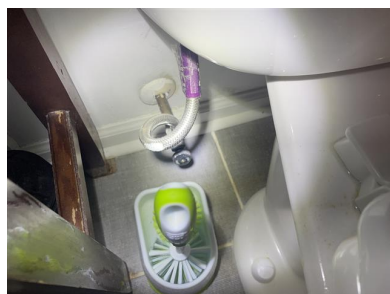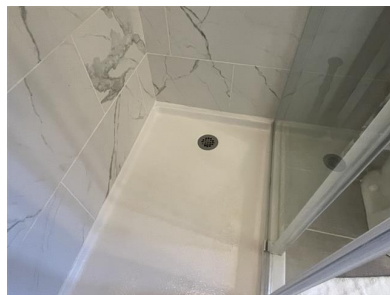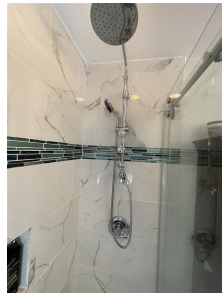

basement bath

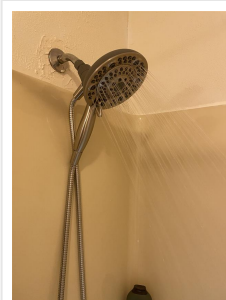



✂ STYLES & MATERIALS: PLUMBING SYSTEM

Water Source: Public	Water Filters: None	Plumbing Water Supply (into home): Not visible
Plumbing Water Distribution (inside home): Copper	Plumbing Waste (inside home): PVC ABS	Plumbing Waste Source: Public Sewer
Washer Drain Size: Not visible	Water Heater Power Source: Electric	Water Heater Capacity: 50 Gallon (2-3 people)
Water Heater Location: Basement Utility Room	Water Heater Manufacturer: STATE	Age of Water Heater: 1-5 years Extra Info : 2023

👁 ITEMS: PLUMBING SYSTEM


5.0 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

✔ INSPECTED

5.1 PLUMBING WATER SUPPLY, DISTRIBUTION SYSTEM AND FIXTURES

📋 INSPECTED, REPAIR OR REPLACE

(1) At master bath sink, the sink bowl needs to have caulking applied in certain areas where the sink bowl intersects the underside of the countertop. There appears to be "void" (gap) in various areas.

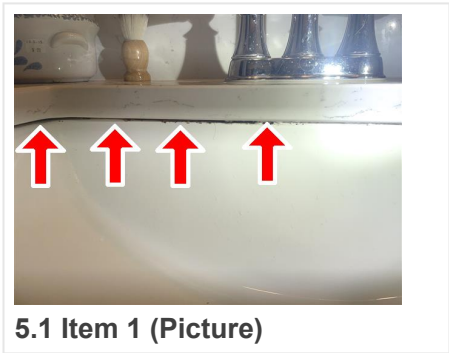

(2) The basement vanity sink drain stop rod is not connected to the drain stop. Recommend repair.



5.1 Item 2 (Picture)

(3) At basement bath, there was a minor leak coming from the valve handle to the bathtub. It stopped shortly after it started. This appears to be intermittent. Repair or replace if desired.



5.1 Item 3 (Picture)

5.2 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

☑ INSPECTED

Water heater has been recently replaced (and was functioning adequately) but there was no expansion tank installed at the water heater on the cold water pipe which enters the tank. Expansion tanks (or expansion valves) are generally required to be installed when a water heater is replaced after approx 2004, and the water is "metered" (supplied by the city/county/public system) This is not an immediate repair, but does need to be repaired by a plumber at some point..




5.2 Item 1 (Picture)

5.3 MAIN WATER SHUT-OFF DEVICE (DESCRIBE LOCATION)

☑ INSPECTED

The INTERIOR main water shut off is located in the unfinished basement utility room area. It may also be shut off outside at the water meter in front flower bed outside of kitchen window

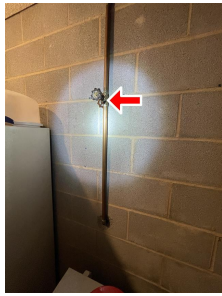

5.3 Item 1 (Picture)
knob at water pipe in unfinished basement area



5.3 Item 2 (Picture)
water meter at front flower bed outside of kitchen

5.4 VISIBLE/ACCESSIBLE SUMP PUMP/GRINDER PUMPS AND ALARMS

☑ NOT PRESENT

none noted

5.5 SEWER LINES/SEPTIC TANKS

☑ NOT INSPECTED








We do not inspect septic systems or sewer laterals, as these are underground and not visible. We noted no plumbing waste line clogs or backups after testing all plumbing fixtures.

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 6. ELECTRICAL SYSTEM

📋 DESCRIPTION

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

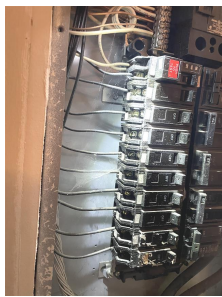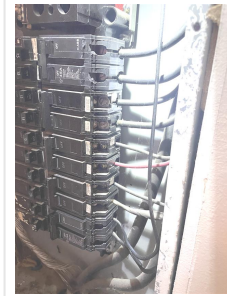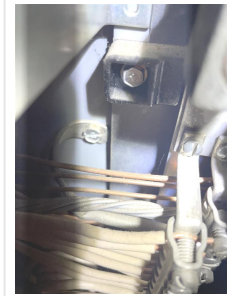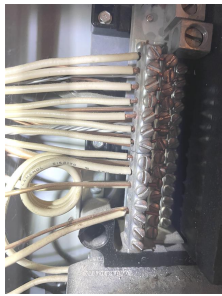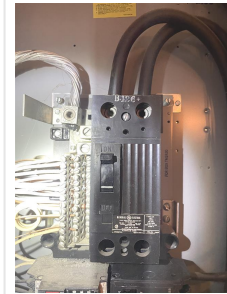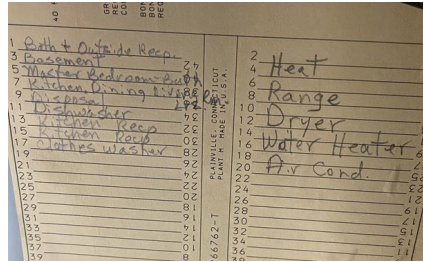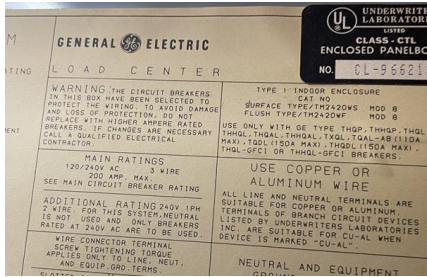

✕ STYLES & MATERIALS: ELECTRICAL SYSTEM

**Service Entry Cables/
Conductors:**

Below ground
Aluminum
220 volts

Main Panel Capacity:

200 AMP

Main Breaker Amps:

200

Subpanels:

None noted

Panel Type:

Circuit breakers
GFCI Breakers

Electric Panel Manufacturer:

GENERAL ELECTRIC

Branch wire 15 and 20 AMP:

Copper

Wiring Methods:

NM wiring - Romex or similar

Range/Oven Power Source:

220 Electric

Clothes Dryer Power Source:

220 electric

ITEMS: ELECTRICAL SYSTEM


6.0 SERVICE ENTRANCE CONDUCTORS

✓ INSPECTED

6.1 SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS

✗ INSPECTED, REPAIR OR REPLACE

Inside the electrical panel, the knock-out hole at the top of the panel needs to be covered with knock-out plate, and at the bottom of the panel, the service entrance cables from the meter need to have a bushing installed (the bushing is meant to protect the electrical cable insulation from chaffing against the metal of the box). Recommend repair by electrician if/when they are on site for other issues noted in this section.

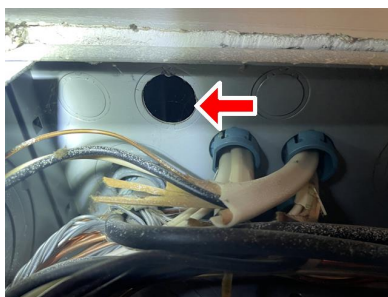

6.1 Item 1 (Picture)
hole at top



6.1 Item 2 (Picture)
bushing needed at service
entrance cables at bottom of
panel

6.2 BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATABILITY OF THEIR AMPERAGE AND VOLTAGE

✓ INSPECTED

6.3 CONNECTED DEVICES AND FIXTURES (OBSERVED FROM A REPRESENTATIVE NUMBER OPERATION OF CEILING FANS, LIGHTING FIXTURES, SWITCHES AND RECEPTACLES LOCATED INSIDE THE HOUSE, GARAGE, AND ON THE DWELLING'S EXTERIOR WALLS)

☐ INSPECTED, REPAIR OR REPLACE

(1) Rear exterior light at the the rear basement door did not function. This may be due to a burnet bulb. If bulb replacement does not rectify the issue, the light circuit will need evaluation by an electrician.

(2) At basement room which has the exterior door, the ceiling fan/light has 2 different light switches which can operate the fixture. One is at the entrance to the room, the other is next to the rear exterior door. This is called a 3-way circuit, and both switches can typically operate the ceiling fixture independently. However, in this room, one of the light switches has to be in the "on" position for the other light switch to function. This sometimes occurs when occupants over the years have changed out the fixture but incorrectly wired something at the fixture or at a light switch. This also appears to be occurring at the main level den. You may desire to have an electrician evaluate and correct the problem. The fixtures function, but it can be a nuisance to have to walk across the room to the "functional" light switch, depending upon your entry point into the room

6.4 POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, ALL RECEPTACLES IN GARAGE, CARPORT AND EXTERIOR WALLS OF INSPECTED STRUCTURE

☒ INSPECTED

6.5 OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)

☒ INSPECTED

As an FYI - due to the age of the home, the kitchen receptacles are not GFCI protected within 6 ft of the sink.. This means they will not trip to prevent shocks, as they do in more modern homes. Prior to 1987, they were not required in the kitchen. Home was built in 1984. If you desire, you may elect to have an electrician install GFCI receptacles in the kitchen. (However, BOTH bathrooms and the exterior front porch receptacle WERE GFCI protected and are on the same circuit)

6.6 OPERATION OF AFCI (ARC FAULT CIRCUIT INTERRUPTERS)

☒ NOT PRESENT

There are no ARC fault circuit breakers in this home due to its age.

6.7 LOCATION OF MAIN AND DISTRIBUTION PANELS

☒ INSPECTED

Main panel is in the basement room which has the door to the exterior.

6.8 SMOKE DETECTORS / CO DETECTORS

☐ INSPECTED




It would be prudent to replace all batteries in the smoke detectors. While doing this, if any smoke detector is older than 10 years old, it should be replaced, as it as at the end of its useful lifespan. There is typically a date on the back of the smoke detector. Newer detectors provide better safety. A smoke detector should be in: the den; the kitchen area, the master bedroom, both basement bedrooms,

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 7. HEATING / CENTRAL AIR CONDITIONING

📋 DESCRIPTION


The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

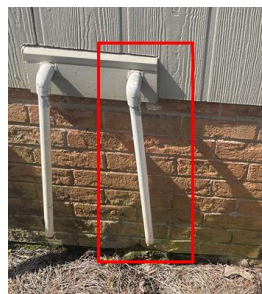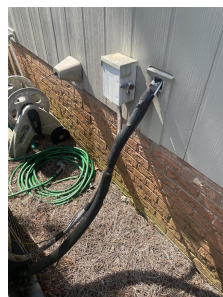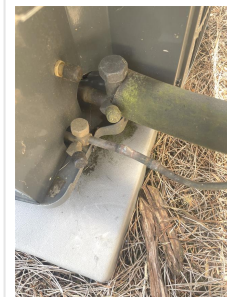


your HVAC condensate drain for the heat pump. - it was functioning (no current blockage inside the drain pipe)



air handler for heat pump in basement

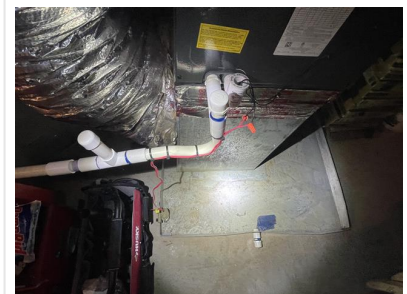

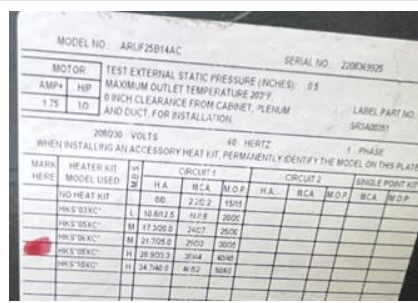

looking up metal flue liner from the fireplace

✂ STYLES & MATERIALS: HEATING / CENTRAL AIR CONDITIONING

Heat Type:

Heat Pump Forced Air (also provides cool air)

Heat System Manufacturer:

DAIKIN
GOODMAN

Filter Type:

Disposable

Number of Woodstoves:

None

Energy Source:

Electric
R-410 Refrigerant
Heat strips

Heat/AC Zoning/Multi-Zones:

No

Operable Fireplaces:

One

Cooling Equipment Type:

Heat Pump Forced Air (also provides warm air)

Number of Heat Systems (excluding wood):

One

Ductwork:

Insulated
Flex Ducting

Types of Fireplaces:

Insert
Solid Fuel

Cooling Equipment Energy Source:

Electricity
410 Refrigerant

Central Air (or AC only) Manufacturer: DAIKIN GOODMAN Age of HVAC Equipment: 1-5 years old Extra Info : 2022	Evaporator Coil Box(s): Not Opened/Sealed	Thermostat(s): 1 Thermostat Digital
---	---	--

ITEMS: HEATING / CENTRAL AIR CONDITIONING

7.0 HEATING EQUIPMENT

INSPECTED

7.1 NORMAL OPERATING CONTROLS

INSPECTED

7.2 AUTOMATIC SAFETY CONTROLS

INSPECTED

7.3 DISTRIBUTION SYSTEMS INCLUDING FANS, PUMPS, DUCTS AND PIPING, WITH SUPPORTS, INSULATION, AIR FILTERS, REGISTERS, RADIATORS, FAN COIL UNITS, CONVECTORS, AUTOMATIC DAMPER SYSTEMS)

INSPECTED, REPAIR OR REPLACE

(1) All air filters need replacement (1 on main floor and 1 at basement ceiling)



7.3 Item 1 (Picture)
main floor



7.3 Item 2 (Picture)
basement ceiling

(2) Battery needs to be replaced in the digital thermostat.



7.3 Item 3 (Picture)

7.4 PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM

☑ INSPECTED

7.5 CHIMNEYS, FLUES AND VENTS (FOR FIREPLACES, GAS WATER HEATERS OR HEAT SYSTEMS)

☑ INSPECTED

As a precaution, it may be prudent to have a chimney sweep evaluate the metal flue liner for the fireplace to ensure no rust at the chimney cap has worn through the aluminum cap and to ensure that all connection joints in the flue liner are tight. I was able to visually see the flue liner from the attic scuttle hole, but did not do an in-depth inspection of the flue liner. I was also able to see the termination cap when looking up into the metal liner from the fireplace - no obstructions were noted. Some HOA's have a contract with a chimney sweep to do this since the safety of the units is dependent upon the flues being kept in good condition. I am unsure if your HOA does this or not.



7.5 Item 1 (Picture)
looking up liner from fireplace



7.5 Item 2 (Picture)
damper was operable

7.6 SOLID FUEL HEATING DEVICES (FIREPLACES, WOODSTOVE)

☑ INSPECTED

7.7 COOLING AND AIR HANDLER EQUIPMENT

☑ INSPECTED

7.8 NORMAL OPERATING CONTROLS

☑ INSPECTED

7.9 PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM

☑ INSPECTED

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 8. INSULATION AND INTERIOR VENTILATION

📋 DESCRIPTION

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.

✂ STYLES & MATERIALS: INSULATION AND INTERIOR VENTILATION

Floor System Insulation:

Batts
Fiberglass
Extra Info : Only visible in unfinished basement area

Wall Insulation:

Fiberglass
Extra Info : Only visible in unfinished basement area

Attic Insulation:

Blown
Fiberglass

Interior Exhaust Fans (Bathrooms/kitchens/etc):

None
Extra Info : Master bath ot required to have fan since there is an operable window

Kitchen Range/Cooktop Ventilation:

Recirculating

Dryer Vent:

Flexible Metal
Extra Info : Flex foil

👁 ITEMS: INSULATION AND INTERIOR VENTILATION

8.0 INSULATION UNDER FLOOR SYSTEM

☑ INSPECTED

8.1 INSULATION IN WALLS

☑ INSPECTED

8.2 INSULATION IN ATTIC


☑ INSPECTED

8.3 VENTING SYSTEMS (KITCHENS, BATHS AND LAUNDRY)

📋 INSPECTED, REPAIR OR REPLACE

At basement bathroom, it is an interior bathroom (no window) and does not have an exhaust fan installed. This is unusual, as bathrooms which include a shower (but no window) typically have been required to have fans for decades. There could be several reasons for this. 1) This issue may go back to the original build, and it was just never installed. 2) There may be a fan pipe in the ceiling, but the light in the bathroom did not have a fan installed. If this is the case, the light can simply be switched out for a fan/light, BUT there was only 1 vent termination noted at the rear of home, and the adjacent unit appears to have 2 vents at the exterior. The vent termination at the exterior rear wall may have been covered up with newer siding, and the termination vent at the rear wall would need to be relocated to properly vent to the exterior. (Seller stated that there was no fan when they bought it)

Additionally regarding the laundry dryer vent - When looking behind the dryer, there was an excessive amount of lint. I then noted that the flexible vent pipe behind the dryer has a significant hole in it. This flexible dryer hose can obviously be replaced, BUT my concern is this: Due to this hole in the dryer vent, I could not test the dryer vent to determine if the singular vent termination at the rear exterior wall is for the dryer or the bath fan. Further verification will be needed to determine if the singular vent pipe at the rear is for the dryer or the bath vent (unit next door appears to have 2 vents instead of 1, assuming the adjacent unit has the same floor plan) The repair method for the basement bathroom vent and dryer vent will be determined upon further verification of both of these areas. Repair of the dryer vent and operation of the dryer may be the easiest way to determine what this singular vent is connected to (assuming the dryer vent is not clogged inside the wall or ceiling) NOTE: the laundry room and basement bath are aligned back to back, so it should be relatively easy to find out what steps need to be taken by opening up the bathroom ceiling. The laundry vent pipe should run above the bathroom ceiling as well.

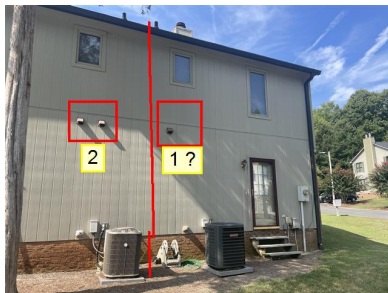**8.3 Item 1 (Picture)****8.3 Item 2 (Picture)**
light in basement bath - no fan noted**8.3 Item 3 (Picture)**
hole in vent flex pipe behind the dryer

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

🏠 9. BUILT-IN KITCHEN APPLIANCES/LAUNDRY AREA(S)

DESCRIPTION

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.





range/cooktop >>>



Microwave >>>



Dishwasher >>>

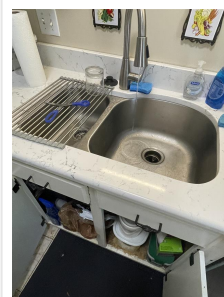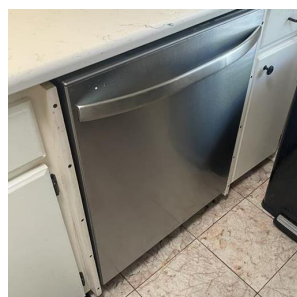

kitchen sink >>>



ITEMS: BUILT-IN KITCHEN APPLIANCES/LAUNDRY AREA(S)

9.0 DISHWASHER


INSPECTED

The dishwasher drain hose under the sink which attaches to the disposal needs to be elevated to a height just above the bottom of the sink and attached to the backside cabinet wall with a metal strap. This is called a "high loop" and it prevents water from the disposal from draining back into the dishwasher basin. This is a minor repair.

The dishwasher drain hose was not installed as to create a trap under sink.(known as a "high loop") The high loop prevents grey water and debris from disposal from running back to he dishwasher drain basin. Grey water which sits in the dishwasher basin can create mildew and foul smells inside the dishwasher. Repair recommended.



9.0 Item 1 (Picture)

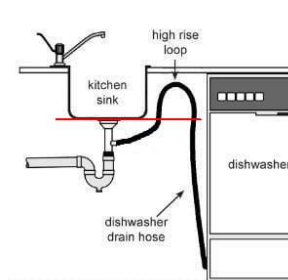

9.0 Item 2 (Picture)

9.1 RANGES/OVENS/COOKTOPS

INSPECTED

9.2 RANGE HOOD (S)

INSPECTED

9.3 FOOD WASTE DISPOSER

INSPECTED

9.4 MICROWAVE COOKING EQUIPMENT

INSPECTED

9.5 REFRIGERATOR

☑ NOT INSPECTED

Not inspected - seller said refrigerator is not transferring.

9.6 CLOTHES WASHER/ DRYER

☑ INSPECTED, NOT INSPECTED

Partial inspection - I did not operate the clothes washer or dryer. These are not considered built-in appliances and typically do not convey (seller stated they are not transferring). I DID view the washer connections behind these units. No water leak stains were noted



9.6 Item 1 (Picture)



9.6 Item 2 (Picture)

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.