

QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 22/07/2026

Our Ref: 00041103/PHILB

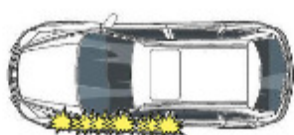
Your Ref: 47022/1

To the Court REPAIRABLE REPORT

Dear Sirs,

Client: **Mrs Pam Aldington**

We refer to your instructions received on **21 July 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: SUZUKI VITARA SZ-T BOOSTERJET MH		Colour: White	Speedo:	Miles
Reg No: VU22RZH	Registered: Mar 2022	Type: 5 Door Hatchback	Trans: Manual	
Vin No: TSMLYDD1S00A27424	MOT Exp:	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno	
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested	
Audio: Not Seen	Manf'd: 2022			Spare Tyre
Brakes: Not Known	Tax Exp:			Not Know
Steering: Not Known	Fuel:			Centre Belt
Extras: Not Seen	C.C.: 1373			Not Tested
Air Bags Deployed: Not Known	BHP: 127.	L/H/F Belt Not Tested	L/H/R Belt Not Tested	
Damage: Light to Moderate Collision/Impact LH Side	Incident: 19/07/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno	
Vehicle Value: £13,895.00		Repair Cost: £4,537.08 inc VAT	(32.65% of PAV) Roadworthy: Yes	

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light to moderate collision/impact damage to the left hand side.

ENGINEER'S COMMENTS

The engineer has inspected this vehicle from images supplied by the principal only, the repair costs have been based on the images received and therefore may not be accurate if further damage is found, condition details and service records have not been checked in relation to the pre-accident value

VEHICLE HISTORY CHECK

22/07/2026 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-L/F Wing Moulding, Left Front Door, L/F Door Mldg Set, L/F Inner Door Foil, L/F Upp Door Mldg, L/R Inner Door Foil, L/Sill Moulding, Panel Sundries, Car Care Kit, Sundry Parts

Repairable parts:-L/F Wing, L/R Door

Repaint only parts:-Left Front Door New Part Painting, L/F Wing Repair Painting <50%, L/R Door Repair Painting <50%, Preparation For Pre-Painting

Specialist/Sundry charges:-Bsi Compliance, Hybrid Recharge, Epa, Pas 2060 / Aries, Repair Methods, Corrosion

Protection Materials External

Remove And Refit parts:-Description, L/F Wing Moulding, Renew L/F Door, L/R Outer Door Channel Moulding, Left Rear Door Trim, L/R Inner Door Foil, L/R Outer Door Handle, L/Sill Moulding, Corrosion Prote To 3 Panels

Parts to check:-Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vacuum, Power Down Ev/Hybrid, Electric Risk Assess

COST OF REPAIRS

No estimate has been obtained for repairing the vehicle but, **subject to further damage found during dismantling**, we have calculated the time involved in such a repair using Audatex and we consider that a reasonable labour charge would be £1,965.41. The cost of the paint and materials would be £796.46, The cost of the replacement parts would be approximately £824.13, The specialist/sundry charges would be £194.90, and the VAT liability on the total would amount to some £756.18 giving a total repair cost of £4,537.08 including VAT **subject to undisclosed damage**. The labour charge is based on 23.6 hours at a rate of £83.28 per hour.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 03/03/2022. The corresponding CAP Guide (model code: 9178) adjusted retail value for vehicles of this type and age in the July 2026 guide is £13,895.00 at 15000 Miles, trade value is £11,500.00 and mid value is £12,697.50. We place the pre-accident value of this particular vehicle at £13,895.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £4,550.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We confirm that we have not authorised repairs on your behalf and our actions in this matter remain without prejudice.

REPAIR DURATION

We consider that this repair will take some 6 to 7 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy.

The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of



Chris O'Hare AMIMI IMI VDA
Exclusive Vehicle Assessors



CLVOSdamage-V1.jpeg



2_CLVOSdamage-V1-2.jpeg



3_CLVOSdamage-V1-3.jpeg



4_CLVOSdamage-V1-4.jpeg