

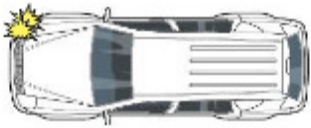
Emma Gascoigne
Waterside Lodge
Oakwood Park
Selby
YO8 5DB

Date: 10/03/2026
Our Ref: 00031953/DME
Your Ref: EHR97778

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Emma Gascoigne**

We refer to your instructions received on **10 March 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: BMW X7 M50I AUTO		Colour: Black	Speedo: 49020 Miles
Reg No: X55ELG	Registered: Sep 2021	Type: 5 Door Estate	Trans: Automatic
Vin No: WBACX620009H89898		MOT Exp: 	R/H/F Tyre Not Kno R/H/R Tyre Not Kno
Mods: Not Seen	Cond: Unknown	R/H/F Belt Not Tested	R/H/R Belt Not Tested
Audio: Not Seen	Manfd: 2021		
Brakes: Not Known	Tax Exp: 		
Steering: Not Known	Fuel: Petrol		
Extras: Not Seen	C.C.: 4395		
Air Bags Deployed: Not Deployed	BHP: 523	L/H/F Belt Not Tested	L/H/R Belt Not Tested
Damage: Light to Moderate Collision/Impact RH Front	Incident: 03/03/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno
Vehicle Value: £53,656.00		Repair Cost: £12,034.22 inc VAT (22.43% of PAV)	Roadworthy: No

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF DAMAGE

The vehicle has suffered light to moderate collision impact to the right hand front.

ENGINEER'S COMMENTS

I can confirm repairs have been authorised via Audatex in accordance with your original instructions.

Authority sent via Audatex.

VEHICLE HISTORY CHECK

10/03/2026 - According to the Experian database; there is a plate change on record

REPAIR SCHEDULE

New parts required:- R/Bumper Air Grille, L/Bump Air Grille Cv, R/F Outer Trim, R/Fog Lamp Cover, R/F Lwr Bumper Cap, R/Inn U-Sonic Sender, R/F Ctr Sensor Brkt, L/F Sens Inn Brkt, R/F Fog Lamp, R/Fog Lamp Bracket, Sundries



Repairable parts:-Repair Sundries Panel, Repair Front Bumper

Repaint only parts:-Front Bumper Repair Paint Plastic, Frt Ctr Bumper Trim Surface Paint Plast., Frt Towing Eye Cover surface Paint Plast., Machine Polish, Pre-Painting Sundry Materials, Preparation for Pre-Painting

Specialist/Sundry charges:-Energy Payment, Adas-Methods, Adas Reset, Methods Research, E.P.A. Charge, Car Care Kit

Remove And Refit parts:-Add/Time For Main Work, Front Bumper Trim, L/F Ultrasonic Converter, R/F Ultrasonic Converter, Front Bumper Lwr Air Intake Grill, Front Centre Bumper Trim, L/F Bumper Air Grille, R/F Bumper Air Grille, Front Number Plate, R/F Lower Bumper Cover, R/F Wheelhouse Liner Front, R/F Fog lamp, Align Front Fog Lamps, Right Front Wheel, L/Bump Air Grille Cv, Polish O/S Headlamp, Post calibration Extensive-Road-Test, Pre And Clean Car

Parts to check:-Check Wash & Vac, Check Road test-QC, Check Vehicle Diag Pre Check, Check Vehicle Diag Post Check, Check Iir-Adas

COST OF REPAIRS

An Audatex estimate has been obtained from Atkinsons Body Repair, Unit 4 Windmill House Ind Est, Sutton Road, York, YO23 2RA (Tel. 01904765948) in the sum of £1,937.53 labour plus parts at manufacturer's list prices plus £857.65 for paint and materials plus £531.94 for specialist/sundry charges. Having calculated the time involved in this repair I consider this to be reasonable and I have agreed with the repairers that there will be a reduction of £351.26 to £506.39 for paint and materials in their final account. The labour charge is based on 18.8 hours at a rate of £103.06 per hour. I have also agreed that the cost of paint and materials will be limited to £506.39. The cost of the necessary replacement parts will be approximately £761.82, the specialist/sundry charges will be £461.94, the VAT liability on this repair will amount to some £733.54 giving a total repair cost of £4,401.22 including VAT **subject to any undisclosed damage. I am pleased to confirm that I have achieved total gross savings in this matter of £7,863.85.**

OTHER DAMAGE

I noted the following damage on the vehicle:- None noted.

REPAIRER VAT STATUS

I am informed that the repairer is registered for VAT

PRE-INCIDENT VALUE

According to the information available to me the vehicle was first registered in 03/09/2021.

The corresponding Glass's Guide retail value for vehicles of this type and age in the March 2026 guide is £53,656.00 at 49000 Miles, trade value is £44,142.00.

I place the pre-accident value of this particular vehicle at £53,656.00 bearing in mind the condition described herein.

RESERVE

I consider that a repair reserve of £4,425.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

Authorised via Audatex 10/03/2026.

REPAIR DURATION

I consider that this repair will take some 5 to 6 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In my opinion this vehicle was not roadworthy at the time of my inspection as a result of the damage sustained.

INSTRUCTIONS ISSUED

I am pleased to confirm that I have authorised the repairers to proceed with the work via Audatex in accordance with your instructions, on the 10th March 2026, on your behalf.

REPAIR DURATION

I consider that this repair will take some 5 to 6 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In my opinion this vehicle was not roadworthy at the time of my inspection as a result of the damage sustained.

For & on behalf of

A handwritten signature in black ink that reads "TIM CLARKE". The signature is written in a cursive, slightly slanted style.

Tim Clarke IMI VDA Accreditation, C.A.E., M.I.M.I.
Exclusive Vehicle Assessors