

Mrs Dawn Beckwith
15 Park Hill
Barnoldswick
BB
Barnoldswick
BB18 5BU

Date: 27/04/2026
Our Ref: 00034435/JEFFP
Your Ref: EHR99795


To the Court **REPAIRABLE REPORT**

Dear Sirs,

Client: **Mrs Dawn Beckwith**

We refer to your instructions received on **15 April 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: AUDI A1 S LINE 25 TFSI	Colour: BLACK	Speedo: 18000 Miles
Reg No: BL23LRO	Registered: Jul 2023	Type: 5 Door Hatchback
Vin No: WAUZZZGB5PR058570	MOT Exp: 	R/H/F Tyre Not Kno
Mods: Not Seen	Cond: Good	R/H/R Tyre Not Kno
Audio: Not Seen	Manf'd: 2023	R/H/F Belt Not Tested
Brakes: Not Known	Tax Exp: 	R/H/R Belt Not Tested
Steering: Not Known	Fuel: Petrol	Spare Tyre Not Know
Extras: Not Seen	C.C.: 999	Centre Belt Not Tested
Air Bags Deployed: Not Known	BHP: 93.7	L/H/F Belt Not Tested
Damage: Collision/Impact	Incident: 20/03/2026	L/H/R Belt Not Tested
		L/H/F Tyre Not Kno
		L/H/R Tyre Not Kno

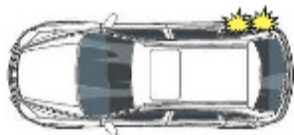

Vehicle Value: £18,706.00	Repair Cost: £2,935.26 inc VAT (15.69% of PAV)	Roadworthy: Yes
----------------------------------	---	------------------------

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light to moderate collision/impact damage to the right hand rear bumper, and light to moderate collision/impact to the right hand rear quarter panel.

VEHICLE HISTORY CHECK

According to the Experian database; there is a plate change on record

REPAIR SCHEDULE

New parts required:-R/R Protection Foil, Pre Cleaning Charge, Wash And Vacuum, Roade Test And Qi, Post Diagnostic, Car Care Kit, Panel Sundries, Sundry Parts

Repairable parts:-Rear Bumper, R/R Side Panel

Repaint only parts:-Two Coat Pearl/Mica, Rear Bumper Repair Paint Plastic, R/R Side Panel Repair Painting <50%, De Nib & Polish.Per Panel, Preparation For Pre-Painting

Specialist/Sundry charges:-Adas Methods, E.P.A. Charge, Tech Data + Methods, Car Care Kit

Blend only parts:-R/R Door Lower Surface Paint

Remove And Refit parts:-Description, Right Rear Door Trim, R/R Outer Window Channel Seal, Right Rear Door Handle, Rear Bumper Cover, Rear Bumper Lower Centre Spoiler, Renew R/R Wheelarch Protective Foil, Pre Cleaning Charge R&R / New Parts, Wash And Vacuum R&R / New Parts, Roade Test And Qi R&R / New Parts, Post Diagnostic R&R / New Parts



Parts to check:-Pre Rep Diag Scan, Adas Exploration

COST OF REPAIRS

The repairers, Select Autobodyes (Tel. 01282844110), have compiled an estimate in the sum of £1,607.74 plus parts at manufacturer's list prices plus £682.37 for paint and materials plus £117.64 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be reasonable. The labour charge is based on 15.6 hours at a rate of £103.06 per hour. We have also agreed that the cost of paint and materials will be limited to £682.37. The cost of the necessary replacement parts will be approximately £38.30, the specialist/sundry charges will be £117.64, the VAT liability on this repair will amount to some £489.21 giving a total repair cost of £2,935.26 including VAT **subject to any undisclosed damage.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 10/07/2023. The corresponding Cazana Guide (model code: 4561307) adjusted retail value for vehicles of this type and age in the March 2026 guide is £18,706.00 at 18000 Miles, trade value is £17,396.00 and mid value is £18,051.00. We place the pre-accident value of this particular vehicle at £18,706.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £2,950.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 27th April 2026, on your behalf.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy. **The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.** We understand that the vehicle is still being used by the owner.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. Connexus Hire Solutions commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of



Jeff Parr CAE AMIMI
Exclusive Vehicle Assessors