

Tel: 01925 403405
Fax: 0845 077 0806
Email: engineer@connexus.co.uk

Mr S Butt
76 Saywell Road
Luton
LU20QF

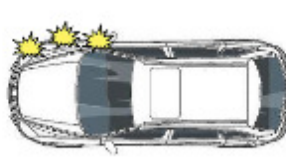
Date: 31/03/2026
Our Ref: 00078094/PK
Your Ref: EHR990049

Engineer Repairable Report

Dear Sirs,

Client/Insured: **Mr S Butt**

We refer to your instructions received on **27 March 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: FORD FIESTA TITANIUM TDCI	Colour: BLUE	Speedo: 89157	Miles
Reg No: PA55TBC	Registered: Mar 2018	Type: 3 Door Hatchback	Trans: Manual
Vin No: WF0FXXGAHFJL76536	MOT Exp:	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested
Audio: Not Seen	Manf'd: 2018		
Brakes: Not Known	Tax Exp:		
Steering: Not Known	Fuel: Diesel		
Extras: Not Seen	C.C.: 1499		Spare Tyre Not Know
Air Bags Deployed: Not Known	BHP: 118	L/H/F Belt Not Tested	L/H/R Belt Not Tested
Damage: Light to Moderate Collision/Impact RH Front Bumper	Incident: 26/03/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno
Vehicle Value: £5,769.00	Repair Cost: £2,940.96 inc VAT	(50.98% of PAV)	Roadworthy: No

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light to moderate collision/impact damage to the right hand front bumper, to the wing, and to the door

VEHICLE HISTORY CHECK

27/03/2026 - According to the Experian database; there is a plate change on record

REPAIR SCHEDULE

New parts required:-Front Bumper, R/F Bumper Bracket, Air Deflector, R/F Upper Reinforcer , Badge, R/Headlamp Cpl, R/F Wing, R/F Wing Insulator, R/F Inn Wing Bracket, R/F Upper Wing Bracket, R/F Wheelhouse Cover

Repairable parts:-Repair R/Door Lower

Repaint only parts:-R/F Wing New Part Painting, R/Door Lower Repair Painting <50%, Preparation for Pre-Painting

Specialist/Sundry charges:-E.P.A. Charge, To Clean Car, Pre Rep Diag Check, Tech Data + Methods, Post Rep Diag Check, Bsi10125 Compliance, Sundry Part

Remove And Refit parts:-Add/Time For One Main Position, Alignment Cpl Before Repair, Front Bumper, Replace Front Bumper Bar, Right Headlamp, Adjust Headlamps, Renew R/Headlamp (Removed), R/Wing, Front Right Bumper Bracket, R & R Front Right Wings Inner Bracket, R/F Door Trim, Right Front Outer Door Handle, R/F Outer Door Channel Moulding, R/Outer Mirror, Specialist And Road Test

COST OF REPAIRS

The repairers, Premier Body Repairs, have compiled an estimate in the sum of £504.00 plus parts at manufacturer's list prices plus £434.65 for paint and materials plus £333.85 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be low and we have agreed an amended labour figure of £558.00. The labour charge is based on 9.3 hours at a rate of £60.00 per hour. We have also agreed that the cost of paint and materials will be limited to £464.66. The cost of the necessary replacement parts will be approximately £1,117.04, the specialist/sundry charges will be £311.10, the VAT liability on this repair will amount to some £490.16 giving a total repair cost of £2,940.96 including VAT **subject to any undisclosed damage. We are pleased to confirm that we have achieved total gross savings in this matter of £27.30.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 01/03/2018. The corresponding Glass's Guide (model code: 269044001) adjusted retail value for vehicles of this type and age in the March 2026 guide is £5,769.00 at 89157 Miles, trade value is £3,696.00 and mid value is £4,732.50. We place the pre-accident value of this particular vehicle at £5,769.00 bearing in mind the condition described herein.

RESERVE

We consider that a repair reserve of £2,950.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 31st March 2026, on your behalf.

REPAIR DURATION

We consider that this repair will take some 3 to 4 working days to complete. This would be subject to the availability of parts and any extra repairs found once the repairs commence.

ROADWORTHY STATE

In our opinion this vehicle was not roadworthy at the time of our inspection as a result of the damage sustained due to Wing crushed bumper hanging off. We understand that the vehicle is not currently being used by the owner.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. Exclusive Repair Network commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of



Phil Kendrick AQP CAE AMIMI
Connexus Vehicle Assessors