

Mr Fabian Brown
34 Brook Crescent
London
N
N9 0DJ


Date: 27/05/2026
Our Ref: 00036622/HASSANA
Your Ref: EHR101777

To the Court
REPAIRABLE REPORT

Dear Sirs,

Client: **Mr Fabian Brown**

We refer to your instructions received on **19 May 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

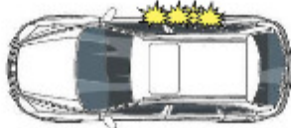Vehicle:	JAGUAR I-PACE EV400 SE	Colour:	Silver	Speedo:	47829	Miles
Reg No:	BP21JVK	Registered:	Jun 2021	Type:	5 Door Hatchback	Trans: Automatic
Vin No:	SADHA2A1XM1606963	MOT Exp:		R/H/F Tyre	Not Kno	R/H/R Tyre Not Kno
Mods:	Not Seen	Cond:	Good	R/H/F Belt	Not Tested	R/H/R Belt Not Tested
Audio:	Not Seen	Manfd:	2021			Spare Tyre
Brakes:	Not Known	Tax Exp:				Not Known
Steering:	Not Known	Fuel:	Electric			Centre Belt
Extras:	Not Seen	C.C.:	0			Not Tested
Air Bags Deployed:	Not Known	BHP:	394.	L/H/F Belt	Not Tested	L/H/R Belt Not Tested
Damage:	Moderate Collision/Impact RH Side	Incident:	11/05/2026	L/H/F Tyre	Not Kno	L/H/R Tyre Not Kno
Vehicle Value: £14,306.00		Repair Cost: £4,371.44 inc VAT		(30.56% of PAV)		Roadworthy: Yes

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the right hand side.

VEHICLE HISTORY CHECK

27/05/2026 - According to the Experian database; According to the Experian database; There is a plate change on record. See plate change details.

REPAIR SCHEDULE

New parts required:-R/F Door Moulding, R/Manufacturer Badge, R/R Door Moulding, Car Care Kit, Sundry Parts

Repaint only parts:-Three Coat Pearl, R/F Door Moulding New Part Paint K1r, R/F Door W/O Frame Repair Painting <50%, R/R Door W/O Frame Repair Painting <50%, De Nib & Polish. Per Panel, Preparation For Pre-Painting

Specialist/Sundry charges:-Adas Methods, Wheel Alignment, E.P.A. Charge, Tech Data + Methods, Car Care Kit

Remove And Refit parts:-Description, Additional Time For Separate Workshop, Right Mirror, R/F Outer Door Channel Moulding, R/F Lower Door Moulding, Cover Mldg R/R Door, R/R Ctr Door Handle Bezel, R/R Lower Door



Moulding

Parts to check:-Adas Exploration, Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vacuum, Est Pre Wash

COST OF REPAIRS

The repairers, A R T Vehicle Solutions (Tel. 01992 536362), have compiled an estimate in the sum of £1,812.17 plus parts at manufacturer's list prices plus £1,035.25 for paint and materials plus £237.06 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be reasonable. The labour charge is based on 15.29 hours at a rate of £118.52 per hour. We have also agreed that the cost of paint and materials will be limited to £1,035.25. The cost of the necessary replacement parts will be approximately £558.39, the specialist/sundry charges will be £237.06, the VAT liability on this repair will amount to some £728.57 giving a total repair cost of £4,371.44 including VAT **subject to any undisclosed damage.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 05/06/2021. The corresponding CAP Guide (model code: 93195) adjusted retail value for vehicles of this type and age in the May 2026 guide is £14,306.00 at 47829 Miles, trade value is £12,050.00 and mid value is £13,178.00. We place the pre-accident value of this particular vehicle at £14,306.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £4,375.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 27th May 2026, on your behalf.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE


In our opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy. **The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.**

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. Connexus Hire Solutions commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of

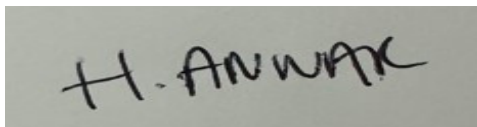

Hassan Anwar ATA VDA
Exclusive Vehicle Assessors