

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

REPAIRABLE REPORT

Dear Sirs


RE: Road traffic Accident: Shirley Osowiecki: 16/07/2022


In accordance with your instructions received on 25/07/2022 requesting us to provide an independent accident damage report, we assessed the damage on 26/07/2022. Vehicle located at Image based assessment. Our findings are as detailed below:

Make	KIA	Registration	DX71UUT
Model	NIRO 3 HEV S-A	Status	Repair
Category		Salvage Value	
Repair Cost	£5,547.19	Legal Status	Unroadworthy
Engineer Value	£24,500.00	Impact Magnitude	Moderate to Heavy



Impact Area

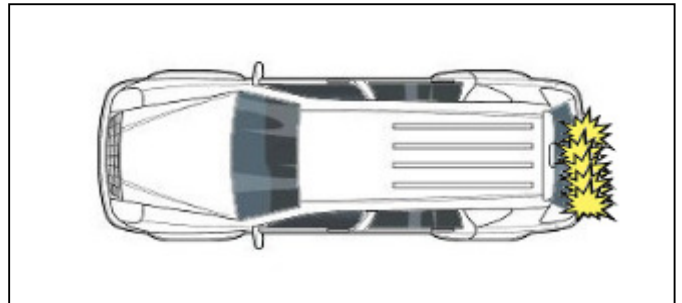

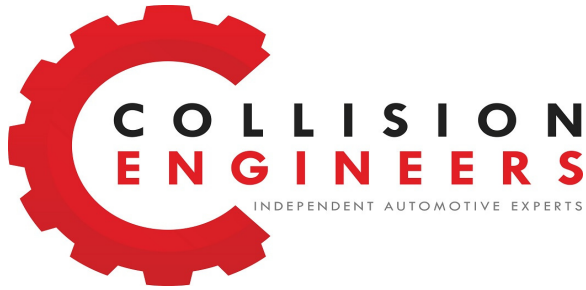

Our Ref: qdos221239

Your Ref: SM/13838/1

Date: 27/07/2022

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate to heavy collision/impact damage to the rear.

ENGINEER'S COMMENTS

Valuation based on average mileage

27/07/2022 - Please note the vehicle is unroadworthy as the rear body has been compromised.

23/08/2022 - UPDATED REPORT. The vehicle has been repaired and additional damage has been found necessitating replacement of the NSR outer lamp, the tow eye cover and both reinforcement crash ends. Furthermore, parts prices have now been confirmed. The vehicle remains economically repairable and the damage is consistent with the original impact.

VEHICLE HISTORY CHECK

26/07/2022 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

PRE-INCIDENT CONDITION


The vehicle is considered to be in good condition for its age and type.

RESERVE

We consider that a repair reserve of £5,550.00 would be reasonable on this occasion.

Vehicle Data

Retail Value	£24,500.00
Trade Value	£22,250.00
Engineer's Value	£24,500.00
Glass's Code	
VIN	KNACC81CVM5487125
Odometer	
Engine	1580
Fuel	
Extras	
Condition	Good
Unrelated Damage	

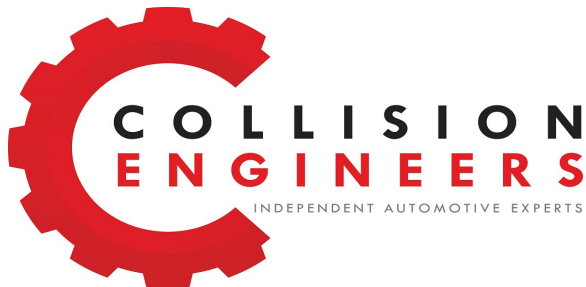

Our Ref: qdos221239

Your Ref: SM/13838/1

Date: 27/07/2022

Main new parts required

Rear Bumper Lining
Rear Bumper Reinforcement
Left Rear Bumper Side Stoneguard
Rear Bumper Lower Support
Right Rear Bumper Lower Support
Right Rear Bumper Outer Bracket
Right Rear Bumper Outer Side Distance-Sensor
Right Rear Bumper Inner Side Distance-Sensor
Right Side Rear Fog Lamp, Complete
Right Rear Fog Lamp Ring/Cover
Right Number Plate Lamp
Tailgate
Left Side Type Designation
Rear Window Repair/Bonding Kit
Left Rear Window Spacing Block/Sleeve
Left Rear Window Upper Spacing Block/Sleeve
Left Rear Window Lower Spacing Block/Sleeve
Tailgate/Boot Lid Trim Support Kit

Rear Bumper Spoiler
Rear Bumper Protection Trim
Right Rear Bumper Side Stoneguard
Left Rear Bumper Lower Support
Left Rear Bumper Outer Bracket
Left Rear Bumper Outer Side Distance-Sensor
Left Rear Bumper Inner Side Distance-Sensor
Left Side Rear Fog Lamp, Complete
Left Rear Fog Lamp Ring/Cover
Left Number Plate Lamp
Rear Panel
Boot Lid/Back Door/Tailgate Badge
Right Side Emblem (Engine Designation)
Rear Window Spacing Block/Sleeve
Right Rear Window Spacing Block/Sleeve
Right Rear Window Upper Spacing Block/Sleeve
Right Rear Window Lower Spacing Block/Sleeve
Tailgate/Boot Lid Trim Clip

Additional operations

Jig set up, clamp and pull
System Diagnostic Check (Post Repair)
Car Care Kit
De-Nib/Polish
Final Inspection & Road Test
Paint Left Rear Side Panel, Complete
Paint Tailgate (with Window Frame)
Paint Left Rear Bumper Side Moulding
Paint Prep. metal (on vehicle without pre-painting)
Paint Colour mixing (1)

Repair Method Research Allowance
System Diagnostic Check (Pre Repair)
Check and adjust four wheel alignment
Environmental Charge
Wash/Clean
Paint Right Rear Side Panel, Complete
Paint Rear Panel, Complete
Paint Right Rear Bumper Side Moulding
Paint Prep. synthetics (combined-operation work)
Paint Sample colour creation (1)

Repair Cost Calculations

Hours	24.40
Hourly Rate	£62.50
Total Labour	£1,525.00
Parts	£2,100.42
Paint/Materials	£757.24
Specialist/Other	£240.00
Sub total	£4,622.66
Vat	£924.53
Total Estimated Cost	£5,547.19



ClientVehicleImage2jpeg-V1.jpeg



ClientVehicleImage3jpeg-V1.jpeg



ClientVehicleImage4jpeg-V1.jpeg



ClientVehicleImage5jpeg-V1.jpeg



ClientVehicleDamage1jpeg-V1.jpeg



ClientVehicleDamage2jpeg-V1.jpeg



ClientVehicleDamage3jpeg-V1(1).jpeg



ClientVehicleDamage4jpeg-V1.jpeg



ClientVehicleDamage6jpeg-V1.jpeg



ClientVehicleDamage7jpeg-V1.jpeg



ClientVehicleDamage9jpeg-V1.jpeg




ClientVehicleDamage10jpeg-V1.jpeg



ClientVehicleDamage12jpeg-V1.jpeg



ClientVehicleDamage13jpeg-V1(1).jpeg

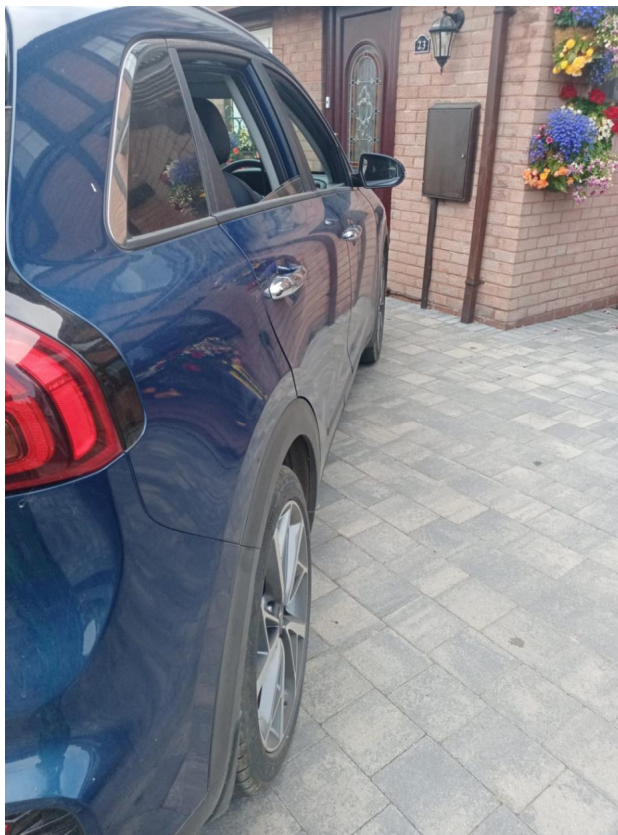

ClientVehicleDamage15jpeg-V1.jpeg



ClientVehicleDamage16jpeg-V1.jpeg



ClientVehicleDamage17jpeg-V1.jpeg



ClientVehicleDamage14jpeg-V1.jpeg



ClientVehicleDamage11jpeg-V1.jpeg




ClientVehicleDamage8jpeg-V1.jpeg



ClientVehicleDamage5jpeg-V1.jpeg



ClientVehicleImage1jpeg-V1.jpeg

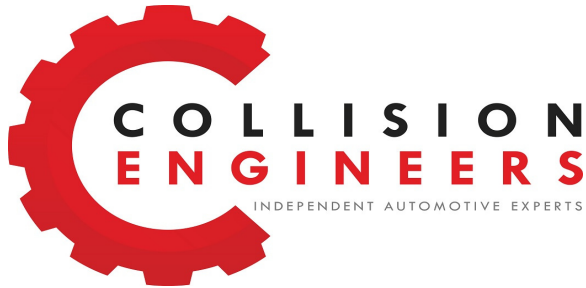

Our Ref: qdos221239

Your Ref: SM/13838/1

Date: 27/07/2022

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully



A Patterson - A Patterson M.Inst.IAEA
engineers@collisionengineers.co.uk

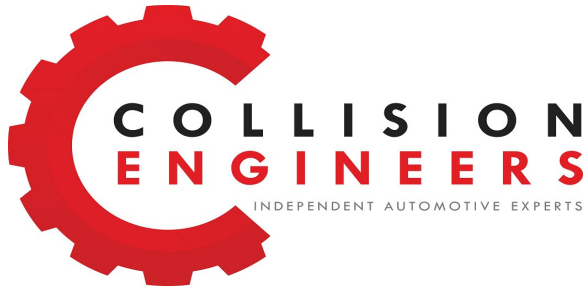

Our Ref: qdos221239

Your Ref: SM/13838/1

Date: 27/07/2022

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

Fee Note

DX71UUT.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

Agreed Fee: £100.00

Sub Total: £100.00

VAT: £20.00

Total Due: £120.00

Payment

Please make cheques payable to Collision Engineers and quote reference qdos221239.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o QDOS Assistance confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10