

Mrs Debbie Karen Smith
Farrows Farm, Stock Road
Stock
Ingatestone
Essex
CM4 9QX

Date: 26/03/2026
Our Ref: 00032959/JAKER
Your Ref: EHR98819

To the Court


REPAIRABLE REPORT - Supplementary Report

Dear Sirs,

Client: **Mrs Debbie Karen Smith**

We refer to your instructions received on **23 March 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: AUDI A1 TECHNIK 25 TFSI	Colour: GREY	Speedo: 136955 Miles
Reg No: EK22XPD	Registered: May 2022	Type: 5 Door Hatchback
Vin No: WAUZZZGB4NR030126	MOT Exp: 	R/H/F Tyre Not Kno
Mods: Not Seen	Cond: Good	R/H/R Tyre Not Kno
Audio: Not Seen	Manf'd: 2022	R/H/F Belt Not Tested
Brakes: Not Known	Tax Exp: 	R/H/R Belt Not Tested
Steering: Not Known	Fuel: Petrol	Spare Tyre Not Know
Extras: Not Seen	C.C.: 999	Centre Belt Not Tested
Air Bags Deployed: Not Known	BHP: 93.7	L/H/F Belt Not Tested
Damage: Light Collision/Impact Rear Bumper	Incident: 16/03/2026	L/H/R Belt Not Tested
		L/H/F Tyre Not Kno
		L/H/R Tyre Not Kno

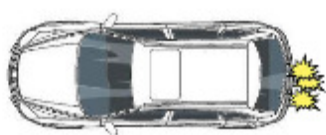

Vehicle Value: £9,891.00	Repair Cost: £4,102.15 inc VAT (41.47% of PAV)	Roadworthy: Yes
---------------------------------	---	------------------------

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light collision/impact damage to the rear bumper.

ENGINEER'S COMMENTS

12/05 - supp - bumper required replacement

VEHICLE HISTORY CHECK

26/03/2026 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-Rear Bumper, Rear Bumper Spoiler, L/Model Badge, R/Engine Badge, Panel Sundries, Car Care Kit, Sundry Parts

Repairable parts:-Lower Tailgate

Repaint only parts:-Two Coat Pearl/Mica, Rear Bumper New Part Paint K1r, Lower Tailgate Repair Painting <50%, De Nib & Polish. Per Panel, Preparation For Pre-Painting

Specialist/Sundry charges:-Bsi Compliance, Adas Methods, Pas 2060 / Aries, E.P.A. Charge, Tech Data + Methods, Car Care Kit

Blend only parts:-L/R Side Panel Surface Paint, R/R Side Panel Surface Paint, Fuel Filler Flap Surface Paint

Plast., Screen Mask Rear Surface Paint

Remove And Refit parts:-Description, Rear Number Plate, Rear Badges, Both Inner Taillamps, Rear Bumper Cover, Renew Rear Bumper Cover, Fuel Flap

Parts to check:-Rear Bumper Support, Adas Exploration, Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vacuum, Est Pre Wash

COST OF REPAIRS

An Audatex estimate has been obtained from South East Automotive, Peter James Motor Group, Unit 16-17, Stirling Industrial Estate, Stirling Industrial Estate, RM108TX (Tel. 0208 984 0022) in the sum of £1,860.76 labour plus parts at manufacturer's list prices plus £901.09 for paint and materials plus £172.64 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be reasonable. The labour charge is based on 15.7 hours at a rate of £118.52 per hour. We have also agreed that the cost of paint and materials will be limited to £901.09. The cost of the necessary replacement parts will be approximately £483.97, the specialist/sundry charges will be £172.64, the VAT liability on this repair will amount to some £683.69 giving a total repair cost of £4,102.15 including VAT **subject to any undisclosed damage.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 30/05/2022. The corresponding Cazana Guide (model code: 5558584) adjusted retail value for vehicles of this type and age in the March 2026 guide is £9,891.00 at 136955 Miles, trade value is £8,605.00 and mid value is £9,248.00. We place the pre-accident value of this particular vehicle at £9,891.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £4,125.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 26th March 2026, on your behalf.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy. **The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.**

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. Connexus Hire Solutions commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of



Jake Roberts CAE AMIMI
Exclusive Vehicle Assessors