


QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 11/06/2026
Our Ref: 00038045/NOELB
Your Ref: 45486/1

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Mr Sam Plumb**

We refer to your instructions received on **10 June 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

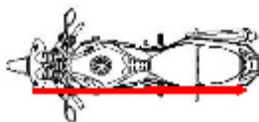Vehicle: APRILIA TUONO V4 APRC ABS		Colour: White	Speedo: 17718 Miles
Reg No: LO63ULW	Registered: Jan 2014	Type: Motorcycle	Trans: Manual
Vin No: ZD4TYB02XDS000430	MOT Exp: 	Front Tyre Not Kno	Rear Tyre Not Kno
Mods: Not Seen	Cond: Good		
Audio: Not Seen	Manf'd: 2014		
Brakes: Not Known	Tax Exp: 		
Steering: Not Known	Fuel: Petrol		
Extras: Not Seen	C.C.: 999		
Air Bags Deployed: Not Known	BHP: 		
Damage: Light to Moderate Collision/Impact LH Side	Incident: 12/05/2026		

Vehicle Value: £5,240.00	Repair Cost: £3,952.27 inc VAT (75.43% of PAV)	Roadworthy: No
---------------------------------	---	-----------------------

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light to moderate collision/impact damage to the left hand side.

ENGINEER'S COMMENTS

No mileage images supplied, mileage taken from value guides.

VEHICLE HISTORY CHECK

11/06/2026 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-L/F Indicator Cpl, Handlebar, L/Handlebar Grip, Left Mirror, Clutch Lever, Rear Seat Bench, Rr Upp Cushion Trim, L/F Side Trim, Swinging Fork, Panel Sundries, Car Care Kit, Sundry Parts

Repaint only parts:-2 Coat System, Rr Upp Cushion Trim Painting, Swinging Fork Painting, De Nib & Polish. Per Panel, Prepare Painting

Specialist/Sundry charges:-Bsi Compliance, Epa, Pas 2060 / Aries

Remove And Refit parts:-Description, Upper Trim, Headlamp Unit, Both F/Indicator Lamps, Seat Cushion, Rear Seat Trim (Seat Removed), Left Lower Side Panel Trim, Control Arm, Rear Swinging Fork, Rear Wheel, Balance Rear Wheel, Front Wheel, Balance Front Wheel, Adjust Headlamp, Adjust Front Fork

Parts to check:-Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vacuum, Est Pre Wash

COST OF REPAIRS

No estimate has been obtained for repairing the vehicle but, **subject to further damage found during dismantling**, we have calculated the time involved in such a repair using Audatex and we consider that a reasonable labour charge would be £1,016.02. The cost of the paint and materials would be £600.00, The cost of the replacement parts would be approximately £1,578.65, The specialist/sundry charges would be £98.89, and the VAT liability on the total would amount to some £658.71 giving a total repair cost of £3,952.27 including VAT **subject to undisclosed damage**. The labour charge is based on 12.2 hours at a rate of £83.28 per hour.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 16/01/2014. The corresponding Cazana Guide (model code: 37942) adjusted retail value for vehicles of this type and age in the May 2026 guide is £5,240.00 at 17718 Miles, trade value is £5,177.00 and mid value is £5,208.50. We place the pre-accident value of this particular vehicle at £5,240.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £3,975.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We confirm that we have not authorised repairs on your behalf and our actions in this matter remain without prejudice.

REPAIR DURATION

We consider that this repair will take some 3 to 4 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle was not roadworthy at the time of our inspection as a result of the damage sustained due to insecure parts.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.


For & on behalf of



Noel Barnes Dip VDA AQP
Exclusive Vehicle Assessors



5_Clientvehicledamages4-V1.JPG

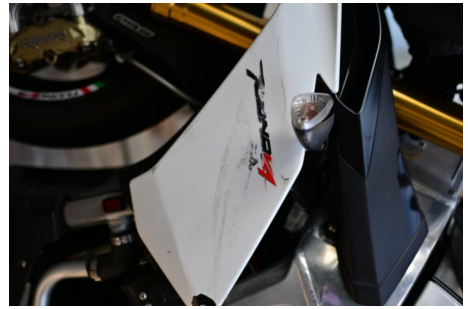

2_Clientvehicledamages7-V1.JPG




3_Clientvehicledamages6-V1.JPG



4_Clientvehicledamages5-V1.JPG



Clientvehicledamage11-V1.JPG

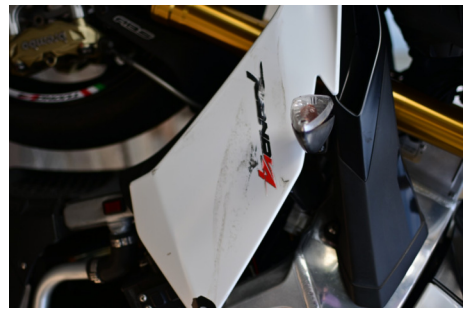

2_Clientvehicledamages7-V1(1).JPG



3_Clientvehicledamages6-V1(1).JPG



4_Clientvehicledamages5-V1(1).JPG



5_Clientvehicledamages4-V1(1).JPG



Clientvehicledamage14-V1.JPG



2_Clientvehicledamage13-V1.JPG




3_Clientvehicledamage12-V1.JPG



Clientvehicledamage10-V1.JPG



2_Clientvehicledamage9-V1.JPG

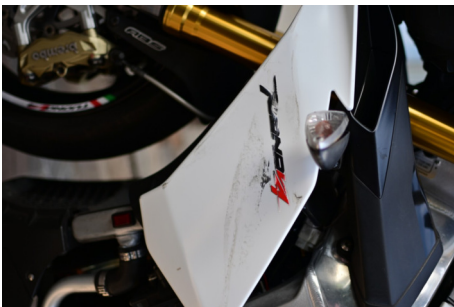

3_Clientvehicledamages8-V1.JPG