

Mr Olukorede Odumosu
18 Wisteria Road
London
SE
London
SE13 5HN


Date: 07/01/2026
Our Ref: 00027908/COHARE
Your Ref: EHR94641

To the Court
REPAIRABLE REPORT - Amended Report

Dear Sirs,
Client: **Mr Olukorede Odumosu**

We refer to your instructions received on **30 December 2025** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: MERCEDES-BENZ A 200 SPORT EXECU	Colour: WHITE	Speedo: 17174 Miles
Reg No: LG72VXK Registered: Sep 2022	Type: 4 Door Saloon	Trans: Automatic
Vin No: W1K1771872J364372	MOT Exp: 	R/H/F Tyre Not Kno R/H/R Tyre Not Kno
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested R/H/R Belt Not Tested
Audio: Not Seen	Manfd: 2022	Spare Tyre Not Known
Brakes: Not Known	Tax Exp: 	Centre Belt Not Tested
Steering: Not Known	Fuel: Petrol	
Extras: Not Seen	C.C.: 1332	
Air Bags Deployed: Not Known	BHP: 160.	L/H/F Belt Not Tested L/H/R Belt Not Tested
Damage: Moderate Accidental Damage LH Front Complete Vehicle	Incident: 30/12/2025	L/H/F Tyre Not Kno L/H/R Tyre Not Kno

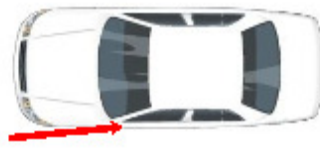

Vehicle Value: £20,373.00	Repair Cost: £9,599.59 inc VAT (47.12% of PAV)	Roadworthy: No
----------------------------------	---	-----------------------

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate accidental damage to the left hand front complete vehicle.

VEHICLE HISTORY CHECK

05/01/2026 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-Left Front Door, L/F Door Seal, L/F Out Window Seal, L/D/Mirror Indicator, L/Door Trim, L/F Door Damping, L/Sill Panel Cover, L/Fastening Clip, L/Fastening Clip, L/F Lwr Floor Cover, Bead Sealer, Clip Kit
Repairable parts:-Repair Methods, Repair L/F Wing, Repair L/Sill Panel, Repair Pulling Side Panel, Repair/Apply Filler On Plast/Metal Parts

Repaint only parts:-Left Front Door Painting Stage I-M, L/Sill Panel Cover Painting, L/F Wing Painting Stage Iii, L/Door Mirror Hsg Painting, L/Sill Panel Painting Stage Iii, L/R Door Painting Stage Ii, Touch-Up Paintwork With Brush, Add Colour Sample 1, Additional Work, Outer Cleaning Carry Out, Polish Vehicle, Non Water Based



Remove, De-Nib And Polish Surface Paint, Security Measures Before, Preparation Work For Two Coat Painting, Add For Preparation Work, Carry Out Colour Shade Determination, Prime Plastic/Metal Parts, Apply Smoothg Filler On Plast/Met Parts, Apply Primer L/Mirror Housing (Add/Work), Apply Filler L/Mirror Housing (Add/Work), Apply Filler Paste L/Mirror Housing Add, Additional Time For 3 Coat System

Specialist/Sundry charges:-Car Care Kit, E.P.A. Charge, Energy Cost, Pas 2060 Charge, Post Repair Sweep, Pre Repair Sweep, 4 Wheel Alignment, Adas First Calibrate, Adas Methods, Panel Materials, Panel Rep Sundries, Bs10125, Collection, Pearl Uplift, Hankook, Tyre Disposal, Diamond Cut, Sundry Part, Repair Methods, Anti-Corrosion

Remove And Refit parts:-Short Test, Battery Earth Cable, L/Underfloor Cover, Front Bumper Cpl, Add For Front Bumper, Addition To Front Bumper, Addition To Front Bumper, Left Headlamp, L/F Wheelhouse Liner Front, Renew L/F Door And Convert Parts, Adjust L/F Door, L/Outer Mirror Housing, Left Front Door Lock Striker, Left Front Door Edge Protection, Left Rear Door, Adjust L/R Door, L/R Door Moulding (Window Line), Left Rear Outer Door Handle, Left Sill Trim, Left A-Pillar Lower Trim, Front Wheel, Add To L/F Wheel Remove And Refit, Left Front Tyre, L/Front Wheel Balance, Adjust Led Headlamp, Vehicle Shutdown, Image 52 Cover Rail Kickplate, Allowance Identify Adas Fee, Inc Sanitise Pre Repair Clean, Allowance R/Test & Final Qc, Allowance Wash And Vac, Adas Extensive Road Test, Corrosion Prote 3 Panels

COST OF REPAIRS

The repairers, FLEETLINE COACHWORKS LTD (Tel. 020 33425522), have compiled an estimate in the sum of £4,053.07 plus parts at manufacturer's list prices plus £1,291.77 for paint and materials plus £1,453.45 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be reasonable. The labour charge is based on 35.6 hours at a rate of £113.85 per hour. We have also agreed that the cost of paint and materials will be limited to £1,291.77. The cost of the necessary replacement parts will be approximately £1,201.37, the specialist/sundry charges will be £1,453.45, the VAT liability on this repair will amount to some £1,599.93 giving a total repair cost of £9,599.59 including VAT **subject to any undisclosed damage.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 08/09/2022. The corresponding Glass's Guide (model code: 333043001) adjusted retail value for vehicles of this type and age in the December 2025 guide is £20,373.00 at 17174 Miles, trade value is £17,960.00 and mid value is £19,166.50. We place the pre-accident value of this particular vehicle at £20,373.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £9,600.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 5th January 2026, on your behalf.

REPAIR DURATION

We consider that this repair will take some 8 to 9 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle was not roadworthy at the time of our inspection as a result of the damage sustained due to Damage in the wheel area geo required. We understand that the vehicle is still being used by the owner.

TEMPORARY REPAIRS

We suggest that it would not be practical to consider cost effective temporary repairs on this occasion to make this vehicle roadworthy.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. Connexus Hire Solutions (ACHL) commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of

A handwritten signature in black ink, reading "C O'Hare". The signature is written in a cursive, flowing style. The "C" is large and loops around the "O", which is also large. The "Hare" is written in a more fluid, cursive script.

Chris O'Hare AMIMI IMI VDA
Exclusive Vehicle Assessors