

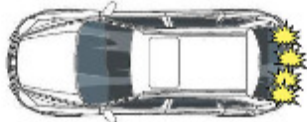
Mrs Susan North
Lime Trees
Burton
Lincoln
LN
Burton
LN1 2RD

Date: 22/04/2026
Our Ref: 00034527/JEFFP
Your Ref: EHR100116 \ GDCCA08587591

To the Court
REPAIRABLE REPORT

Dear Sirs,
Client: **Mrs Susan North**

We refer to your instructions received on **16 April 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle:	SUZUKI SX4 S-CROSS ULTRA BJT MHE		Colour:	GREY	Speedo:	29595	Miles
Reg No:	V6PWN	Registered:	Jul 2023	Type:	5 Door Hatchback	Trans:	Manual
Vin No:	TSMJYBD2S00B05914		MOT Exp:		R/H/F Tyre	Not Kno	R/H/R Tyre Not Kno
Mods:	Not Seen	Cond:	Good	R/H/F Belt	Not Tested	R/H/R Belt	Not Tested
Audio:	Not Seen	Manfd:	2023			Spare Tyre	
Brakes:	Not Known	Tax Exp:				Not Know	
Steering:	Not Known	Fuel:	Hybrid			Centre Belt	
Extras:	Not Seen	C.C.:	1373			Not Tested	
Air Bags Deployed:	Not Known	BHP:	127.	L/H/F Belt	Not Tested	L/H/R Belt	Not Tested
Damage:	Collision/Impact	Incident:	16/04/2026	L/H/F Tyre	Not Kno	L/H/R Tyre	Not Kno

Vehicle Value:	£16,060.00	Repair Cost:	£3,837.84 inc VAT	(23.90% of PAV)	Roadworthy:	Yes
----------------	-------------------	--------------	--------------------------	-----------------	-------------	------------

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the rear bumper, and moderate collision/impact to the rear boot.

VEHICLE HISTORY CHECK

22/04/2026 - According to the Experian database; Email trade.investigations@experian.com

REPAIR SCHEDULE

New parts required:-Tow Bar, Rear Bumper, L/R Upper Bumper, Rr Lwr Bumper Cover, Manufacturer Badge, Badge Model, Sundry Parts

Repairable parts:-Lower Tailgate

Repaint only parts:-Two Coat Pearl/Mica, L/R Upper Bumper New Part Paint K1r, Lower Tailgate Repair Painting <50%, De Nib, Preparation For Pre-Painting

Specialist/Sundry charges:-Aries Standard, Pas Uplift, Tech Data + Methods, E.P.A. Charge, Car Care Kit

Remove And Refit parts:-Description, Renew Rear Bumper, Rear Bumper Cpl, Towbar, Inner Tailgate Trim,



Tailgate Cover, Manufacturer Badge, Badge, Tailgate Moulding, Left Inner Taillamp, Right Inner Taillamp
Parts to check:-Prerepair Clean, And Clean Car, And Quality Control, Veh Diag Post, Veh Diag Pre, Powerdown
Ev/Hybrid, Electric Risk Assess

COST OF REPAIRS

The repairers, EJ Bowman Limited (Tel. 01522 525643), have compiled an estimate in the sum of £1,615.63 plus parts at manufacturer's list prices plus £442.17 for paint and materials plus £149.28 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be reasonable. The labour charge is based on 19.4 hours at a rate of £83.28 per hour. We have also agreed that the cost of paint and materials will be limited to £442.17. The cost of the necessary replacement parts will be approximately £991.12, the specialist/sundry charges will be £149.28, the VAT liability on this repair will amount to some £639.64 giving a total repair cost of £3,837.84 including VAT **subject to any undisclosed damage.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 29/07/2023. The corresponding Cazana Guide (model code: 9679523) adjusted retail value for vehicles of this type and age in the April 2026 guide is £16,060.00 at 29595 Miles, trade value is £13,008.00 and mid value is £14,534.00. We place the pre-accident value of this particular vehicle at £16,060.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £3,850.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 22nd April 2026, on your behalf.

REPAIR DURATION

We consider that this repair will take some 5 to 6 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy. **The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.**

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. Connexus Hire Solutions commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of



Jeff Parr CAE AMIMI
Exclusive Vehicle Assessors