

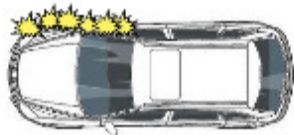
QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 23/04/2026
Our Ref: 00034098/HASSANA
Your Ref: 44716/1

To the Court
REPAIRABLE REPORT - Supplementary Report

Dear Sirs,
Client: **Mrs Christine Hughes**

We refer to your instructions received on **23 April 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: FORD FIESTA TITANIUM AUTO	Colour: BLACK	Speedo: 55285	Miles
Reg No: AP64ETZ	Registered: Jan 2015	Type: 5 Door Hatchback	Trans: Automatic
Vin No: WF0DXXGAKDEG65522	MOT Exp: 	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested
Audio: Not Seen	Manf'd: 2015		Spare Tyre Not Know
Brakes: Not Known	Tax Exp: 		Centre Belt Not Tested
Steering: Not Known	Fuel: Petrol		
Extras: Not Seen	C.C.: 1596		
Air Bags Deployed: Not Known	BHP: 103.	L/H/F Belt Not Tested	L/H/R Belt Not Tested
Damage: Moderate Collision/Impact RH Front	Incident: 07/04/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno
Vehicle Value: £6,784.00		Repair Cost: £4,402.24 inc VAT	(64.89% of PAV) Roadworthy: No

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the right hand front.

VEHICLE HISTORY CHECK

23/04/2026 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-R/F Wing, Sundry Parts

Repairable parts:-Front Bumper, R/Door Lower

Repaint only parts:-R/F Wing New Part Painting, Front Bumper Repair Paint Plastic, R/Door Lower Repair Painting <50%, Machine Polish X3, Preparation For Pre-Painting

Specialist/Sundry charges:-Methods Research Specialist, Epa, Aries Support, Car Care Kit, Panel Repair Sundry Specialist, Osf Wheel Refurb, 4 Wheel Alignment Check & Adjust, Rhf Tyre, Delivery Post Repairspecialist, Bsi Compliance, Corrosion Protection Materials External

Remove And Refit parts:-Description, Add/Time For One Main Position, Front Bumper, Front Bumper Impact Damper, Bumper Grille, Front Bumper Gravel Protection, Front Bumper Lower Grille, Adjust Headlamps, L/Fog Lamp Cover, R/Fog Lamp Cover, Renew R/Wing, R/F Door Trim, Right Front Outer Door Handle, R/F Outer Door Channel Moulding, R/Outer Mirror, Spare Wheel Swap, Set Up Panel Repair System, Corrosion Prote To 2 Panels

Parts to check:-Pre Repair Clean, Wash & Vacuum, Veh Diag Pre, Veh Diag Post, Road Test & Qc, Veh Shutdown (Ice), Adas Exploration, Spare Wheel Swap

COST OF REPAIRS

An Audatex estimate has been obtained from Fix Auto Sittingbourne, Unit 7 West Lane Trading Estate, West Lane, Sittingbourne, Sittingbourne, ME103TT (Tel. 01795 471 620) in the sum of £2,145.25 labour plus parts at manufacturer's list prices plus £771.09 for paint and materials plus £662.35 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be reasonable. The labour charge is based on 22.4 hours at a rate of £95.77 per hour. We have also agreed that the cost of paint and materials will be limited to £771.09. The cost of the necessary replacement parts will be approximately £89.84, the specialist/sundry charges will be £662.35, the VAT liability on this repair will amount to some £733.71 giving a total repair cost of £4,402.24 including VAT **subject to any undisclosed damage.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 16/01/2015. The corresponding Cazana Guide (model code: YBDB) adjusted retail value for vehicles of this type and age in the April 2026 guide is £6,784.00 at 55285 Miles, trade value is £5,495.00 and mid value is £6,139.50. We place the pre-accident value of this particular vehicle at £6,784.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £4,425.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 7th May 2026, on your behalf.

REPAIR DURATION

We consider that this repair will take some 5 to 6 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

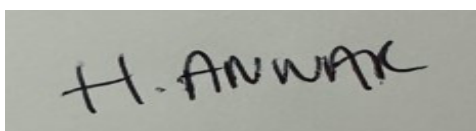
In our opinion this vehicle was not roadworthy at the time of our inspection as a result of the damage sustained due to wheel impact.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of

A handwritten signature in black ink, appearing to read 'H. ANWAR', is written on a light grey rectangular background.

Hassan Anwar ATA VDA
Exclusive Vehicle Assessors