


QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 01/05/2026
Our Ref: 00035506/HASSANA
Your Ref: 45012/1

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Mrs Muna Abdalla**

We refer to your instructions received on **01 May 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

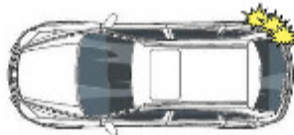Vehicle: JEEP AVENGER SUMMIT EV		Colour: GREY	Speedo: Miles	
Reg No: GL74UAN	Registered: Jan 2025	Type: 5 Door Hatchback	Trans: Automatic	
Vin No: ZACNJAC5XRJL39081	MOT Exp: 	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno	
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested	
Audio: Not Seen	Manf'd: 2025			
Brakes: Not Known	Tax Exp: 			Spare Tyre Not Know
Steering: Not Known	Fuel: Electric			Centre Belt Not Tested
Extras: Not Seen	C.C.: 0			
Air Bags Deployed: Not Known	BHP: 154.	L/H/F Belt Not Tested	L/H/R Belt Not Tested	
Damage: Moderate Collision/Impact RH Rear	Incident: 28/04/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno	

Vehicle Value: £18,676.00	Repair Cost: £2,414.70 inc VAT (12.93% of PAV)	Roadworthy: No
----------------------------------	---	-----------------------

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the right hand rear.

ENGINEER'S COMMENTS

The engineer has inspected this vehicle from images supplied by the principal only, the repair costs have been based on the images received and therefore may not be accurate if further damage is found, condition details and service records have not been checked in relation to the pre-accident value.

The valuation for the purpose of this report has been calculated using an estimated mileage from the vehicles MOT history at the time of loss.

VEHICLE HISTORY CHECK

01/05/2026 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-R/R Wheelarch Mldg, R/R Tyre, R/R Tyre Press Valve, Panel Sundries, Car Care Kit, Sundry Parts

Repairable parts:-Rear Upper Bumper

Repaint only parts:-Two Coat Pearl/Mica, Rear Upper Bumper Repair Paint Plastic, De Nib & Polish. Per Panel,



Preparation For Pre-Painting

Specialist/Sundry charges:-Alloy Refurb D/C, Geometry Check, Epa, Methods Research Specialist

Blend only parts:-R/R Side Panel Surface Paint

Remove And Refit parts:-Description, R/R Wheelarch Moulding, Right Rear Wheel, R/R Tyre (Wheel Removed), Balance Right Rear Wheel (Wheel Removed)

Parts to check:-R/R Outer Lamp, Adas Exploration, Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vaccum, Est Pre Wash

COST OF REPAIRS

No estimate has been obtained for repairing the vehicle but, **subject to further damage found during dismantling**, we have calculated the time involved in such a repair using Audatex and we consider that a reasonable labour charge would be £966.05. The cost of the paint and materials would be £474.26, The cost of the replacement parts would be approximately £186.55, The specialist/sundry charges would be £385.39, and the VAT liability on the total would amount to some £402.45 giving a total repair cost of £2,414.70 including VAT **subject to undisclosed damage**. The labour charge is based on 11.6 hours at a rate of £83.28 per hour.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 25/01/2025. The corresponding Cazana Guide (model code: 9779661) adjusted retail value for vehicles of this type and age in the April 2026 guide is £18,676.00 at 9618 Miles, trade value is £16,809.00 and mid value is £17,742.50. We place the pre-accident value of this particular vehicle at £18,676.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £2,425.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We confirm that we have not authorised repairs on your behalf and our actions in this matter remain without prejudice.

REPAIR DURATION

We consider that this repair will take some 3 to 4 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE


In our opinion this vehicle was not roadworthy at the time of our inspection as a result of the damage sustained due to wheel impact.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of

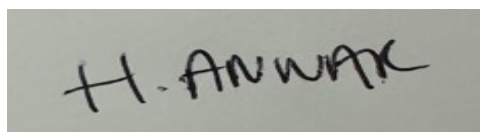

Hassan Anwar ATA VDA
Exclusive Vehicle Assessors



Imageofclientdamagejpg-V1.jpg