

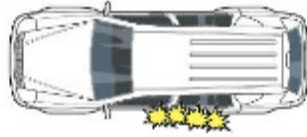
QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 26/05/2026
Our Ref: 00036762/MATTG
Your Ref: 44928/1

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Mr Ian Page**

We refer to your instructions received on **22 May 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: AUDI A4 S LINE BLACK EDITION TFSI		Colour: White	Speedo: 97195 Miles	
Reg No: YH67TFO	Registered: Oct 2017	Type: Estate	Trans: Manual	
Vin No: WAUZZZF40JA056606	MOT Exp:	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno	
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested	
Audio: Not Seen	Manfd: 2017			
Brakes: Not Known	Tax Exp:			Spare Tyre Not Known
Steering: Not Known	Fuel: Petrol			Centre Belt Not Tested
Extras: Not Seen	C.C.: 1395			
Air Bags Deployed: Not Known	BHP: 148	L/H/F Belt Not Tested	L/H/R Belt Not Tested	
Damage: Light Collision/Impact LH Side Complete Vehicle	Incident: 19/04/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno	
Vehicle Value: £11,181.00		Repair Cost: £3,012.86 inc VAT (26.95% of PAV)	Roadworthy: Yes	

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light collision/impact damage to the left hand side complete vehicle.

ENGINEER'S COMMENTS

The engineer has inspected this vehicle from images supplied by the principal only, the repair costs have been based on the images received and therefore may not be accurate if further damage is found, condition details and service records have not been checked in relation to the pre-accident value.

VEHICLE HISTORY CHECK

We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-Panel Sundries, Car Care Kit, Sundry Parts

Repairable parts:-L/R Door, L/R Side Panel



Repaint only parts:-Basecoat Clear, L/R Door Repair Painting <50%, L/R Side Panel Repair Painting <50%, De Nib & Polish. Per Panel, Preparation For Pre-Painting

Specialist/Sundry charges:-Bsi Compliance, Adas Methods, Geometry Check, Epa, Corrosion Protection Materials External

Blend only parts:-L/F Lower Door Surface Paint

Remove And Refit parts:-Description, L/F Door Handle Trim, Left Front Door Handle, Corrosion Prote To 1St Panel

Parts to check:-Adas Exploration, Qc & Road Test, Pre Rep Diag Scan, Post Rep Diag Scan, Wash And Vaccum, Est Pre Wash

COST OF REPAIRS

No estimate has been obtained for repairing the vehicle but, **subject to further damage found during dismantling**, we have calculated the time involved in such a repair using Audatex and we consider that a reasonable labour charge would be £1,597.43. The cost of the paint and materials would be £636.68, The cost of the replacement parts would be approximately £37.71, The specialist/sundry charges would be £238.90, and the VAT liability on the total would amount to some £502.14 giving a total repair cost of £3,012.86 including VAT **subject to undisclosed damage**. The labour charge is based on 15.5 hours at a rate of £103.06 per hour.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 12/10/2017. The corresponding Cazana Guide (model code: 1005451) adjusted retail value for vehicles of this type and age in the April 2026 guide is £11,181.00 at 97195 Miles, trade value is £9,615.00 and mid value is £10,398.00. We place the pre-accident value of this particular vehicle at £11,181.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £3,025.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We confirm that we have not authorised repairs on your behalf and our actions in this matter remain without prejudice.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle has suffered no damage in the incident under review which would render it unroadworthy. **The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.** We understand that the vehicle is still being used by the owner.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of

 .

Jeff Parr CAE AMIMI
Exclusive Vehicle Assessors



CLV damage 1.jpeg



CLV damage 2.jpeg



CLV damage.jpeg



CLV Damage.jpeg



CLV Damage.jpeg



CLV front 44928.jpeg



CLV nearside 44928.jpeg



CLV rear 44928.jpeg

