

Tel: 01925 403405
Fax: 0845 077 0806
Email: engineer@connexus.co.uk

2/2

Miss Natasha Hughes
4
Barton Close
Murdishaw
Runcorn
WA76JU

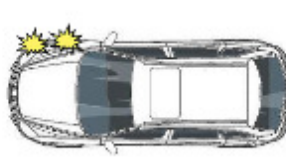
Date: 19/02/2026
Our Ref: 00077022/PK
Your Ref: 571423 \ 578359

Engineer Repairable Report

Dear Sirs,

Client/Insured: **Miss Natasha Hughes**

We refer to your instructions received on **11 February 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: SKODA OCTAVIA SPORTLINE TDI S-A	Colour: GREY	Speedo: 9014	Miles
Reg No: P2HWK	Registered: Jul 2025	Type: 5 Door Hatchback	Trans: Semi-Auto
Vin No: TMBBJ8NX0SM058261	MOT Exp:	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested
Audio: Not Seen	Man'f'd: 2025		Spare Tyre Not Know
Brakes: Not Known	Tax Exp:		Centre Belt Not Tested
Steering: Not Known	Fuel: Diesel		
Extras: Not Seen	C.C.: 1968	L/H/F Belt Not Tested	L/H/R Belt Not Tested
Air Bags Deployed: Not Known	BHP: 147.	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno
Damage: Light Accidental Damage RH Front Bumper	Incident: 10/02/2026		
Vehicle Value: £27,500.00	Repair Cost: £3,430.45 inc VAT	(12.47% of PAV)	Roadworthy: Yes

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light accidental damage to the right hand front bumper, to the wing, and to the wheel

VEHICLE HISTORY CHECK

11/02/2026 - We confirm having checked this vehicle on the Experian Auto Check database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-R/F Out Bumper Brkt, R/F Wing, R/F Wing Bracket Frt, R/F Wheel, R/F Tyre Valve, R/F Tyre, Wing Badge Rh

Repairable parts:-Repair Front Bumper Cover

Repaint only parts:-R/F Wing New Part Painting, Front Bumper Cover Repair Paint Plastic, R/F Door W/O Frame Surface Paint, Touch Up Bolts Surface Paint, Pre-Painting Sundry Materials, Preparation for Pre-Painting

Specialist/Sundry charges:-Pre Diag Check, Post Diag Check, 4 Wheel Alignment, Car Care Kit, E.P.A. Charge, Methods Research, Adas Calibration, Bs10125, Sundry Part, Anti-Corrosion

Remove And Refit parts:-Gfs / Guided Function, Apply Rust Proofing On R/F Wing, Apply Cavity Sealing On Body Part/S, Front Bumper Cover, L/F And R/F Bumper Bracket, R/Headlamp, Renew R/F Wing, R/F Wing Bracket, Load Starter Battery, R/F Door Trim, Right Mirror, Right Front Outer Door Handle, R/F Outer Window Channel Moulding, R/F Wheel/Tyre, Adjust Headlamps, Adjust Radar Sensor

Parts to check:-Check And Clean Car, Check And Quality Control, Check And Road Test

COST OF REPAIRS

The repairers, Parkway Prestige, Unit 3 Leo Industrial Estate, Mosley Road, Trafford Park, M17 1JS (Tel. 0161 872 5335), have compiled an estimate in the sum of £1,170.00 plus parts at manufacturer's list prices plus £653.12 for paint and materials plus £878.55 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be high and we have agreed a reduction with the repairers of £195.00 to £975.00 in their final account. The labour charge is based on 13 hours at a rate of £75.00 per hour. We have also agreed that the cost of paint and materials will be limited to £653.12. The cost of the necessary replacement parts will be approximately £828.60, the specialist/sundry charges will be £401.99, the VAT liability on this repair will amount to some £571.74 giving a total repair cost of £3,430.45 including VAT **subject to any undisclosed damage. We are pleased to confirm that we have achieved total gross savings in this matter of £1,104.67.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 25/07/2025. The corresponding CAP Guide retail value for vehicles of this type and age in the February 2026 guide is £27,500.00, trade value is £25,350.00 and mid value is £26,425.00. We place the pre-accident value of this particular vehicle at £27,500.00 bearing in mind the condition described herein.

RESERVE

We consider that a repair reserve of £3,450.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 19th February 2026, on your behalf.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any extra repairs found once the repairs commence.

ROADWORTHY STATE

In our opinion this vehicle has suffered no damage in the incident under review which would render it un roadworthy. **The vehicle is considered currently roadworthy provided it complies with the current Road Traffic Act in terms of Road Tax, MOT standards (if vehicle age/type applies) and Motor Insurance.**

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. Connexus commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of



Phil Kendrick AQP CAE AMIMI
Connexus Vehicle Assessors