


QDOS Assistance
1st Floor, Barfield House
24-28 alderley Road
Wilmslow
Cheshire
SK9 1PL

Date: 18/05/2026
Our Ref: 00036508/NOELB
Your Ref: 452341

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Miss Tracy Fradgley**

We refer to your instructions received on **18 May 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

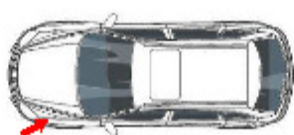Vehicle: VAUXHALL CORSA SE PREMIUM		Colour: RED	Speedo: 21084 Miles	
Reg No: DL70CMY	Registered: Oct 2020	Type: 5 Door Hatchback	Trans: Manual	
Vin No: VXKUPHMDL4420684	MOT Exp: 	R/H/F Tyre Not Kno	R/H/R Tyre Not Kno	
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Belt Not Tested	
Audio: Not Seen	Manf'd: 2020			
Brakes: Not Known	Tax Exp: 			Spare Tyre Not Know
Steering: Not Known	Fuel: Petrol			Centre Belt Not Tested
Extras: Not Seen	C.C.: 1199			
Air Bags Deployed: Not Known	BHP: 73.8	L/H/F Belt Not Tested	L/H/R Belt Not Tested	
Damage: Light to Moderate Collision/Impact LH Front	Incident: 06/05/2026	L/H/F Tyre Not Kno	L/H/R Tyre Not Kno	
Vehicle Value: £9,918.00		Repair Cost: £3,684.65 inc VAT (37.15% of PAV)	Roadworthy: No	

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered light to moderate collision/impact damage to the left hand front.

ENGINEER'S COMMENTS

The engineer has inspected this vehicle from images supplied by the principal only, the repair costs have been based on the images received and therefore may not be accurate if further damage is found, condition details and service records have not been checked in relation to the pre-accident value.

The valuation for the purpose of this report has been calculated using an estimated mileage from the vehicles MOT history at the time of loss.

VEHICLE HISTORY CHECK

We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-Front Bumper, L/F Bumper Bracket, R/F Bumper Bracket, Trim Lift Tape, Panel Sundries, Sundry Parts

Repaint only parts:-Front Bumper New Part Paint K1r, L/F Wing Repair Painting <50%, Machine Polish,



Preparation For Pre-Painting

Specialist/Sundry charges:-E.P.A. Charge, Car Care Kit, Assessment Fee, Corrosion Protection Materials External

Blend only parts:-Bonnet Surface Paint, R/F Wing Surface Paint, Screen Mask Rear Surface Paint

Remove And Refit parts:-Description, Front Bumper, Renew Front Bumper (Removed), Both Headlamp Units, Renew L/F Bumper Bracket, Renew R/F Bumper Bracket, Corrosion Prote To 1St Panel

Parts to check:-Pre Clean Car, And Road Test, And Clean Car, Veh Diag Pre, Veh Diag Post

COST OF REPAIRS

The repairers, N/A, have compiled an estimate in the sum of £1,315.82 plus parts at manufacturer's list prices plus £932.16 for paint and materials plus £234.21 for specialist/sundry charges. Having calculated the time involved in this repair we consider this to be reasonable. The labour charge is based on 15.8 hours at a rate of £83.28 per hour. We also consider that the cost of paint and materials should be limited to £932.16. The cost of the necessary replacement parts will be approximately £588.35, the specialist/sundry charges will be £234.21, the VAT liability on this repair will amount to some £614.11 giving a total repair cost of £3,684.65 including VAT **subject to any undisclosed damage.**

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 31/10/2020. The corresponding Cazana Guide (model code: 6393131) adjusted retail value for vehicles of this type and age in the May 2026 guide is £9,918.00 at 21084 Miles, trade value is £8,827.00 and mid value is £9,372.50. We place the pre-accident value of this particular vehicle at £9,918.00 bearing in mind the condition described herein.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

We consider that a repair reserve of £3,700.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We confirm that we have not authorised repairs on your behalf and our actions in this matter remain without prejudice.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle was not roadworthy at the time of our inspection as a result of the damage sustained due to Insecure parts.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. QDOS Assistance commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.


For & on behalf of



Noel Barnes Dip VDA AQP
Exclusive Vehicle Assessors



Imageofclientdamage-V1.jpg

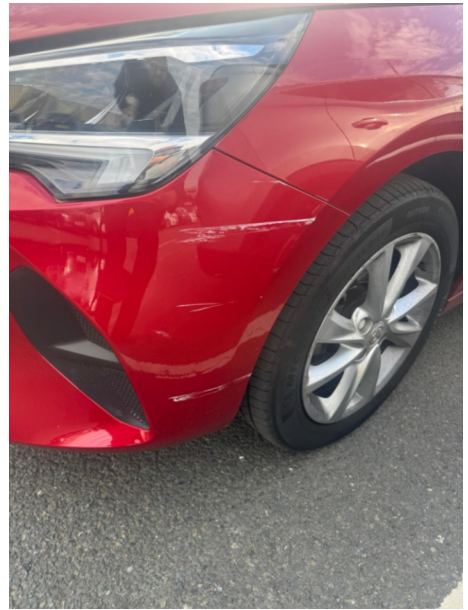

2_Imageofclientdamage2-V1.jpg



3_clvfrontpng-V1.png