THE NEWEST TIDE SENSOR HAS BEEN DEPLOYED AT F.O.B.H. IN THE SHARK RIVER ON FRIDAY, OCTOBER 30, 2026 AROUND NOON. STRONG BREEZE CONVINCED MATT & I THAT PADDLING OUT ON A DINGHY MAY NOT BE A GOOD IDEA, SO WE STRAPPED THE SENSOR TO A PIER WE COULD REACH FROM THE FOBH FLOATING DOCK

NO MESSAGE WAS SEEN AT CDL/CAMP EVANS, BUT WE DID GET A MESHTASTIC MESSAGE AT THE BELMAR MARINA

MATT DONOVAN & I STRAPPED THE NEW TIDE SENSOR TO PIER POLE




MARKED POSITION OF STRAP TO CHECK FOR SLIPPING





SENSOR IS HERE, REACHABLE BY FLOATING DOCK

ORIGINAL PLAN WAS TO USE DINGHY TO STRAP SENSOR TO THIS POLE, BUT WIND CONVINCED US OTHERWISE

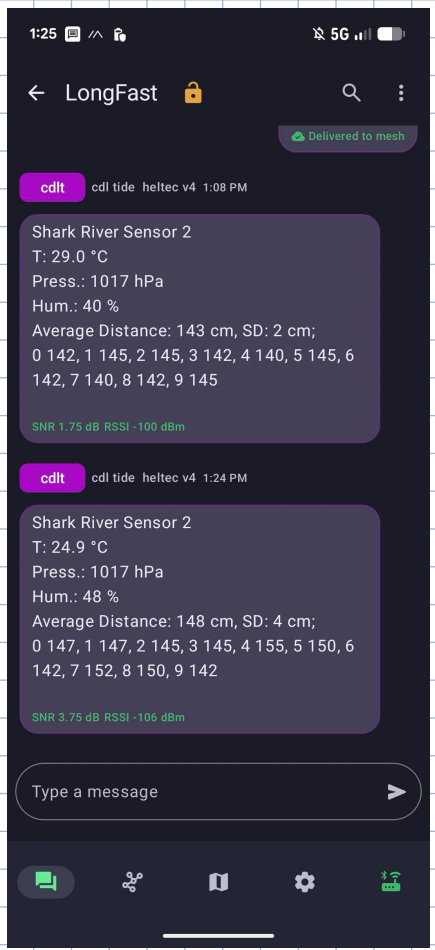

MESSAGE FROM TIDE SENSOR SEEN AT BELMAR MARINA

TAPE MEASURE OF 58" TO WATER ~ 147 cm

VERY CLOSE!

OCTOBER 31. STILL NOTHING RECORDED ON MESHTASTIC DEVICE CONNECTED TO MY OLD APPLE LAPTOP. EVEN AFTER MATT & I REPOSITIONED THE CDL REPEATER TO A BETTER SPOT TO REACH THE SHARK RIVER. WHY? WE GOT MESSAGES WITH THIS VERSION 1 SENSOR, IN AUGUST

IS HELTEC V4 RADIO NOT AS POWERFUL AS PREVIOUS RADIO WITH PICOW?

IS THE ANTENNA BAD? SHOULD I GET A BETTER ONE? (NARROWER BEAM?)

I BROUGHT MESHTASTIC/LAPTOP HOME, BUT STILL NO MESSAGE AS OF HALLOWEEN NIGHT

DO WE NEED ANOTHER REPEATER? AT ARMY HOUSES ACROSS MARCONI ROAD OR AT ISEC?

NOV 1 2026

DISCUSSION WITH NEIL & JOE

1) BIGGER ANTENNA — THEY HAVE ONE I CAN USE

2) STATUS OF COMPUTECON MESHTASTIC UNIT
   - IT IS IN CLIENT MODE!
   - NOT CORRECT CONFIGURATION?

I WENT PAST SENSOR 2 STOPPED AT PARK — I GOT A RESPONSE!!
I DID NOT GET ONE AT HOME OVERNIGHT THOUGH.
(SENSOR 1 DID REACH MY HOUSE AT LEAST ONCE BEFORE IN AUGUST)

CHECK #2 FIRST, THEN IF NO IMPROVEMENT, DRIVE TO MARINA & INSTALL BETTER ANTENNA (#1)

1) INSTALLED LARGER ANTENNA, BUT STILL NO SIGNAL AT CDL

11/2/2026

*

734091 PIN CODE TO ACCESS 1XR COMP. DECON WITH BLUE TOOTH

BLUETOOTH DEVICE

* COLA-2093 (OR 2093 AT END OF MAC ADDRESS)

TRIED TO LISTEN TO TIDE SENSOR AT DIFFERENT POINTS

① BEHIND OFFICERS QUARTERS
② NORTH MARCONI ROAD AT RIVERSIDE

USING 222C HELTEC CONNECTED TO MY OLD MAC LAPTOP

11/4/2026

PUT COMPDECON UNIT ON 1" PVC PIPE TO RAISE IT HIGHER (AND ABOVE BARBED WIRE ON FENCES AT INFOAGE)
- STILL NO SIGNAL FROM FOB H TIDE SENSOR

MOVED UNIT & POLE TO BACK YARD OF OFFICERS QUARTERS
- NO SIGNAL

I THINK I WILL BUY A NEW HELTEC CHIP & SWAP IT OUT ON TIDE SENSOR

11/5/2026

ORDERED A NEW HELTEC V4 (WITHOUT TFT) WHICH SHOULD ARRIVE NEXT MONDAY

↳ PLAN IS TO UNPLUG POWER, SWAP BOARDS, RESTART AND TEST SIGNAL LOCALLY ON MONDAY AFTERNOON?

VERSION 1 OF TIDE SENSOR HAD A PICO W CONTROLLED LORA - WAVE SHARE PICO SX1262 LORA I PURCHASED FROM AMAZON IN FEBRUARY 2026. THE TRANSMITTER IS 22 DBM

VERSION 2:
NEW CHIP IS HELTEC ESP32 V4 PROCESSOR WITH 27 DBM RADIO TRANSMITTER. THE CURRENT

BOARD HAS A TFT DISPLAY AND I MAY HAVE DAMAGED THE TRANSMITTER BY DISCONNECTING THE ANTENNA WHILE IT WAS OPERATING

SO, THE VERSION 2 TRANSMITTER IS MORE POWERFUL THAN THE FIRST ONE SO WE SHOULD HEAR A MESSAGE IF ALL IS FUNCTIONING PROPERLY. OBSTRUCTIONS/ FOLIAGE SHOULD NOT BE A CONCERN (WORKED IN AUGUST, DIDN'T WORK IN OCTOBER)
* 27 dBM IS ABOUT 3X MORE POWERFUL THAN 22 dBM

VERSION 2a WILL HAVE REPLACEMENT HELTEC CHIP (BUT NO TFT DISPLAY) WITH SOLDERED HEADERS, SO IT SHOULD BE EASY TO SWAP CHIPS & PLUG IN ANTENNA BUT I'LL HAVE TO TAKE THE SENSOR OFF THE PIER.