
DI1AT-06

DTC	B2796/99	No Communication in Immobiliser system
-----	----------	--

CIRCUIT DESCRIPTION

DTC No.	DTC Detecting Condition	Trouble Area
		• Key
		Transponder Key Coil
B2796/99	No communication	Transponder Key Amplifier
		Wire harness
		Engine and ECT ECU

WIRING DIAGRAM

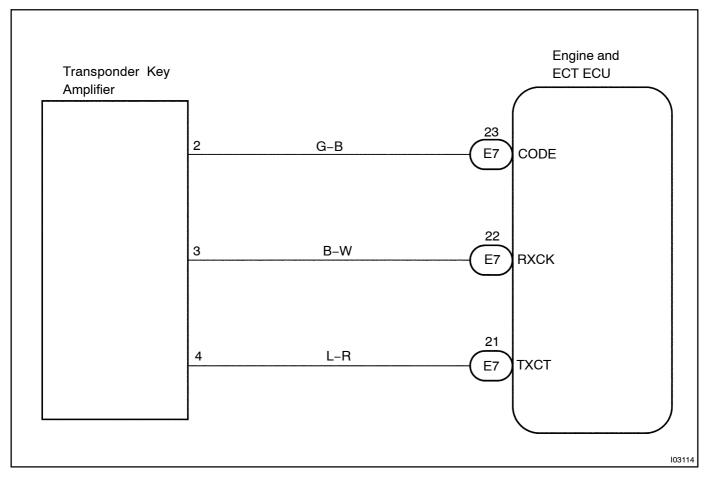

INSPECTION PR	OCEDURE
---------------	---------

1[]	Check[transponder[key[coil[(See[page[BE-253).	
	NG Replace transponder key coil	
ОК		
2	Check harness and connector between transponder key amplifier and ECU.	
	NG Repair or replace harness and connector	
ОК		
3	Does it operate normally after replacement of transponder key amplifier?	
	Yes Replace transponder key amplifier.	
No		
Replace ECU.		