
DI1AV-04

DTC	B2798/99	Communication malfunction No.2
-----	----------	--------------------------------

CIRCUIT DESCRIPTION

DTC No.	DTC Detecting Condition	Trouble Area
B2798/99		Key Transponder Key Coil
	Communication error	Transponder Key Amplifier
		Wire harness
		Engine and ECT ECU

WIRING DIAGRAM

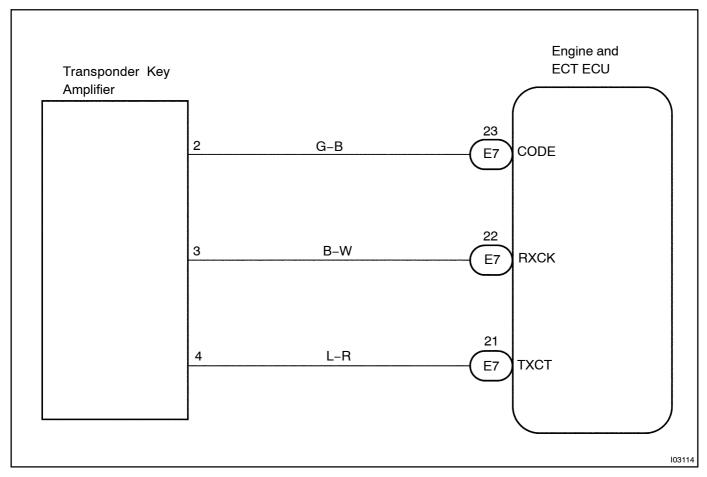

INSPECTION	PROCEDURE
------------	-----------

1[Check[transponder[key[coil[(See[page[BE-253).
	NG Replace transponder key coil
ОК	
2	Check harness and connector between transponder key amplifier and ECU.
	NG Repair or replace harness and connector
ОК	
3	Does the system operate normally after replacement of transponder key amplifier?
	Yes Replace transponder key amplifier.
No	
Repla	ce ECU.