SG98 Burr-Gap Digital Indicator Wiring

GUIRUIMOON FS PFC 12mm indicator -> 4-channel level shifter -> SG98 controller EX_I2C header

Assumption: the indicator exposes the common 4-wire clock/data port: V+, GND, CLK, DATA.
Keep the indicator battery installed unless you confirm the gauge accepts external 3.3V power.

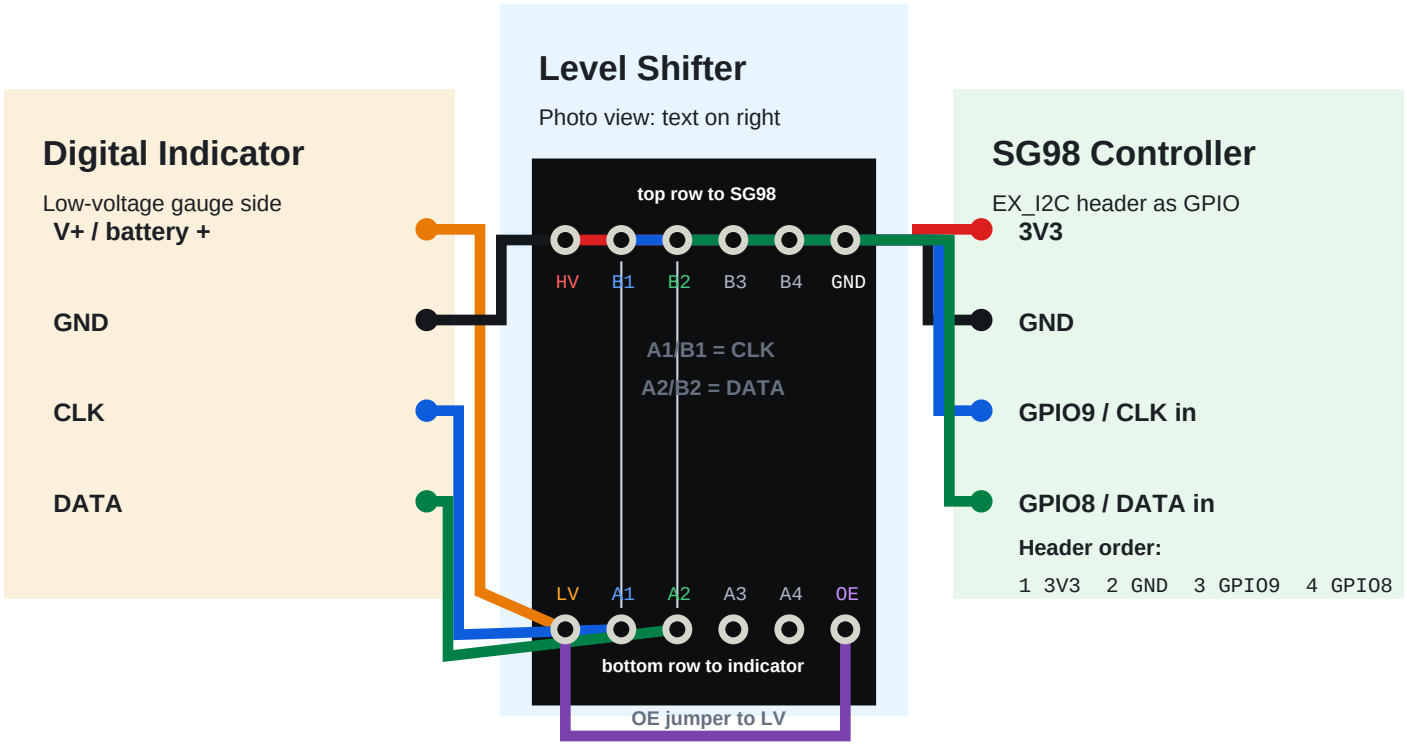

Connection Table

Indicator	Level shifter	Controller
V+ / battery +	bottom LV + OE jumper	no direct controller pin
GND	top GND, shared	EX_I2C pin 2 / GND
CLK	bottom A1 -> top B1	EX_I2C pin 3 / GPIO9
DATA	bottom A2 -> top B2	EX_I2C pin 4 / GPIO8
none	top HV	EX_I2C pin 1 / 3V3

Bring-up notes

1. Confirm GND and V+ at the gauge battery/data connector before wiring.
2. Probe the remaining two pins while moving the plunger; assign CLK and DATA by waveform.
3. Photo board pin order: top HV B1 B2 B3 B4 GND; bottom LV A1 A2 A3 A4 OE.
4. **Jumper OE to LV; tie SG98 GND, shifter top GND, and gauge GND together.**