

Electrical installation condition - 8 October 2026


Project	Riverside Court - Cat B Fit-Out, Phase 2
Client	Halloway Cross Estates Ltd
Address	Riverside Court, 42 Kelham Street, Sheffield S3 8LP
Reference	EIC-2026-10-001
Report date	8 October 2026
Status	Draft - not yet published
Items included	12

RESULTS

Not assessed - a person must resolve these

PHOTOGRAPHS CARRYING SEVERAL ITEMS

Each of these takes a page of its own: a numbered pin on the photograph for every item found on it, and those items listed underneath in pin order. An item's entry in the schedule points back at its pin.

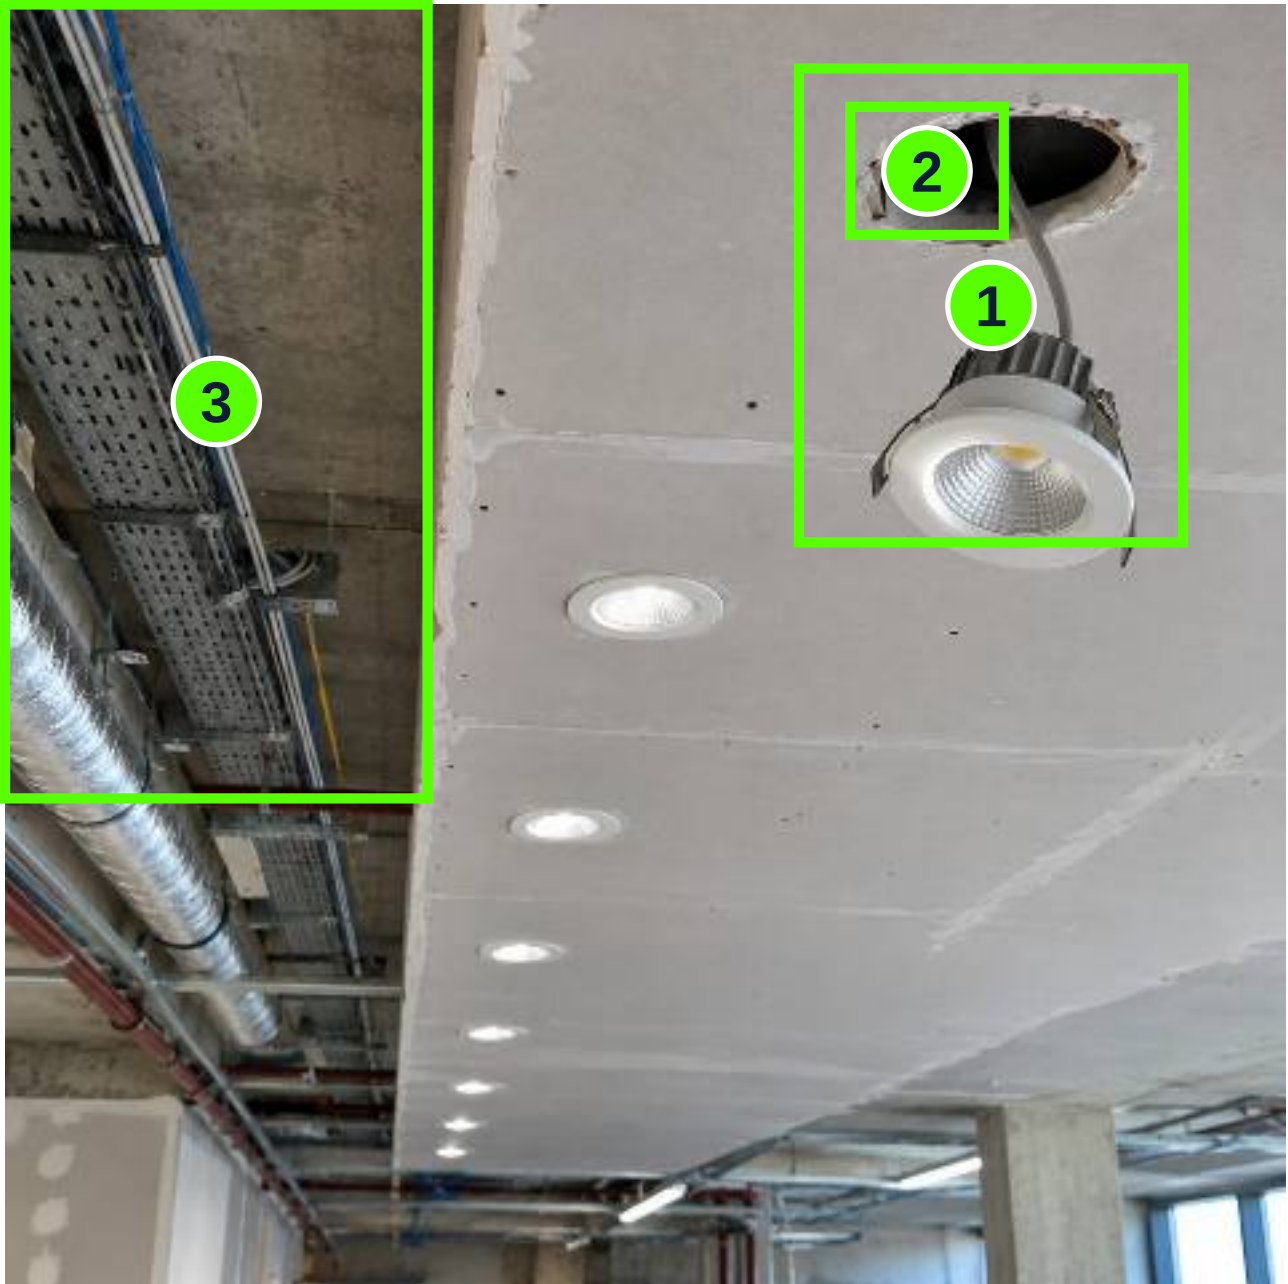

Photograph 2 - 3 items on this photograph, 3 pins on this photograph

Findings on this photograph

- Pin 1 - Item 10 - A recessed luminaire in the plasterboard ceiling at the upper right of the image is hanging from its aperture on a fl...
- Pin 2 - Item 11 - The open ceiling aperture at the same location as the displaced luminaire shows a dark void in which cable or connect...
- Pin 3 - Item 12 - To the left of the image, cable tray and basket containment are installed at high level above the ceiling line, carry...

Item 11

Status: Not assessed **Severity:** Further investigation

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

The open ceiling aperture at the same location as the displaced luminaire shows a dark void in which cable or connector is partially visible. The contents and terminations within the void cannot be identified from this image, and no judgement can be made on the enclosure or connection method from the photograph.

Required action

Inspect the void and the terminations within it, confirm the integrity of the cable sheath and any connectors, and confirm continuity and polarity by test by a competent person before the luminaire is reinstated.



Pin 2 of 3 - photograph 2

A crop of the area this item refers to.

Item 1

Status: Not assessed **Severity:** Further investigation


Not assessed. This item was not resolved by a person and is included here unchanged.


A consumer unit is mounted on a plasterboard wall with the front cover removed, exposing the busbar, neutral bar, earth bar and the incoming meter tails above the enclosure. The internal connections are visible but the cover is not fitted and the installation cannot be judged complete from this view.

Required action

Do not energise or leave energised with the cover removed. Confirm isolation and lock-off, then have a competent person refit the front cover and verify the enclosure is complete and secure before the installation is put back into service.

Reference: BS 7671 - IET Wiring Regulations (18th Edition)

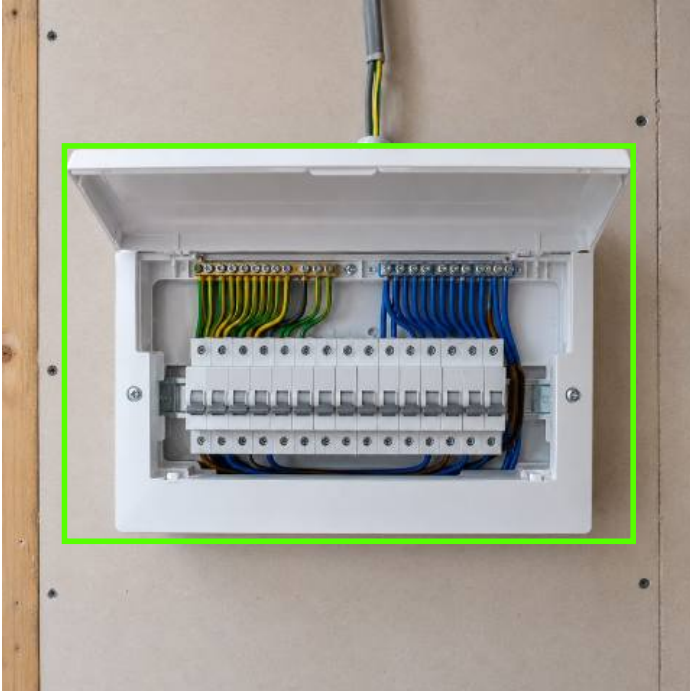

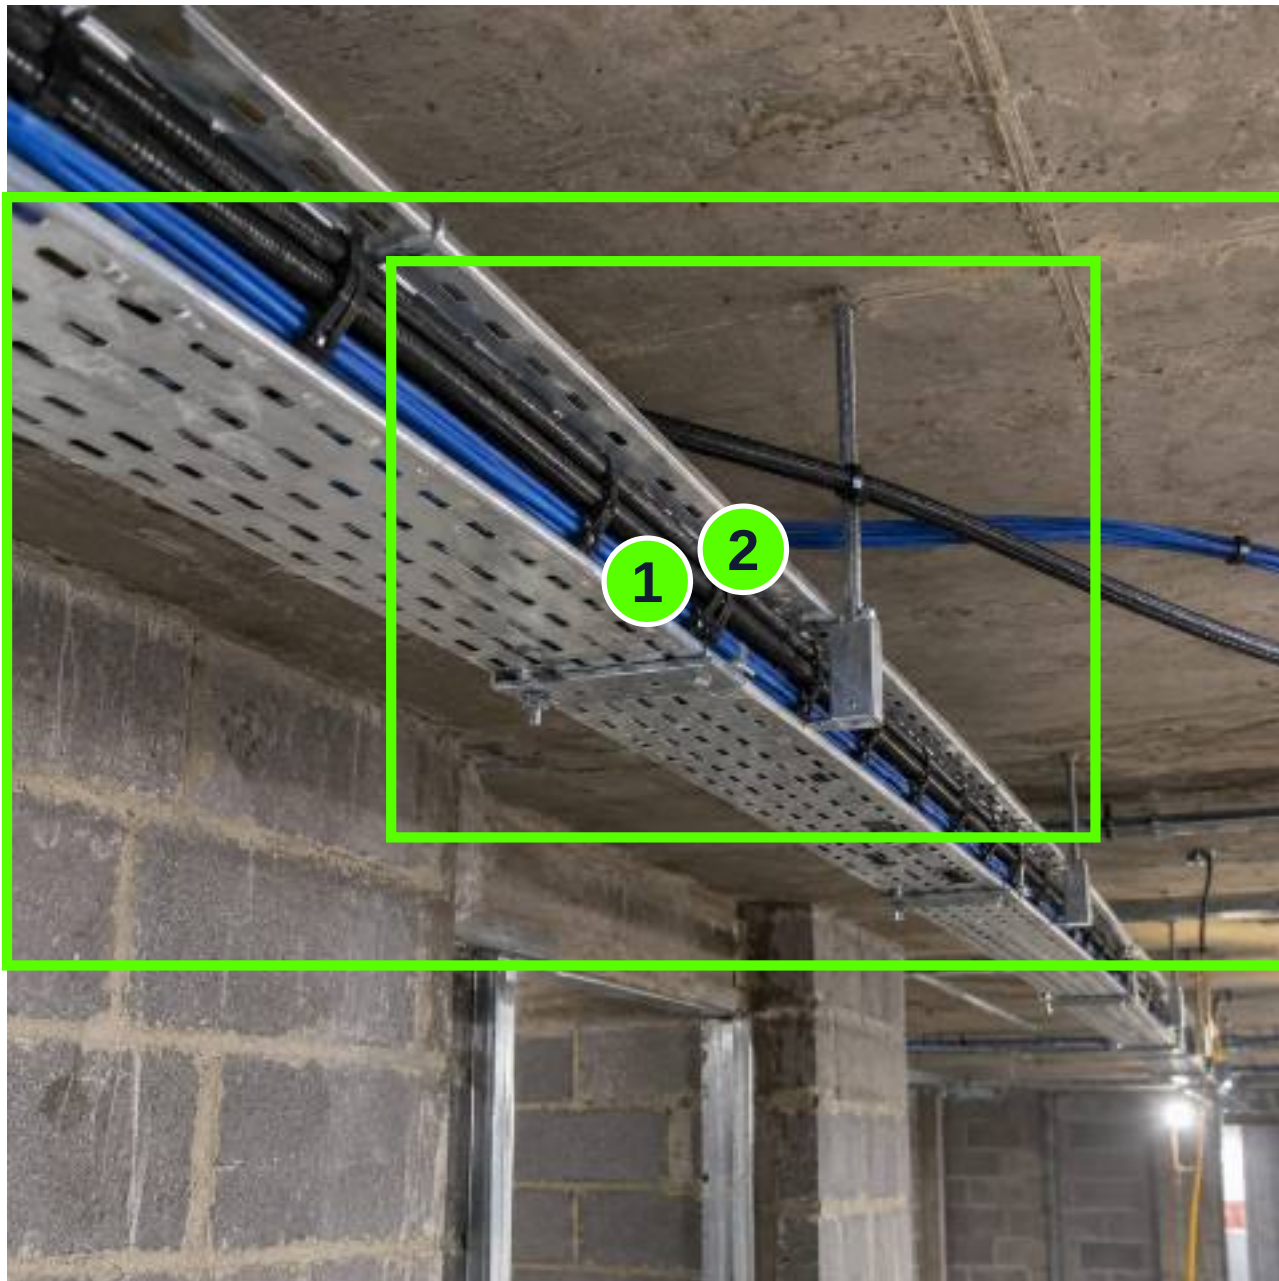

Photograph 4 - 2 items on this photograph, 2 pins on this photograph

Findings on this photograph

Pin 1 - Item 3 - The perforated steel cable tray is suspended from the soffit on threaded rod hangers with pressed bracket fixings.

Pin 2 - Item 4 - The cable tray hanger arrangement is visible only in part.

Item 4

Status: Not assessed **Severity:** Further investigation

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

The cable tray hanger arrangement is visible only in part. The spacing of the threaded rod supports along the run cannot be measured from the photograph, and the load carried by each fixing cannot be judged. The adequacy of the support spacing requires confirmation on site by a person.

Required action

Measure the actual hanger centres against the manufacturer's published support spacing for the tray type and the installed load. Confirm the soffit fixings are correct for the substrate. Record the result on the inspection schedule.



Pin 2 of 2 - photograph 4

A crop of the area this item refers to.

Potentially dangerous

Item 10

Status: Defective - rectification required **Severity:** Potentially dangerous

A recessed luminaire in the plasterboard ceiling at the upper right of the image is hanging from its aperture on a flexible cord, fully out of the ceiling void. The luminaire body carries an exposed metallic heat sink and the cord is unsupported over its free length. The unit is not secured to the ceiling, is not connected to any support or fixing, and the aperture is left open and unsealed. In this condition the luminaire is a suspended object above the working area.

Required action

Isolate the lighting circuit and prove dead before any work on the unit. Re-seat the luminaire in its aperture with the correct retaining clips, restore the cord and any terminations, then reinstate and reseal the aperture. Verify secure fixing and correct termination by test before re-energising.

Reference: BS 7671 - IET Wiring Regulations (18th Edition)



Pin 1 of 3 - photograph 2

A crop of the area this item refers to.

Improvement item

Item 3

Status: Improvement recommended **Severity:** Improvement item

The perforated steel cable tray is suspended from the soffit on threaded rod hangers with pressed bracket fixings. At the far end of the visible run, cables cross onto the tray with no visible tray edge protection or drop-out restraint, and the tray appears to terminate without a stop end. The visible condition of the tray itself is sound and the cables are dressed neatly within it.

Required action

Isolate and prove dead before working on the containment. Fit an end stop or drop-out plate to the tray termination and provide edge protection or a suitable protective device where cables enter and leave the tray, so that the cable sheath cannot chafe on the perforated edge. Confirm the finished arrangement against BS 7671:2018+A4:2026, with the specific regulation number to be confirmed.

Reference: BS 7671 - IET Wiring Regulations (18th Edition)



Pin 1 of 2 - photograph 4

A crop of the area this item refers to.



Photograph 5 - 2 items on this photograph, 2 pins on this photograph

Findings on this photograph

Pin 1 - Item 8 - The metal back box of the left-hand twin socket outlet protrudes proud of the plaster finish and the surrounding plas...

Pin 2 - Item 9 - Both twin socket outlets and the associated switch plate are installed at differing heights and the spacing between t...

Item 8

Status: Defective - rectification required Severity: Improvement item

The metal back box of the left-hand twin socket outlet protrudes proud of the plaster finish and the surrounding plaster has been broken away, leaving a gap between the box and the wall face. The box and its fixing lug are exposed, and the accessory plate does not sit flush against the finished wall. The level of enclosure integrity expected around an accessory at a finished wall is therefore not achieved at this position.

Required action

Isolate the circuit and prove dead before any work at the accessory. Make good the plaster reveal around the back box so that the box sits within the finished wall face, then refit the accessory plate square and flush, ensuring the plate makes effective contact with the wall and that no gap remains around its perimeter. Where the box cannot be brought back, engage a competent person to reset it. Energise only after the accessory has been refitted and the circuit verified.

Reference: BS 7671 - IET Wiring Regulations (18th Edition)



Pin 1 of 2 - photograph 5

A crop of the area this item refers to.

Item 9

Status: Improvement recommended Severity: Improvement item

Both twin socket outlets and the associated switch plate are installed at differing heights and the spacing between the plates is irregular, with the left-hand outlet set lower than the outlet to its right. The mounting heights have not been set consistently along the wall run.

Required action

Where the wall finish is to be reworked in any event, reset the boxes to a common height datum, taken from the finished floor level, and confirm the heights against the project specification before closing up. The circuit must be isolated and proved dead before any box is repositioned, and the accessories re-verified on completion.



Pin 2 of 2 - photograph 5

A crop of the area this item refers to.

Item 7

Status: Improvement recommended Severity: Improvement item

A flat accessory box is mounted within the trunking run and is secured by only two screws, set diagonally. The remaining fixing positions are unfilled, and the box does not present as a fully fixed, closed enclosure consistent with good installation practice.

Required action

Isolate the circuit and prove dead, then secure the accessory at all its fixing positions using the appropriate screws and close the enclosure fully. Confirm the terminations within the box and test the circuit before re-energising.

Reference: BS 7671 - IET Wiring Regulations (18th Edition)



Item 2


Status: Improvement recommended **Severity:** Improvement item

A brass main earthing bar is mounted on a bare concrete wall within an enclosure position. Six green/yellow circuit protective conductors are terminated to the bar by individual crimped lugs under set screws. A further connection is taken from a small square brass block fitted to the bar by a single bolt, and a green/yellow conductor of smaller cross-sectional area runs from that block to a brass earthing clamp on the adjacent copper pipe. The lug terminations on the bar are made at a consistent pitch and the conductors are dressed in a bundle to the lower left. The bar is fixed directly to the concrete wall face without an insulating stand-off, and the incoming conductors are not enclosed in conduit or trunking at the point where they leave the bar, so the protective conductors remain exposed and unsupported over the bundle to the left of the bar. The conductors are not individually identified by circuit.


Required action

Isolate and prove dead before any work to the bar. Re-form the conductor bundle into a defined route and secure it at regular centres to the wall or into a length of trunking or conduit, so that no protective conductor is left free-dressed. Fit individual circuit identification to each protective conductor by durable numbering or ferruling, and record the conductor sizes and the earth fault loop impedance readings in the schedule of test results. Confirm the continuity of every protective conductor and the main protective bonding connection by test, issued by a competent person on a certificate.

Reference: BS 7671 - IET Wiring Regulations (18th Edition)

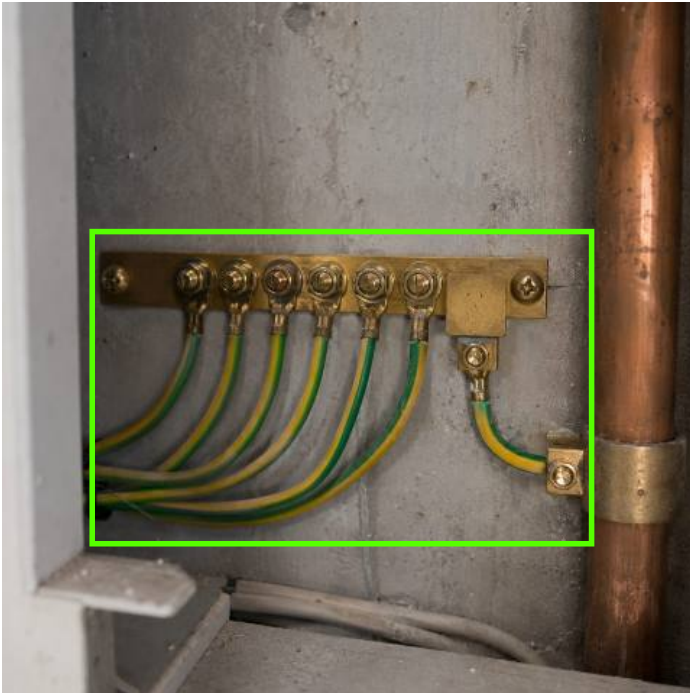

Further investigation

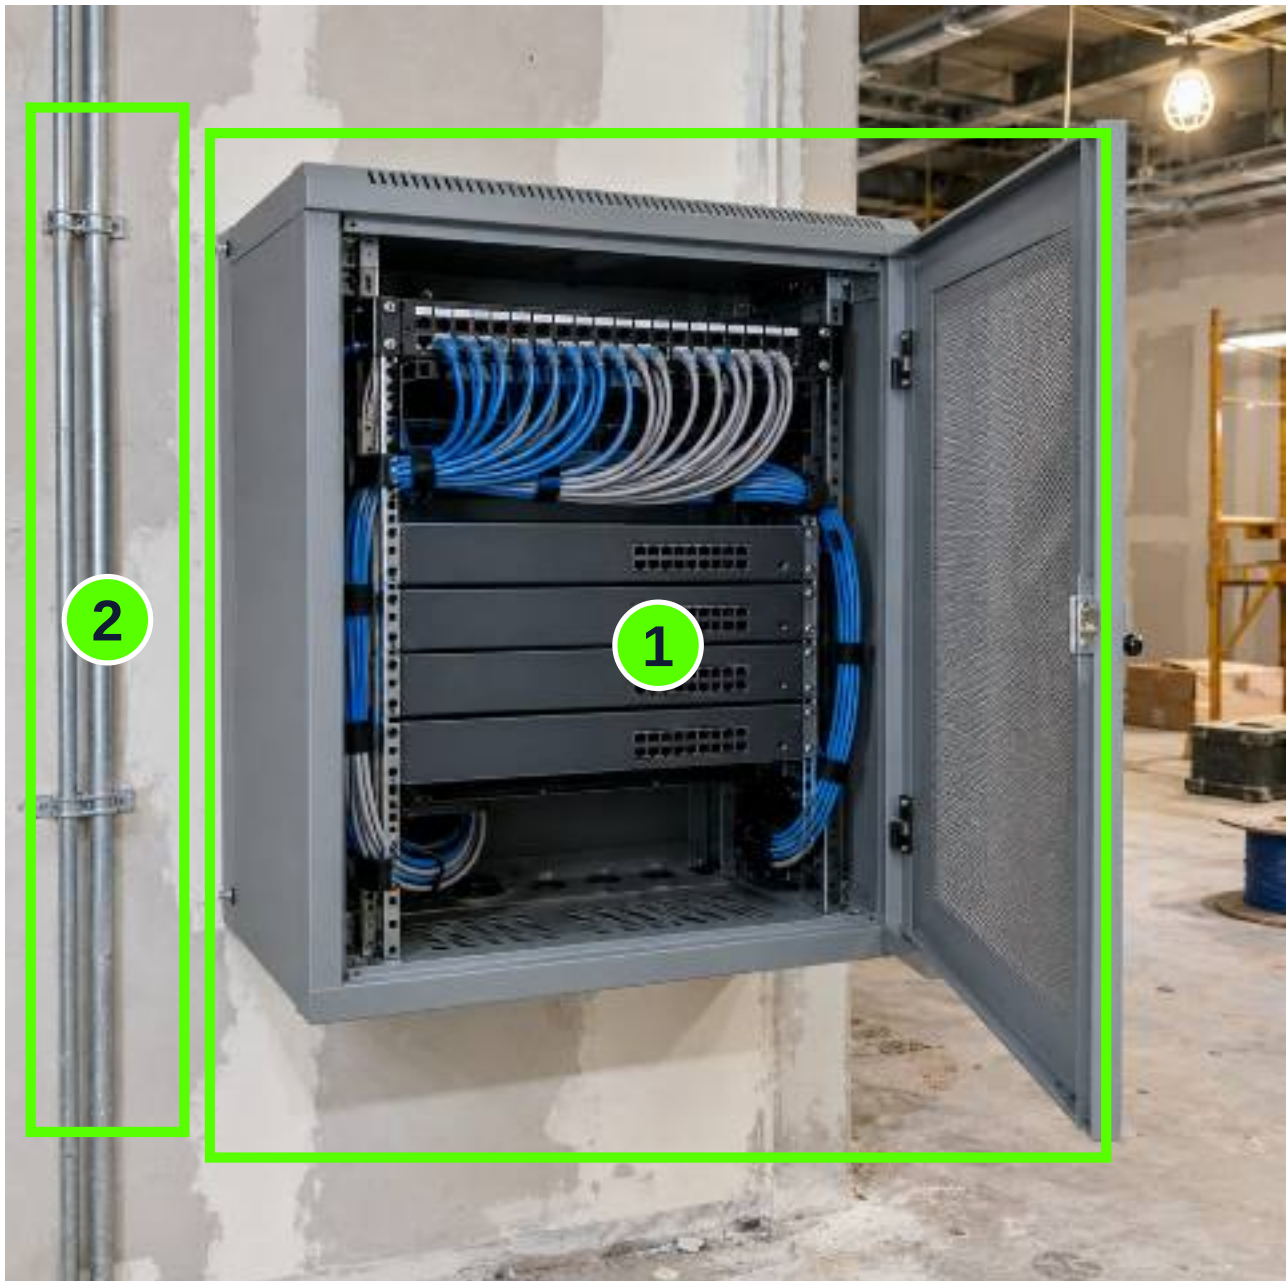

Photograph 7 - 2 items on this photograph, 2 pins on this photograph

Findings on this photograph

Pin 1 - Item 5 - A wall-mounted steel communications cabinet is secured to a plastered wall with its mesh door open and undamaged.

Pin 2 - Item 6 - A galvanised steel conduit drop is fixed to the plastered wall to the left of the cabinet with two metal saddles, sec...

Item 5

Status: Improvement recommended **Severity:** Further investigation

A wall-mounted steel communications cabinet is secured to a plastered wall with its mesh door open and undamaged. Data cabling within the cabinet is dressed with hook-and-loop ties and formed into a service loop. The cable management is neat, terminated and complete, and no exposed live conductive part is visible. The cabinet is a communications enclosure rather than a power distribution board, and no mains intake, protective device or earthing arrangement is visible within it.

Required action

Confirm the cabinet is correctly identified and that any metallic enclosure is bonded and earthed by a competent person, and verify the supply and protective device arrangement. Testing and certification by a competent person are required before the installation is signed off.

Reference: BS 7671 - IET Wiring Regulations (18th Edition)



Pin 1 of 2 - photograph 7

A crop of the area this item refers to.

Item 6

Status: Improvement recommended **Severity:** Further investigation

A galvanised steel conduit drop is fixed to the plastered wall to the left of the cabinet with two metal saddles, secured with visible screw fixings. The conduit run terminates below the level of the cabinet without a visible coupling, draw box or terminating accessory at the point shown, and its relationship to the cabinet is not evident from the photograph. The containment is supported and undamaged; the termination of the run cannot be confirmed from this view.

Required action

Inspect the full conduit run and confirm it terminates in an appropriate accessory and enters the enclosure or equipment correctly. Rectify any open end or unsupported termination. Testing and certification by a competent person are required where the run carries mains conductors.

Reference: BS 7671 - IET Wiring Regulations (18th Edition)



Pin 2 of 2 - photograph 7


A crop of the area this item refers to.

Severity not set

Item 12

Status: Compliant - no action

To the left of the image, cable tray and basket containment are installed at high level above the ceiling line, carrying services in a runs arrangement with drops to plant. The containment is supported at regular intervals and the cable runs within it are laid in an orderly manner. No defect in the containment or its support is apparent at the distance shown.

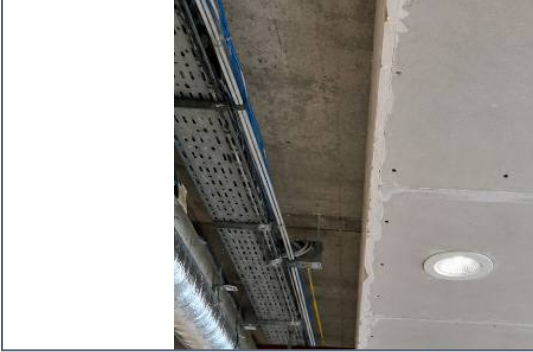

Pin 3 of 3 - photograph 2

A crop of the area this item refers to.