

Finding identification & remedial schedule - 8 October 2026


Project	Riverside Court - Cat B Fit-Out, Phase 2
Client	Halloway Cross Estates Ltd
Address	Riverside Court, 42 Kelham Street, Sheffield S3 8LP
Reference	SNG-2026-10-006
Report date	8 October 2026
Status	Draft - not yet published
Items included	20

RESULTS

Not assessed - a person must resolve these

PHOTOGRAPHS CARRYING SEVERAL ITEMS

Each of these takes a page of its own: a numbered pin on the photograph for every item found on it, and those items listed underneath in pin order. An item's entry in the schedule points back at its pin.

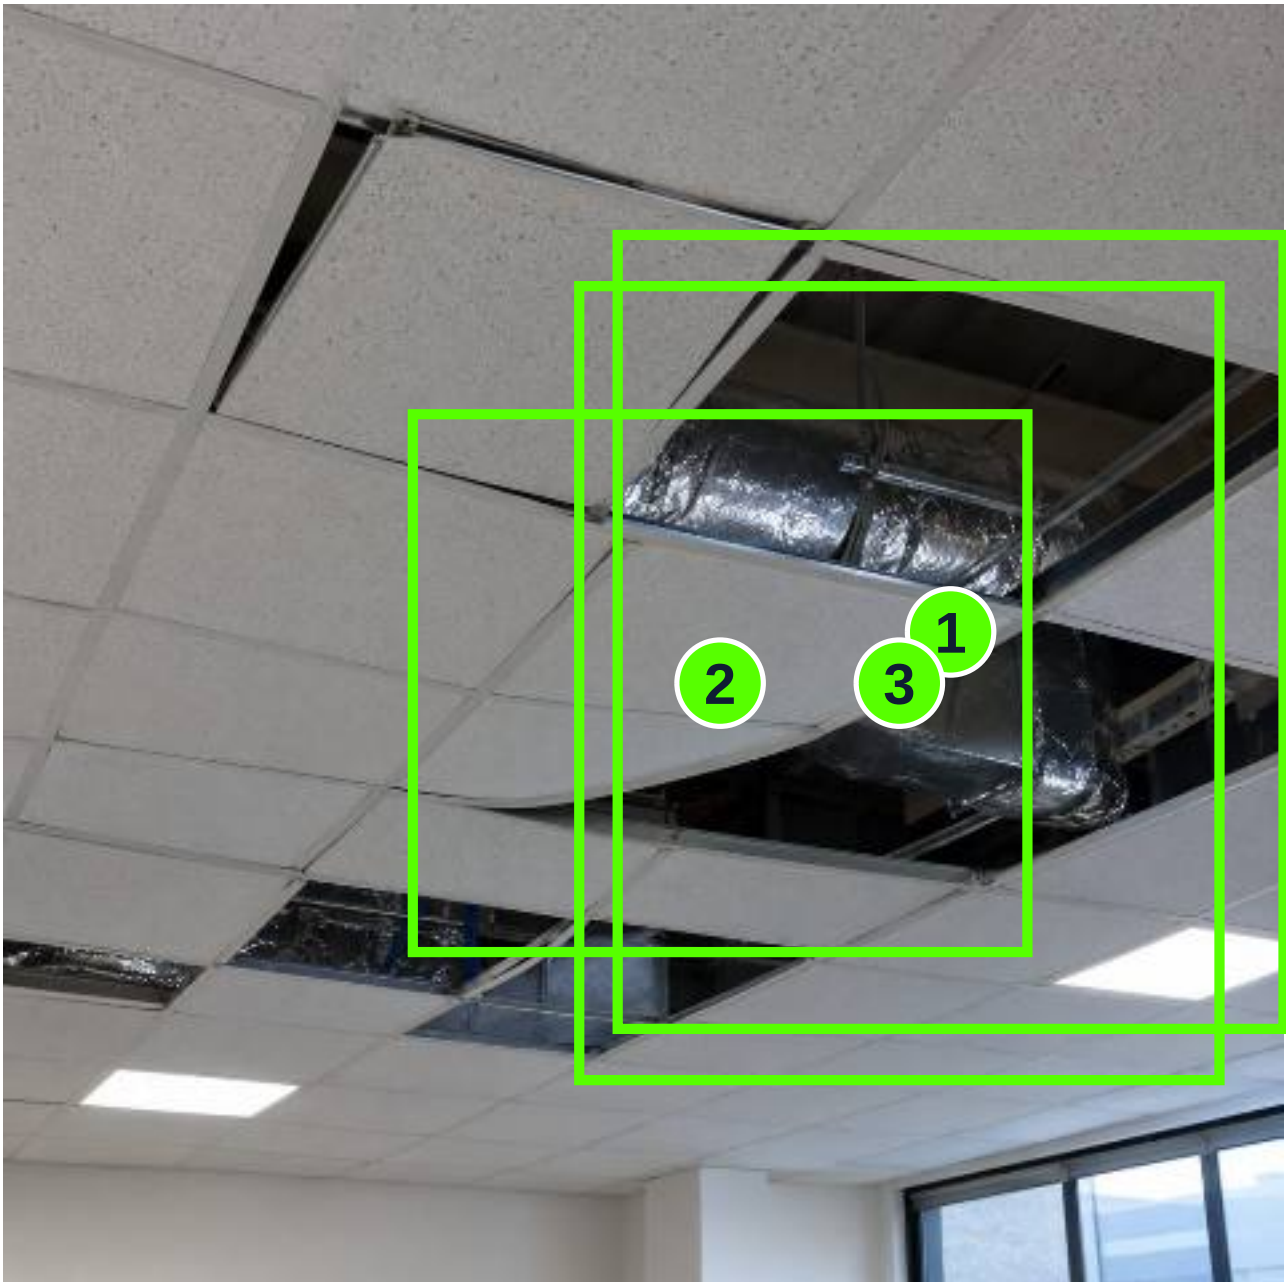

Photograph 8 - 3 items on this photograph, 3 pins on this photograph

Findings on this photograph

Pin 1 - Item 7 - Four ceiling tiles are absent from the suspended grid, exposing the ceiling void.

Pin 2 - Item 8 - Pieces of ceiling tile are sagging below the underside of the grid, one adjacent to the open void at the centre of th...

Pin 3 - Item 9 - Within the open void, a length of insulated ventilation duct wrapped in foil-faced insulation is visible.

Item 7

Status: Not assessed

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

Four ceiling tiles are absent from the suspended grid, exposing the ceiling void. The surrounding tile edges remain in place within the grid. It cannot be determined from the photograph whether the tiles have been removed for access to the services above or whether they are missing as a defect, and the exclusion for work in progress applies until that is confirmed.

Required action

Establish on site whether the tiles have been removed for maintenance access. If they have, they are to be replaced on completion of the works; if not, replacement tiles to be sourced to match the existing pattern and installed. No fix should be specified until the reason for removal is known.



Pin 1 of 3 - photograph 8

A crop of the area this item refers to.

Item 9

Status: Not assessed

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

Within the open void, a length of insulated ventilation duct wrapped in foil-faced insulation is visible. The insulation is creased and reflective where it passes over the grid line at the upper left of the opening. No duct appears to be supported directly off the ceiling grid in the area shown. The visible surfaces appear dry and intact. Duct installation is commonly left incomplete at the time of the photograph, and this cannot be resolved from a single image.

Required action

Before handover, verify the duct support spacing and the continuity of the vapour-tight insulation against the duct manufacturer's installation instructions and the project specification. Where the insulation has been disturbed or gapped at the grid line, re-dress and tape the joints to restore the vapour seal.



Pin 3 of 3 - photograph 8

A crop of the area this item refers to.



Photograph 9 - 2 items on this photograph, 2 pins on this photograph

Findings on this photograph

Pin 1 - Item 19 - The concrete floor slab carries a continuous crack running diagonally across the visible floor area, from the thresho...

Pin 2 - Item 20 - At the threshold opening, the junction between the concrete floor slab and the base of the blockwork wall and the doo...

Item 20

Status: Not assessed Severity: Workmanship

Not assessed. This item was not resolved by a person and is included here unchanged. Reason recorded: the model's confidence was below the threshold for this survey type.

At the threshold opening, the junction between the concrete floor slab and the base of the blockwork wall and the door frame is broken down, with loose aggregate, mortar and debris present in the gap. The frame sits on a small mortar or screed bed which is crumbly and uneven, and there is a visible gap between the underside of the frame and the slab. The extent of the gap and whether a weather seal or damp-proof detail is present cannot be confirmed from this image.

Required action

Remove all loose mortar, aggregate and debris from the threshold junction and clean back to sound material. Confirm on site whether this is an external opening: if it is, the threshold must incorporate a continuous damp-proof course and a sealed weather detail in accordance with the manufacturer's instructions for the frame system. Re-point and make good the base bed to the frame, sealing the junction with a suitable external-grade sealant, and ensure the damp-proof course is lapped and continuous. Refer the detail to the principal contractor's design lead where the as-built junction does not match the specified detail.


Likely cause: Most likely the bedding or pointing at the threshold has broken down through impact from traffic or from the frame installation, or the base bed was laid on a dusty or unprepared slab and has debonded. It may also be that the junction has never been properly finished, and this is incomplete work still to be done.

Reference: Approved Document C - site preparation and resistance to contaminants and moisture



Pin 2 of 2 - photograph 9
A crop of the area this item refers to.

Cosmetic

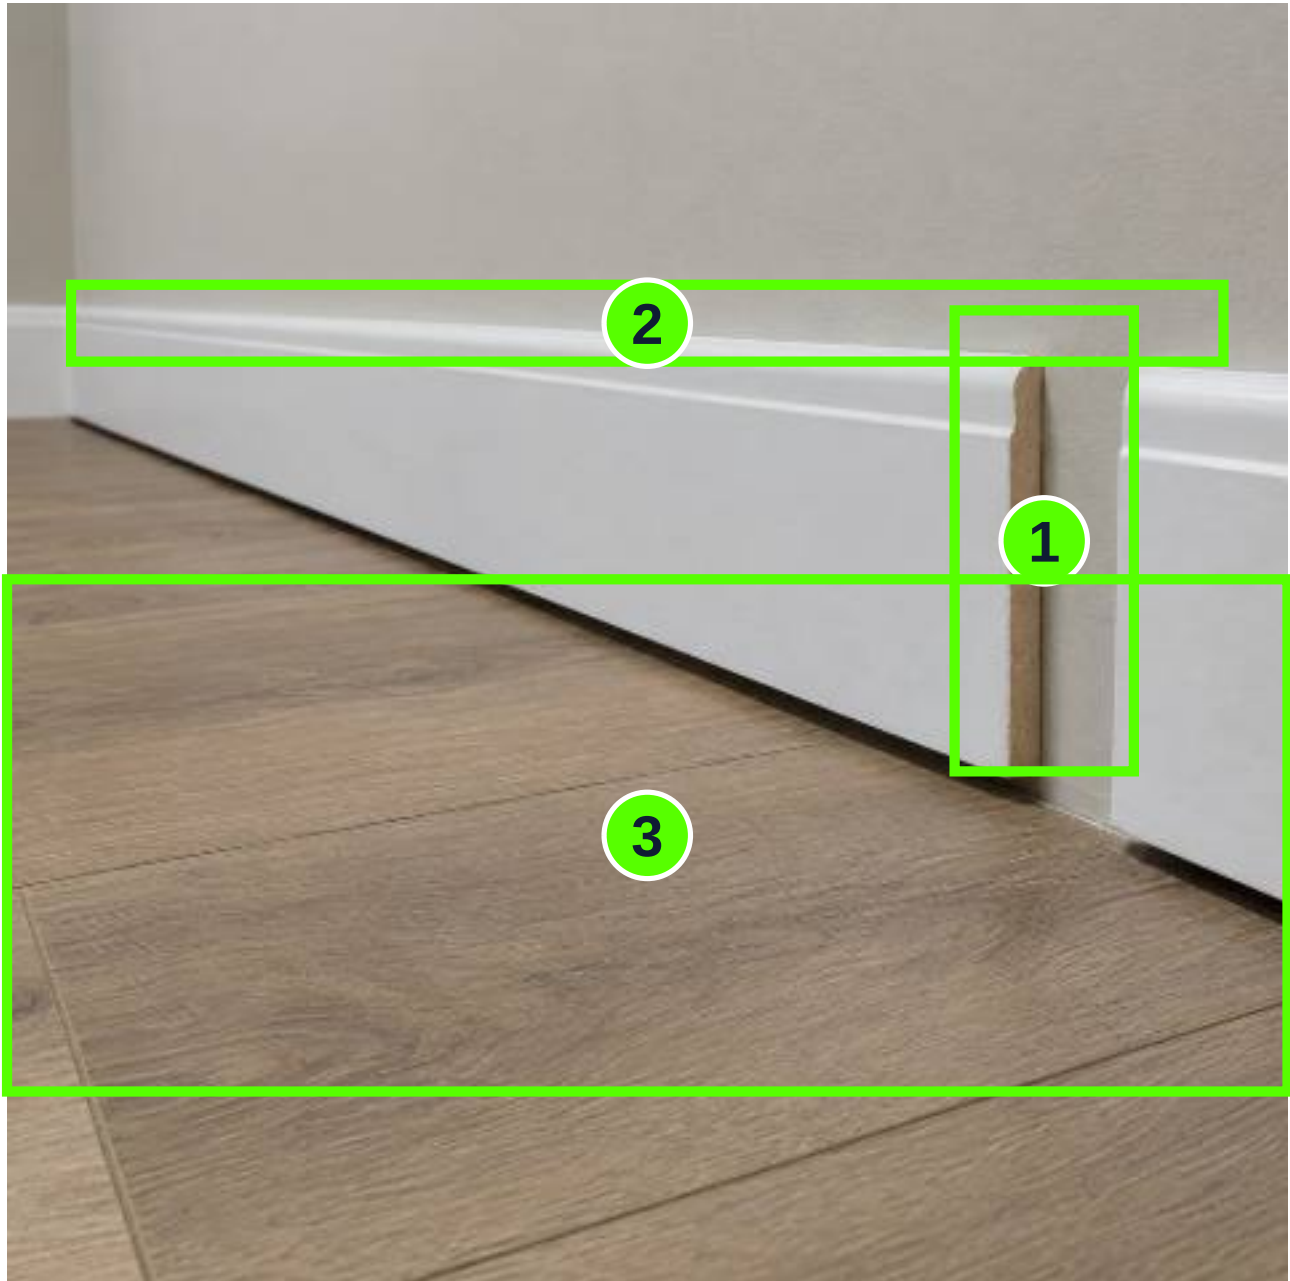

Photograph 1 - 3 items on this photograph, 3 pins on this photograph

Findings on this photograph

- Pin 1 - Item 16 - A length of primed skirting board has been fitted short against an adjoining return, leaving an open butt joint of ap...
- Pin 2 - Item 17 - The skirting boards appear to be fitted direct to the wall face with no visible caulk or sealant line to the top edge...
- Pin 3 - Item 18 - The junction between the floor covering and the base of the skirting is tight and appears to be covered by the skirt.

Item 17

Status: Finding - rectification required **Severity:** Cosmetic

The skirting boards appear to be fitted direct to the wall face with no visible caulk or sealant line to the top edge where the skirting meets the plaster. The junction reads as a hard painted edge rather than a sealed joint. The painted finish to the boards is otherwise sound and the face is free of runs or blistering.

Required action

Confirm on site whether a caulk line was specified to the top edge. Where it was, rake out and apply a paintable acrylic caulk to the junction, tool it off, allow to cure and decorate. Where no caulk was specified, confirm the specified finish before adding one, as some specifications deliberately call for a dry shadow gap.

Likely cause: The most likely cause is that decoration has been carried out without the sealing of the skirting junction, or that the sealant has yet to be applied. A photograph cannot confirm which, and the item may simply be work in progress.



Pin 2 of 3 - photograph 1

A crop of the area this item refers to.

Item 18

Status: Monitor - review before handover **Severity:** Cosmetic

The junction between the floor covering and the base of the skirting is tight and appears to be covered by the skirt. The flooring is laid with the boards running parallel to the wall and the joints are close. No scuffing, lifting or moisture staining to the floor covering is visible in the area shown.

Required action

Review the junction at handover once the skirting joint has been rectified, confirming the floor covering is not trapped or damaged by the skirting and that any specified expansion allowance at the perimeter is present. No action is required if the junction remains sound.



Pin 3 of 3 - photograph 1

A crop of the area this item refers to.



Photograph 2 - 3 items on this photograph, 3 pins on this photograph

Findings on this photograph

- Pin 1 - Item 13 - The silicone sealant at the junction between the rear upstand of the white ceramic basin and the tiled wall has been ...
- Pin 2 - Item 14 - A dark void is visible at the base of the sealant run where it meets the rear left corner of the basin upstand, appro...
- Pin 3 - Item 15 - Sealant residues are present on the glazed face of the basin adjacent to the tap and on the tile faces to the left of...

Item 15

Status: Acceptable - no action **Severity:** Cosmetic

Sealant residues are present on the glazed face of the basin adjacent to the tap and on the tile faces to the left of the joint. These appear to be surplus material from the sealing works rather than damage to the glaze.

Required action

Remove the residues with a plastic scraper and a suitable solvent or sealant remover, taking care not to abrade the glaze or the tile face, once the joint itself has been rectified.

Likely cause: Surplus sealant left on adjacent surfaces during application, without a final clean-up pass.

Reference: BS 8000 - workmanship on construction sites



Pin 3 of 3 - photograph 2

A crop of the area this item refers to.

Item 8

Status: Monitor - review before handover **Severity:** Cosmetic

Pieces of ceiling tile are sagging below the underside of the grid, one adjacent to the open void at the centre of the image and a further two in the lower left of the frame. The tiles have lost flatness and are sitting proud of the grid line. No staining or water marking is evident on the affected tiles from this view.

Required action


Lift and reseal the affected tiles onto the grid flanges. If the sagging recurs or the tiles will not sit flat, remove one tile and inspect the void for moisture, damaged grid sections or overloading. Replace any tile that remains deformed.

Likely cause: Moisture uptake, overloading or physical distortion during handling and installation are all plausible. A single photograph does not allow the cause to be established.



Pin 2 of 3 - photograph 8

A crop of the area this item refers to.

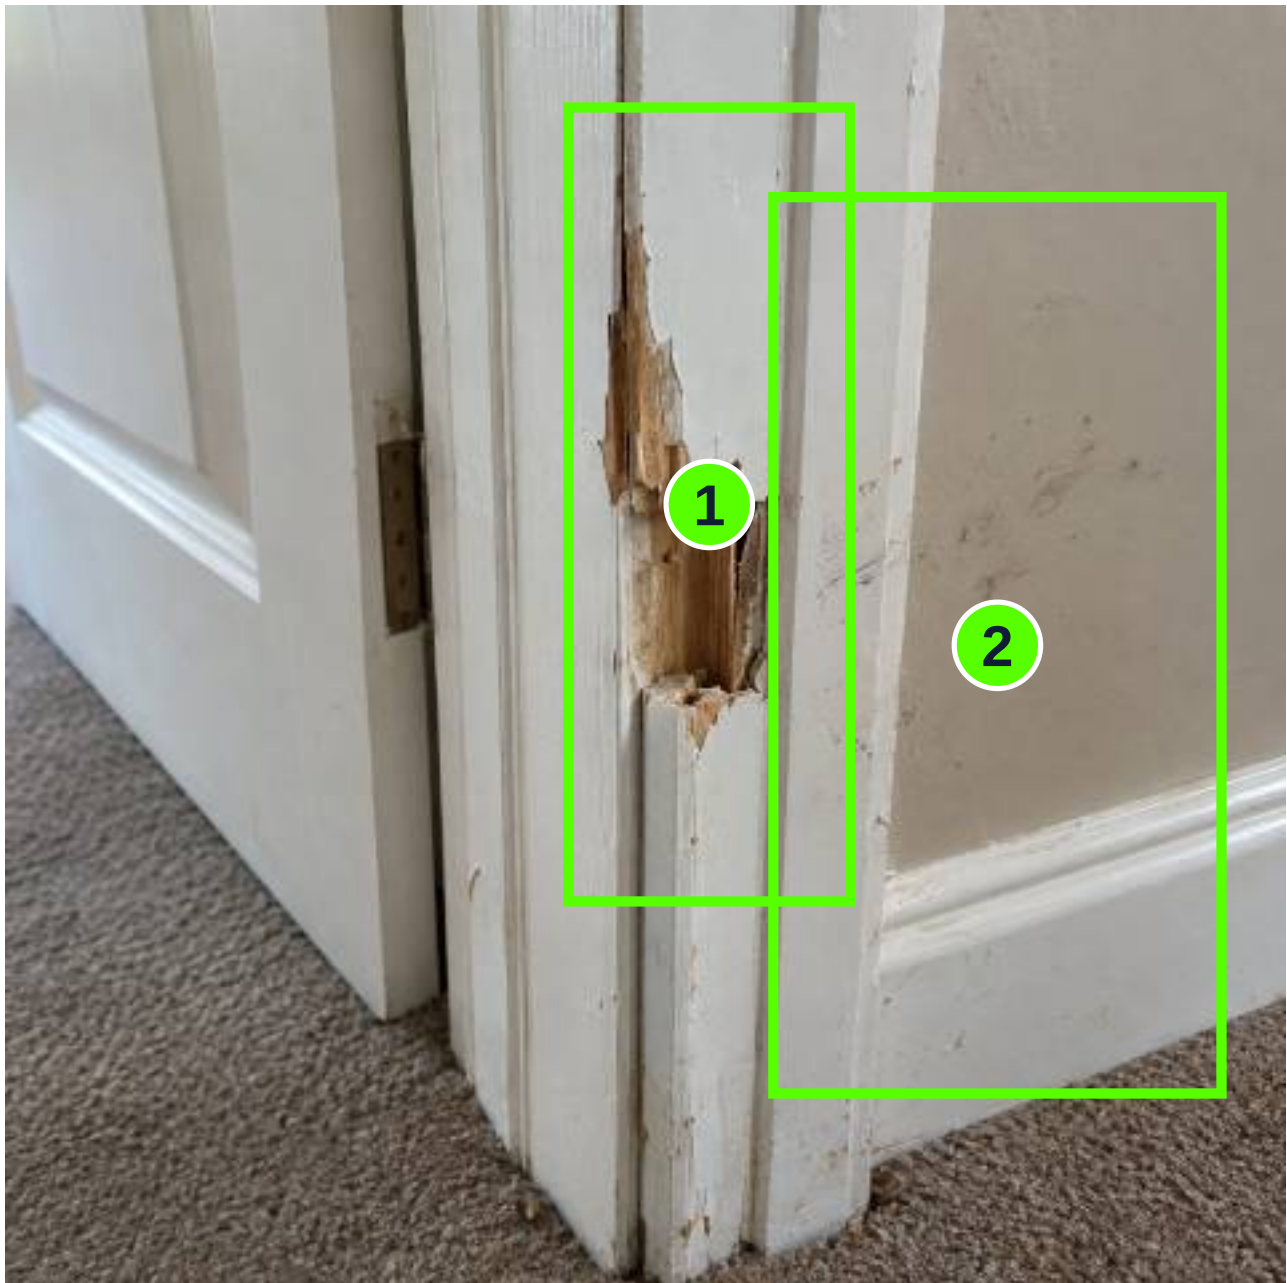

Photograph 10 - 2 items on this photograph, 2 pins on this photograph

Findings on this photograph

Pin 1 - Item 5 - The lower section of the door casing, at strike-plate height and immediately below it, has suffered significant loss ...

Pin 2 - Item 6 - The timber face of the casing to the right of the damaged area, and the adjacent section to the left, carry multiple ...

Item 6

Status: Monitor - review before handover **Severity:** Cosmetic

The timber face of the casing to the right of the damaged area, and the adjacent section to the left, carry multiple fine scratches, scuffs and filled marks in the painted finish, spread across an area of approximately 300 mm in height. The paint film is intact but the surface is inconsistent and shows evidence of previous local filling that has not been fully levelled.

Required action

Abrade the affected areas to a sound edge, spot prime any exposed substrate, fill and level the existing depressions, and apply a full preparatory coat and two finish coats to the casing to achieve a uniform finish.

Likely cause: The scuffing and uneven filling are most likely the result of handling and minor site damage, with subsequent local repair and filling carried out without full preparation of the surrounding finish.

Reference: BS 8000 - workmanship on construction sites



Pin 2 of 2 - photograph 10

A crop of the area this item refers to.

Workmanship

Item 16

Status: Finding - rectification required **Severity:** Workmanship

A length of primed skirting board has been fitted short against an adjoining return, leaving an open butt joint of approximately 8 to 10 mm between the two sections. The cut end of the board is exposed and unfinished, showing the bare MDF core with no primer, sealant or paint to the end grain. The gap is open along the full height of the skirting and is not filled.

Required action

Cut a short infill section of matching skirting to close the gap, or refit the board to a tight butt against the return. Prime all cut ends before fitting, fix to the wall with the specified adhesive and mechanical fixings, fill the joint, then caulk and decorate. Confirm on site who owns the joint between the skirting run and the adjoining return before making good.

Likely cause: The most likely cause is that the board was cut short during installation, either through inaccurate setting out or because the run was worked to a closing dimension and the last length was not measured back to the return. A secondary plausible cause is movement of the board after fixing, where insufficient or incorrectly spaced fixings have allowed the joint to open. It is not possible to determine from the photograph which of these applies.

Reference: BS 8000 - workmanship on construction sites



Pin 1 of 3 - photograph 1

A crop of the area this item refers to.

Item 13

Status: Finding - rectification required **Severity:** Workmanship

The silicone sealant at the junction between the rear upstand of the white ceramic basin and the tiled wall has been applied poorly and smeared across the tile face and the basin surfaces. The sealant line is irregular in width, feathered against the glaze, and spread in patches over an area roughly 250 mm wide and 120 mm high around the tap. Tooling is absent: the bead is left as a series of smears rather than a continuous fillet.

Required action

Cut out and remove the existing silicone mechanically with a sealant remover or sharp blade, clean both faces with a suitable solvent to remove all residue and grease, allow to dry, then apply a single continuous bead of sanitary-grade silicone and tool it immediately to a consistent fillet. The tiler or sanitaryware installer owns this junction.


Likely cause: The most likely cause is application of the sealant without tooling or masking, applied by an operative not experienced in sanitaryware sealing. An alternative or contributory cause is a re-seal carried out over an inadequately cleaned and prepared joint.

Reference: BS 8000 - workmanship on construction sites



Pin 1 of 3 - photograph 2

A crop of the area this item refers to.

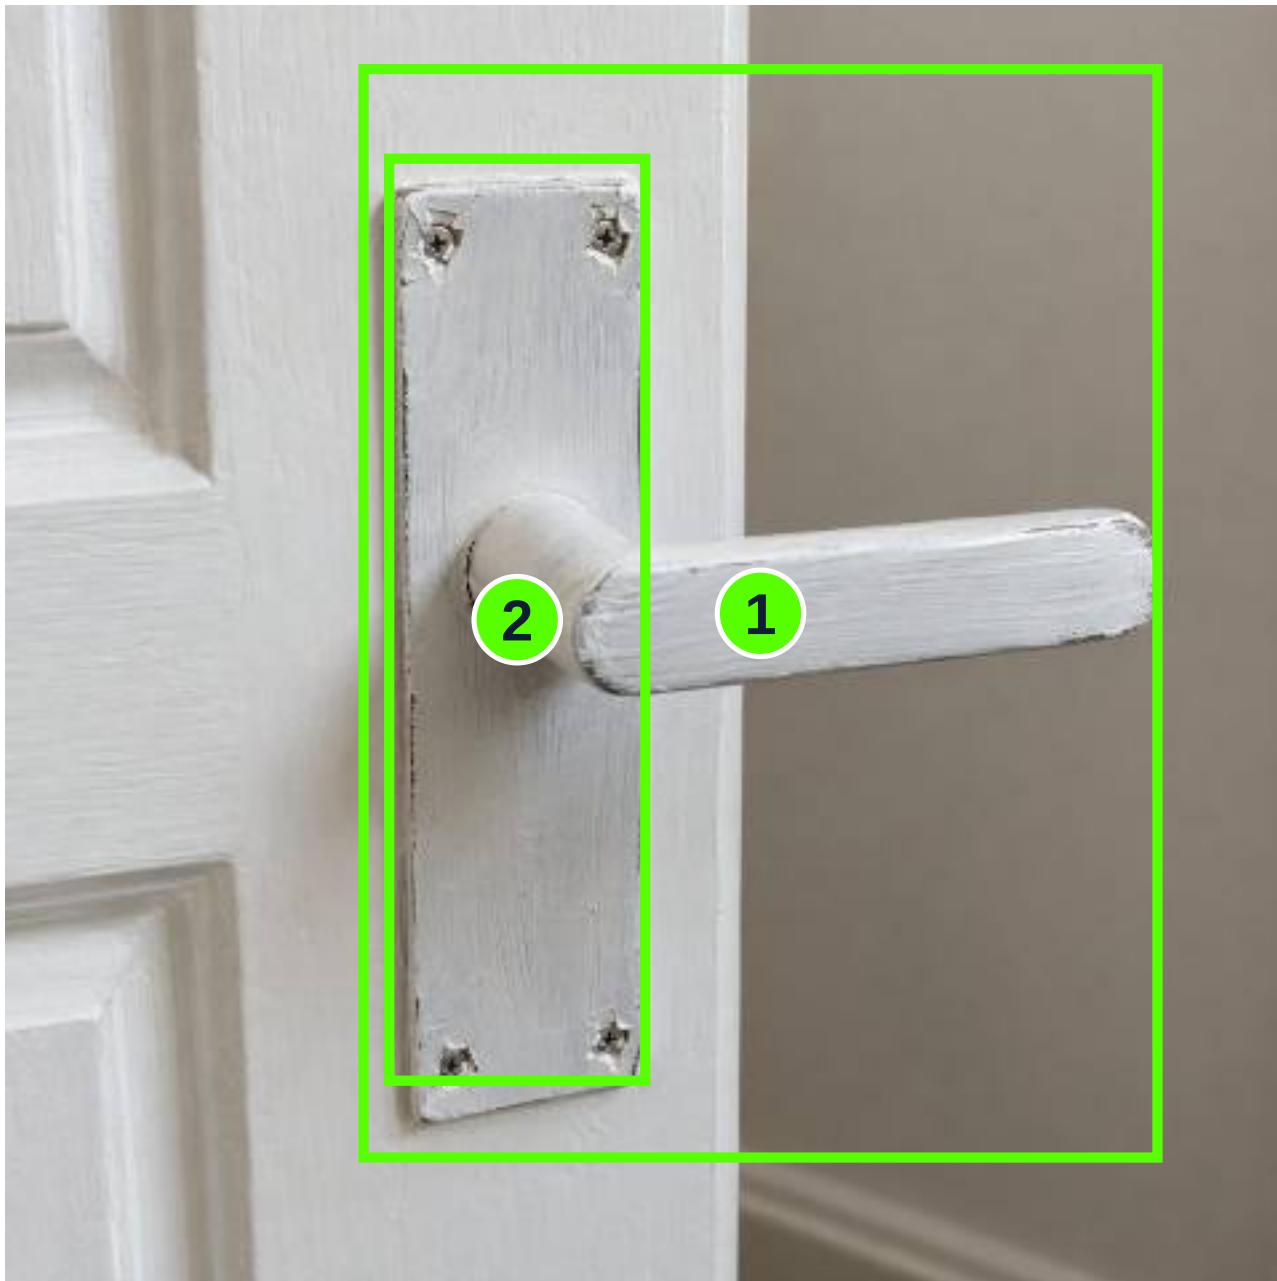

Photograph 3 - 2 items on this photograph, 2 pins on this photograph

Findings on this photograph

Pin 1 - Item 3 - The door lever handle has been painted over, with the coating bridging the lever, the rose and the backplate as a sin...

Pin 2 - Item 4 - The four backplate screws have been painted over and the coating has filled the screw slots.

Item 3

Status: Finding - rectification required **Severity:** Workmanship

The door lever handle has been painted over, with the coating bridging the lever, the rose and the backplate as a single continuous film of paint. The lever-to-rose junction is sealed by paint, and the brush marks run across the handle where the hand grips. The coating is heavy along the top edge of the lever, where it is most likely to chip away in use.

Required action

Strip the paint from the lever, rose and backplate, remove the handle from the door, clean the paint out of the screw slots and the lever pivot, and refit. Make good and redecorate the handle and backplate separately from the door leaf so that the lever is free to operate and is not bridged by paint.

Likely cause: The handle was left in place when the door was decorated, so the coating was applied across the lever, rose and backplate. Loss of the screw heads is a consequence of the same work rather than a separate cause.

Reference: BS 8000 - workmanship on construction sites



Pin 1 of 2 - photograph 3

A crop of the area this item refers to.

Item 4

Status: Finding - rectification required **Severity:** Workmanship

The four backplate screws have been painted over and the coating has filled the screw slots. The screw heads are buried in the coating and cannot be driven with a screwdriver without first cutting the paint out of each slot.

Required action

Cut the paint out of each screw slot, remove the backplate screws, clean the threads and slots, and refit the handle. Redecorate with the ironmongery removed, or mask the screw heads individually if the handle must remain in place.

Likely cause: The screws were not removed or masked before the door was painted, so the coating was applied directly over the fixing heads.

Reference: BS 8000 - workmanship on construction sites



Pin 2 of 2 - photograph 3

A crop of the area this item refers to.

Item 10

Status: Finding - rectification required Severity: Workmanship

The dark grey worktop surface carries a widespread pattern of fine surface scratching, with a denser concentration extending across approximately the front half of the visible counter and a further cluster of linear scratches running diagonally towards the front corner. The scratches are shallow and appear to be confined to the polished surface layer. The density of the marking indicates mechanical abrasion across a substantial part of the visible area rather than a single localised scuff.

Required action

Confirm the worktop material and its specified finishing regime before any action is taken. Establish whether the abrasion is confined to the surface layer or has penetrated the decorative finish; where it is superficial, a specialist stone or solid-surface restorer should undertake a controlled abrasive polish of the affected area and re-establish the specified sheen. Where the marking extends below the surface layer, the affected section will require replacement and re-jointing to the upstand and sink cut-out. Photographic records of the affected area should be taken before works commence, as further scratching is likely during any remaining site activity.

Likely cause: Mechanical abrasion during handling, storage, installation or the protection regime. Protection left in place too long, or grit trapped beneath protective covering, is a common contributor. The photograph does not permit the cause to be established with certainty.

Reference: BS 8000 - workmanship on construction sites



Item 2

Status: Finding - rectification required **Severity:** Workmanship

The external corner between the two plastered wall faces is damaged over a vertical run of approximately 200mm. A metal angle bead is exposed along the corner and the plaster skim has broken away from it in irregular flakes, leaving the grey backing coat and the bright metal bead visible. The damage is widest at the upper third of the exposed section, roughly 60mm across on the face to the right, and tapers to a crack below. The remaining plaster edges are proud and feather-edged, and the painted finish is fractured back from the break line.


Required action

Cut back the paint and loose plaster to sound, well-bonded material around the full extent of the damage. Check the angle bead is correctly fixed and does not move under finger pressure; refix or replace if it is loose, and confirm it is set plumb and true before making good. Pre-wet the edges, fill flush over the bead with a suitable patching plaster in two coats, allow to dry, then fill and sand the corner to a true arris. Spot prime and repaint the full corner to a natural break in the wall finish so the patch does not read. Carry out after the room is otherwise finished to avoid repeat damage.

Likely cause: Most likely impact damage to the corner arris after plastering, either from a trolley, board or other site movement, which has broken the skim away from the bead. A secondary possibility is that the bead was not adequately bedded or fixed, so the plaster never bonded to it and failed under minor contact. The photograph alone does not establish which, and both should be checked on site before the repair is specified.

Reference: BS 8000 - workmanship on construction sites



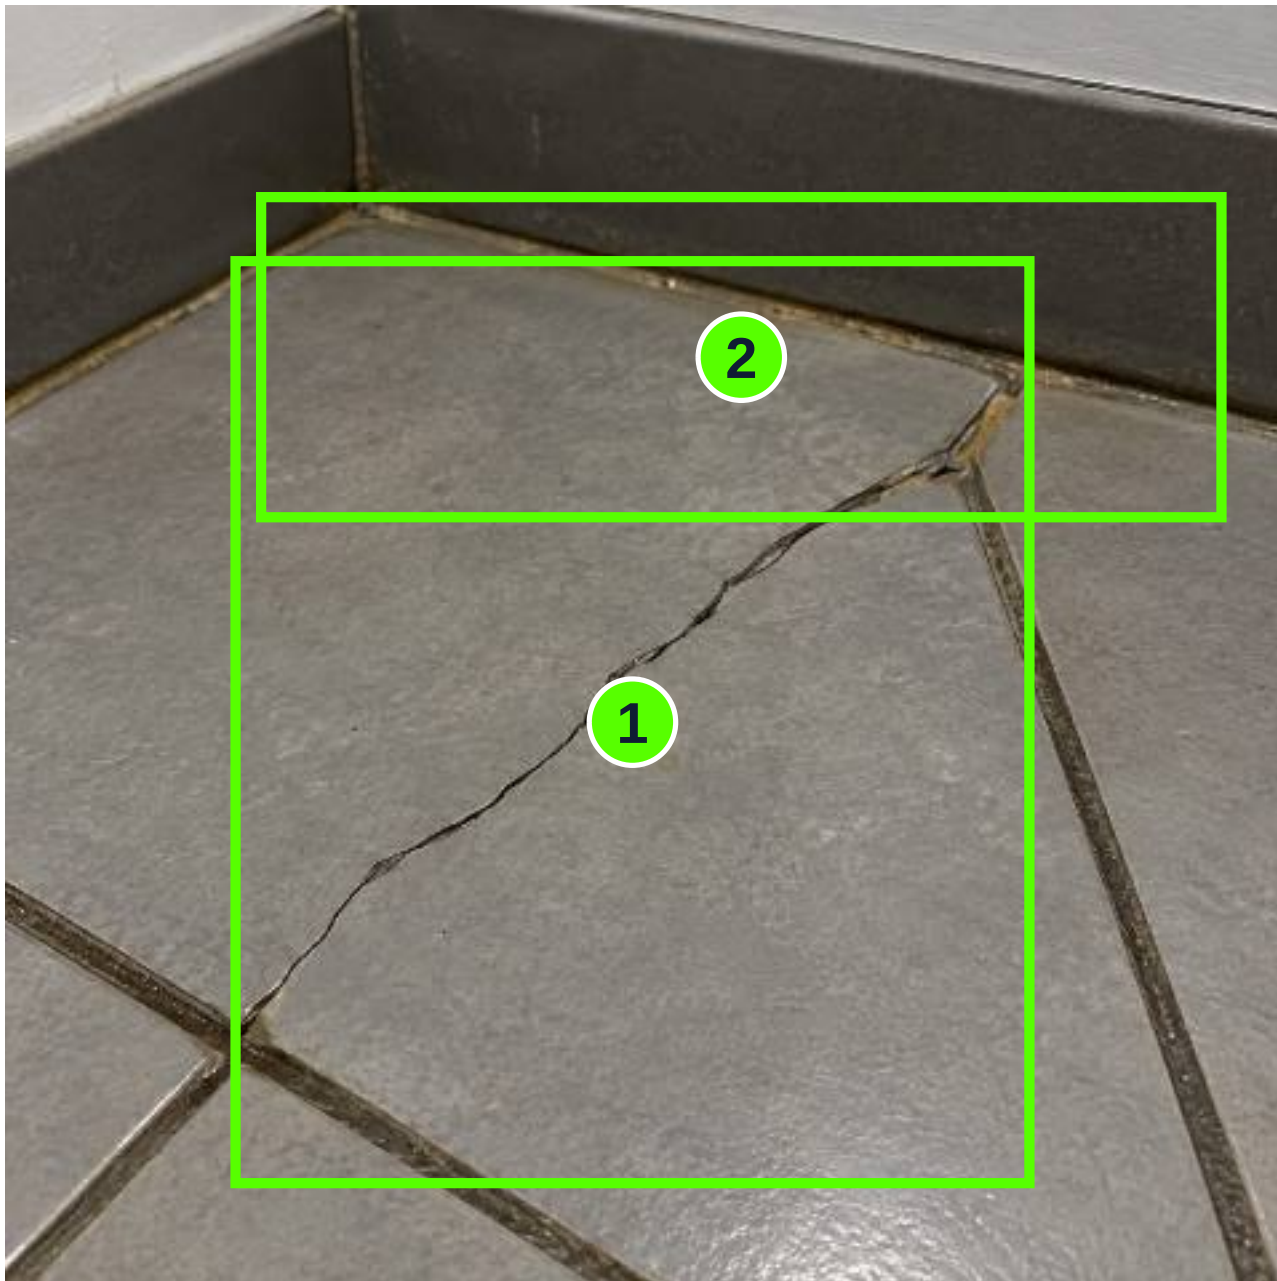

Photograph 6 - 2 items on this photograph, 2 pins on this photograph

Findings on this photograph

Pin 1 - Item 11 - A single diagonal crack runs across one floor tile for approximately 400 mm, passing through the tile body from the j...

Pin 2 - Item 12 - The expansion or movement gap between the perimeter of the tile field and the base of the skirting is filled with gro...

Item 12

Status: Monitor - review before handover Severity: Workmanship

The expansion or movement gap between the perimeter of the tile field and the base of the skirting is filled with grout rather than a compressible sealant. The junction is bridged hard over its visible length of approximately 1.5 m, and the grout line at this interface shows fine hairline separation in places.

Required action

Rake out the grout at the perimeter junction back to a clean, dry, sound substrate and install a compressible backing rod with a flexible sealant compatible with the tile and skirting, leaving the joint free to move. Confirm the joint owner: the perimeter movement joint at a skirting interface is normally the tiling trade's responsibility, with the skirting itself the joiner's, and the interface must be agreed on site before work proceeds.

Likely cause: The grout appears to have been carried into the perimeter joint in place of a compressible sealant, most likely because the movement joint detail was not identified or was overlooked at installation.

Reference: BS 8000 - workmanship on construction sites



Pin 2 of 2 - photograph 6

A crop of the area this item refers to.

Item 1

Status: Finding - rectification required **Severity:** Workmanship

At the striker plate position on the closing jamb, the timber reveal behind the metal plate has broken away and the plate is bedded unevenly against the cut. The painted face of the lining adjacent to the plate is chipped and ragged over an area of approximately 40 mm by 60 mm, and the plate sits proud of the surrounding face. The strike is not rebated flush into sound timber.

Required action

Remove the strike plate and ironmongery from the jamb. Cut out the damaged section of lining and let in a solid timber repair, or replace the affected length of lining. Re-form a clean rebate to the correct depth, refit the strike plate flush and true, and make good the paint finish. Confirm the door latch engages fully and the door closes without effort before decoration is signed off.

Likely cause: Most probably the strike rebate was cut too deep or the fixing screws were over-tightened, causing the plate to pull and the surrounding timber to break out. It is also possible the lining is of a composite or hollow construction that does not accept a rebate well.

Reference: BS 8000 - workmanship on construction sites



Item 5

Status: Finding - rectification required **Severity:** Workmanship

The lower section of the door casing, at strike-plate height and immediately below it, has suffered significant loss of timber. A ragged area of paint and substrate, approximately 120 mm in height and 40 mm in width, has been broken away to reveal exposed softwood grain and splintered fibre. The damage penetrates below the paint film into the body of the architrave or liner, and the painted edge returns are cracked and lifting around the perimeter of the loss.

Required action

Rake out all loose and friable material from the damaged area and cut back to sound timber. Fill the void in layers using a two-part repair filler or a timber dutchman securely fixed and glued, then sand flush with the surrounding face. Prime the bare timber, carry out local filling of the surrounding paint cracks, and apply two coats of finish to match the existing door casing.

Likely cause: The damage is most likely the result of impact from a door-mounted item, a skip or trolley, or the door being forced against the strike plate. It may also be the consequence of the strike plate having been set proud and binding, causing the timber to break away under repeated use. The photograph does not permit the cause to be determined with certainty.

Reference: BS 8000 - workmanship on construction sites



Pin 1 of 2 - photograph 10

A crop of the area this item refers to.

Performance

Item 14

Status: Finding - rectification required **Severity:** Performance

A dark void is visible at the base of the sealant run where it meets the rear left corner of the basin upstand, approximately 40 mm long. The sealant bridges across the gap rather than filling the junction, so an open edge remains at the tile-to-basin interface.

Required action

Remove the bridging sealant, clean out and dry the joint, then fully pack and seal the junction with sanitary-grade silicone carried in a continuous bead into the corner. Where the gap exceeds the sealant's movement capability, insert a closed-cell backing rod first. Further opening up may be required if water has already tracked behind the tiling.

Likely cause: The most likely cause is sealant applied over an unprepared or damp joint, preventing adhesion across the full depth of the gap. A second possibility is insufficient sealant applied to a joint wider than the practical limit for a single bead.

Reference: BS 8000 - workmanship on construction sites



Pin 2 of 3 - photograph 2

A crop of the area this item refers to.

Item 11

Status: Finding - rectification required **Severity:** Performance

A single diagonal crack runs across one floor tile for approximately 400 mm, passing through the tile body from the joint at the lower left corner up to the joint at the upper right, where it terminates at the wall skirting. The crack is open and continuous over its full length, with slight lippage visible at the fracture line. The tile remains in place but is fractured through its thickness.

Required action

Cut out and replace the affected tile. Rake back the bedding and adhesive to sound material, check the screed beneath for cracking or debonding, and re-lay on a full bed of flexible adhesive to the manufacturer's instructions, leaving the correct perimeter and movement joints. Do not fill or grout over the crack. Confirm whether the crack propagates into adjacent tiles or the screed before replacement is specified, as a wider substrate defect would change the repair.

Likely cause: Most likely impact damage from a dropped object or point load during construction traffic, or thermal or moisture movement where no movement joint has been provided. A defect in the screed or bedding beneath the tile is also plausible and cannot be excluded from the photograph.

Reference: BS 8000 - workmanship on construction sites



Pin 1 of 2 - photograph 6

A crop of the area this item refers to.

Item 19

Status: Finding - rectification required Severity: Performance

The concrete floor slab carries a continuous crack running diagonally across the visible floor area, from the threshold of the opening in the lower left towards the right edge. The crack is irregular and meandering, with a width generally in the order of 2 to 4 mm, opening slightly wider at the junction with the wall and threshold, where the slab edge is visibly broken down and spalled. Localised loss of surface material and loose arisings are present alongside the crack over a length of approximately 0.5 m. The crack extends beyond the frame of the photograph, and its full length and termination cannot be established from this image.

Required action

Establish the full extent and depth of the crack by opening up with a proprietary crack-width gauge and, where depth is in doubt, a limited core or drilled investigation. Where the crack is confirmed to be a static shrinkage or settlement crack and is no longer moving, rake out the crack to a sound profile, remove loose material, and fill with a semi-rigid epoxy or cementitious repair mortar to the slab manufacturer's instructions. Where the crack is wider than 5 mm or shows vertical displacement between the faces, refer to the structural engineer before filling. Record the crack with a tell-tale or crack gauge for a monitoring period where movement is suspected. Make good the spalled arisings at the threshold before final floor finishes are laid.

Likely cause: The crack is most likely a shrinkage or early-age movement crack in the slab, or a settlement crack at the junction between the slab and the wall or threshold. It may also follow the line of a construction joint or the edge of a thinner section of slab. A single photograph cannot establish the cause with certainty, and the pattern and width need to be confirmed on site, with a structural assessment where the crack is wide or shows displacement.

Reference: Approved Document A - structure



Pin 1 of 2 - photograph 9

A crop of the area this item refers to.