

Finding identification & remedial schedule

8 October 2026

PROJECT	Riverside Court - Cat B Fit-Out, Phase 2
CLIENT	Halloway Cross Estates Ltd
ADDRESS	Riverside Court, 42 Kelham Street, Sheffield S3 8LP
REFERENCE	SNG-2026-10-006
REPORT DATE	8 October 2026
STATUS	Issued as version 1 on 8 October 2026

18 ITEMS IN THIS SCHEDULE

● Performance 3

● Workmanship 10

● Cosmetic 5

BY TRADE

Tiler	5 items	Carpenter / joiner	4 items
Decorator	4 items	Principal contractor	2 items
Bricklayer	1 item	Plasterer	1 item
Structural	1 item		

SCOPE AND LIMITATIONS

This is a record of the defects observed, as seen on the date of inspection. It is not a structural survey and not a building survey, and it does not report on any matter outside the visible condition of the elements recorded. No opening up, no dismantling and no testing of any kind was carried out. Concealed or inaccessible areas are excluded, and no opinion is given on them. Nothing in this schedule is a specification, a scope of works or a construction instruction; any repair or replacement must be specified separately before work is carried out.

SPECIMEN - PROPOSED LAYOUT FOR REVIEW. NOT AN ISSUED REPORT.

Schedule of items

Listed worst first. Every item carries its own photograph and pin reference.

NO.	ITEM		TRADE	SEVERITY	PHOTO / PIN
PERFORMANCE - act on these first (3 items)					
1	F-011	Floor tile fractured diagonally, approx. 400 mm, open crack	Tiler	Performance	Ph 6 / pin 1
2	F-014	Unsealed gap at basin upstand and tile junction	Tiler	Performance	Ph 2 / pin 2
3	F-019	Continuous crack to floor slab with local spalling at threshold junction	Structural	Performance	Ph 9 / pin 1
WORKMANSHIP (10 items)					
4	F-001	Door strike plate not rebated flush, jamb timber broken out	Carpenter / joiner	Workmanship	Ph 7 / -
5	F-002	Broken plaster and exposed angle bead to external wall corner	Plasterer	Workmanship	Ph 5 / -
6	F-003	Door lever handle and backplate painted over, seizing the lever	Decorator	Workmanship	Ph 3 / pin 1
7	F-004	Backplate screw slots filled with paint, handle not removable	Decorator	Workmanship	Ph 3 / pin 2
8	F-005	Door casing damaged and broken away at strike-plate height	Carpenter / joiner	Workmanship	Ph 10 / pin 1
9	F-010	Extensive surface scratching to worktop	Principal contractor	Workmanship	Ph 4 / -
10	F-012	Perimeter movement joint grouted hard against skirting, not sealed	Tiler	Workmanship	Ph 6 / pin 2
11	F-013	Silicone sealant smeared across basin upstand and tiles	Tiler	Workmanship	Ph 2 / pin 1
12	F-016	Open butt joint and unfinished end grain to skirting	Carpenter / joiner	Workmanship	Ph 1 / pin 1
13	F-020	Broken threshold junction between slab, blockwork and frame with loose debris	Bricklayer	Workmanship	Ph 9 / pin 2
COSMETIC (5 items)					
14	F-006	Scuffed and poorly levelled paint finish to door casing	Decorator	Cosmetic	Ph 10 / pin 2
15	F-008	Ceiling tiles sagging below grid line	Carpenter / joiner	Cosmetic	Ph 8 / -
16	F-015	Sealant residue on basin and tile glazed faces	Tiler	Cosmetic	Ph 2 / pin 3
17	F-017	Absent sealant line to top of skirting	Decorator	Cosmetic	Ph 1 / pin 2
18	F-018	Floor to skirting junction to be reviewed at handover	Principal contractor	Cosmetic	Ph 1 / pin 3

SPECIMEN - proposed contents page. The issued report has no contents page at all.

Floor tile fractured diagonally, approx. 400 mm, open crack

Severity: Performance

Trade: Tiler

Photograph 6, pin 1

F-011

FINDING
A single diagonal crack runs across one floor tile for approximately 400 mm, passing through the tile body from the joint at the lower left corner up to the joint at the upper right, where it terminates at the wall skirting. The crack is open and continuous over its full length, with slight lippage visible at the fracture line. The tile remains in place but is fractured through its thickness.

REQUIRED ACTION
Cut out and replace the affected tile. Rake back the bedding and adhesive to sound material, check the screed beneath for cracking or debonding, and re-lay on a full bed of flexible adhesive to the manufacturer's instructions, leaving the correct perimeter and movement joints. Confirm whether the crack propagates into adjacent tiles or the screed before replacement is specified.

LIKELY CAUSE
Most likely impact damage from a dropped object or point load during construction traffic, or thermal or moisture movement where no movement joint has been provided. A defect in the screed or bedding beneath the tile is also plausible and cannot be excluded from the photograph.



Photograph 6, pin 1 - area this item refers to

Continuous crack to floor slab with local spalling at threshold junction

Severity: Performance

Trade: Structural


Photograph 9, pin 1

F-019

FINDING
The concrete floor slab carries a continuous crack running diagonally across the visible floor area, from the threshold of the opening in the lower left towards the right edge. The crack is irregular and meandering, with a width generally in the order of 2 to 4 mm, opening slightly wider at the junction with the wall and threshold, where the slab edge is visibly broken down and spalled. The crack extends beyond the frame of the photograph, and its full length and termination cannot be established from this image.

REQUIRED ACTION
Establish the full extent and depth of the crack by opening up with a proprietary crack-width gauge and, where depth is in doubt, a limited core or drilled investigation. Where the crack is confirmed static, rake out to a sound profile and fill with a semi-rigid epoxy or cementitious repair mortar. Where the crack is wider than 5 mm or shows vertical displacement, refer to the structural engineer. Record with a tell-tale where movement is suspected.

LIKELY CAUSE
The crack is most likely a shrinkage or early-age movement crack in the slab, or a settlement crack at the junction between the slab and the wall or threshold. A single photograph cannot establish the cause with certainty, and the pattern and width need to be confirmed on site.

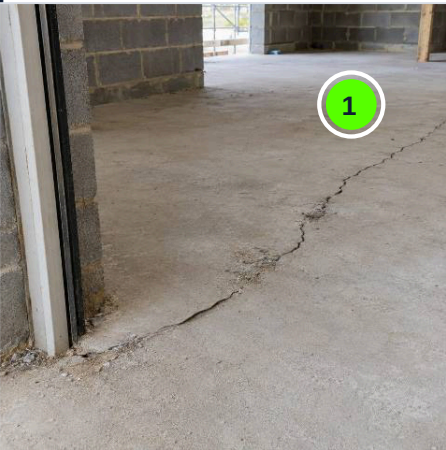

Photograph 9, pin 1 - area this item refers to

By trade

The same items, grouped for handing out. One sheet per trade.

Tiler		5 items
F-011	Floor tile fractured diagonally, approx. 400 mm, open crack	Performance
F-012	Perimeter movement joint grouted hard against skirting, not sealed	Workmanship
F-013	Silicone sealant smeared across basin upstand and tiles	Workmanship
F-014	Unsealed gap at basin upstand and tile junction	Performance
F-015	Sealant residue on basin and tile glazed faces	Cosmetic
Carpenter / joiner		4 items
F-001	Door strike plate not rebated flush, jamb timber broken out	Workmanship
F-005	Door casing damaged and broken away at strike-plate height	Workmanship
F-008	Ceiling tiles sagging below grid line	Cosmetic
F-016	Open butt joint and unfinished end grain to skirting	Workmanship
Decorator		4 items
F-003	Door lever handle and backplate painted over, seizing the lever	Workmanship
F-004	Backplate screw slots filled with paint, handle not removable	Workmanship
F-006	Scuffed and poorly levelled paint finish to door casing	Cosmetic
F-017	Absent sealant line to top of skirting	Cosmetic
Principal contractor		2 items
F-010	Extensive surface scratching to worktop	Workmanship
F-018	Floor to skirting junction to be reviewed at handover	Cosmetic
Bricklayer		1 item
F-020	Broken threshold junction between slab, blockwork and frame with loose debris	Workmanship
Plasterer		1 item
F-002	Broken plaster and exposed angle bead to external wall corner	Workmanship
Structural		1 item
F-019	Continuous crack to floor slab with local spalling at threshold junction	Performance

SPECIMEN - proposed by-trade view.

The product already builds this grouping; the PDF was never given it.