

Customer Complaint Notification — safety-relevant characteristic

Complaint no.	C-OEMN-2026-0312	Date issued	2026-09-22
Supplier	Componentes Arga S.L.	Supplier code	ARGA
Supplier part no.	AR-1003	OEM drawing no.	ON-114203 rev. D (fictitious)
Special characteristic	MIG weld strength (CC)	Quantity NOK (confirmed)	3
Supplier lot (label)	L26241-AR1003-02	Suspect qty delivered	788 pcs
Supplier delivery notes	AL-26-00542 — 394 pcs, shipped 2026-08-31 AL-26-00543 — 394 pcs, shipped 2026-09-04	Detected at	OEM Norte battery module assembly, in-line pull-out audit (station BM-2)
Part description	Battery tray bracket LH	Repeat indicator	YES — same supplier part no. and same characteristic within 24 months

1. Problem description

During the in-line pull-out audit of battery module assembly (1 part every 2 hours) on 2026-09-21, **3 battery tray brackets LH** broke at **MIG weld seam W2** below the minimum pull-out load (drawing note 7: ≥ 18 kN). The fracture starts at the end crater of W2 and runs along the weld root; the root side shows lack of fusion. The bracket carries the battery tray: characteristic classified CC (safety).

All three parts come from the same supplier label: lot **L26241-AR1003-02**, production date 29.08.2026, **shift code N** (night). Parts from other supplier lots tested at station BM-2 during the same week passed (21.3–24.6 kN).

2. Evidence

Sample	Pull-out load (kN)	Requirement	Failure mode	Crack length (mm)
BM2-0921-A	12.4	≥ 18 kN	Fracture in W2, root side	9
BM2-0921-B	14.1	≥ 18 kN	Fracture in W2, root side	7
BM2-0921-C	15.7	≥ 18 kN	Crack from end crater of W2	4

OEM Norte laboratory, macro-section of sample BM2-0921-B (report LAB-ON-26-4471): root penetration 0.4 mm (drawing: ≥ 1.0 mm), porosity and spatter inclusions near the end crater, irregular bead width along W2 (unstable arc suspected by our lab). Base material hardness and chemistry within specification.

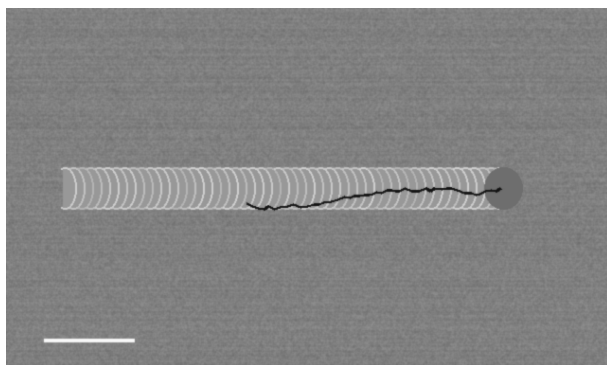


Fig. 1 — Sample BM2-0921-A after pull-out, seam W2 (scale bar 10 mm). Crack from the end crater along the root.

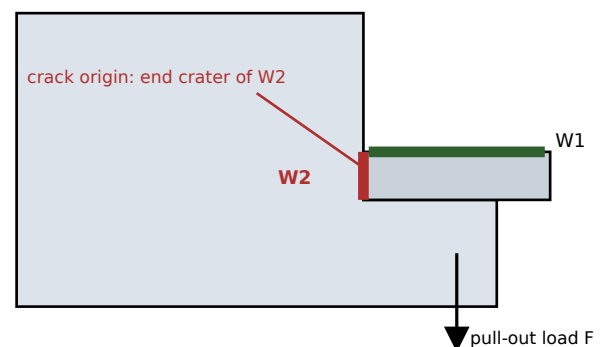


Fig. 2 — Sketch of the bracket: seams W1 and W2, crack origin and load direction of the pull-out test.

3. Requirements to the supplier

1. **Containment within 24 h** (due 2026-09-23): block all suspect stock at the supplier and in transit, sort OEM Norte stock through your resident team or a third party, and confirm the suspect scope from your own traceability (production lots, material lots and delivery notes), not only from the lot on the label. Certified parts must carry a clean-point label.

2. **8D report within 10 working days** (due 2026-10-06) using the **OEM Norte 8D Report v3** (form OEMN-SQ-8D rev. 3). D1–D4 must be uploaded to the supplier portal before the due date; the report must be



- signed by the supplier's Quality Manager.
3. Because this is a **repeat issue** on the same part number and characteristic, D4 must include the review of the previous 8D reports on this part/characteristic, state whether their corrective actions were implemented and standardised on all shifts, and explain why they did not prevent this failure.
4. Read-across: assess the right-hand bracket and any other part welded under the same conditions.
5. Sorting, line disruption and administration costs will be handled according to the Supplier Quality Agreement.

4. Customer contact

Contact	M. Ruiz	Role	Supplier Quality Engineer, battery module assembly
Phone	+34 948 000 312	E-mail	m.ruiz@oem-norte.example

Please acknowledge receipt of this notification within 4 hours through the supplier portal.